

This is a digital copy of a book that was preserved for generations on library shelves before it was carefully scanned by Google as part of a project to make the world's books discoverable online.

It has survived long enough for the copyright to expire and the book to enter the public domain. A public domain book is one that was never subject to copyright or whose legal copyright term has expired. Whether a book is in the public domain may vary country to country. Public domain books are our gateways to the past, representing a wealth of history, culture and knowledge that's often difficult to discover.

Marks, notations and other marginalia present in the original volume will appear in this file - a reminder of this book's long journey from the publisher to a library and finally to you.

Usage guidelines

Google is proud to partner with libraries to digitize public domain materials and make them widely accessible. Public domain books belong to the public and we are merely their custodians. Nevertheless, this work is expensive, so in order to keep providing this resource, we have taken steps to prevent abuse by commercial parties, including placing technical restrictions on automated querying.

We also ask that you:

- + *Make non-commercial use of the files* We designed Google Book Search for use by individuals, and we request that you use these files for personal, non-commercial purposes.
- + Refrain from automated querying Do not send automated queries of any sort to Google's system: If you are conducting research on machine translation, optical character recognition or other areas where access to a large amount of text is helpful, please contact us. We encourage the use of public domain materials for these purposes and may be able to help.
- + *Maintain attribution* The Google "watermark" you see on each file is essential for informing people about this project and helping them find additional materials through Google Book Search. Please do not remove it.
- + *Keep it legal* Whatever your use, remember that you are responsible for ensuring that what you are doing is legal. Do not assume that just because we believe a book is in the public domain for users in the United States, that the work is also in the public domain for users in other countries. Whether a book is still in copyright varies from country to country, and we can't offer guidance on whether any specific use of any specific book is allowed. Please do not assume that a book's appearance in Google Book Search means it can be used in any manner anywhere in the world. Copyright infringement liability can be quite severe.

About Google Book Search

Google's mission is to organize the world's information and to make it universally accessible and useful. Google Book Search helps readers discover the world's books while helping authors and publishers reach new audiences. You can search through the full text of this book on the web at http://books.google.com/










÷			
	·		





STANDARD METHODS

O F

CHEMICAL ANALYSIS

A MANUAL OF ANALYTICAL METHODS AND GENERAL REFERENCE FOR THE ANALYTICAL CHEMIST AND FOR THE ADVANCED STUDENT

EDITED BY

WILFRED W. SCOTT

Associate Professor of Chemistry, Colorado School of Mines,
Metallurgical Analysis, Industrial Research and Chemical Engineering.
Formerly Chief Chemist, Baldwin Locomotive Works;
Research Chemist and Chemical Engineer, General Chemical Company;
Author of "Qualitative Chemical Analysis: A Laboratory Guide";
"Technical Methods of Metallurgical Analysis"

IN COLLABORATION WITH

H. ABRAHAM	D. K. FRENCH	G. L. KELLEY	L. E. SALAS
H. A. BAKER	H. A. GARDENER	A. H. LOW	W. L. SAVELL
J. B. BARNITT	A. H. GILL	R. K. MEADE	J. A. SCHAEFFER
L. E. BARTON	H. D. GREENWOOD	R. M. MEIKLEJOHN	A. SEIDELL
F. G. BREYER	F. E. HALE	J. J. MULLIGAN	W. S. SELLERS
A. CAMPBELL	R. E. HICKMAN	J. C. OLSEN	A. SKOWRONSKI
B. S. CLARK	w. B. HICKS	R. S. OWENS	A. M. SMOOT
W. G. DERBY	J. A. HOLLADAY	W. B. PRICE	C. G. STORM
W. F. DOERFLINGER	L.S. HOLSTEIN	L. D. ROBERTS	L. A. WILSON

250 ILLUSTRATIONS AND 3 COLORED PLATES

THIRD EDITION THOROUGHLY REVISED AND GREATLY ENLARGED

TENTH THOUSAND

VOLUME I



NEW YORK
D. VAN NOSTRAND COMPANY
EIGHT WARREN STREET
1922




Copyright 1917, by
D. VAN NOSTRAND COMPANY

Copyright 1922, by
D. VAN NOSTRAND COMPANY



THIS BOOK IS AFFECTIONATELY DEDICATED TO MY FATHER,

Rev. Thomas Jefferson Scott, P.D.



PREFACE TO THIRD EDITION

THE third edition of Standard Methods of Chemical Analysis appears in two volumes as the amount of new material makes it advisable to divide the work. Volume 1 includes the material in Part 1 and Part 3 of the original text. Volume 2 includes the chapters of Part 2 and has in addition several new chapters.

The entire work has undergone revision, certain sections being rewritten, additions made and portions rearranged. The chapter on assaying has been placed after silver in Volume 1. The conversion factors in the section of useful data have been revised to conform to the atomic weights of 1920. The columns have been rearranged, the factors being placed next to the formula to which they apply. The chapter on acidimetry and alkalimetry is an expansion of the former chapter on acids; this introduces Volume 2. In this volume appear several new chapters.

The most noteworthy additions with their contributers are the following: Chapter on "Asphalts and Allied Substances" by Herbert Abraham, author of a text on this subject: "Standard Methods of Sampling" by J. B. Barnitt, Chief Chemist, General Chemical Company; "Examination of Soap" by A. Campbell, Vice-President, Globe Soap Company; "Selenium and Tellurium" by H. D. Greenwood, Chief Chemist, U. S. Metals Refining Company; "Sanitary Examination of Water" by F. E. Hale, Director of Laboratories, Department of Water Supply, Gas and Electricity, New York City; additions to the chapters on Molybdenum and Tungsten by J. A. Holladay, Chemist, Electrometallurgical Company, and A. M. Smoot, Technical Director, Ledoux and Company; revision of the chapters on "Cadmium" and "Zinc" by L. S. Holstein and L. A. Wilson, Chief and Assistant Chief of Testing Department, New Jersey Zinc Company; "Electrometric Titrations" by G. L. Kelley, Research Department, Midvale Steel and Ordnance Company; an introduction to this chapter on electrometric titrations by J. S. Coye, General Chemical Company: contributions of several methods of analysis and revision of the chapter on Uranium by A. H. Low, Professor of

Chemistry, Colorado School of Mines, and author of "Technical Methods of Ore Analysis"; "Conversion Tables" by R. M. Meiklejohn, Chief Chemist, Laurel Hill Works, General Chemical Company; addition to the chapter on "Bismuth" by J. J. Mulligan, Metallurgist, U. S. Metals Refining Company: addition to the chapter on "Alloys" by W. B. Price, Chief Chemist and Metallurgist, Scovill Manufacturing Company, author of "Technical Analysis of Brass"; a chapter on "Radium" by L. D. Roberts, Colorado School of Mines: "Physical and Chemical Examination of Rubber" by L. E. Salas, Consulting Chemist, London, England; methods of determining "Solubility of Substances" by A. Seidell, author of "Solubilities of Organic and Inorganic Materials"; contribution to the subjects of "Gold" and "Platinum" by A. Skowronski, Chief Chemist, Raritan Copper Works; "Examination of Explosives" by C. G. Storm, U. S. War Department; a number of other contributions have been made by specialists whose names appear under their subjects.

Among the many to whom we are indebted for new material appearing in this work or for suggestions that have assisted us in our revision we would mention W. F. Baugham, H. M. P. Brinton, J. S. Coye, W. G. Derby, W. A. Drushel, C. M. Elston, F. A. Gooch, W. B. Hicks, W. F. Hillebrand, C. James, H. B. Knowles, I. A. Palmer, L. D. Roberts, C. E. Scholl, W. W. Skinner, W. A. Wilson. The names of others appear throughout the pages of this book. The Editor would specially mention his colleague, Albert H. Low, for many helpful criticisms and suggestions. Also he wishes to express his appreciation of the cooperation of the contributing staff, who have made possible the thorough revision of this work.

WILFRED W. SCOTT.

Colorado School of Mines, Golden, Colorado. May 15, 1922.

PREFACE TO FIRST EDITION

THIS book is a compilation of carefully selected methods of technical analysis that have proven of practical value to the professional chemist. The subjects have been presented with sufficient detail to enable one with an elementary knowledge of analytical processes to follow the directions; on the other hand, lengthy exposition, theoretical dissertation and experimental data are purposely avoided, in order to include a large amount of information in a compact, accessible form. References to original papers are given when deemed advisable.

For methodical arrangement the material is grouped under three major divisions—Part I. Quantitative determination of the elements. Part II. Special subjects. Part III. Tables of information.

In the first division the elements are generally taken up in their alphabetical order, each chapter being fairly complete in itself, cross-references being given to certain details included elsewhere to avoid repetition. For example, the complete directions for separation of the halogens are given in the chapter on chlorine, and references to these details are given in the chapters dealing with the other members of this group. Occasionally it has been deemed advisable to place several related elements together in the same chapter.

Each chapter on the elements is generally arranged according to the following outline:

Physical Properties. Atomic weight; specific gravity; melting-point; boiling-point; oxides.

Detection. Characteristic reactions leading to the recognition of the element.

Estimation. The subject is introduced with such information as is useful to the analyst.

Preparation and Solution of the Samples. Here directions are given for the preparation and decomposition of characteristic

materials in which the element occurs. Recommendations to the best procedures are included to assist the analyst in his choice.

Separations. This section is devoted to procedures for the removal of substances, commonly occurring with the element, that may interfere with its estimation. In the absence of such substances, or in case methods are to be followed by which a direct estimation of the element may be made in the presence of these substances, this section on separations may be omitted in the course of analysis. Here the discretion of the chemist is necessary, and some knowledge of the substance examined essential.

Methods. The procedures are grouped under gravimetric and volumetric methods. Several processes are generally given to afford the opportunity of selection for particular cases and for economical reasons where special reagents may not be available.

In many of the chapters methods for determining traces of the element are given, and the subjects are concluded by typical examples of complete analysis of substances containing the elements.

The titles to the procedures generally give a clue to the processes. Names of originators are occasionally retained where common usage makes the methods generally known by these.

Although the combined acid radicals are taken up with the elements to which they may be assigned, a chapter is devoted to the more important of the acids in their free state, and is placed with the other special subjects in the second division of the book. Here are found chapters on water, paint, oil, alloys, coal, cement, gas, and such subjects as are best classed in sections apart from simple substances dealt with in the first portion of the work.

The last portion of the book is devoted to tables of the more important arithmetical operations. These are designed to assist the analyst to greater accuracy of calculations, as well as to relieve him of needless expenditure of time and energy.

The material herein included has been carefully selected, an effort having been made to obtain the more trustworthy methods that will meet the general needs of technical chemists.

A list of the majority of publications consulted is given in alphabetical order in the appendix of this volume. Reference to these authorities will be found throughout the book.

W. W. Scott.

CONTENTS

VOL. I

ALUMINUM

WILFRED W. SCOTT, M.A., Editor

Associate Professor of Chemistry and Chemical Engineering, Colorado School of Mines

Detection—with ammonium hydroxide, with sodium thiosulphate, alizarine S test, 3. Estimation, 3. Preparation and solution of the sample—general procedure for ores, sulphide ores, carbonate fusion, bisulphate fusion, solution of alloys, 3-5. Separation of aluminum from—silica, iron, phosphoric acid, chromium, manganese, cobalt, nickel, zinc, alkaline earths, alkalies, titanium, uranium, glucinum, 5, 6. Gravimetric methods—determination of aluminum by hydrolysis with ammonium hydroxide; hydrolysis with sodium thiosulphate; precipitation as phosphate; precipitation as aluminum chloride, 10. Volumetric methods—determination of combined alumina by alkali titration; free alumina or free acid in aluminum salts—potassium fluoride method, 11-13. Minute amounts of aluminum by Atack's Alizarine S method, 14. Bauxite analysis, 14, 15. Aluminum in iron and steel, 16. Analysis of metallic aluminum, standard method of the Aluminum Company of America, 17, 18.

ANTIMONY

WILFRED W. SCOTT

Detection—as sulphide, by hydrolysis, in minerals, traces; distinction between antimonous and antimonic salts, 18. Estimation, 19. Preparation and solution of the sample—sulphide ores, low grade oxides, speisses, slags, mattes, alloys, hard lead rubber goods, 19–21. Separations of antimony from—members of subsequent groups from mercury, copper, bismuth, cadmium, lead, arsenic and tin, 21–23. Gravimetric methods—determination as antimony trisulphide; as metal by electrolysis, 23, 24. Antimony in solder and in alloys with tin and lead, 25. Volumetric methods—determination with potassium bromate; with potassium iodide; by oxidation with iodine; permanganate method; indirect evolution method, 25–28. Determination of small amounts of antimony, Nichols Copper Company method; determination of antimony in tartar emetic, 29–33.

ARSENIC

WILFRED W. SCOTT

Detection—with hydrogen sulphide, volatility of arsenous chloride, traces; distinction between arsenates and arsenites, 34. Estimation, 34. Preparation and solution of the sample—pyrites ore, arseno-pyrites, arsenous oxide, arsenic acid, alkali arsenates; arsenic in sulphuric acid, in hydrochloric acid, in organic matter; lead arsenate; zinc arsenite; water soluble arsenic in insecticides; arsenic in mispickel; in iron; in copper, 34–37. Separations—isolation of arsenic by distillation, Knorr's distillation method; separation as sulphide from antimony and tin, etc., 37–40. Gravimetric methods—determination as trisulphide; as magnesium pyroarsenate, 40. Volumetric methods—

by oxidation with standard iodine; potassium iodate method; precipitation as silver arsenate, 43-46. Small amounts of arsenic by the Gutzeit method—in sulphuric, hydrochloric, and nitric acids; in iron, pyrites, cinders, bauxite, phosphates, phosphoric acid, sults, baking powder, organic matter, canned goods, meats, etc., standard method of the General Chemical Company, 46-53. Marsh test for arsenic; analysis of commercial arsenic (As₂O₂), 53-55.

BARIUM

WILFRED W. SCOTT

Detection—as barium chromate, with calcium sulphate or strontium sulphate, by precipitation as fluosilicate, flame test, spectrum, 56. Preparation and solution of the sample—ores, sulphates, sulphides, carbonates; salts soluble in water; organic matter; insoluble residue, 56-57. Separations—the alkaline earths; introductory, sources of loss, preliminary tests; separation from members of previous groups; separation of the alkaline earths from magnesium and the alkalies by the oxalate and sulphate methods; separation of the alkaline earths from each other, 57-62. Gravimetric methods—determination as chromate; as sulphate, 62-64. Volumetric methods—titration of the barium salt solution with dichromate; reduction with ferrous salt and titration with permanganate; potassium iodide method; acid titration of the carbonate. Analysis of barytes and witherite; commercial valuation of the ores, 65-67.

BISMUTH

WILFRED W. SCOTT

Editor

J. J. MULLIGAN

Metallurgist, U.S. Metals Refining Company

Detection—as bismuth oxychloride, and by reduction, 70. Estimation, 70. Preparation and solution of the sample—ores, cinders; alloys, bearing metal, lead bullion and refined lead, 70–71. Separations from—members of the ammonium hydroxide, sulphide and carbonate groups and from the alkalies; separation from arsenic, antimony, tin, molybdenum, tellurium and selenium; mercury, lead, copper and cadmium, 72–73. Gravimetric methods—by precipitation and determination as the basic chloride, BiOCl; as the oxide, Bi₂O₃, (a) by precipitation as the basic nitrate, (b) subcarbonate, (c) hydroxide, determination as bismuth sulphide, Bi₂S₃; as metallic bismuth by reduction with potassium cyanide; by deposition of the metal electrolytically, 73–76. Volumetric methods—by titration of the oxalate with permanganate; cinchonine potassium iodide colorimetric method; bismuth iodide colorimetric comparison, 76–78. Bismuth in lead bullion, in alloys, ores, mattes, 78–80.

BORON

WILFRED W. SCOTT

Detection—flame test, borax bead and turmeric tests, 81. Estimation, 81. Preparation and solution of the sample—boric acid in silicates and enamels; boronatro-calcite, borocalcite, boracite, calcium borate; borax and boric acid; boric acid in mineral water; in carbonates; in foods—milk, butter, meat, etc., 82-83. Gravimetric

methods—distillation of methyl borate and fixation with lime, 84-85. Volumetric methods—titration of boric acid in presence of mannitol or glycerole in evaluation of borax or boric acid. Chapin's method. Robin's test for traces, 86-91.

BROMINE

WILFRED W. SCOTT

Detection—by silver nitrate, by absorption in carbon tetrachloride or disulphide, by magenta test, bromates, 92. Estimation, 93. Preparation and solution of the sample—bromides, bromine in organic matter, 93. Separation of bromine from the heavy metals, from silver, cyanides, chlorine and iodine, 93–94. Gravimetric methods—precipitation as silver bromides, (1) hydrobromic acid and bromides of the alkaline earths and alkalies; (2) treatment in presence of heavy metals, 94. Volumetric methods—determination of free bromine with potassium iodide; soluble bromides by chlorine method, Volhard's method; traces of bromine, 94–96. Arsenous acid method for bromates, 96. Analysis of crude potassium bromide and commercial bromine, 96–97. Determination in mineral water; separation from iodine, 97.

CADMIUM

L. S. HOLSTEIN

Chief of Testing Department, New Jersey Zinc Co.

L. A. WILSON

Assistant Chief of Testing Department, New Jersey Zinc Co.

Detection as sulphide, tube test, blowpipe tests, 99. Estimation, 99. Preparation and solution of the sample, 100. Separations from silica, arsenic, antimony, tin, bismuth, copper, mercury, zinc, 100-101. Gravimetric methods—Procedure for ores; determination as sulphate, electrolytic method, 101-103. Volumetric method, 103.

CALCIUM

WILFRED W. SCOTT

Detection—as oxalate, flame test, spectrum of calcium, 104. Estimation and occurrence, 104. Preparation and solution of the sample—limestone, dolomite, magnesite, cement, lime, gypsum, Plaster of Paris, sulphates, silicates, chlorides, nitrates and other water soluble salts, sulphides, pyrites ore, 105. Separation of calcium from—silica, iron, alumina, copper, nickel, cobalt, manganese, zinc, barium, strontium and the alkalies, treatment in presence of phosphates of iron and aluminum, 105, 106. Gravimetric methods—precipitation as calcium oxalate; other methods, 107–108. Volumetric method by titration of the oxalate with standard potassium permanganate solution, 108.

CARBON

WILFRED W. SCOTT

Detection—element, carbon dioxide in carbonates and in gas, free carbonic acid in water, distinction between carbonates and bicarbonates, carbon monoxide, 109. Estimation, 110. Preparation of the sample—iron, steel and alloys; organic matter; carbonates and bicarbonates, 110. Separation of carbon from other substances; separa-

tion from iron by the cupric potassium chloride method, 110-111. Gravimetric method—combustion furnaces, types of absorption apparatus, general procedure for determining carbon by combustion, 111-115. Graphitic carbon in iron and steel, 115-116. Combined carbon, 116-117. Determination of carbon in organic substances—organic matter free of nitrogen, halogens, sulphur and the metals, 117; carbon and hydrogen in nitrogenous substances, 120; organic substances containing halogens, 120; wet combustion process, 120-121. Determination of carbon dioxide in carbonates—gravimetric; hydrometer method for carbonates, method for determining perborates, 121-127. Residual and available carbon dioxide in baking powder, 123-124. Determination of carbon dioxide by measuring the gas, 123 (126, reference). Determination by loss of weight, 124. Volumetric methods, total carbon by barium hydroxide absorption, 127. Direct colorimetric method for determining carbon in iron and steel, Beneker-Eggertz method, 127-130. Analysis of graphite, 130. Volumetric determination of hydrocyanic acid in soluble cyanides, Liebig's method, Volhard's method, determination of cyanide and thiocyanate, 131-133.

CERIUM AND OTHER RARE EARTHS

R. STUART OWENS

Research Chemist, New York City

Members of the rare earth group—atomic weights, specific gravities, melting-points, oxides. Detection of cerium, lanthanum, praseodymium, neodymium, scandium, ytterbium and erbium, 134–135. Estimation—occurrence, 135. Preparation and solution of the sample, 136. Separations—rare earths from iron, aluminum, thorium, calcium, magnesium; separation of scandium from yttrium, yttrium group, separation of praseodymium, neodymium, lanthanum and samarium from each other, 136–137. Gravimetric estimations, 137. Volumetric method for the determination of cerium. Determination of cerium in Welsbach mantles, colorimetric method, 138. Determination as ceric iodate, Brinton and James method, 139. Separation of the rare earth oxalates (outline table), 139.

CHLORINE

WILFRED W. SCOTT

Editor

WM. F. DOERFLINGER

Chief Chemist, Perry-Austin Manufacturing Company

Detection—free chlorine, chlorides by silver nitrate test, free hydrochloric acid, detection of chlorine in presence of cyanate, cyanide, thiocyanate, bromide, iodide, chlorate. Test for hypochlorite, chlorite, chlorate, perchlorate, 142–143. Estimation—occurrence, 143. Preparation and solution of the sample—water-soluble chlorides, water-insóluble chlorides, silver chloride, chlorine in rocks, free chlorine, chlorine in ores and cinders, 143–144. Determination of halogens in organic compounds—Carius method, 145; lime method, 146; sodium peroxide method, 146. Separations—chlorine and the halides from the heavy metals, the halides from silver and silver cyanide; separation of the halides from one another, chlorine from iodine, and from bromine and iodine, 147–148. Gravimetric method—determination of chloride by precipitation as silver salt, 148. Volumetric methods—silver thiocyanate ferric alum method of Volhard, silver chrmate method of Mohr, volumetric method for determination of

free chlorine, 149-151. Determination of hypochlorous acid in presence of chlorine, 151. Gravimetric method for determination of chloric acid, 152. Gravimetric determination of perchloric acid, 152. Determination of chlorates and perchlorates in presence of one another, 153. Determination of hydrochloric, chloric, and perchloric acids in presence of one another, 153. Estimation of chlorine, bromine and iodine in presence of each other, 154. Chloride and cyanide in a mixture, chloride, cyanide, thiocyanate in presence of each other, 154-155. Evaluation of bleaching powder, chloride of lime, for available chlorine, 155.

CHROMIUM

WILFRED W. SCOTT

Detection—test with barium salt, hydrogen peroxide, reducing agents, ether, diphenyl carbazide, 156. Estimation, 156. Preparation and solution of the sample—general procedures for decomposition of refractory materials, special procedures—high silica ores, chrome iron ores, iron and steel, 157–158. Separations—chromium from iron and aluminum, 134. Gravimetric methods—precipitation of chromic hydroxide and ignition to Cr₂O₂, determination as barium chromate, 159–160. Volumetric methods—potassium iodide method, procedure by reduction with ferrous salts, 161–162. Determination of small amounts of chromium, diphenyl-carbazide method, 162–163. Determination of chromium in soluble chromate; chromite, steel, 164. Duboscq colorimeter, 164.

COBALT

W. L. SAVELL, Ph.D.

Research Chemist, Doloro Mining and Reduction Company

Detection—general procedure, potassium sulphocyanate, potassium nitrite, 166. Estimation, 167. Preparation and solution of the sample—general procedure for ores, cobalt oxides, metallic cobalt, nickel and cobalt alloys, 167. Separations—ammonium sulphide group from hydrogen sulphide, ammonium sulphide group from the alkalies, cobalt and nickel from manganese, cobalt from nickel, cobalt from zinc, 168. Gravimetric methods—precipitation of cobalt with potassium nitrite, nitrosobeta-naphthol method, electrolytic deposition of metallic cobalt, 169. Determination of cobalt in cobalt oxide, 171. Cobalt in the commercial metal and in ferrocobalt, 172. Cobalt in metallic nickel, 172. Cobalt in ores and in enamels, 173. Determination of cobalt in steel, 174. Volumetric methods, 175.

COPPER

WILFRED W. SCOTT, Editor

WALLACE G. DERBY

Research Chemist, Nichols Copper Company

Detection—general procedure, flame test, wet tests, hydrogen sulphide test, other methods, 177. Estimation—occurrence, 177. Preparation and solution of the sample—solubilities, decomposition of copper ores, sulphide ores, copper pyrites, copper glance, iron pyrites, matte, oxidized ores, oxides, treatment of matte slag, metals, iron ores and iron ore briquettes, steel, cast iron and alloy steels, 178-181. Separations—precipitation of copper as sulphocyanate, separation of copper by precipitation in metallic form by a more positive element, separation from members of the ammonium sulphide

and subsequent groups; removal of silver, removal of bismuth, lead, mercury, arsenic, antimony and tin; separation from cadmium, 181-184. Gravimetric methodsdetermination as cuprous sulphocyanate, determination as copper oxide. Deposition of metallic copper by electrolysis-introduction. Rapid methods-solenoid method of Heath, deposition from nitric acid solution, deposition from ammoniacal solution. Slow methods—electrolytic determination of copper in blister copper, standard procedure of Nichols Copper Company, large portion and small portion methods, traces of copper in the electrolyte, notes and precautions for the electrolytic deposition of copper, 184-192. Volumetric methods for determining copper based on precipitation copper as cuprous thiocyanate-iodide method, permanganate method, Demorest's method, Volhard's method, Garrigues' method, 193-196. Colorimetric determination of small amounts of copper-potassium ethyl xanthate method, ferrocyanide method, ammonia method, hydrogen sulphide method, 197-199. Determination of impurities in blister copper—bismuth, iron, lead, zinc, nickel, cobalt, arsenic, antimony, selenium, tellurium, oxygen, sulphur, phosphorus, 199-205. Determination of copper in refined copper, 205. Chlorine in cement copper and copper ores, 206. Copper in blue vitriol, 207. Copper and lead determination in brass, 207. Methods for determining the combinations of copper in ores and furnace products. The silver sulphate sulphuric method, phosphoric acid, ammonium chloride method, caustic soda sodium tartrate method, sulphuric acid mercury method, 208-211.

FLUORINE

WILFRED W. SCOTT

Detection—etching test, hanging drop test, black filter paper test, 212-214. Estimation—occurrence, 214. Preparation and solution of the sample—solubilities, organic substances, silicious ores and slags, calcium fluoride, soluble fluorides, hydrofluoric acid, fluorspar, 214-215. Separations—removal of silicic acid from fluorides, separation of hydrofluoric and phosphoric acids, separation of hydrofluoric from hydrochloric and boric acids, 215-216. Gravimetric methods—precipitation as calcium fluoride, as lead chlorofluoride, 216-217. Volumetric methods—Offerman's method, ferric chloride method, Steiger and Merwin colorimetric method, 218-222. Valuation of fluorspar, standard method of the Fairview Fluorspar and Lead Company, 222. Analysis of sodium fluoride, 223. Determination of traces of fluorine, 224.

GLUCINUM (BERYLLIUM)

WILFRED W. SCOTT

Detection, 225. Estimation—occurrence, 225. Separations—removal of silica and of the hydrogen sulphide group, separation of glucinum from iron, manganese, zirconium, yttrium, aluminum, chromium, iron, 226. Gravimetric determination of glucinum, 226, 227.

GOLD

WALLACE G. DERBY, M.S.

Research Chemist, Nichols Copper Company

Detection of gold in alloys, test for gold in minerals, benzidine acetate tests, phenylhydrazine acetate test, 228-229. Estimation—solubility, 229. Gravimetric methods—wet gold assay of minerals, electrolytic method, 230. Volumetric methods—permanganate and iodide methods, 231-232. Colorimetric methods—procedures of

Prister, Cassel, Moir, 233-234. Preparation of proof gold, Furnace method—reference, 234-235.

IODINE

WILFRED W. SCOTT

Detection—element, free iodine characteristics, iodide, iodate, 236. Estimation—occurrence, 236. Preparation and solution of the sample, iodides of silver, copper mercury, lead, etc., iodates, free iodine (commercial crystals), iodine or iodides in water, organic substances, mineral phosphates, 236–237. Separations—iodine from heavy metals, from bromine or from chlorine, separation from chlorine and bromine—palladous iodide method, 238–239. Gravimetric methods—precipitation of silver iodide, determination as palladous iodide, 239. Volumetric methods—hydriodic acid and iodides by thiosulphate or by arsenite titration, decomposition by ferric salts, decomposition with potassium iodate, nitrous acid method of Fresenius, hydrogen peroxide—phosphoric acid method, chlorine method of Mohr, Volhard's method, 239–243. Determination of iodates, periodates, and iodates with periodates in a mixture, 244–245. Determination of iodine in mineral waters, 245.

IRON

WILFRED W. SCOTT

Detection—ferric iron, hydrochloric acid solution, sulphocyanate, ferrocyanide, salicylic acid, sodium peroxide tests; distinction between ferrous and ferric salts, 246-Estimation—occurrence, 246. Preparation and solution of the sample—solubilities soluble iron salts, sulphide and oxide ores, iron ore briquettes, silicates, iron and steel, separations—general procedure; special cases, ether method, 247-248. Gravimetric methods—determination as oxide, Fe₂O₄; Cupferron method, 249-250. Volumetric methods—general considerations, by oxidation, the iron having been reduced—titration with potassium dichromate, potassium permanganate, Jones reductor method, 250-257. Stannous chloride method for determining ferric iron, 257. Colorimetric methods for determining small amounts of iron-with sulphocyanate, with salicylic acid, 258-259. Technical analysis of iron and steel-with specifications of Baldwin Locomotive Works. Introduction; preparation of the sample, combined or carbide carbon-colorimetric method, specifications for combined carbon; total carbon by combustion; graphite in iron; manganese by persulphate method, lead oxide procedure of Deshey, method by U. S. Bureau of Standards—manganese by the bismuthate method; specifications for manganese; determination of phosphorus by the alkalimetric and molybdate methods; specifications for phosphorus; determination of sulphur by the evolution method; method by the U. S. Bureau of Standards; specifications for sulphur in iron and steel; determination of silicon, rapid foundry method, method by the U.S. Bureau of Standards; specifications for silicon in iron and steel, 259-268. U.S. Bureau of Standards method for determining silicon, aluminum, titanium and zirconium in steel, 268-270.

LEAD

WILFRED W. SCOTT

Detection—hydrochloric acid test, hydrogen sulphide test, confirmations of tests, 271. Estimation—occurrence, 271. Preparation and solution of the sample—solubilities, decomposition of ores, minerals of lead, iron pyrites, alloys, 272. Separations—isolation of lead as sulphate, separation from barium, isolation as lead chloride, ammonium acetate extraction of lead from the impure sulphate, 273. Gravimetric methods—determination of lead as sulphate, as chromate, as molybdate, electrolytic

determination as peroxide, PbO₁, 274–276. Volumetric methods—ferrocyanide method molybdate method, chromate method, permanganate method of Low, 276–278. Determination of small amounts of lead—gravimetric methods—by ammonium acetate extraction, by occlusion with iron hydroxide, Seeker-Clayton method modified; colorimetric estimation, 279–285. Analysis of metallic lead, method of the National Lead Company, modified, 286–290. Determination of lead peroxide in minium, 290.

MAGNESIUM

WILFRED W. SCOTT

Detection—general procedure, test with baryta or lime water, 291. Estimation—occurrence, 291. Preparation and solution of the sample—solubilities, general procedure for ores, 292. Separations—removal of members of the hydrogen sulphide group, ammonium sulphide group, separation from the alkaline earths, 292. Gravimetric determination by precipitation as ammonium magnesium phosphate, 293. Volumetric determination by titration of ammonium magnesium phosphate with standard acid, 294.

MANGANESE

WILFRED W. SCOTT

Detection—general procedure, manganese in soils, minerals, vegetables, etc., borax test, sodium carbonate and nitrate tests, 295. Estimation—occurrence, 295. Preparation and solution of the sample—solubilities, decomposition of ores, sulphides, slags, iron ores, alloys, manganese bronze, ferro-titanium alloy, ferro-chromium, metallic chromium, ferro-aluminum, vanadium alloys, molybdenum alloys, tungsten alloys, silicon alloys, iron, steel and pig iron, 296–297. Separations—removal of the members of the hydrogen sulphide group, separation of manganese from the alkaline earths and the alkalies, from nickel and cobalt; basic acetate method for removal of iron and aluminum; isolation of manganese as the dioxide, MnO₂, 298–300. Gravimetric method—determination as manganese pyrophosphate, 300. Volumetric methods—bismuthate method, procedure of Volhard, ammonium persulphate colorimetric method, oxidation of manganese with oxides of lead, 301–306. Analysis of spiegel iron for manganese, 306.

MERCURY

WILFRED W. SCOTT

Detection—general procedures, 308. Estimation—occurrence, 308. Preparation and solution of the sample—solubilities, decomposition of ores, 308–309. Separations—removal of mercury in presence of members of the ammonium sulphide, ammonium carbonate and soluble groups; separation of mercury from arsenic, antimony, tin, lead, bismuth, copper, cadmium, selenium, tellurium, organic substances, 309. Gravimetric methods—precipitation as sulphide, determination by electrolysis, Holloway-Eschka process, 310–312. Volumetric process by Seamon's method, 312.

MOLYBDENUM

WILFRED W. SCOTT, Editor

A. M. SMOOT

Technical Director, Ledoux & Co.

J. M. HOLLADAY

Chemist, Electro-metallurgical Co.

Detection—general procedure, sodium thiosulphate test, sulphur dioxide test, phosphate test, detection in minerals, characteristics of molybdenite, 313. Estima-

tion—occurrence, 313. Preparation and solution of the sample—solubilities, decomposition of ores, steel and iron, 314. Separations—molybdenum from iron in presence of large amounts of iron, separation from the alkalies, alkaline earths, lead, copper, cadmium, bismuth, vanadium, arsenic, phosphoric acid, titanium and tungsten, 314–315. Gravimetric methods—precipitation as lead molybdate, determination as oxide, MoO₁ after precipitating with mercurous oxide, determination as sulphide, 316–317. Volumetric methods—iodometric reduction method, estimation by reduction with Jones reductor and subsequent permanganate titration, determination of molybdenum and vanadium in a mixture of the two. Determination of molybdenum in ores, 318–320. Determination of commonly occurring substances in molybdenum ores—arsenic, copper, phosphorus, 321–328.

NICKEL

W. L. SAVELL, Ph.D.

Research Chemist, Doloro Mining and Reduction Company

Detection—general procedure, dimethylglyoxime test, alpha benzildioxime test, 329. Estimation, 330. Preparation and solution of the sample, solubilities, general procedure for decomposing ores, fusion methods, solution of metallic nickel and its alloys, 330–331. Separations—ammonium sulphide group from hydrogen sulphide and from the alkaline earths and alkalies; separation of nickel from cobalt, manganese, zinc, iron, aluminum, chromium, 331–332. Gravimetric methods—precipitation of nickel by alpha benzildioxime, precipitation by dimethylglyoxime, electrolytic deposition of nickel, nickel in metallic nickel, in cobalt and cobalt oxide, 332–336. Volumetric determination of nickel in alloys, determination in nickel-plating solutions, 336.

NITROGEN

WILFRED W. SCOTT

Detection—organic nitrogen, nitrogen in gas mixtures. Ammonia, free and combined, tests for. Nitric acid-ferrous sulphate test, diphenylamine test, copper test, phenolsulphonic acid test. Detection of nitrous acid—by acetic acid, by potassium permanganate, 337-338. Estimation—occurrence, composition of air; free nitrogen, total nitrogen, combined nitrogen, 338-339. Preparation of the sample—organic substances—method in absence of nitrates, method in presence of nitrates; soils available nitrate, ammonium salts, nitrates, nitrites, mixtures of ammonium salts, nitrates and nitrites; nitric acid in mixed acid, 339-341. Separations—ammonia. nitric acid, removal of nitrous, chromic, hydrobromic and hydriodic acids, 341-342. Procedures for the determination of combined nitrogen—ammonia—gravimetric determination of ammonia by precipitation as ammonium platinochloride, 342. metric methods-analysis of aqua ammonia, combined ammonia in ammonium salts; analysis of ammoniacal liquor—ammonia, carbon dioxide, hydrochloric acid, hydrogen sulphide, sulphuric acid; determination of traces of ammonia (ref.), 342-345. Nitric acid—gravimetric determination by precipitation as nitron nitrate, 345. Volumetric methods—direct estimation of nitrates by reduction to ammonia by the Allen-Devarda method, 346. Analysis of nitrate of soda—moisture, insoluble matter, sodium sulphate, iron, alumina, lime, magnesia, sodium chloride and carbonates, 349-350. Nitric nitrogen in soil extracts by Vamari-Mitscherlich-Devarda method, 350. Determination of hydroxyl amine, 351. Iodometric determination of nitrates, 352-353. Determination of nitrogen of nitrates and nitrites by means of the nitrometer—general procedure, duPont nitrometer method, 351-357. Determination of nitric acid in

oleum by duPont nitrometer method, 357. Combined (reference to ferrous sulphate method), and tree HNO₃, 357. Determination of nitrites. Bouvold's gravimetric method, permanganate volumetric method, 358. Detection of a nitrate in a ni:rite salt, 359. Determination of pyridine in ammonium nitrate, 358-361.

PHOSPHORUS

WILFRED W. SCOTT

Detection—element, acids—hypophosphorous, phosphorous, orthophosphoric, metaphosphoric, pyrophosphoric, comparative table, 362–363. Estimation—occurrence, typical ores, 363. Preparation and solution of the sample—iron ores, phosphate rocks, minerals, iron and steel, ores with titanium, soluble phosphates, baking powder, etc. Precipitation of ammonium phosphomolybdate, 364–366. Gravimetric methods—direct weighing of ammonium phosphomolybdate, determination as magnesium pyrophosphate; direct precipitation of magnesium ammonium phosphate, 366–368. Volumetric methods—by titration with an alkali, by titration of the reduced molybdate with potassium permanganate, 368–370. Phosphate rock analysis—(tentative methods of the committee on standard methods), sampling and determination of moisture, phosphoric acid, iron and aluminum phosphates, iron, 371–375. Volumetric determination of free phosphoric acid, 375.

PLATINUM

REGINALD E. HICKMAN

Chief Chemist, J. Bishop and Company Platinum Works

Detection—general characteristics, tests with potassium iodide, hydrogen sulphide, ammonium chloride, potassium chloride, ferrous sulphate, stannous chloride, oxalic acid, sodium hydroxide with glycerine, formic acid, etc., 376-377. Estimation—characteristic substances containing platinum, 377. Preparation and solution of the sample—solubilities, decomposition of ores, platinum scrap, substances containing small amounts of platinum, 377-379. Separations—platinum from gold, from iridium, palladium, ruthenium, rhodium, osmium, 379-380. Gravimetric methods—weighing as metallic platinum, weighing as a salt, electrolytic method, 380-381.

RARER ELEMENTS OF THE ALLIED PLATINUM METALS

REGINALD E. HICKMAN

IRIDIUM.—Detection—tests with caustic alkalies, potassium chloride, ammonium chloride, hydrogen sulphide, metallic zinc, formic and sulphurous acids, 382. Estimation. Preparation and solution of the sample, 383. Separations—iridium from platinum, 383. Gravimetric methods, reduction with zinc, ignition of the ammonium salt, insoluble residue, 383-384.

Palladium.—Detection—tests with alkalies, ammonia, mercuric cyanide, potassium iodide, hydrogen sulphide, etc., 384-385. Estimation—Preparation and solution of the sample. Separations—palladium from platinum and iridium, from silver and gold, 385-386. Gravimetric methods, 385-387.

RUTHENIUM.—Detection—potassium hydroxide, hydrogen sulphide, ammonium sulphide, metallic zinc, 387. Estimation—Preparation and solution of the sample. Separations—ruthenium from platinum, from iridium, from rhodium, 388–389. Gravimetric methods, 389.

Rhodium.—Detection—tests with hydrogen sulphide, potassium hydroxide, ammonium hydroxide, potassium nitrite, reducing agents, 389. Estimation—Prepara-

tion and solution of the sample. Separations—rhodium from platinum, from iridium, from ruthenium, 390-391. Gravimetric methods, 392.

OSMIUM.—Detection—characteristics, tests with hydrogen sulphide, potassium hydroxide, ammonium hydroxide, reducing agents, 392–393. Estimation—Preparation and solution of the sample. Gravimetric methods, 393–394.

Assay Methods for Platinum Ores, 395.

Determination of platinum and palladium in gold bar, and in refined gold, 396-399.

POTASSIUM, SODIUM AND OTHER ALKALIES

W. B. Hicks, Ph.D.

Chief of Analytical Dept., The Solvay Process Company

Detection-Sodium, potassium, 401; lithium, rubidium and cæsium, 402-403; Estimation, 404. Solution of the sample—procedure for rocks and other insoluble mineral products, procedure for soils, fertilizers, organic compounds, ashes of plants, saline residues, soluble salts and brines, 404-405. Separations—alkali metals from other constituents-hydrogen sulphide and ammonium sulphide groups of metals; separation from silica; from iron, alumina, chromium, titanium, uranium, phosphoric acid; separation from sulphates; from barium, calcium, strontium; separation from iron, alumina, chromium, barium, calcium, strontium, phosphates, sulphates, etc., in one operation; separation from boric acid; separation from magnesium-mercuric oxide method, barium hydroxide method, ammonium phosphate method; separation of the alkali metals from one another—separation of sodium from potassium; lithium from sodium and potassium; lithium and sodium from potassium, rubidium and casium, 405-408. Methods for the determination of sodium—as sodium chloride, as sodium sulphate, difference method, 409-410. Methods for the determination of potassium as chloroplatinate, modified chloroplatinate method, Lindo-Gladding method, perchlorate method, other methods, 410-413. Determination of sodium and potassium by indirect method. Determination of magnesium, sodium and potassium in presence of one another, 413. Methods for determining lithium—determination as lithium chloride, as lithium sulphate, Gooch method, Rammelsberg method, spectroscopic method, 413-414. Determination of sodium, potassium, and lithium in the presence of one another. Determination of the alkalies in silicates by J. Lawrence Smith method, 416. Hydrofluoric method, 417. Alkalies in alunite, 417. Volumetric methods, 418.

RADIUM

L. D. ROBERTS, Editor

Associate Professor of Chemistry, Colorado School of Mines

General outline, 419. Detection, electroscope, 419. Estimation, 1558, Vol. 2.

SELENIUM AND TELLURIUM

WILFRED W. SCOTT, Editor

H. D. GREENWOOD

Chief Chemist, U.S. Metals Refining Co.

Detection—general procedure; detection of sclenium—tests with sulphuric and hydrochloric acids, barium chloride, hydrogen sulphide, detection of tellurium—fusion test, tests with hydrogen sulphide, potassium iodide and reducing agents, 420-421.

Estimation—occurrence of selenium and tellurium, 421. Preparation and solution of the sample, selenium and tellurium solubilities, decomposition of ores, 422. Separations—selenium and tellurium from the iron and zinc group metals, from alkalies and alkaline earths, from cadmium, copper and bismuth, separation from silver and gold, separation of selenium from tellurium by direct precipitation and by distillation methods, 422–424. Estimation the two elements by the distillation of separation, 424–425. Gravimetric methods—determination of selenium by precipitation with sulphur dioxide, potassium iodide reduction method, precipitation of tellurium by sulphur dioxide, determination as tellurium dioxide, 425–427. Volumetric methods—iodometric method for selenic and telluric acids, 427. Analysis of commercial selenium, 428. Selenium and tellurium in refined copper, 428–430.

SILICON

WILFRED W. SCOTT

Detection, 431. Estimation—occurrence—solubilities, 431-432. Preparation and solution of the sample—general considerations, preparation of the substance for decomposition, general procedure for decomposing the material, silicates not decomposed by acids—carbonate fusion, fluorides; special procedures for decomposing the sample—ferrosilicons, steels containing tungsten, chromium, vanadium and molybdenum; silicon carbide, carborundum; sulphides, iron pyrites, slags and roasted ores, 432-435. Procedure for determination of silicon and silica, 436. Analysis of silicate of soda, 437. Analysis of sand, commercial valuation, 438.

SILVER

WALLACE G. DERBY

Research Chemist, Nichols Copper Company

Detection—wet method, silver chloride, characteristics, sundry tests, 439-440. Estimation—preliminary considerations, solubility, furnace methods, 440. Gravimetric methods—determination as silver chloride, as cyanide, electrolytic method, 440-441. Volumetric methods—thiocyanate procedure of Volhard, Gay-Lussac method, combination methods, Denigé's cyanide method, miscellaneous volumetric methods, nephelometric method, 442-448. Preparation of pure silver, 448.

FURNACE METHODS OF ASSAYING OF GOLD AND SILVER

WALLACE G. DERBY, M.S.

Research Chemist, Nichols Copper Company

Sample, the unit of weight, general survey of the subject of sampling, 451. Furnace operations; consequent to the furnace operations; preliminary to the furnace operations; silver and gold retained in the slag; silver and gold retained in the cupel; corrected assay; determination of gold; determination of silver; influence of quantity of sample, 453. Roasting, incineration, 455. Crucible method of fusion, 456. Scorification method of fusion, 467. Cupellation, 472. Parting, 478. Combination methods, 481. Determination of gold in eyanide solution, 485, Summary, 488

STRONTIUM

WILFRED W. SCOTT

Detection—sodium sulphate test, flame test, spectra, 489. Estimation—occurrence

and uses, 489. Preparation and solution of the sample—solubilities, 490. Separations—strontium from magnesium, alkalies, calcium and barium, 490. Gravimetric methods—determination as sulphate, carbonate, oxide, 491. Volumetric methods—alkalimetric, indirect method—chloride titration with silver nitrate, 491–492.

SULPHUR

WILFRED W. SCOTT

Detection-element: sulphides, sulphates, sulphites; thiosulphates, 493. mation—occurrence—element, sulphur dioxide, hydrogen sulphide, sulphide sulphate ores. Preliminary considerations, 494. Preparation and solution of the sample—solubilities—element, sulphide, sulphate, thiosulphate, sulphite; decomposition of sulphur ores; sulphur in coal by Eschka's method; sulphur in rocks, silicates and insoluble sulphates, barium and lead sulphates, 494-496. Separations—substances containing iron, separation of sulphur from metals forming an insoluble sulphate, nitrates and chlorates, silica, ammonium and alkali salts, 496-497. Gravimetric determination of sulphur-precipitation as barium sulphate, general considerations, precipitation from hot solutions, precipitation from cold solutions—large volume, standard method of the General Chemical Company, 497-500. Evolution method for sulphur in steel, ores, cinders, sulphides and metallurgical products, 500. Combustion method for evaluation of sulphide ores, 504. Volumetric methods for determining soluble sulphates—determination of sulphur by Wildenstein's method and by Hinman's method, Benzidine hydrochloride method, 505-507. Determination of persulphates ferrous sulphate and oxalic acid methods, 508. Determination of sulphur in combination as sulphides, sulphites, bisulphites, metabisulphites, thiosulphates, sulphates available hydrogen sulphide in materials high in sulphide sulphur—iron sulphide, sodium sulphide, etc.; hydrogen sulphide and soluble sulphides; sulphide and sulphydrate in presence of each other; thiosulphate in presence of sulphide and sulphydrate; sulphates and sulphides in presence of one another; sulphur in thiocyanic acid and its salts; sulphurous acid free, or combined in sulphites, acid sulphites, metabisulphites and thiosulphates—gravimetric method by oxidation to sulphate and precipitation as barium sulphate, volumetric methods-iodine titration, acidimetric and alkalimetric methods; determination of sulphites, metabisulphites, thiosulphates, sulphates, chlorides, and carbonates in presence of one another, 509-515. Determination of hydrosulphites, 516. Determination of free sulphur in a mixture, 517. Evaluation of spent oxide for total, residual and available sulphur, 518. Analysis.of brimstone, moisture, available sulphur, ash, arsenic and chlorine, 519. Quantitative estimation of small amounts of sulphide sulphur, 520.

THORIUM

R. STUART OWENS

Research Chemist, New York City

Detection, 522. Estimation—occurrence, 522. Preparation and solution of the sample—silicates; phosphates (monazite). 1. By fusion with potassium acid sulphate; 2. Sulphuric acid extraction; oxides, 522-523. Separations from other elements, 523. Gravimetric method for determining thorium, 523. Minute amounts of thorium by Jolly's method, 524.

TIN

W. S. SELLERS

AND

B. S. CLARK

Chemists, American Can Company

Detection of tin, 525. Estimation—preparation of the sample, opening up tin ores—the cyanide process, sodium carbonate method, other methods—fusion with sodium hydrate, reduction by means of hydrogen, fusion with sodium peroxide, 419–527. Separations—general procedure, separation of tin from lead, copper, antimony, phosphorus, iron and alumina, tungstic acid, 527, 528. Gravimetric methods—determination of tin or the oxides of tin by hydrolysis, determination of tin as sulphide, 528, 529. Bichloride of tin—stannic acid method—hot water precipitation; Acker process method; determination as sulphide, 530, 532. Volumetric determination of tin—Lenssen's iodine method as modified by Baker, standard method of the American Can Company, 532. Electrolytic determination of tin, 536. Estimation of tin in canned food products, 536.

TITANIUM

WILFRED W. SCOTT, Editor

L. E. BARTON

Chief Chemist, Titanium Pigment Company

Detection—tests with hydrogen peroxide, morphine, zinc, sulphur dioxide and by fusion with microcosmic salt, 538. Estimation—occurrence and application, 539. Preparation and solution of the sample—element, oxides, salts of titanium—general considerations—solution of steel, alloys, ores, titaniferous slags, 539, 540. Separations -titanium from the alkaline earths, etc.; separation from copper, zinc, aluminum, iron, manganese, nickel; cobalt, 540, 541. Gravimetric methods-modified procedure of Gooch, 541. Determination of titanium in ferro-carbon titanium, 542. Volumetric methods—reduction of titanic solution, addition of ferric salt and titration of reduced iron with permanganate; reduction of titanic salt and titration with ferric salt, 543-545. Colorimetric determination of titanium with hydrogen peroxide; colorimetric determination in steel treated in ferro-carbon titanium, (a) determination of titanium insoluble in hydrochloric acid, (b) determination of titanium soluble in hydrochloric acid, (c) total titanium; determination in presence of interfering elements; colorimetric determination of titanium with thymol solution. Analysis of titaniferous ores—determination of titanium, silica, alumina, phosphorus. Standard methods of the Titanium Alloy Manufacturing Company, 545-553. Analysis of titanium pigments, 553.

TUNGSTEN, TANTALUM AND COLUMBIUM

WILFRED W. Scott, Editor

J. A. HOLLADAY

Chemist, Electro-Metallurgical Co.

А. М. Ѕмоот

Technical Director, Ledoux and Co.

TUNGSTEN.—Detection—minerals, iron, steel and alloys, 554. Estimation—occurrence and uses, 555. Solution of the sample—solubilities, decomposition of ores,

acids, minerals, steel and alloys, steel containing a high percentage of tungsten, ferrotungsten alloys, tungsten bronzes, 555-557. Separations—tungsten from silica, separation of tungsten from tin, antimony by Talbot's process, separation from arsenic and phosphorus, separation from molybdenum by Hommel's process, volatilization of molybdenum with dry hydrochloric acid gas by Pechard's process; separation from vanadium, titanium, iron, 557-559. Gravimetric procedures—analysis of ores and concentrates, 559-573. Isolation of tungsten, 562. Volumetric method, 564. Determination of commonly occurring substances, 565; phosphorus, 565; sulphur, 565; arsenic, 566; tin, 567; copper, 569; manganese, 570. Analysis of tungsten metal and ferro-tungsten, 571-574. Determination of phosphorus, 571; sulphur, 573; silicon, 573; manganese, 574.

TANTALUM AND COLUMBIUM.—Detection, 575. Estimation—occurrence, application, 575. Solution of the sample—general procedure, tantaliferous minerals, 576. Separations—isolation of columbium and tantalum oxides; removal of tin, antimony, tungsten and silica, 576, 577. Determination of columbium and tantalum, 577.

URANIUM

WILFRED W. SCOTT, Editor

ALBERT H. LOW

Professor of Chemistry, Colorado School of Mines

Detection—general procedure—uranous salts, uranyl salts, 578. Estimation—occurrence, industrial application, 578. Preparation and solution of the sample—solubilities—element, oxide, salts; solution of ores, 579. Separations—uranium from copper, lead, bismuth, arsenic, antimony, and other members of the hydrogen sulphide group; separation of uranium from iron and from elements having water insoluble carbonates; separation from vanadium, 579–580. Gravimetric determinations of uranium as the oxide, U₂O₂, 581. Volumetric determination of uranium by reduction and subsequent oxidation, 581. Determination of uranium in carnotite, 582.

VANADIUM

WILFRED W. SCOTT

Detection—tests with sulphide, reducing agents, hydrogen peroxide, ammonium chloride, distinction from chromium, detection in steel, 583, 584. Estimation—occurrence and industrial application, 584. Preparation and solution of the samplesolubility of the element, its oxides and salts; general procedure for decomposition of ores of vanadium, ores high in silica, products low in silica, iron, steel and alloys, 585, 586. Separations—general procedure, removal of arsenic, molybdenum, phosphoric acid, separation of vanadium from chromium, 586, 587. Gravimetric methods—determination of vanadium by precipitation with mercurous nitrate; by precipitation with lead acetate, 587, 588. Volumetric methods—reduction to vanadyl condition and oxidation with potassium permanganate, reduction with zinc followed by permanganate titration; determination of vanadium in steel; determination of molybdenum and vanadium in presence of one another; determination of vanadium, arsenic or antimony in presence of one another by Edgar's method; determination of vanadium and iron in presence of one another; iodometric method for estimation of chromic and vanadic acids in presence of one another; determination of vanadium in ferrovanadium, methods of the Vanadium Company of America—general procedure, vanadium in ores; in steel; in steel containing chromium; in cupro-vanadium; in brasses and bronzes, 589-596.

and subsequent groups; removal of silver, removal of bismuth, lead, mercury, arsenic, antimony and tin; separation from cadmium, 181-184. Gravimetric methodsdetermination as cuprous sulphocyanate, determination as copper oxide. Deposition of metallic copper by electrolysis—introduction. Rapid methods—solenoid method of Heath, deposition from nitric acid solution, deposition from ammoniacal solution. Slow methods—electrolytic determination of copper in blister copper, standard procedure of Nichols Copper Company, large portion and small portion methods, traces of copper in the electrolyte, notes and precautions for the electrolytic deposition of copper, 184-192. Volumetric methods for determining copper based on precipitation copper as cuprous thiocyanate-iodide method, permanganate method, Demorest's method, Volhard's method, Garrigues' method, 193-196. Colorimetric determination of small amounts of copper—potassium ethyl xanthate method, ferrocyanide method, ammonia method, hydrogen sulphide method, 197-199. Determination of impurities in blister copper—bismuth, iron, lead, zinc, nickel, cobalt, arsenic, antimony, selenium, tellurium, oxygen, sulphur, phosphorus, 199-205. Determination of copper in refined copper, 205. Chlorine in cement copper and copper ores, 206. Copper in blue vitriol, 207. Copper and lead determination in brass, 207. Methods for determining the combinations of copper in ores and furnace products. The silver sulphate sulphuric method, phosphoric acid, ammonium chloride method, caustic soda sodium tartrate method, sulphuric acid mercury method, 208-211.

FLUORINE

WILFRED W. SCOTT

Detection—etching test, hanging drop test, black filter paper test, 212-214. Estimation—occurrence, 214. Preparation and solution of the sample—solubilities, organic substances, silicious ores and slags, calcium fluoride, soluble fluorides, hydrofluoric acid, fluorspar, 214-215. Separations—removal of silicic acid from fluorides, separation of hydrofluoric and phosphoric acids, separation of hydrofluoric from hydrochloric and boric acids, 215-216. Gravimetric methods—precipitation as calcium fluoride, as lead chlorofluoride, 216-217. Volumetric methods—Offerman's method, ferric chloride method, Steiger and Merwin colorimetric method, 218-222. Valuation of fluorspar, standard method of the Fairview Fluorspar and Lead Company, 222. Analysis of sodium fluoride, 223. Determination of traces of fluorine, 224.

GLUCINUM (BERYLLIUM)

WILFRED W. SCOTT

Detection, 225. Estimation—occurrence, 225. Separations—removal of silica and of the hydrogen sulphide group, separation of glucinum from iron, manganese, zirconium, yttrium, aluminum, chromium, iron, 226. Gravimetric determination of glucinum, 226, 227.

GOLD

WALLACE G. DERBY, M.S.

Research Chemist, Nichols Copper Company

Detection of gold in alloys, test for gold in minerals, benzidine acetate tests, phenylhydrazine acetate test, 228–229. Estimation—solubility, 229. Gravimetric methods—wet gold assay of minerals, electrolytic method, 230. Volumetric methods—permanganate and iodide methods, 231–232. Colorimetric methods—procedures of

Prister, Cassel, Moir, 233-234. Preparation of proof gold, Furnace method-reference, 234-235.

IODINE

WILFRED W. SCOTT

Detection—element, free iodine characteristics, iodide, iodate, 236. Estimation—occurrence, 236. Preparation and solution of the sample, iodides of silver, copper mercury, lead, etc., iodates, free iodine (commercial crystals), iodine or iodides in water, organic substances, mineral phosphates, 236–237. Separations—iodine from heavy metals, from bromine or from chlorine, separation from chlorine and bromine—palladous iodide method, 238–239. Gravimetric methods—precipitation of silver iodide, determination as palladous iodide, 239. Volumetric methods—hydriodic acid and iodides by thiosulphate or by arsenite titration, decomposition by ferric salts, decomposition with potassium iodate, nitrous acid method of Fresenius, hydrogen peroxide—phosphoric acid method, chlorine method of Mohr, Volhard's method, 239–243. Determination of iodates, periodates, and iodates with periodates in a mixture, 244–245. Determination of iodine in mineral waters, 245.

IRON

WILFRED W. SCOTT

Detection-ferric iron, hydrochloric acid solution, sulphocyanate, ferrocyanide, salicylic acid, sodium peroxide tests; distinction between ferrous and ferric salts, 246-Estimation—occurrence, 246. Preparation and solution of the sample—solubilities soluble iron salts, sulphide and oxide ores, iron ore briquettes, silicates, iron and steel, separations—general procedure; special cases, ether method, 247-248. Gravimetric methods—determination as oxide, Fe₂O₂; Cupferron method, 249-250. Volumetric methods—general considerations, by oxidation, the iron having been reduced—titration with potassium dichromate, potassium permanganate, Jones reductor method, 250-257. Stannous chloride method for determining ferric iron, 257. Colorimetric methods for determining small amounts of iron-with sulphocyanate, with salicylic acid, 258-259. Technical analysis of iron and steel—with specifications of Baldwin Locomotive Works. Introduction; preparation of the sample, combined or carbide carbon-colorimetric method, specifications for combined carbon; total carbon by combustion; graphite in iron; manganese by persulphate method, lead oxide procedure of Deshey, method by U. S. Bureau of Standards—manganese by the bismuthate method; specifications for manganese; determination of phosphorus by the alkalimetric and molybdate methods; specifications for phosphorus; determination of sulphur by the evolution method; method by the U.S. Bureau of Standards; specifications for sulphur in iron and steel; determination of silicon, rapid foundry method, method by the U.S. Bureau of Standards; specifications for silicon in iron and steel, 259-268. U. S. Bureau of Standards method for determining silicon, aluminum, titanium and zirconium in steel, 268-270.

LEAD

WILFRED W. SCOTT

Detection—hydrochloric acid test, hydrogen sulphide test, confirmations of tests, 271. Estimation—occurrence, 271. Preparation and solution of the sample—solubilities, decomposition of ores, minerals of lead, iron pyrites, alloys, 272. Separations—isolation of lead as sulphate, separation from barium, isolation as lead chloride, ammonium acetate extraction of lead from the impure sulphate, 273. Gravimetric methods—determination of lead as sulphate, as chromate, as molybdate, electrolytic



LIST OF ILLUSTRATIONS

FIG.	AGE
A1. Generator for Antimony Determination	29
1. Apparatus for Distillation of Arsenous Acid	38
4. Urbasch's Hydrogen Sulphide Generator	43
3. Scott's Hydrogen Sulphide Generator	42
2. Knors's Arsenic Distillation Apparatus	3 9
5. Purification of Hydrochloric Acid	48
6. Gutzeit Apparatus for Arsenic Determination	52
6a. Apparatus for Fluorine Analysis	68
7. Purification of Carbon Disulphide	75
8. Distillation of Methyl Borate	84
8a. Distillation Apparatus for Determining Boron	88
8b. Apparatus for Determining Bromine	98
8c. Cadmium Apparatus	102
9. Test for Carbonate	109
10. Chilled Steel Mortar	
11. Geissler Bulb	
12. Liebig Bulb	
13. Gerhardt Bulb	
14. Vanier Bulb	
15. Fleming's Apparatus for Determination of Carbon by Combustion	
16. Fleming's Absorption Apparatus	
17. Boat and Holder for Carbon	
18. Shimer Combustion Apparatus	
18a. Stetser and Norton Combustion Train	117 119
19. Diagrammatic Sketch of Combustion Tube	
20. Apparatus for Determining Carbon Dioxide	
22. Mohr's Alkalimeter.	
22a. Barker's Hydrometer	
23, 24. Hot Water Racks for Test Tubes; Color Carbon Determination	128
25. Carbon Tubes	
26. Color Comparitor or Camera.	
26a. Colorimeter	
27. Terminal Case Showing Battery of Electrodes.	
28. Solenoid for Rotation of Electrolyte.	
29. Riffle Sampler.	
30. Constant Temperature Bath and Dividing Pipette	
31. Hydrometer Jar for Electrolysis of Copper	
32. Special Beaker for Electrolysis of Copper.	
32a. Combustion Furnace, Hinged Type	206
33. Etching Test for Fluorine	212
34. Hanging Drop Test for Fluorine	213
35. Black Filter Paper Test for Fluorine	213
36. Adolph's Apparatus for Determining Fluorine	
to the state of th	

xxviii LIST OF ILLUSTRATIONS

FIG.		AGE
37. Steiger-Merwin Fluorine-Titanium Chart		221
38. Merwin's Chart on Ratio of Depth of Color		
39. Apparatus for Determining Iodine in Iodide		
40, 49. Jones' Reductor		
40a. Apparatus for Storing and Using Titanous Salt		56a
41. Apparatus for Stannous Chloride Titration of Iron		257
42. Dividing Pipette		259
43. Hurley's Colorimeter		
44. Cooper Hewitt's Mercury Light		285
45. Bell Jar Vacuum Filtering Apparatus		
46. Automatic Measuring Pipette		303
47. Sulphur Extraction Apparatus		310
48. Halloway-Eschka Apparatus for Determining Mercury		311
49a. Jones' Reductor		
50. Apparatus for Determining Nitrogen, Kjeldahl Method		340
51. Devarda's Apparatus Modified by Allen		347
52. Weighing Bottle and Dropper		348
53. Mitscherlich's Apparatus, Nitrogen in Soils		
53a. Davison Scrubber for Ammonia Determination		
53b. Apparatus for Determining Nitrates (Gooch & Gruener)		
54. Nitrometer		355
55. Du Pont's Nitrometer		
55a. Apparatus for Determining Pyradine		
55b. Analytical Balance		
56. J. Lawrence Smith Apparatus		416
57. Apparatus for Separation of Selenium and Tellurium		424
58. Lead Cup for Silica Test		
59. Apparatus for Determining Silver, Gay-Lussac Method		
59a. Chart Showing Influence of Quantity of Gold or Silver in Assay	ing	455
59b. Assay Furnace		
59c. Assaying Outfit		467
59d. Chart Showing Cupellation Loss		476
59c. Assay Balances		479
60. Evaporation in Sulphur Determination		
61, 62. Apparatus for Precipitating Sulphur		
63. Apparatus for Filtering Barium Sulphate		
64. Scott's Apparatus for Determining Sulphur in Iron and Steel		
65. Arrangement for Protecting the Crucible from the Flame		503
65a. Apparatus for Determining Hydrosulphite		
66. Sanders' Extraction Apparatus		517
67. Seller's Apparatus for Determining Tin		
68. Seller's Apparatus, Diagrammatic Sketch		
69, 70. Colorimeter		
71. Voit Flask and Distillation Apparatus		
72, 73. Apparatus for Determining Zinc		
74. Gooch Filtering Apparatus		622
PLATE I. Arsenic Stains, Gutzeit Method		
PLATE II. Emissions Spectra		
PLATE III Intraction Grating Spectrum and Prismatic Spectrum	Ramna maae	4()1

VOLUME I

PART I

TECHNICAL METHODS FOR THE DETECTION AND DETERMINATION OF THE MORE IMPORTANT ELEMENTS



ALUMINUM 1

WILFRED W. SCOTT

Al, at.wt. 27.1; sp.gr. 2.583; m.p. 658.7°; b.p. 2200°; oxide Al₂O₃.

DETECTION

General Procedure. The sample is prepared by one of the procedures outlined under "Preparation and Solution of the Sample." Silica is removed by taking the solution to dryness, boiling the residue with hydrochloric acid and filtering. The members of the hydrogen sulphide group are removed as usual with H₂S, the filtrate boiled to expel the excess of H₂S, iron oxidized with nitric acid, and aluminum, iron and chromium precipitated as hydroxides by addition of ammonium hydroxide in presence of ammonium chloride. On treating the precipitate with sodium peroxide, aluminum and chromium hydroxides dissolve, whereas ferric hydroxide remains insoluble. Aluminum hydroxide is precipitated by acidifying the alkaline solution with hydrochloric or nitric acid, and neutralizing with ammonia; chromium remains in solution.

Cobalt Nitrate Test. The white gelatinous precipitate of aluminum hydroxide may be confirmed by adding a drop of cobalt nitrate solution and burning the filter. The residue will be colored blue by the resulting aluminum cobalt compound.

Sodium Thiosulphate Test. Na₂S₂O₃, added to a neutral or slightly acid solution, containing aluminum, precipitates aluminum hydroxide, upon boiling the solution. Sodium sulphite, or ammonium chloride added in large excess, will also cause this precipitation.

Alizarin S Test. The reagent used is a 0.1% filtered solution of commercial alizarin S, the sodium salt of alizarin monosulphonic acid (yellow with acids, purple with alkalies).

To 5 cc. of the neutral or acid solution under examination is added 1 cc. of the reagent, and then ammonia until the solution is alkaline, as shown by the purple color. The solution is boiled for a few moments, allowed to cool, and then acidified with dilute acetic acid, when red coloration or precipitate remaining is conclusive evidence of the presence of aluminum. The red calcium, strontium, barium, zinc and magnesium salts, and salts of other metals later than Group II are readily soluble in cold dilute acetic acid, and do not interfere with the coloration.

Phosphates or chromium do not interfere and comparatively large amounts of iron may be present (0.003 milligram Al in presence of 1 milligram ferric iron, 10 milligrams chromium salt). In presence of greater quantities of iron citric acid is added to keep this in solution. One part of aluminum may be detected in 10 million parts of water.

¹ Also spelled Aluminium.

ESTIMATION

The determination of aluminum, in terms of alumina, Al_2O_1 , is required in the evaluation of aluminum ores, bauxite, $Al_2O(OH)_4$; diaspore, AlO(OH); alunite, $K_2O.3Al_2O.4SO_1.6H_2O$, etc. It is determined in the analysis of feldspar, halloysite, clays, granite, gneiss, porphyry, mica schist, slate, obsidian or pumice stone, cryolite, limestone, and in the complete analysis of a large number of mineral substances. The estimation of alumina is required in the analysis of cements, plaster, ceramic materials, aluminum salts, and is especially important in the control of processes in the manufacture of aluminum products. As a metal it is determined in commercial aluminum, and its alloys.

Preparation and Solution of the Sample

In dissolving substances containing aluminum it will be recalled that alumina, although ordinarily soluble in acids, is very difficult to dissolve when it is highly heated. It may be best dissolved, in this case, by fusion with sodium carbonate or with acid potassium sulphate, followed by an acid extraction. The metal is scarcely acted upon by nitric acid, but is readily soluble in the halogen acids and in hot concentrated sulphuric acids.

General Procedure for Ores. One gram of the finely powdered ore, taken from a representative sample, is placed in a platinum dish, 5 cc. of concentrated sulphuric acid are added, followed by about 20 cc. of strong hydrofluoric acid. The mixture is evaporated over a steam bath as far as possible and then taken to SO₁ fumes on the hot plate (Hood). Upon cooling, a little dilute hydrochloric acid is added and the mixture warmed. The solution is diluted with distilled water and filtered if any residue remains.

The insoluble residue remaining on the filter may be brought into solution by fusing the ignited residue with sodium carbonate or acid potassium sulphate. If barium is present sodium carbonate fusion is made and the melt extracted with water to remove the sodium sulphate. The residual carbonates may now be dissolved with hydrochloric acid.

SULPHIDE ORES should be oxidized with nitric acid and bromine according to the general procedure for decomposing pyrites in the determination of sulphur.

The solution of the sample having been effected, aluminum is separated from elements that interfere in its estimation. Directions for the removal of these substances are given under "Separations." The element is now in solution in such form that it may be determined gravimetrically or volumetrically.

Fusion Method. Sodium Carbonate. The air-dried material, ground to a fine powder, is placed in a glass-stoppered bottle. If the determination is to be made on the dry basis, moisture is driven out by placing the material in the hot air or steam oven for an hour (100 to 110° C.). One gram sample, placed in a large platinum crucible, is mixed with 4 to 5 grams of anhydrous sodium carbonate and the material heated to fusion, the heating being continued until the molten mass appears clear. The liquid mass may be poured on a large platinum crucible lid, or if preferred, allowed to cool in the crucible, a platinum prod being held in the fusion until it solidifies. By gently heating the crucible over a flame the fusion loosens from the sides and may be lifted out on the prod. In either case the cooled mass is dissolved by placing it, together with the crucible in which the

fusion was made in a casserole, and treating with hydrychloric acid, the casserole being covered with a clock glass during the reaction.

Silica is removed by evaporating the solution to dryness on the water or steam bath and drying in the oven at 110° C. for an hour or more. The residue is extracted with hot dilute hydrochloric acid and silica filtered off.

If the solution is cloudy upon treatment of the fusion with acid, it indicates either the presence of barium sulphate or incomplete decomposition of the sample. In the latter case the residue is gritty and the fusion of this material should be repeated.

Solution of Metallic Aluminum and its Alloys. The metal may be dissolved in dilute hydrochloric acid, 1:1, or in a solution of sodium hydroxide or potassium hydroxide.

Alloys of aluminum are best brought into solution with a mixture of hydrochloric and nitric acids.

SEPARATIONS

General Considerations. In the usual course of analysis, aluminum is in solution as a sulphate or as a chloride, silica having been removed by dehydration, as described under "Preparation and Solution of the Sample." The following interfering elements may be present in the solution: iron, manganese, arsenic, antimony, titanium, phosphoric acid, and more rarely chromium and airconium. In alloys of aluminum other elements may be added to this list. The separation more commonly required is from iron, aluminum and iron being precipitated together as the hydroxides. In usual practice the two are weighed together as Fe₂O₂ and Al₂O₃, after ignition to this form, and iron then determined, either on a separate portion of the sample, or by solution of the precipitate by fusion with sodium carbonate or potassium bisulphate and subsequent extraction with hydrochloric acid.

Removal of Silica. This compound has already been considered under 'Preparation and Solution of the Sample," SiO₂ being removed by taking the solution to dryness, dehydrating the oxide by additional heating in the oven, followed by extraction of the soluble constituents with dilute hydrochloric acid and filtration. Under the first procedure for solution of the ore by sulphuric and hydrofluoric acids silica is expelled as gaseous SiF₄.

Separation from Iron. 1. Aluminum hydroxide is precipitated by the addition of a salt of a weak acid to its neutral or slightly acid solution, iron remaining in solution. Details of the procedure for precipitation of aluminum hydroxide by means of sodium thiosulphate are given under "Gravimetric Methods for Determination of Aluminum," page 9.

2. Aluminum chloride is precipitated from a concentrated solution of hydrochloric acid and ether saturated with HCl gas. Details of the procedure are given under the gravimetric methods for aluminum, page 10.

Note. The following additional procedures for separation of iron and alumina have been suggested:

(a) Precipitation of iron as FeS in presence of organic acids, citric, tartaric, salicylic, etc., aluminum remaining in solution.

(b) Precipitating iron by adding sodium peroxide to a cold neutral solution of the elements until the precipitate first formed dissolves, then decomposing the sodium ferrate by boiling, Fe(OH), precipitates, Al remaining in solution. (Glaser, J. S. C. I., 1897, 936.)

(c) The neutral solution of the elements is localed with freshly precipitated MnO₃, which causes the precipitation of train as Fe (fr.), while adminium remains in solution, (chromium also passes into the fibrate.)

(d) Precipitation of iron from and sociators by means of amino-nitrosophenylhydroxylamine, (cupterron , aluminum remaining in solution. O. Baudisch, Chem. Ztg., 33, 1208, 1905. Febt., 35, 413, 1911; O. Faudisch and V. L. King, J. I. E. C.,

3, 627, 1911).

(c) Precipitation of aluminum together with phosphoric acid, if present), by phenylhydrazine, added to the reduced weakly and or neutral solutions. Iron, cobalt, nickel, calcium, and magnesum remain in solution. Hess and Campbell C. N., lxxxi, 158. Engles, J. S. C. I., 1868, 746.

(f) Electrolytic separation of the by amalgamation with mercury cathode and Magnesishum at J. S. C. L. 1890, 1064;

determining aluminum in the solution Kolin and Woodgate, J. S. C. I., 1880, 280 Kretzschmar, J. S. C. I., 1890, 1064;

Phosphoric Acid. In presence of phosphoric acid, the phosphates of iron and alumina together with the phosphates of the other elements of the group and those of the alkaline carths will be precipitated upon making the solution alkaline with ammonia. Should from and alumina be the only elements of these two groups present in the solution, they may be precipitated together as phosphates, iron determined by titration and calculated to the phosphate salt, and alumina obtained by difference. Occasionally, however, it is necessary to remove phosphoric acid.

Removal of Phosphoric Acid. The material is fused with about six times its weight of a mixture of 4 parts Na, CO, and 1 part SiO, (silex), and the melt extracted with water containing ammonium earbonate. Iron and aluminum remain on the filter, upon filtration, while sedium phosphate passes into solution. Both the precipitate and filtrate contain silica. The precipitate of iron and alumina is dissolved in hydrochloric acid and taken to dryness, the residue dehydrated as usual, then treated with dilute hydrochloric acid and rather filtered off. The solution contains iron and aluminum in form of chlorides.

Separation of Aluminum from Chromium. The solution is made strongly alkaline with sodium or potassium hydroxides and chromium oxidized by passing in chlorine gas or by adding bromine. The solution is now acidified with nitric acid and aluminum hydroxide precipitated by addition of ammomum by droxide, chromium remaining in solution as a chromate.

Separation of Aluminum from Manganese, Cobalt, Nickel, Zinc, the Alkaline Earths, and Alkalies. Iron and aluminum are precipitated as basic are lates, the other elements passing into solution. Details of the procedure are precin under the basic acetate method on page 298.

In observe of phosphates, these elements do not interfere in the determinotion of aluminum by precipitation as the hydroxide.

Commution of Aluminum from Titanium. Details of the procedure are proceedingles "Titanium,"

Copulation of Aluminum from Uranium. Aluminum is precipitated as a contametr in presence of a large amount of ammonium salts by addition of a large core of ammonium carbonate and ammonium sulphide, while uranium reasons in solution as the complex compound UO₃(CO₃)₄(NH₄)₄.

Separation from Glucinum. Aluminum is soluble in the fixed alkalies and remains in solution on boiling; glucinum also dissolves, but is precipitated on titaling. I divinium to soluble in an excess of ammonium carbonate, aluminum

Philipped separations see chapter on element in question.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF ALUMINUM

There are two general procedures for the gravimetric determination of aluminum. A. Direct determination, when it is possible to precipitate the hydroxide or phosphate of the element, free from impurities. B. Indirect determination when the element is precipitated and weighed along with iron, the latter then determined by titration and aluminum estimated by difference.

Determination by Hydrolysis of an Aluminum Salt with Ammonium Hydroxide

Principle. The method depends upon the hydrolysis of a soluble salt of aluminum by neutralizing the free and combined acid with ammonia. This hydrolysis takes place in presence of ammonium chloride, which prevents the precipitation of magnesium hydroxide by NH₄OH, the common ion, NH₄+, repressing the ionization of the base, NH₄OH. (See Notes.) The direct determination of aluminum by this procedure excludes the presence of elements undergoing hydrolysis with similar conditions. Iron, chromium, titanium, zirconium, thallium, cerium interfere. In their presence a separation must be made.

Reaction. AlCl₃+3NH₄OH = Al(OH)₃+3NH₄Cl.

If phosphoric acid is present in the solution aluminum will be precipitated as the phosphate, AlPO₄.

Procedure. To the solution, containing aluminum, free from phosphoric acid and the elements precipitated by ammonium hydroxide, are added 10 cc. of ammonium chloride (10%) and 5 cc. of concentrated nitric acid. The solution is diluted to about 150 cc. and heated to boiling. Upon cooling slightly, carbonate-free ammonium hydroxide is added slowly from a burette until a slight permanent precipitate forms, and then drop by drop until the solution reacts alkaline to litmus paper and the odor of ammonia is faintly perceptible. The precipitate is allowed to settle on the water bath for a few minutes, then filtered hot and washed first several times by decantation and finally on the filter with a hot solution of ammonium nitrate. (Twenty cc. strong nitric acid diluted and neutralized with ammonium hydroxide and made to 1000 cc.)

The precipitate is purified, if other members of the ammonium sulphide group and following groups are present, as the gelatinous precipitate is apt to occlude some of these. This is accomplished by dissolving the precipitate in a small amount of hot, dilute hydrochloric acid, 1:1, the solution being caught in the beaker in which the first precipitation was made. The precipitation of the hydroxide is repeated exactly as is stated above. The precipitate, washed free of chlorides (AgNO₁ test), is drained of water and placed together with the filter paper in a platinum crucible.

The ignition of the precipitate is conducted slowly at first until the paper is thoroughly charred, the heat is now increased to the full power of the Meker blast, the crucible being covered to prevent mechanical loss. Blasting for thirty minutes is generally sufficient to dehydrate the oxide, Al₂O₄. It is advisable, however, to repeat the heating until the weight becomes constant. The residue is weighed as Al₂O₄.

Notes. Ammonia should be free from carbonates. Upon long standing with frequent exposure to air the ammonia takes up CO₂, forming carbonate of ammonia. Freshly distilled ammonia will be pure, the carbonate being precipitated by addition of lime in the distilling flask. Ammonia is best kept in a ceresine or paraffine bottle. It will then remain free from silica, which it invariably contains when confined in glass bottles.

Long heating of the mixture containing the aluminum precipitate is objectionable.

1. The solution is apt to become acid owing to the decomposition of ammonium salts and the volatilization of ammonia.

2. The precipitate will become slimy and will be difficult to wash and filter. It is preferable to redissolve and again precipitate if this condition occurs.

3. The CO₂ of the air is apt to be absorbed by the solution, causing the precipitation of calcium carbonate, etc., should the solution be exposed for any length of time

4. Silica from the beaker will contaminate the precipitate.

Hence it is advisable to filter as soon as possible after making the precipitation

of Al(OH)₁.

S. and S. No. 589, black band filter paper filters well and may be used to advantage with precipitates of the nature of aluminum hydroxide. B. and A. No. B. filter is also good.

Washing the precipitate with ammonium nitrate prevents the aluminum from passing through the filter and keeps it from packing. It favors the formation of the insoluble hydrogel form of the hydrate while preventing the formation of the soluble hydrosol. Ammonium chloride may be used in place of nitrate. Aluminum hydroxide is soluble in acids and alkalies. The ignited oxide,

Al2O3, is insoluble in acetic acid but is soluble in mineral acids and the fixed alkalies, It is rendered very difficultly soluble in acids by strong ignition, generally requiring fusion with sodium carbonate or potassium bisulphate with subsequent acid treatment to effect solution.

Al₂O₃, m.w., 102.2; sp.gr., 3.73 to 3.99; m.p., 2020° C.

A yellow or reddish precipitate indicates the presence of iron, an element frequently present with aluminum. Should this be the case, iron must be determined, either in a separate portion of the sample, or in the residue obtained by the procedure outlined. The amount of Fe₂O₃ is subtracted from the total residue, and Al₂O₃ obtained by difference.

If phosphoric acid is present the phosphate of alumina will precipitate together with the phosphates of elements insoluble in alkaline solutions. Should phosphoric acid be present either its removal is essential, or the phosphate method for alumina

should be followed.

Fluorides hinder the precipitation of aluminum.² Evaporation to dryness and heating the residue to redness will transform fluorides to oxides and overcome this

difficulty.

Sulphates tends to hold up aluminum from precipitation and a certain amount of sulphuric acid is occluded by the aluminum hydroxide precipitate. Magnesium is more apt to precipitate with alumina in presence of sulphates.3 Ammonium chloride greatly lessens this difficulty.

Traces of alumina may be recovered from the filtrate by evaporation to dryness, ignition and resolution with HCl. The Al(OH), is now precipitated with NH4OH.

Since alumina absorbs moisture from the air, the crucible containing this compound

should be kept covered in a desiccator until weighed

Ammonium hydroxide, in presence of sufficient NH₄Cl, will not precipitate Mg(OH)₂, since the addition of NH₄Cl increases the ammonium ions in the solution and, by the common ion effect, represses the hydroxyl ions of the base, NH4OH, so that there are insufficient hydroxyl ions for the solubility product of Mg(OH)₂ to be exceeded; therefore magnesium remains in solution. A discussion of the theory of solubility product and law of mass action may be found in the author's work on Qualitative Chemical Analysis, published by D. Van Nostrand Co. Reference is also made to Vol. I of The Elements of Qualitative Chemical Analysis, by Julius Stieglitz, publ. by the Century Co.

¹ W. Blum, Jour. Am. Chem. Soc., 38, 7, 1282, 1916. C. F. Sidener and Earl Petti-

john, Jour. Ind. Eng. Chem., 8, 8, 714, Aug., 1916.

² E. P. Veitch, Jour. Am. Chem. Soc., 22, 246, 1900. W. R. Bloor, ibid., 29, 1603, 1907. L. P. Curtman and H. Dubin, ibid., 34, 1485, 1912.

Determination of Aluminum by Hydrolysis, Neutralizing the Mineral Acid by Addition of a Salt of a Weak Acid. Sodium Thiosulphate Method 1

If a salt of a weak acid and strong base is added to a neutral or slightly acid solution of an aluminum salt containing a mineral acid, transposition takes place and aluminum is hydrolyzed.

Reaction. $2AlCl_1 + 3Na_2S_2O_3 + 3H_2O = 2Al(OH)_3 + 6NaCl + 3SO_3 + 3S$.

Procedure. If the solution is acid, dilute ammonia is added until a precipitate forms that dissolves with difficulty, but not enough ammonium hydroxide to cause a permanent precipitation. The solution is diluted so that it contains about 0.1 g. Al per 200 cc., then an excess of sodium thiosulphate is added, and the solution is boiled free of SO₂. Al(OH), precipitates along with free If iron is absent it is advisable to add a few drops of ammonium hydroxide until the solution has a slight odor of ammonia. The mixture again boiled is filtered and the residue of Al(OH), and sulphur washed with hot water containing ammonium chloride or nitrate. The precipitate is dried, separated from the filter, the latter ignited and the ash added to the main precipitate. Alumina is now determined by blasting to constant weight, the residue being weighed as Al₂O₂.

Notes. The above method may be employed for separation of aluminum from iron, the addition of ammonia, following the neutralization of the mineral acid by thiosulphate being omitted. The precipitation of Al(OH), by this procedure gives a more dense and better filtering precipitate than does ammonia alone.

Note. G. Wynkoop suggests the use of sodium nitrite as the salt of a weak acid

for neutralizing the mineral acid.²
Reaction. 2AlCl₃+6HOH=2Al(OH)₃+6HCl and

 $6HCl + 6NaNO_2 = 6NaCl + 3H_2O + 3NO + 3NO_2$.

Precipitation of Aluminum as a Phosphate

This procedure, developed by Carnot, is of special value in determination of aluminum in iron and steel. It is founded on the reaction that aluminum is precipitated as the neutral phosphate, from a boiling solution faintly acid with acetic acid. Iron, reduced to the ferrous condition by addition of sodium hyposulphite, does not interfere.

Procedure. A sample of 10 grams of iron or steel, in a platinum dish, covered with a piece of platinum foil, is dissolved by addition of hydrochloric acid. The solution is diluted to about 100 cc. and filtered into a flask, the residue of carbon, silica, etc., is washed thoroughly and the filtrate is neutralized by addition of ammonium hydroxide and ammonium carbonate; no permanent precipitate should form. A little sodium hyposulphite is added, and when the liquid, at first violet, becomes colorless, 2 or 3 cc. of a saturated solu-

¹ Method by Chancel, Compt. rend. (1858), 46, 987. ² J. Am. Ch. Soc., 19, 434 (1897). The method may be found in Treadwell and Hall "Quantitative Analysis," 4th ed., p. 85. A. Carnot, Moniteur Scientifique, 1891, p. 14.

tion of sodium phosphate and 5 or 6 grams of sodium acetate, dissolved in a little water, are added. The solution is boiled until free of sulphurous acid odor (about three-quarters of an hour). The solution is filtered off from the precipitated aluminum phosphate (mixed with a little silica and ferric phosphate) and washed with boiling water. The precipitate on the filter is treated with hot dilute hydrochloric acid the filtrate caught in a platinum dish, and then evaporated to dryness and heated at 110° C. for an hour to dehydrate silica. The residue is taken up with dilute hydrochloric acid and the solution filtered free of silica. Upon dilution to about 100 cc. with cold water, the solution is neutralized as before, a little hyposulphite is added to the cold solution and then a mixture of 2 grams of sodium hyposulphite and 2 grams of sodium acetate. The material is boiled for half an hour or more, filtered and the aluminum phosphate residue washed with hot water, then dried, ignited and weighed as aluminum phosphate. The residue contains 22.19% Al.

 $AlPO_4 \times 0.2219 = Al$. $AlPO_4 \times 0.4185 = Al_2O_3$.

Note. Properties of AlPO₄, m.w., 122.14; sp.gr., 2.59; infusible, insoluble, in H₅O and in HC₂H₅O₂, soluble in mineral acids and in alkalies; white, amorphous salt.

Precipitation of Aluminum as Aluminum Chloride¹

Principle. Gooch and Havens found that aluminum chloride is practically insoluble in a mixture of concentrated hydrochloric acid and ether saturated with HCl gas, 5 parts of AlCl₂.6H₂O equivalent to 1 part of Al₂O₂ dissolving in 125,000 parts of the mixture. The method serves for a separation of aluminum from iron, berillium, zinc, copper, mercury and bismuth, the chlorides of these elements being soluble under the above conditions. Barium, however, is precipitated as a chloride with aluminum, if it is present in the solution.

Procedure. To the concentrated aqueous solution of aluminum is added a convenient volume of strong hydrochloric acid (15 to 25 cc.) and an equal volume of ether. The mixture is best placed in a large platinum crucible, which is kept cool in running water. HCl gas is passed into the solution to saturation. The precipitated chloride of aluminum is filtered upon asbestos in a weighed Gooch crucible and then washed with a mixture of ether and water 1:1, saturated with HCl gas. The precipitate is dried for half an hour at 150° C., then covered with a layer of C.P. mercuric oxide (1 gram) and heated at first, gently over a low flame (hood) and then blasted to constant weight. The residue is weighed as Al₂O₃.

Notes. HCl gas is generated by dropping strong sulphuric acid into concentrated hydrochloric acid according to the procedure described under the determination of arsenic by volatilization as arsenious chloride. The gas may be produced in a Kipp generator by the action of concentrated sulphuric acid on ammonium chloride.

The filtrate from aluminum contains iron, berillium, copper, zinc, etc., if these are present in the original solution. If much iron is present it is necessary to increase the amount of other to prevent precipitation of the ferric salt.

¹ F. A. Gooch and F. S. Havens, Am. Jour. Sci. (4), 11, 416. F. A. Gooch " Methods in Chemical Analysis."

VOLUMETRIC METHODS FOR THE DETERMINATION ALUMINUM

Volumetric Determination of Combined Alumina in Aluminum Sulphate and Aluminum Salts

Aluminum salts dissociate in hot solutions and react acid to Introduction. phenolphthalein indicator; the acid readily combines with fixed alkalies, forming the neutral alkali salt. The end point of the reaction is indicated by the pink color produced upon phenolphthalein by the excess of alkali. From the amount of caustic required the percentage of combined Al₂O₂ may be calculated. The following reaction takes place:

$$Al_2(SO_4)_2 + 6NaOH = 2Al(OH)_2 + 3Na_2SO_4$$

Procedure. The factor weight, 1 3.4067 grams, is dissolved in a 4-in. casserole with 100 cc. of distilled water, 1 cc. of phenolphthalein indicator added, and the sample titrated boiling hot 2 with N/2 NaOH, added from a chamber burette, graduated from 50 to 100 cc. in tenths of a cc. The solution is kept boiling during the titration and is constantly stirred. Towards the end of the reaction the alkali is added cautiously drop by drop until a permanent pink color is obtained.

Cc. of NaOH required divided by 4 = per cent combined Al₂O_{3.3} Combined Al₂O₃+free Al₂O₃ = total Al₂O₃.

Notes. If iron is present a correction must be made for it after determining the ferrous and ferric forms as given below.

The amount of phenolphthalcin indicator used should be the same in each determination. An excess of indicator causes low results. It has been noted in case of alums where iron does not interfere that best results are obtained with three or four drops of phenolphthalein solution. Iron tends to mask the end point, hence a larger amount of indicator is necessary if this is present.

Correction for Iron if Present. Since iron salts will also dissociate and titrate with aluminum salts, by this method a correction has to be made for iron Total Al₂O₃ in presence of iron =

combined Al₂O₃-(FeO×.47+Fe₂O₃×.64)+basic Al₂O₃+an additive factor.

The additive factor is obtained by subtracting

(Combined Al₂O₃+basic Al₂O₃) - (FeO × .47+Fe₂O₃ × .64) volumetric. from total Al₂O₂ obtained by gravimetric analysis of an average sample.

¹ Large samples must be taken for salts containing less than 13 per cent Al₂O₂ if the chamber burette is to be used. E.g., potash alum twice this amount is advisable.

Otto Schmatolla, Berichte, xxxviii, No. 4. C. N., 91-2375-236 (1905).

If free acid is present (see next method), the equivalent volume in terms of \(\frac{1}{2} \) N acid must be deducted from the total titration for combined alumina before dividing by 4.

Ferrous Iron, Ferric Iron, and Total Iron A five-gram sample is dissolved in water and the iron oxidized with a few drops of strong potassium permanganate solution; the solution should be pink; the excess of permanganate is destroyed by a drop or so of normal oxalic acid solution and the total iron determined by stannous chloride solution method for iron. On a separate sample ferric iron is determined. Ten grams of the sample are dissolved in an Erlenmeyer flask by boiling with hydrochloric acid, 2:1, in an atmosphere of CO_2 to prevent oxidation, and the iron titrated with standard stannous chloride. The difference between total iron as Fe_2O_3 and ferric oxide = ferrous iron in terms of Fe_3O_3 . This multiplied by .9 = FeO.

Combined Sulphuric Acid

Provided no free acid is present, the per cent combined sulphuric acid in aluminum sulphate is obtained by multiplying the cc. caustic titration for total alumina by 0.72.

In case free acid is present, the per cent free acid deducted from total acid found by titration gives combined acid.

Su'phuric acid combined with the fixed alkalies is not titrated.

Determination of Free Alumina or Free Acid by the Potassium Fluoride Method

Introduction. The method suggested by T. J. I. Craig (J. S. C. I. 30, 185), has been modified by the author, after a personal investigation of the details involved. In this modified form it has been used successfully as a rapid works method. Frequent gravimetric checks on a large number of determinations have shown it to be accurate.

The procedure is based upon the fact that an excess of neutral potassium fluoride decomposes aluminum salts, forming two stable compounds, which react neutral to phenolphthalein, while the free acid remains unaltered, the following reaction taking place:

$$Al_2(SO_4)_3+12KF+xH_2SO_4=2AlF_3XF+3K_2SO_4+xH_2SO_4$$

The precipitate AlF₃3KF is insoluble in an excess of the potassium fluoride reagent and is not appreciably attacked by acids or alkalies. Although theoretically about 7 parts by weight of potassium fluoride is sufficient to combine with 1 part of aluminum sulphate, in practice it is advisable to use twice this amount.

Reagents Required. Half Normal solutions of sulphuric acid and potassium hydroxide.

Phenolphthalein indicator, 0.1% alcoholic solution.

Potassium fluoride solution; made by dissolving 1000 grams of potassium fluoride in about 1200 cc. of hot, CO₂-free water, then neutralizing the solution with hydro-fluoric acid or potassium hydroxide as the reagent may require, using 5 cc. of phenol-phthalein as indicator. Dilute sulphuric acid may be used in place of hydrofluoric acid in the final acid adjustment to get a neutral product. One cc. of the solution in 10 cc. of CO₂-free water should appear a faint pink. The concentrated mix is filtered if necessary and then diluted to 2000 cc. with CO₂-free water. The gravity will now be approximately 1.32 or about 35° Bé. One cc. contains 0.5 g. potassium fluoride.

¹ W. W. Scott, Jour. Ind. Eng. Chem., 7, 1059, 1915.

Method of Procedure

Solids. 3.4067 g. of the finely ground sample, or an equivalent amount in solution (100 cc. of sample containing 34.067 g. per liter), are taken for analysis The powder is dissolved by boiling with 100 cc. of distilled water in a 4-incasserole with clock glass cover. To the hot solution 10 cc. of N/2 H₂SO₄ are addedand after cooling to room temperature, 20° C., 18 to 20 cc. of the potassium fluoride reagent are added and 0.5 cc. of phenolphthalein. The solution is now titrated with N/2 KOH, added drop by drop until a delicate pink color, persisting for one minute, is obtained. This titration shows whether the product is basic or acid.

Basic Alumina. This is indicated when the alkali back-titration is less than the amount of acid added. Free Al₂O₃ = (cc. H₂SO₄-cc. KOH) \div 4.

Free Acid. In case the back-titration of the alkali is greater than the cc. of acid added, free acid is present. Free acid = (cc, KOH - cc, H_2SO_4) × 0.72.

Liquors. In works control it is necessary to test the concentrated liquors to ascertain whether these are basic or acidic. The Bé. or sp.gr. of the solution having been taken, 5 cc. is diluted to 100 cc. with distilled, CO₂-free water. If H₂S is present, it is expelled by boiling the solution, which should be acid, 10 cc. of N/2 H₂SO₄ is added, the solution cooled, and KF and phenolphthalein added and the titration made as in case of solids.

If basic (cc. H_2SO_4 - cc. KOH) × (.0245 × .3473 × 100) ÷ (5 × sp.gr.) = Al_2O_3 .

If acid (cc. KOH –cc. $H_2SO_4 \times 2.45$) ÷ wt. of sample = per cent free acid (H_2SO_4). If neutral, the back titration of the alkali is the same as the cc. acid added.

CO2-free water must always be used when phenolphthalein indicator is NOTES. This may be obtained by boiling distilled water for several minutes to This reagent is very sensitive to carbonic acid. necessary. expel CO₂.

If the sample does not dissolve clear, a prolonged digestion with previous addition of the required amount of standard acid, 10 cc., is advisable. This is best accomplished in an Earlnmeyer flask with a return condenser.

Darkening of the solution during the back titration with the alkali, indicates that an insufficient amount of fluoride has been added. If this is the case it will be necessary to make a fresh determination.

The fluoride method has the following advantages. Determinations may be made The end point is easily detected. No neutral standard is necby gas or electric light. essary as in case of the tint method.

Ammonium salts, if present, must be expelled by boiling the sample with an excess

of standard KOH and this excess determined.

3.4067 = 2.45225 × .3473 × 4 (i.e. gms. H₂SO₄ per 100 cc. N/2 acid multiplied by 4 times factor to equivalent Al₂O₃). Derived directly from mol. wt. of Al₂O₃ = $(.1022 \times 100 \times 4)$ + (6×2) . 0.72 = 2.8792 +4 (i.e. factor Al₂O₃ to H₂SO₄+4).

The main details of the above volumetric procedures were worked out at the Laurel Hill Laboratory, General Chemical Company, and are published by courtesy of this company.

Colorimetric Estimation of Minute Amounts of Aluminum with Alizarin S.—Atack's Method¹

Reagent. See page 3.

Procedure. The original solution (5 to 20 cc.) is acidified with hydrochloric or sulphuric acid. Ten cc. of glycerin and 5 cc. of a 0.1% solution of alizarin S are added, the solution made up to about 40 cc. with water (in presence of much iron or chromium citric acid is added to form the double citrates) and then rendered slightly ammoniacal. After standing for five minutes, the cold solution is acidified with dilute acetic acid, the alizarin S acting as indicator (red coloration) until no further change in the coloration occurs. The liquid is then made up to 50 cc. and compared with a standard. Suitable amounts of aluminum for estimation are 0.005 to 0.05 milligrams, the solution under examination being suitably diluted if necessary.

BAUXITE ANALYSIS²

Characteristic bauxites	H_2O	SiO ₂	Fe ₂ O ₂	Al ₂ O ₂	TiO ₂
Arkansas		6.4%	1.43%	87.3%	3.99%
Georgia	36%	9-15	1-14	42-62	1.8-2.3
Tannessoa	27 Ř	18 4	· 4 1	40 O	

Sampling. The bauxite received in cars is sampled during the unloading according to the standard procedure for ores. If the sample is a composite aliquot parts of the total weights are taken and mixed, e.g., suppose three cars contained respectively 23,000, 32,500, and 26,340 pounds, then the aliquots would be 23, 32.5 and 26.34 pounds, which mixed, would make a representative sample of the shipment. The ore is broken down, quartered, ground down and again quartered. The moisture is determined on 1000 grams, dried in the oven at 100° C. for one hour, the sample being spread out on a sheet of manilla paper. The dried sample is placed in a large bottle for analysis.

Extraction of Ores of Aluminum for Their Commercial Valuation. Twenty-five grams of bauxite, alunite or clay, placed in an 600 cc. Kjeldahl flask with reflux condenser are digested for one hour with 60 cc. 10 N (48%) sulphuric acid. Time being taken when the mix begins to boil. The flame is so regulated that the water drips back into the flask from the condenser at the rate of 12 to 15 drops per minute. When the digestion is completed 150 cc. of hot water are introduced through the condenser. The mixture is now filtered using a Buchner funnel and suction. The residue is washed with six 100 cc. portions of water and the filtrate made up to 1000 cc. A 200 cc. aliquot is made up to 1000 cc. and 100 cc. of this taken for determination of alumina as stated on next page.

¹ F. W. Atack, Jour. Soc. Chem. Ind.; 34, 936 (1915); C. A. 9; 23; 3186 (1915).

² Bauxite and kaolin are two sources of alumina of commercial importance. The alumina of certain grades of clay, is made available for acid extraction by roasting at a definite temperature. 550°-700° C.

Insoluble Residue. The residue on the filter paper is ignited in a platinum dish over a low flame until the paper chars, and then over a good Meker blast for 15 to 20 minutes.

Weight of the residue \times 4 = per cent insoluble residue.

Soluble Alumina. 100 cc. of the above solution (0.5 g.) is diluted with an equal volume of water, 10 cc. of hydrochloric and 2 cc. of nitric acids added and the solution boiled. Iron and alumina are now precipitated and determined in the usual way.

Soluble Iron. 200 cc. of the solution (1.0 g.), is oxidized by adding a few crystals of potassium chlorate and the solution taken to dryness. The residue is taken up with 10 to 15 cc. of concentrated hydrochloric acid and again evaporated to dryness to expel chlorine. Then taken up with 25 cc. hydrochloric acid and the iron determined by titration. The stannous chloride method is used for samples containing less than 5% iron and the dichromate method for ores containing over 5%.

Determination of Total Silica, Titanium Oxide, Ferric Oxide and Alumina

The method by the Aluminum Company of America is to digest 1 gram of the dried bauxite in 90 cc. of an acid mixture containing 12 parts of dilute sulphuric acid, 1:3, together with 6 parts of strong hydrochloric acid and 2 parts of nitric by volume, to this are added 10 cc. of concentrated sulphuric acid. The mixture is heated until sulphuric acid fumes are evolved, then diluted with water and filtered.

Silica. The residue is ignited and the ash fused with potassium bisulphate. The cooled fusion is taken up with 5 cc. sulphuric acid and 20 cc. of water and digested until only a white residue remains. This filtered off, washed and ignited = SiO₂.

Titanium Oxide. This is best determined colorometrically on a 0.1 gram sample according to the procedure outlined in the chapter on Titanium.

Iron and Alumina. These are determined by the usual procedure;—oxidation with potassium chlorate, precipitation with ammonium hydroxide and ignition. Iron may be determined in a separate sample (100 cc. = 0.5 g.) by titration. Al₂O₃ = difference between weighed oxides and Fe₂O₃, after subtracting TiO₂ if present.

VOLUMETRIC DETERMINATION OF THE AVAILABLE ALUMINA IN BAUXITE AND CLAYS¹

This method is based on the solution of the sample in a known amount of sulphuric acid, and the titration of the excess acid with standard sodium hydroxide solution, and the alumina estimated from the amount of acid used to combine with it. It has been proven with long practice that this method is accurate within 0.5%, and is very satisfactory as a works control method. It is much more rapid than the regular gravimetric procedure

Take a five gram sample that has been ground to pass through a 60-mesh sieve and put it into a 300 cc. Kjedahl flask with about 28 to 30 grams of 40° Bé sulphuric acid, which is weighed from a weighing burette. (This acid may be measured with a burette and the weight calculated if so desired with a reasonable chance of error introduced.) Digest this at a gentle boil for one hour, giving the flask an occasional shaking. Care must be taken that good condensation is effected, otherwise a loss in acid will give high results. After the digestion wash down the condenser and filter the insoluble residue off on a Bueckner funnel with suction, washing the residue acid free. Make the filtrate

¹ By Harold E. Martin.

up to 2000 cc. in a volumetric flask. To a 200-cc. aliquot add 20 cc. KF reagent, and 1 cc. phenolphthalein indicator and titrate to a permanent pink with standard N/10 NaOH.

Reagents: The 40° acid must be made up very accurately and standardized against

standard caustic.

1000 grams of potassium fluoride are dissolved in 1200 cc. of hot CO₂ free water, and then neutralized with HF or KOH as may be necessary, using phenolphthalein indicator. Filter this solution and dilute to 2000 cc. This solution should be kept in a wax-lined bottle.

Take 20 cc. of KF reagent and add 5 cc. of N/2 NaOH and one cc. of phenolphthalein indicator, and titrate with N/2 H₂SO₄. Apply this correction to the titration of the

ample.

Calculations:

$$\frac{(\text{cc. N/10 H}_2\text{SO}_4 - \text{cc. N/10 NaOH}) \times .3473 \times 100}{\text{weight of sample}} = \% \text{ Al}_2\text{O}_3 + \text{Fe}_2\text{O}_3$$

% Fe₂O₄ × .64 = Fe₂O₄ equivalent to Al₂O₄ which can be subtracted from the total oxides above, the result being the available alumina.

DETERMINATION OF ALUMINUM IN IRON AND STEEL¹

The method is especially adapted for determination of aluminum in iron and steel, but may be extended to iron ores and materials high in iron.

Procedure. Solution. Ten grams of iron or steel are dissolved by adding about 50 cc. of hot hydrochloric acid, 1:1, preferably in a platinum dish, covered

with a platinum foil.

Precipitation. When the solution of iron is complete, it is diluted to about 100 cc. and filtered free of carbon, silica, etc. Two grams of sodium phosphate are added and the solution neutralized with ammonium hydroxide or carbonate, then cleared by hydrochloric acid with about 1 cc. excess. Twenty cc. of acetic acid are now added and the solution diluted to 300 to 400 cc. with hot water and, on boiling, 10 grams of sodium thiosulphate added. The solution is boiled free of sulphurous acid, (no odor of SO₂) about 20 to 30 minutes being necessary. The phosphate is filtered off and washed with hot water. It is again dissolved in a little hydrochloric acid and aluminum reprecipitated by neutralizing with ammonium hydroxide and adding about 1 gram of sodium phosphate together with 10 grams of sodium thiosulphate, following the above procedure. The precipitate will now be free of iron.

Ignition and Calculation. The precipitate and filter are ignited wet, first over a low flame, then gradually increasing the heat to full blast of a

Meker burner. The residue contains 22.19% Al or 41.85% of Al₂O₃.

Factor AlPO₄ to Al = .2219. Factor AlPO₄ to Al₂O₃ = .4185.

Notes. Interfering substances. Copper may be removed by H₂S. Other members of this group will also be eliminated.

Manganese and nickel are eliminated together with small amounts of iron at the second precipitation.

Titanium may be estimation colorimetrically or separated from alumina.

Vanadium, if present, may be separated according to directions given in the chapter

on Vanadium.

Chromium is eliminated by fusion of the mixed phosphates with Na₂CO₃, extraction with water, and precipitation of aluminum phosphate by adding ammonium acetate and sodium phosphate. Chromium remains in solution.

¹ Arnold and Ibbotson, "Steel Works Materials." Stillman, "Engineering Chemistry." "A Rapid Method for the Determination of Aluminum in Iron and Steel," C. N., 61, 313. "On the Determination of Minute Quantities of Al in Iron and ^{^4}eel," J. E. Stead, J. S. C. I., 1889, 956.

ANALYSIS OF METALLIC ALUMINUM¹

Determination of Silicon

Acid Mixture: 400 cc. conc. nitric acid. 1200 cc. conc. hydrochloric acid. 600 cc. conc. sulphuric acid. 1800 cc. water.

Fusion Method

Dissolve 1 gram of well mixed drillings in 35 cc. of acid mixture using a 41-inch porcelain dish with a 5-inch cover glass. When the drillings are completely dissolved, evaporate the solution not only to fuming but to complete dryness, and bake. This insures the freedom of the solution from hydrochloric and nitric acids, and the complete dehydration of the silica. Take up the residue with 10 cc. 25 per cent sulphuric acid and about 100 cc. of water; bout to complete solution of the sulphate, filter, wash well and ignite. Fuse the residue with eight to ten times its weight of sodium carbonate and take up the fused mass in a porcelain dish with sulphuric acid (1:1). Evaporate the resulting solution until copious fumes are evolved, which will cause the separation of the silica; dilute carefully, boil, filter, wash well and ignite in a platinum crucible and weigh. Treat the ash with hydrofluoric acid and a few drops of sulphuric acid; carefully ignite and weigh. The difference in the two weights obtained above represents the silicon as silica.

Calculate the silica to silicon by the factor 0.4693.

Graphitic Silicon

Aluminum, sometimes if not always, contains some silicon in the graphitic state; this graphitic silicon does not oxidize to SiO₂ on ignition and is not volatile with HF, which two characteristics distinguish it from amorphous silicon.

To determine graphitic silicon the mixture of Si and SiO₂ obtained as in the solution method is treated in a weighed platinum crucible with 2-3 drops of H₂SO₄ and 2-3 cc. HF.

The brown residue of Si remaining is strongly ignited and weighed; the silicon remaining is that which was in the metal in the graphitic state.

Determination of Iron Permanganate Method

Cool the filtrate obtained from solution of the sample in acid mixture (see page 16) and reduce the iron present by passing the solution through a Jones reductor. Titrate immediately with a solution of potassium permanganate of such strength that 1 cc. equals 0.0010 gram iron.

In all cases the precautions given for use of the Jones reductor should be observed, and explicit directions given in the chapter on Iron, carefully followed. A blank determination is made by carrying out a regular iron determination with the metal sample omitted. The amount of potassium permanganate required to give the blank a distinct color is subtracted from the amount required to give the same color to each reduced solution.

The author acknowledges his indebtedness to Mr. W. S. Allen, Mr. J. P. Kelly and Dr. F. E. Hale for review and criticism of the subject.

¹Standard Method of Analysis of the Aluminum Company of America. By courtesy of Mr. E. Blough, Chief Chemist.

ANTIMONY

WILFRED W. SCOTT

Sb₁ at.wt. 120.2; sp.gr. 6.62¹; m.p. 630°C²; b.p. 1440°C¹; oxides, Sb₂O₂, Sb₂O₄, Sb₂O₅.

DETECTION

Hydrogen Sulphide precipitates the orange-colored sulphide of antimony from fairly strong hydrochloric acid solutions (1:4) in which several members of the group remain dissolved. Arsenic is also precipitated. The latter may be removed by boiling the solution containing the trichloride, AsCl₂ being volatile.

If antimony is already present as a sulphide, together with other elements of the hydrogen sulphide group, it may be dissolved out by treating the precipitate with sodium hydroxide, potassium hydroxide, sodium sulphide, ammonium polysulphide in solution. Antimony sulphide is reprecipitated upon acidifying the filtrate. Arsenic and tin will also be precipitated with antimony if they are present in the original precipitate. Should a separation be necessary, the precipitate is dissolved with hot concentrated hydrochloric acid, with the addition of crystals of potassium chlorate, from time to time, until the sulphides dissolve. The solution is placed in a Marsh apparatus, pure zinc added and the evolved gases passed into a neutral solution of silver nitrate. The black precipitate of silver antimonide and metallic silver are filtered off, washed free of arsenous acid, and the antimonide dissolved in strong hydrochloric acid (silver remains insoluble). The orange-colored antimony sulphide may now be precipitated by diluting the solution with water and passing in H₂S gas to saturation.

Minerals which contain antimony, when heated alone or with 3 to 4 parts of fusion mixture (K₂CO₂ and Na₂CO₂), on charcoal, yield dense white fumes, a portion of the oxide remaining as a white incrustation on the charcoal. A drop of ammonium sulphide placed upon this sublimate gives a deep orange stain.

Hydrolysis. Most of the inorganic antimony salts are decomposed by water, forming insoluble basic salts, which in turn break down to the oxide of antimony and free acid. An excess of tartaric acid prevents this precipitation.

Traces of Antimony. Nascent hydrogen liberated by the action of sinc and hydrochloric or sulphuric acid reacts upon antimony compounds with the formation of stibine. This gas produces a black stain on mercuric chloride or silver nitrate paper. Details of the procedure are given under the quantitative method for determining minute amounts of antimony.

Distinction between Antimonous and Antimonic Salts.

Chromates form with antimonous salts green chromic salts and antimonic salts.

Potassium Iodide reduces antimonic salts, free iodine being liberated.

¹ Van Nostrand's Chem. Annual, Olsen, 3d Ed.

² Cir. 35, U. S. Bureau of Standards.

ESTIMATION

The determination of antimony is required in the evaluation of antimony ores—stibnite, Sb₂S₃; valentinite, Sb₂O₃, etc. It is generally required in the complete analysis of minerals of nickel, lead, copper, silver, in which antimony generally occurs as a sulphide. The determination is required in the analysis of Britannia metal, bearing and antifriction metals, type metal and hard lead; in the analysis of certain mordants, antimony salts, vulcanized rubber, etc. It is looked for as an undesirable impurity in certain food products.

Preparation and Solution of the Sample

In dissolving the substance containing antimony it must be remembered that metallic antimony is practically insoluble in cold dilute hydrochloric, nitric or sulphuric acid and the oxides, Sb₂O₃ or Sb₂O₅, are precipitated in strong nitric acid. The element, however, is readily soluble in hydrochloric acid containing an oxidizing agent, such as nitric acid, potassium chlorate, chlorine, bromine, etc. The oxides of antimony are soluble in hydrochloric acid and the caustic alkalies.

Solution of Sulphide Ores, Low-grade Oxides, etc.1

0.5 to 1 gram of the finely ground ore, placed in a Kjeldahl flask, is mixed with 5 to 7 grams of granular or powdered potassium sulphate, and 10 cc. of strong sulphuric acid. About 0.5 gram of tartaric acid, or a piece of filter paper, is added to reduce arsenic and antimony and the mixture heated, gradually at first, and then with the full Bunsen flame. The heating is continued until the carbon is completely oxidized and most of the free acid driven off, leaving a clean fusion but not to complete expulsion of H₂SO₄. The melt is now cooled over the bottom and sides of the flask by gently rotating during the cooling.

About 50 cc. of dilute hydrochloric acid (1:1) are added and the melt dissolved by warming gently. The contents of the Kjeldahl flask are transferred to an Erlenmeyer flask, the Kjeldahl being rinsed out with 25 cc. of strong hydrochloric acid. Arsenic sulphide may now be precipitated with H₂S from the strongly acid solution, whereas antimony, etc., remain in solution. The sulphide is filtered off through a double filter, that has been moistened with hydrochloric acid (2:1), a platinum cone supporting the filter to prevent its breaking. The flask is rinsed out with hydrochloric acid (2:1). The precipitate is washed at least six times with the acid. Antimony passes into the filtrate together with other elements of the ore.

The filtrate is diluted with double its volume of warm water and then is saturated with hydrogen sulphide. Antimony sulphide, together with other elements of the Hydrogen Sulphide Group, will precipitate. These are washed with hydrogen sulphide water. Antimony sulphide may now be dissolved by addition of sodium sulphide and caustic solution (separation from Cu, Pb, Cd, Bi, etc.) (5 to 10 cc. of a mix of 60 grams Na₂S with 40 grams of NaOH diluted to 1000 cc.).

¹ Method of A. H. Low modified.

The solution containing the antimony is treated with about 2 grams of potassium sulphate and 10 cc. of strong sulphuric acid and heated as before, to destroy liberated sulphur and expel most of the free acid. The melt is dissolved in hydrochloric acid, and the antimony titrated according to one of the volumetric procedures given under "Volumetric Methods."

Note. An insoluble residue remaining from the acid extraction of the first melt may be dissolved by fusion with sodium hydroxide and extraction of the melt with hot water. If a precipitate forms when this alkaline solution is acidified with hydrochloric acid, the presence of barium sulphate is indicated.

Decomposition of the Ores by Fusion with Sodium Hydroxide.

Oxides. 0.5 to 1 gram of the powdered ore is mixed with about 10 grams of sodium hydroxide and placed in a thin-walled iron crucible of 60 cc. capacity. It is advisable to fuse a portion of the alkali hydroxide in the crucible with a pinch of potassium nitrate and then add the ore mixed with the remainder of the sodium hydroxide. The covered crucible is heated until the fusion becomes homogeneous. The melt is poured out on a large nickel crucible cover or shallow dish. On cooling, the cake is detached and placed in a casserole containing water, any adhering cake on the cover, or melt remaining in the iron crucible, being dissolved with dilute hydrochloric acid and added to the sample in the casserole. About 30 to 40 cc. of strong hydrochloric acid are now added and the mixture heated (casserole covered) until the melt has dissolved. Two to 3 grams of tartaric acid having been added to keep antimony dissolved, the solution is diluted to about 300 cc., and antimony is then precipitated as the sulphide with hydrogen sulphide. The treatment of the precipitate at this stage has been given in the "Solution of Sulphide Ores."

Sulphides. Howard and Harrison ¹ recommend the following procedure for fusion of sulphide ores with caustic: 0.5 gram of the powdered ore is fused with a mixture of 8 grams of sodium carbonate and sodium peroxide, 1:1, in a nickel crucible. The cooled melt is dissolved with sufficient hydrochloric acid to neutralize the alkali and about 15 cc. of strong acid added in excess. The solution is diluted to 250 cc., antimony being kept in solution by addition of potassium chlorate. An aliquot portion of the solution is taken, antimony reduced by metabisulphite and titrated with iodine.

Treatment of Speisses, Slags, Mattes, etc.² 0.5 to 2 grams of the sample is treated with 10 to 15 cc. of strong nitric acid and the mixture taken to dryness. Fifteen cc. of strong hydrochloric acid are added and the sample transferred to a 350-cc. flask, additional hydrochloric acid being used to wash out the beaker. Arsenic is precipitated from the strong acid solution as the sulphide, and antimony determined in the filtrate.

Solution of Alloys. Alloys are generally decomposed by treatment with mixtures of hydrochloric acid together with an oxidizing agent—nitric acid, potassium chlorate, bromine, etc. The subject is taken up in detail in the chapter on alloys.

The alloy drillings are treated with strong hydrochloric acid, a little bromine added, and the mixture heated until the alloy dissolves, additional bromine being added from time to time if necessary. The excess bromine is removed by heating gently to boiling. The higher oxides are reduced by addition of

¹ Phar. Jour., 1909, 83, 147. ² H. E. Hooper's method.

sodium metabisulphite and the sulphides precipitated, as usual, with hydrogen sulphide. Arsenic may now be volatilized by boiling, and antimony titrated with iodine or potassium bromate.

Alloys of Antimony, Lead and Tin. 0.5 to 1 gram of the finely divided alloy is warmed with 100 cc. of strong hydrochloric acid until the action subsides. Solid iodine is now added, in small quantities at a time, until the alloy completely dissolves. The excess of iodine is now removed by boiling and the small amount of free iodine remaining neutralized with a few drops of a weak solution of sodium thiosulphate. Although tin is oxidized to the higher state, antimony is not oxidized by iodine in acid solution beyond the trivalent form. The solution may now be titrated with standard iodine in presence of an excess of sodium bicarbonate according to the procedure given under the volumetric methods.

Hard Lead. The method of solution and titration are given under "Potassium Bromate Method for Determining Antimony."

Antimony in Rubber Goods. Three grams of the finely rasped rubber are treated in a Kjeldahl flask with 40 to 45 cc. of strong sulphuric acid. A small quantity of mercury or mercury salt is added, together with a small piece of paraffine wax. The mixture is heated until the rubber is dissolved and the black liquid begins to clear. Two to 4 grams of potassium sulphate are then added and the heating continued until a colorless or pale yellow liquid is obtained. After cooling, 1 to 2 grams of potassium metabisulphite are added and an excess of tartaric acid. The liquid is diluted sufficiently to prevent the charring of the tartaric acid and boiled until the odor of sulphurous acid has disappeared. A few cc. of dilute hydrochloric acid are added, the liquid diluted to 200 cc., filtered through a dry filter, and 195 cc. titrated either with iodine or with potassium bromate (the latter in acid solution), as described under the volumetric procedures.

SEPARATIONS

Separation of Antimony (together with Members of the Hydrogen Sulphide Group), from Iron, Chromium, Aluminum, Cobalt, Nickel, Manganese, Zinc, the Alkaline Earths, and Alkalies. The acid solution of the elements is saturated with hydrogen sulphide, the elements of the Hydrogen Sulphide Group are precipitated as sulphides, the other elements remaining in solution. Antimony sulphide may be precipitated from an hydrochloric acid solution containing 15 cc. of strong acid per 100 cc. of solution; lead and cadmium are incompletely precipitated.

Separation of Antimony (together with Arsenic and Tin), from Mercury, Copper, Bismuth, Cadmium and Lead. The sulphides of antimony, arsenic, and tin are soluble in a mixture of sodium hydroxide and sodium sulphide, the soluble sulpho salts being formed, mercury, copper, bismuth, cadmium, and lead remaining as insoluble sulphides. The following procedure may be used for alloys free from members of other groups. The acid solution is treated with 3 to 5 grams of tartaric acid and diluted slightly (more tartaric acid being added if the solution becomes turbid), then poured into 300 cc. of a mixture of sodium sulphide and sodium hydroxide (150 cc. of the mix described under

¹ W. Schmitz, Chem. Zentralbl., 1911, ii, 1710. Analyst, 1912, p. 64.

"Solution of Sulphide Ores" diluted to 300 cc.). The mixture is warmed and the insoluble sulphides allowed to settle out. The solution is filtered free of the precipitate and the latter washed. The filtrate is acidified with hydrochloric or sulphuric acid and saturated with hydrogen sulphide. The sulphides of arsenic, antimony and tin are now filtered off and treated as described later.

Separation of Arsenic, Antimony, and Tin. The sulphides may be dissolved in concentrated hydrochloric acid by addition of potassium chlorate to oxidize the sulphur to sulphuric acid. This oxidation may be effected in the alkaline solution of the sulpho salts by addition of 30% hydrogen peroxide in small portions until the yellow solution is completely decolorized and then 1 to 2 cc. in excess, the solution then boiled to completely oxidize the sulphides to sulphates and to remove the excess of peroxide. The solution is then acidified, the precipitation of the sulphides and the subsequent filtration and resolution being avoided.

Removal of Arsenic. This may be accomplished by volatilizing arsenic as arsenic trichloride in a strong hydrochloric solution by boiling. If arsenic is to be determined the procedure given under the chapter on arsenic is followed, the arsenic being distilled in a current of hydrochloric acid gas. If arsenic is not desired it may be expelled by reducing the solution with sodium metabisulphite or potassium iodide and boiling. Antimony and tin remain in the concentrated acid solution.

The separation of arsenic from antimony and tin may be effected by removal of the former in a strong hydrochloric acid solution as described under the section "Preparation and Solution of the Sample," arsenic being precipitated by hydrogen sulphide, whereas antimony and tin remain in solution.

Separation of Antimony from Tin. Upon the removal of arsenic, antimony may be determined directly in the presence of tin by one of the volumetric methods given later. If a gravimetric separation is desired, it may be made according to a modification of Clark's method, which depends upon the fact that antimony is completely precipitated from a solution containing oxalic acid, by hydrogen sulphide, whereas tin is not. The tin must be in the stannic form, otherwise the insoluble crystalline stannous oxalate will form.

If the mixture is acid, it is neutralized with caustic and twenty times the weight of the Sn and Sb present added in excess, e.g., 2 grams potassium hydroxide in excess for every 0.1 gram of tin and antimony present in the solution. About ten times as much of tartaric acid is now added as the maximum weight of the two metals, followed by 30% hydrogen peroxide to oxidize the tin. The excess of peroxide is removed by boiling. To the slightly cooled solution a hot solution of pure oxalic acid is added, 5 grams of oxalic acid for each 0.1 gram of the mixed elements. CO₂+O₃ are evolved. The solution is boiled for about ten minutes and the volume made up to about 100 cc.. Hydrogen sulphide is rapidly passed into the boiling solution until a change from a white turbidity to an orange color takes place and antimony begins to precipitate. The passage of the gas is continued for fifteen minutes, the solution diluted with hot water to a volume of 250 cc. and hydrogen sulphide passed into the boiling solution for another fifteen minutes. The flame is now removed and the H₂S "gasing" continued for ten minutes longer. The precipitated antimony pentasulphide is filtered off in a weighed Gooch crucible.

¹ The Original procedure may be found in Chem. News, Vol. XXI, p. 124.

It may be determined gravimetrically as Sb₂S₁, according to the procedure given later, by washing with 1% oxalic acid and dilute acetic acid, by decantation, the solutions being hot and saturated with hydrogen sulphide. The precipitate washed into the crucible is dried in a current of CO₂ at a heat of 280 to 300° and weighed as Sb₂S₂.

Tin may be determined electrolytically in the filtrate evaporated to about 150 cc., the oxalic acid being nearly neutralized with ammonia. See Electrolytic Determination of Tin.

Antimony may be separated from tin in a hot hydrochloric acid solution by addition of pure iron. The iron and tin sulphides are dissolved in concentrated hydrochloric acid plus a few crystals of potassium chlorate. The solution should contain about 10% hydrochloric acid, more hydrochloric acid being added as the iron dissolves. Antimony is precipitated as a metal.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF ANTIMONY

The accuracy and rapidity of volumetric methods for the determination of antimony leave little to be desired in the estimation of this element, so that the more tedious gravimetric methods are less frequently used. The following procedures are given in view of possible utility in certain analyses.

Determination of Antimony as the Trisulphide, Sb₂S₃ ¹

Although hydrogen sulphide passed into a cold solution tends to precipitate Sb₂S₃, in hot strongly acid solutions, the lower sulphide, Sb₂S₃, tends to form. The higher sulphide is decomposed at 230° C. with formation of Sb₂S₃ and the volatilization of sulphur. A temperature of 280 to 300° is even more favorable for this transformation. The method takes advantage of these conditions for formation of antimony trisulphide, in which form it is weighed.

Procedure. The solution of antimony, free from arsenic, is treated in an Erlenmeyer flask with strong hydrochloric acid until the solution contains about 20% of the concentrated acid. The mixture is heated to boiling and a slow current of hydrogen sulphide is passed into the hot solution until the precipitate passes from a yellow color through an orange and finally becomes a dark red to black color. The flask is agitated gently to coagulate the precipitate, which settles in a crystalline form. The solution is diluted with an equal volume of water, washing down the walls of the flask. A slight turbidity is generally seen, due to precipitation of a small amount of antimony that remains in solution in a strong acid solution. H₂S is now passed into the diluted solution until it becomes clear, thirty-five to forty minutes are usually sufficient to precipitate all of the antimony. The precipitate is transferred to a weighed Gooch crucible, washed with small portions of water containing hydrogen sulphide, and finally with pure water.

It is a common practice, at this juncture, to wash the precipitate with carbon disulphide or carbon tetrachloride to remove precipitated sulphur. Alcohol is now used, followed by ether, and the precipitate sucked dry.

Method of Vortmann and Metzel modified.
 Paul, Z. anal. Chem. \$1, 540 (1892).

The Gooch crucible is placed in a large combustion tube and heated in a current of dry, pure CO_2 at 130° C. for an hour. The temperature is now raised to 280 to 300° C. and the heating continued for two hours. The residue will consist of pure Sb_2S_4 .

 $Sb_2S_3 \times 0.7142 = Sb$, or $Sb_2S_3 \times 0.8568 = Sb_2O_3$.

Notes. Antimony may be determined by oxidation of the sulphide precipitate by means of fuming nitric acid. The mixture evaporated to dryness is ignited and the residue weighed as Sb₂O₄. The temperature of the ignition should be between 750 to 800° C. The volatile trioxide forms at a little above 950°. The procedure requires greater care than the sulphide method and possesses no advantages.

Pure carbon dioxide may be obtained from limestone placed in a Kipp generator. The gas is dried by passing it through strong sulphuric acid. It should be free from oxygen of the air. It is advisable to sweep out the air from the generator before attaching it to the combustion train. The air in the tube is swept out with carbon

dioxide before heating the sample.

Property of Sb₂S₃, m.w., 336.61; sp.gr., 4.65; fusible and volatile; solubility, 0.000175 gram per 100 cc. H₂O; decomposed by hot H₂O; soluble in alkalies, NH₄HS, K₂S, conc. HCl.

Electrolytic Determination of Antimony 1

The chief condition for the success of the electrolytic deposition of antimony in metallic form is the absence of polysulphides, since these substances prevent the element from being deposited, $2Sb+3Na_2S_2=2Na_2SbS_2$. The formation of polysulphides may be prevented during electrolysis by addition of potassium cyanide to the solution, $^2Na_2S_2+KCN=Na_2S+KCNS$.

The results of this method, according to F. Henz,³ are invariably 1.5 to 2% too high of the total antimony present in the solution. Treadwell and Hall recommend subtraction of a constant factor of 1.6% of the weight of the antimony deposited. The sample for analysis should contain not over 0.2 gram antimony.

Procedure. Antimony precipitated as the sulphide is washed and then dissolved off the filter by pouring pure sodium sulphide solution (sp.gr. 1.14) over the precipitate, the solution being caught in a weighed platinum dish, with unpolished inner surface. The total volume of the solution should be not over 80 cc. (if less than this, additional Na₂S solution is added to make up to 80 cc.). Sixty cc. of water followed by 2 to 3 grams of potassium cyanide (C.P.) are added and the cyanide dissolved by stirring with the rotating anode. The solution heated to 60 to 70° is electrolyzed with a current of 1 to 1.5 amperes, E.M.F. = 2 to 3 volts. Two hours are generally sufficient to deposit all the antimony. The light-gray deposit adheres firmly upon the cathode. Without breaking the current the solution is siphoned off, while fresh water is being added, until the current ceases to flow through the liquid. The cathode is washed thoroughly with water, followed by alcohol and ether and then dried at about 80°, cooled in a desiccator and weighed.

The antimony deposits may be removed by heating with a solution of alkali

¹Method first proposed by Parrodi and Mascazzini, Z. anal. Chem., 18, 587 (1879), modified by Luckow, Z. anal. Chem., 19, 13 (1880), and later improved by Classen and Reiss, Berichte, 14, 1629 (1881); 17, 2474 (1884); 18, 408 (1885); 27, 2074 (1894). ²Treadwell and Hall, Analytical Chemistry. ³Z. anorg. Chem., 37, 31 (1903).

polysulphide or by a mixture of equal parts of saturated solution of tartaric acid and nitric acid.

VOLUMETRIC METHODS

Potassium Bromate Method for Determining Antimony¹

Outline. This method is of special value in determining antimony in hard lead and alloys. It was first suggested by Györy and later modified by Siedler, Nissensen and Rowell.² The process is based upon the oxidation of antimony from the trivalent to the pentavalent form by potassium bromate, the following reaction taking place:

 $KBrO_3+3SbCl_3+6HCl=3SbCl_5+KBr+3H_2O$.

Standard Solutions.

Antimony Chloride Solution. Six grams of the C. P. pulverized metal are dissolved in 500 cc. of concentrated hydrochloric acid together with 100 cc. saturated bromine solution, more acid and bromine added if necessary to effect solution. After expelling the bromine by boiling, about 200 cc. concentrated hydrochloric acid are added and the whole made up to one liter. Fifty cc. =0.3 gram antimony.

N/10 Potassium Bromate Solution. 2.82 grams of C. P. salt are dissolved in water and made up to 1 liter. Theoretically 2.7852 grams are required, but the salt invariably contains potassium bromide as an impurity. The solution is standardized against 50 cc. of the antimony chloride solution, which has been reduced with sodium sulphite according to the standard scheme. One cc. of N/10 KBrO₂=0.006 gram Sb.

Methyl Orange. 0.1 gram M. O. per 100 cc. of distilled water. The indicator should be free from sediment.

Saturated Bromine Solution. 500 cc. concentrated hydrochloric acid saturated with 70 cc. of bromine.

Procedure. Solution. One gram of the finely divided alloy is brushed into a 500-cc. beaker, 100 cc. of concentrated hydrochloric acid and 20 cc. of saturated bromine solution are added. The beaker is covered and placed on the steam bath until the metal dissolves. It may be necessary to add more bromine and acid to effect complete solution. In case the oxides of antimony and tin separate out and do not redissolve, fusion with sodium hydroxide may be necessary. Bromine is now expelled by boiling the solution down to about 40 cc.

Reduction. One hundred cc. of concentrated hydrochloric acid and 10 cc. of a fresh saturated solution of Na₂SO₃ are added and the solution boiled down to 40 cc., on a sand bath, to expel arsenic and the excess of normal sodium sulphite. Samples high in arsenic may require a repetition of the reduction.

Titration. The cover and sides of the beaker are rinsed down with 20 cc. of hydrochloric acid (sp.gr. 1.2) followed by a few cc. of hot water and the solution heated to boiling on a sand bath. The standard bromate solution is now run into the hot solution of antimony to within 2 to 3 cc. of the end-

² H. W. Rowell, Jour. Soc. Chem. Ind., XXV, 1181.

¹S. Gyōry, Zeit. Anal. Chem., **32**, 415 (1893). J. B. Duncan, Chem. News, **95**, **49** (1907).

point, this having been determined in a preliminary run with methyl orange added in the beginning, 4 drops of methyl orange are added and the titration completed cautiously until the color of the indicator is destroyed. or copper is present the final product will appear yellow. Since the end-reaction is slow the last portion of the reagent should be added drop by drop with constant stirring.

1 cc. $N/10 \text{ KBrO}_3 = 0.006 \text{ gram Sb.}$

Since antimony chloride begins to volatilize at 195° C, and boils at 220° C.

it is advisable not to carry the concentration too far while expelling arsenic. Lead, copper, zinc, tin, silver, chromium, and sulphuric acid have no effect upon the determination, but large quantities of calcium, magnesium, and ammonium salts tend to make the results high. Low found that copper produced high results, approximately .012% too high for every 0.1% of copper present. The author (W.W.S.) finds, however, that with the procedure given above, amounts of copper as high as 15% produced no difficulty beyond a yellow coloration of the solution. With larger mounts of copper the end-point became difficult to detect owing to the depth of amounts of copper, the end-point became difficult to detect owing to the depth of this yellow color, so that in case of brass and copper alloys, the method must be modified by a procedure for removal of the copper. Lead up to 95% caused no Iron, in amounts such as are commonly met in alloys of lead, does not interfere.

During the course of analysis antimony may be isolated as the sulphide; this is dissolved in strong hydrochloric acid, and reduced and concentrated to expel arsenic that may be present as a contamination, and the resulting solution titrated with potassium bromate as directed above.

Sources of Error. (a) Imperfect volatilization of arsenic. (b) Incomplete expul-

(c) Over-titration if insufficient hydrochloric acid is present.

No loss of antimony occurs at temperatures below 120° C.

Potassium Iodide Method for Determining Antimony

Procedure. To 1 gram of fine sawings or filings in a 16-oz. Erlenmeyer flask add 60 cc. of concentrated hydrochloric acid and heat on an asbestos board or on the water bath just below boiling. When hydrogen is no longer evolved. decant the liquor and wash twice with concentrated hydrochloric acid, retaining the antimony in the flask. Now dissolve the antimony by adding 15 cc. of concentrated hydrochloric acid and solid potassium chlorate, a few crystals at a time, until the antimony is in solution, the liquid being kept hot. Expel chlorine by boiling, add 50 cc. of concentrated hydrochloric acid and again bring to boiling. 'Cool and add 20 cc. of 20% potassium iodide solution and 1 cc. of carbon disulphide or tetrachloride. Titrate the liberated iodine with tenth-normal sodium thiosulphate. The brown color will gradually disappear from the solution and the last traces of free iodine will be collected in carbon disulphide or carbon tetrachloride, giving a pink color. When this pink color disappears the end-point has been reached.

One cc. $N/10 \text{ Na}_2S_2O_3 = .006 \text{ gram of Sb.}$

Na₂S₂O₃ is standardized against .3 gram antimony as in case of Potassium Bromate Method, the above procedure, however, being followed. Antimony must be free from copper and arsenic.

Notes. The following reversible reaction is of interest: "R" representing a trivalent metal with oxidation to pentavalent form.

$$R_2O_3 + 2I_2 + 2H_2O = R_2O_5 + 4HI$$
.

The reaction goes to the right when an alkali is present to neutralize the free acid formed; e.g., Mohr's process for determining arsenic by titration of the lower ¹ A. H. Low, "Technical Methods of Ore Analysis."

oxide with iodine in presence of sodium bicarbonate. The reaction goes to the left in presence of strong acid; e.g., Weller's process for the determination of antimony

in an acid solution.

The solution should not contain more than $\frac{1}{2}$ of its volume of hydrochloric acid (sp.gr. 1.16), since too much hydrochloric acid gives high results, owing to the action of hydrochloric acid on potassium iodide. Too little acid leads to the separation of basic iodides and chlorides of antimony. The solution is best boiled down to 20% hydrochloric acid (above strength).

Stannous chloride may be used in place of thio-sulphate in titration of iodine.

 $SbCl_4+2KI=SbCl_3+2KCl+I_2$ and $I_2+SnCl_2+2HCl=SnCl_4+2HI$.

Determination of Antimony by Oxidation with Iodine

The procedure originated by Mohr and modified by Clark, depends upon the reaction Sb₂O₂+2I₂+2H₂O=Sb₂O₅+4HI.

The reaction takes place when iodine is added to a solution of antimonous salt in presence of an excess of alkali bicarbonate. In an acid solution oxidation with iodine does not go beyond Sb₂O₃.

Procedure: Solution. The sample is brought into solution by one of the procedures given under "Preparation and Solution of the Sample." Alloys of antimony, lead, and tin are treated according to directions given for this combination.

Titration. To the hydrochloric acid solution of antimony is added tartaric acid or Rochelle salts, the excess of the acid neutralized with sodium carbonate, the solution made barely acid with hydrochloric acid and a saturated solution of sodium bicarbonate added in the proportion of 10 cc. bicarbonate solution for each 0.1 gram of Sb₂O₂. Starch is added as an indicator and the solution titrated with N/10 iodine.

1 cc. N/10 iodine = 0.006 gram Sb.

NOTE. The titration should be made immediately upon addition of the sodium salts.

Antimony in Solder Metal and Alloys with Tin and Lead 1

Procedure. Dissolve 2 grams of the sample of alloy in concentrated hydrochloric scid. When the metal is all in solution, add crystals of iodine until the solution is thoroughly permeated. The color at this point should be a deep purple. Boil until all of the iodine fumes have been driven out. The metallic antimony which did not go into solution in the hydrochloric acid should now be all dissolved. If it is not, add more iodine until the solution is complete. When all is in solution and the color changes to a straw yellow, cool, add a few cc. of starch solution. If a blue color appears, due to an excess of iodine, run in N/10 sodium thiosulphate solution until colorless. In case there is no blue color developed, add N/10 iodine until a faint blue appears. Now add 50 cc. of a saturated solution of Rochelle salts. Make alkaline to litmus by adding 25% sodium hydrate solution. Then make slightly acid with HCl and finally alkaline with sodium bicarbonate. Cool and titrate with N/10 iodine.

NOTE. "The method gives very good results. I have checked it up when there was one-tenth of a gram known antimony present and the results were within a reasonable limit of accuracy." ¹

¹ Method communicated to author by Mr. B. S. Clark.

Other Procedures

Permanganate Method

Antimonous salts may be titrated with standard potassium permanganate. The iron value for the permanganate multiplied by 1.075 or the oxalic acid (C₂H₂O₄·2H₂O) value multiplied by 0.9532, will give the antimony value.¹

Indirect Evolution Method

The method depends upon the evolution of H₂S from the sulphides of antimony decomposed by strong hydrochloric acid, the amount of hydrogen sulphide being the same for either Sb₂S₂ or Sb₂S₅, the following reactions taking place:

- 1. $Sb_2S_3 + 6HCl = 2SbCl_3 + 3H_2S$.
- 2. $Sb_2S_5+6HCl = 2SbCl_3+S_2+3H_2S$.

The details of the method are practically the same as determination of sulphur by the evolution method in the analysis of iron and steel. See Chapter on Sulphur. The antimony sulphide precipitate is placed in the evolution flask, strong hydrochloric acid added with an equal volume of water and the evolved hydrogen sulphide absorbed in an ammoniacal solution of cadmium chloride. The precipitated cadmium sulphide is then titrated with iodine in an acid solution.

One cc. N/10 I = 0.001604 gram S, since 3S = 2Sb, therefore $Sb = S \times 2.499$, hence, 1 cc. N/10 I = 0.00401 gram Sb.

Preparation of Standard Iodine Solution. An approximate tenth normal solution is made by dissolving 12.7 grams of commercial iodine, roughly weighed on a watch-glass, in 200 cc. of water containing about 25 grams of potassium iodide, solution being effected in a graduated liter flask. After making up to 1000 cc. with distilled water, the reagent is transferred to a dark-colored bottle, to protect it from light. It is advisable to make up 5 to 10 liters at a time for laboratories where the solution is in constant demand. After standing several hours, the reagent is standardized by running a portion from a burette into 100 cc. of tenth normal arsenous acid (see page 240) until a faint yellow color is perceptible. In presence of starch indicator a faint blue color is obtained.

100 divided by the cc. of iodine required gives the factor for a N/10 solution. **Example.** If 98.5 cc. of iodine are required, $100 \div 98.5 = 1.0152$ N/10 or .10152 normal.

Tenth normal arsenous acid solution contains 4.953 grams of As₂O₃, per liter, dissolved in sodium hydroxide and made up according to directions given on page 204. The oxide is seldom pure, so that allowance must be made for impurities. For example, the acid containing 99.56 per cent As₂O₃ would require 4.953 ÷ .9956 = 4.97 grams per liter of solution.

Commercial iodine may contain chlorine, bromine, cyanogen and water. It may be purified by repeated sublimation ("Analytical Chemistry," Treadwell and Hall, IV Ed. page 646, or "A Treatise on Quantitative Inorganic Analysis" (1913), by J. W. Mellor, page 288). There is no advantage in taking the theoretical amount of purified iodine, however, since the reagent changes in strength on standing.

Potassium iodide augments solution of iodine, which is sparingly soluble in water. The iodine may be standardized by titrating a definite volume with N/10 sodium thiosulphate. See page 240.

¹ Technical Methods of Ore Analysis, by A. H. Low.

Determination of Small Amounts of Antimony

Details of this procedure were worked out by Mr. W. Shelton, under the direction of Mr. W. C. Ferguson, chief chemist, and Mr. E. Fitzpatrick, first assistant chemist, Nichols Copper Company. The method is accurate and is of special value in determining traces of antimony in copper and in alloys. Since arsenic may also be determined a separation by distillation is necessary if the latter is present. (See pages 32, 37.)

Description of Generator

The generator consists of three separate parts:

1. Glass cap which is placed over funnel A, to hold the disc of test paper in place.

2. F-G, this part of the apparatus has two small parts: F, which is a tube of glass $\frac{1}{16}$ " long, $\frac{1}{16}$ " wide, fitted into a rubber tube G, $\frac{1}{16}$ " wide which in turn is fitted into the lower part of funnel A. The part F is a very important one and care should be taken to have exactly the same size glass tubing and that distance from the top of F is F." of F is $\frac{1}{16}$ ".

The entire apparatus consists of parts, A, B, C, D, E, F, G.

A. The funnel for test paper.

A. The funnel for test paper.

B. Bulb for holding cotton saturated with lead acetate to absorb any H₂S gas should any be present when generator is operating. Use 0.5 gms. of cotton.

C. This part extends to E, which has two purposes: No. 1. For introducing acid, H₂O, the test, etc., without opening the apparatus. No. 2. As a safety valve, should the apparatus become alarged or storped up the pressure will ever titself in this direction. the apparatus become clogged or stopped up the pressure will exert itself in this direction.

D. Upper part acts as condenser. The lower part is ground to fit the bottle No. 3.

E. This part is explained in C.
3. This part is the bottle which has 250 cc. capacity with a ground mouth to receive the No. 2 part of generator.

Note: All generators must be made and assembled as nearly uniform as possible

to assure concordant results.

4. This figure shows the manner in which the test is placed on funnel A, Fig. 2, and how the cap, Fig. 1, fits over and holds the test paper in position.

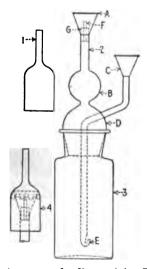


Fig. 1a. Fitzpatrick Apparatus for Determining Traces of Antimony.

Chemicals and Solutions

All chemicals and solutions must be previously tested for arsenic and antimony before using.

HCI—C.P. Conc. redistilled, As and Sb free. HNO₁—C.P. Conc. NH₂OH—C.P. Conc.

Fe₂(NO₂)₃—5 lbs. to 9 liters, about 3% solution. KClO₃—use dry crystals.

FeCl₂—2 lbs. to 2 liters. ZnCl₂—20 lbs. to 9 liters HCl (purified by dissolving 15 gms. zinc in 500 cc. of the above

stock solution).

Zinc Shot-Wash in dilute HCl before using.

5% HgCl₂ used for test paper. 5 gr. to 100 cc. H₂O. (Cut with die into circles of 1 ⁸/₄".

in diameter.)

10% Pb. (C₁H₁O₂); for cotton. 10 grs. to 100 cc. H₂O. 5% NH₄OH; for developer of test paper, 200 cc. NH₄OH per liter. 1% AuCl₂ solution.

Preparation of Test Paper. The paper used must be selected, when purchased, for

evenness of thickness and texture in sheets of 24" x 40".

The above sheets are cut in half and saturated with a 5% HgCl₂ solution—the wet sheet is then placed on a glass plate and the surplus solution is squeezed out with a 10" rubber roller, which is rolled over the paper twice. Care must be exercised to roll the paper evenly and with good pressure using the same conditions for each sheet. The sheet is now hung over a line to dry, in a warm place away from the sunlight or any influence of hydrogen sulphide. Do not dry paper in oven. When dry the paper is cut with die into pieces of 1\{\frac{1}{2}\}'' in diameter. Keep the discs of test paper in a darkbrown bottle and away from the light until used.

Enough test paper should be made at one time to last for about 3 months. Each new lot made should be tested with known amounts of As and Sb and compared with standards, before using. Should they not check close it is advisable to make

new set of standards from the test paper just made.

Preparation of Lead Acetate Cotton. A roll of absorbent cotton is opened and saturated with a 10% solution of lead acetate and surplus drained off, then hung on a line to dry in a warm place away from the influence of hydrogen sulphide. Do not dry in oven. When dry, place in stoppered bottle until used.

Precautions

Blank. A blank test should be run with each day's work, using all the reagents used in actual tests.

The stain obtained on test paper from blank is subtracted from the actual test. Limits. The limits of As or Sb that can be determined by this method must be within the following figures:

> As separately from .00002 grs. to .00010 grs. Sb separately from .00002 grs. to .00015 grs.

Checks. A 10 grs. sample of standard copper known to be free from As or Sb is weighed out and known amounts of As and Sb are introduced.

Distillation. The distilling apparatus should not be used for any other tests when

the As or Sb is known to be higher than the limits for this work.

Zinc. The zinc shot must be cleaned with dilute HCl and washed with distilled water each day to insure proper action in generator, and to expel any sulphide present which would spoil the test

Generator. The presence of nitrates, chlorates, or compounds of copper interfere with generation of arsine and stibine, so care must be exercised to have these compounds

climinated.

Large quantities of ferrous and ferric compounds interfere also in the generation tibine to some degree. The small amount of Fe that gets into the test from the of stibine to some degree. process of distillation is overcome by the addition of 2 cc. stannous chloride—at times more may be required.

Uniformity. Uniformity must be strictly adhered to throughout the test.

In the determination of antimony in presence of arsenic the removal of the latter is necessary. This is accomplished by distillation of AsCl, according to the procedure outlined on page s 32, 37.

Standard Antimony Solution and Standard Stains

Antimony Solution. A stock solution is made up by weighing out 0.553 gms. $KSbO_1C_4H_4O_6$ which is dissolved in distilled water and made up to 2000 cc. which represents 1 cc. = .0001 g. Sb.

From the above stock solution take 100 cc. and make up to 1000 cc. this solution now equals 1 cc. = .00001 g. Sb, which is used for making the standard stains and introducing into checks.

Outline of the Method

Preparation of Standard Stains. Extreme care must be taken when preparing the standard stains.

Wash the generator thoroughly with distilled water, place freshly prepared lead acetate cotton in the bulb, B, No. 2, and see that the top of part F, No. 2, is exactly $\frac{1}{18}$ " from the top of part A, No. 2.

Now introduce into bottle of generator, No. 3, the required amount of As or Sb as desired and then add 50 cc. redistilled HCl, As free, 2 cc. stannous chloride solution and make up to 220 cc. with distilled water.

The disc of mercuric chloride test paper is now placed on top of funnel A, No. 2, and the glass cap, No. 1, is forced over the paper holding it in place.

Now introduce 15 gms. metallic zinc shot and place the No. 2 section with No. 1 attached into the No. 3 or bottle of generator. The apparatus now being assembled, observe that the apparatus is fitted together tightly, because as soon as the zinc is introduced, Arsine and Stibine is generated immediately. Place the generator into the water bath to maintain constant temperature which should be about 70° F. Allow the generator to operate for 1 hour.

The glass cap, No. 1, is now removed and the test paper is developed in a No. 2 beaker with 5% NH₄OH solution for three minutes, then washed 5 times with distilled water. The test paper is now toned with a 1% AuCl₂ solution by allowing the test paper to remain in solution for five minutes. The test paper will now have a violet or purple stain, the intensity depending on the amount of As or Sb introduced. Wash the paper 5 times with distilled water and preserve in 50 cc. glass stoppered bottles containing about 5 cc. water. Keep bottles in dark place, because the stains darken on exposure to light.

Duplicate tests are made, finally selecting of two the one which is the most uniform.

The stains are made to represent the following amounts:

	ЯЪ	As and Sb Combined
1	00002	.00002
2	00004	.00004
3	00006	.00006
4	00008	.00008
5		.00010
6	00012	.00012
7		.00014
8		.00016

Procedure for Refined Copper

A blank is run with all tests.

Weigh 10 gms. of the shot or drilled sample into a No. 3 beaker. Add 50 cc. Conc. HNO₃, C.P. As free, let stand covered with watch glass until the action has subsided. Now place beaker on wire gauze over Bunsen flame and heat until all the copper is dissolved.

Remove from flame, dilute to 150 cc. with distilled water (if too basic add a few drops of HCl to clear the solution). Add 2 cc. ferric nitrate solution, stir, then make ammoniacal by adding C.P. ammonium hydrate (As free). Bring to boiling. Remove from flame and filter through a 15 cm. fluted Perfection filter paper. Immediately wash the filter paper free from copper compounds with hot water, using dilute ammonia where necessary to wash out any copper salts that have crystallized.

The precipitate (which contains both As and Sb) is dissolved off the filter with hot dilute hydrochloric acid, by means of a wash bottle into a No. 4 casserole. Wash the filter three times with hot water.

Add a pinch of KClO₂ to the casserole, cover with watch glass, place the casserole in an asbestos cut out over Bunsen burner and boil the contents down to 10 cc., taking care that it does not roast on the sides.

Distillation. Transfer the contents of the casserole to the distilling apparatus. Add 20 cc. ferrous chloride and 20 cc. zinc chloride solution, and distill until the contents of flask begins to froth. Now add, drop at a time, 35 cc. HCl, through the dropping funnel which is connected to flask. Distil until all the HCl is out of the funnel and out of the flask.

The distillate is received in a No. 4 beaker having 40 cc. H₂O in which both the As and Sb is contained.

The above distillate is now transferred and washed from the beaker into the special designed generator. Add 2 cc. stannous chloride which insures a complete reduction of any ferric compounds present. Dilute the contents of generator to 220 cc. Place disc of HgCl₂ test paper on the funnel top, then put on cap to hold in place. Add 15 gms. metallic zinc or 1 No. 6 porcelain spoonful. Take care that the generating apparatus is properly closed, then place into water bath to maintain constant temperature which should be about 70° F. The apparatus is allowed to operate for one hour during which time the arsine and stibine generated shall effect the HgCl₂ test paper, causing a yellow or orange colored spot which varies in color and size according to the amount of As and Sb present. The paper is now removed from the apparatus and developed in a No. 2 beaker containing 5% ammonium hydrate solution for three minutes. The color of the spot now changes to a brownish black. Wash test paper five times with distilled water. Now cover the test paper with 10 cc. of 1% gold chloride solution which tones the color of the spot to a violet or purple hue that fixes it so comparison can be made with the standard stains or spots to determine the amount of arsenic or antimony in the sample.

Determination of Antimony in Tartar Emetic

Iodine in the presence of sodium bicarbonate oxidizes trivalent antimony to the pentavalent form as shown by the reaction:

$$K(SbO)C_4H_4O_6+6NaHCO_2+I_2$$

= $Na_4SbO_4+KNaC_4H_4O_6+2NaI+H_2O+6CO_2$.

Procedure. 10 grams of tartar emetic are dissolved in water, the solution diluted to 500 cc. and 20 cc. taken for analysis. This is diluted to 100 cc. 25 cc. of 2 per cent sodium bicarbonate are added and the mixture titrated with N/10 iodine reagent.

1 cc. N/10 I = 0.016617 g. $K(SbO)C_4H_4O_6 \cdot \frac{1}{2}H_2O$

ARSENIC

WILFRED W. SCOTT

As₄ at.wt. 74.96— cryst. sp.gr. 5.73 m.p. 850 b.p. subl. 554° amorp. 4.72 m.p. 6.p. subl. 554° 0xides, As₂O₃, As₂O₅.1

DETECTION

Hydrogen sulphide precipitates the yellow sulphide of arsenic, As₂S₂, when passed into its solution made strongly acid with hydrochloric acid. If the solution contains more than 25% hydrochloric acid, (sp.gr. 1.126) the other members of the hydrogen sulphide group do not interfere, as they are not precipitated from strong acid solutions by hydrogen sulphide. Arsenic sulphide is soluble in alkaline carbonates. (Antimony sulphide, Sb₂S₂, reddish yellow, is insoluble in alkaline carbonates.)

Volatility of the chloride, AsCl₁, is a means of separation and distinction of arsenic. Details of the procedure are given under "Separations." The distillate may be tested for arsenic as directed above.

Traces of arsenic may be detected by either the Gutzeit or Marsh test for arsenic. Directions for the Gutzeit test are given at the close of the volumetric procedures.

Distinction between Arsenates and Arsenites. Magnesia mixture precipitates white, MgNH₄AsO₄, when added to ammoniacal solutions containing arsenates, but it produces no precipitate with arsenites.

Red silver arsenate and yellow silver arsenite are precipitated from neutral solutions by ammoniacal silver nitrate. An arsenate gives a yellow precipitate with ammonium molybdate solution.

ESTIMATION

The determination of arsenic is required in the valuation of native arsenic, white arsenic, As₂O₃; ores of arsenic—orpiment, As₂S₂; realgar, As₂S₂; pyrargyrite, As₂Sb₃; arsenopyrite, or mispickel, FeSAs; cobaltite or cobalt glance, CoSAs; smaltite, CoAs₂; niccolite, NiAs. The substance is estimated in copper ores, in speiss, regulus; in iron precipitates (basic arsenate). It is determined in paint pigments, Scheel's green, etc. The element is determined in shot alloy and in many metals. It is estimated in germicides, disinfectants, and insecticides—Paris green, lead arsenate, zinc arsenite. Traces are looked for in food products and in substances where its presence is not desired.

Preparation and Solution of the Sample

In dissolving arsenic compounds it will be recalled that the oxide, As₂O₃, is not readily acted upon by dilute acids—hydrochloric or sulphuric. The compound is soluble, however, in alkaline hydroxides and carbonates. Nitric

¹Van Nostrand's Chem. Annual—Olsen—3d Ed.

acid oxidizes As₂O₂ to the higher oxide, As₂O₅, which is soluble in water. The sulphides As₂S₂ and As₂S₃ are practically insoluble in hydrochloric or sulphuric acids, but are dissolved by the fixed alkalies and alkali sulphides. All arsenites, with the exception of the alkali arsenites, require acids to effect solution.

Pyrites Ore and Arseno-pyrites. The amount of the sample may vary from 1 to 20 grams, according to the arsenic content. The finely ground sample in a large casserole is oxidized by adding 10 to 50 cc. of bromine solution (75 cc. KBr+50 cc. liquid Br+450 cc. H₂O) covering and allowing to stand for fifteen minutes, then 20 to 50 cc. of strong nitric acid are added in three or four portions, allowing the action to subside upon each addition. The glass cover is raised by means of riders, and the sample evaporated to dryness on the steam bath; 10 to 25 cc. of hydrochloric acid are now added and the sample again taken to dryness. Again 10 to 25 cc. of hydrochloric acid are added and the sample taken to dryness. Finally 25 cc. of hydrochloric acid and 75 cc. of water are added, and the mixture digested over a low flame until all the gangue, except the silica, is dissolved. The solution is now examined for arsenic by distillation of the arsenic after reduction, the distillate being titrated with standard iodine solution according to directions given later.

Arsenous Oxide. The sample may be dissolved in caustic soda, the solution neutralized with hydrochloric acid, and the resulting sample titrated with iodine.

Fusion Method. One gram of the finely powdered mineral is fused in a nickel crucible with about 10 grams of a mixture of potassium carbonate and nitrate, 1:1,¹ and the melt extracted with hot water. Two hundred cc. of a saturated solution of SO₂ is added to the filtrate to reduce the arsenic, the excess of SO₂ then expelled by boiling, the solution diluted with dilute sulphuric acid, and arsenic determined in the filtrate.

Arsenic in Sulphuric Acid. Arsenous acid may be titrated directly with iodine in a 20- to 50-gram sample, which has been diluted to 200 to 300 cc. with water and nearly neutralized with ammonium hydroxide and then an excess of sodium acid carbonate added, followed by the iodine titration.²

Arsenic Acid in Sulphuric Acid. Twenty-five cc. of the acid containing about 0.1% arsenic or a larger volume in case the percentage of arsenic is less than 0.1% As₂O₃ (the sp.gr. of the acid being known) are measured out into a short-necked Kjeldahl flask. About half a gram of tartaric acid and 2 grams of fused, arsenic-free potassium bisulphate are added and the acid heated over a low flame until the liberated carbon is completely oxidized and the acid again becomes clear, e.g., a pale straw color. It is not advisable to heat to violent fuming, as a loss of arsenic is then apt to occur. The cooled acid is poured into about 300 cc. of water, the excess acid nearly neutralized with ammonia, bicarbonate of soda added in excess and the arsenous acid titrated with standard iodine. Total arsenic as As₂O₃ minus arsenous arsenic as As₂O₃ = arsenic arsenic in terms of As₂O₃. This result multiplied by 1.1616 = As₂O₃.

Arsenic in Hydrochloric Acid. The arsenic in 20 to 100 cc. sample is reduced by ferrous chloride, the arsenic distilled according to directions given later, and the distillate titrated with iodine.

 $^{^{1}}$ 0.1% arsenic determined on a 20-gram sample.

² SO₂ should be expelled by heat or by a current of air before treating with the alkali.

Arsenic in Organic Matter. 1 0.2 to 0.5 gram of the sample finely powdered is oxidized by mixing with 10 to 15 grams of sodium carbonate and sodium peroxide. 1:1, in a nickel crucible, a portion of the fusion mixture being spread over the charge. After heating gently for fifteen minutes, the fusion is completed by heating to dull redness for five minutes longer. The contents of the crucible are rinsed into an Erlenmeyer flask after extraction with water. and the solution made acid with dilute sulphuric acid, 1:1. The mixture is boiled down to 100 cc., 1 to 2 grams of potassium iodide added and the solution further concentrated to about 40 cc. Iodine is reduced with sulphurous acid or thiosulphate, the solution diluted with hot water and saturated with hydrogen sulphide. Arsenous sulphide is filtered off, washed, dissolved in 15 to 20 cc. of half-normal sodium hydroxide and 30 cc. of hydrogen peroxide (30%) solution added, and the solution boiled. About 12 cc. of dilute sulphuric acid, 1:1, are added, together with 1 to 2 grams of potassium iodide, the solution concentrated to 40 cc. and free iodione reduced with thiosulphate as before. Arsenic is now titrated, with standard iodine, upon neutralization of the free acid with sodium hydroxide and sodium acid carbonate.

Lead Arsenate. Ten grams of the thoroughly mixed paste or 5 grams of the powder are dissolved by treating with 25 cc. of 10% hot sodium hydroxide solution, and diluted to 250 cc. An aliquot part, 50 cc. (=2 grams paste and 1 gram powder) is placed in an Erlenmeyer flask and 20 cc. of dilute sulphuric acid, 1:1, added, and the solution diluted to 150 cc. About 3 grams of solid potassium iodide are added and the solution boiled down to about 50 cc. (but not to fumes). The liquor will be colored yellow by free iodine. Tenth normal sodium thiosulphate is added drop by drop until the free iodine is neutralized (solution loses its yellow color), it is now diluted to about 250 cc. and the free acid neutralized by ammonium hydroxide (methyl orange indicator), then made slightly acid with dilute sulphuric acid, and an excess of bicarbonate of soda added. The arsenic is titrated with standard iodine.

The arsenic may be reduced by placing the 50-cc. sample in a Kjeldahl flask, adding 25 cc. of strong sulphuric acid (1.84 sp.gr.), ½ gram tartaric acid and 2 grams acid potassium sulphate, KHSO₄, and digesting over a strong flame until the organic matter is destroyed and the solution is a pale yellow color. The cooled acid is diluted and neutralized, etc., as directed above.

Water-soluble Arsenic in Insecticides. Rapid Works Test. Two grams of the paste is digested with 1000 cc. of water at 90° C. for five minutes, in a graduated 1000-cc. flask. An aliquot portion is filtered and the arsenic determined by the Gutzeit method.

Water-soluble arsenite may be titrated directly with iodine in presence of sodium bicarbonate.

Zinc Arsenite. About 5 grams of powder or 10 grams of paste are taken and dissolved in a warm solution containing 300 cc. of water and 25 cc. of strong hydrochloric acid. The cooled solution is diluted to 500 cc. and 100-cc. portions taken for analysis. The acid is partly neutralized with ammonium hydroxide and 50 cc. of a saturated solution of ammonium oxalate added (to prevent precipitation of the zinc as ZnCO₂), and an excess of sodium bicarbonate, NaHCO₂. Arsenic is now titrated with iodine as directed later.

Soluble Arsenic in Zinc Arsenite. One gram sample is rubbed into an

¹Organic matter may be destroyed by heating the substance on addition of 10% H_2SO_4 and solid $(NH_4)_2SO_8$.

ARSENIC 37

emulsion with several portions of water until the whole is in suspension. The cloudy liquor is diluted to 1000 cc. and a portion filtered through a ½-in. asbestos mat on a perforated plate, the asbestos being covered with a layer of filter paper. The first 50 cc. are rejected. One hundred cc. of the clear filtrate (= 0.1 gram) is treated with 10 cc. of strong sulphuric acid, 0.05 gram, Fe₂O₂ (use ferric ammonium sulphate) and ½ cc. of 80% stannous chloride solution and heated until colorless. Arsenic is now determined by the Gutzeit method, using the larger-sized apparatus.

Arsenic Acid, Alkali Arsenates, etc. The sample is dissolved in 20 to 25 cc. of dilute sulphuric acid, 1:1, in an Erlenmeyer flask, and reduced by addition of 3 to 5 grams of potassium iodide, the action being hastened by placing the mixture on a steam bath. The iodine liberated is exactly neutralized with thiosulphate and the arsenous acid titrated with iodine according to the procedure given later.

Arsenic in Steel, Iron, Pig Iron, etc. One to 50 grams of steel, etc., may be treated according to the scheme for pyrites. If a large sample is taken, it is advisable to treat it in a 500-cc. flask, connected with a second flask containing bromine, to guard against loss of arsenic by volatilization. When the sample has dissolved it is taken to dryness (the bromine in the second flask being combined with it) and treated as directed in pyrites. Arsenic chloride, AsCl, is transferred to the distilling flask with strong hydrochloric acid, and arsenic separated from the iron by volatilization of reduced chloride according to the procedure given below.

Arsenic in Copper. Arsenic is precipitated with iron by the basic acetate method, and thus freed from copper. Details of procedure are given under the determination of impurities in copper in the chapter on the subject.

SEPARATIONS

Isolation of Arsenic by Distillation as Arsenous Chloride ²

By this method arsenic may be separated from antimony, tin, and from other heavy metals. It is of special value in the direct determination of arsenic in iron ores, copper ores, and like products and has a wide application. The procedure depends upon the volatility of arsenous chloride at temperatures lower than the other heavy metals. In a current of HCl gas, arsenous chloride begins to volatilize below 108° C., and is actively volatile at 120° C.; antimony starts to volatilize at 125° C., but is not actively volatile until a temperature of 180° has been reached. The boiling-point of arsenous chloride, AsCl, is 130.2°; antimony trichloride, SbCl, is 223.5°; and that of stannous chloride, SnCl, is over 603°; other chlorides having still higher boiling-points. Tin in its higher form, SnCl, is readily volatile, boiling-point is 114° C., so that it is necessary to have it in its divalent form to effect a separation from arsenic. When heavy metals are present in the residue remaining from the arsenie distillate, or when zinc chloride is added to raise the boiling-point, antimony

² J. E. Stead's Method. R. C. Roark and C. C. McDonnell, Jour. Ind. Eng. Chem., VIII, 4, 327 (1916).

¹ The ore may be brought into solution by fusion with a mixture of sodium carbonate, potassium nitrate and zinc oxide, 1:1:2. The fusion being made in a platinum dish. The potassium iodide procedure may be followed for reduction of arsenic. (See Lead Arsenate.)

may also be separated by distillation by carrying the solution to near dryness, adding concentrated HCl by means of a separatory funnel, drop by drop, during further distillation of the concentrate. Arsenic may be determined in the distillate (first portions) either gravimetrically or volumetrically.

Procedure. If arsenic is present as arsenic chloride, as prepared in the method for solution of iron ores, the sample may be transferred directly to the distillation flask by means of concentrated, arsenic-free hydrochloric acid. If a preliminary separation of other metals has been made and arsenic is present (along with antimony and tin) as a sulphide, it is oxidized by addition of concentrated HCl and sufficient potassium chlorate to cause solution and oxidation of free sulphur, and the chlorate decomposed by evaporation to

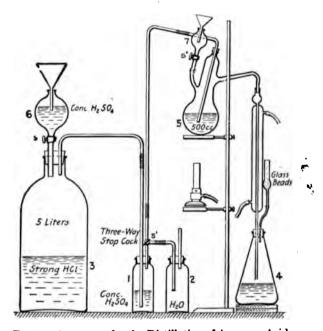


Fig. 1.—Apparatus for the Distillation of Arsenous Acid.

dryness; or if preferred, by evaporation of the alkaline solution to dryness, oxidation with fuming nitric and re-evaporation to dryness to expel the nitric acid. The residue is taken up with hydrochloric acid and washed into the flask with strong hydrochloric acid as directed above.

Distillation. The sample, in a half-liter distilling flask (Fig. 1, "5") is made up to about 150 cc. with concentrated hydrochloric acid and about 5 grams of cuprous chloride, Cu₂Cl₂, are added. The apparatus is connected up as shown in the illustration, Fig. 1. The end of the condenser dips into 400 cc. of cold water in a large beaker (1 liter) or flask ("4"). The solution is cooled by placing it in ice-water or cold running water. The sample is saturated with dry hydrogen chloride gas generated by dropping concentrated sulphuric acid into strong hydrochloric acid ("3") and passing the gas through

sulphuric acid ("1") (sp.gr. 1.84) as shown in cut. When the point of saturation is reached the gas begins to bubble through the solution instead of being absorbed by it. When this occurs, heat is applied and the solution brought to boiling, the current of HCl gas being continued. At a temperature of 108 to 110° C. the first 100 cc. will contain practically all of the arsenic. About two-thirds of the solution is distilled off. It is advisable to add more hydrochloric acid to the residue in the flask, together with cuprous chloride, and repeat the distillation into a fresh lot of water. This may be done during the estimation of arsenic in the first distillate.

Arsenic may be determined in the distillates either gravimetrically or volumetrically. The volumetric procedures for arsenic, in this isolated form, are generally to be preferred, since they are both rapid and accurate. For amounts over 0.5% arsenic, the iodine method is recommended, for smaller amounts (arsenic in crude copper), precipitation with silver nitrate and titration of the silver salt is best. Exceedingly small amounts are best determined by the Gutzeit method, page 46.

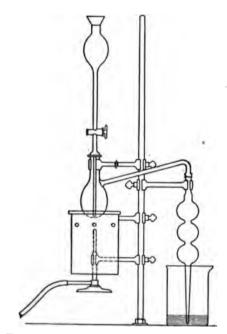


Fig. 2.—Knorr Arsenic Distillation Apparatus.

The inlet funnel is filled about half full with hydrochloric acid (sp. gr. 1.2). The outlet of the condenser tube is caused to dip just beneath the surface of 100 cc. of distilled water, containing a lump of ice. The solution in the distillation flask is heated to boiling; concentrated hydrochloric acid is introduced through the funnel drop by drop at the rate sufficient to replace the evaporation. All the arsenic usually distils over in half an hour. At this time the beaker holding the condensate is replaced by another with 100 cc. of water. And the distillation continued about 15 minutes. Test this distillate to ascertain whether any arsenic is present.

40 ARSENIC

Commercial hydrochloric acid invariably contains arsenic, so this must be purified by redistillation in presence of an oxidizing agent to oxidize the arsenic to the non-volatile arsenic pentachloride, AsCl₅, form, (Fig. 5) or by treatment with H₂S and filtration. A blank run should be made on the reagents used especially when traces of arsenic are to be determined.

Separation of Arsenic from Antimony and Tin by Precipitation as Sulphide in a Strong Hydrochloric Acid Solution

This procedure for isolation of arsenic depends upon the insolubility of the sulphide of arsenic in strong hydrochloric acid, whereas that of antimony dissolves. The sulphide of tin is also soluble.

Procedure. The metals present in their lower conditions of oxidation are precipitated as sulphides in presence of dilute hydrochloric acid (5% solution) to free them from subsequent groups (Fe, Al, Ca, etc.). The soluble members of the hydrogen sulphide group are now dissolved and separated from copper, lead, etc., by caustic as follows: The greater part of the washed precipitate is transferred to a small casserole, that remaining on the filter paper is dissolved off by adding to it a little hot dilute potash solution, catching the filtrate in the casserole. About 5 grams weight of solid potassium hydroxide or sodium hydroxide is added to the precipitate. Arsenic, antimony, and tin sulphides dissolve. The solution is filtered if a residue remains, and the filter washed. This preliminary treatment is omitted if alkaline earths and alkalies are the only contaminating elements present.

The casserole containing the sample is covered and placed on a steam bath. Chlorine is now conducted into the warm solution for an hour, whereby the alkali is decomposed and antimony and arsenic oxidized to their higher state. Sufficient hydrochloric acid is added to decompose the chlorate formed, and the uncovered solution evaporated to half its volume. An equal volume of hydrochloric acid is added and the evaporation repeated, to expel the last trace of chlorine. The acid solution is washed into an Erlenmeyer flask, cooled by ice to 0° C. and two volumes of cooled, concentrated, hydrochloric acid added. H₂S gas is rapidly passes into this solution for an hour and a half. The flask is now stoppered and placed in boiling water for an hour. The yellow arsenic sulphide, As₂S₄, is filtered through a weighed Gooch crucible, washed with hydrochloric acid, 2:1, until free from antimony, i.e., the washing upon dilution remains clear. The residue is now washed with water, followed by alcohol, and may be dried and weighed as As₂S₄, or determined volumetrically. Antimony and tin are determined in the filtrate. McCay recommends washing As₂S₄, with alcohol, CS₂ and finally alcohol.

The sulphide may be dissolved in concentrated sulphuric acid by heating to sulphuric acid fumes and until the solution becomes clear. No arsenic is lost, provided the heating is not unduly prolonged. Fifteen to twenty-five minutes is generally sufficient to dissolve the sulphide and expel SO₂, etc. The acid may be neutralized with ammonia or caustic, made again barely acid and then alkaline with bicarbonate of soda, and arsenous acid titrated with iodine.²

¹ Le Roy W. McCay, Chem. News, 56, 262 (1887).

² J. and H. S. Pattinson, Jour. Soc. Chem. Ind., 1898, p. 211.

GRAVIMETRIC METHODS FOR DETERMINATION OF ARSENIC

As in the case of antimony, the accuracy and rapidity of the volumetric methods for the determination of arsenic make these generally preferable to the more tedious gravimetric methods. The following methods, however, are of value in certain analytical procedures.

Determination of Arsenic as the Trisulphide, As₂S₃

Arsenic acid and arsenates should be reduced to the arsenous form before precipitation as the sulphide. The procedure is especially adapted to the isolation of arsenic from other elements, when this substance is present in the solution in appreciable quantities, advantage being taken of the extreme difficulty with which arsenous sulphide, As₂S₃, dissolves in hydrochloric acid solution.

Procedure. The solution containing arsenic in the arsenious form is made strongly acid with hydrochloric acid and hydrogen sulphide passed into the cold solution to complete saturation. The hydrogen sulphide pressure generator is recommended for this treatment. Figs. 3 and 4. The precipitate is filtered into a weighed Gooch crucible (previously dried at 105° C.), the compound dried at 105° C. to constant weight and weighed as As₂S₂.

Factors. $As_2S_3 \times 0.6091 = \text{grams As.}$ $As_2S_3 \times 0.8042 = \text{grams As}_2O_3.$ $As_2O_3 \times 1.1616 = \text{grams As}_2O_5.$ $As_2O_5 \times 1.3134 = \text{grams H}_3AsO_4 \cdot \frac{1}{2}H_2O.$ $As_2S_3 \times 1.2606 = \text{grams As}_2S_5.$

Note. Arsenic may also be determined as arsenic sulphide by passing a rapid stream of H₂S into a cooled solution of arsenic acid containing at least two parts of concentrated hydrochloric acid for each part of water present in the solution.

Determination of Arsenic as Magnesium Pyroarsenate

The method worked out by Levol depends upon the precipitation of arsenic as MgNH₄AsO₄·6H₂O, when magnesia mixture is added to an ammoniacal solution of the arsenate. Although 600 parts of water dissolve 1 part of the salt, it is practically insoluble in a 2½ per cent ammonia solution, 1 part of the anhydrous salt requiring 24,558 parts of the ammonia water according to Virgili. The compound loses 5½ molecules of water at 102° C. and all of the water when strongly ignited, forming in presence of oxygen the stable magnesium pyroarsenate, Mg₂As₂O₇, in which form arsenic is determined.

Procedure. The solution containing the arsenic, in the form of arsenate, and having a volume not exceeding 100 cc. per 0.1 gram arsenic present, is treated with 5 cc. of concentrated hydrochloric acid, added, with constant stirring, drop by drop. Ten cc. of magnesia mixture are added (Reagent = 55 grams MgCl₂+70 grams NH₄Cl+650 cc. H₂O and made up to 1000 cc. with NH₄OH, sp.gr. 0.96), for each 0.1 gram of arsenic present. Ammonia solution (sp.gr. 0.96) is added from a burette, with stirring, until the mixture is neutralized (a red color imparted to the solution in presence of phenolphthalein indicator), and

¹ Average of three results. J. F. Virgili, Z. anal. Chem., 44, 504 (1905).

then ammonia added in excess equal to one-third the volume of the neutralized solution. The precipitate is allowed to settle at least twelve hours and is then filtered into a weighed Gooch crucible and washed with 2.5% ammonia until free from chloride. After draining as completely as possible by suction the

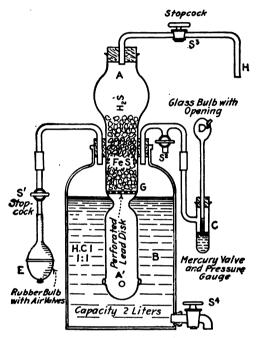


Fig. 3.—Scott's Hydrogen Sulphide Generator.

Fig. 3 shows a convenient form of a generator for obtaining hydrogen sulphide gas under presure. The apparatus is the writer's modification of the Banks' generator sold by E and A. and is designed for large quantities of hydrogen sulphide gas. The cylinder A A' is constricted, as shown, to support perforated lead disk G, upon which rests the iron sulphide. The lower end of the chamber is closed to catch small particles of FeS that may be carried through the perforations of the disk. Small openings admit the acid to A'. The level of the acid is below the disk G, so that the acid only comes in contact with the sulphide when pressure is applied by means of the rubber bulb E, the stopcock S' being open and S' closed. The mercury gauge C is adjusted to blow out at a given pressure, to prevent accident, the bulb D preventing the mercury from being blown out of the apparatus. A small opening in D allows the escape of the gas. When the apparatus is in operation, H is connected to an empty heavy-walled bottle, which in turn is attached with glass tube connection to the pressure flask in which the precipitation of the sulphide is made, the flask being closed to the outside air. By pressure on the rubber bulb E, acid is forced into the chamber A' past the disk into the sulphide in A. The entire system will now be under the pressure indicated by the gauge C. The pressure is released by opening the stopcock S' and the flask containing the precipitate then disconnected. The reservoir is designed to hold about two liters of acid, and the cylinder containing the sulphide is of sufficient capacity to hold over one pound of FeS, so that the apparatus will deliver a large quantity of hydrogen sulphide.

precipitate is dried at 100° and then heated to a dull red heat (400 to 500° C.), preferably in an electric oven, until free of ammonia. The temperature is then raised to a bright red heat (800 to 900° C.) for about ten minutes, the crucible then cooled in a desiccator and the residue weighed as Mg₂As₂O₇.

Factors, $Mg_2As_2O_7 \times 0.4827 = As$, or $\times 0.6373 = As_2O_3$, or $\times 0.7403 = As_2O_5$, or $\times 0.7925 = As_2S_3$.

Notes. In place of an electric furnace the Gooch crucible may or placed in a larger non-perforated crucible, the bottom of the Gooch being 2-3 mm. above the bottom of the outer crucible. The product may now be heated in presence of a current of oxygen passed through a perforation in the covering lid of the Gooch, or

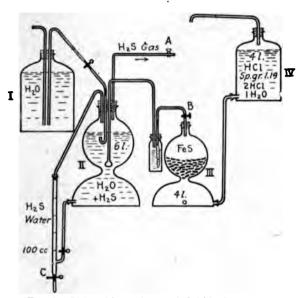


Fig. 4.—Urbasch's Hydrogen Sulphide Generator.

The apparatus designed by Urbasch (Chem. Zeit. (1910) 34, 1040. The Analyst (1910) 35, 558), shown in Fig. 2, enables a constant supply of gas and its saturated aqueous solution to be obtained. The bottle IV is charged with hydrochloric acid, and iron sulphide is placed in III. The hydrogen sulphide is passed through the water in II until a saturated solution is obtained. Water is placed in I and II. If gas is required the taps A and B are opened and Hs drawn from A. Hydrogen sulphide water is obtained by opening the pinch cock C of the burette, the liquid drawn off being simultaneously replaced from the vessel II. The container is made of dark-colored glass to protect the hydrogen sulphide water from light. Water may be drawn into II, when required by opening the pinch cock leading to the bottle I.

in place of the oxygen, a thin layer of powdered NH4NO, may be placed on the arsenate residue and the heat gradually applied until the outer crucible attains a light red glow.

VOLUMETRIC METHODS FOR THE DETERMINATION OF ARSENIC

Oxidation of the Arsenous Acid with Standard Iodine 1

This procedure is applicable for the determination of arsenic in acids, after reduction of arsenic to its arsenous form, for valuation of arsenic in the trioxide, for determination of arsenic isolated by distillation as arsenous chloride, for arsenic in arsenites and reduced arsenates in insecticides, etc. The method depends upon the reaction—As₂O₂+2H₂O+2I₂=As₂O₅+4HI. The liberated hydriodic acid is neutralized by sodium bicarbonate. The trace of excess iodine is detected by means of starch, a blue color being produced.

Procedure. If the solution is acid, it is neutralized by sodium or potassium hydroxide or carbonate (phenolphthalein indicator) then made slightly acid. If the solution is alkaline, it is made slightly acid. Two to 3 grams of sodium Licarbonate are added together with starch indicator and the solution titrated with tenth normal iodine solution, the iodine being added cautiously from a burette until a permanent blue color develops.

One cc. N/10 iodine = 0.00375 gram As, or 0.004948 gram As₂O₃. As₂O₃×1.1616 = As₂O₅. As×1.3201 = As₂O₃ or ×1.5336 = As₂O₅. As₂O₃×0.7575 = As.

Potassium lodate Method for Determining Arsenic¹

The method is specially applicable to determining arsenic in insecticides. The reaction is represented as follows:

$$As_2O_3 + KIO_3 + 2HCl = As_2O_5 + ICl + KCl + H_2O.$$

Procedure. In determining total arsenic the sample is placed in a distilling bulb, connected to a condenser, strong hydrochloric acid added together with cuprous chloride, and arsenious chloride distilled over into an Erlenmeyer flask according to the standard procedure outlined on page 38. If arsenic is high, an aliquot portion of the distillate is taken and the titration made with standard jodate solution as stated later.

¹ Geo. S. Jamison, J. I. E. C. 10, 290-292, 1918.

- For determining arsenious oxide in Paris Green or other arsenite 0.15 to 0.4 grams of the sample may be weighed directly into a glass-stoppered bottle (500 cc.) and the titration made.

Iodate Titration. 30 cc. of hydrochloric acid sp.gr. 1.19, 20 cc. of water and 6 cc. of chloroform are added to the solid arsenite. If the arsenic is in solution, sufficient HCl should be present to have the acidity between 11 and 20 per cent HCl. (If this falls below 11% HCl hydrolysis of the iodine monochloride will take place. If over 20% HCl the reaction proceeds very slowly.) Potassium iodate solution is now added, rapidly at first, shaking the contents of the bottle. When the iodine that has been liberated during the first part of the titration has largely disappeared from the solution, the stopper of the bottle is inserted and the contents thoroughly shaken. The titration is now conducted cautiously, shaking thoroughly with each addition of the reagent. The titration is complete when after shaking and allowing to stand 5 minutes no color is observed in the chloroform.

Reagent. Contains 3.244 g. of KIO₂ (dried at 140° C.) per 1000 cc.—1 cc. = 0.003 g. As₂O₂.

Volumetric Determination of Arsenic by Precipitation as Silver Arsenate

Bennett's modification of Pearce's method, combining Volhard's, depends upon precipitation of arsenic, from a solution neutralized with acetic, by addition of neutral silver nitrate solution; the silver arsenate is dissolved in nitric acid, and the silver titrated with standard thiocyanate.

Procedure. 0.5 gram, or less, of the finely powdered substance is fused with 3 to 5 grams of a mixture of sodium carbonate and potassium nitrate (1:1) about one-third being used on top of the charge. The cooled mass is extracted with boiling water and filtered. The filtrate, containing the alkali arsenate, is strongly acidified with acetic acid, boiled to expel the carbon dioxide, then cooled and treated with sufficient sodium hydroxide solution to give an alkaline reaction to phenolphthalein indicator. The purple red color is now discharged from the solution by addition of acetic acid. A slight excess of neutral silver nitrate is vigorously stirred in and the precipitate allowed to settle in the dark. The supernatant liquid is poured off through a filter and the precipitate washed by decantation with cold distilled water, then thrown on the filter and washed free of silver nitrate solution. The funnel is filled with water and 20 cc. of strong nitric acid added. The dissolved silver arsenate is caught in the original beaker in which the precipitation was made, the residue on the filter washed thoroughly with cold water and the filtrate and washings made up to 100 cc. The silver is now titrated by addition of standard ammonium or potassium thiocyanate, until a faint red color is evident, using ferric ammonium alum indicator, according to the procedure described for determination of silver. (See Chlorine and Silver Chapters.)

One cc. N/10 thiocyanate = 0.010788 gram Ag. Factor. Ag $\times 0.2316$ = As.

Note. The silver arsenate salt is nearly six times the weight of arsenic, so that very small amounts of arsenic may be determined by the procedure, hence it is not necessary to use over 0.5 gram of the material. For traces of arsenic the Gutzeit method, following, should be used.

DETERMINATION OF SMALL AMOUNTS OF ARSENIC Modified Gutzeit Method ¹

The following procedure furnishes a rapid and accurate method for determination of exceedingly small amounts of arsenic ranging from 0.001 milligram to 0.5 milligram As₂O₄. It is more sensitive and less tedious than the Marsh test. The details, given below with slight modifications, have been carefully worked out in the laboratories of the General Chemical Company and have proved exceedingly valuable in estimating small amounts of arsenic in acids, bases, salts, soluble arsenic in lead arsenate and zinc arsenite and other insecticides, traces of arsenic in food products, baking powders, canned goods, etc.

The method depends upon the evolution of arsine by the action of hydrogen on arsenic compounds under the catalytic action of zinc, the reaction taking place either in alkaline or acid solutions. The evolved arsine reacts with mercuric chloride, forming a colored compound. From the length and intensity of the color stain the amount of arsenic is estimated by comparison with standard stains.

Although the acidity of the sample and the amount of zinc shot should be kept within certain limits, the results are not effected by slight variation as was formerly thought. The physical characteristics of the zinc used rather than the surface exposed to acid action appears to have an effect on the evolution of arsine. The best results are obtained with zinc having a finely crystalline structure.

Iron present in the solution tends to prevent evolution of stibine, but has no apparent effect of arsine generation.

Stannous chloride is essential to the complete evolution of arsine, hence this reagent is added to the solution in which arsenic is determined.

Antimony present in the solution in amounts less than 0.0001 gram, does not interfere with the determination of arsenic. If a greater amount of antimony is present a separation of arsenic should be made by distillation. The following modification of the method given on page 38 is recommended. In place of the generator for HCl shown in Fig. 1, air saturated with HCl, by passing it through a gas wash bottle containing concentrated hydrochloric acid, is drawn through the boiling solution containing the sample in a saturated HCl solution, reduction of arsenic to arsenious chloride having been effected with cuprous chloride as prescribed. The air sweeps the arsine into the water in the receiving flasks (Fig. 1). It is advisable to have two flasks connected in series in place of one as shown. Gentle suction is applied at the receiving end of the train. The apparatus may be made in fairly compact form.

¹ By courtesy of the General Chemical Company with acknowledgments to W. S. Allen, R. M. Palmer and F. J. Seibert.

Special Reagents. Standard Arsenic Solution. One gram of resublimed arsenous acid, As₂O₄, is dissolved in 25 cc. of 20% sodium hydroxide solution (arsenic-free) and neutralized with dilute sulphuric acid. This is diluted with fresh distilled water, to which 10 cc. of 95% H₂SO₄ has been added, to a volume of 1000 cc. Ten cc. of this solution is again diluted to a liter with distilled water containing acid. Finally 100 cc. of the latter solution is diluted to a liter with distilled water containing acid. One cc. of the final solution contains 0.001 milligram As₂O₄.

Standard Stains. Two sets of stains are made, one for the small apparatus for determining amounts of As₂O₂ ranging from 0.001 to 0.02 milligram, and a second set for the larger-sized apparatus for determining 0.02 to 0.5 milligram As₂O₂. Stains made by As₂O₂ in the following amounts are convenient for the standard sets; e.g., small apparatus, 0.001, 0.002, 0.004, 0.006, 0.01, 0.15, 0.02 milligram As₂O₂. Large apparatus, 0.02, 0.05, 0.1, 0.2, 0.3, 0.4, 0.5 milligram As₂O₂.

In making the stain the requisite amount of standard reagent, As₂O₄ solution, is placed in the Gutzeit bottle with the amounts of reagents prescribed for the regular tests and the run made exactly as prescribed in the regular procedure.

Preservation of the Stains. The strips of sensitized paper with the arsenic stain are dipped in molten paraffine (free from water), and mounted on a sheet of white paper, folded back to form a cylinder. The tube is placed in a glass test-tube containing phosphorus pentoxide, which is then closed wy a stopper. It is important to keep the stained strip dry, otherwise the stain soon fades, hence the paper on which the strips are mounted and the glass test-tube, etc., must be perfectly dry. It is advisable to keep the standard in a hydrometer case, while not in use, as light will gradually fade the color.

Sensitized Mercuric Chloride (or Bromide) Paper. 20×20 in. Swedish Filter Paper No. 0 is cut into four equal squares. For use in the large Gutzeit apparatus the paper is dipped into a 3.25% solution of mercuric chloride (mercuric bromide may be used in place of the chloride) or if it is to be used in the small Gutzeit apparatus it is dipped into a 0.35% mercuric chloride solution. (The weaker the solution, the longer and less intense will be the stain.) The paper should be of uniform thickness, otherwise there will be an irregularity in length of

¹ The accuracy of the method is within 10% of the truth.

Evolution of arsine by the electrolytic method, in place of the method outlined, proved to be unreliable. The evolution of arsine is effected by the slightest variation in conditions so it is extremely difficult to obtain concordant results.

In the Marsh test arsine is passed through a glass tube constricted to capillarity. By application of heat the arsine is decomposed and metallic arsenic deposited. The tube is heated just before the capillary constriction so that arsenic deposits in the drawn out tube. Comparison is made with standards, the length of the stain being governed by the amount of arsenic in the evolved gas. Slight variations in the size of the capillary tube and rate of evolution make a notable variation in length of stain.

stain for the same amounts of arsenic. (The thicker the paper the shorter the stain. The paper is hung up and dried in the air, free from gas fumes, H_2S being particularly undesirable.) When dry, half an inch of the outer edge is trimmed off (since this is apt to contain more of the reagent), and the paper cut into strips. The paper with more concentrated reagent is cut into strips 13 cm. by 5 mm. and that with 0.5% mercuric chloride into strips 7 cm. by 4 mm. The paper is preserved in bottles with tight-fitting

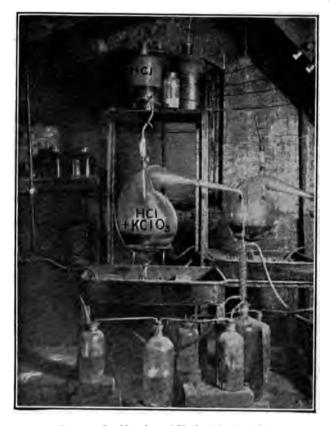


Fig. 5.—Purification of Hydrochloric Acid.

stoppers. Standards should be made with each batch of paper. Paper with a white deposit of HgCl₂ should not be used.

Ferric Ammonium Alum. Eighty-four grams of the alum with 10 cc. of mixed acid is dissolved and made up to a liter. Ten cc. of this solution contains approximately 0.5 gram Fe_2O_3 .

Lead Acetate. One per cent solution with sufficient acetic acid to clear the solution.

Zinc. Arsenic-free zinc shot, 3 to 6-in. mesh. The zinc is treated with C. P. hydrochloric acid, until the surface of the zinc becomes clean and dull. It is

then washed, and kept, in a casserole, covered with distilled water, a clock-glass keeping out the dust.

Mixed Acid. One volume of arsenic-free H₂SO₄ is diluted with four volumes of pure water and to this are added 10 grams of NaCl per each 100 cc. of solution.

Stannous Chloride. Eighty grams of stannous chloride dissolved in 100 cc. of water containing 5 cc. arsenic-free hydrochloric acid (1.2 sp.gr.).

Arsenic-free Hudrochloric Acid. The commercial acid is treated with potassium chlorate to oxidize the arsenic to its higher form and the acid distilled. The distilling apparatus may be arranged so that a constant distillation takes place, acid from a large container dropping slowly into a retort containing potassium chlorate, fresh hydrochloric acid being supplied as rapidly as the acid distills. See Fig. 5 on page 48.

Lead Acetate Test Paper for Removal of H_2S . Large sheets of qualitative filter paper are soaked in a dilute solution of lead acetate and dried. The paper is cut into strips 7×5 cm.

Blanks should be run on all reagents used for this work. The reagents are arsenic-free if no stain is produced on mercuric chloride paper after forty-five minutes' test.

Special Apparatus. The illustration, Fig. 6 (page 52), shows the Gutzeit apparatus connected up, ready for the test. The dimensions on the left-hand side are for the small apparatus and those on the right for the large form. Rubber stoppers connect the tubes to the bottle. The apparatus consists of a wide-mouth 2-oz. or 8-oz. bottle according to whether the small or large apparatus is desired, a glass tube (see Fig. 6) containing dry lead acetate paper and moist glass wool for removal of traces of hydrogen sulphide and a small-bore tube containing the strip of mercuric chloride paper.

Preparation of the Sample

The initial treatment of the sample is of vital importance to the Gutzeit Method for determining traces of arsenic. The following procedures cover the more important materials or substances in which the chemist will be called upon to determine minute amounts of arsenic.

Traces of Arsenic in Acids. The acid placed in the Gutzeit apparatus should be equivalent to 4.2 grams of sulphuric acid or 3.1 grams of hydrochloric acid and should contain 0.05 to 0.1 gram Fe₂O₃ equivalent. If large samples are required for obtaining the test it is necessary either to expel a portion of the acid in order to obtain the above acidity or to make standard stains under similar conditions of acidity. It must be remembered that arsenous chloride is readily volatile, whereas the arsenic chloride is not, hence it is necessary to oxidize arsenic before attempting to expel acids. If nitric acid or bromine or chlorine (chlorate) be added for this purpose, it must be expelled before attempting the Gutzeit test. Nitric acid may be expelled by adding sulphuric acid and taking to SO₃ fumes. Free chlorine, bromine, or iodine will volatilize on warming the solution. Chlorine in a chlorate is expelled by taking the sample to near dryness in presence of free acid. Sulphurous acid or hydrogen sulphide, if present, should be expelled by boiling the solution, then making faintly pink with KMnO₄ and destroying the excess with a drop or so of oxalic acid. SO₂ is reduced by zinc and hydrogen to H₂S, which forms black HgS with mercuric chloride, hence removal of SO₂ and H₂S are necessary before running the test.

Sulphuric Acid. With amounts of arsenic exceeding 0.00035% As₂O₂, 5 to 10 grams of acid, according to its strength, are taken for analysis and diluted to 15 or 20 cc. If H₂S or SO₂ are present, expel by boiling for fifteen or twenty minutes. Prolonged fuming of strong acid should be avoided by previously diluting the acid with sufficient water. In mixed acid containing nitric acid the sample is taken to SO₂ fumes to expel nitric acid. The procedure given later for the regular determination is now followed.

For estimating very minute amounts of arsenic, 0.000005 to 0.00005% As₂O₃, it is necessary to take a 25- to 50-gram sample for analysis. The acid is treated as directed above for removal of H₂S or SO₂ or nitric acid and diluted in the Gutzeit apparatus to at least 130 cc., using the large apparatus. Upon the addition of iron and stannous chloride as directed in the procedure described on page 52 for large Gutzeit test. The stains are compared with standard stains produced by known amounts of arsenic added to 50-gram portions of arsenic-free sulphuric acid of strength equal to that of the sample. The stains are longer and less intense than those produced by less acid.

Hydrochloric Acid. Twenty cc. is taken for analysis (sp.gr. being known); the sample should contain an acid equivalent of about 3.1 grams of hydrochloric acid. Chlorine is expelled by bubbling air through the acid before taking a sample. The procedure is given for further treatment of the sample following the section on preparation of the sample.

Nitric Acid. One hundred cc. of the acid (sp.gr. being known) is evaporated with 5 cc. of concentrated sulphuric acid to SO₁ fumes, to expel nitric acid. Arsenic is determined in the residue by the standard procedure.

Iron Ores, Pyrites, Burnt Pyrites, Cinders, etc. One gram of the finely ground ore is oxidized by treating with 5 cc. of a mixture of 2 parts liquid bromine and 3 parts of carbon tetrachloride. After fifteen minutes, 10 cc. of concentrated nitric acid are added and the mixture taken to dryness. Five cc. of concentrated sulphuric acid (95%) are added and the mixture taken to SO₃ fumes to expel the nitric acid. The cooled sample is taken up with 50 cc. of water and digested until all of the iron sulphate has dissolved; it is now washed into a 100-cc. flask, made to volume, and arsenic determined in an aliquot portion in the usual way, given later. Insoluble Fe₂O₃, briquettes, etc., is best dissolved by fusion with potassium bisulphate, KHSO₄. The fused mass is dissolved in warm dilute hydrochloric acid, and then washed into the Gutzeit bottle.

Alumina Ores. Bauxite. One gram of bauxite is treated with one part of concentrated nitric acid and 6 parts of concentrated hydrochloric acid, and taken to dryness on the water bath. The residue is taken up with an equivalent of 4.7 grams of hydrochloric acid or 6.3 grams of sulphuric acid in a volume of 25 cc. and the mix heated until the material has dissolved. The sample is diluted to exactly 100 cc. and arsenic determined on an aliquot portion.

Phosphates, Phosphoric Acid. Arsenic, in phosphoric acid, combined or free, cannot be determined in the usual way, as P_2O_b has a retarding effect upon the evolution of arsine, so that the results are invariably low, and small amounts of arsenic escaping detection. Arsenic, however, may be volatilized from phosphates and phosphoric acid, as arsenous chloride, AsCl₃, in a current of

hydrogen chloride by heating to boiling. One gram or more of the phosphate is placed in a small distilling flask, connected directly to a 6-in. coil condenser dipping into the Gutzeit bottle, containing 20 to 30 cc. of cold distilled water. A second bottle connected in series may be attached for safeguarding loss (this seldom occurs). Fifty cc. of concentrated hydrochloric acid are added to the sample and 5 grams of cuprous chloride. Arsenic is distilled into the Gutzeit bottle by heating the solution to boiling and passing a current of air through strong hydrochloric acid into the distilling flask by applying suction at the receiving end of the system. All of the arsenic will be found in the first 10 or 15 cc. of the distillate. Arsenic may now be evolved after addition of iron, stannous chloride and zinc, as directed in the procedure.

Salts, Sodium Chloride, Magnesium Sulphate, etc. One-gram samples are taken and dissolved in a little water and an equivalent of 6.3 grams of sulphuric acid added. The solution of iron and stannous chloride having been added, the run is made with 5 cc. of zinc shot, placed in the Gutzeit bottle.

Baking Powder, Other than Phosphate Baking Powder. A 10-gram sample is heated with 10 cc. hydrochloric acid, 10 cc. of ferric ammonium alum and 30 cc. of distilled water, until the starch hydrolyzes. 0.5 cc. of stannous chloride is added to the hot solution and the mixture washed into the Gutzeit apparatus. The required amount of zinc is added and the arsenic determined as usual.

Phosphate Baking Powders. Ten grams of the material mixed to a paste with about 50 cc. of hydrochloric acid are transferred to a small distilling flask with a few cc. of HCl. A tube, connected to a bottle of strong hydrochloric acid, passes into the mixture in the flask through a ground glass stopper. The flask is attached to a tube, which dips into water in a Gutzeit bottle. Two grams of cuprous chloride are added, the apparatus made tight and the flask immersed in boiling hot water. By aspirating air through the system into the Gutzeit bottle, which is water cooled, arsenic distills into the bottle and may be determined by the procedure outlined.

Arsenic in Organic Matter, Canned Goods, Meat, etc. The finely chopped, well-mixed sample is placed in a large flask and enough water added to produce a fluid mass. An equal quantity of concentrated hydrochloric acid and 1 to 2 grams of potassium chlorate are added. The flask is shaken to mix the material and it is then placed on the steam bath. Upon becoming hot, nascent chlorine is evolved and vigorously attacks the organic matter. Half-gram portions of potassium chlorate are added at five-minute intervals, shaking the flask frequently. When the organic material has decomposed and the solution becomes a pale yellow color, the mass is diluted with water and filtered. Arsenic will be found in the filtrate. A white, amorphous substance generally remains on the filter, when cadaver is being examined. The filtrate is diluted to a given volume and an aliquot portion taken for analysis. This is evaporated to near dryness to expel excess of acid and decompose chlorates. An equivalent of 4.7 grams of hydrochloric acid is added (three times this amount for the large apparatus), the volume of the solution made to about 30 cc., 10 cc. of ferric ammonium alum and 0.5 cc. of stannous chloride added, and the solution poured into the Gutzeit apparatus for the test as given below.

Procedure for Making the Test

For amounts of arsenic varying from 0.001 milligram to 0.02 milligram As₂O₂, the small apparatus is used. The volume of the solution should be 50 cc. It should contain an equivalent of 4.2 to 6.3 grams sulphuric acid and should have

Small Apparatus Large Apparatus .10 cm. long X .7.5 mm. Bore 10cm. long x 4 mm. Bore Constricted 6 cm from Upper End Strip Hg Cl2 Paper in Tube 5cm. X 1.25 cm. 6cm, x 1.5cm Glass Wool Moistened with Lead Solution 9 cm. x 15 cm 7cm x 1.25cm Dry Lead.... Acetate Pape 8-oz.Bottle 250cc.for Tests of oz. Bottle 60cc., for Tests of AS₂O₃ below AS₂0z over 0.05m**e** 05 mg AS203

Fig. 6.—Gutzeit Apparatus for Arsenic Determination.

about 0.1 gram equivalent of Fe₂O₃ reduced by 0.5 cc. of stannous chloride solution. Arsine is generated by adding one 5-cc. crucible of arsenic-free zinc shot, \(\frac{1}{3}\) to \(\frac{1}{6}\)-inch mesh. Temperature 75 to 80° F.

For amounts ranging from 0.02 to 0.5 milligram As₂O₃,¹ the large apparatus is used. The volume of the solution should be about 200 cc. and should contain an equivalent of 18.5 grams of sulphuric acid and should have 0.1 gram equivalent of Fe₂O₃, reduced by 0.5 cc. stannous chloride solution. Arsine is generated by adding one 12-cc. crucible of zinc shot (\frac{1}{3} to \frac{1}{3}-inch mesh.) The temperature should be 105° F. The sample taken should be of such size that a stain is obtained equivalent to that given by 0.1 to 0.5 milligram As₂O₃.

Lead acetate paper is placed in the lower portion of tube B; the upper portion of B contains glass wool moistened with lead acetate solution; the tube A contains the test strip of mercuric chloride paper. See Fig. 6. Immediately upon adding the required amount of zinc to the solution in the bottles, the connected tubes are put in position, as shown in the illustration, and the bottle gently shaken and allowed to stand for one hour for the small apparatus, forty minutes for the large. The test paper is removed, dipped in molten paraffine and compared with the standard stains. See Plate I.

Estimation of Per cent.

The milligram As₂O₃ stain $\times 100$ Weight of sample taken = % As₂O₃.


¹ It is advisable to use smaller samples when the arsenic content is over 0.3 milligram As₂O₃, as the longer stains are unreliable.

Ferrous iron prevents polarization between zinc and the acid and hence aids in the colution of arsine.

In the analysis of baking powders, bauxite, sodium or similar salts, the distillation method is recommended. See pages 50 and 51, "Phosphates," and "Phosphate baking powder."

Hydrochloric acid is used in place of sulphuric acid in cases where complete solution by the latter acid cannot be effected.

Standards and samples should be run under similar conditions, temperature, acidity, amount of zinc, volume of solution, etc. In place of zinc shot, zinc rods, cubes or discs may be used for generating arsine and hydrogen.



the control of the day the boat

The second secon

The Trail of Trail of The Trail of The Trail of Trail


.

and the second of the second o

and the second of the second o

and the standard section of the

and the state of t

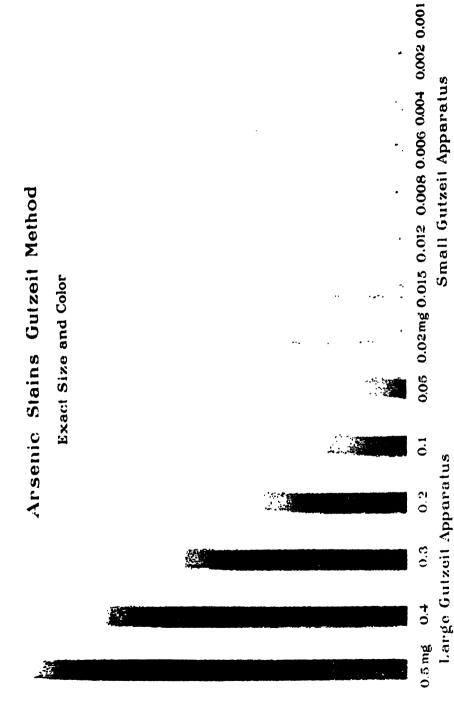

The numerals represent milligrams As 203 causing the stain

PUBLIC Line ASTOR, LPS

METHOD FOR ANALYSIS OF COMMERCIAL "ARSENIC," ARSENOUS OXIDE, As₂O₃

The following constituents may be commonly present as impurities, SiO₂, Sb₂O₂, Fe₂O₂, NiO, CoO, CaO, SO₂, Cu, Pb, and Zn.

Determination of Moisture

Two 10-gram samples are dried to constant weight in the oven at 100° C-Loss in weight = moisture.

Sulphuric Acid, H₂SO₄

The samples from the moisture determination are dissolved in concentrated hydrochloric acid, heating to boiling if necessary, and the samples diluted to 300 to 400 cc. Barium chloride solution is added in slight excess to the hot solution, the precipitate, BaSO₄, allowed to settle and filtered and the sulphate dried and ignited as usual.

$BaSO_4 \times 0.343 = SO_2$.

Determination of Arsenic as As₂O₃

Duplicate 5-gram samples are dissolved in 20 grams potassium carbonate in 60 cc. of hot water, by boiling until solution is effected. The samples are made up to 1 liter and aliquots of 100 cc. (=0.5 gram) taken for analysis. The solution is made faintly acid with hydrochloric acid, testing the solution with litmus paper or by adding methyl orange directly to the solution. An excess of bicarbonate is added and the arsenic titrated with tenth-normal iodine according to the standard procedure for arsenic. One cc. N/10 I=.004948 gram As₂O₂.

Residue upon Sublimation of As₂O₃. SiO₂, Pb, Cu, Fe₂O₃, NiO, CoO, Zn

Two 5-gram samples are weighed into tared porcelain crucibles and heated gently on sand baths with the sand banked carefully around the crucible so as to heat the entire receptacle. After the greater part of the arsenous oxide has volatilized, the crucible is ignited directly in the flame to a dull red heat, until fumes are no longer given off. The residue is weighed as total non-sub-limable residue.

Silica

The residues are transferred to beakers and treated with aqua regia, taken to dryness, and the silica dehydrated at 110° C. for an hour or more. The residue is taken up with hot dilute hydrochloric acid, boiled, and the silica filtered off, ignited, and weighed.

Lead and Copper

The filtrate from the silica is "gassed" with H₂S and the precipitate filtered off. The filtrate is put aside for determination of iron, etc. The precipitate is dissolved in hot dilute nitric acid, 2 to 3 cc. of concentrated sulphuric acid added,

the solution taken to SO₄ fumes, the cooled concentrate diluted to 20 or 30 cc., and the lead sulphate filtered off, ignited, and weighed as PbSO₄.

The filtrate from the lead sulphate containing the copper is treated with aluminum powder and the copper thrown out of solution; the excess of aluminum is dissolved with a few cc. of hydrochloric acid. The filtrate should be tested for copper with H₂S and the precipitate added to the copper thrown out by the aluminum. The copper on the filter is dissolved in hot dilute nitric acid, the extract evaporated to 2 or 3 cc., the acid neutralized with ammonia and then made acid with acetic, potassium iodide added and the liberated iodine titrated with standard thiosulphate solution according to the regular scheme for copper.

Iron, Nickel, Cobalt, and Zinc

The filtrate from the H₂S Group is boiled to expel the H₂S and the iron oxidized by addition of nitric acid and boiling. The iron (and alumina) is precipitated with ammonium hydroxide and the precipitate filtered off and washed several times with hot water. If alumina is suspected (light-colored precipitate) it may be determined by the difference method—ignition of the precipitate, weighing, and finally subtracting the iron found by titration with standard stannous chloride solution. The iron is dissolved in hydrochloric acid and titrated hot with stannous chloride solution.

The filtrate from the iron is boiled and a 1% alcoholic solution of dimethylglyoxime added to precipitate the nickel. The salt is filtered on a tared Gooch, the precipitate dried at 100° C., and weighed. The weight of the salt $\times 0.2032 = \text{Ni}$.

The filtrate from the nickel is boiled until all the alcohol has been driven off and the cobalt precipitated by addition of sodium hydroxide in excess filtered, ignited, and weighed as CoO.

The filtrate is made acid with hydrochloric acid, and then alkaline with ammonium hydroxide and colorless sodium sulphide solution added to precipitate the zinc. The mixture is boiled five to ten minutes, the precipitated 2nS allowed to settle, filtered off, and washed once or twice and then dissolved in hydrochloric acid and the zinc determined by titration directly with potassium ferrocyanide, or by converting to the carbonate by addition of potassium carbonate, filtered and washed free of alkali, the precipitate dissolved in a known amount of standard acid, and the excess acid titrated with standard caustic (methyl orange indicator) according to the procedure given for zinc. $H_2SO_4 \times 0.06665 = Zn$.

Antimony and Calcium Oxides

Two 15-gram samples are treated with 300 cc. of concentrated hydrochloric acid, boiled down to 50 cc. to expel the arsenic as AsCl₃, an equal amount of concentrated hydrochloric acid is added, and the last traces of arsenic precipitated by H₂S passed into the hot concentrated hydrochloric acid solution. The arsenous sulphide, As₂S₃, is filtered off. Antimony is precipitated by diluting the solution with an equal volume of water, the solution having been concentrated by boiling down to about 50 cc. The Sb₂S₃ is filtered off, washed several times with hot water, dissolved by washing through the filter with concentrated hydrochloric acid, and antimony determined in the strong hydrochloric acid solution by the potassium bromate method—addition of methyl orange indicator

and titration with standard potassium bromate added to the hot solution to the disappearance of the pink color of the indicator.

The filtrate from the antimony is concentrated, made slightly alkaline with ammonium hydroxide, and gased with hydrogen sulphide to remove iron, nickel, cobalt, zinc, chromium, and last traces of lead, etc. The filtrate is then concentrated and made acid with crystals of oxalic acid, boiled and methyl orange added and then ammonia drop by drop slowly until the indicator changes to an orange color. An excess of ammonium oxalate is now added and the beaker placed on the steam bath until the calcium oxalate has settled. The lime is now determined by filtering off the precipitate and washing, drying and igniting to CaO, or by titration with standard permanganate, according to the regular procedure for calcium.

The author wishes to acknowledge the assistance received from Mr. J. P. Kelly and Dr. F. E. Hale by review and criticism of this chapter.

the solution taken to SO₄ fumes, the cooled concentrate diluted to 20 or 30 cc., and the lead sulphate filtered off, ignited, and weighed as PbSO₄.

The filtrate from the lead sulphate containing the copper is treated with aluminum powder and the copper thrown out of solution; the excess of aluminum is dissolved with a few cc. of hydrochloric acid. The filtrate should be tested for copper with H_SS and the precipitate added to the copper thrown out by the aluminum. The copper on the filter is dissolved in hot dilute nitric acid, the extract evaporated to 2 or 3 cc., the acid neutralized with ammonia and then made acid with acetic, potassium iodide added and the liberated iodine titrated with standard thiosulphate solution according to the regular scheme for copper.

Iron, Nickel, Cobalt, and Zinc

The filtrate from the H_sS Group is boiled to expel the H_sS and the iron oxidized by addition of nitric acid and boiling. The iron (and alumina) is precipitated with ammonium hydroxide and the precipitate filtered off and washed several times with hot water. If alumina is suspected (light-colored precipitate) it may be determined by the difference method—ignition of the precipitate, weighing, and finally subtracting the iron found by titration with standard stannous chloride solution. The iron is dissolved in hydrochloric acid and titrated hot with stannous chloride solution.

The filtrate from the iron is boiled and a 1% alcoholic solution of dimethylglyoxime added to precipitate the nickel. The salt is filtered on a tared Gooch, the precipitate dried at 100° C., and weighed. The weight of the salt $\times 0.2032 = Ni$.

The filtrate from the nickel is boiled until all the alcohol has been driven off and the cobalt precipitated by addition of sodium hydroxide in excess filtered, ignited, and weighed as CoO.

The filtrate is made acid with hydrochloric acid, and then alkaline with ammonium hydroxide and colorless sodium sulphide solution added to precipitate the zinc. The mixture is boiled five to ten minutes, the precipitated 2nS allowed to settle, filtered off, and washed once or twice and then dissolved in hydrochloric acid and the zinc determined by titration directly with potassium ferrocyanide, or by converting to the carbonate by addition of potassium carbonate, filtered and washed free of alkali, the precipitate dissolved in a known amount of standard acid, and the excess acid titrated with standard caustic (methyl orange indicator) according to the procedure given for zinc. $H_2SO_4 \times 0.06665 = Zn$.

Antimony and Calcium Oxides

Two 15-gram samples are treated with 300 cc. of concentrated hydrochloric acid, boiled down to 50 cc. to expel the arsenic as AsCl₂, an equal amount of concentrated hydrochloric acid is added, and the last traces of arsenic precipitated by H₂S passed into the hot concentrated hydrochloric acid solution. The arsenous sulphide, As₂S₂, is filtered off. Antimony is precipitated by diluting the solution with an equal volume of water, the solution having been concentrated by boiling down to about 50 cc. The Sb₂S₂ is filtered off, washed several times with hot water, dissolved by washing through the filter with concentrated hydrochloric acid, and antimony determined in the strong hydrochloric acid solution by the potassium bromate method—addition of methyl orange indicator

and titration with standard potassium bromate added to the hot solution to the

disappearance of the pink color of the indicator.

The filtrate from the antimony is concentrated, made slightly alkaline with ammonium hydroxide, and gased with hydrogen sulphide to remove iron, nickel, cobalt, zinc, chromium, and last traces of lead, etc. The filtrate is then concentrated and made acid with crystals of oxalic acid, boiled and methyl orange added and then ammonia drop by drop slowly until the indicator changes to an orange color. An excess of ammonium oxalate is now added and the beaker placed on the steam bath until the calcium oxalate has settled. The lime is now determined by filtering off the precipitate and washing, drying and igniting to CaO, or by titration with standard permanganate, according to the regular procedure for calcium.

The author wishes to acknowledge the assistance received from Mr. J. P. Kelly and Dr. F. E. Hale by review and criticism of this chapter.

BARIUM

WILFRED W. SCOTT

Ba, at.wt. 137.37; sp.gr. 3.78; m.p. 850° C.; volatile at 950° C.; oxides, BaO, BaO₃.

DETECTION

Barium is precipitated as the carbonate together with strontium and calcium, by addition of ammonium hydroxide and ammonium carbonate to the filtrate of the ammonium sulphide group. It is separated from strontium and calcium by precipitation as yellow barium chromate, BaCrO₄, from a slightly acetic acid solution.

Saturated solutions of calcium or strontium sulphates precipitate white barium sulphate, BaSO₄, from its chloride or nitrate or acetate solution, barium sulphate being the least soluble of the alkaline earth sulphates.

Soluble chromates precipitate yellow barium chromate from its neutral or slightly acetic acid solution, insoluble in water, moderately soluble in chromic acid, soluble in hydrochloric or nitric acid.

Fluosilicic acid, H₂SiF₆, precipitates white, crystalline barium fluosilicate, BaSiF₆, sparingly soluble in acetic acid, insoluble in alcohol. (The fluosilicates of calcium and strontium are soluble.)

Flame. Barium compounds color the flame yellowish green, which appears blue through green glass.

Spectrum. Three characteristic green bands (α, β, γ) .

Barium sulphate is precipitated by addition of a soluble sulphate to a solution of a barium salt. The compound is extremely insoluble in water and in dilute acids (soluble in hot concentrated sulphuric acid). The sulphate is readily distinguished from lead sulphate by the fact that the latter is soluble in ammonium salts, whereas barium sulphate is practically insoluble.

ESTIMATION

The determination of barium is required in the valuation of its ores, barite-heavy spar, BaSO₄; witherite, BaCO₁; baryto calcite, BaCO₂CaCO₂. It is determined in certain white mixed paints and colored pigments, Venetian, Hamburg or Dutch whites, chrome paints, etc. In analysis of Paris green, baryta insecticides, putty, asphalt, dressings and pavement surfacings. It may be found as an adulterant in foods, wood preservatives, filler in rubber, rope, fabrics. It is determined in salts of barium. The nitrate is used in pyrotechny, in mixtures for green fire.

Preparation and Solution of the Sample

Compounds of barium, with the exception of the sulphate, BaSO₄, are soluble in hydrochloric and nitric acids. The sulphate is soluble in hot concen-

¹ See Preliminary Tests under Separations.

trated sulphuric acid, but is reprecipitated upon dilution of the solution. The sulphate is best fused with sodium carbonate, which transposes the compound to barium carbonate; sodium sulphate may now be leached out with water and the residue, BaCO₂, then dissolved in hydrochloric acid.

Solution of Ores. Sulphates. 0.5 to 1 gram of the finely divided ore is fused with 3 to 5 grams of sodium and potassium carbonate mix, 2:1, or sodium carbonate alone, in a platinum dish. (Prolonged fusion is not necessary.) The melt is cooled and then extracted with hot water to dissolve out the alkali sulphates. Barium carbonate, together with the other insoluble carbonates, may now be dissolved by hot dilute hydrochloric acid. From this solution barium may be precipitated by addition of sulphuric acid. If it is desired to separate barium along with strontium, calcium, and magnesium, the members of the preceding groups are removed by H₂S in acid and in ammoniacal solution, as directed under "Separations."

Sulphides. The ore is oxidized, as directed for pyrites under the subject of sulphur. After the removal of the soluble sulphates, the residue, containing silica, barium, and small amounts of insoluble oxides, is fused and dissolved according to the procedure for sulphates.

Carbonates. In absence of sulphates the material may be dissolved with hydrochloric acid, taken to dryness to dehydrate silica and after heating for an hour in the steam oven (110°±) the residue is extracted with dilute hydrochloric acid and filtered. The filtrate is examined for barium according to one of the procedures given later.

Salts Soluble in Water. Nitrates, chlorides, acetates, etc., are dissolved with water slightly acidulated with hydrochloric acid.

Material Containing Organic Matter. The substance is roasted to destroy organic matter before treatment with acids or by fusion with the alkali carbonates.

The Insoluble Residue remaining from the acid treatment of an ore may contain barium sulphate in addition to silica, etc. The filter containing this residue is burned and the ash weighed. Silica is now volatilized by addition of hydrofluoric acid with a few drops of sulphuric acid, and evaporation to dryness. If an insoluble substance still remains after taking up the remaining residue with dilute hydrochloric acid, barium sulphate is indicated. This is treated according to the method given for sulphates.

NOTE. The insoluble substance remaining is frequently ignited and weighed as barium sulphate without fusion with the carbonate.

SEPARATIONS

The Alkaline Earths

Preliminary Considerations. In the determination of barium, calcium, and strontium, the following causes may lead to loss of the elements sought:

•a. Presence of Phosphates. Phosphoric acid, free or combined, has a decided influence upon the determination of the members of this group. Combined as phosphate it will cause the complete precipitation of barium, calcium, and strontium, along with iron, alumina, etc., upon making the solution alkaline for removal of the ammonium sulphide group. It is a common practice to hold up the iron+alumina by means of tartaric, citric, or other organic acids before making ammoniacal for precipitation of this group as oxalates, or again the basic acetate method is used for precipitation of iron and alumina; calcium,

barium, and strontium going into solution. These procedures may be satisfactory for the analysis of phosphate rock and similar products, but do not cope with the difficulty when large amounts of phosphates are present. In samples containing free phosphoric acid, barium, calcium, and strontium, present in small amounts, may remain in solution in presence of sulphates or oxalates. Appreciable amounts of calcium, 1% or more, may escape detection by the usual method of precipitation by ammonium oxalate added to the alkaline solution, on account of this interference, so that the removal of phosphoric acid before precipitation of this group is frequently necessary. This may be accomplished by addition of potassium carbonate in sufficient excess to combine completely with the phosphoric acid and form carbonates with the bases. The material taken to dryness is fused with additional potassium carbonate in an iron crucible, and the fusion leached with hot water—sodium phosphate dissolves and the carbonates of the heavy metals remain insoluble.

- b. Another source of loss is the presence of sulphates, either in the original material or by intentional or accidental addition, in the latter case due to the oxidation of hydrogen sulphide, which has been passed into the solution during the removal of elements of the hydrogen sulphide and ammonium sulphide groups, barium and strontium sulphate being precipitated along with these members. A potassium carbonate fusion will form K₂SO₄, which may be leached out with water.
- c. Loss may be caused by occlusion of barium, calcium, strontium, and magnesium by the gelatinous precipitates Fe(OH)₃, Al(OH)₂, etc. A double precipitation of these compounds should be made if considerable amounts are present.
- d. A large excess of ammonium salts, which accumulate during the preliminary separations, will prevent precipitation of the alkaline earths. This can be avoided by using the necessary care required for accurate work, the addition of reagents by means of burettes or according to definite measurements in graduates, etc. Careless addition of large amounts of ammonium hydroxide and hydrochloric acid should be guarded against. In case large amounts of ammonium chloride are present, time is frequently saved by a repetition of the separations. Ammonium chloride may be expelled by heating the material, taken to dryness in a large platinum dish, the ammonium salts being volatilized.

e. Carbon dioxide absorbed by ammonium hydroxide from the air will precipitate the alkaline earths with the ammonium sulphide group.

Direct Precipitation on Original Sample. For the determination of barium, calcium, and strontium, it is advisable to take a fresh sample, rather than one that has been previously employed for the estimation of the hydrogen sulphide and ammonium sulphide groups, as is evident from the statements made above. The alkaline earths are isolated by being converted to the insoluble sulphates and separations effected as given later under Sulphate Method.

Preliminary Tests. Much time may be saved by making a preliminary test for barium, strontium, and calcium by means of the spectroscope and avoiding unnecessary separations.

By means of the spectroscope with the use of the ordinary Bunsen flame exceedingly minute amounts of calcium, strontium and barium

PULL ASTON

Emmissions-Spectra.

Aa B G G HeII D Eb Solar Spectrum Nitrogen (Band Spectrum) Oxygen Hydrogen Barium Calcium Strontium Indium Thallium Rubidium Caesium Potassium Lithium 8odium

Plate II.

The second secon

by the arc spectra
l to the positive
stable resistance
200 volts and
t 0.002 milli
of barium,
cium shows
cen them;
barium
v bright
518.4
trum
reen

he d

nf tale Afkamer i i les sons Mazer l'in l'illig à sel-

 $\frac{\partial u}{\partial x} = \frac{\partial u}{\partial x} + \frac{\partial u}{\partial x} +$

Solar Spectrum

Nitrogen
(Band
Spectrum)

Oxyge

H

may be detected per cc. The test is very much more delicate by the arc spectra method. The liquid containing the substance is connected to the positive pole and an iridium needle is connected by means of an adjustable resistance of 300 to 500 ohms to the negative pole. An E.M.F. of 100 to 200 volts and 1 ampere current are required. By the arc it is possible to detect 0.002 milligram of calcium, 0.003 milligram of strontium, 0.006 milligram of barium, 0.1 milligram of magnesium per cc. In these concentrations, calcium shows one brilliant line (423 $\mu\mu$), a bright line (616 $\mu\mu$), and a faint line between them; strontium two bright lines (422 and 461 $\mu\mu$) and two fairly bright lines; barium two brilliant lines (455 and 493 $\mu\mu$), two other bright lines, and a fairly bright one; and magnesium a brilliant band composed of three lines (516.8 to 518.4 $\mu\mu$), as well as a fairly bright line further towards the violet end of the spectrum

The flame test may be of value in absence of sodium; barium giving a green flame, strontium a brilliant scarlet, and calcium an orange red.

Separation from Members of Previous Groups. The members of the previous groups may be removed by precipitation as sulphides by H₂S passed into the acid and then the alkaline solutions, the combined filtrates concentrated to about 300 cc. and made slightly acid with hydrochloric acid. The following procedures for isolation of barium from magnesium and the alkalies and from members of the alkaline earth group may be necessary before precipitation in its final form. The methods of separation will apply to the analyses of the elements mentioned so that the details of procedure will not be given elsewhere.

Separation of the Alkaline Earths from Magnesium and the Alkalies. Two general procedures will cover conditions commonly met with in analytical work:

A. Oxalate Method. Applicable in presence of comparatively large portions of calcium. The acid solution containing not over 1 gram of the mixed oxides is brought to a volume of 350 cc. and for every 0.1 gram of magnesium present about 1 gram of ammonium chloride is added, unless already present. Sufficient oxalic acid is added to completely precipitate the barium, calcium, and strontium. 2 ($H_2C_2O_4 \cdot 2H_2O = 126.04$, Ba = 137.37, Ca = 40.07, Sr = 87.63.) The solution is slowly neutralized by addition, drop by drop, of dilute ammonium hydroxide (1:10), methyl orange being used as indicator. About $\frac{1}{2}$ gram of oxalic acid is now added in excess, the solution again made alkaline with ammonium hydroxide, and allowed to settle for at least two hours. The precipitate is filtered off and washed with water containing 1% ammonium oxalate, faintly alkaline with ammonia.

The precipitate contains all the calcium and practically all of the barium and strontium. If Mg is present in amounts of 10 to 15 times that of the alkaline earths a double precipitation is necessary, to remove it completely from this group. The oxalates are dissolved in hydrochloric acid and reprecipitated with ammonium oxalate in alkaline solution.

The filtrate contains magnesium and the alkalies. Traces of barium and strontium may be present. If the sample contains a comparatively large proportion of barium and strontium, the filtrate is evaporated to dryness, the ammonium salts expelled by gentle ignition of the residue, and the Ba and

¹E. H. Riesenfeld and G. Pfützer, Ber., 1913, 46, 3140-3144; Analyst, 1913, 38, 584.

² Calcium and strontium will slowly precipitate in the oxalic acid solution. Ba oxalate will precipitate upon making the solution alkaline.

Sr recovered as sulphates according to the method described below. Magnesium is precipitated as magnesium ammonium phosphate from the filtrate.

The oxalates of barium, calcium, and strontium are ignited to oxides, in which form they may be readily converted to chlorides by dissolving in hydrochloric acid, or to nitrates by nitric acid.

B. Sulphate Method. Applicable in presence of comparatively large proportions of barium, strontium, or magnesium. The solution containing the alkaline earths, magnesium and the alkalies is evaporated to dryness and about 5 cc. concentrated sulphuric acid added, followed by 50 cc. of 95% alcohol. The sulphates 1 of barium, calcium, and strontium, are allowed to settle, and then filtered onto an S. and S. No. 589 ashless filter paper and washed with alcohol until free of magnesium sulphate. In presence of large amounts of magnesium as in case of analyses of Epsom salts and other magnesium salts it will be necessary to extract the precipitate by adding a small amount of water, then sufficient 95% alcohol to make the solution contain 50% alcohol and filter from the residue. Magnesium is determined in the filtrate.

The residue containing barium, calcium, and strontium as sulphate is fused with 10 parts of potassium carbonate or sodium acid carbonate until the fusion becomes a clear molten mass, a deep platinum crucible being used for the fusion. A platinum wire is inserted and the mass allowed to solidify. The fusion may be removed by again heating until it begins to melt around the surface next to the crucible, when it may be lifted out on the wire. The mass is extracted with hot water and filtered, Na₂SO₄ going into the solution and the carbonates of barium, strontium, and calcium remaining insoluble. The carbonates should dissolve completely in hydrochloric acid or nitric acid, otherwise the decomposition has not been complete, and a second fusion of this insoluble residue will be necessary.

Separation of the Alkaline Earths from One Another. This separation may be effected by either of the following processes:

- 1. Barium is separated in acetic acid solution as a chromate from strontium and calcium; strontium is separated as a nitrate * from calcium in ether-alcohol or amyl alcohol.
- 2. The three nitrates are treated with ether-alcohol in which barium and strontium nitrates are insoluble and calcium dissolves; the barium is now separated from strontium by ammonium chromate.

Procedures. 1. (a) Separation of Barium from Strontium (and from Calcium). In presence of an excess of ammonium chromate, barium is precipitated from solutions, slightly acid with acetic acid, as barium chromate (appreciably soluble in free acetic acid), whereas strontium and calcium remain in solution.

The mixed oxides or carbonates are dissolved in the least amount of dilute hydrochloric acid and the excess of acid expelled by evaporation to near dryness. The residue is taken up in about 300 cc. of water and 5-6 drops of acetic acid (sp.gr. 1.065) together with sufficient ammonium acetate (30% solution) to neutralize any free mineral acid present. The solution is heated and an excess of ammonium chromate (10% neutral sol.) added (10 cc. usually sufficient).

¹Solubility of BaSO₄=0.17 milligram, CaSO₄=179 milligram, SrSO₄=11.4 milligrams per 100 cc. sol. cold.

² Method of Stromayer and Rose. H. Rose, Pogg. Ann., 110, 292, (1860).

³ The solution is prepared by adding NH₄OH to a solution of (NH₄)₂Cr₂O₇ until yellow. The solution should be left acid rather than alkaline.

The precipitate of barium chromate is allowed to settle for an hour and filtered off on a small filter and washed with water containing ammonium chromate until free of soluble strontium and calcium (test—addition of NH₄OH and (NH₄)₂CO₂ produces no cloudiness), and then with water until practically free of ammonium chromate (e.g., only slight reddish brown color with silver nitrate solution).

To separate any occluded precipitate of strontium or calcium the filter paper is pierced and the precipitate rinsed into a beaker with warm dilute nitric acid (sp.gr. 1.20) (2 cc. usually are sufficient). The solution is diluted to about 200 cc. and boiled. About 5 cc. of ammonium acetate, or enough to neutralize the free HNO₃, are added to the hot solution and then sufficient ammonium chromate to neutralize the free acetic acid, 10 cc. usually sufficient. The washing, as above indicated, is repeated. Barium is completely precipitated and may be determined either as a chromate or a sulphate or by a volumetric procedure. Strontium and calcium are in the filtrates and may be separated as follows:

(b) Separation of Strontium from Calcium. The method depends upon the insolubility of strontium nitrate and the solubility of calcium nitrate in a mixture of ether-alcohol, 1:1.

Solubility of SrNO₂ = 1 part SrNO₂ in 60,000 parts of the mixture. Ca easily soluble.

If the solution is a filtrate from barium, 1 cc. of nitric acid is added and the solution heated and made alkaline with ammonium hydroxide followed immediately with ammonium carbonate, the carbonates of strontium (together with some SrCrO₄) and calcium will precipitate. The precipitate is dissolved in hydrochloric acid and reprecipitated from a hot solution with ammonium hydroxide and ammonium carbonate. The precipitate, SrCO₂ and CaCO₃, is washed once with hot water and is then dissolved in the least amount of nitric acid, washed into a small casserole, evaporated to dryness and heated for an hour at 140 to 160° C. in an oven, or at 110° C. over night. The dry mass is pulverized and mixed with 10 cc. of ether-alcohol (absolute alcohol, one part, ether-anhydrous, one part). Several extractions are thus made, the extracts being decanted off into a flask. The residue is again dried in an oven at 140 to 160° C., then pulverized and washed into the flask with the ether-alcohol mixture and digested for several hours with frequent shaking of the flask. The residue is washed onto a filter moistened with ether-alcohol mixture. Strontium nitrate, Sr(NO₂)₂, remains insoluble, and may be dissolved in water and determined gravimetrically as a sulphate, oxide, or carbonate or volumetrically. Calcium is in the filtrate and may be determined gravimetrically as an oxide or volumetrically.

Instead of using a mixture of ether-alcohol, amyl alcohol may be used (hood), the mixture being kept at boiling temperature to dehydrate the alcohol to prevent solution of strontium $(b.p.=130^{\circ} \text{ C.})$.

2. Separation of Barium and Strontium from Calcium.¹ The procedure depends upon the insolubility of barium nitrate, (BaNO₃)₂, and strontium nitrate, Sr(NO₃)₂, in a mixture of anhydrous ether and absolute alcohol or anhydrous amyl alcohol, whereas Ca(NO₃)₂ dissolves.

The mixed oxides or carbonates are dissolved in nitric acid and taken to dryness in a beaker or Erlenmeyer flask, and heated for an hour or more in an ¹See Fresenius, Z. anal. Chem., 29, 413-430 (1890).

oven at 140 to 160° C. Upon cooling, the mixture is treated with ten times its weight of ether-alcohol mixture and digested, cold, in the covered beaker or corked flask for about two hours with frequent stirring. An equal volume of ether is now added and the digestion continued for several hours longer. The residue is washed by decantation with ether and alcohol mixture until calcium is removed (test—no residue on platinum foil with drop of filtrate evaporated to dryness).

Separation of Barium from Strontium. The dry mixed chlorides are dissolved in the least possible amount of water (0.2 cc., or more if necessary) the solution warmed, then cooled. More water is added if crystals appear. (The solution should be saturated.) A mixture of 4:1 of HCl (33%) and ether is added dropwise with stirring. Sufficient reagent is added to precipitate BaCl₂ and dissolve SrCl₂. The mixture is decanted on an asbestos filter and washed with the HCl-ether reagent. The BaCl₂ is dried at 150° C. and weighed. (Method of Gooch and Soderman.)

Barium and strontium may be separated by precipitation of barium as a chromate, the nitrate residue being dissolved in water and barium precipitated

according to directions given under Procedure No. 1.

Amyl alcohol may be used in place of ether-alcohol by digesting the nitrates in a boiling solution (130° C.), calcium going into solution and barium and strontium remaining insoluble as nitrates.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF BARIUM

For reasons given under "Preliminary Considerations," it is advisable to take a special sample for the determination of barium that has not undergone treatment with hydrogen sulphide or ammonium hydroxide, since these may cause the loss of barium as stated.

Barium in Insoluble Residue. In the complete analysis of ores the residue remaining insoluble in acids is composed largely of silica, together with difficultly soluble substances, among which is barium sulphate. This residue is best fused in a platinum dish with sodium carbonate or a mixture of sodium and potassium carbonates (long fusion is not necessary). The cooled mass is digested with hot water to remove the soluble sodium compounds, silicate being included. Barium, together with the heavy metals, remains insoluble as carbonate and may be filtered off. The residue is now treated with dilute ammonia water to remove the adhering sulphates (testing the filtrate with hydrochloric acid and barium chloride solution; the washing being complete when no white precipitate of barium sulphate forms). The carbonates are washed off the filter into a 500-cc. beaker. the clinging carbonate being dissolved by pouring a few cc. of dilute, 1:1, hydrochloric acid on the paper placed in the funnel. This extract is added to the precipitate in the beaker and the latter covered to prevent loss by spattering. Additional hydrochloric acid is cautiously added so that the precipitate completely dissolves and the solution contains about 10 cc. of free hydrochloric acid (sp.gr. 1.2). Barium is precipitated from this solution best as a sulphate according to directions given later.

Silicates. One gram of the finely pulverized sample is treated with 10

cc. of dilute sulphuric acid, 1:4, and 5 cc. of strong hydrofluoric acid. The mixture, evaporated to small bulk on the steam bath, is taken to SO₄ fumes on the hot plate. Additional sulphuric acid and hydrofluoric acid are used if required. By this treatment the silica is expelled and barium, together with other insoluble sulphates, will remain upon the filter when the residue is treated with water and filtered. Lead sulphate, if present, may be removed by washing the residue with a solution of ammonium acetate. Barium sulphate may be purified by fusion with potassium carbonate as above directed or by dissolving in hot concentrated sulphuric acid, and precipitating again as BaSO₄ by dilution.

Ores may be decomposed by either of the above methods or a combination of the two. Sulphide ores require roasting to oxidize the sulphide to sulphate.

Determination of Barium as a Chromate

A preliminary spectroscopic test has indicated whether a separation from calcium and strontium is necessary. If these are present, barium is separated along with strontium from calcium as the nitrate in presence of alcohol-ether mixture, according to directions given under "Separations." Barium is now precipitated as the chromate, BaCrO₄, from a neutral or slightly acetic acid solution, strontium remaining in solution.

Precipitation of Barium Chromate. If barium is present in the form of nitrate, together with strontium, the mixed nitrates are evaporated to dryness and then taken up with water. About 10 cc. ammonium acetate (300 grams NH₄C₂H₄O₂ neutralized with NH₄OH+H₂O to make up to 1000 cc.) added and the solution heated to boiling. Five cc. of 20% ammonium bichromate are added drop by drop with constant stirring and the precipitate allowed to settle until cold. The solution is decanted off from the precipitate through a filter and washed by decantation with dilute (0.5%) solution of ammonium acetate, until the excess chromate is removed, as indicated by the filtrate passing through uncolored. If much strontium was originally present, a double precipitation is necessary, otherwise the precipitate may be filtered directly into a Gooch crucible and ignited, the following paragraph directions being omitted.

Purification from Strontium. The precipitate is dissolved from the filter by running through dilute (1:5) warm nitric acid, poured upon the chromate, catching the solution in the beaker in which the precipitation was made; the least amount of acid necessary to accomplish this being used and the filter washed with a little warm water. Ammonium hydroxide is now added to the solution, cautiously, until a slight permanent precipitate forms and then 10 cc. of ammonium acetate solution added with constant stirring and the mixture heated to boiling. The precipitate is allowed to settle until the solution is cold and then filtered and washed by decantation as before, a Gooch crucible being used to catch the precipitate.

Ignition. The precipitate is washed once with dilute alcohol, 1:10, dried at 110° C., and ignited, gently at first and then to a dull red heat until the color of the chromate is uniform. It is advisable to cover the crucible at first and then after five minutes to remove the cover.

$$BaCrO_4 \times 0.6051 = BaO$$
. $BaCrO_4 \times 0.5420 = Ba$.

Notes. The use of sodium hydrate or acetate in place of the ammonium hydroxide and acetate is sometimes recommended, owing to the slight solubility of

BaCrO₄ in ammonium salts, as seen by the following table, approximate figures being given:

100,000 parts of cold water dissolves	0.38 parts BaCrO ₄
100,000 parts of hot water dissolves	4.35 parts BaCrO
100,000 of 0.5% solution of NH ₄ Cl dissolves	4.35 parts BaCrO ₄
100,000 of 0.5% solution of NH ₄ NO ₂ dissolves	2.22 parts BaCrO
100,000 of 0.75% solution of NH ₄ C ₂ H ₃ O ₂ dissolves	2.00 parts BaCrO
100,000 of 1.5% solution of NH ₄ C ₂ H ₂ O ₂ dissolves	4.12 parts BaCrO
100,000 of 1% acetic acid dissolves	20.73 parts BaCrO ₄

Although the solvent action of ammonium salts is practically negligible under conditions of analysis given above, the solvent action of free acetic acid is of importance. so that it is necessary to neutralize or eliminate free mineral acids before addition of the acetate salt.

The edges of the BaCrO₄ precipitate upon drying may appear green, owing to the action of alcohol; upon ignition, however, the yellow chromate is obtained.

Color orange yellow, when hot, fades to a light canary yellow upon cooling.

BaCrO₄, mol.wt., 253.47; sp.gr., 4.498^{15°}; 100 cc. H₂O sol. cold will dissolve 0.00038^{18°} gram, hot dissolves 0.0043 gram; soluble in HCl, HNO₃, yellow rhombic plates.

Determination of Barium by Precipitation as Sulphate, BaSO₄

This method depends upon the insolubility of barium sulphate in water and in very dilute hydrochloric acid or sulphuric acid, one gram of the salt requiring about 344,000 cc. of hot water to effect solution.

Reaction, $BaCl_2 + H_2SO_4 = BaSO_4 + 2HCl$.

BaSO₄, mol.wt., 233,44; sp.gr., 4.47 and 4.33; m.p., 1580° (amorphous decomposes); H₂O dissolves 0.0001720° gram and 0.0003³⁴° per 100 cc. 3% HCl dissolves 0.0036 gram. Soluble in conc. H.SO. White, rhombic and amorphous forms.

Procedure. The slightly hydrochloric acid solution of barium chloride, prepared according to directions given, is heated to boiling (volume about 200-300 cc.) and a slight excess of dilute hot sulphuric acid added. The precipitate is settled on the water bath and the clear solution then decanted through a weighed Gooch crucible or through an ashless filter paper (S. and S. 590 quality). The precipitate is transferred to the Gooch (or paper), and washed twice with very dilute sulphuric acid solution (0.5% H₂SO₄), and finally with hot water until free of acid. The precipitate is dried and ignited, at first gently and then over a good flame to a cherry red heat, for half an hour. The residue is weighed as barium sulphate, BaSO.

$$BaSO_4 \times 0.5884 = Ba$$
, or $\times 0.6569 = BaO$, or $\times 0.8455 = BaCO_3$.

Notes. The determination of barium is the reciprocal of the determination of sulphur or sulphuric acid. Precautions and directions given for the sulphur precipitation apply here also, with the exception that dilute sulphuric acid is used as

the precipitating reagent in place of barium chloride.

The author found that precipitation of barium sulphate in a large volume of cold solution containing 10 cc. of concentrated hydrochloric acid per 1600 cc. of solution, by adding a slight excess of cold dilute sulphuric acid in a fine stream, exactly in the manner that barium chloride solution is added in the precipitation of sulphur, and allowing the precipitate to settle, at 100m temperature, for several hours (preferably over night), gives a precipitate that is pure and does not pass through the Gooch asbestos mat. We refer to the chapter on Sulphur for directions for filtering, washing, and ignition of the residue.

VOLUMETRIC METHODS FOR THE DETERMINATION OF BARIUM

Titration of the Barium Salt with Dichromate

This method is of value for an approximation of the amount of barium present in a solution that may also contain calcium, strontium, and magnesium or the alkalies. It depends upon the reaction

 $2BaCl_2+K_2Cr_2O_7+H_2O=2BaCrO_4+2KCl+2HCl$.

 $N/10~K_{2}Cr_{2}O_{7}$ (precipitation purposes) contains 7.355 grams pure salt per liter.

Procedure. The solution containing the barium is treated with ammonia until it just smells of it. (If an excess of ammonia is present the solution is made faintly acid with acetic acid.) It is then heated to about 70° C. and the standard dichromate added, with stirring until all the barium is precipitated and the clear supernatant solution is a faint yellow color from the slight excess of the reagent. For accurate work it is advisable to titrate the precipitate formed by one of the methods given below. One cc. $K_1Cr_2O_7=0.00687$ gram Ba. (Note reaction given above.)

NOTE. An excess of potassium dichromate may be added, the precipitate filtered off, washed and the excess of dichromate determined as stated below.

Reduction of the Chromate with Ferrous Salt and Titration with Permanganate

Ferrous sulphate reacts with barium chromate as follows:

 $2BaCrO_4 + 6FeSO_4 + 8H_2SO_4 = 3Fe_2(SO_4)_3 + Cr_2(SO_4)_3 + 2BaSO_4 + 8H_2O_4$

An excess of ferrous salt solution is added and the excess determined by titration with $N/10 \text{ KMnO}_4$ solution. Fe = $\frac{1}{4}$ Ba.

Reagents. N/10 solution of KMnO₄. N/10 FeSO₄ (27.81 grams per liter) or FeSO₄ (NH₄)₂SO₄ (39.226 grams per liter). One cc. =0.004579 Ba.

Procedure. The well-washed precipitate of barium chromate is dissolved in an excess of standard N/10 ferrous ammonium sulphate solution containing free sulphuric acid. The excess ferrous salt is titrated with standard N/10 potassium permanganate solution.

(Cc. N/10 ferrous solution minus cc. permanganate titration) multiplied by 0.004579 gives grams barium in the solution. Iron factor to barium is 0.8187.

Potassium Iodide Method

The procedure depends upon the reactions:

- 1. $2BaCrO_4+6KI+16HCl=2BaCl_2+2CrCl_3+6KCl+8H_2O+6I$.
- 2. $3I_2+6Na_2S_2O_3=6NaI+3Na_2S_4O_6$.

Procedure. The precipitate, BaCrO₄, is dissolved in 50 to 100 cc. of dilute hydrochloric acid and about 2 grams of solid potassium iodide salt added and allowed to react about ten minutes. The liberated iodine is now titrated

with N/10 thiosulphate. Near the end of the titration starch solution is added and followed by N/10 thiosulphate until the color disappears.

One cc. $N/10 \text{ Na}_2S_2O_2 = 0.004579 \text{ gram Ba.}$

Titration of Barium Carbonate with Standard Acid

To the well-washed barium carbonate, BaCO₃, an excess N/10 H₂SO₄ is added and the excess acid determined.

One cc. N/10 acid = 0.00687 gram Ba.

ANALYSIS OF BARYTES AND WITHERITE

Barytes or heavy spar is a variety of native barium sulphate, and witherite a native barium carbonate. These minerals are typical examples of barium-bearing ores. The analysis may involve the determination of barium and calcium sulphates or carbonates, magnesia, iron and aluminum oxides and moisture. Traces of lead, copper, and zinc may be present, as well as sulphide, sulphur and fluorine in fluorspar. The following is an approximate composition of a high-grade sample:

$$\begin{array}{c} {\rm BaSO_4}\!=\!96\%,\ {\rm CaCO_3}\!=\!1.5\%,\ {\rm MgCO_3}\!=\!0.3\%,\ {\rm SiO_2}\!=\!0.5\%,\ {\rm Al_2O_3}\!=\!0.5\%,\\ {\rm Fe_2O_3}\!=\!0.2\%,\ {\rm H_2O}\!=\!0.5\%. \end{array}$$

For complete analysis treat as directed under preparation of the sample.

Procedure for Commercial Valuation of the Ore

Total BaO as Barium Sulphate

One gram of the finely pulverized sample is weighed into a platinum crucible (35 cc. capacity), mixed with 8 grams of sodium carbonate, fused for twenty minutes over a Bunsen burner and twenty minutes over a Méker burner or blast lamp. The fusion is leached out with 200 cc. hot water in a 250 cc. beaker, the barium carbonate filtered off, washed thoroughly with hot dilute sodium carbonate solution (2 grams per liter) until no test for sulphate is obtained. The barium carbonate is dissolved from the paper with hot dilute hydrochloric acid, catching solution in a 600 cc. beaker and the paper thoroughly washed. The solution is neutralized with ammonium hydroxide, made slightly acid with hydrochloric acid (1-1.5 cc.), heated to boiling and the barium precipitated with hot ammonium sulphate solution (30 grams per liter). After standing on a steam plate for four hours, the barium sulphate is filtered off on a weighed platinum gooch crucible, ignited for 35 minutes and weighed.

The filtrate containing the SO₂ and washings from the barium carbonate is acidified with hydrochloric acid, 1-1.5 cc. excess heated to boiling, the sulphates precipitated with hot 10% barium chloride solution and proceeding as above.

¹ Standard Method of New Jersey Zinc Company.

Silica

One gram of the finely pulverized sample is weighed into a platinum crucible and fused with sodium carbonate as under Total BaO as Barium Sulphate. The melt is detached from the crucible, placed together with the crucible and cover in a 150 cc. platinum dish and covered with hot water. Leaching is carried on until disintegration of the fusion is complete. The residue, composed of mixed carbonates, silicates, etc., is filtered off, catching filtrate in a 400 cc. beaker, and washed thoroughly with hot water containing sodium carbonate. The residue on the paper is dissolved with hot dilute hydrochloric acid, catching in a separate 400 cc. beaker, and the paper thoroughly washed. This paper containing a portion of the silica is placed in a platinum crucible and retained.

The first filtrate, from the barium carbonate, is acidified and evaporated to dryness to dehydrate the silica. The second solution, containing the barium in solution as chloride is also evaporated to dryness. After dehydrating, the residues in both beakers are taken up with hydrochloric acid and filtered. They may be filtered through the same paper, washing the paper thoroughly before passing the second solution. Following the passage of the second solution, the paper is thoroughly washed, added to the original paper in the crucible, ignited and weighed. The contents of the crucible are treated with hydrofluoric and sulphuric acids, evaporated to dryness, ignited and weighed. The difference in weight is amount of silica present.

Iron and Alumina

The two filtrates from the silica determination are nearly neutralized with ammonium hydroxide (acidity 1 cc. hydrochloric acid), and combined. Ammonium sulphate solution is added to assure complete precipitation of all the barium, the beaker placed on a steam plate for two hours. The barium sulphate is then filtered off. The iron and alumina in the filtrate are precipitated with ammonium hydroxide, the precipitate filtered off, washed, ignited in a platinum crucible and weighed.

Lime

The filtrate from the precipitated iron and alumina is acidified slightly with hydrochloric acid, boiled down to a volume of less than 100 cc. and filtered if necessary. The solution is now made ammoniacal, heated to boiling, and 10 cc. of ammonium oxalate solution added. After standing for two hours in a warm place the precipitate of calcium oxalate is filtered off, washed with hot water, ignited and weighed.

Magnesia

The filtrate from the lime determination is boiled down to about 200 cc., slightly acidified, and 15 cc. of microcosmic salts (Saturated Solution) added. Ammonium hydroxide is added with 40 cc. in excess and the precipitate allowed to settle over night. The precipitate is then filtered off, dissolved with hydrochloric acid (1 part concentrated acid to four parts of water), diluted to 100 cc., 10 cc. of microcosmic salt solution added, followed by ammonium hydroxide with 40 cc. excess and allowed to stand over night. The precipitate of magnesium ammonium phosphate is filtered off, washed, carefully ignited and weighed.


Carbon Dioxide

The carbon dioxide is determined according to method given for carbonates under chapter on Carbon, page 111. It is necessary to use a large sample, i.e., 5-10 grams, and for samples containing a small amount of carbonates a Geissler absorption bulb is preferable to the heavy Fleming bulb.

Fluorine

One gram of sample is placed in a lead bomb with 12 cc. of sulphuric acid, the bomb closed with glass plate in place and heated in an oil bath for 45 minutes at 165° C. The etching on the glass plate is compared with etching using known amounts of fluorine as CaF₂ and the same kind of glass.

The glass plate is kept cool by circulating cold water. The type of bomb and its connections are shown in figure 6a.

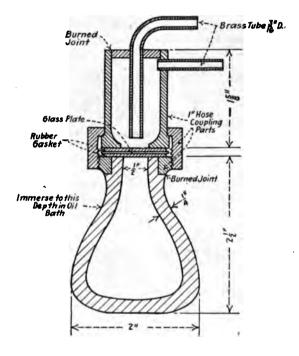

Loss on Ignition

One gram of the sample is weighed out into a platinum crucible dried at 110° C. for two hours and weighed. This moisture is to be used for calculating all results to a dry basis. The crucible is heated gently at first and then placed in a muffle furnace or over a blast lamp and ignited until it ceases to lose weight on reheating. This loss is calculated to a basis of one gram of dry material.

BARIUM

Blanc Fixe

This sulphate of barium is generally marketed as paste and less commonly in the dry form. Both pulp and dry forms should contain not less than 97.5% BasO₄ on the The pulp (paste) should not contain over 30% H₂O. 'Blanc Fixe is used in dry basis.

Qualitative Tests. Suitability for photographic purposes. Spread a sample on a glass plate and apply a drop of 10% AgNO, solution. Set aside in a dark closet. No dark brown or black stain should be evident in five minutes.

Alumina and Iron. Heat a small portion with HNO₃, dilute and filter. Test the filtrate with NH₄OH. filtrate with NH₄OH. A gelatinous colorless precipitate = $Al(OH)_3$, a red precipitate = $Fe(OH)_3$ and possibly $Al(OH)_3$ with the iron.

Lead. Extract a small portion with ammonium acetate and test the extract with K₂Cr₂O₇. A yellow precipitate indicates PbCrO₄, showing the presence of PbSO₄. Silica. Test about 0.5 g. with 10 cc. conc. H₂SO₄, complete solution shows the

absence of SiO₂.

Organic Matter. Coloration of the acid in the silica test indicates the presence of

organic matter.

Carbonates. Addition of acid will cause effervescence in presence of carbonate.

Extract a small portion with HNO2 and test the extract with am-Phosphates.

monium molybdate for phosphate.

Quantitative Analysis. The qualitative tests will indicate the presence of impurities. These can now be determined by the standard procedures. The following brief outline may be found useful as a guide for the method of examination.

Moisture. Determine loss on 2-gram sample dried at 105° C. for two hours.

Loss on Ignition. Ignite residue from above. Loss is due to escape of CO₂ and to organic matter and combined water.

Iron and Alumina. Digest a 5-gram sample with 150 cc. HCl (1:3). Evaporate extract to dryness, take up with 100 cc. dilute HCl and filter to remove SiQ. Precipitate iron and alumins in filtrate in usual manner and determine. If P₂O₅ is present it will be present with the precipitate. If present it will be necessary to add a known quantity of iron as FeCl₃ to carry down all the P₂O₅. This iron and the P₂O₅, determined on a separate sample, must be deducted, to obtain the iron and alumina in the sample.

Phosphate. Extract a 2-gram sample with water by decantation. Digest the residue with a 10% solution of HNO₂ and filter. Precipitate P₂O₅ in the filtrate with ammonium molybdate in the usual manner. The yellow precipitate is dissolved in NH_OH and P₂O₅ precipitated with magnesia mixture and determined by the standard

procedure.

$$Mg_2P_2O_7 \times 0.6379 = P_2O_5 \qquad Mg_2P_2O_7 \times 2.7038 = Ba_3(PO_4)_2$$

Lead Sulphate. This may be determined in the residue from the iron and alumina determination by extraction with ammonium acetate and precipitation with dichromate reagent by usual procedure. PbCrO₄ \times 0.9383 = PbSO₄.

For Other Ingredients consult chapter on Paint Analysis, page 1188.

BISMUTH

WILFRED W. SCOTT AND J. J. MULLIGAN¹

Bi, at.wt. 208.6; sp.gr. 9.7474; m.p. 271°; b.p. 1420° C.; oxides, Bi₂O₃, Bi₂O₄.

DETECTION

Bismuth is precipitated from its solution, containing free acid, by H₂S gas, as a brown sulphide, Bi₂S₂. The compound is insoluble in ammonium sulphide (separation from arsenic, antimony, and tin), but dissolves in hot dilute nitric acid (separation from mercury). The nitrate, treated with sulphuric acid and taken to SO₂ fumes, is converted to the sulphate and dissolves upon dilution with water (lead remains insoluble as PbSO₄). Bismuth is precipitated from this solution by addition of ammonium hydroxide, white Bi(OH)₂ being formed (copper and cadmium dissolve). If this hydroxide is dissolved with hydrochloric acid and then diluted with a large volume of water, the white, basic salt of bismuth oxychloride, BiOCl, is precipitated. The compound dissolves if sufficient hydrochloric acid is present. It is insoluble in tartaric acid (distinction from antimony).

Reducing Agents. Formaldehyde in alkaline solution, hypophosphorous acid, potassium or sodium stannite, reduce bismuth compounds to the metallic state. For example, a hot solution of sodium stannite poured onto the white precipitate of Bi(OH), on the filter will give a black stain. The test is very delicate and enables the detection of small amounts of the compound.

 $3K_2SnO_2 + 2BiCl_2 + 6KOH = 2Bi + 3K_2SnO_2 + 6KCl + 3H_2O$.

Blowpipe Test. A compound of bismuth heated on charcoal with a powdered mixture of carbon, potassium iodide and sulphur, will give a scarlet incrustation on the charcoal.

ESTIMATION

The determination of bismuth is required in complete analysis of ores of cobalt, nickel, copper, silver, lead, and tin, in which it is generally found in small quantities. In evaluation of bismuthite, bismuth ochre, etc. In the analysis of the minerals wolfram, molybdenite. It is determined in the residues from the refining of lead (the principal source of bismuth in the United States). In the analysis of alloys—antifriction metals, electric fuses, solders, stereotype metals, certain amalgams used for silvering mirrors (with or without lead or tin), and in bismuth compounds.

Preparation and Solution of the Sample

In dissolving the substance, the following facts must be kept in mind: nitric acid is the best solvent of the metal. Although it is soluble in hot sulphuric acid, it is only very slightly soluble in the cold acid. The metal is practically insoluble in hydrochloric acid, but readily dissolves in nitrohydrochloric acid.

¹ Metallurgist, U. S. Metals Refining Co., East Chicago plant.

The hydroxides, oxides, and most of the bismuth salts are readily soluble in hydrochloric, nitric, and sulphuric acids.

Ores or Cinders. One gram of the finely pulverized ore or cinder (or larger amounts where the bismuth content is very low) is treated in a 400-cc. beaker with 5 cc. of bromine solution (Br+KBr+H₂O),¹ followed by the cautious addition of about 15 cc. of HNO₂ (sp.gr. 1.42). When the violent action has ceased, which is apt to occur in sulphide ores, the mixture is taken to dryness on the steam bath, 10 cc. of strong HCl and 20 cc. of concentrated H₂SO₄ and the covered sample heated until SO₂ fumes are freely evolved. The cooled solution is diluted with 50 cc. of water and gently heated until only a white or light gray residue remains. The solution is filtered and the residue washed with dilute H₂SO₄ (1:10), to remove any adhering bismuth. Silica, the greater part of the lead (also BaSO₄) remain in the residue, whereas the bismuth, together with iron, alumina, copper, antimony, etc., are in the solution. Details of further treatment of the solution to effect a separation of bismuth are given under "Separations" and the procedures for determination of bismuth.

Alloys, Bearing Metal, etc. One gram of the borings, placed in a small beaker, is dissolved by adding 20 cc. of concentrated HCl and 5 cc. of strong HNO₂. The alloy will usually dissolve in the cold, unless considerable lead is present, in which case prolonged heating on the steam bath may be necessary. (A yellow or greenish-yellow color at this stage indicates the presence of copper.) Lead may now be removed either as a sulphate by taking to SO₂ fumes with H₂SO₄ or by precipitating as a chloride, in the presence of alcohol, according to directions given under Separations. The bismuth is determined in the filtrate from lead according to one of the procedures given under the quantitative methods.

Lead Bullion, Refined Lead.² Ten to twenty-five grams of the lead, hammered or rolled out into thin sheets and cut into small pieces, are taken for analysis. The sample is dissolved by a mixture of 250 cc. of water and 40 cc. of strong nitric acid, in a large covered beaker, by warming gently, preferably on the steam bath. When the lead has dissolved, the beaker is removed from the heat and dilute ammonia (1:2) added to the warm solution, very cautiously and finally drop by drop until the free acid is neutralized and the liquid remains faintly opalescent, but with no visible precipitate. Now 1 cc. of dilute HCl (1:3) is added. The solution will clear for an instant and then a crystalline precipitate of bismuth oxychloride will form, if any considerable amount of bismuth is present. The beaker is now placed on the steam bath for an hour, during which time the bismuth oxychloride will separate out, together with a small amount of lead and with antimony if present in appreciable amounts. The further isolation and purification of bismuth is given under "Separations." In brief-antimony is removed by dissolving the precipitate in a small amount of hot dilute HCl (1:3), precipitating bismuth, traces of lead, and the antimony by H₂S, dissolving out the antimony sulphide with warm ammonium sulphide, dissolving the Bi₂S₂ and PbS in HNO₂ and reprecipitation of the bismuth according to the procedure given above. Bismuth is now determined as the oxychloride. Further details of this method are given under the gravimetric procedures for bismuth.

¹ Bromine solution is made by dissolving in water 75 grams of KBr, to which are added 50 grams of liquid bromine and the mixture diluted to 500 cc. with water.

² Bismuth in Refined Lead. "Technical Methods of Ore Analysis." A. H. Low.

SEPARATIONS

The following procedures are given in the order that would be followed in the complete analysis of an ore, in which all the constituents are sought. This general scheme, however, is not required for the majority of bismuth-bearing samples commonly met with in the commercial laboratory, direct precipitations of bismuth frequently being possible.

Separation of Bismuth from Members of Subsequent Groups, Fe, Cr, Al, Mn, Co, Ni, Zn, Mg, the Alkaline Earths and Alkalies, together with Rare Elements of these Groups. The solution should contain 5 to 7 cc. of concentrated hydrochloric acid (sp.gr. 1.19) for every 100 cc. of the sample. The elements of the hydrogen sulphide group are precipitated by saturating the solution with H₂S (Hg, Pb, Bi, Cu, Cd, As, Sb, Sn, Mo, Se, Te, Au, Pt). The members of subsequent groups remain in solution and pass into the filtrate.

Separation of Bismuth from Arsenic, Antimony, Tin, Molybdenum, Tellurium, Selenium. In presence of mercury, the soluble members of the hydrogen sulphide group are separated from the insoluble sulphides by digesting the precipitate above obtained with ammonium sulphide; in absence of mercury, however, which is generally the case, digestion of the sulphides with sodium hydroxide and sodium sulphide solution is preferred, the general procedure being followed. Mercury, lead, bismuth, copper, and cadmium remain in the residue, whereas the other members of the group dissolve.

Separation of Bismuth from Mercury. The insoluble sulphides, remaining from the above treatment with ammonium sulphide after being washed free of the soluble members of this group, are placed in a porcelain dish and boiled with dilute nitric acid (sp.gr. 1.2 to 1.3). The solution thus obtained is filtered, upon dilution, from the insoluble sulphide of mercury. A little of the lead may remain as PbSO₄, the solution may contain lead, bismuth, copper, and cadmium.

Separation of Bismuth from Lead. This is the most important procedure in the determination of bismuth as the separation is almost invariably necessary, as these elements commonly occur together. Bismuth produced in the United States in 1912 was obtained entirely from the residues in the refining of lead.

There are two general procedures for the separation of lead and bismuth.

A. Precipitation of lead either as lead sulphate or as lead chloride, the

bismuth remaining in solution under the conditions of the precipitation.

B. Precipitation of bismuth as the oxychloride or subnitrate, lead remaining in solution.

Precipitating Lead as PbSO₄. This procedure is generally used in the process of a complete analysis of an ore containing lead and bismuth. The nitric acid solution of the sulphides, obtained upon removal of the soluble group and mercury by boiling the insoluble sulphides with dilute nitric acid, is treated with about 10 cc. of strong sulphuric acid, and taken to SO₄ fumes by heating. The cooled sulphate solution is diluted with water and the insoluble lead sulphate filtered off and washed with dilute sulphuric acid solution (1:20). Bismuth passes into solution, together with copper and cadmium, if also present in the original sample.

¹ Mineral Industry, 1912, p. 98.

'Precipitation of Lead as PbCl₂. This separation is used in the complete analysis of pig lead, the details of the separation being given under this subject.

As the separation of bismuth from lead by precipitation of the former element as the oxychloride or subnitrate is incorporated in the quantitative

methods following, it will not be taken up here.

Separation of Bismuth from Copper and Cadmium. This separation is accomplished by precipitating bismuth as the oxychloride with hydrochloric acid, or as the carbonate by adding an excess of ammonium carbonate to the solution nearly neutralized by ammonia, or as the hydroxide by adding an excess of ammonia. Details of these procedures are given under the gravimetric methods for determining bismuth.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF BISMUTH

Determining Bismuth by Precipitation and Weighing as the Basic Chloride, BiOC1

The determination depends upon the formation of the insoluble oxychloride, BiOCl, when a hydrochloric acid solution of bismuth is sufficiently diluted with water, the following reaction taking place, BiCl₃+H₂O = BiOCl+2HCl.

The procedure is recommended for the determination of bismuth in refined lead, bearing metal, and bismuth alloys. Copper, cadmium, and lead do not interfere; appreciable amounts of antimony and tin, however, should be removed by H₂S precipitation and subsequent treatment with Na₂S, and the residual sulphides dissolved in hot dilute nitric acid, according to directions given under "Separations."

Properties of BiOCl. Mol.wt., 259.46; sp.gr., 7.717^{15*}; m.p., red heat; insol. in H₂O and in H₂C₄H₄O₆, soluble in acids. Appearance is white, quadratic crystalline form.

Procedure. The solution of bismuth, freed from appreciable amounts of tin and antimony, is warmed gently and treated with sufficient ammonia to neutralize the greater part of the free acid. At this stage a precipitate is formed by the addition, which dissolves with difficulty; the last portion of the dilute ammonia (1:2) is added drop by drop, the solution is diluted to about 300 cc., and the remainder of the free acid neutralized with dilute ammonia added cautiously until a faint opalescence appears, but not enough to form an appreciable precipitate. One to 3 cc. of dilute hydrochloric acid (1 part HCl sp.gr. 1.19 to 3 parts H₂O) are now added, the mixture stirred and the bismuth oxychloride allowed to settle for an hour or so on the steam bath, then filtered hot by decanting off the clear solution through a weighed Gooch crucible. The precipitate is washed by decantation twice with hot water and finally washed into the Gooch, then dried at 100° C. and weighed as BiOCl.

$BiOCl \times 0.8017 = Bi$.

Note. Three cc. of dilute hydrochloric acid (or 1 cc. conc. HCl, sp.gr. 1.19) are sufficient to completely precipitate 1 gram of bismuth from solution.

Determination of Bismuth as the Oxide, Bi₂O₃

Preliminary Considerations. The determination of bismuth as the oxide requires the absence of hydrochloric acid or sulphuric acid from the solution of the element, since either of these acids invariably contaminates the final product. In presence of these acids, which is frequently the case, determination of bismuth by precipitation as Bi₂S₂ or by reduction to the metal and so weighing is generally recommended; a brief outline of the methods is given later; a solution of bismuth free from hydrochloric acid and practically free of sulphuric acid may be obtained by precipitating Bi₂S₂, together with CuS, CdS, and PbS, the amount of sulphuric acid formed by the reaction being negligible. Bismuth should be in a nitric acid solution, free from antimony and tin.

Two general conditions will be considered: 1. Solutions containing lead. Copper and cadmium may also be present. 2. Solutions free from lead. Copper

and cadmium may be present.

1. Separation from Lead, Copper, and Cadmium, by Precipitation as Basic Nitrate.¹ Either the sulphuric or hydrochloric acid methods may be employed for effecting the separation of lead by precipitation. Furthermore advantage may be taken of the fact that bismuth nitrate is changed by the action of water into an insoluble basic salt, while lead, copper and cadmium do not undergo such a transformation.

Procedure. The bismuth nitrate solution is evaporated to syrupy consistency and hot water added with constant stirring with a glass rod. The solution is again evaporated to dryness, and the hot-water treatment repeated. Four such evaporations are generally sufficient to convert the bismuth nitrate completely into the basic salt; when this stage is reached the addition of water will fail to produce a turbidity. The solution is finally evaporated to dryness and, when free from nitric acid, is extracted with cold ammonium nitrate solution (1.NH4NO₂: 500 H₂O) to dissolve out the lead and other impurities. After allowing to stand some time with frequent stirring, the solution is filtered and the residue washed with ammonium nitrate solution, then dried.

Ignition to Bismuth Oxide. As much of the precipitate as possible is transferred to a weighed porcelain crucible, the filter is burned and the ash added to the main precipitate. This is now gently ignited over a Bunsen burner. Too high heating will cause the oxide to fuse and attack the glaze of the crucible.

Properties. Bi(OH)₂NO₂ mol.wt., 304.03; sp.gr., 4.928^{15°}; decomp., 260°; insol. in H₂O; sol. in acids; hexagonal plates.

 $Bi_2O_1 = mol.$ wt., 464.0; sp.gr., 8.8 to 9.0; m.p., 820 to 860°; insoluble in cold water and in alkalies, but soluble in acids; yellow tetragonal crystals.

$$Bi_2O_3 \times 0.8965 = Bi.$$

- 2. Precipitation of Bismuth as the Subcarbonate or Hydroxide, Lead being Absent. Either of these procedures effects a separation of bismuth from copper and cadmium.
- A. Procedure. Precipitation of the Subcarbonate. The solution is diluted to about 300 cc. and dilute ammonia added cautiously until a faint turbidity is obtained and then an excess of ammonium carbonate. The solution

¹ J. Löwe, Jour. prak. Chem., (1), 74, 344, 1858.

1 to boiling, the precipitate filtered off, washed with hot water, dried ited according to directions given in the bismuth subnitrate method. Itue is weighed as Bi₂O₂.

rocedure. Isolation of Bismuth by Precipitation as the Hydroxide.¹ Ition is taken to dryness and the residue treated with 5 cc. of nitric :4) and 25 cc. of water added. The resulting solution is poured, with stirring, into 25 cc. of concentrated ammonia and 50 cc. of 4% n peroxide. Upon settling of the bismuth hydroxide, the clear solution d off and the residue is treated with more ammonia and peroxide. It iltered onto a filter paper, washed with hot, dilute ammonium hydroxide, followed by hot water and washed free of any adhering copper or cadno residue when a drop is evaporated on platinum foil). Re-solution dilute nitric acid and reprecipitation may sometimes be necessary to the pure product. The hydroxide may be dried, ignited and weighed according to directions already given on page 74.

xties. Bi₂O₃·CO₂·H₂O, mol.wt., 526.02; sp.gr., 6.86; decomp. by heat; in water, soluble in acids, insoluble in Na₂CO₃; white precipitate.

H)₁, mol.wt., 259.02; loses $1\frac{1}{2}$ H₂O at 150°; insol. in cold water and in soluble in acids; white precipitate.

Determination of Bismuth as the Sulphide, Bi₂S₃

procedure is applicable to the determination of bismuth in a hydror sulphuric acid solution, freed from other members of this group.

Bismuth sulphide pitated by passing H₂S into itly acid solution, preferably ressure. When the precipicomplete, the bismuth sul-3i₂S₂, is filtered off into a Gooch crucible, the precipished with H2S water, then cohol to remove the water, by carbon disulphide to out the precipitated sulhen alcohol to remove the de, and finally with ether. rying for fifteen to twenty , the residue is weighed as This weight multiplied by ∙Bi.

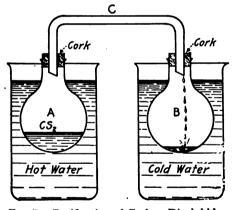


Fig. 7.—Purification of Carbon Disulphide.

2. The carbon disulphide used should be freshly distilled. This may be shed by placing the carbon disulphide in a small flask (A, Fig. 7) connected s of a glass tube (C) to a second flask (B), cork stoppers being used. The re immersed in beakers of water, the container with the reagent being placed ater (60-80°C.) and the empty flask in cold water. The reagent quickly disthet empty flask in pure form.

verties of Bismuth Sulphide. Bi₂S₁, mol.wt., 512.21; sp.gr., 7-7.81 sed by heat, solubility = 0.000018g. per 100 cc. cold H₂O; soluble in niric nun rhombic crystals.

¹ P. Jannasch, Zeit. anorg. Chem., 8, 302, 1895.

Determination of Bismuth as the Metal

Reduction with Potassium Cyanide. Bismuth precipitated as the carbonate and ignited to the oxide according to the procedure given, is fused in a weighed porcelain crucible with 5 times its weight of potassium cyanide over a low flame. The cooled melt is extracted with water, pouring the extracts through a filter that has been dried and weighed with the crucible. Bismuth is left undissolved as metallic bismuth. After washing with water, alcohol, and ether, the filter, with the metal and loosened pieces of porcelain glaze, is dried at 100° C. together with the crucible. These are then weighed and the increased weight taken as the amount of bismuth present in the sample.

Electrolytic Deposition of Bismuth

With samples containing less than 0.03 gram bismuth, the metal may be satisfactorily deposited by electrolysis of its sulphuric acid solution, lead having been removed previously by sulphuric acid by the standard procedure. The solution contains about 6 cc. of strong sulphuric acid per 100 cc. This is electrolyzed with a current of 0.6 to 0.7 ampere and about 2.7 to 3 volts Further details of this method may be found in "Technical Methods of Ore Analysis," by A. H. Low, page 54, VIII Edition. John Wiley & Sons.

VOLUMETRIC DETERMINATION OF BISMUTH

Determination of Bismuth by Precipitation as Oxalate and Titration by Potassium Permanganate 1

Normal bismuth oxalate, produced by addition of oxalic acid to a nitric acid solution of the element, boiled with successive portions of water, is transformed to the basic oxalate. This may be titrated with potassium permanganate in presence of sulphuric acid.

Procedure. Preparation of the Sample. One gram of the finely ground sample is treated with 5 to 10 cc. of concentrated nitric acid and digested on the steam bath and finally evaporated to dryness, the residue is taken up with 5 cc. of nitric acid (sp.gr. 1.42) +25 cc. of water, and diluted to 100 cc.

Precipitation of the Oxalate. About 5 grams of ammonium oxalate or oxalic acid are added and the liquid boiled for about five minutes, the precipitate allowed to settle and the supernatant solution filtered off. The precipitate is boiled twice with 50-cc. portions of water and the washings poured through the same filter. If the filtrate still passes through acid, the washing is continued until the acid is removed and the washing passing through the filter is neutral. The bulk of the basic oxalate precipitate is placed in a beaker and that remaining on the filter paper is dissolved by adding 2 to 5 cc. of hydrochloric acid, 1:1, the solution being added to the bulk of the precipitate.

¹ Method by H. Rose, Pogg. Ann., 110, p. 425.

Vanino and Treubert (Ber., 31 (1898), 1303), reduce bismuth by adding formal-dehyde to its slightly acid solution and then making strongly alkaline with 10% NaOH solution and warming. N.B. Treadwell and Hall, Anal. Chem., p. 181, 3d Ed.

¹ The method is rapid and is sufficiently accurate for commercial work. Warwick and Kyle (C. N., 75, 3).

Muir and Robbs, J. C. S., 41, 1.

This is now warmed until it goes into solution and the liquid is diluted to 250 cc. with hot water. Dilute ammonia is now added until the free acid is neutralized; the resulting precipitate is taken up with dilute sulphuric acid, 1:4, added in slight excess. The resulting solution, warmed to 70°, is titrated with standard potassium permanganate.

One cc. KMnO₄ N/10 = 0.0104 gram Bi.

NOTE. Lead, copper, arsenic, iron, zinc, and tellurium do not interfere. Hydrochloric acid should not be used to dissolve the sample, as it interferes with the oxalate precipitation.

Cinchonine Potassium Iodide, Colorimetric Method 1

This method is applicable for the determination of small amounts of bismuth, 0.00003 to 0.00015 gram, in ores and alloys. The procedure depends upon the fact that bismuth nitrate produces a crimson or orange color when its solution is added to a solution of cinchonine potassium iodide, the intensity of the color depending upon the amount of bismuth in the resulting product.

Special Reagents. Cinchonine Potassium Iodide Solution. Ten grams of cinchonine are dissolved by treating with the least amount of nitric acid that is necessary to form a viscous mass and taking up with about 100 cc. of water. The acid is added a drop at a time, as an excess must be avoided. Twenty grams of potassium iodide are dissolved separately and cinchonine solution added. The resulting mixture is diluted with water to 1000 cc. After allowing the reagent to stand forty-eight hours, any precipitate formed is filtered off and the clear product is ready for use. The reagent preserved in a glass-stoppered bottle keeps indefinitely. It should be filtered free of suspended matter before use.

Standard Bismuth Solution. One gram of metallic bismuth is dissolved in the least amount of dilute nitric acid (1:1) that is necessary to keep it in solution and diluted to 1000 cc., in a graduated flask. One hundred cc. of this solution is diluted to 1000 cc. One cc. of this diluted solution contains 0.0001 gram bismuth.

Procedure. Isolation of Bismuth. The solution is freed from lead by H₂SO₄, and from arsenic, antimony, and tin by precipitation of the sulphides and extraction with Na₂S solution. The residual sulphides are dissolved in hot dilute nitric acid, according to the standard methods of procedure. The free nitric acid is nearly neutralized by the cautious addition of dilute ammonia, the last portion being added drop by drop, until a faint cloudiness is evident, and then 10 to 15 cc. of 10% ammonium carbonate are added with constant stirring. The mixture is digested for about three hours on the steam bath, the clear solution decanted through a small filter, the residue washed by decantation once or twice with hot water containing ammonium carbonate and then on the filter twice with pure hot water.

Colorimetric Comparison

The residue of bismuth basic carbonate is dissolved in the least amount of dilute nitric acid necessary to effect solution and the filter washed free of bismuth with a little water containing a few drops of nitric acid. The solution is made up to a definite volume, 50 cc. or 100 cc. according to the bulk of

¹ Method of W. C. Ferguson.

precipitate dissolved. Two small beakers placed side by side may be used for the color comparison, a sheet of white paper or tile being placed under the beakers. Two 50-cc. Nessler tubes, however, are preferred. Three cc. of cinchonine solution are added to each container. From a burette the bismuth nitrate sample is run into one of these containers in just sufficient quantity to color the reagent a crimson or orange tint. The exact volume required to do this is noted and the equivalent amount of sample used calculated. (If no color is produced bismuth is absent.) The reagent in the adjacent beaker or Nessler tube is diluted to 5 to 7 cc., and into this is run, from a burette, the standard bismuth nitrate solution until the color exactly matches the sample. From the cc. of the standard required the amount of bismuth in the sample can readily be calculated.

Reaction. $3KI + C_{19}H_{22}N_2OKI + Bi(NO_3)_3 = C_{19}H_{22}N_2OKIBiI_3 + 3KNO_3$.

Precautions. The sensitiveness of the method is lost if the depth of color is too great. It is necessary, then, to add the sample to the cinchonine reagent in such quantity only as will produce a light crimson or orange color.

Solutions in the comparison tubes or beakers must not be overdiluted, since the bismuth salt formed by the reaction of the cinchonine reagent is soluble in water with the disappearance of color in too dilute solutions.

Comparison must be expeditiously made, as a precipitate is apt to form upon standing, and iodine will sometimes separate.

The order of addition must be observed; e.g., the bismuth solution is added to the cinchonine reagent, never the reverse.

Colorimetric Determination of Bismuth. Bismuth Iodide Method ¹

Bismuth iodide gives an intense yellow, orange, or red color to its solution. The color is not destroyed by SO₂, as is that of free iodine. The intensity of the color varies as follows:

- 1 part of bismuth in 10,000 parts of water produces an orange-colored solution.
- 1 part of bismuth in 40,000 parts of water produces a light orange color.
- 1 part of bismuth in 100,000 parts of water produces a faint yellow color.

Reagents. Standard Bismuth Solution. One gram of bismuth is dissolved in 3 cc. of strong nitric acid and with 2.8 cc. of water and made up to 100 cc. with glycerine. Glycerine is added to keep the BiI₁ in solution. Glycerine is not necessary for amounts of bismuth below 0.0075 gram per cc.

Potassium Iodide Solution. Five grams of potassium iodide dissolved in 5 cc. of water is diluted to 100 cc. with glycerine.

Procedure. The sample is dissolved with just sufficient nitric acid and water necessary to cause solution, 10 cc. of glycerine and 10 cc. of potassium iodide solution added and the sample diluted to 50 cc. Comparison is now made with 10 cc. of the standard bismuth solution to which has been added 10 cc. of potassium iodide and 30 cc. of water. It is advisable to have the standard stronger in bismuth than the sample and to draw out the standard from the comparison cylinder until the two colors match.

¹T. C. Thresh, Pharm. Jour., 641, 1880.

Bismuth Determination in Lead Bullion¹

Ten to twenty-five grams of the lead, hammered or rolled out and cut into small pieces, are taken for analysis. The sample is dissolved in a mixture of 200 cc. water and 50 cc. strong nitric acid, in a large covered beaker, and warmed gently on water or steam bath. When lead has dissolved, the beaker is removed and placed on cool surface and enough sulphuric acid (1-1) added to precipitate lead.

The lead sulphate is allowed to settle and the clear supernatant liquid is decanted into another beaker and held. To the residue of lead sulphate 10-20 cc. concentrated sulphuric acid is added and brought down to strong fumes on hot plate. After strong fuming, the portion containing lead sulphate is diluted with water. To the first clear decanted portion, 10 cc. sulphuric acid is added and this also evaporated down to fumes of sulphuric acid. Both portions are removed from hot plate and when cool add 50 cc. water and 3 to 5 grams of tartaric acid to each. Heat to dissolve tartaric acid and filter over asbestos pad, the clear portion first, and then follow with the one containing bulk of lead sulphate. The bulk of lead sulphate is washed by decantation three or four times with warm water before transferring to asbestos pad. When bismuth is higher than .30% in the bullion, the sulphate residue may be retreated with sulphuric acid, fumed and washed. The clear solution is allowed to stand for one hour and refiltered to ensure removal of all lead sulphate. The filtrate is then warmed and hydrogen sulphide gas passed filtered on a paper and washed with cold H2S water. The sulphides are washed from filter back to precipitating beaker. The sulphides of Sb, Sn, Te, etc., are leached out with a 10% K2S solution, which has been saturated with hydrogen sulphide, and allowed to stand in warm place and filtered over the original sulphide paper. After washing with warm water containing a few drops of K2S solution, the precipitate is dissolved in nitric acid and a few drops of bromine to ensure solution of all sulphur. It is all important to remove Sb, Sn and Te from sulphide precipitate before going any further by repeating hydrogen sulphide precipitation.

The nitric acid solution of Bi, Cu, etc. is made faintly alkaline with ammonia and 1 gram ammonium carbonate added and the solution boiled for five to ten minutes when the bismuth is precipitated as basic salt. To ensure solution of the copper, a few drops of free ammonia are added with stirring before filtering. The bismuth precipitate is filtered on a tared gooch, washed with water, dried and ignited to Bi₂O₃ over Bunsen flame.

$$Bi_2O_3 \times .8966 = Bi.$$

If the bismuth precipitate is dark after precipitation with ammonia and ammonium carbonate, it may be due to tellurium. If so, the filtered precipitate is dried, ignited and fused with caustic potash and sulphur to put the tellurium in a soluble form and thus remove tellurium from insoluble bismuth sulphide; or redissolving in acid and reprecipitating as sulphides and washing the sulphides with K₂S solution as before mentioned.

This method is applicable to refined lead when larger portions are taken.

¹ J. J. Mulligan.

Bismuth in Alloys¹

The alloy is dissolved in nitric acid, as little hydrochloric as possible, and 10 cc. sulphuric, and run down to strong SO₃ fumes and proceed as for ores.

Where bismuth is present with considerable tin, the cementation of the bismuth with pure iron wire to free it from tin and then treat residue same as for ores and mattes, seems to be the best means for obtaining a bismuth precipitation free of tin for control analyses.

In the presence of considerable copper, the bismuth can be precipitated as basic carbonate, filtered and the impure basic precipitate treated with nitric acid and evaporated to fumes of sulphuric, the procedure is then the same as for ores and matte.

Determination of Bismuth in Ores, Mattes¹

A qualitative test for lead and insoluble bismuth compounds on all products to be analyzed for bismuth is an important step with the removal of lead as sulphate as soon as perfect solution of the sample is insured.

For products containing from $\frac{1}{2}\%$ to 25% bismuth, one gram portions are

taken; for 50% or higher ½ gram portions are weighed up.

The weighed portion is transferred to a 250 cc. beaker and 25 cc. H₂O and 10 cc. concentrated nitric acid added, and where sulphur is present a few drops of bromine are added cautiously after acid has been allowed to act for a sufficient time. After all sulphur has gone in solution, boil down to dryness on water bath or hot plate, 2 cc. of nitric acid and 1 cc. hydrochloric acid are added, then 10 cc. of sulphuric acid cautiously added, and the covered sample taken down on hot plate to strong fumes of SO₃. The cooled solution is diluted with 50 cc. water and 2 to 3 grams tartaric acid are added and the mixture brought to a boil. The residue containing insoluble lead sulphate, silica and other insolubles are filtered and washed with 2% solution of sulphuric acid to free residue of soluble bismuth.

The filtrate contains Bi, Cu, Sb, As, Te and a small amount of Pb may be in the solution. After standing for one-half hour or more, the solution is refiltered to remove any lead that may have gone through on first filtration.

The clear solution containing bismuth is saturated with hydrogen sulphide gas for one-half hour.

Filter sulphides on filter paper and wash with H₂S water. If much iron is present the sulphides are redissolved in nitric and sulphuric, taken to fumes, and the sulphide precipitation repeated.

The sulphides are leached with a 10% solution of K₂S saturated with H₂S gas to remove As, Sb, Sn, Te and Se. The remaining sulphides containing Cu, Cd, Bi are dissolved in nitric acid and a little bromine water, bromine boiled off and solution made slightly alkaline with ammonia water and 1 gram of ammonium carbonate added. The solution is boiled for five to ten minutes and 1 cc. of ammonia is added and the basic carbonate filtered on a tared Gooch, ignited and weighed as Bi₂O₃.

 $Bi_2O_3 \times .8966 = Bi$.

¹ J. J. Mulligan.

WILFRED W. SCOTT

B, at.wt. 11.0; {amorp. sp.gr. 2.45; m.p. 2200°; b.p. sub!imes. cryst. sp.gr. 2.55; m.p. 2500°; b.p. 3500° C; oxide, B₁O₁

DETECTION

Flame Test. Boric acid is displaced from its salts by nearly all acids, including even carbonic acid. Upon ignition, however, it in turn drives out other acids which are volatile at lower temperatures. A powdered borate, previously calcined, is moistened with sulphuric acid and a portion placed on the loop of a platinum wire is heated to expel the sulphuric acid, then moistened with glycerine and placed in the colorless flame; a green color will be imparted to the flame. Copper salts should be removed with H₂S and barium as BaSO₄ if present, as these also color the flame green.

The flame test may be conveniently made by treating the powdered sample in a test-tube with sulphuric acid and alcohol (preferably methyl alcohol). A cork carrying a glass tube is inserted and the test-tube gently warmed. The escaping gas will burn with a green flame.

The test may be made by igniting the mixture of powder, alcohol, and sulphuric acid in an open porcelain dish. The green color will be seen in presence of a borate. The test is not as delicate as the one with the test-tube.

Borax Bead. Na₂B₄O₇ 10H₂O fused in a platinum loop, swells to several times its original volume as the water of crystallization is being driven out, then contracts to a clear molten bead. If the bead is dipped into a weak solution of cobalt and plunged into the flame, until it again becomes molten, the bead upon cooling will be colored blue.

Turmeric Test. A few drops of acetic acid are added together with 2 or 3 drops of an alcoholic turmeric solution to an alcoholic extract of the sample, placed in a porcelain dish. The solution is diluted with water and then evaporated to dryness on the water bath. 1/1000 milligram of boric acid will produce a distinct color, 2/100 milligram will give a strong reddish-brown colored residue, which becomes bluish-black when treated with a drop of sodium hydroxide solution.

ESTIMATION

The determination of boron is required in the valuation of borax, Na₂B₄O₇·10H₂O; boracite, 4MgB₄O₇2MgOMgCl₂; borocalcite, CaB₄O₇·6H₂O; hydroboracite; boronatrocalcite, etc., the element being reported generally as the oxide, B₂O₄. The determination is required for obtaining the true value of commercial boric acid, in the analysis of fluxes and certain pigments. It is determined as a food-preservative in milk, meat, canned goods, etc. The element is determined in certain alloys of nickel, cobalt, zinc, chromium, tungsten, molybdenum and in the analysis of steel.

¹Silicates should be mixed with potassium fluoride and potassium acid sulphate, KHSO₄ then held in the flame.

Preparation and Solution of the Sample

It will be recalled that crystalline boron is scarcely attacked by acids or alkaline solutions; the amorphous form, however, is soluble in concentrated nitric and sulphuric acids. Both forms fused with potassium hydroxide are converted to potassium metaborate. Boric acid is more readily soluble in pure water than in hydrochloric, nitric, sulphuric, or acetic acids, but still more soluble in tartaric acid (Herz, Chem. Zentr., 1903, 1, 312). It is soluble in alcohol and volatile oils. Borax is insoluble in alcohol. With acids it becomes transposed to boric acid and the sodium salt of the acid.

Boric Oxide in Silicates, Enamel, etc. About 0.5 gram of the finely ground material is fused with five times its weight of sodium carbonate, the melt extracted with water and the extracts, containing the sodium salt of boric acid, evaporated to small volume. The greater part of the excess sodium carbonate is neutralized with hydrochloric acid and finally made acid with acetic acid (litmus paper test=red). Boric oxide is now determined by the distillation process according to the procedure given later in the chapter.

Boronatrocalcite, Borocalcite, Boracite, Calcium Borate. Ten grams of the powdered material is placed in a flask with a reflux condenser and about 50 cc. of normal hydrochloric acid added and the mixture boiled for half an hour. The contents of the flask, together with the washings, including those of the reflux condenser (CO₂-free water being used), are filtered into a 500-cc. flask and made to volume with CO₂-free water. Fifty cc. of this solution is titrated with half-normal sodium hydroxide, using paranitrophenol indicator. When a yellow color appears the hydrochloric acid has been neutralized. A second 50-cc. portion is now taken for analysis and the free hydrochloric acid neutralized with sodium hydroxide, using the amount of caustic required in the trial analysis (this time without an indicator). Boric acid is now determined by titration according to the procedure on p. 86.

Borax, Boric Acid. Ten grams of the material are dissolved in about 300 cc. of water (free from CO₂) and made to 500 cc. in a graduated flask, with pure water. One hundred-cc. portions are taken for analysis and the solution titrated, in presence of mannitol or glycerol, according to directions given under the volumetric procedures.

Boric Acid in Mineral Water. Water containing more than 0.1 gram boric acid per liter, about 200 cc. are evaporated to small volume, the precipitated salts are filtered off and washed. Boric acid passes into the filtrate and may be determined by the distillation method of Gooch given on p. 84.

With water containing traces of boric acid, 5 liters or more are evaporated to about one-tenth the original volume the precipitate filtered off and washed with hot water. The filtrate is evaporated down to a moist residue. If the residue is small, it is acidified with acetic acid and the boric acid determined by distillation, as stated on p. 84. If considerable residue is present, hydrochloric acid is added to acid reaction, and then the mixture digested with absolute alcohol in a corked flask for ten to fifteen hours, with occasional shaking. The solution is filtered, the residue washed with 95% alcohol, the filtrate diluted with water, 10 cc. of 10% sodium hydroxide solution added and the alcohol distilled off. A second alcoholic

¹ Reference is made to Treadwell and Hall, Anal. Chem., 4th ed., p. 431-432 for those desiring more explicit details of this method.

extraction is generally recommended. The final alkaline solution is taken to dryness and gently ignited. The residue is extracted with water, made acid with acetic acid and B_2O_2 determined by distillation.

Carbonates. The material is treated with sufficient acid (M. O. indicator) to liberate all the CO₂ and react with the combined alkali of boric and carbonic acid; it is boiled in a flask with reflux condenser to expel CO₂, ten to fifteen minutes, the solution exactly neutralized with sodium hydroxide, (M. O.), and the liberated boric acid titrated in presence of glycerol and phenolphthalein as usual.

Boric Acid in Milk, Butter, Meat and Other Foods

Milk. One hundred cc. of milk is treated with 1 to 2 grams of sodium hydroxide, and evaporated to dryness in a platinum dish. The residue is thoroughly charred 2 by gently heating; at this stage care must be exercised or loss of boric acid will result; 20 cc. of water are added, the sample heated and hydrochloric acid added drop by drop until all but the carbon has dissolved. The mixture is washed into a 100-cc. flask with as little water as possible, 0.5 gram calcium chloride added, then a few drops of phenolphthalein indicator, then a 10% sodium hydroxide solution until a slight permanent pink color is obtained and finally 25 cc. of lime water. (All P2Os is precipitated as calcium phosphate.) The liquid is made to 100 cc., mixed thoroughly, and then filtered through a dry filter. To 50 cc. of the filtrate, equivalent to 50 cc. of the milk taken, normal sulphuric acid is added until the pink color disappears, then methyl orange indicator is added, followed by more of the standard acid until the yellow color changes to a faint pink. Carbon dioxide is expelled and the liberated boric acid titrated in presence of glycerine, according to the procedure given for evaluation of borax and boric acid, under "Volumetric Determination of Boron."

Butter. Twenty-five grams of butter are weighed out in a beaker and 25 cc. of a sugar sulphuric acid mixture added. (Mix=6 grams sugar of milk, 4 cc. normal sulphuric acid per 100 cc. of solution.) The beaker is placed in the oven (100° C.) until the fat is melted and the mixture is thoroughly stirred. When the aqueous solution has settled, 20 cc. are pipetted out, phenolphthalein added, the solution brought to boiling and half-normal sodium hydroxide added until a faint pink color is obtained. Ten cc. of neutral glycerine are added and the titration carried on until a permanent pink color appears. The difference between the two titrations multiplied by the factor for equivalent boric acid gives the weight of boric acid in the portion taken.

The determination is not affected by the phosphoric or butyric acid or by the sugar of milk in the butter.

Meat. Ten grams of the chopped meat are mixed in a mortar with 40 to 80 grams of anhydrous sodium sulphate, and dried in the water oven. The mass is powdered, then placed in a flask and 100 cc. of methyl alcohol added and allowed to stand for about twelve hours. The alcohol is distilled into a flask and saved. Fifty cc. more of alcohol are added to the residue and this again distilled into the first distillate. The distillates are made up to 150 cc., a

¹ R. T. Thomson, Glasgow City Anal. Soc. Repts., 1895, p. 3.

⁴C. Freschius and G. Popp, Chem. Centr., 1897, 2, 69.

² The milk residue thoroughly charred will give a colorless solution upon extraction. ³ H. Droop Richmond and J. B. P. Harrison, Analyst, 27, 197.

50-cc. portion diluted with 50 cc. of water and 50 cc. of neutral glycerine added with phenolphthalein indicator, and the boric acid titrated with twentiethnormal sodium hydroxide.

One cc. N/20 NaOH = 0.0031 gram boric acid, H_2BO_2 .

Boric acid in canned goods, sauces, cereals, etc., may be determined by evaporation of the substance with sodium hydroxide and incineration as in case of milk. The sodium hydroxide is neutralized and boric acid titrated as usual.

GRAVIMETRIC DETERMINATION OF BORON

The solubility of boron compounds prevents complete precipitation by any of the known reagents, hence most of the gravimetric methods are indirect.

Distillation as Methyl Borate and Fixation by Lime 1

This excellent method, originally worked out by F. A. Gooch, and later modified by Gooch and Jones, depends upon the fact that the borates of alkaline carths and alkalies give up their boron in the form of the volatile methyl borate (b.p., 65° C.), when they are distilled with absolute methyl alcohol (acetonefree). The methyl borate passed over lime in presence of water is completely

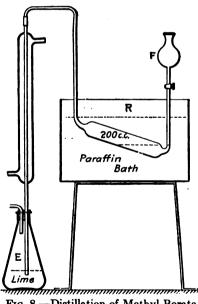


Fig. 8.—Distillation of Methyl Borate.

² See note on v. 75.

saponified, the liberated boric acid combining with the lime to form calcium borate, which may be dried, ignited, and weighed. The increase of the weight of the lime represents the B₂O₃ in the sample.

$$2B(OCH_2)_2+CaO+6H_2O$$

= $6CH_2OH+Ca(BO_2)_2+3H_2O$.

Procedure. About 1 gram of pure calcium oxide is ignited to constant weight over a blast lamp and then transferred to the dry, Erlenmeyer receiving flask (Fig. 8). The crucible in which the lime was heated and weighed is set aside in a desiccator for

0.2 gram or less of the alkali borates. obtained in solution by a procedure given under "Preparation of the Sample," is treated with a few drops of litmus (or lacmoid), solution and the free alkali neutralized with dilute HCl solution added drop by drop. A drop of dilute sodium hydroxide solution is added and

then a few drops of acetic acid. The slightly acid solution is transferred to the

¹ Proc. Am. Acad. of Arts and Sciences, 22, 167-176 (1886). Anal. Chem., Treadwell-Hall, Vol. 2.

pipette-shaped retort R, Fig. 8, by means of the attached funnel F, washing out the beaker and funnel with three 2- to 3-cc. portions of water. The stopcock of the funnel is closed, the apparatus is connected up as shown in the illustration, the paraffine bath, heated to not over 140° C., placed in position and the liquid in the retort distilled into the receiver containing the known amount of lime. When all the liquid has distilled over, the paraffine bath is lowered, the retort allowed to cool for a few minutes, 10 cc. of methyl alcohol (acetonefree) added to the residue in R and the contents again distilled by replacing the paraffine bath. The process is repeated three times with methyl alcohol. The contents of the retort (which are now alkaline), are made distinctly acid by addition of acetic acid, and three more distillations made with 100-cc. portions of methyl alcohol, as before. The paraffine bath is now removed, the receiving flask is stoppered, the contents thoroughly mixed by shaking, and set aside for an hour or more for complete saponification of the methyl borate. The contents are now poured into a large platinum dish and evaporated on the water bath at a temperature below the boiling-point of the alcohol. (Loss of boric acid will occur if the alcohol boils.) The adhering lime in the receiving flask is dissolved by wetting its entire surface with a few drops of dilute nitric acid (the flask being inclined and revolved to flow the acid over its sides). The contents are transferred to the dish with a little water and the evaporation repeated. No loss of boric acid will take place at this stage, the alcohol having been removed during the first evaporation. The residue is gently heated to destroy any calcium acetate that may have formed the cooled borate and lime are taken up with a little water and transferred to the crucible in which the lime was heated and weighed. The material clinging to the dish is dissolved with a little nitric acid (or acetic acid), and washed into the crucible. The contents of the crucible are evaporated to dryness on the water bath, then heated very gently over a flame (the crucible being covered) and finally more strongly. The heating is continued until a constant weight is obtained. The increase of weight of the lime represents the amount of B₂O₂ in the sample.

Notes. Gooch and Jones worked out a procedure which utilizes sodium tungstate as a retainer of the methyl borate, in place of the lime. This substance is definite in weight, not hydroscopic, soluble in water, and recoverable in its original weight after evaporation and ignition. "Methods in Chem. Anal.," p. 204, 1st Ed. By F. A. Gooch, John Wiley & Sons, Publishers.

The receiving flask has a cork stopper with a hole to accommodate the tube of the condenser and a slit to permit the escape of air from the flask.

Gooch recommends cooling of the receiving flask.

VOLUMETRIC DETERMINATION OF BORON

Titration of Boric Acid in Presence of Mannitol or Glycerol Evaluation of Borax

The method takes advantage of the fact that boric acid reacts neutral to methyl orange (or paranitrophenol), but is acid to phenolphthalein, and may be quantitatively titrated in the presence of mannitol or of glycerol, which prevent the hydrolization of sodium borate. If insufficient mannitol or glycerol are present the color change takes place too soon, the color fading upon adding more of these substances. The end-point is reached when the further addition of these reagents produces no fading of the color. In the procedure, the alkali is neutralized in presence of methyl orange (or paranitrophenol), and the liberated boric acid is now titrated.

Reactions. Na₂B₄O₇+2HCl+5H₂O = 2NaCl+4H₂BO₃ H₂BO₃+NaOH = NaBO₂+2H₂O.

Procedure. One hundred cc. of the solution containing the borax, prepared according to directions under "Preparation and Solution of the Sample," equivalent to 2 grams of the substance, is taken for analysis.

A. Titration of Combined or Free Alkali. Methyl orange indicator is added and the solution is titrated with normal or half-normal sulphuric acid until the yellow color is replaced by an orange red. (With paranitrophenol the solution becomes colorless.) From this titration the combined alkali, together with any free alkali, is calculated. If free alkali is known to be absent (see note), the amount of borax may be calculated.

One cc. N. $H_2SO_4 = 0.031$ gram Na_2O_7 or = 0.1911 gram $Na_2B_4O_7 \cdot 10H_2O_7$ or = 0.101 gram $Na_2B_4O_7$.

B. Titration of Boric Acid. The liberated boric acid may now be titrated with caustic. This may be accomplished either on the above portion or on a fresh 100-cc. portion (free from methyl orange indicator), to which the amount of acid, required to neutralize the alkali, has been added. Fifty cc. of neutral glycerol or 1 gram of mannitol are added, followed by phenolphthalein indicator. Normal or half-normal sodium hydroxide is added from a burette until a change of color takes place. If methyl orange is present, the color, first becoming yellow, changes to an orange red. In absence of methyl orange the characteristic lavender or purplish pink of alkali phenolphthalein is obtained. More glycerol or mannitol is now added and if the color fades the titration is continued until the addition of these reagents no longer produces this fading of the end-point, From this titration boric acid is calculated and the equivalent borax determined.

One cc. N. NaOH = 0.062 gram H_3BO_3 , equivalent to 0.0505 $Na_2B_4O_7$, or 0.0955 $Na_2B_4O_7 \cdot 10H_2O$.

Factors. Na₂O to Na₂B₄O₇ = 3.2581, reciprocal = 0.3069. Na₂O to Na₂B₄O₇ · 10H₂O = 6.1638, recip. = 0.1622. Na₂O to Na₂CO₃ = 1.7097, recip. = 0.5849. Na₂O to Na₂CO₃ · 10H₂O = 4.6155, recip. = 0.2167.

Notes. In borax (free from excess B₂O₂ or Na₂O), the acid titration is half the subsequent alkali titration (factor, acid to borax = 0.1911, alkali to borax = 0.0955).

f the acid titration exceeds this proportion, alkali other than that combined with oric acid is indicated; if the alkali titration is greater than twice the acid titration, ree boric acid is indicated.

The glycerol should be made neutral with N/10 NaOH before use, in case it con-

ains free fatty acids.

Mannitol is a solid and has some advantages over glycerol; it gives a sharper nd-point, is less apt to contain free acids and does not appreciably alter the bulk the solution to which it is added. (L. C. Jones, C. N., 80, 65, 1899).

N.B. Paper on use of mannitol and glycerol in determining boric acid, by R.

Thomson, J. S. C. I., 12, 432.. Example. By actual test 2 grams $Na_2B_4O_7 \cdot 10H_2O$ required 10.66 cc. N. $H_2SO_4 = 0.66 \times 0.1911 = 2.037$ gram $Na_2B_4O_7 \cdot 10H_2O$. The liberated H_2BO_3 required 21.39 c. of N. $NaOH = 21.39 \times 0.0955 = 2.043$ gram $Na_2B_4O_7 \cdot 10H_2O$. The borax had lost small amount of water of crystallization, hence the high results when calculated to `a₂B₄O₇ · 10H₂O.

EVALUATION OF BORIC ACID

One hundred cc. of the solution, prepared as directed under "Preparation of the Sample," equivalent to 2 grams of the original material, is treated with 0 cc. of glycerol or 1 gram of mannitol, and the acid titrated with standard austic, in presence of phenolphthalein indicator according to the procedure iven in B. under "Evaluation of Borax."

One cc. normal acid contains 0.062 gram H₂BO₂, hence the cc. of caustic

equired multiplied by 0.062 = grams boric acid.

Examples. Two grams H₂BO₂ by actual test required 32.1 cc. N. NaOH $=32.1 \times .062 = 1.99$ grams H₂BO₂.

Detection of Minute Amounts of Boron.

Robin's Test for Boron. To a few drops of the aqueous solution under examination slightly acidified with HCl) are added two drops of a tineture of mimosa flowers, and he mixture evaporated to dryness on the water bath. The residue is treated with lilute ammonia water, whereupon in presence of boric acid, a rose pink to blood red olor develops, according to the amount present. L. Robin claims that as little as .0001 milligram may be detected in presence of nitrates, chlorides, iodides, or calcium ulphate. Organic acids and sodium phosphate interfere. The reagent is prepared by xtracting the mimosa flowers with ethyl alcohol. The extract is protected from the

Distillation Method as Modified by Chapin

Reagents¹

1. Paranithrophenol.—One gram dissolved in 75 cc. of neutral ethyl alcohol and nade up to 100 cc. with water.

2. Phenolphthalein.—One gram dissolved in 100 cc. of ethyl alcohol and made up

o 200 cc. with water.

3. Hydrochloric Acid, 0.1 Normal.—The water should be boiled to remove carbonic

4. Hydrochloric Acid, 1.1 Strength.—A dropping bulb should be filled with this acid then it is needed in accurate small amounts.

- 5. Sodium Hydroxide, 0.5 and 0.1 Normal.—These should be standardized as follows: use pure boric acid in a platinum dish. While still warm break the melt up and place he fragments quickly in a weighing tube. Dissolve 1.75 grams in 250 cc. of hot.
- ¹ Bulletin 700, "The Analysis of Silicate and Carbonate Rocks," by W. F. Hillebrand. Pepartment of the Interior, U. S. Geological Surveys. Am. Jour. Sci., 4th Ser., Vol. 14, 1903, p. 195.

ecently boiled water, cool, and dilute the solution to 500 cc. This solution is 01.

ormal—that is, in presence of mannite or glycerol 1 cm. is neutralized to the phenolhthalein end point by 1 cc. of 0.1 normal sodium hydroxide.

In standardising the sodium hydroxide against this solution both indicators should be used, so that the end may be the same as that seen in actual titration. Follow exactly the directions given under b, below, for the final titraction, only assuming that the boric acid solution is exactly neutral to paranitrophenol—that is, free from mineral acid. When sodium hydroxide is standardized in this way the small amount of carbonate present does no harm.

6. Mannile.—This is preferable to glycerol, for it requires no special preparation, does not materially increase the bulk of the solution to be titrated, and gives an equally

sharp end point.
7. Methyl Alcohol.—This should be distilled over lime after it has been heated for some hours in contact with the lime under a reflux condenser. The more nearly anhydrous the alcohol is the better.

8. Calcium Chloride.—This should be granular, anhydrous, and free from boron.

Apparatus

The main set up of the apparatus required is shown in Fig. 8a.

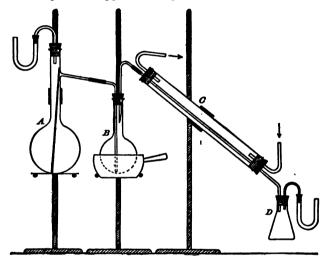


Fig. 8a.—Distilling Apparatus for Boron

A. Flask of 500 cc. capacity for methyl alcohol, having a U tube containing a little mercury as a safety trap, and a capillary "boiling tube" 3 mm. in bore, the bore closed at 1 cm. from the lower end.

B. Flask of 250 cc. capacity, supported in a casserole of water but not touching the bottom. The outlet tube of B should be not less than 12 cm. in vertical height and of rather wide bore. The end inside the flask should be jagged to allow condensed liquid to drop back instead of jumping up the tube.

C. Glass condenser, 40 cc. long, of tubing 3 cm. wide.

D. Receiving flask of 250 cc. capacity. Two or three of these flasks should be at hand, with necks of same size, so that the receiver can be changed without interrupting the distillation. The small U tube attached contains a little water to prevent the escape of any uncondensed methyl borate.

E. (Not shown.) A second glass condensed like C, connected on the one side to a flask exactly like B, which, however, has a stopper with only one hole and rests completely within a large bath. The flask carries also a "boiling tube." On the other side is a receiver like D, but without the U trap. This apparatus is used for distilling off the alcohol after the preliminary titration.

F. (Not shown.) Filter pump. At the end of the side tube is an elbow tube connected

to a rubber stopper with two holes and of a size to fit the flask mentioned in connection with E. The second hole of the stopper is closed by a glass plug, which can be withdrawn to break the vacuum. Midway between pump and stopper is a small safety bottle, to prevent the tap water from sucking back the flask.

Procedure

Chapin used not more than half a gram of mineral powder for even very small amounts of boron, and not less unless the percentage exceeded 10. When the percentage is high it is best to so limit the weight of the sample that the of B₂O₃ shall not exceed 0.1 gram. If a flux is used it should be weighed to within a milligram of two; then the amount of acid required to take up the melt can be measured out at once and there is no danger of using too great an excess.

If the mineral is soluble in hydrochloric acid, transfer 1 gram of it to the flask B, without letting any adhere to the neck, and treat with not more than 5 cc. of 1:1 hydrochloric acid. Heat gently on a water bath until soluble is complete.

If the mineral is not soluble, add to it exactly six times its weight of sodium carbonate or of an equimolecular mixture of sodium and potassium carbonates, mix, and fuse in the usual manner. Without removing from the crucible, decompose the melt with 1:1 hydrochloric acid in calculated amount added by degrees. While this is being done the crucible should rest in a casserole, and the lid should be kept in place as much as possible. Toward the end it may be necessary to heat a little, but care should be taken not to boil, for boric acid would be lost with the steam. Pour the solution into the flask B and rinse the crucible with a very little water.

Then add pure anhydrous calcium chloride, using about 1 gram for each cubic centimeter of solution and running it through a paper funnel to keep the neck of the flask clean. Twirl the flask a little to allow the chloride to take up the water, connect it with the rest of the apparatus, raise the casserole beneath it until the flask rests in the water but does not touch the bottom, and then begin the distillation of the alcohol from the flask A, taking care that the open end of the capillary "boiling tube" is free from alcohol and that the U tube attached to the receiver is trapped with water.

The decomposition flask, B, is not heated until about 25 cc. of alcohol has condensed in it. After that the water bath is heated by a small flame and the flask thus kept hot enough to prevent further condensation of alcohol. The distillation should not be so rapid as to permit escape of methyl borate from the system.

When a distillate of about 100 cc. has collected the receiver is exchanged for a fresh one and the collection of a second distillate is proceeded with. The contents of the trap tube are added to the first receiver, and a preliminary titration is made as follows: Add a few drops of paranitrophenol solution and run in the standard sodium hydroxide until the indicator shows that the free mineral acid is neutralized. Next, add 1 cc. of the phenolphthalein solution and continue the titration until the color of that indicator begins to appear. The end point will not be sharp, but the amount of alkali used between the two end points indicates approximately the amount of boric acid in the distillate. If the mineral is likely to contain more than 3 or 4% of B_2O_3 use the 0.5 normal solution, the object being to keep the distillate as free from the water as possible and thus facilitate the dehydration later on.

After completing the titration add to the distillate twice as much alkali as was used between the two end points, transfer the distillate to the second

distilling apparatus, and boil off the alcohol. The addition of the indicated amount of alkali prevents loss of boron by converting unstable NaBO₂ to stable Na₂BO₃.

In the meantime the second distillate of 100 cc. will have collected. Unless the alcohol contained water or insufficient calcium chloride was used, this second distillate will contain the remainder of the boron. Therefore, before removing the receiver stop the distillation. Treat the second distillate exactly like the first and then add it to the first.

If the amount of alkali used for titrating the second distillate is less than 0.1 cc. of the 0.1 normal solution the distillation may be regarded as complete.

When the liquid from the alcohol is being distilled no longer boils in the steam bath, remove it to a casserole, rinsing the flask once or twice with water, and heat over a direct flame, rotating the casserole while doing so, until the little remaining alcohol has been boiled out. The residue should now be small—about 25 cc. if 0.1 normal alkali was used and much less if 0.5. If the volume is less than 25 cc. make up to that extent.

Return the solution to the flask and add drop by drop with constant twirling 1:1 hydrochloric acid from a dropping bulb, until the color of both indicators is discharged, taking care not to add a drop too much. Now put in the "boiling tube," heat the flask in the steam bath for a minute or two, then attach to the filter pump and boil under reduced pressure until the liquid is nearly cold and only an occasional bubble appears.

All carbon dioxide being thus removed, break the vacuum, cool if necessary

under the tap, and proceed to the final titration.

First neutralize the excess of hydrochloric acid by running in carefully 0.5 normal sodium hydroxide until the yellow of paranitrophenol just appears. Bring back to acid reaction with 0.1 normal hydrochloric acid and then to the appearance of a faint yellow with 0.1 normal alkali. The solution is now exactly neutral as the indicators itself shows this color in a neutral solution. Make sure that the end point is reached exactly. One drop of 0.1 normal acid should discharge the color entirely.

Now add 1 gram of mannite, read the burette, and continue titrating to the end point of phenolphthalein. Add another gram of mannite, and if this causes a disappearance of the end color add more alkali until it reappears.

The number of cubic centimeters of alkali used multiplied by its equivalent in terms of B_2O_3 gives the amount of the latter contained in the solution. If the solution of alkali is exactly 0.1 normal this equivalent is 0.0035.

The changes of color that take place during the titration need mention. When the mannite (or glycerol) is added to the solution the yellow color due to the paranitrophenol disappears at once. This is due to the fact that the combination of these reagents with the boric acid forms an acid of sufficient strength to affect the indicators, although boric acid alone does not. As the titration proceeds the color reappears and grows stronger, becoming very intense just before the phenolphthalein end point appears. The latter will be noticed as a faint brownish tinge, and then another drop of the 0.1 normal alkali changes it to an intense brownish red, which is the real end point.

Notes

E. T. Allen and E. G. Ziez¹ tested the Chapin method very fully in its application to the determination of boron in glasses and regard it as far superior to other methods, even though it is subject to a slight but very uniform correction of 1 milligram or less, to be determined by a blank run. The correction seems to be due always in part to a boron content of the reagents used and in part to a titration error. The fact that such correction is unavoidable makes the method of uncertain value for determining the very small amounts of boron that rocks may be presumed to carry, but the constancy of results is so great that a consistent excess found over what the blank affords is strong evidence that boron is actually present.

Allen and Ziez found the method to be affected appreciably by relatively large amounts of arsenious acid but not by arsenic acid. The effect of the former can be eliminated by converting it to arsenic acid by oxidizing with hydrogen peroxide after making the solution distinctly alkaline with sodium hydroxide.

Allen and Ziez also found that relatively large amounts of fluorides effect the accuracy of the method but do not seriously impair its usefulness for ordinary work.

¹ "Analysis of Silicate and Carbonate Rocks," by W. T. Hillebrand, Bull. 700, U. S. Geol. Survey, 1919.

BROMINE

WILFRED W. SCOTT

Br, at.wt. 79.92; sp.gr. 3.1883°; m.p. -7.3°; b.p. 58.7° C.; acids, HBr, HBrO, HBrO;

DETECTION

Silver Nitrate solution precipitates silver bromide, AgBr, light yellow, from solutions containing the bromine anion. The precipitate is insoluble in dilute nitric acid, but dissolves with difficulty in ammonium hydroxide and is practically insoluble in ammonium carbonate solution (distinction from AgCl).

Carbon Disulphide or Carbon Tetrachloride shaken with free bromine solution, or with a bromide to which a little chlorine water has been added, (a large excess of chlorine must be avoided, as this forms BrCl compound), will absorb the bromine and become a reddish-yellow color, or if much bromine is present, a brown to brownish-black. In the latter case a smaller sample should be taken to distinguish it from iodine.

Bromates are first reduced by a suitable reducing agent such as cold oxalic acid, sodium nitrite, hydrochloric acid, etc., and the liberated bromine tested as directed above. Silver nitrate added to bromates in solution precipitates AgBrO₂, which is decomposed by hydrochloric acid to bromine gas.

Barium Chloride precipitates Ba(BrO₂)₂, which is reduced readily to bromine as directed above.

Magenta Test for Bromine.¹ The test reagent is made by adding 10 cc. of 0.1% solution of magenta to 100 cc. of 5% solution of sulphurous acid and allowing to stand until colorless. This is the stock solution. Twenty-five cc. of this reagent is mixed with 25 cc. of glacial acetic acid and 1 cc. of sulphuric acid. Five cc. of this is used in the test.

Test. Five cc. of the magenta reagent is mixed with 1 cc. of the solution tested. Chlorine produces a yellow color. Bromine gives a reddish-violet coloration. The colored compound in each case may be taken up with chloroform or carbon tetrachloride and a colorimetric comparison made with a standard.

In halogen mixes, iodine is first eliminated by heating with an iron per salt. Bromine is now liberated by adding sulphuric acid and potassium chromate. A glass rod with a pendant drop of sodium hydroxide is held in the vapor to absorb bromine, and the drop then tested with the magenta reagent. After iodine and bromine are eliminated, chlorine may be tested by heating the substance with potassium permanganate, which liberates this halogen.

¹G. Deniges and L. Chelle. Ann. Chim. anal., 1913, 18, 11-15; The Analyst, 1913, 119.

ESTIMATION

Bromine never occurs free in nature. It is found chiefly combined with the alkalies and the alkaline earths, hence occurs in many saline springs and s a by-product of the salt industry. It is found in silician zinc ores, Chili altpeter, in sea water (probably as MgBr₂), in marine plants. Traces occur in oal, hence in gas liquors.

The substance is used in metallurgy, the arts, and medicine. It is a valuble oxidizing agent for the laboratory.

Preparation and Solution of the Sample

The following facts regarding solubility should be remembered: The element bromine is very soluble in alcohol, ether, chloroform, carbon disulphide, arbon tetrachloride, concentrated hydrochloric acid and in potassium bromide plution. One hundred cc. of water at 0° C. is saturated with 4.17 grams of romine, and at 50° C, with 3.49 grams. The presence of a number of salts acreases its solubility in water, e.g., BaCl₂, SrCl₂, etc.

Note. The element is a dark, brownish-red, volatile liquid, giving off a dark reddish apor with suffocating odor, irritating the mucous membrane (antidote dil. NH₄OH, ther), very corrosive. Acts violently on hydrogen, sulphur, phosphorus, arsenic, ntimony, tin, the heavy metals, and on potassium, but has no action on sodium, ven at 200° C. Bleaches indigo, litmus, and most organic coloring matter. It is a trong oxidizing agent. Bromine displaces iodine from its salts, but is displaced by hlorine from its combinations.

Bromides are soluble in water, with the exception of silver, mercury, lead, nd cuprous bromides.

Bromates are soluble in water with the exception of barium and silver bromates and some basic bromates.

Decomposition of Organic Matter for Determination of Bromine. The ubstance is decomposed with nitric acid in presence of silver nitrate in a bomb ombustion tube by the Carius method described in the chapter on Chlorine, inder "Preparation and Solution of the Sample." The residue, containing he halides, is dissolved in warm ammonia water, and filtered, as stated. The iltrate and washings are acidified with nitric acid, heated to boiling and the ilver bromide settled in the dark, then filtered through a weighed Gooch cruible, the washed precipitate dried at 130° C. and weighed as AgBr.

In presence of two or three halogens the lime method is recommended, as given in the chapter on chlorine, page 146.

Salts of Bromine. The ready solubility of bromides and bromates has been nentioned. A water extract is generally sufficient. Insoluble salts are decomposed by acidifying with dilute sulphuric acid and adding metallic zinc. The iltrate contains the halogens.

SEPARATIONS

Separation of Bromine from the Heavy Metals. Bromides of the heavy netals are transposed by boiling with sodium carbonate, the metals being precipitated as carbonates and sodium bromide remaining in solution.

Separation of Bromine from Silver (AgBr) and from Cyanides (AgCN). The silver salts are heated to fusion. The mass is now treated with an excess

of zinc and sulphuric acid, the metallic silver and the paracyanogen filtered off and the bromine determined in the filtrate.

Separation of Bromine from Chlorine or from Iodine. Details of the procedure for determining the halogens in presence of one another is given in the chapter on Chlorine, page 154. Free bromine is liberated when the solution of its salt is treated with chlorine.

Separation of Bromine from Iodine.¹ The neutral solution containing the bromide and iodide is diluted to about 700 cc. and 2 to 3 cc. of dilute sulphuric acid, 1:1, added, together with about 10 cc. of 10% sodium nitrite, NaNO₂, solution. (Nitrous acid gas may be passed through the solution in place of adding sodium nitrite, if desired.)² The solution containing the halides is boiled until colorless and about twenty minutes longer, keeping the volume of solution above 600 cc. 0.5 gram KI may be decomposed and the iodine expelled from the bromide in half an hour. The bromine is precipitated from the residue remaining in the flask by addition of an excess of silver nitrate and determined as silver bromide.

The procedure for determining iodine is given in the chapter on this subject.

GRAVIMETRIC METHODS

Precipitation as Silver Bromide

The general directions for determination of hydrochloric acid and chlorides apply for determining hydrobromic acid and bromides.

I. Hydrobromic Acid and Bromides of the Alkalies and Alkaline Earths. Procedure. The bromide in cold solution is made slightly acid with nitric acid and then silver nitrate added slowly with constant stirring until a slight excess is present. The mixture is now heated to boiling and the precipitate settled in the dark, then filtered through a weighed Gooch crucible, and washed with water containing a little nitric acid and finally with pure water to remove the nitric acid. After ignition the silver bromide is cooled and weighed as AgBr.

 $AgBr \times 0.4256 = Br$, or $\times 0.6337 = KBr$.

II. Heavy Metals Present.

If heavy metals are present it is not always possible to precipitate silver bromide directly. The heavy metals may be removed by precipitation with ammonia, sodium hydroxide or carbonate and the bromide then determined in the filtrate as usual.

VOLUMETRIC METHODS

Free hydrobromic acid may be titrated with standard alkali exactly as is described for the determination of hydrochloric acid in the chapter on Acids. One cc. normal caustic solution is equivalent to 0.08093 gram HBr.

¹ F. A. Gooch and J. R. Ensign, Am. Jour. Sci., (3), xl, 145.

² Nitrous acid gas is generated by dropping dilute H₂SO₄, by means of a separatory funnel onto sodium nitrite in a flask.

Determination of Free Bromine. Potassium Iodide Method

The method depends upon the reaction KI+Br=KBr+I.

Procedure. A measured amount of the sample is added to an excess of potassium iodide, in a glass-stoppered bottle, holding the point of the delivering burette just above the potassium iodide solution. The stoppered bottle is then well shaken, and the liberated iodine titrated with standard thiosulphate solution.

One cc. of N/10 thiosulphate, Na₂S₂O₃ = 0.007992 gram Br.

Determination of Bromine in Soluble Bromides. Liberation of Bromine by Addition of Free Chlorine

When chlorine is added to a colorless solution of a soluble bromide, bromine is liberated, coloring the solution yellow. At boiling temperature the bromine is volatilized, the liquid becoming again colorless. When the bromide is completely decomposed and bromine expelled, further addition of chlorine produces no color reaction. KBr+Cl=KCl+Br.

Procedure. The solution containing the bromide is heated to boiling and standard chlorine water added from a burette (protected from the light by being covered with black paper), the tip of the burette being held just above the surface of the hot bromide solution to prevent loss of chlorine. The reagent is added in small portions until finally no yellow coloration is produced. From the value per cc. of the chlorine reagent the bromine content is readily calculated.

Standard Chlorine Water. The reagent is made by diluting 100 cc. of water saturated with chlorine to 500 cc. This solution is standardized against a known amount of pure potassium bromide (dried at 170° C.), the same amount of bromide being taken as is supposed to be present in the solution examined. The value per cc. of the reagent is thus established.

Silver-Thiocyanate-Ferric Alum Method. (Volhard)

The procedure is the same as that used for the determination of chlorine. The bromide solution is treated with an excess of tenth-normal silver nitrate solution, and the excess of this reagent determined by titration with ammonium thiocyanate, using ferric alum indicator. One cc. of the thiocyanate should be equivalent to 1 cc. of silver nitrate solution. The formation of the red ferric thiocyanate indicates the completed reaction. (Consult the procedure in the chapter on Chlorine, page 149.)

One cc. of $N/10 \text{ AgNO}_3 = 0.007992 \text{ gram Br.}$

Determination of Traces of Bromine

By means of the magenta reagent, described under "Detection," small amounts of bromine may be determined colorimetrically.

To 5 cc. of the solution is added 0.2 cc. of strong hydrochloric acid, 1 cc. of concentrated sulphuric acid, 1 cc. of the stock magenta reagent and 0.2 cc. of a 10% solution of potassium chromate, shaking the mixture with addition

of each reagent, and without cooling, 1 cc. of chloroform is added. Comparison is made with a standard sample containing a known amount of bromide.1

NOTE. A solution containing 0.001 gram bromine per liter has a violet to reddishviolet color.

Determination of Bromates by Reduction with Arsenous Acid and Titration of the Excess 2

Bromic acid may be reduced by arsenous acid in accordance with the reaction 3H₂AsO₂+HBrO₂=3H₂AsO₄+HBr. In the process a considerable excess of arsenous acid is added, the excess titrated with iodine and the bromate calculated.

Procedure. The sample of bromate, dissolved in water, is treated with a considerable excess of N/10 arsenous oxide (dissolved in alkali hydrogen carbonate) reagent, the solution then acidified with 3 cc. to 7 cc. of dilute sulphuric acid (1:1) and diluted to a volume not exceeding 200 cc. After boiling for ten minutes, the free acid is neutralized with alkali hydrogen carbonate (NaHCO₂ or KHCO₂) and the excess of arsenite titrated with N/10 iodine.

Let x cc. equal the difference between the two titrations with N/10 iodine (i.e. of total arsenite minus excess arsenite) and we equal the weight of bromate desired, then

$$w = \left(\frac{x \text{ cc.} \times \text{mol. wt. RBrO}_3}{6 \times 10 \times 1000}\right) \text{milligrams.}$$

ANALYSIS OF CRUDE POTASSIUM BROMIDE AND COMMERCIAL BROMINE

Determination of Chlorine, Combined or Free

This is the principal impurity present and its estimation is concerned here. Andrews' modification of Bugarszk's method * is as follows:

Procedure. The following amount of sample and reagents should be taken.

Approx. per cent Impurity if KCl Present is	Amount Substance to be Taken, Gram.	Iodate Solution 1/5 N. Required: cc.	2N. HNOs Required,
Over 5	0.6	36	20
1.5 to 5	1.8	96	26
0.2 to 1.5	3.6	186	35.

¹G. Denigés and L. Chelle, Ann. Chem. anal., 1913, 18-15; Analyst, 1913, p. 119. By means of the magenta reagent it is possible to detect bromine in the ash of plants, beet root, spinach, etc. The organic substance may be decomposed by heating in a combustion tube. Filter paper moistened with the reagent and held in the fumes of the organic substances gives the characteristic test if bromine is present.

² Method of F. A. Gooch and J. C. Blake, Am. Jour. Sci., 14, Oct., 1902. Procedure communicated to the Editor by Prof. Gooch.

³ Jour. Am. Chem. Soc., 1907, 29, 275-283; Zeits. anorg. Chem., 1895, 10, 387.

The mixture is gently heated to boiling in a long-necked Kjeldahl flask, inclined at an angle of 30°, potassium iodate solution added, then nitric acid and sufficient water to make the volume about 250 cc. The boiling is continued until bromine is expelled (test steam with 2% KI solution rendered faintly acid with hydrochloric acid). The mixture is boiled down to not below 90 cc. Now 1 to 1.5 cc. of 25% phosphorus acid are added and the mixture boiled for five minutes after all the iodine has been expelled. The colorless liquid is cooled, mixed with a slight excess of 1/20 or 1/50 normal silver nitrate solution (according to the proportion of chloride), the excess of silver nitrate then determined by titration with standard thiocyanate with ferric nitrate as indicator. (See procedure for silver-thiocyanate-ferric alum method of Volhard for determination of chlorine, page 149.)

Determination of Chlorine in Crude Bromine

Three grams of bromine (or more if less than 0.5% chlorine is present) in 50 cc. of 4% potassium iodide solution in a glass-stoppered flask (cooled in ice during hot weather) are shaken and then transferred to a Kjeldahl flask. Sixty cc. of 1/5 N. KIO₂ solution and 24 cc. 2N. HNO₂ introduced, the solution diluted to 250 cc. and chlorine determined as directed above.

Determination of Bromine in Mineral Waters in Presence of Iodine. Separation from Iodine

The method of Baughman and Skinner (U. S. Bureau of Chemistry) is as follows:

The neutral or slightly acid sample, which should contain not more than 0.1 g. bromine, or 10 g. total salts, is introduced into the distillation flask and adjusted to a volume of approximately 75 cc. One and a half to 2 grams of ferric sulphate are added, the liberated iodine distilled with steam into 100 cc. of potassium iodide solution (10 g. KI per 100 cc.). The potassium iodide solution may be titrated with sodium thiosulphate solution, to determine the iodine. The bromine is determined in the liquid remaining in the distillation flask.


Determination of Bromide in Mineral Waters and Brines¹

Bromine occurs combined as bromide in natural and artificial brines, associated frequently with small amounts of iodide. Bromine may be obtained in the mother liquor or "bittern," a by-product in the manufacture of common salt. The following procedure for evaluation of these brines for their bromine content was developed by W. F. Baughman and W. W. Skinner, U. S. Bureau of Chemistry.

¹ J. Ind. Eng. Chem., 11, 954-959 (Oct., 1919).

Apparatus. Three tall form, 250 cc. glass stoppered Dreschsel gas washing bottles or cylinders are joined together in series, the first two are joined by welding together the outlet tube of the first and the intake tube of the second, and the second and third by rubber tubing, bringing the ends of the glass tubing in contact with each other. The drawing Fig. 8b shows the details of the apparatus.

Procedure. "Evaporate the sample of water or brine, which should not be acid (if necessary add a small amount of sodium carbonate), to dryness or nearly so. Charge the reaction cylinder by introducing first glass beads to a

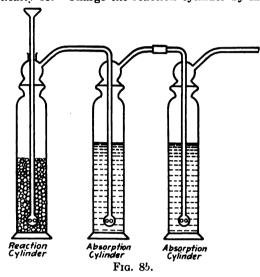

depth of about 1 in., then as much of the sample as can be scraped in, and finally enough glass beads to fill the cylinder half full. Make a solution of sodium sulphite and sodium carbonate of such a concentration that 25 cc. will contain 1 g. of sulphite and 0.2 g. of carbonate. 20 cc. of this solution to the first absorption cylinder, 5 cc. to the second, and dilute each approximately 200 cc. Connect the three cylinders and draw through a slow current of air. Add 15 g. of chromic anhydride dissolved in 10 to 12 cc. of water to the reaction cylinder, followed by washings from the evaporat-

ing dish which contained the sample, sufficient to bring the total volume added to about 25 cc. Aspirate until the contents of the reaction cylinder are in solution and thoroughly mixed, then discontinue, close the inlet tube with a small piece of rubber tubing and a clamp, and reduce the pressure in the apparatus slightly by sucking out some air in order to guard against any possible escape of bromine at the ground glass stopper. Allow to stand overnight, then aspirate with a rather strong current of air (about ½ to ¾ l. per min.) for three hours, adding four 2 cc. portions of 3 per cent hydrogen peroxide at thirty minute intervals. Stop the aspiration and evaporate the contents of the two absorption cylinders nearly to dryness. Clean out the reaction cylinder and freshly charge with glass beads and 15 g. chromic anhydride. Into the first absorption cylinder, put 10 g. potassium iodide, dissolved in 200 cc. of water, and into the second 3 or 4 g. in a like amount of water. Connect the apparatus, draw through a slow current of air, and transfer the contents of the evaporating dish to the reaction cylinder by means of a small funnel, using 25 cc. of water. Aspirate with a rather strong current of air until all the bromine is evolved (about 1 hour) and titrate the potassium iodide solution with thiosulphate."

Chromic acid in concentrated solution liberates bromine from bromides quantitatively at room temperature.

Iodides should be removed if present in appreciable amount.

CADMIUM

L. A. WILSON AND L. S. HOLSTEIN¹

Cd, at.wt. 112.4; sp.gr. 8.642; m.p. 320.9°; b.p. 778° C.; oxide CdO.

DETECTION

admium is detected in the wet way by precipitation as the yellow sulphide ydrogen sulphide from an acid solution. It is distinguished from arsenic, nony and tin (stannic) by the insolubility of its sulphide in ammonium oxide or colorless ammonium sulphide; from tin (stannous) by its insility in yellow ammonium sulphide; and from mercury by its solubility it nitric acid. The separation of cadmium may be made from lead since nium sulphate is soluble in dilute sulphuric acid while lead sulphate is not; bismuth since ammonium hydroxide precipitates bismuth hydroxide but cadmium in solution, and from copper by passing hydrogen sulphide into olution containing potassium cyanide which prevents the precipitation of er sulphide but not cadmium sulphide.

he detection of cadmium may be made in the dry way through the tube. This test is carried out in the following manner. A piece of hard glass ig of about 5 mm. bore is sealed at one end. From 200-400 milligrams e fine dried ore is mixed with a reducing agent as dry powdered charcoal introduced into the tube. The tube is heated just above the mixture of nd reducing agent and drawn out to a capillary of about 1 mm. diameter. end of the tube containing the mixture is now heated in the blast lamp the cadmium together with zinc, arsenic, antimony, etc., is volatilized and ensed in the capillary in the form of separated rings. The cadmium ring tected from the others by introducing a little powdered sulphur into the and heating so that the sulphur vapor passes over the rings. The cada is converted to sulphide and appears red while hot and yellow while

Very small amounts of cadmium may be detected in this way and it is ble with experience to estimate, from the appearance of the ring, either llic or sulphide the amount of cadmium present. See Fig. 8c page 102.

admium. Brilliant Spectrum of Green and Blue Lines.

lowpipe Tests. Heated on charcoal in the reducing flame, cadmium gives wn incrustation which is volatile.

ESTIMATION

admium occurs in small quantities in practically all zinc ores and is found ost spelters and commercial zinc materials as sheet zinc, zinc oxide, etc. es it occurs usually as the sulphide; the rare mineral greenockite being

The metal cadmium is largely obtained as a by-product from zinc ing. It is used in certain alloys, as trial plates for silver coinage and more tly in substitutes for tin base-bearing metals. Precipitated yellow num sulphide is used as a paint pigment.

New Jersey Zinc Co.

All metals present in the ore must be in the oxidized state. Sulphide ores must be illy roasted before using in this test. In the case of metallic substances, however, lucing agent is necessary.



Cadmium is determined, after separation from other elements, by weighing as the sulphide or as the metal following electrolysis. As it usually occurs in small quantities in the presence of large quantities of zinc, several precipitations with hydrogen sulphide are necessary and the methods must be followed in close detail to obtain accurate results. The determination of cadmium is necessary in case of spelters sold under specified rejection limits, in ores purchased and to be smelted for such spelter, and in other zinciferous material where cadmium is deleterious to the finished product. The methods to be used for the determination of cadmium in spelter is given under the chapter on zinc.

Preparation of Sample

Samples of metals, as spelter, cadmium metal, brass, etc., should be in the form of drillings, sawings or pourings, taken in a proper manner to be representative of the lot and of sufficient fineness to preclude against a non-representative sample being weighed for analysis. The samples of ore or fine material should be ground to pass a 100-mesh screen. Metallics, if also present, are kept separate from the fine material which passes through the screen, and in weighing out the sample, proportional amounts of each are taken.

SEPARATIONS

Removal of Silica. Evaporate with hydrochloric acid or sulphuric acid, and filter off the dehydrated silica, using suction.

Removal of Lead. Evaporate to fumes with sulphuric acid, cool, take up with water, warm until all soluble salts are dissolved and allow to stand until all lead sulphate settles. By using sulphuric acid to dehydrate the silica, lead and silica may be separated together.

Separation from Ammonium Sulphide Group, Except Zn, Alkaline Earths, and Alkalies. The solution from lead and silica separation containing 12 cc. sulphuric acid (1:1) per 100 cc. of solution is saturated cold with hydrogen sulphide, passing a steady stream for 20-30 minutes, and after the first 5 minutes adding a drop of ammonium hydroxide until zinc sulphide precipitates in quantity. It is necessary to add ammonium hydroxide to bring down zinc in order to assure the complete precipitation of cadmium. The precipitate of sulphides is filtered off and washed with cold water.

Removal of Arsenic, Antimony and Tin. The precipitate on the filter is washed with ammonium hydroxide or colorless ammonium sulphide, dissolving out the arsenic, antimony and tin (stannic). If tin in the stannous condition is found to be present, yellow ammonium sulphide must be used. Arsenious sulphide is practically insoluble in the hydrochloric acid used in dissolving the cadmium sulphide. Antimonious sulphide is also only slightly soluble, so that these sulphides remain behind in carrying out the analysis.

The sulphides of tin, however, are soluble in the hydrochloric acid and must be removed before the final precipitation of cadmium sulphide.

Removal of Bismuth, Copper and Mercury. Bismuth is not removed in the course of analysis as its sulphide is soluble in hydrochloric acid and hence it must be removed by precipitating with ammonium hydroxide before the final precipitation of cadmium is made. Copper sulphide is, however, practically insoluble in the hydrochloric acid used and remains behind when dissolving the first precipitations of cadmium sulphide, so that the use of potassium cyanide need seldom be resorted to mercuric sulphide is practically insoluble in cold hydrochloric acid (1:2) and is left behind in carrying out the analysis.

Separation from Zinc. Cadmium is separated from the accompanying zinc by successive precipitations with hydrogen sulphide, each time bringing down less zinc, until finally only cadmium is precipitated. In the presence of a large quantity of zinc it is not possible to precipitate all cadmium with the acidity required to prevent the precipitation of any zinc sulphide.

GRAVIMETRIC METHODS

Determination as Cadmium Sulphide

Procedure for Ores

A 10 gram sample of the finely pulverized ore is weighed out into a 400 cc. beaker, moistened with water and 50 cc. of aqua regia carefully added. When violent action has stopped, the beaker is placed on a warm plate to complete decomposition. The cover glass and sides of beaker are washed down with water, 25 cc. of sulphuric acid (1:1) added and evaporation carried to fumes. Water (100 cc.) is added, boiled until all soluble salts are dissolved, and the residue filtered off, and washed, using suction.

A steady stream of hydrogen sulphide is passed through the filtrate, which should have a volume of approximately 300 cc. for 30-40 minutes. After all iron in solution has been reduced, ammonium hydroxide is added 1 cc. at a time until a heavy precipitation of zinc sulphide has taken place.2 The precipitate is allowed to settle, the clear solution decanted and finally the bulk of the precipitate transferred to a 15 cc. paper, and washed with cold water. The sulphides on the paper are dissolved with hydrochloric acid (1:2) catching the solution in a clean beaker. Any precipitate adhering to the sides of the original beaker is also dissolved off and poured into the filter. After all zinc sulphide has been dissolved, the paper is washed three more times with the hydrochloric acid.3 To the solution 15 cc. of sulphuric acid is added and evaporation carried just to fumes. Water is added (200 cc.) and hydrogen sulphide passed through as before. Ammonium hydroxide should be added one drop at a time, only to start the precipitation of cadmium sulphide. precipitate is filtered off, redissolved as previously and a third precipitation made.4 Before making the final precipitation, the solution should be allowed

⁴ It is necessary to make three or even four precipitations of cadmium sulphide in order to free it completely of zinc.

¹ In the case of oxidized ores, hydrochloric acid alone may be used, although it is well to use a little nitric acid also.

² The solution should always be sufficiently acid so that no iron etc. precipitates.


³ This strength of acid will leave on the paper as an insoluble residue all the As, Cu, and Hg, most of the Sb, and some of the Bi and Sn. The second precipitation of CdS should free the Cd of the rest of the Sb, but not the Bi or Sn.


to stand, and any lead sulphate filtered off. The final precipitate of cadmium sulphide is filtered on a weighed Gooch crucible.

The cadmium sulphide on the Gooch crucible need only be washed once or twice, if at all, as it usually receives sufficient washing in the transfer to the crucible, and in the scrubbing and washing out of the beaker. After drying at 110° C. for 1 hour, the crucible is cooled, weighed and the cadmium calculated from the difference in weights.

$$CdS \times .778 = Cd$$
.

It is seldom that bismuth and tin will be encountered in making a determination for cadmium so that the procedure for removing these elements need rarely be used. Cadmium sulphide precipitated from sulphuric acid is bright



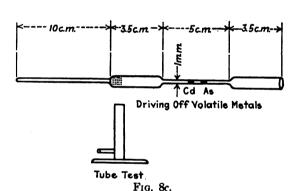

yellow to orange. If the precipitate is brown in color, bismuth and tin should be looked for and removed.

Determination as Sulphate

The final precipitate of cadmium sulphide is dissolved with hydrochloric acid, and evaporated to dryness in a weighed platinum crucible or dish. A slight excess of dilute sulphuric acid is poured over the residue and evaporated over a steam bath or warm The excess of sulplate. phuric acid is driven off by heating in an air bath, or in a muffle heated below a dull red heat. For

an air bath, the crucible or dish may be placed in a larger vessel, and this outer vessel heated to redness. $CdSO_4 \times 0.5392 = Cd$.

Electrolytic Determination of Cadmium

The final precipitate of CdS is dissolved and the cadmium determined electrolytically as given under cadmium in spetter, Chapter on Zinc, or if the amount of cadmium is large the electrolytic determination is best carried out with a potassium cyanide electrolyte. The hydrochloric acid solution of cadmium, after separation of interfering elements is taken to fumes with sulphuric acid, a drop of phenolphthalem added for indicator, and a pure solution of sodium hydroxide added until a permanent red color is obtained. A strong solution of potassium cyanide is added drop by drop until the cadmium hydroxide just dissolves, avoiding any excess. The solution is diluted to 100 cc. with water, electrolyzed cold using a gauze electrode with a current

of 0.5-0.7 ampere and voltage of 4.8-5.0. At the end of 5-6 hours the current is increased to 1-1.2 amperes and electrolysis continued for an hour more. The electrode is removed from the solution the instant the current is broken and immediately washed with water, followed by alcohol and ether. After drying at 100° C., the electrode is cooled and weighed. Prolonged heating of the deposit should be avoided.

Rapid deposition can be effected by means of the rotating anode (600 revolutions per minute). The solution of cadmium sulphate containing 3 cc. of H₂SO₄ (1:10) per 150 cc. The solution, heated to boiling, is electrolyzed with a current of N.D.₁₀₀ = 5 amperes, E.M.F. = 8-9 volts. Fifteen minutes is sufficient for the deposition of .5 gram of cadmium.

Notes. Before washing and discontinuing the current, it is advisable to add a little water to raise the level of the liquid and continue the electrolysis to ascertain

whether the deposition is complete.

Traces of cadmium may be estimated in the above solution by saturating this with H₂S and comparing the yellow-colored colloidal cadmium sulphide solution with a known quantity of cadmium and the same amounts of potassium hydroxide and cvanide as in the solution tested.

VOLUMETRIC DETERMINATION OF CADMIUM

Titration of Cadmium Sulphide with Iodine.2

The titration of cadmium sulphide with standard iodine in a hydrochloric acid solution is the same as the procedure given for determination of sulphur by the evolution method, the following reaction taking place:

$$CdS+2HCl+I_2=CdCl_2+2HI+S.$$

Procedure. Cadmium having been isolated as the sulphide according to the standard procedures given, the precipitate is washed and allowed to drain on the filter. The filter, together with the sulphide, is placed in a beaker or an Erlenmeyer flask, water added, and the whole shaken to break up the precipitate. A moderate quantity of hydrochloric acid is added and the solution titrated with standard N/5 or N/10 iodine solution. Towards the end a little starch solution is added and the titration continued until the excess of iodine colors the solution blue. If preferred, an excess of iodine solution may be added and the excess determined by a back-titration with standard thiosulphate solution.

One cc. N/10 iodine = 0.00562 gram cadmium.

¹ Electro-Analysis, E. F. Smith. P. Blakiston's Son & Co. Pub.

² P. von Berg (Z.'a. C., 26, 23) transfers the precipitate and filter to a stoppered flask, expels the air with CO₂ and by boiling and then titrates in an hydrochloric acid solution. Experiments by the author have shown this caution to be unnecessary.

CALCIUM

WILFRED W. SCOTT

Ca, at.wt. 40.07; sp.gr. 1.5446^{29*}; m.p. 810° 1° C.; oxide, CaO

DETECTION

In the usual course of qualitative and quantitative analysis calcium passes into the filtrates from the elements precipitated by hydrogen sulphide in acid and alkaline solutions (Ag, Hg', Hg'', Pb, Cu, Cd, As, Sb, Sn, Fe, Cr, Al, Mn, Ni, Co, Zn, etc.), and is precipitated from an ammoniacal solution by ammonium carbonate as calcium carbonate, along with the carbonates of barium and strontium. The separation of calcium from barium and strontium is considered under Separations. The oxalate of calcium is the least soluble of the alkaline-earth group.² All, however, are soluble in mineral acids. Calcium oxalate may be precipitated from weak acetic acid solution by ammonium oxalate.

Flame Test. The flame of a Bunsen burner is colored yellowish red wher a platinum wire containing calcium salt moistened with c ncentrated hydrochloric acid is held in the flame.

Spectrum. An intense orange and green line with a less distinct violet line. Note chart of the spectra of the alkaline earths. Plate II.

See chapter on Barium under Separations—Preliminary Tests, page 58.

ESTIMATION

The determination of calcium is required in complete analyses of ores. It is of special importance in the analysis of mortar, cement, bleaching powder plaster of Paris, certain paint pigments such as phosphorescent paint, CaS. The determination is required in the analysis of water.

Calcium occurs in the following substances: as carbonate in limestone, marble, chalk, Iceland spar, shells, coral, pearl. Together with magnesium it is found in dolomite. It occurs as sulphate in anhydrite, gypsum, alabaster selenite; as silicate in the mineral wollastonite, CaSiO₂; as phosphate in phosphorite, Ca₃(PO₄)₂, also in bones and in apatite, 3Ca₃(PO₄)₂·CaF₂; as fluoride in fluorspar, CaF₂. As oxalate it occurs in plant cells. It is found in nearly all mineral springs, artesian wells, and river waters, principally as bicarbonate of calcium, CaHCO₃.

Preparation and Solution of the Sample

The oxide, hydroxide, and salts of calcium are soluble in acids with the exception of gypsum and certain silicates which require fusion with sodium carbonate or bicarbonate followed by an hydrochloric acid extraction.

¹Cir. 35 (2d Ed.) U. S. Bureau of Standards.

 2 Solubility: CaC₂()₄·H₂O = 0.000554 gram per 100 cc. H₂O. BaC₂O₄·H₂O = 0.0093 gram. SrC₂O₄·H₂O = 0.0051 gram. MgC₂O₄2H₂O = 0.07 gram. Van Nostrand's Chem. Annual—Olsen.

Solution of Limestones, Dolomites, Magnesites, Cements, Lime, etc. One gram of the powdered material is digested in a 250-cc. beaker with 20 cc. of water, 5 cc. of concentrated hydrochloric acid, and 2 or 3 drops of nitric acid (sp.gr. 1.42). The beaker is covered to prevent loss by effervescence. When the violent action has subsided, the sample is placed on a hot plate and boiled for a few minutes. The watch-glass is rinsed into the beaker and the solution filtered. The residue is washed, dried and ignited in a platinum crucible, and then fused with a little sodium carbonate or bicarbonate. The cooled fusion is dissolved in hot dilute hydrochloric acid, the liquid added to the main solution and calcium determined by precipitation as calcium oxalate, after removal of silica, iron, alumina, etc.

Solution of Gypsum, Plaster of Paris, and Sulphates of Lime, etc. The treatment of the sample is similar to the one given above with the exception that it is advisable to add a larger amount of strong hydrochloric acid, e.g., about 20 to 25 cc. If barium sulphate is present it is indicated by the clouding of the solution, upon acidifying the water extract of the carbonate fusion.

Silicates. Solution of silicates is best obtained by direct fusion of 1 gram of the powdered material with 4 to 5 grams of sodium carbonate, in a platinum crucible. The cooled melt is now covered with water and dissolved with hydrochloric acid according to the standard procedure for carbonate fusions. The hydrochloric acid solutions are taken to dryness and the silica dehydrated in an oven at 110° C. for an hour and then the residue is extracted with dilute hydrochloric acid and filtered. The filtrate contains iron, alumina, magnesium, lime, etc.

Chlorides, Nitrates, and Other Water-soluble Salts. These are dissolved in water slightly acidified with hydrochloric acid.

Sulphides, Pyrites Ore, etc. The ore should be oxidized with bromine or by roasting, previous to the acid treatment.

SEPARATIONS

Removal of Silica. The solution obtained by one of the above procedures is evaporated to dryness and the silica dehydrated at 110° C. for an hour. The residue is now extracted with dilute hydrochloric acid. Silica remains insoluble and may be filtered off. The solution contain lime, together with iron, alumina, magnesia, etc., as chlorides.

Removal of Iron and Alumina. The filtrate from the silica residue is treated with a few drops of nitric acid and boiled to oxidize the iron. Ammonia is now added cautiously until the solution just smells of it (a large excess over that required to neutralize the acid and combine with iron and alumina, will tend to dissolve Al(OH)₂). The precipitated hydroxides are allowed to settle and then filtered hot through a rapid filter and washed with hot water. Calcium, together with magnesium, is in solution and passes into the filtrate.

Removal of Copper, Nickel, Cobalt, Manganese, Zinc, and Elements Precipitated as Sulphides in Acid and Alkaline Solutions. This separation is required seldom in lime-bearing ores. In analysis of pyrites and certain other ores, containing members of the hydrogen sulphide and ammonium sulphide groups, the removal of these impurities is necessary.

The solution from the residue of silica is made slightly ammoniacal and H₂S passed into the solution to saturation (or ammonium sulphide may be

added). The precipitated sulphides are filtered off from the solution heated to boiling. The filtrate containing the calcium is boiled down to 50 to 75 cc. and the precipitated sulphur removed by filtration. Calcium is determined in the filtrate by precipitation with ammonium oxalate or oxalic acid according to directions given later.

Separation of Calcium from Magnesium and the Alkalies. In the presence of considerable amounts of calcium and comparatively small quantities of magnesium the oxalate method of precipitating calcium, in presence of ammonium chloride, is generally sufficient for precipitating calcium free from magnesium and the alkalies. In analysis of dolomite, MgCO₃·CaCO₃, and of samples containing comparatively large amounts of magnesium, a double precipitation of calcium is generally necessary for removal of occluded magnesium.

Separation of Calcium from Barium and from Strontium. The alkaline earths are converted to nitrates, all moisture expelled by heat, and calcium nitrate extracted from the insoluble nitrates of barium and strontium by a mixture of anhydrous ether and absolute alcohol, in equal parts, or by boiling the dry nitrates in amyl alcohol (b.p., 137.8° C.). Details of the procedure are given under Separations of the Alkaline Earths in the chapter on Barium, page 59.

Phosphate Rocks, Calcium Phosphate, etc.1

Determination of Lime in Presence of Phosphates, Iron, and Alumina. Should phosphoric acid be present in the solution, calcium will be precipitated as a phosphate upon making the solution neutral or slightly alkaline with ammonia, and will remain with iron and alumina precipitates.

Precipitation of Calcium Oxalate in Presence of Iron and Alumina. The solution containing the phosphates freed from silica is oxidized by boiling with nitric acid as usual. Ammonia water is added to the cooled solution until a slight precipitate forms, and then citric acid is added in sufficient quantity to just dissolve the precipitate. If this does not readily occur, additional ammonia is added, followed by citric acid until the solution clears, then about 15 cc. of citric acid in excess. The solution is diluted to 200 cc. and heated to boiling. Calcium oxalate is now precipitated by addition of ammonium oxalate. Iron and alumina remain in solution.

Citric acid is made by dissolving 70 grams of the acid, H₂C₆H₆O₇·H₂O, in a liter of water.

Wagner's Solution. In place of citric acid, the following solution may be used. Twenty-five grams of citric acid and 1 gram of salicylic acid are dissolved in water and made to 1000 cc. Twenty-five to 50 cc. of this reagent is effective in preventing precipitation of iron and alumina.

¹ Zeit. für Angewandte Chemie, 34, 776, Aug., 1898.

GRAVIMETRIC DETERMINATION OF CALCIUM

Precipitation of Calcium Oxalate and Ignition to Calcium Oxide

Calcium oxalate is precipitated from feebly ammoniacal solutions or from solutions acidified with acetic, oxalic, citric, or salicylic acids, by means of ammonium oxalate. The presence of ammonium chloride hinders precipitation of magnesium and does not interfere with that of calcium. If, however, much magnesium (or sodium) is present it will contaminate the calcium precipitate so that a second precipitation is necessary to obtain a pure product. compound formed from hot solutions is crystalline or granular and filters readily. whereas the flocculent precipitate formed in cold solutions does not. Calcium oxalate, CaC₂O₄·H₂O₁ decomposes at red heat to CaO, in which form it is weighed.

Procedure. If the calcium determined is in the filtrate from previous groups, hydrogen sulphide is expelled by boiling and the precipitated sulphur filtered off, the solution having been concentrated to about 200 cc. The filtrate should contain sufficient ammonium chloride to hold magnesium in solution in presence of ammonium oxalate (i.e., about 10 grams NH₄Cl per 0.0015 gram MgO per 100 cc. of solution.) 2 If not already present, the chloride is added in sufficient amount, and the solution diluted to about 400 cc.

Precipitation. The solution is heated to boiling and 10 cc. of acetic acid added to the neutral mixture. Fifteen cc. or more of a saturated solution of oxalic acid is added and after five minutes a slight excess of ammonia. solution is allowed to cool an hour or so, the clear solution decanted through a 10-cm. filter and the precipitate washed three times by decantation and finally on the filter with dilute ammonia (1:10), or 1% ammonium oxalate.

To remove clinging impurities (Na or Mg) the precipitate is dissolved in dilute nitric acid (1:4) and the filtrate collected in the beaker in which the first precipitation was made. The solution is heated to boiling after addition of a few drops of oxalic acid and sufficient ammonium hydroxide to make the solution slightly alkaline. The precipitated oxalate is allowed to settle, filtered and washed as in the first precipitation, the oxalate adhering to the sides of the beaker being carefully "copped" out. The oxalate is ignited wet in a weighed crucible, the heat being low at first, until the filter has charred and then to the full heat of the Méker blast lamp. Fifteen minutes of blasting should be sufficient to obtain constant weight. If the precipitate is large a second ignition is advisable to insure the complete decomposition of the oxalate and carbonate to oxide.

The crucible is cooled in a desiccator and weighed as soon as possible.4

Factors. $CaO \times 0.7146 = Ca$, or $\times 1.7847 = CaCO_1$, or $\times 2.8908 = Ca(HCO_1)_1$. or $\times 2.428 = \text{CaSO}_4$.

4 Calcium oxide absorbs moisture and CO2 from the air.

¹ Calcium oxalate dried at $100 = \text{CaC}_2\text{O}_4 \cdot \text{H}_2\text{O}$. Heated to 200° C. = = CaC₁O₄. At 500° C. the oxalate begins to decompose, free carbon is liberated, and calcium carbonate begins to form. At bright red heat carbon burns off and the carbonate is completely decomposed to the oxide and CO₂.

² Mellor, "A Treatise on the Ceramic Industries," 213 (1913).

³ Approximately 8.6% at 20° C. About five times as much ammonium oxalate as is required for combination with calcium and magnesium should be added to the solution.

Other Methods. Gravimetric

Calcium may be converted to carbonate, sulphate or fluoride and so weighed. The oxide above obtained may be converted to sulphate by moistening with a few drops of water and then adding a slight excess of sulphuric acid (1:4, dilute). The excess sulphuric acid is driven off by heating over a low flame to SO₂ fumes and then more strongly at dull red heat until the excess acid has been expelled. A ring burner reduces the risk of spurting. Addition of a drop or so of ammonia to the cooled residue and reheating assists expulsion of the acid. The residue is weighed as CaSO₄.

 $CaSO_4 \times 0.2943 = Ca \text{ or } \times 0.4119 = CaO \text{ or } \times 0.7352 = CaCO_3$.

VOLUMETRIC DETERMINATION OF CALCIUM

Titration of the Oxalate with Permanganate 1

This procedure may be applied successfully in a great variety of instances on account of the readiness with which calcium oxalate may be separated. In the presence of iron, alumina, manganese, magnesia, etc., it is advisable to make a reprecipitation of calcium oxalate to free it from adhering contaminations.

The following reaction takes place when potassium permanganate is added to calcium oxalate in acid solution:

$$5CaC_2O_4 + 2KMnO_4 + 8H_2SO_4 = 5CaSO_4 + K_2SO_4 + 2MnSO_4 + 10CO_2 + 8H_2O_4$$

Procedure. Calcium oxalate, obtained pure, by precipitation and washing according to directions given under the gravimetric determination of calcium, is washed into a flask through a perforation made in the filter paper, the filter is treated with a little warm, dilute sulphuric acid ² and the adhering oxalate dissolved and washed into the flask. About 25 cc. of dilute sulphuric acid, 1:1, is added and the solution diluted to 250 to 300 cc.

When the precipitate has dissolved, the solution warmed to 60 or 70° C. is titrated with standard potassium permanganate, added cautiously from a burette with constant agitation, until a faint permanent pink color is obtained.

One cc. N/10 KMnO₄ = 0.0020 gram Ca, or $\times 0.0028$ = CaO.

Factors. $Ca \times 1.3993 = CaO$ or $\times 2.4974 = CaCO_3$ or $\times 3.3975 = CaSO_4$ or $\times 2.581 = Ca_3(PO_4)_2$.

Analysis of Limestone and Cement. See chapter on Cement by Richard K. Meade.

¹ Fresenius, Hempel, Mohr, Sutton and others have testified to the accuracy of this method for the determination of calcium.

² HCl in moderate quantity may be used in place of sulphuric acid without danger

of liberating free chlorine as is the case in presence of iron.—Fleischer.

³ From the reaction $2KMnO_4$, equivalent to 50 or 10H, reacts with $5CaC_2O_4$. and $5Ca=(5\times40)\div10=20$. A normal solution of calcium=20 grams Ca per liter. One cc. N/10 solution=0.002 gram Ca.

WILFRED W. SCOTT.

C. at.wt. 12.0; sp.gr. amorp. 1.75-2.10; cryst.: graphite, 2.25; diamond, 3.47-3.5585; m.p. sublimes at 3500° C.; oxides, CO and CO₁

DETECTION²

Element. Carbon is recognized by its appearance and by its inertness towards general reagents. It is seen in the charring of organic matter when heated or when acted upon by hot concentrated sulphuric acid.

Upon combustion with oxygen or by oxidation with chromic and sulphuric acids, carbon dioxide is formed. The gas passed into line water forms a white precipitate, CaCO₃. Penfield fuses the substance with precipitated and washed PbCrO₄ in a hard glass tube closed at one end. The CO₂ is tested at the mouth of the tube.2

Carbon Dioxide. Carbonates. CO, in Gas. A white precipitate with lime water, baryta water, ammoniacal solutions of calcium, or barium chlorides, or lead acetate (basic), carbonates of the metals are formed.

Carbonates. Action of mineral acids cause effervescence, CO₂ being evolved. The gas is odorless (distinction from SO₂, H₂S, and N₂O₃) and is H2 SO4

colorless (distinction from N₂O₃). The gas absorbed in the reagents above mentioned produces a white precipitate. The test is best made by placing the powdered material in a large test-tube with a stopper carrying a funnel and delivery tube as shown in the illustration, Fig. 9. For small amounts of combined CO2, warming of the test-tube may be necessary. Sulphuric or phosphoric acid should be used to liberate the gas, which is conducted into the reagent used for the test.

Distinction between Soluble Carbonates and Bicarbonates. The solution of the former is alkaline to phenolphthalein indicator (pink). Bicarbonate solutions remain colorless with this indicator. Normal carbonates precipitate magnesium carbonate when added to magnesium sulphate solution; bicarbonates cause no precipitation.

Free Carbonic Acid in Water in Presence of Bicarbonates. 0.5 cc. of rosolic acid (1 part acid in 500 parts of 80%

alcohol), produces a red color with bicarbonates in absence of free CO₂, and a colorless or faintly yellow solution when free CO, is present.

Fig. 9.—Test for

Carbonate.

Carbon Monoxide. The gas burns with a pale blue flame and is not absorbed by potassium hydroxide or lime water (distinction from CO₂). It is oxidized to CO₂ and so detected. With hot, concentrated potassium hydroxide, potassium formate is produced.

The gas is detected in the blood by means of the absorption spectrum.

¹ Van Nostrand's Chemical Annual, Olsen.

² J. Am. Chem. Soc. 39, 3745 (1917).

ESTIMATION

The element occurs free in nature in the crystalline forms, diamond and graphite, and in the amorphous form, charcoal, coke, etc. It occurs in iron, steel, and in certain alloys. Its estimation in these metals is generally required. Carbon is determined in the analysis of organic compounds in which it is invariably combined and may also be present as free carbon (asphaltum).

Combined as a carbonate it occurs in a large number of substances, among which are found calcite, marble, limestone, dolomite, magnesite, strontianite, witherite, spatic iron ore. It occurs as the dioxide in the air, in water $(H_2O \cdot CO_2)$ and in flue gas. Carbon dioxide is the active constituent of baking powders $(NaHCO_2)$.

Preparation of the Sample

Iron, Steel, and Alloys. Drillings taken from different sections of the representative bar should be free from grease and dust. These are best kept in glass-stoppered bottles. Where a large number of

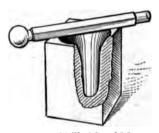


Fig. 10.—Chilled Steel Mortar.

glass-stoppered bottles. Where a large number of daily samples are determined, it is found more convenient to use small manila envelopes, upon which the record of the analysis may be placed. Should it be impossible to obtain drillings free from grease, this impurity may be removed by heating the sample in an atmosphere of nitrogen, or by repeated extraction with ether.

Coarse chips, cast-iron drillings, etc., should be broken down in a chilled-steel mortar, Fig. 10.

Carbon may now be separated in a definite weight of the sample as directed below, or it may

be determined by direct combustion or by oxidation with chromic acid according to a procedure given later.

Organic Matter. It is advisable to fuse this in a nickel or iron crucible with sodium peroxide. The carbonate thus formed may be determined as usual. The organic substance may be oxidized directly in the combustion furnace.

Carbonates. Limestone, Dolomite, Cement, Alkali Carbonates and Bicarbonates. The powdered material is decomposed by addition of an acid as directed in the methods given later.

Separation of Carbon from Other Substances

The element is generally determined as carbon dioxide, in which form it is liberated from most of the combinations in which it occurs, free from other substances by ignition in a current of oxygen, or by oxidation with chromic acid as directed later.

Separation of Carbon in Iron and Steel. Cupric Potassium Chloride Method. 0.5 to 2 grams of the drillings are treated with 100 to 200 cc. of cupric potassium chloride solution and 10 cc. of hydrochloric acid (1.19). This mixture dissolves the iron according to the reaction

Fe+CuCl₂=FeCl₂+Cu and Cu+CuCl₂=Cu₂Cl₂+carbon as a residue.

The solution should be stirred frequently to hasten the solution of the iron. It is advisable to keep the temperature of the solution at about 50° C. When the iron and copper have dissolved the carbon is filtered off into a perforated platinum boat or crucible, as directed under the methods. It is now oxidized to CO₂ and so determined.

Note. The cupric potassium chloride solution is prepared by dissolving 150 parts of potassium chloride and 170 parts of crystallized cupric chloride in water and crystallizing out the double salt. Three hundred grams of this salt are dissolved in 1000 cc. The solution may be used several times by chlorinating the dirty brown filtrate from the carbonaceous residue. The cuprous chloride formed during the solution of the steel is converted again to cupric chloride, and the chlorinated double salt is even more energetic in its solvent action than the freshly made reagent. (Blair.)

GRAVIMETRIC METHODS FOR DETERMINATION OF CARBON

The determination of carbon by combustion with oxygen is made in two general classes of substances: A. Steel, iron and in certain alloys. B. Organic compounds. Carbon in steel and alloys is considered in two forms: carbide or combined carbon, and graphitic carbon. In organic substances carbon occurs principally combined with hydrogen, oxygen, and nitrogen. For the present we will consider procedures for the determination of carbon in steel and alloys.

The most accurate procedure for determination of carbon in steel, alloys, and in other materials containing the substance combined or free is by combustion with oxygen in a furnace heated by gas or electricity; the carbon dioxide formed being absorbed in caustic, and weighed.

Apparatus. Combustion Furnace. Although the gas furnace has been used more commonly on account of gas being more available than electricity, the extension of generating electric plants makes it possible to use electric furnaces, and these are gradually displacing those heated by gas, as they are more compact, easily manipulated and comparatively simple in structure.

A simple electric furnace may be made by wrapping a silica tube with a thin covering of asbestos paper, which has been moistened with water. On drying the paper will cling to the tube. A spiral coil of nichrome wire (Driver and Harris) is wound around this core. On a 2-foot length of tube two 45-foot lengths of No. 18 wire, connected in parallel, will heat the tube to bright redness, attaching the terminals to an ordinary light socket. The coils should be covered with \(\frac{1}{4}\)-in. coating of alundum cement. For appearance' sake as well as for protection, the tube is placed in a large cylinder of sheet iron, packed around with asbestos, and is held in position by circular asbestos boards placed at the ends of the large cylinder. The cylinder is mounted on a stand.

Absorption Apparatus. A large number of forms are for sale. The Geissler and Liebig bulbs have been popular (Figs. 11 and 12), but are now being displaced by forms that have less surface exposed, that are more easily cleaned and less fragile, such as Gerhardt's, Vanier's and Fleming's apparatus (Figs. 13, 14 and 16). The Vanier and the Fleming absorption apparatus are especially to be recommended, on account of their capacity, compactness, efficiency, in handling gases passing at a rapid rate, and their simplicity of form.

Procedure for Determining Carbon by Combustion. Mr. William R. Fleming ¹ describes his apparatus in the Iron Age, Jan. 1, 1914. The following abstract is taken from Eimer & Amend's circular, edited by Mr. Fleming.

The greatest value of this rapid method is realized when it is used to follow a bath of steel in the open-hearth furnace preliminary to tapping. It abolishes








Fig. 11.—Geissler Bulb.

Fig. 12.—Liebig Bulb.

Fig. 13.—Gerhardt Bulb.

completely the unreliable and dangerous color carbon. By this method absolutely accurate results can be reported to the open hearth ten minutes after the drillings are received.

In principle this method is not new; in manipulation it is new. Hereto-



Fig. 14.—Vanier Bottle.

fore chemists have been laboring under the impression that the flow of gas during a combustion must not exceed a certain snail-like pace. This false impression has been injected into the minds of chemists by a few who were supposed to have investigated the matter. The truth is that the faster oxygen is fed to burning steel the more complete the combustion will be. The rate of current is limited by the efficiency of the apparatus used to absorb the evolved carbon dioxide.

The Apparatus Described. The combustion train is shown complete in Fig. 15. The oxygen is delivered to the train through a regulating and reducing valve such as is used for welding. The regulating valve is not essential, yet any chemist who uses one will appreciate its convenience, especially in this method. Its convenience will be explained later. K is a mercury pressure gauge. It serves as a guide during the combustion and is an essential piece of apparatus. The graduated column is 6 ins. high and is

divided into eighths. P is a washing bottle containing caustic potash solution. Filled to the mark indicated with 50% solution it will serve for at least 1000 combustions. It is used solely to indicate the flow of gas, not to purify it. If the chemist desires he may omit this from the train. T is a calcium chloride jar. It is filled to the mark indicated with finely divided calcium chloride, about pea size, retaining all the dust. A layer of asbestos is formed over the chloride and the remaining space filled with soda lime. The glass tubing leading from the jar is loosely packed for a distance of several inches with asbestos. This prevents any soda lime dust being carried into the combustion tube. G is a mercury valve like that used in Johnson's train. It is used solely to maintain an atmosphere of

¹ Metallurgist, Andrews Steel Company, Newport, Ky.

pure oxygen in the purifying train, a condition essential to accurate results. It is not used to prevent carbon dioxide backing into the purifying train, of which

there is not the remotest possibility.

The combustion tube is the ordinary fused silica tube glazed on the inside only. The tube is 30 ins. long with inside diameter of from 7 to 1 in. One tube of 30 ins. will serve twice as long as one of 24 ins. It is loosely packed with asbestos for a distance of 6 ins. at the exit end, and 3 ins. is allowed to project from the furnace. For about the first 100 combustions, the combustion boat is pushed close against the asbestos. The portion of the tube immediately above this will become coated with iron oxide. The asbestos is then moved up so that it covers this portion of the tube and a fresh area exposed to the spraying oxide. In this manner one tube can be made to serve 600 combustions or even more. Both platinum and nickel cylinders have been used inside the tube to protect it from the spraying oxide, but it is doubtful whether this practice pays. These cylinders are not used in this laboratory because it is believed that they delay incipient combustion for at least thirty seconds.

The Furnace and Combustion Tube. The furnace used is one of the ordinary resistance type. It is constantly maintained at a temperature of 1000° C. This temperature is verified daily by the use of a pyrometer. Many claim to be expert at judging temperatures, but none are expert enough to be without a pyrometer. The two-way stop following the combustion tube will be found very convenient when it is not desirable to pass the current through the jars Z and O.

Z is filled with 20-mesh zinc. Once filled it will serve for several thousand combustions. As a matter of fact it is included in this train as a filter. If nickel boats and aluminum are used the chemist may omit this zinc jar from the train, for with all ordinary grades of steel it serves no purpose.

O is the phosphoric anhydride jar. A little asbestos is placed in the lower part just above the lower stopper. The remaining space in the jar is completely filled with phosphoric anhydride. The upper stopper is packed tightly enough to prevent any powder being swept into the weighing apparatus. As the anhydride liquefies it passes down into the lower stopper, where it can

Fig. 15.—Fleming's Apperatus for Determination of Carbon by Combustion

be removed conveniently without disturbing the anhydride above it. Likewise

the anhydride can be replenished by removing only the upper stopper. The jar need not be washed oftener than once in 500 combustions. When filled with anhydride, fresh reagent need not be added for at least 150 combustions. After each combustion the jar should be given a few sharp taps with the hand to prevent canals being formed.

Details of the Absorption Apparatus. The absorption apparatus, shown



Fig. 16.—Fleming Absorption Apparatus.

in detail in Fig. 16, has been modified slightly at the suggestion of Henry G. Martin, of the Railway Steel Spring Company, Chicago Heights, Ill. This apparatus is no more efficient than the old style, but it is much more convenient and less troublesome. In the old-style tube the anhydride would liquefy after several days and require replenishing. To overcome this, Mr. Martin suggested using separate chambers for the anhydride and soda lime, so that communication could be broken when the tube was standing idle. The tube shown, Fig. 16, is Fleming's modification of Mr. Martin's suggestion. When properly filled this tube will serve for at least 70 combustions when operating on 1.5 grams of sample containing 1.03% carbon.

The anhydride in the upper chamber serves for at least 300 combustions. Soda lime, placed in the lower tube in alternate layers (\frac{1}{2}\) in.) of the different meshes, has proven a very convenient and desirable reagent. The 12-mesh soda lime for nitrogen can also be used with excellent results. If this is employed, part of it should be ground to about 60-mesh and

alternate layers of fine and coarse used.

It is exceedingly important that the tube be loaded with alternate layers of coarse and fine reagent, for, if the 12-mesh reagent is transferred directly from the bottle to the absorption tube, the latter will fail to be effective for more than 30 combustions and in some cases less. The reason for this is evident. The lower stopper is packed loosely with asbestos, also the lower portion of the soda lime chamber just above the stopper. Beginning with a layer of 12-mesh soda lime, the entire chamber is filled with alternate layers of fine and coarse reagent. The small diameter of the anhydride chamber is packed with asbestos and the remaining space filled with phosphoric anhydride. Finally, the upper stopper is packed with asbestos. The anhydride chamber, filled as indicated, will not require refilling for at least 300 combustions. It is not necessary to turn the chamber to break communication while the tubes are idle, for the packing of the small diameter with asbestos prevents the absorption of moisture from the soda lime. The tubes must be used in pairs, so that one serves as a tare in weighing the other. A pair of tubes assures the operator of at least 140 combustions. A glass or rubber tubing about 12 ins. long serves as a guard for the absorption tube. It connects the bottle, P_1 , which is used to indicate flow of gas.

The use of clay boats has been abandoned in favor of nickel boats filled with alundum. These are greatly superior to clay boats in every conceivable way. The alundum is labeled as being free from carbon, but this is not true. In fact, some of it contains considerable carbon. It should always be burned in oxygen at 1000° before using. The boats are formed out of 22-gauge pure sheet nickel. One boat will serve for about 130 to 150 combustions, some more, some less.

Details of the Analysis. The furnace being at 1000°, the two freshly prepared absorption tubes are placed in the train and oxygen run through at the rate of 300 cc. per minute for fifteen minutes. This insures the displacement of all air from the purifying train as well as the absorption tubes. Remove one absorption tube from the train and turn on the oxygen until the mercury stands at about 2 ins. The rate of current is then measured by inverting a graduated cylinder filled with water. Several trials will establish a rate of about 325 cc. per minute. Note the reading of the column of mercury at this rate and subsequently, when using the same absorption tube, maintain this same pressure in the train and the rate of flow will be 325 cc., the rate during all combustions. Shut off the oxygen and, when it comes to a slow bubbling through P_1 , close the upper stopper of the absorption tube. Disconnect it from the train, but do not close the lower stopper for about five seconds after disconnection. Weigh against its mate as a tare. It is now ready for the first combustion.

Weigh 1.5 grams of drillings, preferably thin, curly drillings from a twist drill, and spread out in the nickel boat which is half filled with alundum. Place the absorption tube in the train and place its mate beside it. With the oxygen flowing about 100 cc. per minute, the drillings are pushed into the combustion tube. The current is immediately run up to the desired pressure, which gives 325 cc. per minute. The regulator will do the rest. It will feed the oxygen automatically to the burning steel. As a rule the drillings are entirely burned one and one-half minutes after insertion. Continue the flow of oxygen for three and one-half minutes more (five minutes, total time) and disconnect as before the absorption tube. Weigh immediately. The result will be accurate and reliable. Whether determining carbon in a standard steel, where the greatest accuracy is required, or in a bath test, the time required is always five minutes.

The weight of the boat, plus refractory lining, should be kept as low as possible, so as not to introduce too much cold material into the combustion tube. The boats used in this laboratory are $\frac{1}{2}$ in. wide, $\frac{1}{4}$ in. deep and 3 ins. long. Sheet nickel varies in percentage of carbon. As a rule, a nickel boat must be ignited in oxygen at 1000° for one to two hours.

There seems to be a difference of opinion concerning the physical condition of the steel after burning, some chemists believing that inaccurate results are obtained if the drillings have fused during combustion. Others maintain that complete fusion of the drillings is essential to accurate result. If drillings which happen to be a little thick are used, low results are obtained unless these are perfectly fused.

Graphitic Carbon

In Iron and Steel. The sample of 1 gram of pig iron or 10 grams of steel is treated with 15 cc. of nitric acid (sp.gr. 1.2), per gram of sample taken. When all the iron has dissolved, the graphite is allowed to settle and the supernatant liquid decanted onto an ignited asbestos filter, using either a perforated boat, Fig. 17, or a filtering tube. The residue is transferred to the filter, and washed thoroughly with hot water. It is treated with hot caustic solution (sp.gr., 1.1), washed thoroughly again with hot water, then with a little dilute hydrochloric acid, and finally with hot water. The carbon is now burned by one of the procedures given—the oxidation in the combustion

furnace being recommended. The CO₂ is absorbed in caustic and estimated according to the standard procedure given for carbon.



Fig. 17.—Boat and Holder for Carbon Determination.

 $CO_2 \times 0.2727 = graphitic carbon.$


The perforated boat, shown in the cut, fits snugly into the receptacle below. Sufficient asbestos is poured into the boat to form a film over the bottom. A seal is made around the boat with additional asbestos, the apparatus having been inserted in a rubber stopper in the neck of a suction flask and suction applied.

The apparatus is recommended by Blair for combustion of graphitic carbon or of total carbon liberated from iron or steel by the cupric potassium chloride method. The boat may be placed directly in the combustion tube and the carbon oxidized as usual.

The Shimer Combustion Apparatus 1

The apparatus, designed for the rapid determination of iron and steel, is in general applicable to the same class of chemical operations as is the com-

bustion tube of platinum, silica, or porcelain. It offers the advantage of neatness, reduction in the number of parts to be handled, diminished consumption of gas, and increased ease of manipulation. The simplified form, shown in the cut, Fig. 18, enables the use of the standard form of platinum crucible, A, with its inner wall ground to fit a tapered nickel, water-jacketed stopper, B. The rubber jacket of the original type is eliminated and a detachable nickel reinforcing ring, C, at the top of the crucible serves the double purpose of completing the security of the seal and as a support for the apparatus.

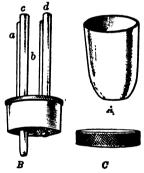

Water is circulated through the stopper through F_{IG} . 18.—Shimer Combustion the tubes c and d. The current of oxygen passes Apparatus, Simplified Form. through a into the crucible, oxidizing the material

within the crucible, which is heated to red heat with a burner placed below it. The carbon dioxide formed passes through b to the absorption train. The remainder of the apparatus for the determination is the same as is used with the combustion tube. An asbestos shield protects the upper portion of the outfit, the crucible fitting snugly in a hole in the asbestos board.

Combined Carbon

Indirect Method. The excess of carbon remaining when the graphitic carbon is subtracted from total carbon (in iron and steel), is calculated as combined carbon. This difference method is generally accepted as being the most accurate for estimation of combined carbon.

¹ Courtesy of Baker Platinum Works.

Stetser and Norton Combustion Train for Carbon **Determinations**

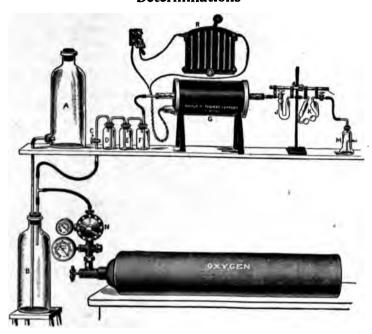


Fig. 18a.—Stetser and Norton Combustion Train for Carbon Determinations.1

- Aspirator Bottle, 8 liters capacity, graduation interval 250 ml., with one hole rubber stopper.

 Bottle, narrow mouth, of green glass, 2 gallons capacity, with two hole rubber stopper.

 Glass Tubing, 6 mm. outside diameter, for connections.

 Glass Tube, 3 mm. bore.

 Glass Stoppock, 2 mm. bore; used to prevent the gas from flowing through the train when turned
- Glass Stopcock, 2 mm. bore; used to prevent the gas from flowing through the train when turned on at the regulator.

 Bottle, wide mouth, 8 os. capacity, with two hole rubber stopper; to be used empty as a safety. Ditto; to be filled one-third full with concentrated Sulphuric Acid. Ditto; to be filled with Ascarite.

 Combustion Tube, of Silica, glased, 30 inches long by % inch diameter.

 Combustion Tube Pirmace.

 Rheostat, for controlling the temperature.

 Vanier Zinc Drying Tube; to be filled with 30 mesh Zinc.

 Vanier Sulphuric Acid Bulb; to be filled with Sulphuric Acid.

 Stetser and Norton Modification of the Midvale Absorption Bulb.

Combustion Method

The train illustrated in Fig. 18a was described by J. B. Stetser and R. H. Norton in "Combustion Train for Carbon Determinations," The Iron Age, Vol. 102, No. 8. The special features of this outfit are rapidity with which combustions can be made, simplicity of the absorption bulb, and the use of Ascarite, a special sodium hydrate asbestos absorbent mixture according to the formula of Mr. J. B. Stetser. It is a dryer as well as an absorber.

The absorption bulb is a modification of the Midvale Absorption Bulb designed by Mr. H. L. Fevert, of the Midvale Steel Company, and with one

¹ By courtesy of Arthur H. Thomas Co.

filling can be used for at least 400 determinations using one-half factor weight with carbon 0.50%. The bulb measures 45 mm. in diameter at its widest portion at the bottom, and 120 mm. high over all. It is provided with a capillary tube and rubber stopper at top, or with ground glass stopper.

The usual procedure is to allow three or four minutes for combustion. Results are often reported in six minutes after the sample enters the laboratory: this includes time for drilling, weighing sample, running test, weighing bulb

and reporting result.

The oxygen is delivered from a high pressure cylinder through the gas pressure regulator, and the authors also recommend that bottles as shown in the illustration be used to measure the amount of gas consumed and to supply rapidly the extra quantity of oxygen required during the burning of the drillings, in addition to equalizing the pressure.

Method of Operation.—The train is set up free from leaks, and the stop-cocks are opened with the exception of the one on the Sulphuric Acid Bulb K. This is opened sufficient to allow gas to flow at the rate of 200 to 250 ml. per

minute when the Absorption Bulb is attached.

The stopcock C is then closed, the remaining stopcocks being left as adjusted. The train is now ready for operation. Bottle B is filled with water. The gas regulator is opened, allowing oxygen to displace the water in bottle B, which water is driven into bottle A. When bottle A is filled, the regulator is closed and the train is ready for combustion. The exit end of the combustion tube, the usual glazed silica tube being recommended, is packed with some asbestos burned in a current of oxygen prior to using.

A sample of one-half factor weight properly prepared and weighed is placed in the alundum boat, RR Alundum protection being used, and then inserted in the furnace. The stopcock C is opened, and if the furnace is at 1800° C. or over, and the sample of drillings fine and uncovered, it should begin to burn in 20 seconds. The burning should take 40 to 60 seconds additional, consuming 500 ml. of oxygen. An additional 500 ml. of oxygen is turned on to wash out all CO₂, and the bulb is then ready to be weighed.

If the sample is covered by a lid or RR Alundum, or if the drillings are coarse, or the furnace is below 1800° C., the combustion may be delayed as much as two minutes. The actual burning will, as before, take from 40 to 60 seconds. In any event, 500 ml. of gas must be passed through the apparatus after the steel has ceased burning. The point at which the burning of the sample begins may be determined by the increased rate at which gas passes through the liquid in bottle E, due to the rapid absorption of oxygen by the burning steel. A similar decrease marks the end of the burning period.

Standardization of the Stetser and Norton Absorption Bulb.—A freshly filled bulb should be run on the train for an hour and then weighed. When the bulb has reached a constant weight, the train is checked by running a government standard

A bulb once filled and standardized will last for several weeks and is sufficient for from three to four hundred determinations. On account of the difference in color between the used and unused portions of the absorbent, it is possible to determine the moment a bulb can be discarded.

Notes. In chromium, tungsten and titanium steels a temperature of 1500° C.

is necessary to oxidize the carbon by direct combustion for thirty minutes. (J. R. Cain and H. E. Cleaves, J. Wash. Acad. Sci., 194, 4, 393–397.)

Carbon in Soils. One to 3 grams of 60-mesh sample is treated with a solution of 3.3 grams Cr0₈+10 cc. H₂O and 50 cc. conc. H₂SO₄ (1.84). The evolved CO2 is absorbed in standard caustic and titrated with acid, phenolphthalein and methyl orange being used as indicators. (J. Ind. Eng. Chem., 1914, 6, 843-846.)

DETERMINATION OF CARBON IN ORGANIC SUBSTANCES Combustion of Organic Substances Free of Nitrogen, Halogens, Sulphur, and the Metals

The following modification of the procedure described for determination of carbon in iron and steel is applicable to the determination of carbon in organic substances free from the substances mentioned above.

Apparatus. This is practically the same as that shown in Fig. 19, with the exceptions that copper plugs may be used to advantage in place of the platinum plugs. In the absorption end of the train a calcium chloride tube is preferred. The calcium chloride should have been saturated with dry CO2 gas, the excess of which has been removed by a current of pure air. This tube




Fig. 19.—Diagrammatic Sketch of Combustion Tube.

is weighed as well as the potash bulb, the calcium chloride retaining the water formed by the combustion of the hydrogen of the organic substance, which is thus determined.

The organic substance, if a solid, is introduced into the combustion boat directly; if it is a liquid, it is held in a bulb blown in a capillary tube. One end of the tube is sealed and a bulb blown. When cool, the tube is weighed, and the material then introduced by first warming the bulb and then inserting the open end of the tube into the liquid to be examined. By cooling the bulb, liquid is drawn into the tube. The end is wiped off, and the liquid expelled from the capillary by gently heating this portion. The end is now sealed if the liquid is volatile, otherwise it is left open, and the tube is weighed. increased weight is due to the organic substance. The tip of the capillary is now broken, if sealing was necessary, by means of a file. The tube containing the sample is placed in the boat, the open end of the capillary pointing toward the open end of the combustion tube. After connecting up the apparatus, the copper oxide end of the tube is heated to redness and oxygen slowly passed through the tube at such a rate that the bubbles in the potash bulb can be readily counted. The entire tube is now heated and remaining operation is the same as has been described for iron and steel combustion.

The gain of weight of the calcium chloride tube is due to water formed by the combustion of hydrogen of the compound, that of the potash bulb to the carbon.

> $H_2O \times 0.1121 = H$ $CO_2 \times 0.2727 = C.$

Note. The oxygen gas should be free from hydrogen. A preheater, placed before the purifying tubes of the train, causes the combustion of the hydrogen and the absorption of the water formed before the gas enters the combustion tube.

Determination of Carbon and Hydrogen in Nitrogenous Substances

A modification of the first procedure described for determinations of carbon and hydrogen in organic substances must be made, since from substances containing nitrogen, nitroso and nitro compounds, oxides of nitrogen are formed which would be absorbed in the calcium chloride and potash bulbs, giving high results for hydrogen and carbon. To overcome this difficulty, a copper spiral, that has been reduced (See note below) is placed in the front end of the combustion tube (to the right in Fig. 19) to reduce the oxides of nitrogen to nitrogen.

Note. Reduction of copper spiral may be accomplished as follows: The copper spiral is prepared by rolling together a piece of copper gauze about 10 centimeters wide, making it as large as will conveniently pass into the combustion tube. The spiral is heated till it glows by holding it in a large gas flame, and while still hot it is dropped into a test-tube containing 1 or 2 cc. of methyl alcohol or ether. This quickly boils away, igniting at the end of the tube. The copper is completely reduced to bright metallic copper. The spiral is taken out with a pair of crucible tongs and dried by quickly passing it through a flame a few times, and while it is still warm it is introduced into the front of the combustion tube.

The substance is introduced into the tube and the connections made. The copper oxide spiral, that was pushed after the boat, is heated, and then the reduced spiral (right end of tube). The oxide near the boat, and finally the entire tube is heated to a red heat. When the bubbles cease to show in the potash bulb, the stopcock is opened to the oxygen-purifying train and a slow flow of oxygen turned on, the gas allowed to pass through the tube until it can be detected with a glowing splinter at the exit of the absorption end of the apparatus.

If the substance is difficult to burn, it is mixed with freshly ignited (cold) copper oxide, which assists combustion.

The remainder of the operation is the same as has been described.

Organic Substances Containing Halogens

The procedure is the same as that described for nitrogenous substances with the exception that a silver spiral is used in place of the reduced copper spiral. The heating of this spiral should be between 180 and 200° C. (not over 200°).

Organic Substances Containing Sulphur

These are best ignited with sodium peroxide and the carbonate formed is determined by the procedure given for carbon dioxide in carbonates.

The Wet Combustion Process for Determination of Carbon

The method depends upon the oxidation of carbon to carbon dioxide when the powdered material is digested with a mixture of concentrated sulphuric acid and chromic acid, or potassium dichromate, or permanganate. The pro-

cedure is applicable to oxidation of free carbon, carbon combined in organic substances and in certain instances to carbon combined with metals, where the substance may be decomposed by the action of the acids. It is of value in determination of carbonates in presence of sulphides, sulphites, thiosulphates and nitrites, which would vitiate results were they not oxidized to more stable forms, from passing into the potash bulb with the carbon dioxide.

Apparatus. The apparatus is identical with that used for determining carbon dioxide in carbonates, Fig. 20, with the exception that in place of the acid bulb nearest the decomposition flask two bulbs are placed. The first of these contains a strong solution of chromic and sulphuric acids, the second is filled with glass beads moistened with chromic acid solution. Following this is the drying bulb containing concentrated sulphuric acid and finally the absorption apparatus, as shown in the illustration.

Procedure. 0.2 to 1 gram of the powdered material, fine drillings, free carbon, or organic substance is placed in the decomposition flask. If the material is apt to pack it is advisable to mix with it pure ignited sca-sand to prevent this. Five to 10 grams of granular potassium dichromate are added and the apparatus swept free of carbon dioxide by passing purified air through it before attaching the absorption apparatus. The potash bulb is now weighed, using a counterbalance bulb and following the precautions given in the drycombustion method. The bulb is attached to the train.

Oxidation. Concentrated sulphuric acid placed in the acid funnel, attached to the decomposition flask, is allowed to flow down on the sample until the funnel is almost empty; the stop-cock is then closed. A flame is placed under the flask, when the vigorous action has ceased, and the material gently heated until the reaction is complete and the organic matter or carbon completely oxidized.

The apparatus is now swept free of residual CO₂ by applying suction, the gas being completely absorbed by the potash, or the soda lime reagent.

The increase of weight of the absorption bulb is due to carbon dioxide.

$$CO_2 \times 0.2727 = C$$
.

Nore. The following additional purifiers are frequently advisable: (a) an absorption bulb containing silver sulphate to absorb chlorine and vapors from sulphur compounds; (b) a capillary tube of silica or platinum heated to a dull redness to oxidize any hydrocarbons, carbon monoxide, etc., that may be evolved and imperfectly oxidized by the chromic acid.

DETERMINATION OF CARBON DIOXIDE IN CARBONATES

The method is applicable for determination of carbon dioxide in limestone, dolomite, magnesite, strontianite, witherite, spatic iron ore, carbonates of sodium, and potassium, bicarbonates in baking powder, carbon in materials readily oxidized to CO₂ chromic sulphuric acid mixture. The procedure depends upon the evolution of carbon dioxide by a less volatile acid, or the oxidation of carbon. The CO₂ is absorbed in caustic and weighed.

Apparatus. The illustration shows the apparatus found suitable for this determination. It is Knorr's apparatus slightly modified. The absorption bulb or bottle should be one that will effectively absorb carbon dioxide entering

¹ Not applicable for determining carbon in ferro-silicon, ferro-chrome or tungsten steel.

Note. The oxygen gas should be free from hydrogen. A preheater, placed before the purifying tubes of the train, causes the combustion of the hydrogen and the absorption of the water formed before the gas enters the combustion tube.

Determination of Carbon and Hydrogen in Nitrogenous Substances

A modification of the first procedure described for determinations of carbon and hydrogen in organic substances must be made, since from substances containing nitrogen, nitroso and nitro compounds, oxides of nitrogen are formed which would be absorbed in the calcium chloride and potash bulbs, giving high results for hydrogen and carbon. To overcome this difficulty, a copper spiral, that has been reduced (See note below) is placed in the front end of the combustion tube (to the right in Fig. 19) to reduce the oxides of nitrogen to nitrogen.

Note. Reduction of copper spiral may be accomplished as follows: The copper spiral is prepared by rolling together a piece of copper gauze about 10 centimeters wide, making it as large as will conveniently pass into the combustion tube. The spiral is heated till it glows by holding it in a large gas flame, and while still hot it is dropped into a test-tube containing 1 or 2 cc. of methyl alcohol or ether. This quickly boils away, igniting at the end of the tube. The copper is completely reduced to bright metallic copper. The spiral is taken out with a pair of crucible tongs and dried by quickly passing it through a flame a few times, and while it is still warm it is introduced into the front of the combustion tube.

The substance is introduced into the tube and the connections made. The copper oxide spiral, that was pushed after the boat, is heated, and then the reduced spiral (right end of tube). The oxide near the boat, and finally the entire tube is heated to a red heat. When the bubbles cease to show in the potash bulb, the stopcock is opened to the oxygen-purifying train and a slow flow of oxygen turned on, the gas allowed to pass through the tube until it can be detected with a glowing splinter at the exit of the absorption end of the apparatus.

If the substance is difficult to burn, it is mixed with freshly ignited (cold) copper oxide, which assists combustion.

The remainder of the operation is the same as has been described.

Organic Substances Containing Halogens

The procedure is the same as that described for nitrogenous substances with the exception that a silver spiral is used in place of the reduced copper spiral. The heating of this spiral should be between 180 and 200° C. (not over 200°).

Organic Substances Containing Sulphur

These are best ignited with sodium peroxide and the carbonate formed is determined by the procedure given for carbon dioxide in carbonates.

The Wet Combustion Process for Determination of Carbon

The method depends upon the oxidation of carbon to carbon dioxide when the powdered material is digested with a mixture of concentrated sulphuric acid and chromic acid, or potassium dichromate, or permanganate. The pro-

cedure is applicable to oxidation of free carbon, carbon combined in organic substances and in certain instances to carbon combined with metals, where the substance may be decomposed by the action of the acids. It is of value in determination of carbonates in presence of sulphides, sulphites, thiosulphates and nitrites, which would vitiate results were they not oxidized to more stable forms, from passing into the potash bulb with the carbon dioxide.

Apparatus. The apparatus is identical with that used for determining carbon dioxide in carbonates, Fig. 20, with the exception that in place of the acid bulb nearest the decomposition flask two bulbs are placed. The first of these contains a strong solution of chromic and sulphuric acids, the second is filled with glass beads moistened with chromic acid solution. Following this is the drying bulb containing concentrated sulphuric acid and finally the absorption apparatus, as shown in the illustration.

Procedure. 0.2 to 1 gram of the powdered material, fine drillings, free carbon, or organic substance is placed in the decomposition flask. If the material is apt to pack it is advisable to mix with it pure ignited sea-sand to prevent this. Five to 10 grams of granular potassium dichromate are added and the apparatus swept free of carbon dioxide by passing purified air through it before attaching the absorption apparatus. The potash bulb is now weighed, using a counterbalance bulb and following the precautions given in the drycombustion method. The bulb is attached to the train.

Oxidation. Concentrated sulphuric acid placed in the acid funnel, attached to the decomposition flask, is allowed to flow down on the sample until the funnel is almost empty; the stop-cock is then closed. A flame is placed under the flask, when the vigorous action has ceased, and the material gently heated until the reaction is complete and the organic matter or carbon completely oxidized.

The apparatus is now swept free of residual CO₂ by applying suction, the gas being completely absorbed by the potash, or the soda lime reagent.

The increase of weight of the absorption bulb is due to carbon dioxide.

$$CO_2 \times 0.2727 = C.$$

Norm. The following additional purifiers are frequently advisable: (a) an absorption bulb containing silver sulphate to absorb chlorine and vapors from sulphur compounds; (b) a capillary tube of silica or platinum heated to a dull redness to oxidize any hydrocarbons, carbon monoxide, etc., that may be evolved and imperfectly oxidized by the chromic acid.

DETERMINATION OF CARBON DIOXIDE IN CARBONATES

The method is applicable for determination of carbon dioxide in limestone, dolomite, magnesite, strontianite, witherite, spatic iron ore, carbonates of sodium, and potassium, bicarbonates in baking powder, carbon in materials readily oxidized to CO₂ chromic sulphuric acid mixture. The procedure depends upon the evolution of carbon dioxide by a less volatile acid, or the oxidation of carbon. The CO₂ is absorbed in caustic and weighed.

Apparatus. The illustration shows the apparatus found suitable for this determination. It is Knorr's apparatus slightly modified. The absorption bulb or bottle should be one that will effectively absorb carbon dioxide entering

¹ Not applicable for determining carbon in ferro-silicon, ferro-chrome or tungsten

Weigh 2 grams of baking powder into a flask suitable for the subsequent determination of carbonic acid, add 20 cc. of cold water, and allow to stand twenty minutes. Place the flask in a metal drying cell surrounded by boiling water and heat, with occasional shaking, for twenty minutes.

To complete the reaction and drive off the last traces of gas from the semisolid mass, heat quickly to boiling and boil for one minute. Aspirate until the air in the flask is thoroughly changed, and determine the residual carbon dioxide by absorption, as described under total carbonic acid.


The process described, based on the methods of McGill and Catlin, imitate, as far as practicable, the conditions encountered in baking, but in such a manner that concordant results may be readily obtained on the same sample, and comparable results on different samples.

Available Carbon Dioxide

The residual is subtracted from the total, and the difference taken as available CO₂.

Determination of Carbon Dioxide by Loss of Weight

An approximate estimation of the carbon dioxide in carbonates—baking powders, bicarbonate of soda, limestone, etc., may be obtained by the loss of weight of the material when treated with a known weight of acid.








Fig. 22.—Mohr's Alkalimeter.

Various forms of apparatus are used for this determination. The Schroetter and Mohr types are shown, Figs. 21 and 22.

About 0.5 to 1.0 gram of sample is taken and placed in the bottom of the flask, dilute hydrochloric and strong sulphuric acids then placed in the bulbs as indicated in the illustrations. The apparatus is weighed as it is thus charged. The hydrochloric acid is now allowed to flow down on the carbonate and the stopper closed. The evolved gas passes through the strong sulphuric acid, which absorbs the moisture. After the vigorous action has subsided the apparameters are the strong sulphuric acid,

ratus is placed over a low flame and the solution heated to boiling and boiled very gently for about three minutes. CO_2 -free air is aspirated through the solution to expel the last traces of CO_2 , by applying gentle suction at a and opening b, the air being purified by passing through soda lime. The apparatus is again weighed and the loss of weight taken as the CO_2 of the material.

Available CO₂ in baking powder may be determined by substituting water in place of hydrochloric acid.

Determination of CO₂ in Carbonates— Hydrometer Method of Barker¹

No mechanical balance or scale is required by the following procedure.

The method depends upon the principle of the hydrometer, following the law that when an object is immersed in a liquid it is buoyed up by a force equal to the weight of the liquid displaced by the object. The carbon dioxide set free from the sample decreases the weight; and the rise of the graduation scale tube above the water records the percentage of carbonates from which the gas was released. The procedure is suitable for determining the comparative strengths of baking powders, for rapid tests of the quality of limestone and for estimation of carbon dioxide of carbonates in general.

Procedure. To analyze a sample for carbonates measure out 40 cc. of hydrochloric acid (sp.gr. 1.15), using a small graduate; pour this into the acid reservoir through the opening A. graduated stem disconnected hang a 10 gram weight at B. The hydrometer should then float in a cylinder of water and be immersed to some point at C. Remove the 10 gram weight and introduce pulverized limestone, or other substance that is being tested, until the instrument is immersed to exactly the same point that it occupied with the suspended weight. The reservoir will now contain 10 grams of sample. Connect up the graduated stem and add water, a drop at a time. through the funnel-shaped top, until immersed to the zero point. Raise the hydrometer out of the water and open the stopcock D until the acid drops slowly into the reaction chamber, decomposing the carbonate. As the reaction proceeds the instrument rises slowly and at the conclusion the point on stem at the surface of the water gives the per

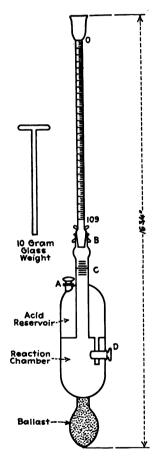


Fig. 22a.—Barker's Hydrometer.

¹ J. F. Barker, Jour. Ind. Eng. Chem., IX, 8, 786-787 (1917).

cent of calcium carbonate equivalent to the carbon dioxide in the sample. This figure is the calcium carbonate equivalent so often mentioned in connection with limestone analyses.

A Fahrenheit thermometer accompanies each instrument and is hung inside the floating cylinder. Its reading is taken before and after each determination to allow for any error due to change in temperature. To the figure for calcium carbonate equivalent add 0.5 for each degree rise, or subtract 0.5 for each degree fall in temperature between the two readings. This temperature change need seldom amount to more than a fraction of a degree.

The limestone may be weighed to an accuracy of 0.02 gram. The weight of CO2 remaining in the apparatus tends to offset the loss due to moisture escaping with the gas, but the difference, together with any other sources of error has been accounted for in the graduation of the reading stem.

Determination of Percarbonates

Percarbonates are decomposed by dilute sulphuric acid according to the reaction

K₂C₇O₆+2H₂SO₄=2KHSO₄+2CO₂+H₂O₃.

Procedure. Two tenths of a gram of the salt is added to about 300 cc. of cold dilute sulphuric acid (1:30). The liberated hydrogen peroxide is titrated with potassium permanganate.

1 cc. N/10 KMnO₄=0.00991 g. $K_2C_2O_6$.

VOLUMETRIC METHODS FOR THE DETERMINATION OF CARBON

Total Carbon. Absorption of Carbon Dioxide in Barium Hydroxide

The carbon dioxide evolved by oxidation of the material by dry combustion with oxygen or by oxidation with chromic sulphuric acid mixture is absorbed in barium hydroxide, free from carbonate, and the precipitated barium carbonate titrated with standard hydrochloric acid.

Procedure. The essential difference in this method from those already described under the gravimetric methods is in the fact that a perfectly clear saturated solution of barium hydroxide is used for absorption of the carbon dioxide in place of caustic potash. Considerable care must be exercised to prevent contaminating the reagent with carbonate. The solution is drawn by suction through a siphon, dipping below the surface of the reagent, into the absorption tube, which should be of such construction that the material may readily be poured out. After absorption of the CO₂ gas, the apparatus is disconnected and the excess barium hydroxide neutralized with dilute hydrochloric acid (1:4) using phenolphthalein indicator. A few drops of methyl orange are now added and a measured excess of standard hydrochloric acid run in from a burette. After heating to boiling the excess acid is titrated with standard caustic solution, 1 cc. of which is equivalent to 1 cc. of the hydrochloric acid.

 $HCl \times 0.1646 = C.$

1 cc, N/10 HCl≈0.0022 gram CO₂.

NOTE. The method is used in the Omaha laboratory of the Union Pacific Railroad. Dr. N. F. Harriman, Chief Chemist, informed the writer (W. W. Scott), that with care no difficulty is experienced with contamination of the barium hydroxide and excellent results are obtained. The Victor-Meyer bulb is used for holding the barium hydroxide.

Determination of Carbon by Measurement of the Volume of Carbon Dioxide Evolved by Oxidation of Carbon, or by the Decomposition of Carbonates with Acid.

Description of the Scheibler and Dietrich Process and that of Lunge and Marchlewski are given in Mellor's work on "Inorganic Analysis," pp. 555-559, 1st Ed. A modification of Wiborg's method is described in Blair, "Chemical Analysis of Iron," pp. 146-149, 7th Ed.

Determination of Carbon Dioxide in a Gas Mixture.

See Gas Analysis.

Direct Colorimetric Method for Determination of Combined Carbon

The procedure is of value to the steel laboratory where a large number of daily determinations of combined carbon are required. By this method over a hundred determinations a day may be made by an experienced manipulator. The method depends upon the color produced by combined carbon dissolved in nitric acid, the depth of color increasing with the combined carbon content of the material. Comparison is made with a standard sample of iron or steel, which is of the same kind and in the same physical condition as the material tested. That is to say, a Bessemer steel should be compared with a Bessemer standard, open hearth with open hearth, crucible steel with crucible steel, the standards containing approximately the same amounts of carbon, and as nearly as possible the same chemical composition. The samples should be taken from the original bar which has not been reheated, hammered, or rolled. Copper,





Fig. 23. Fig. 24. Hot Water Racks for Test Tubes. Color Carbon Determination.

cobalt, and chromium will interfere with the test; the other elements have very little effect.

Procedure. One standard sample of 0.2 gram and the same amount of sample drillings are taken for analysis. The weighings are conveniently made in brass or aluminum pans, boat-shaped to enable the drillings to be dumped into test-tubes. A counterpoise, weighing the same as the boat, is placed on the opposite pan, together with the 0.2 gram weight. A magnetized knife will assist in removing the excess of material. The weighed sample is brushed into a test-tube 6 ins. long (150 mm.) § in. (16 mm.) in diameter. (Each test-tube has a label near the open end to distinguish the sample.) A rack or a 600-cc. beaker may be employed for holding the test-tubes during the weighing. After the batch is ready the tubes are transferred to a perforated rack (Figs. 23 or 24) and this then stood in the water bath filled with cold water.

The proper amount of nitric acid (sp.gr. 1.2; e.g., 1 conc. HNO₃: 1 H₂O), from a burette, is now added to each test-tube.

3 cc. HNO, for 0.3% C.
4 cc. HNO, for 0.3 to 0.5%.
7 cc. HNO, for over 1% C. steel.

5 cc. HNO₂ for 0.5 to 0.8% C.

¹ Blair, "The Chemical Analysis of Iron."

The depth of color produced by the acid will give an idea of the amount required. One cc. of acid is added at a time until the depth of color is correct. This requires experience gained from observation of the color produced by standard samples. The acid is added slowly to the coarse drillings. Insufficient acid gives a darker tinted solution than it properly should be. The nitric acid should be free from chlorine and hydrochloric acid, since these produce a yellow color. (Cl and FeCl, are yellow.)

A glass bulb or a small funnel is placed in each test-tube and the water in the bath then heated to boiling and boiled until all the carbonaceous matter has dissolved, the tubes being shaken from time to time to prevent formation of a film of oxide. Low-carbon steels require about twenty minutes, whereas steels of over 1% carbon require about forty-five minutes. (Blair.) As soon as the bubbles cease and the brownish flocculent matter disappears, the rack is removed from the bath and placed in a casserole of cold water. (Prolonged heating and strong light each causes fading of the color due to combined carbon.)

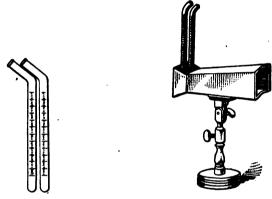


Fig. 25.—Carbon Tubes.

Fig. 26.—Color Comparator or Camera.

Color Comparison. This is made in graduated, clear, colorless, glass cylinders called carbon tubes. The form shown in Fig. 25 was found by the writer to be the most satisfactory type for a steel-works laboratory where rapidity of manipulation was essential. The bend at the upper portion of the tube facilitates mixing of the solution upon dilution with water, the tube being tilted back and forth until the solution is homogeneous, the bend preventing the liquid from spilling. The dilution should be at least twice that of the amount of nitric acid used, as this amount of water is necessary to destroy the color due to ferric nitrate.

The standard is poured into the carbon tube and the rinsings from the test-tube added. The solution is diluted to a convenient multiple in cc. of the carbon content. For example, 0.45% carbon sample may be diluted to 9 cc., then each cc. will represent 0.05% carbon. The sample is placed in a second tube of exactly the same diameter, wall thickness, and form. If the solution of the sample is darker than the standard, water is added little by little,

followed by mixing, until the shade matches the standard. If the standard, on the other hand, is darker than the sample, a greater dilution of the standard is necessary, the cc. again representing a multiple of the carbon content. For example dilution of the .45% carbon sample to 15 cc. makes each cc. to represent 0.03 carbon. (It is frequently advisable to take a standard of lower carbon content in place of greater dilution of the standard.)

Example. Suppose in the first case the dilution of the sample was 15 cc. in order to match the standard, then $15\times0.05=0.75\%$ carbon. Six cc. dilution case $2=6\times0.03=0.18\%$ carbon.

The color comparison can be best made in a "camera," a long box with one end closed by a ground-glass screen, Fig. 26. Parallel to the screen and near it, two holes through the top of the box admit the test-tubes. The inner walls of the camera are blackened to prevent reflection of light. If a camera is not available, the tubes may be held side by side and compared against a sheet of white paper held as a background.

CARBON DETERMINATION IN STEEL

Beneker's Modification of Eggertz's Method for Determining Carbon in Steel

By this procedure interference of the color due to iron is eliminated.

.2 g. of the sample and standard (which does not need to be very similar in carbon content to the sample) are weighed into two test tubes, treated with .7 cc. -10 cc. of nitric acid of the usual dilution, say 3 parts water to 2 parts acid, and warmed until dissolved and perfectly clear. When cold, $\frac{1}{2}$ cc. of 85% phosphoric acid is added to each tube, transferred to the comparison tubes and read. When this method is used on low carbon steel the bleaching action is very pronounced, because in that case the iron color bleached out represents the major part of the original color. Dilution of standard or sample introduces no error, because of the absence of the interfering iron color.

ANALYSIS OF GRAPHITE

Determination of Carbon

The procedure for determining carbon in graphite is the same as that described for determination of carbon in difficultly combustible organic substances.

The material is broken down in a steel mortar and powdered in an agate mortar. About 0.2 gram is taken for the determination and mixed with copper oxide to assist the combustion, then placed in the boat and the combustion of the carbon carried on according to the standard method in the combustion tube.

 $CO_2 \times 0.2727 = C$.

CYANOGEN

DETECTION

Traces of Hydrocyanic Acid. To the solution to be tested are added two drops of 10% NaOH and the mixture is evaporated to near dryness. After cooling, a drop of 2% ferrous sulphate is added and the sample allowed to stand in the cold for about fifteen minutes. Now 2-3 drops of strong HCl are added and the solution warmed gently, then cooled. The solution is a blue green if HCN was present in the original sample. 0.000002 g. HCN may be detected.

NOTE. Test for Cyanide. This depends upon the solvent action of HCN upon freshly precipitated HgO in presence of KOH. The filtrate is tested for mercury in an acid solution by addition of H₂S. (Hood.)

VOLUMETRIC DETERMINATION OF HYDROCYANIC ACID¹

The method depends upon the decolorization of the blue ammoniacal solutions of cupric salts by a soluble cyanide, the reduction to cuprous condition being available for an accurate quantitative estimation of the cyanide.

Standard Copper Sulphate. Twenty-five grams of copper sulphate, CuSO₄·5H₂O are dissolved in a 1000-cc. flask with 500 cc. of distilled water and ammonium hydroxide added until the precipitate that first forms dissolves and a deep blue solution is obtained. Water is now added to make the volume exactly 1000 cc. The cupric solution is standardized by running a portion into a solution containing 0.5 gram pure potassium cyanide, KCN, per 100 cc. of water and 5 cc. of ammonium hydroxide until a faint blue color is evident. Chlorides do not interfere.

Procedure. 6.5 gram of the soluble cyanide is dissolved in 100 cc. of water and 5 cc. strong ammonium hydroxide added. The standard cupric sulphate solution is now added until the blue color is obtained. The cc. required multiplied by the factor of the copper salt in terms of the salt sought gives the weight of that salt in the sample.

Liebig's Method for Determination of Hydrocyanic Acid. Soluble Cyanides ²

Silver nitrate reacts with an alkali cyanide in neutral or alkaline solution as follows: AgNO₃+2KCN = Ag(CN)₂K+KNO₃. The potassium silver cyanide is soluble, hence the precipitate that first forms immediately dissolves on stirring as long as the cyanide is present in excess or in sufficient quantity to react according to the equation. A drop of the silver salt in excess will produce a permanent turbidity, owing to the following reaction:

Ag(CN)₂K+AgNO₃ = 2AgCN+KNO₃, the insoluble AgCN being formed.

¹J. McDowell, C. N., 1904, p. 221. ²Ann. d. Chem. und Pharm., 77, p. 102. Procedure. The alkali cyanide contained in a beaker placed over a sheet of black glazed paper, is treated with 4 to 5 cc. of 10% KOH solution and diluted to 100 cc. The liquid is now titrated with standard silver nitrate, with constant stirring, until a faint permanent turbidity is obtained.

One cc. $N/10 \text{ AgNO}_1 = 0.013022 \text{ gram KCN}$.

Determination of Cyanide by Volhard's Method

The method involves Volhard's method for determining halogens, the procedure depending upon the fact that the silver salts of cyanides are insoluble in dilute cold nitric acid solutions.

The neutral cyanide solution is treated with an excess of silver nitrate reagent, and slightly acidified with nitric acid and diluted to a definite volume in a measuring flask. A portion of the solution is now filtered through a dry filter, and a convenient aliquot portion of this is titrated with standard thiocyanate solution, using ferric alum as indicator (see page 149) to determine the silver nitrate present. From this titrate the excess silver nitrate reagent added and that combined with the cyanide ascertained.

1 cc. $N/10 \text{ AgNO}_3 = 0.006511 \text{ g. KCN or } 0.005203 \text{ g. CN.}$

Determination of Cyanide and Thiocyanate in Presence of One Another

The cyanide is determined preferably by Liebig's method, page 131 and the cc. of AgNO₃ required recorded. To the alkaline or neutral solution is added an excess of standard AgNO₃ and the solution acidified with HNO₃, then made to definite volume and a portion filtered. The silver nitrate in a convenient amount of the filtrate, an aliquot portion of the whole, is determined by titrating with standard thiocyanate solution, using ferric alum indicator (page 149). From this titration the excess of AgNO₃ added is determined, and the amount of reagent required for the thiocyanate is known.

1 cc. $N/10 \text{ AgNO}_3 = 0.006511 \text{ g. KCN}$ or 0.005203 g. CN or 0.005808 g. CNS.

In place of the above method the following may be used: One portion of the solution is treated with nitric acid and the thiocyanic acid oxidized to sulphate. By adding Ba(NO₃)₂ solution BaSO₄ is precipitated and the equivalent thiocyanic acid calculated, also the equivalent N/10 AgNO₂ that would be required to precipitate this. In another portion an excess of N/10 AgNO₂ is added and the thiocyanate and cyanide precipitated. The excess of the silver nitrate may now be determined by Volhard's method described above and the amount required by CN and CNS thus ascertained. The amount of reagent required for CNS is subtracted from this total and that required by CN thus obtained. The factors are given above.

For determination of cyanide in presence of the halogens see the chapter on chlorine, page 154.

Determination of Thiocyanic Acid (Sulphocyanic) and Halogen Hydrides in Presence of One Another

Thiocyanic acid is determined in one portion by oxidation with nitric acid and precipitation of the sulphuric acid formed by adding barium nitrate = BaSO₄. A second portion is heated in a closed tube according to the method of Carius, see page 145. The halogen silver salts are filtered off and weighed.

Chlorine is now passed over the heated mixture of halogens and the whole converted to silver chloride. The salt is weighed after removing excess of Cl with a current of air.

A third portion is fused with sodium carbonate and potassium nitrate and the iodine determined as palladous iodide (see page 239).

From the data thus obtained the cyanide and halogens may be estimated.

For his review and criticism of this chapter the author wishes to mention Mr. J. M. Cratty, Chief Chemist, U. S. Navy Yards, Philadelphia, Pa.

CERIUM AND THE OTHER RARE EARTHS

R. STUART OWENS 1

Group.*	Symbol.	At. Wt.†	8p. Gr.	М. Р.	Oxides.
Yttrium	. Yt	88.7	3.800	1250	Yt ₂ O ₂
Erbium		167.7	4.770		Er ₂ O ₂ , Er ₂ C ₄
Holmium	. Ho	163.5	i		
Thulium	. Tm	168.5			Tm ₂ O ₂
Dysprosium	. Dy	162.5			
Ytterbium	. Yb	173.5	• • • • • • • • • • • • • • • • • • • •	1800	Yb ₂ O ₃
Lutecium	. Lu	175.0			
Europium	. Eu	152.0			
Victorium	•	Discovery	not confirm.	ed.	
Terbium	. Tb	159.2			Tb ₂ O ₂
Gadolinium	. Gd	157.3	1.310		Gd ₂ O ₃
Cerium	. Ce	140.25	6.625	950	Ce ₂ O ₃ , Ce ₂ O ₅
Lanthanum	. La	139.0	6.163		La ₂ O ₂
Neodymium	. Nd	144.3	6.544	840	Nd ₂ O ₂
Praseodymium	. Pr	140.9	6.544	940	Pr ₂ O ₂
Samarium		150.4	7.700	1350	Sm ₂ O ₃
Scandium	. Sc	44.1		1300	Sc ₂ O ₃
Decipium		Discovery	not confirm	ed.	

^{*} According to Böhm (Browning, "Introduction to the Rarer Elements.") † International atomic weights, 1916.

DETECTION

The samples having been brought into solution by one of the methods detailed under preparation and solution of the sample, the elements may be detected by one of the following tests:

Spectroscopic. Many of the rare earth's elements have either characteristic spark spectrums or absorption spectrums and their presence may be detected by this means.

trum.
"
"
"
"
6
• •

Cerium shows lines of greatest intensity in the arc spectrum at 4337.9, 4527.5, 4386.9, 4594.1. In the spark spectrum at 4460.3, 4562.5, 4572.4, 4594.1, 4628.3. All of these lines are in the visible spectrum.

¹ Research Chemist, New York City.

In the wet way cerium may be detected when in the form of cerium nitrate by boiling with lead peroxide and nitric acid. A deep yellow color is imparted to the solution, due to the formation of ceric nitrate.

Cerium may be detected by the addition of sodium hypochlorite to the solution of a colorless cerous salt. Red ceric hydroxide is precipitated. The test may be confirmed by the chlorine gas evolved when the precipitate is dissolved in hydrochloric acid.

Cerous salts are precipitated by fixed alkalies and are insoluble in excess. Tartaric acid hinders the precipitation. Ammonium sulphide also precipitates the hydroxide. Oxalic acid precipitates cerous oxalate, white, from moderately acid solutions. It is soluble in hot ammonium oxalate but precipitated by dilution with cold water.

Lanthanum may be detected by adding iodine to the washed precipitate, formed by the addition of ammonium hydroxide to a solution of its salts. A characteristic blue coloration results.

Praseodymium, neodymium, may be detected by the reddish color of their solutions also by the rose red or violet color imparted to a bead of microcosmic salt when heated in the flame of a blow pipe.

Scandium. The hydrochloric acid solution of a scandium salt, when boiled for thirty minutes with solid Na₂SiFl₆ gives a precipitate which is free from all the other rare earths, the scandium taking the place of the sodium in the compound.

Ytterbium may be detected by adding to a neutral solution H₂SeO₁·4H₂O. A white precipitate of Yb₂(SeO₂)₂, which is insoluble, results.

Erbium. In the flame test this earth gives an intense green light.

ESTIMATION

The estimation of the rare earths is not required, other than Cerium, at the present time except in a few special instances as the various elements have found but limited commercial applications. They have all been separated from their native combinations, but only a few have been isolated and many are still believed to be combinations of elements.

Cerium enters into the manufacture of Welsbach mantles; in the form of Ce₂(SO₄)₂ it is used in the manufacture of aniline black; as oxalate, it is used in medicine, and as metal in alloys.

Yttrium is employed in the fabrication of Nernst lamp filaments and gas mantles.

The most important ores which contain the rare earth elements are:

Monazite, (Ce, La, Di, Th), PO,	raw mat	erial f	or Ce,	La.
Gadolinite, Be ₂ FeY ₂ Si ₂ O ₁₀ ,	"	4.6		arths.
Xenotime, YtPO	"	"	$\mathbf{Y}\mathbf{t}$	"
Euxenite, $R'''(NbO_3)_3 \cdot R_2'''(TiO_3)_3 \cdot 3/2H_2O$,	"	"	\mathbf{Yt}	""
Cerite, (Ca, Fe)(CeO)(Ce ₂ ·3OH)(SiO ₃) ₃ ,	"	"	Ce	"
Samarskite, R ₁ "R ₂ "(Nb, Ta) ₆ O ₂₁ ,	"	"	$\mathbf{Y}\mathbf{t}$	"
Yttrotantalite, R"R ₂ ""(Nb, Ta) O15 · 4H ₂ O,	"	"	$\mathbf{Y}\mathbf{t}$	"
Sipylite, complex,	"	"	$\mathbf{Y}\mathbf{t}$	"
Keilhauite, complex silicate.	"	"	Yt	"

In the formulas given above R" stands for any dibasic radical or element while R" stands for any tribasic radical or element.

Preparation and Solution of the Sample

- 1. Fusion Method. The finely pulverized sample is fused with sodium carbonate and the melt after cooling is extracted with cold water. A sufficient quantity of hydrochloric acid to impart an acid reaction is added. The solution obtained is evaporated to dryness and baked to dehydrate the silica, then treated with a little hydrochloric acid and after dilution with water, filtered. Ammonia water is added to the solution in slight excess and the solution allowed to stand until the precipitate has settled. It is then filtered off, washed with cold water and dissolved in hydrochloric acid. All of the rare earths are then present in the solution as chlorides.
- 2. Acid Extraction. Decomposition of the finely pulverized sample may be effected by mixing it with a sufficient quantity of sulphuric acid to make a paste and then heating the mass, slowly at first and then gradually increasing the heat to dull redness when fumes of SO₂ appear. After cooling, the mass is extracted with cold water and the metals of the H₂S group removed in the usual way. The rare earths are then present in the solution as sulphates and may be separated by one of the methods detailed below.
- 3. Acid Extraction. A strong mixture of nitric acid and hydrochloric acid may be used to effect the decomposition of some of the minerals. The solution after being evaporated to dryness and baked leaves a residue which contains the mixed rare earths. The rare earths are dissolved in dilute hydrochloric acid. Any silica present is filtered off and the rare earths present in the clear solution may be separated by one of the methods detailed below.
- 4. Decomposition by Means of Hydrofluoric Acid.¹ Samarskite and euxenite in the finely powdered state are moistened with their own weight of water and twice as much fuming hydrofluoric acid. The attack takes place in a few seconds. When the violent action is over the solution is evaporated to dryness on the steam bath, taken up with water (30 to 40 cc. for a 5-gram sample) and the contents of the dish filtered and washed. The mineral is then divided into two portions, the filtrate containing all the metallic acids, iron and manganese, the insoluble portion containing all the rare earths and uranic acid.

The difficulty of attack increases in proportion to the amount of tantalic acid present in the sample. The rare earths are then extracted from the incoluble portion by one of the methods previously mentioned. Fusion with sodium carbonate is preferred.

SEPARATIONS

Separation of the rare earths from iron, aluminum and thorium ² may be effected by adding sodium fluoride to the hydrochloric acid solution of the Iron Group which has been precipitated as hydroxide. The precipitate, which consists of the double fluorides of the rare earths and thorium, is washed thoroughly and evaporated with sulphuric acid on the sand bath to decompose the fluorides. This process removes the alkaline earths as insoluble sulphates. The excess acid is removed by fuming and the solution of the sulphates after diluting and warming is treated with sodium thiosulphate in solution. Thorium thiosulphate is precipitated. In solution are the sulphates of all the rare earths. Scandium

¹ Prescott and Johnson.

² Browning's "Introduction to the Rarer Elements."

is also precipitated as thiosulphate if the solution in sulphuric is fumed too long and a neutral solution results.

Calcium and manganese, which may also come down with an oxalate precipitate of the rare earths, may be separated from the earths of the yttrium group by precipitation of the solution with oxalic acid, filtering off the precipitate, dissolving it in nitric acid and evaporating to dryness to decompose the manganese salts. Extracting with water leaves the manganese in the residue. Treat the filtrate with ammonia water. The yttrium group precipitates as hydroxides and may be filtered from the calcium, which remains in solution.

Cerium, lanthanum, praseodymium, neodymium, europium and gadolinium may be separated from the other rare earths by adding a saturated solution of potassium sulphate to the sulphate or chloride solution of all of the rare earths. The above-mentioned elements form insoluble double selts.

Scandium may be separated from yttrium by boiling a solution of the nitrates. A basic scandium nitrate is first precipitated.

Yttrium Group. Barium carbonate forms no precipitate in the cold, hence the elements comprising same may be separated from aluminum, iron, chromium, thorium, cerium, lanthanum, praseodymium, and neodymium by this means.

Yttrium Group. The precipitation of the group as hydroxides is not affected by the presence of tartaric acid. Hence the members may be thus separated from aluminum, glucinum, thorium, zirconium, and iron.

Praseodymium, neodymium, lanthanum, and samarium may be separated from each other by the fractional precipitation of a dilute solution of the nitrates with a very dilute solution of ammonia water (1 gram of NH₂ in 500 cc.). The first precipitates are rich in samarium; the didymiums come down next and the lanthanum in the last portions. By a continual repetition nearly pure salts may be obtained.

Besides the separations mentioned above the group members may be freed from each other by various other methods, as for example:

- (1) Fractional crystallization of the picrates.
- (2) Fractional crystallization of the double magnesium nitrates.
- (3) Fractional precipitation of the oxalates in a nitric acid solution, etc.

GRAVIMETRIC ESTIMATIONS

Owing to the fact that the quantitative separation of the rare earths is only accomplished by the expenditure of a vast amount of time and labor and that the various elements with the exception of but few have found no commercial application, exact methods have not been worked out for the various quantitative assays.

Cerium, however, which is the most important, may be determined as follows:

The element having been brought into solution by one of the methods detailed above and separated from the base metals, silica and thorium may be isolated from the other rare earths by precipitation in a slightly acid solution with oxalic acid. The precipitate is allowed to settle twenty-four hours, filtered, washed with water and ignited. The oxides are then dissolved in hydrochloric acid and precipitated as hydroxide by the addition of an excess of caustic potash. The

Preparation and Solution of the Sample

- 1. Fusion Method. The finely pulverized sample is fused with sodium carbonate and the melt after cooling is extracted with cold water. A sufficient quantity of hydrochloric acid to impart an acid reaction is added. The solution obtained is evaporated to dryness and baked to dehydrate the silica, then treated with a little hydrochloric acid and after dilution with water, filtered. Ammonia water is added to the solution in slight excess and the solution allowed to stand until the precipitate has settled. It is then filtered off, washed with cold water and dissolved in hydrochloric acid. All of the rare earths are then present in the solution as chlorides.
- 2. Acid Extraction. Decomposition of the finely pulverized sample may be effected by mixing it with a sufficient quantity of sulphuric acid to make a paste and then heating the mass, slowly at first and then gradually increasing the heat to dull redness when fumes of SO₁ appear. After cooling, the mass is extracted with cold water and the metals of the H₂S group removed in the usual way. The rare earths are then present in the solution as sulphates and may be separated by one of the methods detailed below.
- 3. Acid Extraction. A strong mixture of nitric acid and hydrochloric acid may be used to effect the decomposition of some of the minerals. The solution after being evaporated to dryness and baked leaves a residue which contains the mixed rare earths. The rare earths are dissolved in dilute hydrochloric acid. Any silica present is filtered off and the rare earths present in the clear solution may be separated by one of the methods detailed below.
- 4. Decomposition by Means of Hydrofluoric Acid.¹ Samarskite and euxenite in the finely powdered state are moistened with their own weight of water and twice as much fuming hydrofluoric acid. The attack takes place in a few seconds. When the violent action is over the solution is evaporated to dryness on the steam bath, taken up with water (30 to 40 cc. for a 5-gram sample) and the contents of the dish filtered and washed. The mineral is then divided into two portions, the filtrate containing all the metallic acids, iron and manganese, the insoluble portion containing all the rare earths and uranic acid.

The difficulty of attack increases in proportion to the amount of tantalic acid present in the sample. The rare earths are then extracted from the incoluble portion by one of the methods previously mentioned. Fusion with sodium carbonate is preferred.

SEPARATIONS

Separation of the rare earths from iron, aluminum and thorium ² may be effected by adding sodium fluoride to the hydrochloric acid solution of the Iron Group which has been precipitated as hydroxide. The precipitate, which consists of the double fluorides of the rare earths and thorium, is washed thoroughly and evaporated with sulphuric acid on the sand bath to decompose the fluorides. This process removes the alkaline earths as insoluble sulphates. The excess acid is removed by fuming and the solution of the sulphates after diluting and warming is treated with sodium thiosulphate in solution. Thorium thiosulphate is precipitated. In solution are the sulphates of all the rare earths. Scandium

¹ Prescott and Johnson.

² Browning's "Introduction to the Rarer Elements."

is also precipitated as thiosulphate if the solution in sulphuric is fumed too long and a neutral solution results.

Calcium and manganese, which may also come down with an oxalate precipitate of the rare earths, may be separated from the earths of the yttrium group by precipitation of the solution with oxalic acid, filtering off the precipitate, dissolving it in nitric acid and evaporating to dryness to decompose the manganese salts. Extracting with water leaves the manganese in the residue. Treat the filtrate with ammonia water. The yttrium group precipitates as hydroxides and may be filtered from the calcium, which remains in solution.

Cerium, lanthanum, praseodymium, neodymium, europium and gadolinium may be separated from the other rare earths by adding a saturated solution of potassium sulphate to the sulphate or chloride solution of all of the rare earths. The above-mentioned elements form insoluble double salts.

Scandium may be separated from yttrium by boiling a solution of the nitrates.

A basic scandium nitrate is first precipitated.

Yttrium Group. Barium carbonate forms no precipitate in the cold, hence the elements comprising same may be separated from aluminum, iron, chromium, thorium, cerium, lanthanum, praseodymium, and neodymium by this means.

Yttrium Group. The precipitation of the group as hydroxides is not affected by the presence of tartaric acid. Hence the members may be thus separated from aluminum, glucinum, thorium, zirconium, and iron.

Praseodymium, neodymium, lanthanum, and samarium may be separated from each other by the fractional precipitation of a dilute solution of the nitrates with a very dilute solution of ammonia water (1 gram of NH; in 500 cc.). The first precipitates are rich in samarium; the didymiums come down next and the lanthanum in the last portions. By a continual repetition nearly pure salts may be obtained.

Besides the separations mentioned above the group members may be freed from each other by various other methods, as for example:

- (1) Fractional crystallization of the picrates.
- (2) Fractional crystallization of the double magnesium nitrates.
- (3) Fractional precipitation of the oxalates in a nitric acid solution, etc.

GRAVIMETRIC ESTIMATIONS

Owing to the fact that the quantitative separation of the rare earths is only accomplished by the expenditure of a vast amount of time and labor and that the various elements with the exception of but few have found no commercial application, exact methods have not been worked out for the various quantitative assays.

Cerium, however, which is the most important, may be determined as follows:

The element having been brought into solution by one of the methods detailed above and separated from the base metals, silica and thorium may be isolated from the other rare earths by precipitation in a slightly acid solution with oxalic acid. The precipitate is allowed to settle twenty-four hours, filtered, washed with water and ignited. The oxides are then dissolved in hydrochloric acid and precipitated as hydroxide by the addition of an excess of caustic potash. The

Preparation and Solution of the Sample

- 1. Fusion Method. The finely pulverized sample is fused with sodium carbonate and the melt after cooling is extracted with cold water. A sufficient quantity of hydrochloric acid to impart an acid reaction is added. The solution obtained is evaporated to dryness and baked to dehydrate the silica, then treated with a little hydrochloric acid and after dilution with water, filtered. Ammonia water is added to the solution in slight excess and the solution allowed to stand until the precipitate has settled. It is then filtered off, washed with cold water and dissolved in hydrochloric acid. All of the rare earths are then present in the solution as chlorides.
- 2. Acid Extraction. Decomposition of the finely pulverized sample may be effected by mixing it with a sufficient quantity of sulphuric acid to make a paste and then heating the mass, slowly at first and then gradually increasing the heat to dull redness when fumes of SO₂ appear. After cooling, the mass is extracted with cold water and the metals of the H₂S group removed in the usual way. The rare earths are then present in the solution as sulphates and may be separated by one of the methods detailed below.
- 3. Acid Extraction. A strong mixture of nitric acid and hydrochloric acid may be used to effect the decomposition of some of the minerals. The solution after being evaporated to dryness and baked leaves a residue which contains the mixed rare earths. The rare earths are dissolved in dilute hydrochloric acid. Any silica present is filtered off and the rare earths present in the clear solution may be separated by one of the methods detailed below.
- 4. Decomposition by Means of Hydrofluoric Acid.¹ Samarskite and euxenite in the finely powdered state are moistened with their own weight of water and twice as much fuming hydrofluoric acid. The attack takes place in a few seconds. When the violent action is over the solution is evaporated to dryness on the steam bath, taken up with water (30 to 40 cc. for a 5-gram sample) and the contents of the dish filtered and washed. The mineral is then divided into two portions, the filtrate containing all the metallic acids, iron and manganese, the insoluble portion containing all the rare earths and uranic acid.

The difficulty of attack increases in proportion to the amount of tantalic acid present in the sample. The rare earths are then extracted from the incoluble portion by one of the methods previously mentioned. Fusion with sodium carbonate is preferred.

SEPARATIONS

Separation of the rare earths from iron, aluminum and thorium ² may be effected by adding sodium fluoride to the hydrochloric acid solution of the Iron Group which has been precipitated as hydroxide. The precipitate, which consists of the double fluorides of the rare earths and thorium, is washed thoroughly and evaporated with sulphuric acid on the sand bath to decompose the fluorides. This process removes the alkaline earths as insoluble sulphates. The excess acid is removed by fuming and the solution of the sulphates after diluting and warming is treated with sodium thiosulphate in solution. Thorium thiosulphate is precipitated. In solution are the sulphates of all the rare earths. Scandium

¹ Prescott and Johnson.

² Browning's "Introduction to the Rarer Elements."

is also precipitated as thiosulphate if the solution in sulphuric is fumed too long and a neutral solution results.

Calcium and manganese, which may also come down with an oxalate precipitate of the rare earths, may be separated from the earths of the yttrium group by precipitation of the solution with oxalic acid, filtering off the precipitate, dissolving it in nitric acid and evaporating to dryness to decompose the manganese salts. Extracting with water leaves the manganese in the residue. Treat the filtrate with ammonia water. The yttrium group precipitates as hydroxides and may be filtered from the calcium, which remains in solution.

Cerium, lanthanum, praseodymium, neodymium, europium and gadolinium may be separated from the other rare earths by adding a saturated solution of potassium sulphate to the sulphate or chloride solution of all of the rare earths. The above-mentioned elements form insoluble double salts.

Scandium may be separated from yttrium by boiling a solution of the nitrates. A basic scandium nitrate is first precipitated.

Yttrium Group. Barium carbonate forms no precipitate in the cold, hence the elements comprising same may be separated from aluminum, iron, chromium, thorium, cerium, lanthanum, praseodymium, and neodymium by this means.

Yttrium Group. The precipitation of the group as hydroxides is not affected by the presence of tartaric acid. Hence the members may be thus separated from aluminum, glucinum, thorium, zirconium, and iron.

Praseodymium, neodymium, lanthanum, and samarium may be separated from each other by the fractional precipitation of a dilute solution of the nitrates with a very dilute solution of ammonia water (1 gram of NH, in 500 cc.). The first precipitates are rich in samarium; the didymiums come down next and the lanthanum in the last portions. By a continual repetition nearly pure salts may be obtained.

Besides the separations mentioned above the group members may be freed from each other by various other methods, as for example:

- (1) Fractional crystallization of the picrates.
- (2) Fractional crystallization of the double magnesium nitrates.
- (3) Fractional precipitation of the oxalates in a nitric acid solution, etc.

GRAVIMETRIC ESTIMATIONS

Owing to the fact that the quantitative separation of the rare earths is only accomplished by the expenditure of a vast amount of time and labor and that the various elements with the exception of but few have found no commercial application, exact methods have not been worked out for the various quantitative assays.

Cerium, however, which is the most important, may be determined as follows:

The element having been brought into solution by one of the methods detailed above and separated from the base metals, silica and thorium may be isolated from the other rare earths by precipitation in a slightly acid solution with oxalic acid. The precipitate is allowed to settle twenty-four hours, filtered, washed with water and ignited. The oxides are then dissolved in hydrochloric acid and precipitated as hydroxide by the addition of an excess of caustic potash. The

Preparation and Solution of the Sample

- 1. Fusion Method. The finely pulverized sample is fused with sodium carbonate and the melt after cooling is extracted with cold water. A sufficient quantity of hydrochloric acid to impart an acid reaction is added. The solution obtained is evaporated to dryness and baked to dehydrate the silica, then treated with a little hydrochloric acid and after dilution with water, filtered. Ammonia water is added to the solution in slight excess and the solution allowed to stand until the precipitate has settled. It is then filtered off, washed with cold water and dissolved in hydrochloric acid. All of the rare earths are then present in the solution as chlorides.
- 2. Acid Extraction. Decomposition of the finely pulverized sample may be effected by mixing it with a sufficient quantity of sulphuric acid to make a paste and then heating the mass, slowly at first and then gradually increasing the heat to dull redness when fumes of SO₂ appear. After cooling, the mass is extracted with cold water and the metals of the H₂S group removed in the usual way. The rare earths are then present in the solution as sulphates and may be separated by one of the methods detailed below.
- 3. Acid Extraction. A strong mixture of nitric acid and hydrochloric acid may be used to effect the decomposition of some of the minerals. The solution after being evaporated to dryness and baked leaves a residue which contains the mixed rare earths. The rare earths are dissolved in dilute hydrochloric acid. Any silica present is filtered off and the rare earths present in the clear solution may be separated by one of the methods detailed below.
- 4. Decomposition by Means of Hydrofluoric Acid.¹ Samarskite and euxenite in the finely powdered state are moistened with their own weight of water and twice as much fuming hydrofluoric acid. The attack takes place in a few seconds. When the violent action is over the solution is evaporated to dryness on the steam bath, taken up with water (30 to 40 cc. for a 5-gram sample) and the contents of the dish filtered and washed. The mineral is then divided into two portions, the filtrate containing all the metallic acids, iron and manganese, the insoluble portion containing all the rare earths and uranic acid.

The difficulty of attack increases in proportion to the amount of tantalic acid present in the sample. The rare earths are then extracted from the incoluble portion by one of the methods previously mentioned. Fusion with sodium carbonate is preferred.

SEPARATIONS

Separation of the rare earths from iron, aluminum and thorium ² may be effected by adding sodium fluoride to the hydrochloric acid solution of the Iron Group which has been precipitated as hydroxide. The precipitate, which consists of the double fluorides of the rare earths and thorium, is washed thoroughly and evaporated with sulphuric acid on the sand bath to decompose the fluorides. This process removes the alkaline earths as insoluble sulphates. The excess acid is removed by fuming and the solution of the sulphates after diluting and warming is treated with sodium thiosulphate in solution. Thorium thiosulphate is precipitated. In solution are the sulphates of all the rare earths. Scandium

¹ Prescott and Johnson.

² Browning's "Introduction to the Rarer Elements."

is also precipitated as thiosulphate if the solution in sulphuric is fumed too long and a neutral solution results.

Calcium and manganese, which may also come down with an oxalate precipitate of the rare earths, may be separated from the earths of the yttrium group by precipitation of the solution with oxalic acid, filtering off the precipitate, dissolving it in nitric acid and evaporating to dryness to decompose the manganese salts. Extracting with water leaves the manganese in the residue. Treat the filtrate with ammonia water. The yttrium group precipitates as hydroxides and may be filtered from the calcium, which remains in solution.

Cerium, lanthanum, praseodymium, neodymium, europium and gadolinium may be separated from the other rare earths by adding a saturated solution of potassium sulphate to the sulphate or chloride solution of all of the rare earths. The above-mentioned elements form insoluble double salts.

Scandium may be separated from yttrium by boiling a solution of the nitrates. A basic scandium nitrate is first precipitated.

Yttrium Group. Barium carbonate forms no precipitate in the cold, hence the elements comprising same may be separated from aluminum, iron, chromium, thorium, cerium, lanthanum, praseodymium, and neodymium by this means.

Yttrium Group. The precipitation of the group as hydroxides is not affected by the presence of tartaric acid. Hence the members may be thus separated from aluminum, glucinum, thorium, zirconium, and iron.

Praseodymium, neodymium, lanthanum, and samarium may be separated from each other by the fractional precipitation of a dilute solution of the nitrates with a very dilute solution of ammonia water (1 gram of NH, in 500 cc.). The first precipitates are rich in samarium; the didymiums come down next and the lanthanum in the last portions. By a continual repetition nearly pure salts may be obtained.

Besides the separations mentioned above the group members may be freed from each other by various other methods, as for example:

- (1) Fractional crystallization of the picrates.
- (2) Fractional crystallization of the double magnesium nitrates.
- (3) Fractional precipitation of the oxalates in a nitric acid solution, etc.

GRAVIMETRIC ESTIMATIONS

Owing to the fact that the quantitative separation of the rare earths is only accomplished by the expenditure of a vast amount of time and labor and that the various elements with the exception of but few have found no commercial application, exact methods have not been worked out for the various quantitative assays.

Cerium, however, which is the most important, may be determined as follows:

The element having been brought into solution by one of the methods detailed above and separated from the base metals, silica and thorium may be isolated from the other rare earths by precipitation in a slightly acid solution with oxalic acid. The precipitate is allowed to settle twenty-four hours, filtered, washed with water and ignited. The oxides are then dissolved in hydrochloric acid and precipitated as hydroxide by the addition of an excess of caustic potash. The

precipitate, suspended in solution, is subjected to the action of chlorine gas which is bubbled through in a steady stream. All of the rare earths except cerium are converted into the chlorides, while the latter remains as a reddish, gelatinous precipitate, ceric hydroxide—(Ce(OH)₄). This may be filtered off, washed, ignited and weighed as oxide (CeO₂).

Cerium may be determined in its salts by precipitation with oxalic acid, allowing to settle out, filtering, washing, and igniting to the oxide.

VOLUMETRIC METHOD FOR THE DETERMINATION OF CERIUM

Method of Franz Stolba.¹ The cerium having been separated from all of the other rare earths by some procedure, as, for example, that outlined above under Gravimetric Determination, may be precipitated as ceric oxalate. (Dissolving the hydroxide in hydrochloric acid and then precipitating with oxalic acid.) The oxalate precipitate is filtered off, washed with water until free from hydrochloric acid, and transferred to a beaker containing a small quantity of sulphuric acid and a sufficient quantity of water. The mixture is warmed to about 70° C. and titrated with a standard solution of KMnO4. During the process of titration the quantity of undissolved matter diminishes and the change of color at the end is very distinct. The solution of KMnO4 used is previously standardized, using a known amount of pure ceric sulphate and the same quantities of water and sulphuric acid.

Determination of Cerium in Welsbach Mantles. Colorimetric Method²

Burn off the organic matter and heat with about three times their own weight of H₂SO₄ (conc.) on a sand bath. Allow to cool and pour into 20 cc. of water. In twenty-four hours the sulphates are completely dissolved and the solution after neutralizing the excess of acid with ammonia water is precipitated with oxalic acid. The oxalates after settling out are filtered, washed, transferred to a porcelain casserole and digested with nitric acid, a little being added at a time until complete decomposition has taken place. Evaporate to dryness to remove the excess acid. The nitrates of cerium and thorium are dissolved in water and made to volume. Aliquots are then taken and diluted in comparison tubes, 1 cc. H₂O₂ (Merck's perhydrol) is added. On adding ammonia water Th(OH) is colored orange in proportion to the amount of cerium present. In dilute solutions citric acid prevents the precipitation of the hydroxides and the color can be easily compared with standards containing known amounts.

¹ Crooke's "Select Methods of Analysis."

² Method of E. Benz, Z. angew Chem., 16, 300, 1902.

Determination of Cerium in Presence of Other Rare Earths by Precipitation as Ceric Iodate—Method of Brinton and James¹

The method has been found accurate for determining cerium in presence of large amounts of rare earths.

To the solution containing the rare earth nitrates (thorium Procedure. having been previously removed) is added enough concentrated nitric acid to make up 1 of the total solution. At this point this should not exceed 75 cc. The amount of sample taken should contain not over 0.15 gram of ceria, since the precipitate is bulky and the washing is rendered more difficult by the large precipitate. About 0.5 g., very roughly estimated, of solid potassium bromate is added, and when it has dissolved, an amount of potassium iodate which is 10 to 15 times that theoretically required for the estimated ceria present is added in form of the nitric acid solution already given. This reagent The precipitate of ceric iodate is to be slowly added with constant stirring. is allowed to settle in the cold until the supernatant liquid is practically clear, and it is then filtered on a paper of close texture, such as Whatman No. 42. The precipitate is brought upon the paper pretty completely, and the beaker rinsed just once with a small amount of the washing solution already described. After draining, but not standing longer than is necessary, the precipitate is carefully rinsed from the paper back into the beaker with more of the washing Any clots should be broken up with a stirring rod, and the mixture well churned. The precipitate is again brought on the same filter in the same way, and allowed to drain. It is then rinsed back into the beaker with hot water, heated to boiling, with constant stirring, and conc. nitric acid is dropped in until the precipitate is completely dissolved. Any unnecessary excess of nitric acid is to be avoided. For about 0.1 g. of ceric oxide from 20 to 25 cc. of acid will usually be required. To this solution about 0.25 g. of potassium bromate is added, and about the same amount of potassium iodate as was used in the first precipitation. This may be used in the form of the regular precipitating reagent, unless the use of this solution would make the volume unduly large, in which case the solid potassium iodate can be dissolved by heating in a small volume of 1:2 nitric acid, and thus added. The precipitate is allowed to settle as before, and the perfectly cold mixture is then filtered through the original paper, given one very small washing with the nitric acidiodate washing solution, rinsed back into the beaker once more, well churned, and finally brought on to the paper and washed with 3 small portions of the washing solution. Every trace of the ceric iodate need not be removed from The paper with the precipitate is now lifted from the funnel and the beaker. dropped into the original beaker, taking care to remove any trace of ceric iodate adhering to the glass funnel, either with the upper edge of the filter paper or with a small fragment of another "ashless" filter paper. About 5-8 g. of oxalic acid crystals are now added, and then 50 cc. of water. The covered

¹ H. M. P. Brinton and C. James, Jour. Am. Chem. Soc., 41, 7, 1080, July, 1919.

CERIUM AND THE OTHER RARE EARTHS

140

beaker is heated gently, and its contents are finally boiled until iodine vapors are no longer given off, and all sublimed iodine is vaporized from the cover glass and from the upper edges of the beaker. The cover glass and sides of the beaker are rinsed down with water, and after having stood for several hours the cerous oxalate, mixed with the pulp of the first paper, is filtered, washed with cold water, and ignited in a platinum crucible over the blast lamp. The weight of ceric oxide is obtained by deducting the weight of the two paper ashes.

RARE EARTH OXALATES

Convert into the sulphates by evaporating with sulphuric acid. Dissolve in water and add solid sodium sulphate in excess to the nearly neutral solution.

(1) PRECIPITATE:

Th, Ce, La, Pr, Nd, Sa, Eu, Gd, etc., as double sodium sulphates.

Boil with an excess of sodium hydroxide, filter, wash with hot water and dissolve in nitric acid. Treat the nitrates with an excess of sinc oxide and potassium permanganate.

(3) PRECIPITATE:

CeO₂ and ThO₂. MnO₂ is present is removed by solution in hydrochloric acid and then precipitation of the Ce and Th as double sulphates with sodium. Precipitate is boiled with an excess of sodium hydroxide, washed with hot water and dissolved in nitric acid. Add

ammonia and ammonium ox-alate and ammonium acetate.

PRECIPITATE:

Cerium oxalate. Treat with ex-cess of sinc oxide and solution of potassium per-manganate. Cerium oxide pre-cipitates. Dis-solve in hydro-chloric acid and precipitate rium as oxalate with oxalic acid.

FILTRATE: Thorium oxalate is treated with am-monia in excess, ignite. ThO2.

(3) FILTRATE:

Saturate the solution with sodium sulphate and wash the precipitate formed with a solution of sodium sulphate.

FIL-PRECIPITATE: TRATE: Boil with excess of sodium hy-droxide, filter and wash with hot water. Combine with fil-

trate No. 1.

hot water. Dissolve in a known amount of nitric acid and add an equivalent amount magnesium nitrate in solu-tion. Evapo-rate the solu-tion until upon blowing on surface small crystals form. Spray water on surface and al-

lise. Lanthanum crystallizes 1st, Prascodymium crystallizes 2d, Neodymium crystallizes 3d Samarium crystallizes 4th Europium crystallizes 5th Gadolinium crystallises 6th The crystallisa-

tion is con-trolled by the spectroscope.

low to crystal-

The greater number of times the earths are fractionated the purer the prod-uct will be.

(1) FILTRATE:

As double sodium sulphates. Yt, To Dy, Ho, Er, Tm, Yb, Sc, etc. Add oxalic acid in excess to precipitate the earths as oxalates.

(2) PRECIPITATE:

As an excess of sulphuric acid and evaporate to form anhydrous sulphates of Yt, Tb, drous sulphates of Yt, Yb, Dy, Ho, Er, Tm, Sc, Yb, etc. Dissolve in cold water and

pour over an excess of barium bromate. Stir well and place on the hot water bath. When double water bath. When double decomposition is complete (when the liquid gives no further precipitate with barium bromate solution after diluting and boiling), the mass is filtered and evaporated to crystallisation.

evaporated to crystallisa-tion.

Terbium crystallises 1st,
Dysprosium crystallises
2d, Holmium crystallises
3d, Yttrium crystallises
4th, Erbium crystallises
6th
Crystallises
1th protection of the crystallises
1th protection The mother liquor is made

neutral with ammonia and saturated with potassium sulphate.

PRECIPI-FILTRATE: TATE

Add oxalic acid. Ytterbium is Scandium. Potassium Sulphate. precipitat-ed as oxal(2) Fil-TRATE: Add to filtrate No. 3.

CHLORINE

WILFRED W. SCOTT and WM. F. DOERFLINGER

Cl., at. at. 25.46; D. (air), 2.491; m.p. -101.5°; b.p. -33.6° C.; oxides. Cl.O, Cl.O., Cl.O.

DETECTION

Pree Chlorine. The yellow gas is recognized by its characteristic odor. It liberates iodine from iodides; it bleaches litmus, indigo, and many organic coloring substances.

Chlorides. Silver Nitrate Test. In absence of bromides and iodides, which also form insoluble silver salts, silver nitrate precipitates from solutions containing chlorides white, curdy, silver chloride, AgCl (opalescent with traces), whuble in NHOH (AgBr slowly soluble, AgI difficultly soluble). also soluble in concentrated ammonium carbonate (AgBr is very slightly soluble; AgI is insoluble). Silver chloride turns dark upon exposure to light.

Free Hydrochloric Acid. Manganese Dioxide, Potassium Permanganate, and certain oxidizing agents liberate free chlorine gas when added to solutions containing free hydrochloric acid. The gas passed into potassium iodide liberates free iodine, which produces a blue solution with starch.

Concentrated Sulphuric Acid added to chlorides and heated liberates HCl gas, which produces a white fume in presence of ammonium hydroxide.

Detection in Presence of Cyanate, Cyanide, Thiocyanate. An excess of silver nitrate is added to the solution, the precipitate filtered off and boiled with concentrated nitric acid to oxidize the cyanogen compounds and the white precipitate, silver chloride, subjected to the tests under chlorides to confirm the compound.

Detection in Presence of Bromide and Iodide. About 10 cc. of the solution is neutralized in a casserole with acetic acid, adding about 1 to 2 cc. in excess, and then diluting to about 6 volumes with water. About half a gram of potassium persulphate, KrSrOt, is added and the solution heated. Indine is liberated and may be detected by shaking the solution with carbon disulphide, which is colored blue by this element. Iodine is expelled by boiling, the potassium persulphate being repeatedly added until the solution is colorless. Bromine is liberated by adding 2 or 3 cc. of dilute sulphuric acid and additional A yellowish-red color is produced by this element. disulphide absorbs bromine, becoming colored yellowish red. Bromine is expelled with additional persulphate and by boiling. The volume of the solution should be kept to about 60 cc., distilled water being added to replace that which is expelled by boiling. When bromine is driven out of the solution, the silver nitrate test for chlorides is made. A white, curdy precipitate, soluble in ammonium hydroxide and reprecipitated upon acidifying with nitric acid, is produced, if chlorides are present.

¹Ref. Cis. 35 (2d Ed.), U. S. Bureau of Standards.

If Chlorates are Present. The halogens are precipitated with silver nitrate, the precipitate dissolved with zinc and sulphuric acid and the solution treated as directed in the preceding paragraph.

Test for Hypochlorite. Potassium hypochlorite, KClO, shaken with mercury forms the yellowish-red compound Hg₂OCl₂, which does not form with the

other potassium salts of chlorine, i.e., KCl, KClO₂, KClO₃, KClO₄.

Hypochlorites decolorize indigo, but do not decolorize potassium permanganate solutions. If arsenious acid is present, indigo is not decolorized until all of the arsenious acid has been oxidized to the arsenic form.

Tests for Chlorite. Potassium permanganate solution is decolorized by chlorites. (The solution should be dilute.)

A solution of indigo is decolorized, even in presence of arsenious acid (distinction from hypochlorites).

Detection of Chlorate. The dry salt heated with concentrated sulphuric acid detonates and evolves yellow fumes.

Chlorates liberate chlorine from hydrochloric acid.

Perchlorate. The solution is boiled with hydrochloric acid to decompose hypochlorites, chlorites and chlorates. Chlorides are removed by precipitation with silver nitrate, the filtrate evaporated to dryness, the residue fused with sodium carbonate to decompose the perchlorate to form the chloride, which may now be tested as usual.

ESTIMATION

The determination of chlorine is required in a large number of substances. It occurs combined as a chloride mainly with sodium, potassium and magnesium. Rock salt, NaCl, sylvine, KCl, carnallite, KCl·MgCl₂·6H₂O, matlockite, PbCl₂·PbO; horn silver, AgCl, atacamite, CuCl₂·3Cu(OH)₂, are forms in which it is found in nature. Chlorine is determined in the evaluation of bleaching powder. It is estimated in the analysis of water.

Preparation and Solution of the Sample

In dissolving the sample the following facts should be borne in mind: Although chlorides are nearly all soluble in water, silver chloride is practically insoluble (100 cc. dissolves 0.000152 gram at 20° C.); mercurous chloride is nearly as insoluble as silver chloride (0.00031 gram); lead chloride requires heat to bring it into solution (in cold water only 0.673 gram soluble per 100 cc. of water). Chlorides of antimony, tin, and bismuth require free acid to keep them in solution. Hydrochloric acid increases the solubility of silver, mercury, lead, antimony, bismuth, copper (Cu'), gold and platinum, but decreases the solubility of cadmium, copper (Cu''), nickel, cobalt, manganese, barium, calcium, strontium, magnesium, thorium, sodium, potassium and ammonium chlorides.

Chlorine gas is most readily dissolved in water at 10° C. (1 vol. H₂O dissolves 3.095 vols. Cl). Boiling completely removes chlorine from water.

Hypochlorites, chlorites, chlorates, and perchlorates are soluble in water.

The chlorine may be present either combined or free. In the combined state it may be present as free hydrochloric acid or as a water-soluble or insoluble salt.

¹Prescott and Johnson, Qual. Chem. Anal. D. Van Nostrand Co.

Water-soluble Chlorides. Chlorides of the alkali or alkaline earth groups may be treated directly with silver nitrate upon making slightly acid with nitric acid, the chlorine being determined either gravimetrically or volumetrically according to one of the procedures given later. It is convenient to work with samples containing 0.01 gram to 1 gram of Cl. The sample is dissolved in about 150 cc. of water, made acid with nitric acid with about 5 to 10 cc. in excess of the point of neutralization, should the sample be alkaline. Then the chlorine combined as chloride is determined as directed later.

If the water solution contains a chloride of a heavy metal which forms basic salts (e.g., stannic, ferric, etc., solutions), or which may tend to reduce the silver solution, it is necessary to remove these by precipitation with ammonium hydroxide, or by sodium hydroxide, or potassium carbonate solution. The salt is dissolved in water and acidified with HNO₃, adding about 10 cc. in excess, for about 150 cc. of solution. (This excess HNO₃ should be sufficient to oxidize substances which would tend to reduce the silver reagent; e.g., FeSO₄, etc.) Ammonia solution (free from chloride) is added in sufficient quantity to precipitate the heavy metals iron, manganese, aluminum, etc. The mixture is filtered and the residue washed several times with distilled water. Chlorine is determined in the filtrate by acidifying with HNO₃ as directed above.

Water-insoluble Chlorides. The chloride may frequently be decomposed by boiling with sodium carbonate solution. Many of the minerals, however, require fusion with sodium carbonate to prepare them for solution; e.g., apatite, sodalite, etc. Silver chloride may also be decomposed by fusion.

Silver Chloride. The sample is mixed with about three times its weight of Na₂CO₃ and fused in a porcelain crucible until the mass has sintered together. The soluble chloride, NaCl, is leached out with water, leaving the water-insoluble carbonate of silver, which may be filtered off. The filtrate is acidified with HNO₃ and chlorine determined as usual.

Chlorine in Rocks. The finely ground material is fused with about five times its weight of potassium carbonate. The melt is extracted with hot water, cooled and the solution acidified with nitric acid (methyl orange indicator), and the solution allowed to stand several hours (preferably over night). If silicic acid precipitates, the solution is treated with ammonia and boiled, filtered and the filter washed with hot water. The cooled filtrate is acidified with nitric acid and chlorine determined as usual. If silicic acid does not separate, the addition of ammonia may be omitted and chlorine determined in the solution.

Free Chlorine. Free chlorine may be determined volumetrically according to the procedure given under this section. If it is desired to determine this gravimetrically, a definite amount of the chlorine water is transferred by means of a pipette to a flask containing ammonia solution and the mixture heated to boiling. The cooled solution is acidified with nitric acid and the chloride precipitated with silver nitrate according to the standard procedure given on page 151.

NOTE. Free chlorine cannot be precipitated directly, as the following reaction takes place: 6Cl+6AgNO₃+3H₂O=5AgCl+AgClO₃+6HNO₃.

Reaction of chlorine with ammonia: 2Cl+2NH₄OH=NH₄Cl+NH₄OCl+H₂O.

When the solution is boiled, NH₄OCl breaks down, e.g., 3NH₄OCl+2NH₂=3NH₄Cl

 $+N_2+3H_2O.$

Chlorine in Ores and Cinders. One hundred grams of the finely ground ore or cinder are placed in a 500-cc. flask, containing 300 cc. of strong sulphuric

acid (Cl-free). The flask is shaken to mix the sample with the acid and then connected with an absorption apparatus, containing distilled water or dilute caustic solution. The sample is gradually heated, the distillation flask resting upon a sand bath. After two hours, which is sufficient to expel all the chlorine as hydrochloric acid, the contents of the absorption tubes are filtered, if free sulphur is present (sulphide ores), nitric acid added and the filtrate brought to boiling to oxidize any SO₂ that may be present. Chlorine is precipitated according to the standard procedure on page 148.

During the run the distilling flask should be shaken occasionally to prevent caking. Suction applied at the absorption end of the apparatus and a current of air swept through the system aids in carrying over the HCl into the water or NaOH.

Determination of Halogens in Organic Compounds. Method of Carius 1

Organic compounds may be decomposed by heating with strong nitric acid at high temperatures under pressure. If this heating is conducted in the presence of silver nitrate, the halogen hydride, formed by the action of nitric acid on the organic compound, is converted to the silver halide. This is weighed, or the excess AgNO₁ titrated (p. 149). Arsenic, phosphorus, and sulphur are oxidized to arsenic, phosphoric, and sulphuric acids, the metals present being converted to nitrates.

Procedure. About 0.5 to 1 gram of powdered silver nitrate is introduced, by means of a glazed paper funnel, into a heavy-walled, bomb-glass tube, which is sealed at one end and is 50 cm. long, 2 cm. in diameter and about 2 mm. thickness of wall. About 30 cc. of strong nitric acid (96%), free from chlorine, are introduced by means of a long-stemmed funnel, to avoid wetting the upper portion of the tubing. About 0.1 gram of the organic substance, contained in a small bore, thin wall, glass tube closed at one end (4-5 cm. long), is introduced into the bomb tube, inclined to one side. The small tube should float in the nitric acid, as it is important that the material should not come in contact with nitric acid until the bomb has been sealed, as loss of halogen is apt to occur with open tubes. The upper end of the bomb is softened in the blast-lamp flame, drawn out to a thickwalled capillary tube and fused.

When cold, the bomb is wrapped in asbestos paper, shoved into an iron tube of a bomb furnace and the heat turned on. The heating is so regulated that the temperature is raised to 200 °C. in three hours. If a higher temperature is necessary, the heating should be such as to cause a rise of 50°C. in three hours. Substances of the aromatic series require eight to ten hours heating at 250 to 300°C., while aliphatic substances may be decomposed at 200°C. in about four hours. *Occasionally it is necessary to relieve the pressure in a tube after heating to 200°C., before taking to a higher temperature, by softening the tip of the cooled bomb in a flame, allowing the accumulated gas to blow out, resealing and again heating to the desired temperature. Evidence of crystals or drops of oil in the glass tube indicate incomplete decomposition. When the bomb is cooled, it is removed by

¹ Ann. d. Chem. u. Pharm. (1865), 136, p. 129.

² Treadwell and Hall, Anal, Chem., J. Wiley & Son. P. C. R. Kingscott and R. S. G. Knight, Methods of Quant. Org. Anal. Longmans, Green & Co. (1914), Clowes and Coleman, Quant. Chem. Anal., P. Blakiston's Son & Co., 1900.

taking out the iron sheath from the furnace and inclining it so that the glass capillary tip slides partly out of the tube. (The eyes should be protected by goggles.) The point of the capillary is held in the flame until the tip softens and the gas pressure is released by blowing through a passage in the softened glass. When the gas has escaped, a scratch with a file is made below the capillary and the tip broken off by touching the scratch with a hot glass rod. The contents of the bomb are poured out into a beaker, the tube washed out with water and the combined solution made to about 300 cc. This is heated to boiling and then allowed to cool. The halide precipitate is filtered through a Gooch crucible, then dried and weighed. or by titrating the excess AgNO₃ by Volhard's method, the halide may be estimated.

If pieces of glass should be present, the precipitates, AgCl or AgBr, are dissolved, in ammonium hydroxide, filtered and reprecipitated by acidifying with nitric acid. AgI may be dissolved by means of dilute sulphuric acid and zinc. The excess zinc is removed, the glass washed free of iodine, dried and weighed and its weight subtracted from the original impure AgI, giving the weight of the pure silver iodide.

Lime Method for Determination of Halogens in Organic Matter

A layer of lime (free from chloride), about 6 cm. long, is introduced into a difficultly fusible glass tube, closed at one end (35 cm. long and with 1 cm. bore), followed by 0.5 gram of the substance, and 6 cm. more of the lime. The substance is thoroughly mixed by means of a copper wire with a spiral end. The tube is nearly filled with lime, and in a horizontal position, gently tapped to cause the lime to settle and form a channel above the layer. The tube is placed in a small carbon combustion furnace. The heat is turned on, so that the front end of the tube is heated to dull redness and then the end containing the substance. When the organic matter has been decomposed, the tube is cooled and the contents transferred to a beaker and the lime dissolved in dilute nitric acid (Cl-free). The carbon is filtered off and the halogen determined as usual in the filtrate.

Should a sulphate be present in the mixture, organic matter will reduce it to a sulphide, so that AgS will be precipitated along with the halides. To prevent this, hydrogen peroxide is added to the solution which should be slightly alkaline. The mixture is boiled to remove the excess of H₂O₂ and is then acidified with nitric acid, the solution filtered and the halide determined in the filtrate.

With substances rich in nitrogen, some soluble cyanide is apt to form. The silver precipitate containing the halides and the cyanide is heated to fusion. The residue is now treated with zinc and sulphuric acid, the metallic silver and the paracyanogen filtered off and the halides determined in the filtrate.

Sodium Peroxide Method

Organic compounds may be decomposed by sodium peroxide in an open crucible without recourse to a sealed tube, as is required by the Carius method. The following is the procedure outlined by Pringsheim.¹

About 0.2 gram of substance in a small steel crucible is treated with a cal-

¹ C. N., 1905, **91**, 2372, 215.

culated quantity of sodium peroxide.1 The crucible should be only two-thirds of its height full; this is put in a large porcelain crucible, in which a little cold water is carefully placed, so that the steel crucible stands out 1 to 2 cm. latter crucible is covered with its own cover, in which is a hole through which an iron wire heated to redness can be introduced with the object of starting the combustion. As soon as the combustion is completed the whole is plunged into the water in the larger crucible. The porcelain crucible is covered with a watch-glass and heated gently until the whole mass is dissolved. This point is recognized when no more bubbles are given off and when there are no more particles of carbon which have escaped combustion. The steel crucible is then removed and washed carefully; the solution is filtered and treated with an excess of sulphurous acid (to neutralize the alkaline liquid, and to reduce the oxidized products: bromic, iodic acids, etc.). The solution is acidulated with nitric acid, then made to a volume of about 500 cc., and the halogens precipitated with silver nitrate and the precipitate washed, dried and weighed as usual.

SEPARATIONS 2

Separation of Chlorine and the Halides from the Heavy Metals. Halides of the heavy metals are transposed by boiling their solutions with sodium carbonate, the heavy metals being precipitated as carbonates and the halides going into solution as sodium salts.

Separation of Halides from Silver and from Silver Cyanide. The silver salt is treated with an excess of zinc and sulphuacid, the metallic silver and the paracyanogen filtered off, and the halides determined in the filtrate.

Separation of the Halides from One Another. Separation of Chlorine from Iodine. The method depends upon the fact that nitrous acid sets iodine free from dilute solutions containing a mixture of halogen salts, bromides and chlorides being unaffected.

The solution of the chloride and the iodide in an Erlenmeyer flask is diluted to 400 cc. and 10 cc. of dilute sulphuric acid, 1:1, are added. The gas from 2 grams of sodium nitrite is passed into the solution at the rate of about five bubbles per second. (Pure sodium or potassium nitrite may be added directly to the solution in the flask.) The liberated iodine is now completely expelled by boiling until the evolving steam no longer reacts upon litmus paper. Should a determination of iodine be desired the evolved gas is absorbed in a hydrogen peroxide sodium hydroxide solution according to the procedure described under iodine.

¹ Charge of sodium peroxide is judged as follows:

Per cent C and O in material.	Amount of sugar to add.	Amount of Na ₂ O ₂ required.
Over 75 30 to 75 25 to 50 Below 25	0 0 1 the wt. of sub. An equal weight	18 times wt. of sub. 16 times wt. of sub. 16 times wt. of sub. 16 times wt. of sub.

^{*}Attention is called to "Methods in Chemical Analysis," by F. A. Gooch for useful information on the separation of the halogens.

³ Nitrous acid is generated by addition of dilute H₂SO₄ to NaNO₂, the acid being added drop by drop through a thistle tube with glass stop-cock.

The contents of the flask are treated with silver nitrate and the precipitated silver chloride determined as usual.

Separation of Chlorine and Bromine from Iodine. The procedure is similar to the separation of chlorine from iodine with the exception that a more dilute solution is necessary to prevent the volatilization of bromine with the iodine.

The neutral solution containing the halogens is diluted to about 700 cc. and about 2 to 3 cc. of dilute sulphuric acid, 1:1, are added and a sufficient amount of pure sodium nitrite introduced or nitrous acid gas passed into the solution as directed above. The solution is boiled until colorless and until the evolved steam no longer acts upon litmus paper. About twenty minutes' boiling after the color of iodine has disappeared from the flask will completely eliminate iodine; in this case, however, water should be added to the flask to replace that evaporated before the solution has been reduced to a volume of less than 600 cc.

For determination of bromine in the residue remaining in the flask, see the chapter on this subject, page 93 and page 154.

GRAVIMETRIC METHOD

Determination of Chlorine Combined as Chloride by Precipitation as Silver Chloride

The procedure is the reciprocal to the one for determination of silver; in this case the soluble silver salt is added to the sodium chloride solution, in which chlorine is to be determined.

Procedure. To the nitric acid solution of the chloride, prepared according to directions given under "Preparation and Solution of the Sample," is added silver nitrate solution in slight excess, stirring during the addition of the reagent. (Stirring aids the coagulation of the AgCl and hastens settling. It is advisable to allow the precipitate to settle sufficiently to clear the upper portion of the solution in order to detect whether further precipitation takes place upon addition of more of the reagent.) The mixture is now heated until it is hot to the touch and then allowed to settle for half an hour or more, preferably in the dark. It is filtered through a weighed Gooch crucible, washing the precipitate by decantation several times with cold water, slightly acid with nitric acid, and then the precipitate transferred to the Gooch is washed free of silver nitrate (HCl test) with cold distilled water. The Gooch is dried for fifteen to twenty minutes at 100° C. and then at about 130° C. to constant weight. The sample is now weighed as AgCl.¹

 $AgCl \times 0.2474 = Cl.$

Notes. Free chlorine is converted to chloride according to the procedure given for preparing the sample, and then determined according to the procedure given above. If chlorine and chlorides are both present in the solution and each is desired, the free chlorine is determined according to the volumetric procedure given later, and the total chloride determined gravimetrically, then free chlorine subtracted from total chlorine and the result taken as combined chlorine of the solution.

¹ The silver chloride should be completely soluble in ammonia. If it is not, the product is impure. To separate it from SiO₂, Al₂O₃, and other impurities, the precipitate is dissolved in ammonia, the solution filtered free from the impurities, and the AgCl reprecipitated by acidifying with nitric acid and adding a few drops of silver nitrate.

If a paper filter is used in place of the Gooch crucible, the greater part of the precipitate is removed, the paper ignited separately, the reduced silver oxidized with HNO₃, a drop or so HCl added, then evaporated off, and the residue combined with major portion of AgCl and ignited gently until the salt begins to melt.

VOLUMETRIC METHODS

Determination of Chlorine in Acid Solution, Silver Thiocyanate Ferric Alum Method

The method, devised by Volhard, is applicable to titration of chlorine in acid solutions, a condition frequently occurring in analysis, where the Silver-Chromate Method of Mohr cannot be used. The method is based on the fact that when solutions of silver and an alkali thiocyanate are mixed in presence of a ferric salt, the thiocyanate has a selective action towards silver, combining with this to form thiocyanate of silver, any excess of that required by the silver reacting with the ferric salt to form the reddish-brown ferric thiocyanate, which color serves as an indication of the completion of the reaction. An excess of silver nitrate is added to the nitric acid solution containing the chloride, AgCl filtered off, and the excess of silver titrated with the thiocyanate in presence of the ferric salt.

Copper (up to 70%), arsenic, antimony, cadmium, bismuth, lead, iron, zinc, manganese, cobalt, and nickel, do not interfere, unless the proportion of the latter metals is such as to interfere by intensity of the color of their ions.

Preparation of Special Reagents. N/10 Ammonium or Potassium Thiocyanate Solution. About 8 grams of ammonium or 10 grams of potassium salt are dissolved in water and diluted to one liter. The solution is adjusted by titration against the N/10 silver nitrate solution. It is advisable to have 1 cc. of the thiocyanate equivalent to 1 cc. of the silver nitrate solution. Owing to the deliquescence of the thiocyanates the exact amount for an N/10 solution cannot be weighed.

N/10 Silver Nitrate. This solution contains 10.788 grams Ag or 16.989 grams AgNO₃ per liter. The silver nitrate salt, dried at 120° C., or pure metallic silver may be taken, the required weight of the latter being dissolved in nitric acid and made to volume, or 17.1 grams of the salt dissolved in distilled water and made to 1000 cc. The solution is adjusted to exact decinormal strength by standardizing against an N/10 sodium chloride solution, containing 5.846 grams of pure NaCl per liter.

Ferric Indicator. Saturated solution of ferric ammonium alum. Should this not be available, FeSO₄ may be oxidized with nitric acid, and the solution evaporated with an excess of H₂SO₄ to expel the nitrous fumes. A 10% solution is desired. Five cc. of either of these reagents are taken for each titration.

Pure Nitric Acid. This should be free from the lower oxides of nitrogen. Pure nitric acid is diluted to contain about 50% HNO₂, and boiled until perfectly colorless. The reagent should be kept in the dark. Dilute nitric acid does not interfere with the method.

Procedure. To the solution, containing 0.003 to 0.35 gram chlorine, in combination as a chloride, is added sufficient of the pure HNO₃ to make the solution acid and about 5 cc. in excess. To the solution, diluted to about 150 cc., is added an excess of standard silver nitrate reagent. The precipitated AgCi

¹ Liebig's Ann. d. Chem., 130, 1; Sutton, "Volumetric Analysis," 10 Ed. Z. Anorg. Chem., 63, 330, 1909.

is filtered off and washed free of silver nitrate. The filtrate and washings are combined and titrated with standard thiocyanate.¹

The filtrate from the precipitated chloride is treated with 5 cc. of the ferric solution, and the excess silver determined by addition of the thiocyanate until a permanent reddish-brown color is produced. Each addition of the reagent will produce a temporary reddish-brown color, which immediately fades as long as silver uncombined as thiocyanate remains. The trace of excess produces ferric thiocyanate, the reddish-brown color of this compound being best seen against a white background. From this titration the amount of silver nitrate used by the chloride is ascertained.

One cc. $N/10 \text{ AgNO}_{3} = 0.00355 \text{ gram Cl or } 0.00585 \text{ gram NaCl.}$

Volumetric Determination of Chlorine in a Neutral Solution, Silver Chromate Method

The method, worked out by Fr. Mohr, is applicable for determination of chlorine in water or in neutral solutions containing small amounts of chlorine; the element should be present combined as a soluble chloride. Advantage is taken of the fact that silver combines with chlorine in presence of a chromate, Ag₂CrO₄ being decomposed as follows: Ag₂CrO₄+2NaCl=2AgCl+Na₂CrO₄. When all the chlorine has gone into combination as AgCl, an excess of K₂CrO₄ immediately forms the red Ag₂CrO₄, which shows the reaction of AgNO₂ with the chloride to be complete.

Reagents. Tenth Normal Silver Nitrate Solution. Theoretically 16.989 grams AgNO₃ per liter are required. In practice 17.1 grams of the salt are dissolved per 1000 cc. and the solution adjusted against an N/10 NaCl solution containing 5.846 grams NaCl per liter.

Potassium Chromate. Saturated solution.

Procedure. To the neutral solution (made so, if necessary, by addition of nitric acid or ammonium hydroxide), are added 2 or 3 drops of the potassium chromate solution. A glass cell³ (or a 50-cc. beaker) is filled to about 1 cm. in depth with water tinted to the same color as the solution being titrated. The cell is placed on a clear glass plate half covering the casserole containing the sample. The standard silver solution is now added to the chloride solution from a burette until a faint blood-red tinge is produced, the red change being easily detected by looking through the blank, colored cell.

One cc. N/10 $K_2CrO_4 = 0.003546$ gram Cl.

Notes. Chlorides having an acid reaction (AlCl₂) are treated with an excess of neutral solution of sodium acetate and then titrated with silver nitrate.

Elements whose ions form colored solution with chlorine are precipitated from the solution by sodium hydroxide or potassium carbonate, and the filtrate, faintly acidified with acetic acid, is titrated as usual.

¹Time is saved by filtering, through a dry filter paper, only a portion of the mixture made to a definite volume, and titrating an aliquot portion. The first 10-15 cc. of the filtrate are rejected.

² Upon addition of the ferric solution no color should develop. If a reddish or yellowish color results, more nitric acid is required to destroy this. The amount of nitric acid does not affect results when within reasonable limits.

³ Depré, Analyst, 5, 123; also, Systematic Handbook of "Volumetric Analysis," F. A. Sutton.

Free hydrochloric acid is neutralized with ammonium hydroxide and titrated.

It is advisable to titrate the sample under the same conditions as those observed during standardization. The solution should be kept to small bulk and low temperature for accuracy on account of the solubility of the silver chromate.

Free chlorine should be converted to a chloride before titration. This may be

accomplished, as stated under preparation of the sample, by boiling with ammonium hydroxide. Free chlorine may be determined by sweeping the gas, by means of a current of air, into a solution containing potassium iodide, the liberated iodine titrated by N/10 thiosulphate, Na₂S₂O₃, and the equivalent chlorine estimated.

Volumetric Determination of Free Chlorine

The determination depends upon the reaction Cl+KI=KCl+I. The iodine liberated by the chlorine is titrated with Na₂S₂O₂ and the equivalent Cl calculated.

Procedure. A measured amount of the chlorine water is added to a solution of potassium iodide in a glass-stoppered bottle by means of a pipette, the delivery tip of which is just above the surface of the iodide solution. bottle is then closed and the contents vigorously shaken. The liberated iodine is titrated with tenth-normal sodium thiosulphate (2Na₂S₂O₃+I₂=2NaI+Na₂S₄O₆). When the yellow color of the iodine has become faint, a little starch solution is added and the titration completed to the fading out of the blue color.

One cc. $N/10 \text{ Na}_2S_2O_3 = 0.003546 \text{ gram Cl.}$

Determination of Hypochlorous Acid in the Presence of Chlorine

The determination depends upon the reactions:

$$2KI + HOCl = KCl + KOH + I_2$$
 and $2KI + Cl_2 = 2KCl + I_2$.

The alkali liberated by hypochlorous acid and the total iodine are determined and the calculations made for each of the constituents.

Procedure. A measured volume of N/10 HCl is added to a potassium iodide solution. To this the sample containing the hypochlorous acid and chlorine The liberated iodine is titrated with N/10 Na₂S₂O₃. (The addition of starch is omitted.) The colorless solution is treated with methyl orange indicator and the excess of hydrochloric acid is titrated with N/10 NaOH. The potassium hydroxide, produced by the action of the hypochlorous acid upon the iodide, requires half as much acid for neutralization as the volume of thiosulphate required by the iodine set free by the hypochlorous acid.

Calculation. The cc. back titration with NaOH are subtracted from the total cc. of HCl taken = cc. HCl required by NaOH liberated by HOCl = A. Then 2A cc. = cc. Na₂S₂O₃ required by the I liberated by HOCl. (c. $A \times 0.005247$ =gram HOCl. The total Na₂S₂O₃ titration minus 2A cc. (due to the iodine liberated by HOCl) = cc. Na₂S₂O₂ that are required by the iodine liberated by The cc. thus required multiplied by 0.003546 = grams chlorine in the chlorine. sample taken.

¹ Six parts AgCrO₄, dissolve in 100,000 parts H₂O at 15.5°.—W. G. Young, Analyst, 18, 125.

Gravimetric Determination of Chloric Acid, HClO₃, or Chlorates, by Reduction to Chloride and Precipitation as Silver Chloride

Reduction of the Chlorate. Among the methods of reduction of chlorates the following deserve special mention: 1. Reduction with Sulphurous Acid.¹ 2. Ferrous sulphate. 3. Zinc.

1. About 0.2 to 0.5 gram of the salt is dissolved in 100 cc. of distilled water and either SO₂ gas passed into the solution or sulphurous acid in solution added in excess. The solution is now boiled to expel SO₂ and the chloride precipitated

as AgCl in presence of free nitric acid.

2. The sample in 100 cc. of distilled water is treated with 50 cc. of crystallized ferrous sulphate (10% solution), heated to boiling, with constant stirring, and then boiled for fifteen minutes. Nitric acid is added to the cooled solution, until the deposited basic ferric salt is dissolved. The chloride is now precipitated as AgCl, as usual.

3. The dilute chlorate solution is treated with acetic acid until it reacts distinctly acid. An excess of powdered zinc is now added and the solution boiled for an hour. Nitric acid is added to the cooled solution in sufficient quantity to dissolve the zinc remaining. The solution is filtered, if necessary, and the chloride precipitated as usual.

Factors. AgCl \times 0.855 = KClO₁, or \times 0.2474 = Cl.

Note. In absence of cyanides, carbonates and acids decomposed and volatilized by hydrochloric acid, or oxides, hydroxides and substances other than chlorates that may be decomposed or acted upon by this acid, evaporation of the salt with HCl and ignition of the residue, or addition of an excess of ammonium chloride, and subsequent heating will give a residue of chloride, which may be determined as usual and the equivalent chlorate calculated. Method by L. Blangey.

The methods may be used in determining chlorates in presence of perchlorates, only the former being reduced to chlorides. Outline of the procedure is given later.

Gravimetric Determination of Perchloric Acid by Reduction to Chloride

A perchlorate ignited with about four times its weight of ammonium chloride in a platinum dish may be decomposed to chloride. A second treatment is usually necessary to change the salt completely. Platinum appears to act as a catalyser, so must be added in solution if a porcelain crucible is used.

Procedure. About 0.2 to 0.5 gram of potassium perchlorate is intimately mixed with about 2 grams of ammonium chloride in a platinum crucible, the latter then covered with a watch-glass and the charge ignited gently for one and a half to two hours, the temperature being below the fusing-point of the residual chloride (otherwise the platinum would be attacked). A second addition of ammonium chloride is made and the mix again heated as before. The resulting chloride may now be determined as usual.

Factors. AgCl \times 0.9667 = KClO₄, \times 0.2474 = Cl.

¹ Blattner and Brassuer, Chem. Zeit. Rep., 1900, 24, 793.

² Perchlorates are decomposed by ignition with NH₄Cl in presence of platinum

Determination of Chlorates and Perchlorates in Presence of OneAnother

(1) A portion of the sample is treated with about twelve times its weight of ammonium chloride in a platinum dish (or in a porcelain dish with the addition of 1 cc. of hydroplatinic acid), and the mixture heated according to the procedure given for perchloric acid (page 152). The resulting chloride is determined as usual. This is the total chlorine in the sample.

(2) In a second portion the chlorate is reduced by means of SO₂ or FeSO₄, according to directions given for determination of chloric acid, and chlorine determined. The chlorine of this portion is subtracted from the total chlorine, the difference multiplied by 3.9075 = KClO₄. The chlorine of the second portion multiplied by 3.4563 = KClO₄, or AgCl in (2) subtracted from AgCl of (1) and the difference multiplied by 0.9667 = KClO₄. AgCl of (2) multiplied by 0.855 = KClO₄.

Determination of Hydrochloric, Chloric, and Perchloric Acids in the Presence of One Another

(1) Total Chlorine. If the determination is made in the valuation of niter a 5-gram sample is fused with about three times its weight of alkali carbonate ¹ or calcium hydroxide, ² in a platinum dish, whereby all the chlorine compounds are converted to chlorides. If the compounds are present as alkali salts, fusion with ammonium chloride in a platinum dish may be made and the total chlorides determined after dissolving the residue in nitric acid.

(2) Chloride and Chlorate. If the estimation is being made in niter, 5 grams of the salt are treated with 10 grams of zinc dust (Cl-free) in presence of 150 cc. of 1% acetic acid. The solution is boiled for half an hour, filtered, and the chloride determined. In a mixture of alkali salts of hydrochloric, chloric, and perchloric acids, reduction may be accomplished by passing in SO₂ gas or by adding ferrous sulphate and boiling according to directions given for the determination of chlorate. The chloride now present in the residue is due to the reduced chlorate and to the original chloride of the sample.

(3) The chloride of the sample is determined by acidifying the salt with nitric acid (cold) and precipitating as AgCl.

Perchlorate. The chloride and chlorate in terms of chlorine are subtracted from total chlorine of (1) and multiplied by the factor for the salt desired.

Chlorate. The chlorine of (3) is subtracted from chlorine of (2) and multiplied by the factor for the compound desired.

Chloride. The AgCl of (3) is multiplied by the appropriate factor.

Factors. AgCl \times 0.2474 = Cl, or \times 0.2544 = HCl, or \times 0.4078 = NaCl, or \times 0.5202 = KCl.

 $AgCl \times 0.855 = KClO_4$, or $\times 0.9667 = KClO_4$.

 $Cl \times 3.4563 = KClO_4$, or $\times 3.9075 = KClO_4$, or $\times 2.1027 = KCl$, or $\times 3.0028 = NaClO_4$, or $\times 3.4535 = NaClO_4$, or $\times 1.6486 = NaCl$.

¹ Mennick, Chem. Zeit. Rep., 1898, 22, 117.

Blattner and Brasseur, Chem. Zeit. Rep., 1900, 24, 793.

Determination of Chlorine, Bromine, and Iodine in the Presence of Each Other

The procedure is Bekk's modification of Baubigny's method.1

The halogens are precipitated with an excess of silver nitrate. filtered onto asbestos or glass wool, washed, dried, and weighed as total halogens as silver salts. A second portion is precipitated and the moist, washed silver salts (0.3 to 0.4 gram) are treated with a solution of 2 grams of potassium dichromate in 30 cc. of concentrated sulphuric acid at 95° C., and digested for thirty minutes. By this procedure the iodine is oxidized to hydriodic acid (HIO₃) and chlorine together with bromine is liberated in form of the free halogen. Toward the end of the reaction a stream of air is led through the solution to remove any chlorine and bromine. This is now diluted to 300 to 400 cc., filtered, and the hydriodic acid reduced by adding, drop by drop, with constant stirring, a concentrated solution of sodium sulphite, Na₂SO₃, until a faint odor of SO, remains after standing ten minutes. (Under certain conditions an excess may result in a partial reduction of the silver iodide.) The precipitated silver salt is filtered, washed with hot, dilute nitric acid, dried and weighed as AgI. The filtrate containing the silver, formerly with the chlorine and bromine, is treated with potassium iodide in sufficient amount completely to precipitate the silver as AgI. This is filtered, washed and weighed. From the three weights the chlorine, bromine and iodine can be easily calculated.

NOTE. Bekk claims an accuracy within less than 0.15%.

Determination of Free Hydrochloric Acid

In absence of other free acids, hydrochloric acid may be accurately determined by titration with standard alkali. Details for the volumetric analysis of muriatic acid in presence of commonly occurring impurities are given in Volume II in the chapter on Acids.

1 cc. N/1 NaOH = 0.03647 g. HCl.

Determination of Chloride and Cyanide in Presence of One Another

The cyanide is determined by Liebig's method described on page 131. To the neutral solution is added sufficient N/10 silver nitrate to combine with all of the cyanide and chloride present and an excess. The solution is acidified with nitric acid and diluted to a definite volume and a portion filtered through a dry filter. A portion of the filtrate, an aliquot of the whole is titrated with standard thiocyanate solution (page 149) using ferric alum indicator and the excess of the AgNO₃ added thus ascertained. From this the amount combined with the CN and Cl is known. The equivalent required by the cyanide is deducted, the difference being due to the chloride present in the solution.

1 cc. N/10 AgNO₃ = 0.005203 g. CN, or 0.013022 g. KCN, or 0.003546 g. Cl or 0.005846 g. NaCl, or 0.007456 g. KCl.

Determination of Chloride, Cyanide and Thiocyanate in Presence of One Another

The cyanide is determined by the method of Liebig described on page 131, and the equivalent $AgNO_3$ required recorded = A.

¹ Julius Bekk, Chem. Ztg., 39, 405-6 (1915). C. A., 9, 2042, (1915).

An excess of N/10 AgNO₃ over that required by CN, CNS and Cl is added and the solution acidified with nitric acid. After making to a definite volume, the solution is filtered through a dry filter, the residue being saved. A portion of the filtrate, an aliquot of the whole solution, is titrated with standard thiocyanate solution using ferric alum indicator (see page 149), the excess of AgNO₃ is calculated. The amount combining with CN, CNS and Cl is now known = B.

The silver salts on the filter paper are washed with water and transferred by means of strong hydrochloric acid to a flask and boiled for an hour. The cyanide and thiocyanate are decomposed and dissolve, while the silver chloride remains unchanged. The sulphuric acid formed by oxidation of the thiocyanate is precipitated by barium nitrate (as BaSO₄). Without removing the precipitate; AgCl and BaSO₄ the silver nitrate in this solution is determined by Volhard's method (page 149) and the AgNO₃ required by thiocyanic acid and cyanide thus ascertained = C.

By deducting the AgNO₂ of (A) from (C) the silver nitrate required by thiocyanic acid is determined.

Deducting the AgNO₃ required by CN and CNS (C) from the total AgNO₃ required by CN, CNS and Cl is (B) the amount required by chlorine is obtained.

We now have the silver nitrate equivalent of Cl, CN, CNS.

 $N/10 \text{ AgNO}_2 = 0.005203 \text{ g. CN}$, or 0.005808 g. CNS or 0.003546 g. Cl.

Note. In the analysis of compounds containing hypochlorites and chlorides, the conversion of hypochlorites to chlorides by heating with hydrogen peroxide is a great convenience.

For instances in the analysis of bleach liquors, washes, etc., the (OCl) and Cl may be very easily and quickly determined by titrating an aliquot with As₂O₃ and then a similar aliquot with AgNO₃ after converting all the OCl to Cl by warming with H₂O₂.

EVALUATION OF BLEACHING POWDER, CHLORIDE OF LIME, FOR AVAILABLE CHLORINE

When chloride of lime is treated with water, it is resolved into calcium hypochlorite, Ca(OCl)₂, and calcium chloride, CaCl₂. The calcium hypochlorite constitutes the bleaching agent. The technical analysis is confined to the determination of available chlorine, which is expressed as percentage by weight of the bleaching powder.

Procedure. Ten grams of the sample are washed into a mortar and ground with water, the residue allowed to settle and the supernatant liquor poured into a liter flask. The residue is repeatedly ground and extracted with water until the whole of the chloride is transferred to the flask. The combined extracts are made up to 1000 cc.

To 50-cc. portions (0.5 gram) of the solution, 3 to 4 grams of solid potassium iodide and 100 cc. of water are added and the solution acidified with acetic acid. Iodine equivalent to the available chlorine is liberated. This is titrated with N/10 arsenious acid.

One cc. N/10 arsenious acid = 0.003546 gram Cl. This multiplied by 200 = %Cl.

In France the strength is given in Gay-Lussac degrees, e.g., liters of gas evolved by 2 kilograms of bleaching powder, 0° C. and 760 mm. $100^{\circ} = 31.78\%$ Cl.

CHROMIUM

VLIMI V. NORT

Co. et.at. 82.9; ep.gr. 6.32; m.p. 1829"; h.p. 2300" C; enides, CrO₂; Cr₂O₂, CrO₂.

DETECTION

Chromium is prescribed by hydrogen sulpinise and summanium hydroxide, so immengees. As OH a sing with the hydroxides of iron and aluminum measurest of persons groups having been removed. The chromic compound is unclosed to caranase by action of chircine, bromine, soliton peroxide, or ayangen peroxide about to the substance containing an excess of caustic alkali. The caranase chaotics and is thus separated from iron, which remains insoluble as to OH. The alkali chromates color the solution yellow.

Barium acetate or chloride added to a neutral or slightly acetic acid administrated a chromate presintates yellow harium chromate. BaCrO₂. Addition of automatical acetate to neutralize any free inorganic acid aids the reaction.

Lead acetate produces a yellow precipitate with chromates, in neutral or weste with solutions.

Mercurous aitrate or ailver aitrate gives red precipitates with chromates.

Hydrogen peroxide added to a chromate and heated with an acid, such as subplurie, uttrie, or hydrochloric, will form a greenish-blue colored solution. Curvatates are reduced by hydrogen peroxide in acid solution, the action being reversed in alkaline solution.

Reducing agents, hydrogen sulphide, sulphurous acid, ferrous salts, alcohol form green chronic salts when added to chromates in acid solution.

Ether staken with a chromate to which nitric acid and hydrogen peroxide are added, is endored a transient blue. Oxygen is given off as the color fades.

$$HCr()_4+3HNO_1=Cr(NO_1)_2+2H_2O+O_3$$

Diphenyl carbazide test. To 5 cc. of the solution containing chromium as chromate, 2 drops of hydrochloric or acetic acid are added, and 1 drop of an acetic acid solution of diphenyl carbazide (0.2 gram CO (NH-NH-C₄H₄)₂ is dissolved in 5 cc. glacial acetic acid and diluted to 20 cc. with ethyl alcohol). A violet pink color is produced in presence of a chromate. Less than 0.0000001 gram chromium may be detected.

Chronic salts are bluish green; chromic acid is red; chromates, yellow; bichronates, red; chrome alum, violet.

The providered mineral, containing chromium, when fused with sodium cartenate and nitrate, produces a yellow colored mass.

ESTIMATION

Among the substances in which chromium is determined are the following: Chrome from or chromite, Cr₂O₂·FeOMgO; crocoisite, PbCrO₄; slags; chromic oxide, chrome green, in pigments; chromates and dichromates; chrome steel and ferro-chrome.

Preparation and Solution of the Sample

Although powdered metallic chromium is soluble in dilute hydrochloric or sulphuric acid, it is only slightly soluble in dilute or concentrated nitric acid. It is practically insoluble in aqua regia and in concentrated sulphuric acid. Chrome iron ore is difficult to dissolve. It is important to have the material in finely powdered form to effect a rapid and complete solution of the sample. An agate mortar may be used to advantage in the final pulverizing of the substance.

General Procedures for Decomposition of Refractory Materials Containing Chromium. The following fluxes may be used:

- A. Fusion with KHSO₄ and extraction with hot dilute HCl. The residue fused with Na₂CO₂ and KClO₃, 3:1, or fusion with soda lime and KClO₃, 3:1.
 - B. Fusion with NaHSO4 and NaF, 2:1.
- C. Fusion with magnesia or lime and sodium or potassium carbonates, 4:1.
- E. Fusion with Na₂O₃, or NaOH and KNO₃, or NaOH and Na₂O₂. Nickel. iron, copper, or silver crucibles should be used for E. Platinum may be used for A, B, or C.

Special Procedures. Materials High in Silica. The finely ground sample, 1 to 5 grams, is placed in a platinum dish and mixed with 2 to 5 cc. concentrated sulphuric acid (1.84), and 10 to 50 cc. of strong hydrofluoric acid added. The solution is evaporated to small volume on the steam bath and to SO; fumes on the hot plate. Sodium carbonate is added in sufficient amount to react with the free acid, and then an excess of 5 to 10 grams added and the mixture heated to fusion and kept in molten condition for half an hour. From time to time a crystal of potassium nitrate is added to the center of the molten mass until 1 to 2 grams are added. (Caution. Platinum is attacked by KNO2, hence avoid adding a large amount at any one time.) Chromium and aluminum go into solution in the flux, but iron is thrown out as Fe(OH)₂. The cooled fusion is extracted with hot water and filtered from the iron residue. Chromium is in solution together with aluminum. If much iron is present it should be disdissolved in a little hydrochloric acid and the solution poured into boiling 10% solution of potassium hydroxide, the cooled solution+Fe(OH), precipitate is treated with hydrogen peroxide or sodium peroxide to oxidize any chromium that may have been occluded by the iron in the first precipitate. The mixture is again filtered and the combined filtrates examined for chromium.

Sodium Peroxide Fusion. Chrome Iron Ores. One to two grams of finely pulverized ore are placed in a nickel or iron crucible of 50 to 75 cc. capacity and mixed with 5 to 10 grams of yellow sodium peroxide. (Fresh peroxide is best). The mass is gently heated over a Bunsen burner until it melts. The fusion is kept at a low red heat for about fifteen minutes. About 5 grams more of the Na₂O₂ are added and the fusion heated for about ten minutes more. The cooled fusion is dissolved in a casserole with 100 cc. to 150 cc. of water, more peroxide being added to this solution if it appears purple. The excess of peroxide is decomposed by boiling the solution, and to the caustic solution free from peroxide is added 10 to 15 grams of ammonium carbonate or a sufficient quantity of the salt to neutralize four-fifths of the sodium hydroxide present in the solution, as the strong caustic would otherwise dissolve the filter. The solution is now filtered. The insoluble matter is treated on the filter with dilute sulphuric



Cr, at.wt. 52.0; sp.gr. 6.92; m.p. 1520°; b.p. 2200° C; oxides, CrO₂; Cr₂O₃, CrO₃.

DETECTION

Chromium is precipitated by hydrogen sulphide and ammonium hydroxide, as bluish-green, $Cr(OH)_3$, along with the hydroxides of iron and aluminum (members of previous groups having been removed). The chromic compound is oxidized to chromate by action of chlorine, bromine, sodium peroxide, or hydrogen peroxide added to the substance containing an excess of caustic alkali. The chromate dissolves and is thus separated from iron, which remains insoluble as $Fe(OH)_3$. The alkali chromates color the solution yellow.

Barium acetate or chloride added to a neutral or slightly acetic acid solution of a chromate precipitates yellow barium chromate, BaCrO₄. Addition of ammonium acetate to neutralize any free inorganic acid aids the reaction.

Lead acetate produces a yellow precipitate with chromates, in neutral or acetic acid solutions.

Mercurous nitrate or silver nitrate gives red precipitates with chromates.

Hydrogen peroxide added to a chromate and heated with an acid, such as sulphuric, nitric, or hydrochloric, will form a greenish-blue colored solution. Chromates are reduced by hydrogen peroxide in acid solution, the action being reversed in alkaline solution.

Reducing agents, hydrogen sulphide, sulphurous acid, ferrous salts, alcohol form green chromic salts when added to chromates in acid solution.

Ether shaken with a chromate to which nitric acid and hydrogen peroxide are added, is colored a transient blue. Oxygen is given off as the color fades.

$$HCrO_4+3HNO_3=Cr(NO_3)_3+2H_2O+O_2$$
.

Diphenyl carbazide test. To 5 cc. of the solution containing chromium as chromate, 2 drops of hydrochloric or acetic acid are added, and 1 drop of an acetic acid solution of diphenyl carbazide (0.2 gram CO (NH·NH·C₅H₅); is dissolved in 5 cc. glacial acetic acid and diluted to 20 cc. with ethyl alcohol). A violet pink color is produced in presence of a chromate. Less than 0.0000001 gram chromium may be detected.

Chromic salts are bluish green; chromic acid is red; chromates, yellow; bichromates, red; chrome alum, violet.

The powdered mineral, containing chromium, when fused with sodium carbonate and nitrate, produces a yellow colored mass.

ESTIMATION

Among the substances in which chromium is determined are the following: Chrome iron or chromite, Cr₂O₂·FeOMgO; crocoisite, PbCrO₄; slags; chromic oxide, chrome green, in pigments; chromates and dichromates; chrome steel and ferro-chrome.

Preparation and Solution of the Sample

Although powdered metallic chromium is soluble in dilute hydrochloric or sulphuric acid, it is only slightly soluble in dilute or concentrated nitric acid. It is practically insoluble in aqua regia and in concentrated sulphuric acid. Chrome iron ore is difficult to dissolve. It is important to have the material in finely powdered form to effect a rapid and complete solution of the sample. An agate mortar may be used to advantage in the final pulverizing of the substance.

General Procedures for Decomposition of Refractory Materials Containing Chromium. The following fluxes may be used:

- A. Fusion with KHSO₄ and extraction with hot dilute HCl. The residue fused with Na₂CO₃ and KClO₃, 3:1, or fusion with soda lime and KClO₄, 3:1.
 - B. Fusion with NaHSO4 and NaF, 2:1.
- C. Fusion with magnesia or lime and sodium or potassium carbonates, 4:1.
- E. Fusion with Na₂O₂, or NaOH and KNO₃, or NaOH and Na₂O₂. Nickel. iron, copper, or silver crucibles should be used for E. Platinum may be used for A, B, or C.

Special Procedures. Materials High in Silica. The finely ground sample, 1 to 5 grams, is placed in a platinum dish and mixed with 2 to 5 cc. concentrated sulphuric acid (1.84), and 10 to 50 cc. of strong hydrofluoric acid added. The solution is evaporated to small volume on the steam bath and to SO; fumes on the hot plate. Sodium carbonate is added in sufficient amount to react with the free acid, and then an excess of 5 to 10 grams added and the mixture heated to fusion and kept in molten condition for half an hour. From time to time a crystal of potassium nitrate is added to the center of the molten mass until 1 to 2 grams are added. (Caution. Platinum is attacked by KNO₂, hence avoid adding a large amount at any one time.) Chromium and aluminum go into solution in the flux, but iron is thrown out as Fe(OH)3. The cooled fusion is extracted with hot water and filtered from the iron residue. Chromium is in solution together with aluminum. If much iron is present it should be disdissolved in a little hydrochloric acid and the solution poured into boiling 10% solution of potassium hydroxide, the cooled solution + Fe(OH), precipitate is treated with hydrogen peroxide or sodium peroxide to oxidize any chromium that may have been occluded by the iron in the first precipitate. The mixture is again filtered and the combined filtrates examined for chromium.

Sodium Peroxide Fusion. Chrome Iron Ores. One to two grams of finely pulverized ore are placed in a nickel or iron crucible of 50 to 75 cc. capacity and mixed with 5 to 10 grams of yellow sodium peroxide. (Fresh peroxide is best). The mass is gently heated over a Bunsen burner until it melts. The fusion is kept at a low red heat for about fifteen minutes. About 5 grams more of the Na₂O₂ are added and the fusion heated for about ten minutes more. The cooled fusion is dissolved in a casserole with 100 cc. to 150 cc. of water, more peroxide being added to this solution if it appears purple. The excess of peroxide is decomposed by boiling the solution, and to the caustic solution free from peroxide is added 10 to 15 grams of ammonium carbonate or a sufficient quantity of the salt to neutralize four-fifths of the sodium hydroxide present in the solution, as the strong caustic would otherwise dissolve the filter. The solution is now filtered. The insoluble matter is treated on the filter with dilute sulphuric

acid, 1:4. If a portion remains insoluble, it is an indication of incomplete decomposition of the ore, and this residue is again fused with peroxide and treated as above. The combined filtrates contain the chromium.

Since chromates are reduced in presence of free acid and peroxide, the latter should be expelled before making the solution acid.¹

If the chromate is to be precipitated as BaCrO₄ or PbCrO₄, the solution should be acidified with hydrochloric acid. If the reduced solution is to be titrated with potassium permanganate, it is best to use sulphuric acid in neutralizing the caustic solution. Further directions will be given under the method chosen.

Method for Solution of Iron and Steel. One gram of steel is dissolved in about 20 cc. of dilute sulphuric acid, 1:3. When the solution is complete nitric acid is added drop by drop until the iron is oxidized, about 5 cc. of the dilute acid, 1:3, being sufficient. After boiling to remove nitrous fumes, the solution is diluted to about 150 cc. Now a strong solution of potassium permanganate is added drop by drop in sufficient amount to just form a permanent precipitate of MnO₂, the solution being heated to boiling between each addition. After boiling five minutes the solution should be free from pink color and a slight brown precipitate should be present. If pink, boil until solution is a yellow color. Cool, filter and determine chromium by the reduction method with ferrous salt. The addition of 5 cc. syrupy H₃PO₄ decolorizes the ferric salts and gives a sharper end point.

SEPARATIONS

Chromium, Iron, and Aluminum. If chromium has been fused with sodium peroxide or carbonate containing a little potassium nitrate, and the fusion extracted with boiling water, most of the chromium goes into solution as a chromate, together with alumina, but some of the chromium is occluded by Fe(OH)₂. If the amount of the iron precipitate is appreciable, and warrants the recovery of occluded chromium, it is dissolved in hydrochloric acid and the iron reprecipitated by pouring into a solution of strong sodium hydroxide. Before filtering off the iron hydroxide, a little H₂O₂ is added to oxidize the Cr₂O₃, if accidentally present, and the solution boiled and filtered. The combined filtrates will contain all of the chromium and aluminum.

If chromium is present as a chromic salt, instead of a chromate, it is oxidized to the higher form, by adding peroxide (H₂O₂ or Na₂O₂) to the alkaline solution. Bromine added to this solution or chlorine gas passed in will accomplish complete oxidation. It must be remembered that in acid solutions hydrogen peroxide, sodium peroxide, or nitrites will cause reduction of chromates to chromic salts (exception, see method for solution of steel), so that these should be boiled out of the alkaline solution before making decidedly acid with hydrochloric or sulphuric acids. Since these are difficult, if not impossible, to completely expel from an alkaline solution, after boiling the strongly alkaline solution, dilute sulphuric acid is added until the solution acquires a permanent brown color (nearly acid), acid potassium sulphate, KHSO₄, is added, and

¹ See Separations.

² Br may be added and then NaOH to oxidize Cr and precipitate Fe(OH)₂. Chromic oxide and most of its compounds, except chrome iron stone, may be decomposed by conc. HNO₂+KClO₃ (added in small portions). M. Gröger, Zeitsch. anorg. Chem., 81, 233–242, 1913.

the boiling continued.¹ This will decompose the bromates and expel bromine, etc., but will not cause the reduction of the chromate, as would a strong acid solution.

Separation of Chromium from Aluminum. This separation is necessary if chromium is to be precipitated as $Cr(OH)_3$. The sodium chromate and aluminate solutions are made slightly acid with nitric acid and then faintly alkaline with ammonium hydroxide, $Al(OH)_3$ is precipitated and chromium remains in solution as a chromate.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF CHROMIUM

Precipitation of Chromic Hydroxide and Ignition to Cr₂O₃²

Chromium present as a chromic salt in solution, free from iron and aluminum or elements precipitated as hydroxides, is thrown out of solution by NH₄OH as Cr(OH)₃, the precipitate ignited to the oxide, Cr₂O₃,² and so weighed. The presence of hydrochloric acid or sulphuric acid does not interfere.

Reduction. If the chromium is already present as the chromic salt, free from iron and alumina, it may be precipitated directly as the hydroxide by addition of ammonia; otherwise, if present as the chromate, as is the case when a separation from iron and alumina has been necessary, and in cases where the chromium has been brought into solution by fusion with an oxidizing reagent, reduction is necessary. This is accomplished by passing SO₂ or H₂S into the slightly acid solution of the chromate, or by adding alcohol to the hydrochloric acid solution and boiling until the solution appears a deep grass green. Twenty cc. of alcohol for every 0.1 gram of Cr has been found to be ample for this reduction. The SO₂ or H₂S should be expelled from solution by boiling, in case either has been used for reduction of the chromate.

Precipitation. Ammonium hydroxide or ammonium sulphide are added in slight excess and the solution boiled for about ten minutes. The solution should be slightly alkaline (litmus), otherwise a few drops of ammonia should be added, but not a large excess; the solution will then settle out clear. A cloudy solution results from prolonged boiling when the solution has become acid; on the other hand, a large excess of ammonia will prevent complete precipitation of chromium and the filtrate will be colored pink or violet. The chromic hydroxide is filtered off on S and S 589 filter paper. Since the precipitate is apt to be gelatinous it is advisable to wash two or three times by decantation and several times on the paper. The well-drained precipitate and filter is ignited wet in a porcelain or platinum crucible, first over a low flame until the paper has been charred, then over a strong gas flame for about thirty minutes,

¹KH8O₄ will not cause reduction of chromates. A. Kurtenacker, Zeitsch. anal. Chem., 52, 401–407, 1913. The Analyst, 38, 449, page 387.

² It is advisable to take such a weight of sample that the ignited Cr₂O₃ does not exceed 0.5 gram in weight.

²Cr₂O₂, mol.wt., 152; sp.gr., 5.04; m.p., 2059°; insol. in H₂O, slightly sol. in acids, dark green hexagonal.

and finally a blast heat for five minutes. The green residue is weighed as Cr_2O_3 .

 $Cr_2O_2 \times 0.6846 = Cr.$

Determination of Chromium as Barium Chromate²

Chromium, present as a chromate, is precipitated from a neutral or faintly acetic acid solution of an alkali chromate by addition of barium acetate or chloride. The BaCrO₄ is gently ignited and weighed. The solution should be free from sulphuric acid or sulphates.

Procedure. The alkali chromate solution is neutralized with nitric acid or ammonia as the case may require, precautions for avoiding reduction having been observed as indicated under Preparation and Solution of the Sample. 10 cc. of ½ N. BaCl₂ or Ba(C₂H₁O₂)₂ (approx. 10% sol.) are added to the boiling solution for each 0.1 gram of chromium present. The reagent should be added in a fine stream or drop by drop to prevent occlusion of the reagent by the precipitate. The precipitated chromate is allowed to settle on the steam bath for two or three hours and then filtered into a weighed Gooch crucible and washed with 10% alcohol solution. The precipitate is dried for an hour in the oven, then placed in an asbestos ring suspended in a large crucible with cover and thus heated over a low flame, gradually increasing the heat until the outer crucible becomes a dull red. The cover is removed and the heating continued for five minutes, or until the precipitate appears a uniform yellow throughout. High heating should be avoided. The cooled residue is weighed as BaCrO₄.

BaCrO₄×0.2055 = Cr, BaCrO₄×0.3002 = Cr₂O₂. BaCrO₄×0.7666 = K₂CrO₄. BaCrO₄×0.5807 = K₂Cr₂O₇.

Notes. If the precipitate on the sides of the crucible appears green, it is ignited until the green color disappears.

If sulphates are present, BaSO₄ will be precipitated, hence this method could not be used. In this case either reduction to the chromic salt and precipitation of chromium as Cr(OH)₄ or a volumetric procedure should be followed.

Oxidize chromium with an excess of hydrogen peroxide in alkaline solution, reduce in acid solution with ferrous sulphate and titrate with permanganate. Decomposition of hydrogen peroxide is accelerated by heat and by presence of sodium sulphate or ferric salts. Salts of nickel cobalt, or manganese, decompose H₂O₂ energetically and lower results are obtained. F. Bourin and A. Senechal. Compt. 1end., 157, 1528-31.

¹ If the filtrate appears yellow, chromate is indicated, the solution should be reduced and the chromium precipitated as $Cr(OH)_2$. If the filtrate is pink, it should be boiled until it appears green and $Cr(OH)_2$ precipitates. These precipitates should be included in the above calculation for chromium.

² BaCrO₄, mol.wt., 253.47; sp.gr., 4.498; solubility per 100 cc. H₂O, 0.00038¹⁶⁰ and 0.0043 hot. Soluble in HCl and in HNO₄; yellow rhombic plates.

OLUMETRIC METHODS FOR THE DETERMINATION OF CHROMIUM

fotassium lodide Method for Determination of Chromium

Chromium present as a chromate is reduced in acid solution by addition of petassium iodide and the liberated iodine titrated by standard sodium thiosubjecte. The method depends upon the following reactions:

- (a) $2CrO_2+6KI = Cr_2O_2+3K_2O+6I$.
- (b) $I_2 + 2Na_2S_2O_3 = 2NaI + Na_2S_4O_6$.

The presence of large quantities of Ca, Ba, Sr, Mg, Zn, Cd, Al, Ni, Co, H₂SO₄, HCl. does not interfere.1

Precedure. The alkali chromate solution containing not over 0.17 gram Cr 2 and free from Fe₂O₃, is made nearly acid with H₂SO₄, boiled with 20 cc. of 30% potassium acid sulphate to decompose bromates or expel Br. Cl. or H.O. as the case may require, more KHSO4 being added if necessary. If the solution is not acid it is made so with sulphuric acid and 5 cc. of the acid per 100 cc. of solution is added in excess.3 About 2 grams of solid potassium iodide are added and, after five minutes, the liberated iodine is titrated with N/10 Na₂S₂O₂ solution. When the green color of the reduced chromate begins to predominate over the free iodine color (brownish red) a little starch solution is added and the titration with the thiosulphate continued until the blue color of the starch compound is just destroyed, care being taken not to confuse the green color of the reduced chromium with the blue of the starch.

One cc. of N/10 Na₂S₂O₃ 4 = 0.001733 gram Cr.

Determination of Chromium by Reduction of the Chromate with Ferrous Salts

The procedure may be used for the determination of chromium in presence of ferric iron and alumina. Hydrochloric or sulphuric acids do not interfere. If hydrochloric acid is present in solution, the K₂Cr₂O₇ back titration should be made. In presence of H₂SO₄ either KMnO₄ or K₂Cr₂O₇ titrations may be made. The method depends upon the reduction of soluble chromates by ferrous salts, the excess being determined by titration.

Reactions. a. $2\text{CrO}_2 + 6\text{FeO} + xs\text{FeO} = \text{Cr}_2\text{O}_2 + 3\text{Fe}_2\text{O}_2 + xs\text{FeO}$.

b. xsFeO is oxidized by standard oxidizing reagent to Fe₂O₂.

¹ Sodium peroxide is generally used for oxidation of chromium. The solution is now neutralised with acid, the iodide added and 10 cc. of strong HCl. The liberated iodine is immediately titrated.

² If desired, stronger solution of titration reagents may be used, and consequently a larger sample taken. A normal sol. of Na₂S₂O₃ may be used to advantage with 1 gram

samples of chromium salts or hydrates, where Cr exceeds 10%.

Sutton recommends for every 0.5 gram K₂Cr₂O₇ present to add .5 gram KI and 1.8 gram H₂SO₄ per 100 cc. of solution. If more K₂Cr₂O₇ is present, increase the KI and H₂SO₄, but not the water.

⁴ If desired, a normal solution of thiosulphate may be used with one gram sample of chromium salts or hydroxides, when the chromium present exceeds 10 per cent.



WILFRED W SCOTT

Cr, at.wt. 52.0; sp.gr. 6.92; m.p. 1520°; b.p. 2200° C; oxides, CrO₂; Cr₂O₁, CrO₂.

DETECTION

Chromium is precipitated by hydrogen sulphide and ammonium hydroxide, as bluish-green, $Cr(OH)_3$, along with the hydroxides of iron and aluminum (members of previous groups having been removed). The chromic compound is oxidized to chromate by action of chlorine, bromine, sodium peroxide, or hydrogen peroxide added to the substance containing an excess of caustic alkali. The chromate dissolves and is thus separated from iron, which remains insoluble as $Fe(OH)_3$. The alkali chromates color the solution yellow.

Barium acetate or chloride added to a neutral or slightly acetic acid solution of a chromate precipitates yellow barium chromate, BaCrO₄. Addition of ammonium acetate to neutralize any free inorganic acid aids the reaction.

Lead acetate produces a yellow precipitate with chromates, in neutral or acetic acid solutions.

Mercurous nitrate or silver nitrate gives red precipitates with chromates.

Hydrogen peroxide added to a chromate and heated with an acid, such as sulphuric, nitric, or hydrochloric, will form a greenish-blue colored solution. Chromates are reduced by hydrogen peroxide in acid solution, the action being reversed in alkaline solution.

Reducing agents, hydrogen sulphide, sulphurous acid, ferrous salts, alcohol form green chromic salts when added to chromates in acid solution.

Ether shaken with a chromate to which nitric acid and hydrogen peroxide are added, is colored a transient blue. Oxygen is given off as the color fades.

$$HCrO_4+3HNO_3=Cr(NO_3)_2+2H_2O+O_3.$$

Diphenyl carbazide test. To 5 cc. of the solution containing chromium as chromate, 2 drops of hydrochloric or acetic acid are added, and 1 drop of an acetic acid solution of diphenyl carbazide (0.2 gram CO (NH·NH·C₄H₄)₂ is dissolved in 5 cc. glacial acetic acid and diluted to 20 cc. with ethyl alcohol). A violet pink color is produced in presence of a chromate. Less than 0.0000001 gram chromium may be detected.

Chromic salts are bluish green; chromic acid is red; chromates, yellow; bichromates, red; chrome alum, violet.

The powdered mineral, containing chromium, when fused with sodium carbonate and nitrate, produces a yellow colored mass.

ESTIMATION

Among the substances in which chromium is determined are the following: Chrome iron or chromite, Cr₂O₂·FeOMgO; crocoisite, PbCrO₄; slags; chromic oxide, chrome green, in pigments; chromates and dichromates; chrome steel and ferro-chrome.

Preparation and Solution of the Sample

Although powdered metallic chromium is soluble in dilute hydrochloric or sulphuric acid, it is only slightly soluble in dilute or concentrated nitric acid. It is practically insoluble in aqua regia and in concentrated sulphuric acid. Chrome iron ore is difficult to dissolve. It is important to have the material in finely powdered form to effect a rapid and complete solution of the sample. An agate mortar may be used to advantage in the final pulverizing of the substance.

General Procedures for Decomposition of Refractory Materials Containing Chromium. The following fluxes may be used:

- A. Fusion with KHSO₄ and extraction with hot dilute HCl. The residue fused with Na₂CO₃ and KClO₄, 3:1, or fusion with soda lime and KClO₄, 3:1.
 - B. Fusion with NaHSO, and NaF, 2:1.
- C. Fusion with magnesia or lime and sodium or potassium carbonates, 4:1.
- E. Fusion with Na₂O₃, or NaOH and KNO₃, or NaOH and Na₂O₃. Nickel. iron, copper, or silver crucibles should be used for E. Platinum may be used for A, B, or C.

Special Procedures. Materials High in Silica. The finely ground sample, 1 to 5 grams, is placed in a platinum dish and mixed with 2 to 5 cc. concentrated sulphuric acid (1.84), and 10 to 50 cc. of strong hydrofluoric acid added. The solution is evaporated to small volume on the steam bath and to SO₂ fumes on the hot plate. Sodium carbonate is added in sufficient amount to react with the free acid, and then an excess of 5 to 10 grams added and the mixture heated to fusion and kept in molten condition for half an hour. From time to time a crystal of potassium nitrate is added to the center of the molten mass until 1 to 2 grams are added. (Caution. Platinum is attacked by KNO₃, hence avoid adding a large amount at any one time.) Chromium and aluminum go into solution in the flux, but iron is thrown out as Fe(OH). The cooled fusion is extracted with hot water and filtered from the iron residue. Chromium is in solution together with aluminum. If much iron is present it should be disdissolved in a little hydrochloric acid and the solution poured into boiling 10% solution of potassium hydroxide, the cooled solution+Fe(OH), precipitate is treated with hydrogen peroxide or sodium peroxide to oxidize any chromium that may have been occluded by the iron in the first precipitate. The mixture is again filtered and the combined filtrates examined for chromium.

Sodium Peroxide Fusion. Chrome Iron Ores. One to two grams of finely pulverized ore are placed in a nickel or iron crucible of 50 to 75 cc. capacity and mixed with 5 to 10 grams of yellow sodium peroxide. (Fresh peroxide is best). The mass is gently heated over a Bunsen burner until it melts. The fusion is kept at a low red heat for about fifteen minutes. About 5 grams more of the Na₂O₂ are added and the fusion heated for about ten minutes more. The cooled fusion is dissolved in a casserole with 100 cc. to 150 cc. of water, more peroxide being added to this solution if it appears purple. The excess of peroxide is decomposed by boiling the solution, and to the caustic solution free from peroxide is added 10 to 15 grams of ammonium carbonate or a sufficient quantity of the salt to neutralize four-fifths of the sodium hydroxide present in the solution, as the strong caustic would otherwise dissolve the filter. The solution is now filtered. The insoluble matter is treated on the filter with dilute sulphuric

Determination of Chromium in a Soluble Chromate

To a concentrated solution of potassium iodide is added a known amount of the soluble chromate dissolved in a little water. The liberated iodine is now titrated with standard thiosulphate reagent.

 $N/10 \text{ Na}_2S_2O_2 = 0.001733 \text{ g. Cr.}$

Determination of Chromium in Chromite

About 0.2 g. of the powdered ore is fused with ten times its weight of Na₂O₂ in a porcelain crucible, placed inside a larger crucible. The melt is dissolved in water and the Fe(OH)₂ filtered off. The filtrate is evaporated to dryness, the residue taken up with as little water as possible and about two grams of KI added. The solution is now diluted to about 300 cc. and the liberated iodine titrated with standard thiosulphate.

 $N/10 \text{ Na}_2S_2O_3 = 0.001733 \text{ g. Cr.}$

Rapid Method for Determination of Chromium in Steel¹

Three grams of steel are dissolved in 100 cc. sulphuric acid 1 to 4. If it does not dissolve rapidly a crystal of $(NH_4)_2(SO_4)_2$ will hasten it. After solution add conc. HNO₂ until iron is oxidized. Boil for one minute, add 10 cc. 5% AgNO₂, remove from flame and add crystals of Am. Persulphate until all the chromium is oxidized as shown by the manganese being converted to Permanganate. Boil until persulphate is broken up and then add 5% sod. chloride until permanganate is destroyed as shown by the disappearance of the red color. An excess of salt sol. should be avoided. Cool thoroughly and titrate with ferous sulphate, determining the excess with permanganate. These solutions are standardized on a known sample of chrome steel.

Two determinations run simultaneously will check within .02%.

¹ Method by A. I. Appelbaum, the chemist analyst, J. T. Baker Chem. Co.





By courtesy of Arthur H. Thomas Company, Philadelphia, Pa.

Fig. 26a.—Colorimeter.

DIRECTIONS FOR THE USE OF A DUBOSCQ TYPE OF COLORIMETER

The mirror is turned so that the two halves of the field appear to be equally illuminated with the cups clean and empty. The solutions are then poured into the cups. The cup containing the standard solution is then lowered to a definite thickness of the standard solution between the bottom of the cup and the end of the plunger. With this movement the half of the field corresponding to the standard solution is seen to darken, while the other half remains luminous and colorless. If the cup containing the unknown solution is now moved in its turn, the two halves of the field are brought to the same intensity, after which the height at which the two liquid columns display this equal absorptive power is read by means of this scale. The proportion of coloring matter in two solutions is inversely proportional to the height of the two columns necessary to obtain the same intensity of illumination, thus if the standard tube is set at 10 mm., and the solution under examination is the same intensity of color at 20 mm., the latter is just one-half the concentration of the standard. This is usually expressed by the formula:

Color of test solution
Color of standard solution

Height of standard solution to be tested

If, therefore, the scale reading is 20 mm. for the standard, and 15 mm. for the solution to be tested, the formula reads: $\frac{32}{12} = 1.33$.

If, for example, the standard solution contains 4 ml. of coloring matter in 100 ml., the solution under test will be found to contain 4 x 1.33 = 5.32 ml. in 100 ml.

COBALT

W. L. SAVELL¹

Co, at.wt. 58.97; sp.gr. 8.7918; m.p. 1478°; b.p. unknown; Oxides, Co₂O₄, Co₂O₅, Co₂O₆, Co₂O₇.

DETECTION

After the removal of the elements precipitated by hydrogen sulphide from acid solution, a little nitric acid is added to the solution to oxidize to the ferric state any ferrous salts which may be present, and ammonia is added until its odor is distinctly perceptible, to precipitate iron, aluminum and chromium.² This precipitate is removed by filtration and hydrogen sulphide passed through the ammoniacal solution to precipitate cobalt, nickel, manganese and zinc. After collecting this precipitate it is washed thoroughly with cold hydrochloric acid of approximately 1.035 specific gravity, to remove manganese and zinc. A small quantity of the residue is fused with borax in the loop of a platinum wire. A blue color in the cold bead indicates cobalt. This test is masked in the presence of large quantities of nickel. In this case the residue is dissolved in hydrochloric acid to which a few drops of nitric acid have been added and the solution evaporated to dryness. The residue is redissolved in water, acidified with hydrochloric acid and the cobalt precipitated with a hot solution of nitroso-beta-naphthol in 50% acetic acid. A brick red precipitate indicates cobalt.

Potassium sulphocyanate, KCNS, produces a red color with cobalt. Alcohol and other are added to this solution and shaken. The ether layer is colored blue by cobalt. If iron is present a solution of sodium thio-sulphate, Na₂S₁O₃, is added until the red color disappears, the solution filtered and then treated with the alcohol-ether mixture.

Potassium Nitrite, KNO₂, added to a neutral or slightly acid solution containing acetic acid, will precipitate cobalt as a yellow complex nitrite having the formula K₂Co(NO₂)₆.

A solution of dicyandiamidine sulphate and sodium hydroxide added to a cobalt solution to which ammonia has been added until the odor is distinctly discernible, and containing from 10 to 20 cc. of 10% sugar solution, will change the color of the solution to red or reddish violet. If large quantities of nickel are present the color will be yellow or reddish yellow, after which the nickel will separate out in brilliant crystals, leaving the cobalt in solution, coloring it as described above.

A concentrated solution of ammonium sulphocyanate added to a cobaltous solution colors it blue. On dilution this becomes pink. Amyl alcohol or a mixture of amyl alcohol and ether 1:1, added to this and shaken, extracts this blue compound. Iron sulphocyanate, Fe(CNS), likewise colors the ether-

¹ Research Chemist, Doloro Mining and Reduction Company, Doloro, Ontario.

² If a relatively large amount of iron is present the basic acetate method of separa-

alcohol extract red, which may mask the cobalt blue. By addition of sodium carbonate solution ferric hydroxide precipitates, while the cobalt color will remain after this treatment.

ESTIMATION

Cobalt is usually estimated as metal; either reduced by hydrogen from the ignited oxide or reduced by electrolysis from an ammoniacal solution of its salts. Sometimes, however, it is estimated as oxide; usually as Co₂O₄. The reduction of the oxide by hydrogen may be carried out in conjunction with any process giving an oxide, hydroxide, carbonate, nitrate, chloride or an organic compound, as a final product.

The reduction of the metal, in solution, by electrolysis, must be accomplished in a strongly ammoniacal solution free from copper and nickel, as these metals are deposited with the cobalt on the cathode. When desirable the copper and nickel may be estimated after the electrolysis by dissolving the deposit from the cathode and proceeding in the usual manner.

Preparation and Solution of the Sample

General Procedure for Ores. The ores containing cobalt vary so widely in their chemical nature that it is difficult to lay down a method for treating all ores. However, as the principal ores contain the cobalt as a sulphide or arsenide the same general methods may be used in the majority of cases. In all cases it is necessary to prepare the sample for treatment by grinding finely. Usually either of the above ores may be brought into solution by heating with strong nitric acid or a mixture of nitric and hydrochloric acids, except silver-bearing ores, which may usually be dissolved in a mixture of nitric and sulphuric acids.

While it is desirable to use no more acid than is necessary to bring the sample into solution, an excess will not interfere, as it may be driven off by evaporation and in the event of determining the cobalt electrolytically it is essential that the solution be free from nitric acid, so that this evaporation becomes part of the procedure.

In the case of especially refractory ores or oxides of cobalt or nickel, a fusion with potassium bisulphate will usually be found sufficient as a preliminary treatment to enable it to be brought into solution. Under certain conditions, however, it has been found necessary to fuse the ore with sodium peroxide in a silver crucible, dissolving the cobalt oxide formed in hydrochloric acid. In somewhat less refractory ores of a silicious nature a preliminary fusion with a mixture of sodium carbonate and potassium carbonate with subsequent solution in hydrochloric acid or sulphuric acid, if the ore is a silver-bearing one, will be found satisfactory.

Cobalt Oxides. Cobalt oxide, gray or black, may be fused with potassium bisulphate, and the melt leached with water; or they may be treated with sulphuric acid, in which they dissolve slowly; or with hydrochloric acid, in which they dissolve more rapidly.

Metallic Cobalt, Nickel and Cobalt Alloys. Metallic cobalt dissolves readily in nitric acid, as do nickel and the ordinary cobalt alloys. There are some alloys of cobalt, however, which require fusion with sodium peroxide before they become amenable to further treatment. Among these are certain cobalt-chromium alloys.

SEPARATIONS

Separation of the Assessment Sulphide Group Containing Cobalt from the Hydrogen Sulphide Group—Mercury Lend Bismonh Copper, Cadmium arsens Antonio To. 5-32 M. Syndenum, etc.

Epirogen, sugmine passed unit a hydrochileric acid solution containing from I to I con of concentrated hydrochileric acid per 100 cc. of solution, precontates only the members of that group and silver, whereas the members of the subsequent groups remain in solution. If the solution is too acid, lead and maintain are not communicly reconstated.

Separation of the Americana Solphide Group from the Alkaline Earths and Alkaline. Americana subjects from exponence, added to a neutral court of contamination of the alkaline remains in the presence of ammonium chloride, measurements only the members of this group, the alkaline earths metals, magnesium and the alkaline remain in addition. A second precipitation should be that if many quantities of the alkaline earths or alkalines are present.

Separation of Cabalt and Nichel from Manganese. The solution of the emorates or submanes of country to nickel is mested with an excess of sodium curronarie and their made strongly and with acetic acid. About 5 grams of sodium acetics for each gram of country and with acetic acid. About 5 grams of sodium acetics for each gram of country to make present is now added, the solution times to 200 cm, and heated to about \$0.00 and saturated with hydrogen sulpinote. I much and model are precipitated as submitted and colorless ammonium summer amount when the country and model that may have passed in solution from the hydrogen subjects to an expensed. The treatment doubt to respected with the second filteria to ensure complete precipitation of the model and model.

Separation of Critical from Nickel. Among a number of methods for effecting the separation that following give good results.

- Mexic is removed from the solution by precipitation with dimethylatic name. The femals of the procedure may be found in the gravimetric methods to the telegrammation of model. A dish remains in solution.
- For the determination of model. Coloring registres in solution.

 2. I than is presuprated by intersolvers-maphthal leaving nickel in solution. Details of the procedure are given under gravimetric methods for determination of solution.
- I count as precipitated as potassium edulite-minine, mirkel remaining in some of Denals of the procedure are given under gravimetric methods for the bet-eminate of 6 south.
- Separation of Cobalt from Zina. The is yes guisted from weak acetic or forms and is due to by hydrogen subjects as one sulphake. Cobalt, nickel and manageness remain in a duto n. The feetals of the procedure are given under the methods of ferentilization of sine.

169

GRAVIMETRIC METHODS FOR THE DETERMINATION OF COBALT

Precipitation of Cobalt by Potassium Nitrite

Cobalt may be precipitated from a solution made slightly acid with an excess of acetic acid by adding a hot solution of potassium nitrite. The cobalt is precipitated as potassium cobalti-nitrite, $K_sCo(NO_s)_s$, very completely, after standing for a period of six hours in a warm place. This method has the advantage of making possible the separation of cobalt from nickel and iron, although it has the one disadvantage, for commercial purposes, of requiring a long time to complete the determination.

Procedure. After bringing the material into solution and separating the silica and members of the first and second groups in the usual manner, the solution is boiled to eliminate hydrogen sulphide. Oxidize the iron present with a little hydrogen peroxide and evaporate the solution to a syrup. Take up in a little water and neutralize with a practically saturated solution of sodium Render slightly acid with acetic acid and add an excess of 1:1 carbonate. acetic acid. Heat to almost boiling and add solution of 50% potassium nitrite containing 100 cc. of glacial acetic acid per liter, also heated to nearly boiling. This solution should be added slowly to the solution of the sample which should be agitated, preferably by rotating gently while the addition is being made. The sides of the beaker should be washed down with a 1% solution of potassium nitrite containing 1 cc. of glacial acctic acid per liter. Allow to stand for at least six hours and if possible overnight. Filter through thick Swedish filter paper without previous wetting. As this precipitate shows a very decided tendency to creep, considerable care is required to keep it well down in the apex of the filter-paper cone. Wash about ten times with the warm nitrite solution mentioned above. Transfer to a beaker by removing the filter paper from the funnel and opening it into the beaker with the outside of the paper against the This leaves it in a convenient position for washing. The bulk of the precipitate is washed off with 10 cc. of 1:1 sulphuric acid, heated to about 80° C. This should leave only a slight film of precipitate on the paper. Keep the solution in the beaker at about 80° C. to assist in dissolving the precipitate and wash the paper with the hot sulphuric acid solution five times, using about 10 cc. each time. Gradually withdraw the filter paper from the top of the beaker during the washing operation. Give the paper a final wash with hot water and squeeze the last drops from it into the beaker. Evaporate and allow to fume strongly for ten minutes. Set the beaker in a cooling trough and add water until the volume is about doubled. Neutralize and make slightly ammoniacal and then add an excess of 50 cc. of strong ammonia and electrolyze as described under Electrolysis in Reduction of Cobalt by Electrolysis, page 170.

Precipitation of Cobalt by Nitroso-beta-Naphthol 1

Nitroso-beta-naphthol, C₁₀H₆(NOH), added to a hydrochloric acid solution of cobalt, precipitates cobalti-nitroso-beta-naphthol, Co(C₁₀H₆O(NO))₃; nickel, if present, remains, in solution. The method is especially suitable for the determination of small amounts of cobalt in the presence of comparatively large

¹ Burgess, Z. Angew., 1896, 596.

train over 0.1 gram of cobalt. The corr and iron completely from solution, and but mercury, lead, cadmium, arsenic, glueinum, calcium and magnesium

the cobalt is added a freshly prepared action in 50% acetic acid, as long as a precipitation of the cobalt. The compound is allowed to the char solution decanted through a filter and the action of with cold water, then with warm 12% hydrogeness the cokel, and finally with hot water until free of

proximate science, then ignited in a weighed platinum cruter a low flame and finally at a white heat, the many a relatinum cover (Rose crucible type) with a platinum many a science of solver as the weighed as a current of hydrogen and weighed as hear to be presence of CO₂ the oxide CoO is formed.

recipitation of Cobalt by Electrolysis 1

stably deposited from an ammoniacal solution of the presence of copper and nickel these are also completely presence in case it is desired to determine the cobalt alone stable these metals from the solution before electrolysis or to exercise after electrolysis in a solution of the metallic deposit. It is usually separated before electrolysis and the nickel, if the electrolysis is estimated afterward by one of the methods given under the electrolysis and the nickel, if the electrolysis and the nickel, if the electrolysis and deposit being dissolved for this purpose.

After preparation and solution of the sample the usual sepa-Number sulphide in acid solution are made if necessary. In s recessive to pass hydrogen sulphide through the warmed solucast one hour to insure the complete precipitation of arsenic. we expet hydrogen sulphide. Add 5 cc. hydrogen peroxide to insure were compounds to ferrie state and add ammonium hydroxide until have a same to litting. Filter off ferric hydroxide and wash with water washing a small quantity of ammonium hydroxide. Redissolve and reprethe ferric hydroxide in the above manner, using a little hydrogen perment instance, until the last traces of cobalt have been removed from it, the filtrates, which should be as small as possible, to add to the main If much iven is present this is best removed as the basic acetate. the treatment of the iron precipitate has made a large adultion this may be reduced by evaporation, after which 50 cc. of ammount are added and the solution electrolyzed, using direct current of and 0.5 ampere per square decimeter. The electrodes should be mun, the anode a spiral wire and the cathode either a hollow cylinder or a sheed gaure. By agitating the solution, raising the voltage and the curCOBALT 171

rent density, the rate of deposition may be increased. In a properly agitated solution the deposition may be completed in forty-five minutes.

The current should not be cut off until the solution is tested to determine if the electrolysis is complete. This is done by mixing a drop or two of the solution from the end of a stirring rod with a few drops of ammonium sulphide. If the electrolysis is complete the mixture will remain colorless, but if some cobalt still remains in the solution the mixture will be darkened. After the electrolysis is complete the cathode is carefully removed from the solution and dipped into a beaker of clean water, after which it is washed with alcohol, preferably ethyl alcohol.

If a large number of electrolytic determinations are to be made, it is convenient to have a wide-mouthed bottle with a well-ground-in glass stopper or a cork stopper for holding the alcohol for the preliminary washing. The mouth should be large enough to receive the cathode without pouring out the alcohol. The cathode may be lowered into the alcohol in this bottle, which should only be partly filled, and then rinsed again by pouring fresh alcohol over it and allowing it to drain into the wide-mouth bottle. This allows a great many cathodes to be washed with a comparatively small quantity of alcohol. Directly after the final washing with alcohol the cathode is passed through the flame of a Bunsen burner and the alcohol ignited. After this is entirely burned off the cathode is placed in a desiccator to cool and when cool is weighed. The increase in weight of the cathode is the weight of cobalt in the sample if the solution had been free from nickel before electrolysis. If the nickel remained in the solution the increase in weight of the cathode represents the cobalt and nickel in the sample. If it is desired to determine the cobalt and nickel together the increase in weight of the cathode is divided by the weight of the sample and multiplied by 100 to obtain the percentage. If it is desired to obtain the percentage of cobalt separately, the plate is dissolved from the cathode in a few cc. of nitric acid and the nickel determined in the resulting solution by precipitation with dimethyl-glyoxime as described in the chapter on Nickel, after which the cobalt is found by difference.

Cobalt in Cobalt Oxide 1

One gram of finely ground cobalt oxide is either fused with 10 grams of potassium bisulphate or heated with 20% sulphuric acid until dissolved. If the fusion method is used the melt is extracted with water and acidified with sulphuric acid. Arsenic and copper are precipitated by passing hydrogen sulphide through the warmed solution, which should be diluted to about 200 cc. for about one hour. These are removed by filtration and the cobalt determinated by one of the above methods. The following procedure is one of the most satisfactory:

Procedure. If it is desired to determine the nickel separately, as is usually the case, this is first precipitated with dimethylglyoxime as described in the chapter on Nickel, after boiling the solution to expel hydrogen sulphide. It is then evaporated to fumes of sulphur trioxide and taken up with twice its volume of water. The free acid is neutralized with ammonium hydroxide and an excess of 50 cc. of strong ammonium hydroxide added. The solution is made up to 250 cc. and electrolyzed as under Precipitation of Cobalt by Electrolysis.

¹R. W. Landrum, Proc. Am. Ceramic Soc., 12, 1910.

Cobalt in Metallic Cobalt and Ferro-cobalt

Cobalt is usually determined in metallic cobalt and irro-cobalt by electrolysis, after separation of the elements precipitated by hydrogen sulphide in acid solution and elimination of iron, if present in large quantities. In case it is desired to estimate nickel separately it is precipitated by dimethylglyoxime as described in the chapter on Nickel, before electrolysis, taking the solution down to sulphur trioxide fumes, diluting with water and adding ammonium hydroxide in excess and electrolyzing. In case the solution is electrolyzed before separating the nickel the determination of this element may be made in the solution of the electrolytic deposit dissolved in acid, the cobalt then found by difference.

Procedure. Dissolve 1 gram of well-mixed drillings in the least possible quantity of nitric acid and add 20 cc. of 1:1 sulphuric acid. Evaporate to fumes of sulphur trioxide and allow to fume strongly for ten minutes. insures the complete elimination of nitrates, which would interfere subsequently with the electrolysis. Cool and dilute carefully with 20 cc. of water. Heat the solution to nearly boiling and pass in hydrogen sulphide for one hour to precipitate copper and arsenic. Filter and boil the solution to expel the last traces of hydrogen sulphide. Add 2 cc. of hydrogen peroxide to oxidize ferrous compounds to ferric state, and add ammonium hydroxide until slightly alkaline to litmus paper and heat to boiling. Filter off the ferric hydroxide and wash with water containing a small quantity of ammonium hydroxide. Redissolve the precipitate in a little 1:1 sulphuric acid, adding a little hydrogen peroxide to keep the iron in the ferric state, and reprecipitate in the same manner as that described above. In presence of comparatively large amounts of iron the basic acetate separation of iron is necessary, as Fe(OH), occludes cobalt and nickel. The filtrates from these precipitations are added to the main one.

In determining the cobalt in metallic cobalt it is not necessary to filter off the iron precipitate, if this is small, as it has been found by W. L. Rigg, of Deloro, Ontario, that this precipitate does not interfere with the accuracy of the determination. The iron content may be up to 5% without interfering seriously with the electrolysis.

The solution is made ammoniacal with 50 cc. of strong ammonium hydroxide and electrolyzed as described above.

Cobalt in Metallic Nickel

The cobalt in metallic nickel may be determined by precipitation with potassium nitrite from a solution of the sample containing an excess of acetic acid. The precipitate is filtered off and dissolved in hot sulphuric acid solution, after which the solution is evaporated to fumes of sulphur trioxide and carefully diluted. The excess of acid is neutralized and made strongly ammoniacal with ammonium hydroxide. The solution is then electrolyzed as previously described.

Procedure. Dissolve 5 grams of thoroughly mixed drillings in a minimum quantity of nitric acid. Evaporate to a syrup. Care must be exercised at this point to prevent evaporating too far and decomposing the nitrates. Dissolve in 50 cc. of water. Neutralize with a practically saturated solution of sodium carbonate. For this purpose a dropping bottle is very convenient. Render slightly acid with acetic acid and add an excess of 10 cc. of 1:1 acetic acid. Heat

COBALT 173

to almost boiling and add 10 cc. of a 50% solution of potassium nitrite to which has been added 10 cc. of glacial acetic acid per 100 cc. of solution. This solution must also be nearly boiling and should be added while gently rotating the nickel solution. Wash down the sides of the beaker with a 1% solution of potassium nitrite containing 1 cc. glacial acetic acid per liter. Allow to stand for at least six hours and preferably overnight. Filter through a thick, 9-cm. filter paper without previous wetting. Considerable care is required to keep the precipitate well down in the apex of the filter paper cone, as it creeps very badly. Wash about ten times with the warm nitrite solution mentioned above. Lift gently from the funnel and open the filter paper into a beaker. Lay the paper against the side of the beaker with the outside against the glass. This leaves the paper adhering to the side of the beaker in a most convenient position for washing. Wash down as much of the precipitate as possible with about 10 cc. of 1:1 sulphuric acid solution, heated to about 80° C. This should leave only a slight film of precipitate on the paper. Keep the solution at about 80° C. and wash the paper five times with the warm sulphuric acid solution, using about 10 cc. each time, gradually withdrawing the paper from the top of the beaker. Give a final wash with hot water and squeeze the last drops from the filter paper into the beaker. Evaporate and allow to fume strongly for ten minutes. Add water in a cooling trough until the volume is about doubled. Neutralize with ammonium hydroxide and add an excess of 50 cc. of strong ammonium hydroxide and electrolyze as described in Precipitation of Cobalt by Electrolysis.

Cobalt in Ores and Enamels 1

The determination of cobalt in ores and enamels is usually made by a slight variation of the above methods. The silica is separated in the usual manner by taking down to dryness with hydrochloric acid and the warmed solution is treated with hydrogen sulphide to precipitate sulphides insoluble in acid solution. Aluminum, chromium and iron are precipitated by adding ammonium hydroxide to the oxidized solution. In the enamel industry it has been the practice to follow R. W. Landrum's method, in which the cobalt, manganese and nickel are precipitated together as sulphides and filtered off. The manganese is dissolved from this precipitate with cold hydrogen sulphide water acidified with one-fifth its volume of hydrochloric acid (sp.gr. 1.11). The residue of cobalt sulphide is burned in a porcelain crucible, dissolved in aqua regia and evaporated with hydrochloric acid. The platinum and copper, if they are present, are thrown down by passing hydrogen sulphide through the solution. The filtrate is made ammoniacal and the cobalt is precipitated with hydrogen sulphide. This is filtered off and washed with water containing a small quantity of ammonium sulphide. The precipitate is either ignited and weighed as oxide or reduced in hydrogen to metallic cobalt, taking care to cool it thoroughly in an atmosphere of hydrogen before allowing it to come into contact with the atmosphere of the room, as finely divided cobalt is decidedly pyrophoric and oxidizes readily, particularly if reduced at a low temperature.

Instead of igniting the sulphide precipitate it may be dissolved in hot 1:1 sulphuric acid solution with the aid of a little nitric acid and treated as described under Precipitation of Cobalt by Electrolysis.

¹ R. W. Landrum, Trans. Am. Cer. Soc., 12, 1910.

Cobalt in Steel

This determination is a modification of the nitroso-beta-naphthol method already described, as worked out in the laboratory of the Firth Stirling Steel Company, McKeesport, Pa. The procedure as described by Mr. Giles, Chief Chemist, is as follows.

Two grams of the sample are weighed into a 500-cc. Erlenmeyer flask and dissolved in 50 cc. of concentrated hydrochloric acid. When the sample is completely decomposed 10 cc. of concentrated nitric acid are added to oxidize the iron, tungsten, etc. The solution is evaporated to 10 cc.; 50 cc. of water are added: the contents of the flask are then transferred to a 500-cc. volumetric flask and cooled to room temperature. A fresh solution of zinc oxide is added in slight excess, the contents of the flask diluted to the mark, well mixed, transferred back to the original Erlenmeyer flask and allowed to settle. Filter 250 cc. (equivalent to 1 gram of the sample) through a dry filter paper, transfer it to a 500-cc. flask, then add 6 cc. of concentrated hydrochloric acid.

The solution, which should now be between 300 and 350 cc. in volume, is, heated to boiling and 10 cc. of freshly prepared solution of nitroso-beta-naphthol (1 gram of salt to 10 cc. glacial acetic acid) are added for each 0.025 gram of cobalt present. Continue to heat for two minutes, remove from plate, shake well, and set aside until the bright red precipitate settles, which will only take a few minutes. Filter the hot solution and wash the flask out with hot 1:1 hydrochloric acid and then wash the flask out with hot acid of the same strength. Wash the paper alternately with hot (1:1) hydrochloric acid and hot water until it has been washed five times with the acid, then wash ten times with hot water. The precipitate is transferred to a quartz or porcelain crucible, heated gently to expel the carbonaceous matter, then at a high temperature until ignition is complete. After cooling the crucible is weighed and the weight of the residue (Co₂O₄) is multiplied by 0.734 to obtain the percentage of cobalt present. If desired the Co₂O₄ may be reduced in hydrogen and weighed as metal.

COBALT 175

Volumetric Methods for the Determination of Cobalt

Perborate Method. Nickel and cobalt are oxidized to trivalent oxide or hydroxides by various oxidizing agents but neither the cobalt and nickel salts of the trivalent metals are stable. Both the trivalent hydroxides liberate iodine when treated with acids and potassium iodide and form the nickelous or cobaltous salts, e.g.,

$$Co(OH)_2 + KI + 3HCl = CoCl_2 + I + KCl + 3H_2O$$
.

Cobalt is more readily oxidized than nickel and when oxidized, forms the more stable compounds. Cobaltic hydroxide may be formed by treating the sulphate with potassium hydroxide and hydrogen peroxide while nickel is not affected even on boiling with these reagents. This procedure, however, has not been satisfactory as a method of analysis on account of the difficulty of removing the excess hydrogen peroxide which persists in the precipitate even after boiling and prolonged washing.

After some rather extended tests, W. D. Engle and R. G. Gustavson have found that the differential oxidation may be very satisfactorily accomplished by means of sodium perborate in the presence of potassium hydroxide and the excess of this oxidizing agent readily decomposes on boiling. Advantage is then taken of the reaction stated above and the iodine liberated is titrated with a standard sodium thiosulphate solution.

Procedure. The ore, metal or other material may be dissolved with acids or brought into solution by any of the usual methods and the metals of the Cu and Fe groups including manganese removed in the usual way. solution so obtained may contain nickel, cobalt, zinc and the metals of the alkaline and alkaline earth groups, but must be free from any substances capable of liberating iodine from an acid solution of potassium iodide. In some cases, it is desirable to precipitate Fe by means of zinc oxide or zinc hydroxide emulsion, making up the mixture so obtained containing the emulsion to a certain volume and after allowing the precipitate to settle, filtering aliquot portions and treating as described. This solution with a volume of about 100 cc. is made acidified with dilute H₂SO₄ using about 5 cc.'s excess (1:5) and then adding one or two grams of dry sodium perborate. Sodium hydroxide is added to a strong alkaline reaction. The mixture is boiled for ten minutes to decompose the excess of perborate. This solution is then cooled to room temperature and after one gram of potassium iodide is added, acidified with dilute H₂SO₄ the potassium iodide slowly reduces the cobaltic hydroxide liberating iodine. Any attempt to hasten the determination at this point will cause low results as cobaltic hydroxide itself is not readily soluble and must be reduced to the cobaltus form before going into solution. This reduction consequently takes place very slowly and care must be exercised to make certain that all the precipitate has been entirely dissolved before the titration is attempted.

176 COBALT

After the complete solution of the precipitate, the liberated iodine is titrated with standard solution of sodium thiosulphate, using starch paste as an indicator in the usual manner.

As it is somewhat difficult to obtain cobalt compounds of known cobalt content, the sodium thiosulphate solution may be standardized by means of potassium bichromate in the usual manner and the factor for cobalt calculated from this determination.

Since one $K_2Cr_2Q_7=6I=6Co$, then the potassium bichromate factor of the solution multiplied by 1.2027 gives its cobalt factor.

WILFRED W. SCOTT and W. G. DERBY.

Cu, at.wt. 63.57; sp.gr. 8.89^{20°}; m.p. 1083 (in air 1065); b.p. 2310; oxides CuO and CuO.

DETECTION

Copper is precipitated in an acid solution by H₂S gas, along with the other members of the hydrogen sulphide group. The insolubility of its sulphide in sodium sulphide is a means of separating copper from arsenic, antimony, and tin. The sulphide dissolves in nitric acid (separation from mercury) along with lead, bismuth, and cadmium. Lead is precipitated as PbSO₄ by sulphuric acid and bismuth as the hydroxide, Bi(OH)₁, upon adding ammonium hydroxide. Copper passes into the filtrate, coloring this solution blue,

 $Cu(OH)_2 \cdot 2NH_4OH \cdot (NH_4)_2SO_4$.

Flame Test. Substances containing copper (sulphides oxidized by roasting), when moistened with hydrochloric acid and heated on a platinum wire in the flame, give a blue color in the reducing flame and a green tinge to the oxidizing flame.

Wet Tests. Nitric acid dissolves the metal or the oxides (sulphides should be roasted), forming a green or bluish-green solution. Ammonium hydroxide added to this solution will precipitate a pale blue compound, which dissolves in excess with the formation of a blue solution. (Nickel also gives a blue color.)

Hydrogen sulphide passed into a copper solution which is free of SO₂ or an oxidizing agent, but somewhat acid with a mineral acid, precipitates at once brownish black CuS or Cu₂S (distinction from nickel, cobalt and zinc), which is difficulty soluble in strong, hot HCl (distinction from antimony), insoluble in fixed alkaline polysulphides (distinction from gold and platinum), soluble in alkaline cyanides (distinction from lead, bismuth, cadmium, mercury and silver), soluble in nitric acid (distinction from sulphide of mercury), with production of a bluish solution (distinction from all other metals except silver).

Potassium ferrocyanide precipitates from an acid or neutral solution of a cupric salt reddish-brown cupric ferrocyanide, which can be confused only with similarly colored precipitates from molybdenum or uranium solutions.

Cupric salts in halogen acid solution are reduced to colorless cuprous compounds by metallic copper, stannous chloride and sulphurous acid; and in alkaline solution are reduced by grape sugar, arsenious or sulphurous acids.

ESTIMATION

The estimation of copper is required in the following substances: In ores1

¹ Ores, copper pyrites, chalcopyrite, Cu²S·Fe²S³; copper glance chalcocite, Cu²S (gray to bluish-black); malachite, CuCO₃·CuOH·H²O (green); azurite, 2CuCO₃·CuOH·QO (blue); cuprite, red copper, Cu²O; malaconite, CuO (black); dioptase, CuOSiO₂H²O (green vitreous); atacamite, CuCl₂3Cu(OH)₂; bornite, Cu₃FeS₃; brochantite, 4CuO·SO₃·3H₂O; corellite, CuS; crysocolla, CuO·SiO₂·2H₂O; tetrahedrite, 4Cu₂S·Sb₂S₁; termantite, 4Cu₂S·As₂S₃; olirenite, 4CuO·As₂O₃·H₂O.

of copper, in which it occurs as native copper or combined as sulphide, oxide, carbonate, chloride, silicate and basic sulphate. In furnace slags, mattes, concentrates, blister copper, bottoms. The determination of copper is required in the analysis of alloys containing copper, brass, bronze, etc. It is occasionally looked for as an undesirable impurity in food products. It is determined in salts of copper, in insecticides, germicides, etc.

Preparation and Solution of the Sample

Hydrochloric and sulphuric acids are effective in dissolving metallic copper only in presence of an oxidizing agent; nitric acid is the most active solvent. The oxides of copper may be dissolved in hydrochloric or sulphuric acid, but nitric acid is commonly used. Some refractory furnace products are with most certainty decomposed by treatment with hydrofluoric and fuming sulphuric acid followed by a bisulphate fusion.

Ores. If the ore consists practically of a single mineral, the fineness of the sample need not exceed 80 mesh. If the ore is a mixture of minerals, lean and rich in copper, the laboratory sample should pass a 120-mesh sieve.

Metallic particles or masses are separated at some stage in the process of sampling and made into a separate sample. If the metallic portion is a small percentage of the total sample and consists of particles, the copper value of which is known to vary by a few percent, no attempt is made to refine the sample of such, but a large portion, 10-100 grams, is taken for analysis and the copper determined in an aliquot part of the solution. If the metallic masses are a large percentage of the sample, large of size, or consisting of particles differing widely in copper content, a weighed amount of 1 to 50 lbs. is melted in a graphite crucible, with addition of suitable fluxes, such as powdered silica or lime, if necessary. Separate samples are made of the weighed products of the fusion and the copper content of the material before melting calculated from their analyses. amount of sample taken for assay depends upon the richness of the ore, homogeneity of the material and the commercial importance of the determination. As a rule in the assay for purchase and sale, a 1 gram test portion is taken of finely pulverized samples containing over 20% copper, 2 to 3 grams of 30% ores and 5 grams of ores containing less than 10% copper.

Sulphide Ores and Matte. One to five grams of the sample are dissolved by adding 10-20 cc. dilute nitric acid (1.2 sp.gr.), or 10 cc. strong nitric acid saturated with potassium chlorate, and allowing the mixture to stand in a warm place for about 15 minutes before applying heat. Decomposition is completed by evaporating to small volume in a casserole and continuing to dryness after addition of 10 cc. hydrochloric acid, or by adding 5-10 cc. 50% sulphuric acid, to the assay in a flask or tall beaker and heating to fumes. Continuing the first procedure, the residue is taken up by warming with 20 cc. 10% H₂SO₄, diluting, boiling and filtering the residue of silica, lead sulphate and silver chloride from the copper solution. Continuing the second procedure, the mass of anhydrous salts are dissolved with water, silver dissolved by just sufficient NaCl solution if the determination is to be by the electrolytic method, and the solution filtered; after it has reached room temperature when the per cent of silver present is high.

Oxidized Ores with the exclusion of details relating to the oxidation of sulphur are brought into solution by the same method of treatment as sulphide ores.

Notes. The sulphur that appears upon adding acid to the ore, with proper precautions, should be yellow. If it is dark and opaque, the solution has been overheated, and some of the ore has been occluded. It is advisable in this case to remove the globule of sulphur and oxidize it separately with bromine and nitric acid, then boil out the bromine and add the solution to the rest of the sample.

boil out the bromine and add the solution to the rest of the sample.

Sulphide ores may be treated according to the procedure recommended for iron pyrites in the chapter on Sulphur, the ore being decomposed with a mixture of bromine and carbon tetrachloride, 2:3, followed by nitric acid and then sulphuric acid.

Treatment of Matte Slag. Only by quick quenching of the molten slag is decomposition of the sample by acids made possible, without preliminary treatment with hydrofluoric acid. As a rule lime slags are readily decomposed by mixed acids. Extremely acid, and high iron slags are apt to be refractory and are decomposed with most certainty by treatment with hydrofluoric acid followed by fusion with potassium bisulphate.

The following scheme¹ of attack, which also can be applied to silicious ores,

with skilful manipulation gives very satisfactory results:

One gram of the 100 mesh fine slag is placed in a 250 cc. beaker of Jena glass, moistened with water, mixed with 3 cc. of sulphuric acid (sp.gr. 1.54), and then, while the particles of the slag are in suspension through rotary movement of the beaker, 15 cc. hydrochloric acid are added. The silica is gelatinized in 2 or 3 minutes by heating the beaker over a free flame. One cc. nitric acid followed by a few drops of hydrofluoric acid are added, and the heating continued in a hood until the material is nearly dry, and then to strong sulphuric acid fumes on a hot plate. When cool, 4 cc. of sulphuric acid are added.

The remainder of the procedure depends upon the method that is to be followed in the determination of copper. If the electrolytic method is preferred, 3 cc. of nitric acid are added; the mass heated until solution is effected, the liquid diluted to 175 cc. with cold, distilled water, and copper plated out in 20-35

minutes, using a rotating anode and 2½ amperes current.

If the iodide method is to be followed, without addition of other acid than sulphuric, the mass is again heated to fumes. When cooled, 25-30 cc. water and 5 cc. hydrochloric acid are added and the liquid boiled until clear. After addition of 40 cc. saturated solution of sodium acetate, $4\frac{1}{2}\%$ solution of sodium fluoride is added until the color of ferric acetate is discharged, and then an excess of 10 cc. When cold, titration is commenced, using a thiosulphate solution with a copper equivalent of 0.0005 g. per cc.

The following quick method has been systematically and satisfactorily checked for a long period by a hydrofluoric acid-bisulphate fusion method, by which copper, precipitated as a sulphide, is ignited, the oxide dissolved in nitric acid and

copper determined by electrolysis.

Three grams of the 100 mesh fine sample are placed in an 800 cc. resistance beaker. The slag is spread over the bottom of the beaker, and while in motion 5 cc. of sulphuric acid are added rapidly to prevent the slag gathering into a mass. After addition of 40 cc. hydrochloric acid, the beaker is heated over a bare flame for about 3 minutes until the silica has gelatinized. To the hot

¹ White, Chemist Analyst, July, 1912.

solution nitric acid is added, drop by drop, until the liquid becomes dark brown. To the liquid, while in a state of agitation, 1-2 cc. hydrofluoric acid are added and the mixture boiled until the solution is complete. The liquid is diluted to 400 cc. and saturated with hydrogen sulphide and the precipitate filtered and washed as usual. The copper sulphide is ignited in a silica crucible; the residue, if washing of the precipitate has been thorough, can be brushed into a 250 cc. beaker and dissolved with a few cc. of nitric acid. After boiling gently to expel nitrogen gases, the free acid is neutralized with ammonia, and the solution then acidified with a slight excess of acetic acid. The cold solution is titrated by the iodide method, using a thiosulphate solution having a copper equivalent of about 0.0005 g. per 1 cc.

Metals. A casting of a copper alloy and even of refined copper is not homogeneous, and the zones of segregation of the constituents of the alloy (usually roughly parallel to the cooling surfaces) are the more sharply defined as the conditions which favor diffusion of the eutectic prevail, therefore, unless the casting be quite thin and quickly cooled, a satisfactorily representative sample of it cannot be obtained from a single drill hole. A single casting may be sampled by complete cross-sectional cuts by a suitable saw or by a series of drill holes located in such a manner as to amount substantially to one or more cross-sectional cuts. Steel is usually present as a contaminant of the drill or saw shavings from refined copper and the tougher alloys and should be removed by a magnet. Crude copper, such as blister or black copper, is sampled by drilling one hole in each piece of a definite fraction of the total pieces of the average lot. of the hole in successive pieces is changed to conform with a pattern or "templet" which will cover a quarter, or half, or the complete top surface of the average piece, the "templet" is divided into squares, preferably about 1 inch on a side, and in the centre of each square the \frac{1}{2}-inch hole is drilled. drillings are ground to pass a 20-mesh screen and the sample then withdrawn by means of a riffle sampler.

Sampling by splashing a molten stream with a wooden paddle and by slowly pouring the metal into water are methods frequently practiced. The size of the particles, the degree of homogeneity and the limit of accuracy of result required are factors which determine whether one or more grams of the sample should be taken for analysis.

Iron Ores and Iron Ore Briquettes. A 5-gram sample of the finely divided material is fused in a large platinum dish with 40 grams of pure potassium bisulphate. If the ore is high in sulphur, it should be roasted by heating to redness in a silica or porcelain crucible before placing in the platinum dish and mixing with the bisulphate.

The cooled fusion is broken up into small pieces and placed in an 800-cc. beaker with clock-glass cover. Three hundred cc. of hot water and 25 cc. of strong hydrochloric acid are added and the fusion is boiled until it passes into solution. If an appreciable residue remains, the solution is filtered, the residue fused with additional bisulphate, then dissolved in hot dilute acid and the filtrate added to the first solution. Silica and barium sulphate remain in the residue.

The solution is now reduced and copper precipitated according to directions given under "Separation of Copper by Precipitation in Metallic Form by a more Positive Element," aluminum powder being preferably used.

The precipitated copper is filtered free from iron and other commonly occurring impurities, then dissolved by pouring on the precipitated metal 30 cc. of hot dilute nitric acid, 1:1, followed by 10 cc. of bromine water and then 10 cc. of hot water. The filter paper is removed, ignited and the ash added to the copper solution. The whole solution is now evaporated to small volume and determined, preferably, by the "Potassium Iodide" method as described under the volumetric procedures.

Steel, Cast Iron, and Alloy Steels. From 3 to 5 grams of steel, depending upon the amount of copper present, are dissolved in a mixture of 60 cc. of water and 7 cc. of sulphuric acid (sp.gr. 1.84) in a 250-cc. beaker. After all action has ceased, a strip of sheet aluminum, 1½ ins. square, bent so that it will stand upright in the beaker, is placed in the solution.

After boiling the solution for twenty to twenty-five minutes, which is sufficient to precipitate all of the copper in the sample, the beaker is removed from the heat and the cover and the sides washed down with cold water. The liquid is decanted through an 11-cm. filter, the precipitate washed three times with water, then placed with the filter in a 100-cc. beaker, and 8 cc. of concentrated nitric acid and 15 cc. of water are poured over the aluminum and the solution heated to boiling. This hot solution is poured over the precipitate and filter in the 100-cc. beaker, and boiled until the paper becomes a fine pulp, only a few minutes being required. The solution is filtered, the residue washed several times with hot water and copper determined in the filtrate by the electrolytic or iodide methods.

SEPARATIONS

Separation of Copper as Cuprous Thiocyanate. Isolation of copper from solutions containing iron, nickel, cobalt, zinc, cadmium, arsenic, antimony and tin may be accomplished by this method. When much arsenic is present, precipitation should be from a solution in which hydrochloric is the only free strong acid. Unless previously removed from the solution, lead, mercury, tellurium and the precious metals will contaminate the precipitate. Selenium may be a contaminant when present in considerable quantity, sometimes when the only free acid is sulphuric, always when hydrochloric acid is present.

Cuprous thiocyanate, besides being the medium of separation of copper from interfering elements preliminary to its determination by the standard electrolytic, iodide or cyanide methods, is the basis of a number of other more or less useful gravimetric and volumetric methods of determining copper. The details of the procedure of procuring the precipitate vary to some extent with its object.

When the intention is to secure in the precipitate substantially all the copper from the solution, the procedure in the main is as follows: To the cold, concentrated and very slightly acid copper solution which must be free of any oxidizing agent, sulphur dioxide, gaseous or in solution, or a solution of an alkaline bisulphite or metabisulphite is added somewhat in excess of the quantity theoretically required to reduce all the copper and ferric iron present, or until saturation of the liquid with SO₂.

¹ W. B. Price, Jour. Ind. Eng. Chem., Vol. 6, No. 2, p. 170,

Cool the liquid if hot through the formation of H_2SO_3 , and add then with constant stirring a solution of alkali thiocyanate of about normal strength until precipitation ceases. Reaction is $2CuSO_4 + 2KCNS + H_2SO_3 = 2Cu-CNS + 2H_2SO_4 + K_2SO_4$. It is common practice to continue introduction of SO_2 throughout precipitation. Let the precipitate stand until it is white and the liquid above it is clear. The presence of FeSO₄ accelerates conversion of cupric to cuprous thiocyanate when sulphuric is the only free acid. Filter with the aid of reduced pressure through doubled filter papers of tight texture. Wash with cold water until a washing is obtained which gives no or very slight indication of thiocyanate when tsted with a ferric salt.

The precipitate is inclined to float and creep with the capillary film of fluid, so precautions must be taken in its manipulation to avoid loss of copper on account of this characteristic.

The collected precipitate may now be treated in several ways which will produce a solution fit for the determination of copper by one of the standard (a) Transfer the filter and precipitate to a porcelain or silica crucible which is very much larger than the volume of the wet precipitate, dry slowly in an oven or muffle and finally incinerate. Some operators made the final washing with 20% alcohol to facilitate drying or with a weak solution of an alkali nitrate to aid incineration. Dissolve the residue in the crucible with hot, strong nitric acid. (b) The point of the filter is punctured and the precipitate washed with as little water as possible into a flask or tall beaker. The filter is finally cleansed of adherent precipitate by washing with dilute nitric acid. The filter is dried, incinerated and dissolved separately or added to the main precipitate before its decomposition. Add 15 cc. strong nitric acid for each gram or fraction of a gram of copper present and let the covered beaker or funnel-closed flask stand in a warm place until the precipitate is dissolved, then boil until solution is free of the nitrogen gases. It is the practice of some to add now 10-15 cc. sulphuric acid and evaporate to fumes. Because evolution of gas during dissolution of the precipitate is profuse, care must be taken to expel the gas slowly to prevent boiling over.

The method as described is rather tedious in its operation and therefore is commonly carried out with modifications which may include: Employing a mixture of the precipitating and reducing agents (for instance, 25 grams alkali thiocyanate with an equal or larger amount of alkali bisulphite in a liter solution); quickening settlement of the precipitate by letting the assay stand in a warm place or even bringing the fluid to boiling; filtering through asbestos, alundum or porous stoneware; washing with hot water. Some of these modifications yield a certain amount of copper to the filtrate because of the appreciable solubility of cuprous thiocyanate in warm or hot water. Consistent with the value of the determination, the amount so dissolved is disregarded, accounted for by an empirical correction, or recovered by expelling SO₂ and concentrating filtrate and washings by boiling, precipitating with H₂S and determining copper, usually by a colorimetric method.

Separation of Copper by Precipitation in Metallic Form by a More Positive Element. Metallic aluminum or zinc is more commonly used in this procedure. A strip of pure aluminum or zinc, placed in the neutral or slightly acid solution, causes the complete deposition of copper. To obtain quick precipitation, a sheet of aluminum, 2.5 by 14 cm., is bent to form a triangle, placed in a covered 150 cc. beaker containing the copper solution, which should be not much over 75 cc. in volume and should hold about 10% free H₂SO₄. Boil 7-10 minutes. (Low, "Technical Methods of Analysis.") The copper is removed mechanically from the displacing metal and dissolved in nitric acid and then estimated, or the aluminum may be dissolved with the copper.

A method of precipitation by means of powdered aluminum is recommended especially for separation of copper from large amounts of iron, iron ores and iron ore briquettes. The solution of the bisulphate fusion of the iron ore is heated until bubbles appear over the bottom of the containing beaker. Aluminum powder is now added in small portions at a time, in sufficient quantity to reduce the iron, the solution becoming colorless. The solution is now heated until the aluminum completely dissolves. Metallic copper is precipitated. It is advisable to add 25 cc. of water saturated with H₂S gas to precipitate traces of copper in solution. The solution is filtered while hot through a close thick filter, and washed six times, keeping the residue covered with water to prevent oxidation by air. The copper is now dissolved in hot dilute nitric acid, evaporated to small volume and determined by the procedure preferred. The potassium iodide method gives excellent results.

Separation of Copper from Members of the Ammonium Sulphide and Subsequent Groups by Precipitation as Copper Sulphide in Acid Solution. The solution containing free hydrochloric or sulphuric acid is saturated with H₂S gas, the precipitated copper sulphide (together with the members of the group), is filtered and washed, first with water containing H₂S and finally with a little pure water. The residue is dissolved in nitric acid and the resulting solution examined for copper.

Removal of Silver. This element is precipitated as the insoluble chloride, AgCl, by addition of hydrochloric acid, and may be removed by filtration, copper passing into the filtrate.

Removal of Bismuth. Upon adding ammonium hydroxide to a solution containing copper and bismuth the latter is precipitated as Bi(OH), and may be removed by filtration. Copper passes into the filtrate as the double ammonium salt. Ammonium carbonate or potassium cyanide may be used instead of ammonium hydroxide.

Removal of Lead. Lead is precipitated by sulphuric acid as PbSO₄ and may be removed by filtration, copper passing into the filtrate.

Removal of Mercury. The sulphide of mercury remains undissolved when the precipitated sulphides are treated with dilute nitric acid, copper sulphide dissolving readily.

Removal of Selenium and Tellurium. Selenium can be eliminated from a copper solution by evaporating several times to dryness with hydrochloric acid. Saturation with SO₂ of a slightly acid sulphate of copper solution which contains about twice as much silver as selenium and boiling then to expel most of the gas, will precipitate selenium and tellurium free of copper, also nearly all the silver. Precipitation of the remainder of the silver as AgCl helps to retain the fine precipitate on the filter.

Removal of Arsenic, Antimony, Tin, Selenium and Tellurium. Copper in minor quantity may be separated from these elements by passage of H₂S into the solution made slightly alkaline with sodium hydrate; after addition of about a gram of tartaric acid if iron is present. Copper sulphide remains insoluble also when the mixed sulphides precipitated from an acid solution are treated with a hot mixture of sodium sulphide and hydrate. These elements in minor quantity, whose presence in the electrolyte for copper determination is an objectionable impurity, are removed very satisfactorily by adding enough ferric iron to the solution to make the total iron present about twenty times that of the combined impurity, making ammoniacal and filtering after settling. Some copper is retained in the precipitate. Moderate amounts of arsenic may be eliminated as arsenious fluoride by the method employed to expel silica from an assay. Oxidizing agents must not be present.

In an alloy tin and antimony may be precipitated as oxides by evaporation of the solution of the alloy with strong nitric acid. A slight amount of copper

may remain insoluble.

Separation from Cadmium. The sulphides in a solution of dilute sulphuric acid, 1:4, are boiled and H₂S gas passed in for twenty minutes, the solution being kept at boiling temperature. Cadmium sulphide dissolves while copper sulphide remains unaffected. The solution is filtered hot, the air above the filter being displaced by CO₂ to prevent oxidation. Traces of cadmium are removed by repeating the operation. (Method by A. W. Hofmann.)

GRAVIMETRIC DETERMINATIONS OF COPPER

Determination of Copper as Cuprous Thiocyanate

The precipitated cuprous thiocyanate, collected in a Gooch crueible is dried to constant weight at a temperature under 150° C. CuCNS decomposes at a somewhat higher temperature. Theoretically the weight of this compound multiplied by 0.5226 gives the equivalent elementary copper; in practice an empirical factor determined by investigation of the conditions of precipitation and manipulation, should be employed.

Determination as Copper Oxide²

The solution, free from ammonium salts and organic matter, is heated to boiling in a porcelain dish and pure potassium hydroxide solution added, drop by drop, until a permanent precipitate, dark brown in color, is formed. The solution is alkaline to litmus-paper. The precipitate is washed by decantation, transferred to the filter and washed with hot water free of alkali. The precipitate and filter are ignited in a porcelain dish, first gently and finally with the full heat of a Bunsen burner. The residue is weighed as CuO.

$$CuO \times 0.7989 = Cu$$
.

¹Copper may be precipitated as the sulphide by nearly neutralizing the free acid with sodium hydroxide, warming the solution and adding crystals of sodium thiosulphate. Upon boiling black sulphide of copper is precipitated together with free sulphur.

² "Analytical Chemistry," Treadwell and Hall,

Deposition of Metallic Copper by Electrolysis

The electrolytic method of determining copper is the most accurate of the gravimetric methods. This deposition may conveniently be made from acid solutions containing free nitric or sulphuric acid) or from an ammoniacal solution.

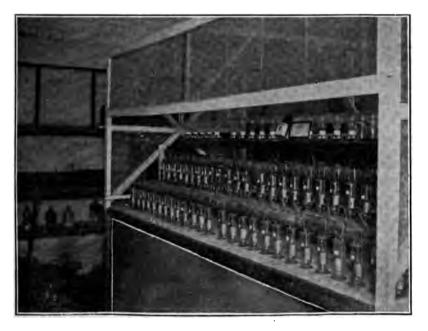


Fig. 27.—Terminal Case Showing Battery of Electrodes for Electrolytic Deposition of Copper.

The end sought by this method is to plate out all, except a trace, of the copper in the form of an evenly distributed, firmly adherent, very finely crystal-line deposit, which is free from a weighable amount of impurity.

In ores, mattes, alloys (from which lead has been removed as the sulphate by taking the solution to fumes with sulphuric acid) deposition by electrolysis, from a solution containing free sulphuric acid, is convenient. On the other hand, deposition from a nitric acid solution is advantageous under conditions where this reagent has been used as a solvent and evaporation with sulphuric acid is unnecessary. This is the case in the analysis of certain alloys and the determination of copper from which impurities have been largely removed. A chloride in an acid solution gives rise to a spongy deposit of copper, and endangers a solvent action on the anode and deposition of platinum on the cathode.

Conditions other than the presence of precipitable impurities, which affect the character of the deposit are—quantity and concentration of copper, size and shape of electrodes, current density, uniformity of distribution of current to the cathode, volume, temperature and rate of circulation of the electrolyte, and concentration of oxidizing agents such as nitric acid and ferric salts. Inasmuch as the change of one condition limits or makes possible or necessary a modification of others, a large number of practicable combinations of conditions are possible. For discussion of these conditions reference is made to articles by Blasdale and Cruess, Jour. Am. Chem. Soc. Oct. 1910, 1264; and by Richards and Bisbee, Jour. Am. Chem. Soc., May, 1904, 530.

By the feature of rate of deposition, electrolytic methods may be classified as "slow" or "rapid." The slow methods, with 12 to 24 hour periods of electrolysis, are practiced when extreme accuracy is required, or when the distribution of laboratory labor and time allowed for completion of the assays permit their economical employment. The electrolyte is a solution of sulphate salts of the metals present, ammonium sulphate or nitrate, and a quantity of free nitric acid, which varies with the amount of copper and ferric salts present, and the current density employed. The oxidizing effect of nitric acid is intensified by the presence of ferric ions. Electrolysis is carried out at room temperature, at current densities varying from ND/100, 0.15 to 0.5 amperes; and deposition on plain, corrugated, slit or perforated platinum cylinders from 0.75 to 2 in. diameter having 50 to 200 cm. depositing surface. A perforated cylinder permits freedom of circulation between the two surfaces of the electrode, the most even distribution of current density, and produces the most uniform coating of the foil. On account of the effect on the character of the deposit by oxygen lodging in regions of the cathode where the current density and circulation is least, the anode should be of such a form that all the gas liberated will be in the zone of maximum circulation. To procure uniform behavior under given conditions the size and shape of the electrolytic beaker should be such as to present the smallest practicable volume of electrolyte between the outer surface of the cylinder and the inside of the beaker. An unclosed seam or rivetted joint in a negative electrode will hold tenaciously salts which require extreme care to remove. It is probable that such recesses retain traces of the electrolyte underneath the coating of copper.

Rapid methods have a tendency to procure high results, resolution and mechanical loss through misting having been prevented. Deposition is hastened by increasing the rate of circulation and the current density. Circulation is

¹ Larison, Eng. and Min. Jour. 84, 442. Fairlie and Boone, Elect and Met. Ind. 6, 58.)

187


promoted by the use of the gauze cathode, by rotating either cathode, or by placing the vessel, containing the solution and electrodes, in a field of electromagnetic force. Quick deposition of a quality satisfactory for some classes of work is brought about by increase of current density upon an electrolyte heated to 50° to 80° C. In all the quick methods, the progress of electrolysis should be watched, and the cathode removed as soon as completion of deposition is detected by the evolution of gas about its surface. The completion of action is ascertained with greater certainty by addition of water to the electrolyte and observing whether the newly exposed surface of the cathode remains bright. When the electrolyte is hot or has a high acid content, detachment of the cathode should be preceded by removal of the electrolyte and simultaneously washing the cathode without interruption of the current. A syphon may be employed, water being added as the liquid drains from the beaker until the acid is removed.

RAPID METHODS

Rapid Deposition of Copper-Solenoid Method of Heath 4

The solenoid is made by winding 500 turns of No. 13 B and S gauge magnet wire upon a copper cylinder $2\frac{3}{4}$ in. in diameter, $3\frac{1}{4}$ in. high, $\frac{3}{32}$ in. thickness of

The cylinder is metal. brazed water tight at the bottom to a 5½ in. disc of $\frac{3}{32}$ in. soft steel. In this disc is a 1-in. hole for the insertion of a rubber plug. through which glass tubes may be inserted for inlet and outlet of air or water to cool the electrolytic beaker. A steel disc of the same size as the bottom and with an opening to fit is brazed to the top of the cylinder. The solenoid thus made is suitable for a 300 cc. lipless beaker $4\frac{7}{4}$ in. high and $2\frac{1}{4}$ in. The solenoid diameter. coil may be in series in the electrolytic line or excited separately.

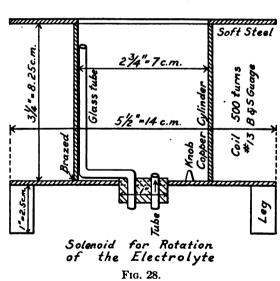

The negative electrode is of gauze 40 meshes per linear Inch, with a depositing surface of 100 cm. and is slit to permit cuick removal from the electrolyte.

- ¹Stoddard, Jour. Am. Chem. Soc., 1909, 385. Price and Humphreys, Jour. Soc. Chem. Ind., 1910, 307.
- ² Eng. and Min. Jour., 89, 89, 1910. ³ Frary, Jour. Am. Chem. Soc., Nov., 1907, 1592. Heath, Jour. Ind. Eng. Chem., Feb., 1911, 74.
 - 4 Heath, Jour. Ind. Eng. Chem., Feb., 1911, 76.

Procedure. Five grams of the thoroughly cleaned copper sample are dissolved in the covered electrolytic beaker on a steam plate with 40 cc. of stock acid solution composed of 7 parts (1.42 sp.gr.) nitric acid, 10 parts sulphuric acid (1.84 sp.gr.) and 25 parts by volume of water. The temperature during the solution is kept just below the boiling point, 50 cc. of the stock solution is used for copper containing 0.03 to 0.1 per cent of arsenic, 60 cc. for material containing 0.11 to 0.5 per cent arsenic. The electrolyte is diluted to 120 cc. A current of 4.5 amperes is used for the electrolysis and the same amount employed to excite the solenoid. During the deposition a double pair of watch glasses cover tightly the beaker until the color of the electrolyte fades out, when they are rinsed and Twenty minutes later and thereafter at 5 minute intervals, a test for completion of deposition is made by withdrawal of 1 cc. onto a porcelain tile and treating with a few drops of freshly prepared hydrogen sulphide water. This test will detect the presence of 0.000005 g. copper or more remaining in The determination is complete in two and a half hours. Extremely accurate results are obtained when the electrolyte is kept very cold by circulation of water about it and when the cathode is withdrawn within 5 minutes after completion of deposition.

In the assay of easting copper, in case the deposit is evidently impure, the cathode may be stripped by treatment with 50 cc. of the stock solvent and then replated under the conditions described.

Notes. The advantage of the solenoid over any mechanical device for the rotation of electrodes is due to the prevention of loss by spraying from the anode, as the beaker can be covered with a double pair of watch glasses.

beaker can be covered with a double pair of watch glasses.

Results range from 0.003 to 0.01 per cent higher than the author's slow method of assay of refined copper, and is due to platinum from the anode, which is corroded by the influence of heat, nascent nitrous acid and high current.

Deposition from Nitric Acid Solution. The solution should not contain over 2-3 cc. of free concentrated nitric acid. If more than this is present, the solution is evaporated to expel most of the acid, the remainder neutralized with ammonia and the requisite amount of nitric acid added. The solution is diluted to 100 cc., warmed to 50° or 60° C. and electrolyzed with a current of 1 ampere and 2-2.5 volts. Two hours are sufficient to deposit 0.3 gram copper. Since the hot acid acts vigorously on copper, it is necessary to wash out the acid from the beaker before breaking the current. (See method for copper in alloys, page 207.)

Deposition from an Ammoniacal Solution. Ammonium hydroxide is added to the solution containing copper until the precipitate, first formed, dissolves. Twenty to twenty-five cc. of ammonium hydroxide (sp.gr. 0.96) are required for 0.5 gram copper or 30-35 cc. for 1 gram. Three to four grams of ammonium nitrate are added and the solution electrolyzed with a current of ND/100=2 amperes. The electrodes are washed, without breaking the current, until the ammonia and nitrate are removed.

Lead, bismuth, mercury, cadmium, zinc and nickel should be absent from the ammoniacal solution. Arsenic is not deposited. Unless a very pure platinum anode is used, platinum may contaminate the deposit appreciably. Jena or other brand of zinc borate resistance glass should not be used for the electrolytic beaker.

SLOW METHODS

Electrolytic Determination of Copper in Blister Copper

The sample should be no coarser than 20 mesh. Because fine particles are comparatively poor in copper, extreme care must be taken in drawing the portion for analysis to preserve the ratio of the coarse to fine. Some analysts, to avoid sampling error, sieve the coarse from the 40 or 60 mesh fine and either make a separate analysis of each weighed product, or weigh into a single test the due proportion of each. Others draw a large portion, by means of a riffle (Fig. 29) or similar sampling device and from its solution in a volumetric flask, pipette an aliquot part equivalent to one or more grams.

By the small portion method insoluble matter must be removed by filtration. When the sample contains an insignificant quantity of insoluble matter, the prac-

tice is to deposit the silver with the copper and make a correction for its presence in accordance with the result of the silver assay of the sample.

By the large portion method, insoluble matter and silver, as silver chloride, is removed from the electrolyte by sedimentation in the volumetric flask.

Procedure. Small Portion Method. The coarse and fine portions are quartered down to convenient amounts and from these a 5-gram composite weighed, which contains the coarse and fine portions in ratio of their percentage weights. The sample is placed in a 350-cc. tall-form beaker, without lip and with flaring rim. Fifty cc. of chlorine-free, stock acid solution (15 parts nitric and 5 parts sulphuric acids) are added, the beaker covered with a funnel (stem up), which just fits in the rim, and the mixture heated gently at first and finally to boiling. When the sample has dissolved, 5 cc. saturated solution of am-



Fig. 29.—Riffle Sampler.

monium nitrate are added and the sample diluted to 200 cc. with water. When the electrolyte has cooled to room temperature the electrodes are introduced, the beaker covered with split watch glasses and electrolysis started with a current of .05 ampere and continued until the appearance of the foil indicates that the silver has deposited. The current is then raised to ND/100 = .75 ampere and this continued for twenty to twenty-two hours, or until the appearance of gas about the negative electrode indicates that deposition of the copper is practically complete. For the unexperienced a simple method is to add a little water to the electrolyte without breaking the current and after 15 minutes to observe whether any deposition or copper takes place on the freshly exposed surface. The watch glasses and electrode stems should be rinsed when the electrolysis has continued 15–16 hours.

Procedure. Large Portion Method.¹ The sample is quartered by a riffle sampler (see Fig. 29) to an amount very close to 10 grams. This quantity is weighed and transferred by a paper chute into a 2000 cc. flask, which has been calibrated by the method of repeated delivery at constant temperature, of a 50 cc. overflow, dividing pipette (see Fig. 10). The liquid employed in calibrating is a copper solution of the same composition as that for which the flask is to be used. A cold mixture of 80 cc. sulphuric acid (sp.gr. 1.82) and 200 cc. nitric acid (1.42) with 500 cc. of water is added. A standard solution of sodium chloride is added in sufficient quantity to precipitate the silver, care being taken to add less than 20% excess. A bulbed condenser tube is placed in the neck before putting the flask on a hot plate.

The solution is gradually heated to boiling and when the solution is nearly complete, boiled gently for one hour. This generally completely dissolves the copper present. Residues of lead, tin, silver, or silica if present in appreciable amounts are separated at this point by filtration.

When the solution in the flask has cooled for half an hour, water is added to a little above the 2000-cc. mark, giving the flask a rotary motion, during the addition, to mix the solution. The flask is placed in a large tank, Fig. 30,

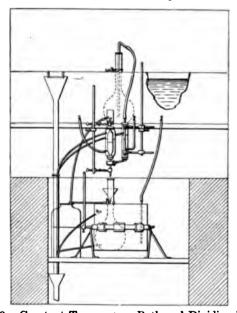


Fig. 30.—Constant Temperature Bath and Dividing Pipette.


containing water and allowed to remain until it becomes of the same temperature as the water and very close to that of the room. The solution is then made exactly to the mark and allowed to settle, after thorough mixing, by placing the flask again in the water tank.

¹ W. C. Ferguson, Jour. Ind. and Eng. Chem., May, 1910.

1

Electrolysis. Portions equivalent to 2 grams of sample are measured out by means of a dividing pipette, with water-jacket through which

the tank-water flows. The solution is run into glasses, hydrometer-jar in shape, with concave bottoms, height of glass, 61 ins., diameter 2½ ins., Fig. 31. Each portion is treated with 5 cc. of a saturated solution of ammonium nitrate and diluted to 125 cc. with water. (NH₄NO₂ or (NH₄)₂SO₄ delays deposition of As and Sb until electrolyte is freed from Cu.) The electrolyte, at this stage, contains about 3.7 cc. of nitric acid.



watch-glasses which cover the jar are rinsed with a spray of water into the ; lass and the run continued for two or three hours. Each electrode is quickly detached from the binding posts, the cathode plunged into cold water, then successively into three jars of 95% alcohol, shaken free of adherent drops and dried by revolving rapidly over a Bunsen flame for a few seconds after ignition of the film of alcohol.

Frg. 31.

The weighing of foil plus the deposit is made with as little delay as possible.

Determination of the Copper Remaining in the Electrolytes. Since the exhausted electrolyte seldom contains over 0.01% copper, this residual copper can be closely estimated by observation of the depth of the sulphide precipitate. Should circumstances be such that the quantity be more than can be estimated by the appearance of the sulphide precipitate and a determination without rerun is necessary, the precipitate is filtered, incinerated, dissolved with a little hot HNO₃, made ammoniacal and after settling, filtered through asbestos. The color of the solution is compared with a standard solution treated with the same amount of reagents as the sample, care being taken that similar conditions prevail when making comparison.

Notes and Precautions

The ideal deposit is of a salmon-pink color, silky Character of the Deposits. in texture and luster, smooth and tightly adherent. A slightly spongy and coarsely crystalline deposit, although good in color and perfectly adherent, will invariably give high results. A loosely adherent deposit caused by either too rapid a deposition at the commencement or too low a current density at some period of the electrolysis, usually shows a red tint and may give a high result on account of oxidation or a low result because of detachment of particles. A darkly shaded deposit indicates the presence of impurity in greater or less extent. If it is impossible to complete the electrolysis without this appearance the electrolyte should be purified. Impurities such as

ysis without this appearance the electrolyte should be purified. Impurities such as arsenic, antimony, bismuth, selenium and tellurium may occur in the blister copper. A dark colored, but perfectly adherent deposit is dissolved very slowly from the foil, in a covered electrolytic jar, by gently heating for several hours with about 60-70 cc. of a solution containing 2 cc. sulphuric and 5 cc. nitric acids. When the solution is complete the temperature is raised to expel dissolved gases. Five cc. saturated ammonium nitrate solution is added and the electrolyte diluted to 125 cc. When cooled to room temperature, electrolysis is carried out under the same conditions as that of the first deposit and on the same foil, if arsenic or antimony is the interfering impurity; on a fresh foil if selenium or tellurium has been the contaminating element. The undeposited copper is determined colorimetrically in the mixture of the first and final electrolytes and added to the weight of the copper deposited.

If the sample contains a large percentage of arsenic or antimony, a portion representing 2 grams is drawn from a pipette into a Kjeldahl flask, 10 cc. of sulphuric acid added.

and the liquid evaporated to fumes to expel nitric acid. From this solution cuprous thiocyanate is precipitated according to the method described on page 153. The funnel containing the filter is placed in a 500 cc. flask with long neck, the filter is punctured and the precipitate washed into the flask with the least quantity of water possible, the adherent precipitate is dissolved from the filter with warm dilute nitric acid, added cautiously to avoid violent evolution of gases from the dissolving precipitate in the flask. The washed filter is incinerated and the solution of its ash by nitric acid added to the electrolyte after completion of electrolysis. When solution of the precipitate is complete, the liquid is boiled to small volume, neutralized, and 5 cc. ammonium nitrate solution and 3 cc. excess free nitric acid added. The liquid is transfered to an electrolytic jar and electrolysis carried out in the manner already described.

The amounts of bismuth, arsenic, antimony, sclenium or tellurium usually found in blister copper may be separated together with iron present by addition of ammonia to a pipetted portion. The filtered precipitate is purified of copper by solution with nitric acid and reprecipitation. The combined filtrates are neutralized, 3½ cc. of free nitric acid added and the solution electrolyzed under the conditions already described. The nitric acid solution of the incinerated filter, carrying the iron, etc., is added to the electrolyte, after electrolysis is complete, for determination as undeposited copper. The undeposited copper is determined colorimetrically by one of the procedures outlined

on pages 165, 166 or 167.

The deposited copper is never absolutely pure. The total impurities seldom exceed 0.03%. Ag from 0.000 to 0.18%; As from 0.000 to 0.003%; Sb from 0.000 to 0.004%; Se and Te from 0.001 to 0.027%; Bi from 0.000 to 0.0003%. Periodical complete analyses may be made and corrections applied to the analysis when exceedingly accurate percentages are required.

Too low a current density or excessive oxidizing power of the electrolyte may produce high results, due to the oxidation of the deposited copper. Too high a current density or a deficiency of oxidizing power in the electrolyte, by causing a deposition

of impurities, will give high results.

The electrodes used by the Nichols Copper Co. are straight platinum wires for the electrodes used by the Nichols Copper Co. are straight platinum wires for the electrodes used by the Nichols Copper Co. are straight platinum wires for the electrodes used by the Nichols Copper Co. the positive ends and cylinders 12 in. long, 1 in. in diameter of 0.004 in. irido-platinum foil, 112 sq. in. depositing surface, for the cathodes.

A uniform current is essential.

The nitric acid used should be free of iodic acid.

The presence of oxide of nitrogen gases, or a chloride in an acid solution, will cause a coarsely crystalline or brittle deposit, under conditions which in their absence would produce a good plating. The deposit moreover may contain platinum from the an de if the electrolyte contains a chloride salt.

Silver may be deposited with the copper and correction made for its presence from tive result of a separate assay. Copper deposits in poor form, unless the silver be first placed of at a very low current density, about 0.03 Amp. ND₁₀₀.

while matter, unless removed, will contaminate the deposit mechanically

Arwan, antiment, relenium or tellurium have an influence on the physical character if the which may affect the copper result beyond the sum of such impurities كومالهم برومل

Whereas impurities are deposited or not, appreciably high results are obtained by community electrolysis for some time after the electrolyte has become impoverished

العوووري أوي

Considering of the copper deposit, in the process of ignition of the alcohol clinging to the exploration will cause exidation of the copper. As much as possible of the alcohol must be shaken off before passing the electrode rapidly through the flame. It is advis-able to weight the copper shortly after deposition, as prolonged contact with air is unde-

sirable, it extreme accuracy is desired.

The copper deposits may be removed by plunging the electrode, for a few moments, in hot nature acid. After washing with water, the foil is ignited to a cherry red in a direct colorless flame. The agnition removes any grease which would be objectionable, that may contamnate the platinum. Alcohol frequently contains oily matter which will clink to the electrode in spite of the rapid ignition for drying the deposit.

VOLUMETRIC METHODS FOR THE DETERMINATION OF COPPER

Potassium Iodide Method¹

The procedure depends upon the fact that cupric salts when treated with potassium iodide liberate iodine, the cuprous iodide formed being insoluble in dilute acetic acid.

Reactions. $2\text{CuSO}_4 + 4\text{KI} = 2\text{CuI} + 2\text{K}_2\text{SO}_4 + \text{I}_2$.

The liberated iodine is titrated with standard thiosulphate.

$$2Na_2S_2O_3+2I = Na_2S_4O_6+2NaI.$$

This method is exceedingly accurate. Very few metals interfere. Bismuth, selenium, trivalent arsenic, antimony or iron should not be present. Lead, mercury, and silver increase the consumption of iodide, but otherwise interfere only because of the color of their iodides.

Solutions. Sodium Thiosulphate. 7.5 grams of the salt, Na₂S₂O₃·5H₂O, are dissolved and made to 2 liters with water. The solution is standardized against a copper solution containing 1 gram of pure copper per liter, 1 cc. =0.001 gram Cu. Approximately the same amount of copper in the same volume of solution, is taken as is to be determined by the assay. For high-grade copper ores and crude copper, etc., it is advisable to prepare a standard thiosulphate solution ten times the above strength. The copper solution is made slightly ammoniacal and then acid with acetic acid. Potassium or sodium iodide crystals, free from iodate, are added and the liberated iodine titrated with the standard thiosulphate. (See Procedure.)

Standard Copper Solution. One gram of purest electrolytic copper is dissolved in 20 cc. of dilute nitric acid, sp.gr. 1.2, and the solution diluted to 1000 cc. For standardizing the thiosulphate to be used with high-grade copper ores, crude copper, blister copper, etc., a copper solution containing ten times the above amount of metallic coppers is prepared.

The following additional reagents are required: starch solution, solid potassium iodide, 50% acetic acid solution, and other common laboratory reagents.

Note. Sodium thiosulphate is apt to change in strength upon standing, so that restandardization is necessary.

Procedure. The solution containing the copper, separated from interfering elements, by precipitation with aluminum, zinc or potassium sulphocyanate, boiled to remove the lower oxides of nitrogen is evaporated to about 30 cc., acid neutralized with sodium carbonate or ammonia, made slightly acid with acetic acid, 1:3, and cooled to near room temperature. About 3 grams of potassium iodide, or the equivalent of a saturated solution, are added and the liberated iodine titrated with standard thiosulphate, the reagent being added until the brown color changes to light yellow and after the addition of starch solution until the blue color fades out. The end-point is very sharp.

Cc. thiosulphate multiplied by value of reagent gives weight of copper in sample.

¹ Short iodide method, see page 211. Suggested by Prof. C. Y. Pfoutz, Colorado School of Mines.

Notes. Nitrous oxides should be expelled before neutralizing with alkalies. To effect this removal, lengthy boiling may be required unless some means of shortening the period are employed. Some fine, inert substance like talcum powder (Peters, J. Am. Chem. Soc., April, 1912, p. 431) added to the acid solution acts as an accelerating agent. A large excess of acetic acid should be avoided. The solution should be cool and contain at least 6 parts of KI for 1 of Cu, e.g., 1 Cu = 5.2231 KI = 1.9965 I = 3.9034 Na₂S₂O₃·5H₂O. The solution should be concentrated, 40 to 50 cc.

When ferric iron is the only disturbing impurity and no nitrates are present, the necessity of separation of copper may be avoided by fixing the free mineral acid by use of sodium acetate and then adding a clear, 4½ per cent solution of sodium fluoride until the red color of ferric acetate has bleached and then an excess of 10 cc. (Jour. Sci. Chem. Ind., May 15, 1915, p. 462; Mott, Chemist Analyst, July, 1912.)

Arsenic or antimony when present in trivalent form may be oxidized by treatment with bromine, chlorine, hydrogen peroxide or potassium permanganate, care being taken to expel or reduce any excess of the oxidizing agent before titration.

Potassium Cyanide Method

This procedure is largely employed on account of its simplicity, although it does not possess the degree of accuracy of the Iodide Method. The procedure depends upon the decoloration of an ammoniacal copper solution by potassium cvanide.

The operations of the standardization of potassium cyanide and of making the assay should be as near alike as possible. If iron is present in the assay it should be added to the standard copper solution titrated, in order to become accustomed to the end-point in its presence.

Silver, nickel, cobalt, cadmium, and zinc interfere and should be removed if present in appreciable quantities. Precipitation of metallic copper by aluminum powder, as directed under Separations, is recommended as a procedure for iron ores and briquettes. In presence of smaller amounts of iron, the titration may be made in presence of iron suspended in the solution. It is not advisable to filter off this precipitate, as it invariably occludes copper. With practice, the shade of color the iron precipitate assumes at the end of the reaction serves as an indicator, so that the operator is assisted rather than retarded by its presence.1

 $2Cu(NH_2)_4SO_4 \cdot H_2O + 7KCN =$

 $K_2NH_4Cu_2(CN)_6+NH_4CNO+2K_2SO_4+6NH_2+H_2O$.

Standard Potassium Cyanide Solution. Thirty-five grams of the salt are dissolved in water, then diluted to 1000 cc.

Standardization. 0.5 gram of pure copper is dissolved in a flask by warming with 10 cc. of dilute nitric acid (sp.gr. 1.2), the nitrous fumes expelled by boiling, the solution neutralized, diluted and titrated as directed under Procedure.

¹ Sutton, "Volumetric Analysis." Davies, C. N., 58, 131. J. J. and C. Beringer, C. N., 49, 3. Dr. Steinbeck, Z. a. C., 8, 1; C. N., 19, 181.

If iron is present in the samples titrated, it is advisable to add iron to the standard copper solution as directed above.

$$\frac{0.5}{\text{cc. KCN solution}}$$
 = wt. Cu per cc. of standard KCN.

Procedure. The solution containing the copper is neutralized with sodium carbonate or hydroxide, the reagent being added until a slight precipitate forms. One cc. of ammonium hydroxide is now added and the solution titrated with standard potassium cyanide solution. The blue color changes to a pale pink; finally a colorless solution is obtained. In presence of iron, when the copper is in excess of the cyanide, the iron precipitate possesses a purplish-brown color, but, as this excess lessens, the color becomes lighter until it is finally an orange brown, the solution appearing nearly colorless. The reagent should be added from a burette drop by drop as the end-point is approached.

Cc. KCN×factor per cc. = weight Cu in assay.

VOLUMETRIC METHODS BASED UPON THE PRECIPITA-TION COPPER AS CUPROUS THIOCYANATE

Iodide Method¹

A thiocvanate salt is oxidized by a series of reactions which when completed this form: $4\text{CuCNS} + 7\text{KIO}_4 + 14\text{HCl} = 4\text{CuSO}_4 + 7\text{KCl} + 7\text{ICl} + 4\text{HCN}$ +5H₂O. Other cyanate than copper, lead and antimony must be absent from the precipitate of cuprous thiocyanate. This precipitate together with the filter paper is placed in a 250 cc. glass stoppered bottle and 5 cc. chloroform, 20 cc. water and 30 cc. concentrated hydrochloric acid added.

A certain amount of standard potassium iodate solution (11.784 grams KIO₂ per liter, 1 cc. = 2 milligrams copper) is added from a burette. When the bottle is thoroughly shaken, a violet color appears in the stratum of chloroform which may increase in depth of tint and then fade with each addition of iodate solution. Disappearance of color determines the end point. The KIO2 solution is very stable. The same layer of chloroform can be used for successive determinations by decanting only the liquor carrying the paper pulp. immediate coloring of the chloroform on addition of a precipitate to the bottle is due to the reaction with residual ICI and has no harmful effect on the determination.

Permanganate Method²

Although this method is based upon these reactions: CuCNS+NaOH = CuOH + NaCNS $5HCNS + 6KMnO_4 + 4H_2SO_4 = 3K_2SO_4 + 6MnSO_4$ and +5HCN+4H₂O, solution of the copper salt by the method of manipulation and possibly incompletion of oxidation makes necessary the use of an empirical factor. Theoretically the iron value multiplied by 0.1897 gives the copper value of permanganate. By this method the Fe to Cu factor may be from

Jamieson, Levy and Wells, Jo. Am. Chem. Soc., May, 1908, p. 760. Price and Meade, "Technical Analysis of Brass," Sec. Ed., p. 84.
 Low, "Technical Methods of Analysis." Chapter on Copper has table of empirical

factors, compiled by G. A. Guess.

0.192 to 0.2. The thiocyanate precipitate is decomposed on the filter with boiling 8% NaOH. The filter is washed with hot water. After making the filtrate acid with dilute H₂SO₄, titration of the solution to permanent tint is made with standard KMnO₄ solution having a strength of 1 cc. equivalent to about 1 mgm. copper.

Demorest's Method²

Precipitation of cuprous thiocyanate is from a nearly boiling 75-100 cc. solution containing ammonium sulphate about 3 grams ammonium tartrate and 1 cc. free sulphuric acid. 5% solution of sodium sulphite is first added then slowly, with stirring 5% solution of potassium thiocyanate. The coagulated precipitate is collected from the hot liquid in an asbestos lined Gooch crucible and washed thoroughly. The precipitate is decomposed in the crucible by pouring on it hot, 10% NaOH. The residue of CuOH in the crucible is washed well with hot water.

The alkaline filtrate is warmed to 50° C. and a few cc. of standard permanganate solution introduced. At 10 or 5 cc. intervals during the titration, a drop of the green solution is placed on a parafined white plate together with a drop of strong hydrochloric acid. When the red color of this test drop becomes faint on addition of a drop of a 10% solution of FeCl₂, 30 cc. of 50% H₂SO₄ are added and the flask shaken until all the MnO₂ is dissolved. The characteristic end point will appear on addition of very little more permanganate. This method has the merit of not requiring an empirical factor, the copper value of the permanganate being 0.1897 times that of the iron.

Volhard's Method

The copper is precipitated with a standard solution of alkali thiocyanate. After filtering and washing the precipitate free of reagent, the excess is titrated with standard silver nitrate solution.

Garrigue's Method

The precipitate of cuprous thiocyanate is collected in a Gooch crucible, decomposed in a casserole with an excess of hot, standard NaOH. The cuprous hydrate formed is filtered, washed and the excess alkali titrated with standard HCl. The reactions are: CuCNS+NaOH=CuOH+NaCNS and $NaOH+HCl=NaCl+H_2O$.

² Jo. Ind. and Eng. Chem., Mar., 1913, p. 215.

COLORIMETRIC DETERMINATION OF SMALL AMOUNTS

OF COPPER

Potassium Ethyl Xanthate Method

The method is based upon the fact that potassium ethyl xanthate produces a yellow-colored compound with copper. The reagent added to a solution containing traces of copper will produce a yellow color varying in intensity in direct proportion to the amount of copper present. Larger amounts of copper with the reagent produce a bright yellow precipitate of copper xanthate. Small quantities of iron, lead, nickel, cobalt, zinc, or manganese do not interfere. The procedure is especially valuable for determination of the purity of salts crystallized in copper pans.

Special Solutions. Stock Solution of Copper Sulphate. 3.9283 grams CuSO₄·5H₂O are dissolved in water and made up to a volume of 1000 cc. One cc. is equivalent to 0.001 gram Cu.

Standard Copper Sulphate. Ten cc. of the stock solution are diluted to 1000 cc. with distilled water. One cc. = 0.00001 gram Cu.

Potassium Ethyl Xanthate Solution. One gram of the salt is dissolved in 1000 cc. of water. The solution is kept in an amber-colored glass-stoppered bottle.

Procedure. Five grams of the substance are dissolved in 90 cc. of water (see note) and the solution poured into 100-cc. Nessler tube; 10 cc. of the potassium xanthate reagent are added and the solution mixed by means of a glass plunger. To a similar tube containing 50 or 60 cc. of water are added 10 cc. of the xanthate reagent and then gradually drop by drop the standard copper solution from a 10-cc. burette (graduated in $\frac{1}{10}$ cc.) until the colors in both tubes match.

If a = grams of the substance taken for analysis, b = number of cc. standard copper solution required to match the sample; then $b \times 0.00001 \times 100 \div a = \%$ Cu.

Notes. The amount of the substance to be taken varies according to its copper content. The greater the copper contamination of the salt, the less sample required. The solution should be neutral or only very slightly acid.

• In place of the Nessler tubes the special colorimetric apparatus described under Titanium and under Lead may be used. A very weak copper standard will be required for the comparison tube.

If the substance is insoluble in water the copper is rendered soluble by treatment with nitric acid. Hydrochloric acid is added and the nitric expelled by evaporation. The substance is taken up with water and the insoluble residue filtered off.

Starch and organic matter are destroyed by addition of 10 cc. 10% sodium hydroxide+10 cc. of saturated sodium nitrate solution, then evaporating to dryness and igniting. Hydrochloric acid is now added to expel the nitric acid as directed above.

In dealing with a flotation concentrate containing oil, the sample should be taken to fumes with nitric acid, otherwise the color is apt to be green instead of blue.—C. Y. Pfoutz.

Ferrocyanide Method for Determination of Small Amounts of Copper

By this colorimetric method it is possible to detect one part of copper in 2,500,000 parts of water. The procedure depends upon the purplish to chocolate-brown color produced by potassium ferrocyanide and copper in dilute solutions. The procedure is applicable to the determination of copper in water and may be used in presence of a number of elements that occur in slags. Iron also produces a colored compound with ferrocyanide (1 part Fe detected in 13 million parts H₂O), so this element must be removed from the solution before testing for copper.

Solutions. Standard Copper Solution. 0.393 gram CuSO₄·5H₂O per liter.

1 cc. = 0.0001 gram Cu.

Ammonium Nitrate. 100 grams of the salt per liter.

Potassium Ferrocyanide. Four grams of the salt per 100 cc. of solution.

Procedure. A volume of 5 to 20 drops of potassium ferrocyanide, according to the amount of copper present in the solution, is placed in a tall, clear, glass cylinder or Nessler tube of 150 cc. capacity, 5 cc. of ammonium nitrate solution added and then the whole or an aliquot portion of the neutral ¹ solution of the assay. The mixture is diluted to 150 cc. The same amount of ferrocyanide and ammonium nitrate solutions are poured into the comparison cylinder, placed side by side with the one containing the sample, on a white tile or sheet of white paper. The standard copper solution is now run from a burette into the comparison cylinder, stirring during the addition, until the color matches that of the assay. The number of cc. required multiplied by 0.0001 gives the weight of copper in the sample contained in the adjacent cylinder.

$$\frac{\text{Amount of Cu} \times 100}{\text{Wt. of sample compared}} = \% \text{ Cu in the sample.}$$

Notes. The solution must be neutral, as the copper compound is soluble in ammonium hydroxide and is decomposed by the fixed alkalies. If the solution contains free alkalies, it is made slightly acid and then the acid neutralized with ammonia, added in slight excess. This is boiled to expel the excess of ammonia, and then tested according to the directions under "Procedure." Solutions containing free acids are neutralized with ammonia.

Iron may be removed by precipitation with ammonia. As this hydroxide occludes copper, the precipitate should be dissolved and reprecipitated to recover the occluded

Determination of copper in water is accomplished by evaporating a quantity of water to drvness, taking up the residue with a little water containing 1 cc. nitric acid, the residue having been ignited to destroy organic matter, precipitating iron with ammonia, as directed above, and determining copper in the filtrate.

The colorimeter used in determination of traces of lead and for the colorimetric

determination of titanium may be employed in place of the Nessler tubes.

Ammonia Method for Determining Small Amounts of Copper

In the absence of organic matter, nickel and elements giving a precipitate with ammonia, copper to an upper limit of 10 milligrams can be determined by comparison of the depth of the blue tint of its ammonium solution with a tem-

porary or permanent standard copper solution of equal volume. Because copper in ammoniacal solution combines with the cellulose of filter paper, clarification of such a solution should be through asbestos. Permanent standard solution of copper sulphate, free of nitrate, if kept cool and away from the direct sunlight, lasts for a long time.

Hydrogen Sulphide Method

In the absence of elements precipitated by hydrogen sulphide, copper to the limit of about 1 milligram, in a solution not too strongly acid with sulphuric or hydrochloric acid, may be determined by comparison of its sulphide with that of a known quantity of copper in equal volume and similarly treated. The liquid should be cold and the passage of the hydrogen sulphide stopped before the compound coagulates.

Norz. Either the ammonia or the hydrogen sulphide method is applicable to the determination of the copper not deposited in the operation of the electrolytic method.

DETERMINATION OF IMPURITIES IN BLISTER AND REFINED COPPER

Introduction. In the complete analysis of copper the following impurities are generally estimated: silver, gold, lead, bismuth, arsenic, antimony, selenium, tellurium, iron, zinc, cobalt, nickel, oxygen, sulphur, and less commonly, tin and phosphorus. In high grades of blister and in refined copper the percentage of these impurities is very low, the blister copper usually averaging over 99.0% copper with silver and the refined copper over 99.93% of the metal. The principal impurity in the refined element is oxygen, which may be present to the extent of .02 to .15%, the remaining impurities being in the third decimal place. From this it is readily seen that large samples are required for the accurate determination of these constituents. The amount of sample taken in blister copper depends upon the grade of copper analyzed. The impurities in this vary from tenths of a per cent to thousandths, as the metal from one locality may contain quite appreciable amounts of a constituent, which may be present only in extremely small quantities or not at all in copper from a different section. In usual practice it is customary to take from 10 to 50 grams of blister and 50 to 500 grams of refined copper for analysis, depending upon the purity of the material. If a larger sample than 50 grams is taken, it is necessary to divide the material into several lots, and, after removal of the bulk of copper and isolation of the impurities, to combine the filtrates or residues containing the constituents sought.

In the procedures the smallest amount of sample, 10 grams, is taken as the basis of calculation for amounts of reagents used. For larger samples, in the initial treatment for removal of copper, proportionately larger amounts of the reagents are required, i.e., multiples of from 2 to 5 times the amount stated. A 50-gram sample is the largest amount of material handled in one lot.

Scrupulous care must be exercised throughout the analysis to prevent con-

¹ Heath, Jour. Am. Chem. Soc., 19, 21.

tamination of the sample or reagents, and to avoid loss of constituents. The reagents used should be free from the substance sought or from interfering substances. It is the practice to carry blank tests of the reagents through under conditions similar to a regular analysis for iron, lead, zinc, arsenic antimony and sulphur.

It is found best to determine the impurities in several portions, i.e., gold and silver by assay; bismuth and iron in one portion; lead, zinc, cobalt, and nickel in a second; arsenic, antimony, selenium, and tellurium in a third; and separate portions for sulphur, oxygen, phosphorus and tin, when these are occasionally required.

Determination of Bismuth and Iron

Separation of Copper. Amount of Sample. Blister copper 10 to 25 grams, refined copper 100 to 500 grams. The drillings are dissolved in a large beaker in 40 cc. of nitric acid per 10-gram sample and the free acid expelled by boiling. The solution should not become basic during the evaporation. Water is added to make the volume 130 cc. per 10 grams or proportionately more for larger samples. Ammonia is now added in sufficient excess to hold the copper in solution and 5 cc. of saturated ammonium carbonate solution and the sample diluted to 200 cc. (25 cc. (NH₄)₂CO₄ per 50 grams, and dilution to 1000 cc.). The beaker is placed on the steam bath for several hours, preferably over night. The solution is filtered hot (to avoid crystallization of the copper salt), the first 100 cc. being refiltered, and the residue washed with hot water containing a little ammonia. By this procedure the copper passes into the filtrate and bismuth and iron remain in the residue on the filter.

Separation of Iron and Bismuth. The precipitate is dissolved in warm, dilute hydrochloric acid (1:3), ammonia added to the solution in sufficient amount to almost neutralize the acid and the solution then saturated with hydrogen sulphide. After settling some time, the precipitate containing bismuth sulphide is filtered off, iron passing into the solution.

Determination of Iron. Hydrogen sulphide is expelled by boiling the filtrate, and iron oxidized by addition of hydrogen peroxide, or potassium chlorate (nitric acid should not be used). The solution is evaporated to dryness and iron then determined in the residue by the stannous chloride method, details of which may be found in the chapter on Iron, page 257.

Determination of Bismuth. The sulphides remaining on the filter are dissolved in nitric acid, the solution evaporated with sulphuric acid to SO₂ fumes to expel nitric acid, the concentrate diluted with water, and lead filtered off. Bismuth is precipitated in the filtrate by addition of ammonia in slight excess, followed by 10 cc. of a saturated solution of ammonium carbonate, and boiling. The precipitate is settled for several hours or over night if preferred, and then separated by filtration. This is now dissolved in the least amount of nitric acid, added to the filter drop by drop from a burette and bismuth determined in the solution by the cinchonine iodide method, given in detail in the chapter on Bismuth, page 77.

Notes. An excess of nitric acid, or the presence of cadmium, lead, silver, or hydrochloric acid interferes with the colorimetric procedure.

In analysis of refined copper several 50-gram portions are taken for analysis, ten such portions on a 500-gram sample; the filtrates, obtained upon dissolving the residue freed from copper, are combined and bismuth and iron determined on this combined solution.

Determination of Lead, Zinc, Nickel, and Cobalt

Removal of Copper. Ten to 25 grams of blister copper, and 100 to 250 grams of refined copper in 25-gram portions are taken for analysis. The metal is dissolved in nitric acid (40 cc. per 10 grams) and the solution boiled until a faint green precipitate begins to appear on the surface of the solution. The free acid being expelled, the solution is made faintly acid by adding 1 to 2 cc. of nitric acid, the solution diluted 300 to 700 cc., according to the amount of copper taken, and then electrolyzed with a current of 1.5 to 2 amperes for thirty-six hours, with a spiral anode and a cathode with about 160 cm. depositing surface. The solution should remain slightly acid throughout the electrolysis, otherwise cobalt, nickel, and zinc may be precipitated as hydroxides from a neutral solution. When the copper is nearly removed, the electrodes are disconnected, and removed.

The solution is concentrated by boiling, a few crystals of oxalic acid added. and the anode (which may be coated with PbO₂) immersed in the hot solution for a few minutes, then rinsed off into the solution.

Separation of Lead. The solution is evaporated to small volume, about 40 cc. of dilute sulphuric acid (1:1) are added and the mixture evaporated to SO₂ fumes. The cooled concentrate is diluted with 100 cc. of water and again evaporated to fumes. About 300 cc. of water added and when the soluble salts have dissolved, the solution is filtered and the residue, PbSO₄, washed. The filtrate contains Zn, Ni, Co, etc.

Determination of Lead. The residue, PbSO₄, is dissolved by successive treatments with ammonium acetate and hot water, the lead precipitated from the solution, made slightly acid with acetic acid, by adding a slight excess of potassium chromate and the element determined as lead chromate according to the standard procedure for lead. See page 274 in the chapter on Lead.

Removal of the Hydrogen Sulphide Group. The filtrate from the lead sulphate is saturated with H₂S and filtered. The filtrate contains zinc, cobalt, and nickel. To recover any occluded zinc, the precipitate is dissolved in nitric acid, taken to fumes with sulphuric acid, diluted to about 200 cc., and again treated with H₂S. The filtrate from this precipitate is combined with the first portion. The precipitate is rejected.

Removal of Iron. This, if present, will be found in the filtrate. The H₂S is expelled by boiling and the solution concentrated to 400 cc. after adding 5 cc. of H₂O₂ to oxidize the iron. Five grams of ammonium sulphate are added, the solution made strongly ammoniacal, and filtered. Iron is precipitated as Fe(OH)₂ and is thus removed. If much iron is present, a double precipitation is advisable to recover any occluded zinc, nickel, or cobalt, and the filtrates combined.

Determination of Zinc. The filtrate from iron is concentrated to 400 cc., then made neutral to litmus by cautious addition of dilute sulphuric acid, drop by drop, and then faintly acid with 3 drops in excess. Zinc is now precipitated as the sulphide by saturating the solution with H₂S and allowing to stand over night. The sulphide is filtered off. The filtrate contains cobalt and nickel.

Zinc sulphide is dissolved in hot dilute HCl (1:2) and a few crystals of KClO₂. The solution is evaporated to dryness, the residue taken up water containing a few drops of HCl and the extract filtered. (To remove any SiO₂ dis-

solved from the beakers.) Zinc carbonate is now precipitated (in a beaker of glass, which does not contain zinc) from the filtrate by addition of sodium carbonate, and ignited to the oxide ZnO.

$ZnO \times 0.8034 = Zn$.

Determination of Nickel and Cobalt. The filtrate from the zinc sulphide is examined for nickel and cobalt. About 0.5 cc. of sulphuric acid is added. H_2S is expelled by boiling, and 2 cc. of H_2O_2 added. The solution is concentrated to about 400 cc. (this should be free from nitric acid), treated with about 25 cc. of ammonium hydroxide, and electrolyzed over night with a current of 0.5 amperes. Nickel and cobalt, if present, are deposited on the cathode as metals and so determined. For greater details, consult the chapter on Nickel under the method by electrolysis.

Determination of Arsenic, Antimony, Selenium, and Tellurium

Ten to 50 grams of blister copper and 100 to Separation of Copper. 500 grams of refined copper are required for the determination. (For 500-grams sample, 5 lots of 100 grams are taken.) The drillings are dissolved in nitric acid (40 cc. per 10 grams) and the solution boiled until a light-green precipitate appears on the surface. The liquor is diluted to 500 cc., and 5 cc. of ferric nitrate containing 3% of iron are added. A basic acetate precipitate is now made, weak sodium hydroxide being added to neutralize the free acid, but not in sufficient amount to produce a permanent precipitate. If the end-point is overrun, nitric acid is added drop by drop until the solution clears. solution is diluted to about 800 cc., 20 cc. of a saturated solution of sodium acetate added, the liquor brought to boiling and filtered hot through a large creased filter paper, the first portion of the filtrate being poured back on the The residue is washed twice with hot water to remove the copper. Five cc. additional iron are added to the filtrate and a second basic acetate precipitation made, a separate filter being used. The precipitates are dissolved in the least amount of nitric acid necessary and the solutions combined. The liquor is concentrated to 150 cc., a pinch of potassium chlorate added, and the concentration continued until the volume has been reduced to about 30 cc. An equal volume of strong hydrochloric acid is added and a second pinch of chlorate and the evaporation repeated to eliminate all traces of nitric acid.

The evaporation is best conducted in a casserole, resting in the circular opening of an asbestos board, in order that the sides of the vessel may be protected from the flame.

Separation and Determination of Arsenic. The solution is transferred to a distillation flask, arsenic reduced with ferrous chloride, and distilled according to the standard procedure for this element, p. 37.1 In this distillate arsenic is determined volumetrically.2 (See chapter on subject.) Antimony, selenium and tellurium remain in the flask.

Separation and Determination of Antimony. Twenty-five cc. of a saturated solution of zinc chloride are added to the liquor remaining in the distilling

¹The concentration should not be carried below 30 cc.

² Arsenic may be precipitated by H_2S , the sulphide dissolved in NH₄OH, the filtrate taken to dryness, HNO_3 added and the evaporation repeated. Arsenic now is determined by precipitation with $AgNO_3$ and titration of the silver with KCNS in presence of a ferric salt. $Ag \times 0.2316 = As$.

flask after the elimination of arsenic. The antimony is now distilled, strong hydrochloric acid being introduced in the distilling flask drop by drop by means of a separatory funnel, to replace the solution distilled, the volume in the flask being kept as low as possible, avoiding crystallization. When the antimony has been completely eliminated, the contents of the distilling flask is poured out while still hot, and, together with the rinsings of the flask, placed aside for the subsequent determination of selenium and tellurium.

The distillate is neutralized with ammonia, then made slightly acid with HCl and antimony precipitated with H_sS. Most of the selenium and tellurium remain in the flask. Some of the selenium, however, distills with the antimony, hence this must be recovered from the antimony sulphide precipitate and at the same time this must be purified.

The precipitate is dissolved in dilute HCl (1:2), containing a little bromine to oxidize the sulphur. The solution is filtered free from sulphur and the filter washed with a little dilute HCl. The filtrate should contain one-third its volume of strong HCl. Selenium is now precipitated by passing in SO₂ gas to saturation and bringing the solution to boiling. The precipitate is allowed to settle several hours and then filtered through a tared Gooch crucible. (To this is added the selenium and tellurium later obtained from the residue of the flask.) The filtrate contains antimony.

After boiling out the SO₂, the filtrate is first neutralized with ammonia, then made slightly acid with hydrochloric acid and antimony precipitated as the sulphide by saturating the solution with H₂S, allowing the precipitate to settle, resaturating with H₂S and again allowing to settle. The filtered, washed precipitate is dissolved with sodium sulphide, and 10 cc. of 25% potassium cyanide (poison) added to the filtrate, together with 2 cc. of 25% sodium hydroxide.

The solution is now electrolyzed hot (90° C.) for an hour with a current of 0.5 ampere and antimony deposited as the metal on the cathode. This is quickly removed and washed by dipping it successively into a beaker of cold water, three of hot water and one of 95% alcohol. The foil is dried at 100° C., and then weighed, on cooling, as usual. Antimony is now removed by immersing the cathode in boiling nitric acid containing tartaric acid, and washing as before. The loss of weight of the foil is taken as antimony.

Note. It is advisable to test the electrolyte for antimony by acidifying the solution with oxalic acid (Hood). A reddish coloration indicates the incomplete removal of the element.

Determination of Selenium and Tellurium. The solution from the distillation flask is nearly neutralized with ammonia and saturated with H₂S. The precipitate is filtered off and dissolved in equal parts of nitric acid (sp.gr. 1.42) potassium bromide bromine solution (20 cc. Br added to a saturated solution of KBr and diluted to 200 cc.). The liquor is diluted to 400 cc., 5 cc. of ferric nitrate (3% Fe''') solution added, and sufficient ammonia to make the solution decidedly alkaline. The precipitate contains, besides the iron, all of the selenium and tellurium, whereas any copper that may have been present is removed. The precipitate, washed, is dissolved in hydrochloric acid, the free acid nearly neutralized and H₂S passed in to saturation. The precipitate is filtered off, washed, and dissolved in the nitric acid potassium bromide and bromine mixture stated above. The solution is filtered and then sufficient hydrochloric acid added to make the solution contain about one-third its volume of strong HCl. Selenium and tellurium are precipitated from this solution by pass-

ing in SO₂ to saturation, and boiling for a minute or so. The precipitate is now filtered into the crucible containing the selenium obtained in the purification of the antimony precipitate. After washing with hot water and once with 95% alcohol, the residue is dried at 100° C, for an hour and weighed as selenium and tellurium. Solution should stand three hours at least, or overnight, before filtering.

Note. The precipitate of selenium and tellurium may contain gold, which should be determined by assay.

Determination of Oxygen

This determination is required only in refined copper. The method depends upon the reduction with hydrogen of cuprous oxide heated to redness; the water formed by the reaction being the measure of the oxygen.

Apparatus. The combustion-furnace is the same as that used for the determination of carbon. As it is necessary that the hydrogen be absolutely free from oxygen and moisture, the gas is passed through a preheater consisting of a platinum or silica tube of small bore heated to redness by a flame or an electrical device. The gas is then passed through a tube containing calcium chloride and finally through a P_2O_5 bulb containing the anhydride. In this purified form it enters the combustion-tube. The product of combustion, water, is absorbed in a tared bulb by P_2O_5 , to which is attached a tube of calcium chloride.

Procedure. The sample, which has been drilled with considerable care to avoid overheating, is dried under partial vacuum in a desiccator after warming to below 70° C. for a few minutes.

One hundred grams are taken for analysis and placed in the combustion tube, the drillings being held in a large boat. Purified hydrogen is rapidly passed through the tube for half an hour to sweep out the air, the tube being cold. The tared P_2O_4 bulb and the calcium chloride tube are now attached. The heat is turned on to bring the sample to cherry red heat, 900° C., and the current of hydrogen passed slowly over the sample for several hours.

The increase of weight of the P_2O_3 bulb = H_2O .

 $H_2O \times 0.8881 = O$. $O \times 4.9687 = CuO$.

Determination of Sulphur

This determination is rarely required in refined copper.

Twenty grams of blister, unrefined or cement copper, placed in a casserole, are treated cold with 50 cc. bromine-potassium bromide mixture (see under Determination of Selenium and Tellurium). After standing at least ten minutes, 100 cc. of strong nitric acid are added. After another ten minutes the casserole is placed on the steam bath and the solution evaporated to small volume. This is taken up with 25 cc. of strong hydrochloric acid and evaporated to a pasty mass. The treatment is repeated to ensure the decomposition of nitrates and to expel nitric acid. It is now taken up with 5 cc. of hydrochloric acid, diluted with water and sulphuric acid precipitated as BaSO₄, according to the standard procedure for sulphur.

Determination of Phosphorus

This determination is seldom required, and then only in low-grade copper and copper scrap containing phosphor bronze. The sample, dissolved in nitric acid, is treated with ferric nitrate and the basic acetate precipitation made as has been described for the determination of arsenic, etc. The precipitate is dissolved in HCl, this solution then made strongly ammoniacal, and saturated with H₂S, and filtered. The filtrate containing the arsenic and phosphoric acid is acidified, arsenic sulphide and sulphur filtered off, and phosphoric acid determined in the filtrate by precipitation with magnesia mixture as usual. See chapter on Phosphorus.

 $Mg_2P_2O_7 \times .2787 = P$.

DETERMINATION OF COPPER IN REFINED COPPER

In determining the quality of copper for electrical purposes each hundredth of a percent above 99.90 has its significance. The methods employed are the electrolytic and the hydrogen reduction methods. Silver present is rated as copper.

Electrolytic Method.¹ The sample, consisting of unground drillings, should be untarnished, free of grease or oil, and cleaned of particles of iron by use of a good magnet.

Procedure. A catch weight of about 5 grams is taken, each piece being examined for dust, particles from the drill and surface oxidation before it is

placed on the balance pan. Solution is effected in a special 400 cc. beaker which has hipped sides to support a series of watch glasses, the lower hip at the 125 cc. mark, the upper at 350 cc. (Fig. 32.)

The drillings are treated with 50 cc. of a stock solution (10.5 p rts nitric acid and 4.5 parts of sulphuric). The watch-glass traps are put in place to retain the copper which is always entrained in the nitrogen peroxide fumes. Except that the current is maintained at .75 ampere throughout the period of electrolysis, the conditions are the same as have been described for



Fig. 32.

the determination of copper by the "Small Portion Method."

Hydrogen Reduction Method. This method is applicable to the determination of copper in grades of refined copper which are characterized by a metallic impurity content which is constant and less than 0.01 per cent. The apparatus consists of a combustion furnace, preferably electrolytically heated, the temperature of which can be kept constant at about 950° C.; a silica tube of \(\frac{3}{4}\)-in. bore, one end of which is connected with a large Peligot tube containing concentrated sulphuric acid, the other end is connected by a rubber plug and flexible tube with a source of purified hydrogen; porcelain combustion boats 95 mm. long, 18 mm. wide and 10 mm. deep.

Procedure. A catch weight of about 25.1 grams of drillings is placed in the combustion boat, and the boat inserted in the silica tube. After passing hydrogen for half an hour through the cold tube, the temperature is raised to 950° C. and so maintained for two hours. If the furnace is of a type, which will permit the removal of the tube without disconnecting the train, the tube is taken from the

¹ Ferguson, Jour. Ind. and Eng. Chem., May, 1910.

² Electric Heating Apparatus Co., New York.

furnace without interruption of the stream of hydrogen and cooled by a jet of cold air. When cold, the mass of copper, the particles of which are cemented, is taken from the boat and weighed.

Note. If the sample is allowed to become molten, the boat and tube will be coated with a film of copper.

A convenient and efficient type of combustion furnace, hinged design, is shown in Fig. 32b. This furnace may be purchased from the Electric Heating Apparatus Company, New York City.



Fig. 32a.—Combustion Furnace, Hinged Design, Type 70—Shown with one "Spare"
Unit. Height to center, 9½".

By courtesy of the Electric Heating Apparatus Company, New York City.

CHLORINE IN CEMENT COPPER AND COPPER ORES

If the material contains very little silver the following method is applicable in laboratories equipped with apparatus for furnace assaying.

Ten grams of the finely ground sample placed in an 800 cc. beaker are treated with 600 cc. water, 100 cc. nitric acid (free from iodic acid) and the mixture brought to boiling by gentle heating. After filtration and thorough washing, the insoluble residue is treated repeatedly with additional water and acid, of the above proportion, until a test of the filtrate with silver nitrate indicates complete extraction of the soluble chloride. The combined filtrates are treated with a slight excess of silver nitrate and chloride of silver precipitated and determined in the usual way.

On a separate 10 gram sample an assay of silver is made and the equivalent weight of chloride calculated. This equivalent is added to the weight of silver chloride obtained in the extract. The percent of chlorine is calculated from this result by the formula.

Weight of AgCl
$$\times$$
.2474 \times 100 = gram chlorine.

DETERMINATION OF COPPER IN BLUE VITROL

This is best determined on a 2 gram sample of the finely powdered dry salt or a catch weight of approximately 2 grams if the salt is moist. Copper is deposited electrolytically, the electrolyte being diluted to 130 cc. and containing 4 cc. of nitric acid and 5 cc. saturated solution of ammonium nitrate. A current of .18 amperes and an electrode of 11½ sq. in. depositing surface are used. If the salt contains insoluble matter consisting wholly of basic salts, complete solution is brought about by gently boiling after adding 4 cc. nitric acid and 25 cc. of hot water to the salt. If the insoluble matter shows a tendency to remain in suspension, the presence of arsenic or antimony is indicated. In this case the impurities are precipitated along with ferric hydroxide as has been previously described under the notes on the electrolytic determination of copper in blister copper.

DETERMINATION OF COPPER AND LEAD IN BRASS 1

One gram of the alloy is dissolved in 8 cc. nitric acid and the nitrous fumes are boiled off; if tin is present, 40 cc. of boiling water are added, the metastannic acid allowed to settle on the hot plate for fifteen minutes and filtered off. (Method for tin is accurate only for wrought brass; high iron or antimony interfere).

The filtrate from the tin is electrolyzed for copper and lead. If the lead is less than 0.75 per cent, an ordinary sandblasted, spiral anode is used; if the amount of lead is 0.75 to 5 per cent a sandblasted gauze cylinder is necessary. For amounts of lead over 5 per cent either a smaller sample is taken or the greater part of the lead is precipitated as lead sulphate and the small amount of lead passing into the filtrate is recovered by electrolysis, using \(\frac{1}{2}\) ampere current per solution, after adding 3 cc. of nitric acid. For lead under 0.5 per cent; 5 cc. of 1:1 sulphuric acid are stirred in, after the current has been passing for at least ten minutes. If the lead is high the sulphuric acid is added after the electrolysis has continued for at least an hour. Under these conditions no lead sulphate deposits from the solution and as long as the current passes, the sulphuric acid present does not attack the PbO₂ deposited. After the sulphuric acid is added the current is raised to \(\frac{1}{2}\) ampere per solution and the electrolysis continued overnight.

The lead per xide is dried at 250°C. for half an hou:. The factor 86.43 gives the equivalent per cent lead. (Factor determined from the average of plarge number of tests made on pure lead. The factor is best obtained under the conditions of the laboratory where the determinations are made, as it varies slightly with change of conditions.)

The copper on the cathode is washed, dried and weighed according to the usual standard procedure.

¹ Method of The National Brass and Copper Tube Company, communication by R. T. Roberts.

METHODS OF DETERMINING THE COMBINATIONS OF COPPER IN ORES AND FURNACE PRODUCTS

Sulphurous Acid Method¹

The method is based on results which show that cuprite, melaconite, malaconite, chrysocolla, and metallic copper, when finely pulverized, are readily and completely soluble in sulphurous acid. Copper sulphides, chalcocite and chalcopyrite, are not attacked, no matter how finely pulverized or how long the period of contact. Metallic iron in quantities ordinarily found in pulverized mineral, even up to 3%, dissolves and affects the determination not at all, provided there is a strong excess of H₂SO₃. The essential conditions of the method are: (a) Fine pulverization of the sample in order completely to liberate the particles of copper minerals from the gangue; (b) The powdered sample must be kept in suspension during the period of lixiviation. give recovery in a half hour's contact and refractory ores yield in less than two hours.

In general, a solution containing 3% SO₂ should be used, but a much weaker one, as low as 0.75%, will suffice in the case of some ores.

Note. For the manufacture of sulphurous acid, an absorption tower of 1 in. dia. NOTE. For the manufacture of sulphurous acid, an absorption tower of 1 in. dia. and 4 ft. long glass tubing filled with broken hard-burned fire clay is set at an angle of 75° between two 3 to 5 gal. bottles, one about 5 ft. above the other. The tube is open at the top and sealed at the bottom with a plug of sealing wax, through which two small glass tubes extend. The upper bottle contains cold distilled water which is siphoned into the upper end of the absorption tower, the flow being regulated by a stopcock. A 6 to 50 lb. cylinder of sulphur dioxide is connected to one of the glass tubes extending into the absorption tower. On opening the valve of the cylinder the issuing SO₂ is gasified and passes to the tower where it is absorbed by water from the upper bottle, converted into SO₂ solution of the desired strength and caught in the lower bottle. converted into SO₂ solution of the desired strength and caught in the lower bottle. A gas generator may be employed instead of cylinder of SO₂. A 3% solution of SO₂ may be produced by this apparatus at the rate of 3 liters per hour.

The procedure is as follows: Place 2 grams of pulp of 100 to 150 mesh fineness in a bottle, add 100 cc. 3% solution of SO2, seal the bottle and agitate by rolling ½ to 3 hours. Filter, wash the residue with SO₂ solution and add the washings to the filtrate which contain in solution all oxides, carbonates and silicates of copper and all the metallic copper. To this solution and 5 to 10 cc. nitric acid, evaporate to 20 cc., dilute with distilled water and determine copper by the electrolytic or other method suitable to the quantity.

The residue from the filtration contains the unaltered and undissolved sulphides, the copper in which is determined by the method suitable to the grade of ore.

The Silver Sulphate-Sulphuric Method²

The method as described is especially adapted to the determination of metallic copper, cuprous oxide and cupric oxide in the raw material used for the manufacture of marine paints, but can with obvious modifications be applied

¹ Van Barneveld and Leaver, Met. and Chem. Eng., Feb. 15, 1918, pp. 204-206. Eng. and Min. Jour., March 23, 1918, pp. 553-4.

² Communicated by E. F. Fitzpatrick, chemist, Nichols Copper Co.

to the differentiation of sulphide and metallic from oxidized copper in ores. Particles of iron from the grinding plates do not interfere. The sample should be no coarser than 150 mesh.

According to the importance of close valuation of any constituent, 2, 5, or 10 grams of the sample are placed in an 800 cc. beaker together with 300 cc. of a neutral, saturated solution of silver sulphate. Boil gently for 10 minutes, decant the solution on to a 15 cm. thick filter paper of close texture and wash the residue in the beaker by decantation. These operations are repeated with addition each time of more silver sulphate, until a NH₄OH test of a filtrate shows no copper. When extraction of all metallic or sulphide copper has been accomplished, the entire residue is transferred to the filter and washed with hot water until an HCl test of the washing shows the presence of no silver. After evaporation to convenient volume and precipitation of silver from the hot liquid by dilute HCl (cautiously added to ensure no excess in case determination is to be by the electrolytic method), removal of the precipitate by filtration only after the liquid has become cold, copper is determined in the whole or an aliquot part by the electrolytic or iodide method.

The residue is washed (with care not to break the paper) into a beaker or flask and boiled for 5 minutes with 200 cc. of 10% H₂SO₄ to bring into solution all the copper combined as CuO and half that combined as Cu₂O. Decant the solution upon the filter used for the silver sulphate leach to decompose particles of oxides which may be retained upon the paper. Wash thoroughly with cold water.

The copper on the filter, precipitated by the reaction $Cu_2O + H_2SO_4 = Cu + CuSO_4$, is dissolved with dilute nitric acid (about 12% HNO₂), solution filtered and freed from silver by the same method and with the same precautions as were employed on the filtrate from the treatment with 10% H_2SO_4 . According to the amount of sample taken or the evident quantity of copper in solution, copper is determined, by any method suitable to the quantity, in the whole or an aliquot part. This copper in terms of per cent content in the sample multiplied by two gives the copper combined as cuprous oxide, and multiplied by 1.1258 gives per cent Cu_2O .

From the per cent of copper in the sample dissolved by 10% H₂SO₄ and determined by any method suitable to the quantity, is subtracted that precipitated by the same operation to obtain by difference copper combined as cupric oxide. This multiplied by 1.2518 gives the per cent CuO.

Phosphoric Acid-Ammonium Chloride Method¹

This method depends upon the solubility of carbonates and silicates and insolubility of sulphides of copper in 15% phosphoric acid; also upon the solubility of metallic copper in a solution of ammonium chloride. Metallic iron does not interfere.

¹ Cremer, Met. and Chem. Eng., June 15, 1918, p. 645.

One gram of the fine sample is placed in a 500 cc. flat bottom flask, covered with 20 cc. of 15% H₂PO₄ and an equal amount of a 20% NH₄Cl solution and boiled gently for 10 minutes. Because H₂PO₄ gives to the solution a yellow tint which interferes with a sharp end point in the determination of copper by the cyanide method, a pinch of burned lime is added to the solution after it has cooled somewhat. The flask is thoroughly shaken, 25 cc. strong ammonia added and the solution boiled again for some time. The ammoniacal copper solution is filtered from the residue, allowed to cool and titrated by the cyanide method. The method as described is adapted to ores containing up to 3% of oxidized copper.

Caustic Soda-Sodium Tartrate Method¹

This method is based on the permanence of sulphides, the rapid yielding to solution of cupric oxide and the decomposition of cuprous oxide ores on treatment with a mixture of caustic soda and sodium tartrate; also upon the solubility of the more refractory form of oxide of copper by a mixture of ammonium hydrate and sulphate. The method is subject to some error because washing with the ammonia solution dissolves some copper from the chalcocite, and because of the difficulty of washing out all of the dissolved copper from the gelatinized spongy mass on the filter when chrysocolla is a constituent of the sample. These errors tend to balance each other when chalcocite and chrysocolla are both present and the resultant error in assays of ores containing less than 5% copper is not serious.

The procedure is to add 20 cc. of a solution of sodium hydrate and tartrate to 2 grams of pulp and boil gently for 5 to 10 minutes with occasional shaking of the beaker. While hot add 25 cc. 20% solution of ammonium sulphate, heat for 10 minutes, filter, wash several times with a hot mixture of ammonium hydrate and sulphate and finish the washing with hot water. Neutralize the filtrate with dilute H₂SO₄, add 2½ cc. concentrated HNO₃ and determine copper by the electrolytic method.

Note. The caustic soda-sodium hydrate stock solution consists of 100 grams sodium hydrate and 50 of sodium tartrate dissolved in 1000 cc. distilled water. The ammonium hydroxide and sulphate washing solution is a mixture of 100 cc. ammonium hydrate, 100 grams ammonium sulphate and 1000 cc. distilled water.

¹ Hunt and Thurston, Col. School of Mines Meg., Sept., 1917, pp. 157-8.

Sulphuric Acid-Mercury Method¹

This method depends upon the dissolution of oxide copper by dilute sulphuric acid and amalgamation of metallic copper, native and that resulting from the decomposition of cuprous oxide, thus separating intact sulphide copper.

According to the copper content, 1 to 3 grams of the sample are heated at 80° to 90° C. for 30 to 45 minutes in a 150 cc. casserole with 50 cc. of 4% H₂SO₄, care being taken to avoid boiling. Cool then to room temperature and add 4 to 5 cc. clean mercury. Rub the mercury about the casserole with the finger or other object for 3 or 5 minutes until it is certain that all the particles of ore have come in contact with the mercury. Pour the supernatant solution, containing the sulphide minerals suspended in it into a beaker, taking care to retain the mercury in a single globule in the casserole. Wash the last traces of the ore into the beaker by means of a fine stream of water. The solution is now filtered and the copper determined by any suitable method.

The copper in the residue represents the sulphide, while that in the filtrate represents the so-called "oxide" or sulphuric acid soluble copper.

Short lodide Method for Copper

Dissolve 0.5 g. of the ore in 5 cc. of conc. HCl and 7 cc. conc. HNO₃, heating to boiling. Add 10 cc. 1:1 H₂SO₄. Evaporate to copious fumes. Cool; add 30 cc. of water; heat till soluble salts are in solution. Add bromine water and boil out excess bromine. Add NH₄OH till Fe(OH)₃ persists on shaking. Add 3 cc. 80% CH₂COOH. Cool under tap water. Add two grams NH₄F: stir till dissolved. The solution will remain turbid. Add two grams of KI in solution. Titrate with sodium thiosulfate.

ú

¹ Maier, Eng. and Min. Jour., Feb. 23, 1819, pp. 372-3.

FLUORINE


WILFRED W. SCOTT

f', at.wt. 19; D (air) 1.31^{15°}, sp.gr. (-187°) 1.14; m.p. -223; b.p. -187° C; acids, HF, H2SiF4.

DETECTION

Fluorine is the most active element known, and is by far the most active of the halogens, displacing chlorine, bromine, and iodine from their combinations.

Etching Test. The procedure depends upon the corrosive action of hydrofluoric acid on glass, the acid being liberated from fluorides by means of hot

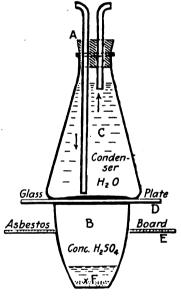

concentrated sulphuric acid. This test is applicable to fluorides that are decomposed by sulphuric acid. The reactions taking place may be represented as follows:

- I. $CaF_2+H_2SO_4=CaSO_4+2HF$.
- $SiO_2+4HF=2H_2O+SiF_4$

The test may be carried out in the apparatus shown in the illustration, Fig. 33. A clear, polished glass plate 2 ins. square, free from scratches, is warmed and molten wax allowed to flow over one side of the plate, the excess of wax being drained off. A small mark is made through the wax, exposing the surface of the plate, care being exercised not to scratch the glass. If the test is to be quantitative, the marks should be of uniform length and The powdered material is placed in a large platinum crucible (B) (a lead crucible will do); sufficient concentrated sulphuric acid is added to cover the sample. The plate (D) with the wax side down is placed over the Fig. 33.—Etching Test for Fluorine. crucible and pressed firmly down. To prevent the wax from melting, a condenser (C), with

flowing water, cools the plate. An Erlenmeyer flask (C) is an effective and simple form of condenser, though a metallic cylinder is a petter conductor of heat. A little water placed on the plate makes better contact with the condenser. As a further protection a wide collar of asbestos board (E) may be placed as shown in the figure. In quantitative work, where a careful regulation of heat is necessary, the crucible is placed in a casserole with concentrated sulphuric acid or in a sand bath, containing a thermometer to register the temperature. The run is best conducted at a temperature of 200° C. (not over 210°-H₂SO₄ fumes).

After an hour the wax is removed with hot water and the plate wiped clean, and examined by reflected light for etching. A test is positive when the mark can be seen from both sides of the glass. Breathing over the etched surface intensifies the mark.

Treatment of Fluo-Silicates not Attacked by Sulphuric Acid. powdered material is mixed with about eight times its weight of sodium carbonate and fused in a platinum crucible. The cooled melt is extracted with water. Calcium fluoride is thrown out from the filtrate, according to directions under Preparation and Solution of the Sample. The fluoride may now be tested as directed in the etching test or as follows by the hanging drop test.

The Hanging Drop Test. The test depends upon the reaction 3SiF₄+3H₂O $=2H_2SiF_6+H_2SiO_2$.

If the material contains carbonates, it is calcined to expel carbon dioxide. Half a gram of the powdered dry material is mixed with 0.1 gram dried pre-

cipitated silica and placed in a test-tube, Fig. 34, about 5 cm. long by 1 cm. in diameter. A one-hole rubber stopper fits in the tube. A short glass tube, closed at the upper end, passes through the stopper extending about 3 mm. below. Two or three drops of water are placed in this small tube by means of a pipette, nearly filling it. Two cc. of concentrated sulphuric acid are added to the sample in the test-tube and this immediately closed by inserting the stopper carrying the hanging drop tube, exercising care to avoid dislodging the drop of water. test-tube is placed in a beaker of boiling water and kept there for thirty minutes. If an appreciable quantity of fluorine is present a heavy gelatinous ring of silicic acid will be found at the end of the hanging drop tube in the

It is important to have material, test-tube, and rubber stopper dry, so that the deposition may occur as stated.1

Fig. 34.

Hanging Drop Test for Fluorine.

Note. Dr. Olsen² makes the test by heating the sample in a small Erlenmeyer flask, with concentrated sulphuric acid. A watch-crystal with a drop of water suspended on its curved

surface is placed over the mouth of the flask. A spot etch is obtained in presence of fluorine.

Fig. 35.

Black Filter Paper Test. According to Browning, small amounts of fluoring may be detected by the converse method for detection of silicates and fluosilicates (See silicon). The fluoride is · placed with a suitable amount of silica, in a small lead cup, 1 cm. in diameter and depth (Fig. 35); a few drops of concentrated sulphuric are added; the cup is covered by a flat piece of lead with a small hole in the center; upon the cover is placed a piece of moistened black filter paper and upon this a small pad of moistened filter paper. The cup

is heated on the steam bath for ten or fifteen minutes. A white deposit will

¹C. D. Howard; Jour. Am. Chem. Soc., 1906, 28, 1238-1239, C. N., 1906, 30.

Communicated to the author by J. C. Olsen.

² P. E. Browning, Am. Jour. Sci. (4), 32, 249. "Methods in Chemical Analysis," by F. A. Gooch.

be found on the under side of the black filter paper, over the opening in the cover, if fluorine is present in an appreciable amount. (0.001 gram CaF, or above, and 0.005 gram Na₂AlF₆ will give the test.)

ESTIMATION

The determination of fluorine in the evaluation of minerals used for the production of hydrofluoric acid is of technical importance. The demand for elimination of the use of fluorides for preservatives of food makes its estimation in small amounts of importance.

Fluorine occurs only combined. It is found abundantly combined with lime in the mineral fluorspar, CaF2. It occurs as cryolite, Na3AlF6; apatite, 3Ca₃(PO₄)₂CaF₂. It is found in mineral springs, ashes of plants, in bones, and in the teeth (CaF₂). It occurs sparingly, with aluminum and silicon, in topaz, and with cerium and yttrium in fluocerite, yttrocerite, also in wavellite, wagnerite, etc.

Preparation and Solution of the Sample

Fluorides of the alkalies, and of silver and mercury, are readily soluble; copper, lead, zinc, and iron fluorides are sparingly soluble; the alkaline earth fluorides dissolve in 100 cc. H₂O as follows: BaF₂=0.163 gram, SrF₂=0.012 gram, $CaF_2 = 0.0016$ gram.

Fluosilicates of potassium, sodium, and barium are slightly soluble in water and practically insoluble if sufficient alcohol is added.

Organic Substances.1 These are best decomposed by the lime method, the details of which are given in the chapter on chlorine under the section for the preparation and solution of the sample, p. 146. For fluorides in organic matter it is advisable to decompose the substance in a seamless nickel tube, 40 mm. long by 4-5 mm. bore. The end of the tube is sealed with silver solder. The lime used should be soluble in acetic acid. The tube is heated to vellow heat for two hours. The lime is then extracted with acetic acid and fluorine determined as calcium fluoride.

Silicious Ores and Slags. 0.5 to 1.0 gram of material is fused in a crucible with ten times its weight of sodium and potassium carbonates (1:1) and poured into an iron mould. If a porcelain crucible has been used, this is broken up and added to the cooled fusion. The mass is digested with about 200 cc. of hot water for an hour, the mass having been broken up into small lumps. (Kneeland recommends using an agate-ware casserole as diminishing the liability of subsequent bumping) then boiled briskly for ten minutes longer and filtered. the solution being caught in a large beaker. The residue is washed with hot water, followed by a hot solution of ammonium carbonate and the insoluble material rejected. The silica is removed with ammonium carbonate, followed by the zinc oxide treatment of the second filtrate, as described under the section of Separations. In presence of appreciable amounts of fluorides, the gravimetric precipitation of fluorine as calcium fluoride is recommended.

¹ H. Meyer and A. Hub, Monatsch. für Chem., 1910, 31, 933-938. C. N., 1910.

<sup>85, 489.

&</sup>lt;sup>2</sup> E. Kneeland, Eng. and Min. Jour., 80, 1212. A. H. Low, "Technical Methods"

Calcium Fluoride. The product is best decomposed by fusion with sodium and potassium carbonates, after mixing the fluoride with 2.5 times as much silicic acid, followed by ten times its weight of carbonates. Most of the silicic acid and all the fluorine will be changed to soluble alkali salts, while the calcium will be left as insoluble calcium carbonate. The mixture must be heated gradually to prevent the contents of the crucible from running over by the rapid evolution of carbon dioxide. The thin liquid fusion soon thickens to a pasty mass. The reaction is complete when there is no further evolution of carbon dioxide. The fused mass is now extracted with hot water as indicated above, and the soluble fluoride filtered from the calcium carbonate residue. Silicic acid is removed from the filtrate by addition of ammonium carbonate. Traces of silicic acid are removed from the filtrate taken to near dryness, after neutralizing the alkali with dilute hydrochloric acid (phenolphthalein indicator), by the zinc oxide emulsion method given under Separations. Fluorine is precipitated as calcium fluoride, according to the procedure given later on page 216.

Soluble Fluorides. See page 223.

Hydrofluoric Acid. See page 216. Also Vol. II Acids.

Valuation of Fluorspar. Perchloric Acid Method. One gram of fluorspar is treated with 15 cc. perchloric acid and 15 cc. of water in a suitable distillation flask and heated in an oil bath until the residue is almost dry. The distillation is continued with 10 cc. and finally 5 cc. portions of perchloric acid and equal amounts of water. Hydrofluoric acid may be determined as lead chlorofluoride in the distillate and water soluble residue analyzed for metals. If a residue analysis is desired treat first with H F evaporate and follow with perchloric acid. The residue is soluble in water or dilute HCl.

SEPARATIONS

Removal of Silicic Acid from Fluorides. This separation is frequently required, especially in samples where the sodium and potassium carbonate fusion has been required for decomposition of fluosilicates, or calcium fluoride mixed with silicic acid. (See Preparation and Solution of the Sample.)

To the alkaline solution about 5 to 10 grams of ammonium carbonate are added, the solution boiled for five minutes and allowed to stand in the cold for two or three hours. (Treadwell and Hall recommend heating to 40° C. and allowing to stand over night.) The precipitate is filtered off and washed with ammonium carbonate solution. The fluoride passes into the filtrate, while practically all of the silicic acid remains on the filter.

Small amounts of silica in the filtrate are removed by evaporating the solution to near dryness on the water bath, then neutralizing the carbonate with dilute hydrochloric acid (phenolphthalein indicator) added to the residue taken up with a little water. Upon boiling the pink color is restored, the solution then cooled and acid again added to discharge the color; this is repeated until finally the addition of 1-2 cc. of 2 N. HCl is sufficient to discharge the color. Four to 5 cc. of ammoniacal zinc oxide solution (moist ZnO dissolved in NH₄OH—Low recommends 20 cc. of an emulsion of ZnO in NH₄OH) is added and the mixture boiled until ammonia has been completely expelled. The precipitate of zinc silicate and oxide is filtered and washed with water. The fluoride is determined in the filtrate by precipitation with calcium chloride as directed later.

Separation of Hydrofluoric and Phosphoric Acids. The method of Rose modified by Treadwell and Koch, takes advantage of the fact that silver phosphate is insoluble in water, whereas silver fluoride is soluble. The alkaline solution of the salts of the acids (solution of the sodium carbonate fusions) is carefully neutralized with nitric acid and transferred to a 300-cc. calibrated flask. A slight excess of silver nitrate solution is added, and the mixture made to volume and thoroughly shaken. After settling, the solution is filtered through a dry filter, the first 10 to 15 cc. being rejected; 225 cc. of this filtrate is again transferred to a 300-cc. calibrated flask, the excess of silver precipitated by adding sodium chloride solution, and after diluting to the mark and shaking, the precipitate is again allowed to settle; 200 cc. of this solution is taken for analysis, after filtering as previously directed. This sample represents 50% of the original sample taken. Fluorine is now determined by one of the procedures outlined.

Separation of Hydrofluoric and Hydrochloric Acids. The solution containing hydrofluoric and hydrochloric acids, in a platinum dish, is treated with nitric acid and silver nitrate. The chloride is precipitated as the silver salt, whereas the fluorine remains in solution and may be filtered off through a glass funnel coated with paraffine or wax, or a hard rubber funnel. In presence of phosphoric acid, silver nitrate added to the solution will precipitate the phosphate as well as the chloride, whereas the fluoride remains in solution. The phosphate may be dissolved out from the chloride by means of dilute nitric acid.

Separation of Hydrofluoric and Boric Acids. An excess of calcium chloride is added to the boiling alkali salt solutions of the two acids. The precipitate is filtered off and washed with hot water. The residue, consisting of calcium fluoride, borate and carbonate, is gently ignited and then treated with dilute acetic acid, taken to dryness, and the residue taken up with acetic acid and water. Calcium acetate and borate are dissolved, whereas the fluoride remains insoluble and may be filtered off and determined.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF FLUORINE

Precipitation as Calcium Fluoride

The method utilizes the insolubility of calcium fluoride in dilute acetic acid in its separation from calcium carbonate, the presence of which facilitates filtration of the slimy fluoride. The reaction for precipitation is as follows:

$$2NaF+CaCl_2=CaF_2+2NaCl.$$

Procedure. Solution of the sample and the removal of silica having been accomplished according to procedures given under Preparation and Solution of the Sample, and Separations, the solution is neutralized, if acid, by the addition of sodium carbonate in slight excess; if basic, by addition of hydrochloric acid in excess, followed by sodium carbonate. To this solution, faintly basic, 1 cc. of twice normal sodium carbonate reagent is added, followed by sufficient

¹ Z. anal. Chem., **43**, 469, 1904. "Analytical Chemistry," Vol. **2**, by Treadwell and Hall. John Wiley and Sons.

calcium chloride solution to precipitate completely the fluoride and the excess of carbonate, i.e., until no more precipitate forms, and then 2-3 cc. in excess. After the precipitate has settled, it is filtered and washed with hot water. (The filtrate should be tested for fluoride and carbonate with additional calcium chloride.) The precipitate of calcium fluoride and carbonate is dried and transferred to a platinum dish, the ash of the filter, burned separately, is added and the material ignited. After cooling, an excess of dilute acetic acid is added, and the mixture evaporated to dryness on the water bath. The lime is converted to calcium acetate, while the fluoride remains unaffected. The residue is taken up with a little water, filtered and washed with small portions of hot water, by which procedure calcium acetate is removed, while calcium fluoride remains on the filter. The residue is dried, separated from the filter and ignited. This, together with the ash of the filter, is weighed as calcium fluoride, CaF₂.

To confirm the result, the residue is treated with a slight excess of sulphuric acid and taken to fumes in a platinum dish. The adhering acid is removed as usual by heating with ammonium carbonate, and the ignited residue weighed as calcium sulphate. One gram of calcium fluoride should yield 1.7436 grams of calcium sulphate.²

 $CaO \times 1.3924 = CaF_1$, or $\times 0.677 = F$.

Factors. $CaF_2 \times 0.4867 = F$, or $\times 0.5126 = HF$, or $\times 1.0757 = NaF$. $CaSO_4 \times 0.5735 = CaF_2$.

Precipitation of Fluorine as Lead Chlorofluoride

The method, worked out by Starck, takes advantage of the double halide formed by action of lead chloride upon a soluble fluoride. The compound, PbFCl, is about fourteen times the weight of the fluorine it contains. Unfortunately, the compound is quite appreciably soluble in water, so that a loss occurs if pure water is used for washing the precipitate. The method is limited to the determination of soluble fluorides.

The sample, made neutral, is treated with a large excess of a cold saturated solution (200 cc. PbCl₂ per 0.1 gram NaF in 50 cc. solution) of lead chloride, the precipitate, settled over night, is filtered off in a weighed Gooch crucible, washed several times with a saturated solution of lead chlorofluoride, and finally two or three times with ice-cold water. The compound is dried two hours at 140-150° C., and weighed as PbFCl.

¹The results are slightly low, owing to the solubility of calcium fluoride: 100 cc. H₂O dissolves 0.0016 gram CaF₂; 100 cc. 1.5 N. HC₂H₂O₂ dissolves 0.011 gram.

²Low recommends disintegration of the fluoride with sulphuric acid, diluting

Low recommends disintegration of the fluoride with sulphuric acid, diluting the mixture with water, boiling with ammonium chloride, and then with ammonium hydroxide and hydrogen peroxide. Calcium oxalate is now precipitated from the filtrate and CaO determined by titration with standard permanganate according to the usual procedure for determination of lime.

the usual procedure for determination of lime.

*Z. anorg. Chem., 70, 173 (1911); Chem. Abs., 5, 2049 (1911).

*One hundred grams H₂O at 18° C. dissolves 0.0325 gram PbFCl and 0.1081 gram at 100° C.

VOLUMETRIC METHODS FOR THE DETERMINATION OF FLUORINE

Volumetric Determination of Fluorine—Formation of Silicon Tetrafluoride and Absorption of the Evolved Gas in Water. Offerman's Method ¹

Silicon tetrafluoride is formed by the action of sulphuric acid upon a fluoride in presence of silica, the evolved gas is received in water and the resulting compound titrated with standard potassium hydroxide. The following reactions take place:

- A. $3SiF_4 + 2H_2O = 2H_2SiF_6 + SiO_2$.
- B. $H_2SiF_6+6KOH=6KF+SiO_2+4H_2O$.

The method is suitable for determining fluorine in fluorspar in evaluation of this mineral.

Procedure. The powdered sample, containing the equivalent of 0.1-0.2 gram calcium fluoride, is mixed with about ten times its weight of pulverized quartz (previously ignited and kept in a desiccator), placed in the decomposition flask F, shown in Fig. 36, and about 1 gram of anhydrous copper sulphate

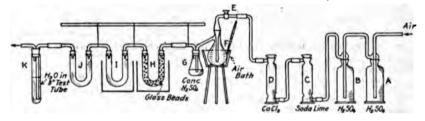


Fig. 36.

added, followed by 25 cc. of concentrated sulphuric acid. The stopcock E is closed and the air bath heated gradually till in one-half hour the temperature has risen to 220° . The cock E is now opened and air slowly forced through the apparatus (by means of water pump) at the rate of about three bubbles per second, the temperature being kept at 220° , and the flask containing the sample occasionally shaken. When the bubbles of silicon tetrafluoride have disappeared from F, the flame is removed, but the air current continued for half an hour longer. The solution in the receiving flask is now titrated with 0.1 N. KOH.

Notes. The apparatus shown in the cut is the form recommended by Adolph, and the details of procedure are essentially his. This method is preferred to that of Penfield, in which an alcoholic solution of potassium chloride is used to absorb the tetrafluoride, and the liberated hydrochloric acid titrated with the standard alkali in presence of cochineal indicator.

The results obtained by this method are generally low, but the procedure is useful for rapid valuation of fluorspar.

² Am. Chem. Jour., 1, 27 (1879).

¹Z. angew. Chem., **3**, 615 (1890). Wm. H. Adolph, Jour. Am. Chem. Soc., **37**, 11, 2500 (1915).

The following suggestions for the method are made by W. V. Norris, Colorado School of Mines.

It is especially necessary that all apparatus be dry, as the least amount of moisture will make the results run low. For this reason it is better to use phosphoric anhydride in washing bottle, "B," instead of sulphuric acid.

The sulphuric acid used should be previously treated as follows:—Heat 500 cc. of acid to white fumes, cool, warm gently but not to fumes, then again cool in a desiccator until ready for use. This will produce an acid that will be an efficient dehydrator and will give off no free sulphur trioxide.

It is advisable to use a large excess of silica in the generator apparatus,

preferably ten times the weight of the sample taken.

The copper sulphate must be anhydrous, and can best be obtained by heating very thin layers of the pure blue crystals, in an oven for about five hours at 215° C.

Adhere strictly to the directions of keeping the temperature in the flask

at 220° C., as that temperature will give the maximum recovery.

The bottles "A," "B," "C" and "D" are for the purpose of thoroughly drying the air. "G" contains strong sulphuric acid, prepared as suggested above. "H" is filled with glass beads, to remove sulphuric acid spray; "I" and "J" are empty tubes which should be thoroughly dry. The gas is completely absorbed in tube "K."

The run having been made as directed, the solution in tube "K" is poured into a beaker, an excess of standard potassium hydroxide added and the excess alkali titrated with standard sulphuric acid, to the boiling solution. Norris prefers the use of litmus indicator to phenolphthalein, claiming that the end

point is sharper.

It is found advisable to use mercury in the tube "K" as a trap, thus preventing the stoppage of the delivery tube by crystallization. The gas readily passes up through the mercury and is absorbed in the supernatant solution.

In place of using N/10 solutions the potassium hydroxide may be made of such strength that 1 cc. will equal 1% fluorine with 0.5 g. sample taken and the acid made to a corresponding strength.

Colorimetric Determination of Fluorine—Method of Steiger² and Merwin³

The method is based on the bleaching action of fluorine upon the yellow color produced by oxidizing a solution of titanium with hydrogen peroxide. A known amount of titanium in solution is mixed with definite volume of the solution containing the fluorine and the tint compared with a standard solution containing an equivalent amount of titanium. The extent of bleaching enables the computation of the fluorine present. The method is applicable to determination of fluorine in amounts ranging from 0.00005 to 0.01 gram. Merwin has shown that large amounts of alkali sulphates have a bleaching action similar to fluorine. Addition of free acid, or rise of temperature, intensifies the color lost by bleaching. Aluminum sulphate has no marked effect on standard solutions, or on solutions bleached by alkali sulphates, but it restores the color to a considerable degree to solutions bleached by fluorine. Ferric sulphate has a similar effect. Phosphoric acid bleaches a standard solution. Silica has little

² G. Steiger, Jour. Am. Chem. Soc., 30, 219, 1908.

³ H. E. Merwin, Am. Jour. Sci. (4), 28, 119, 1909. Chem. Abs., 3, 2919 (1909). J. W. Millor, "A Treatise on Quantitative Inorganic Analysis." Chas. Griffin & Co.

effect. According to Merwin an accuracy of 0.002 gram may be expected, an error which is half that of the most reliable gravimetric method.

Reagents. Standard Titanium Solution. An intimate mixture of 1 gram of TiO₂ and 3 grams of ammonium persulphate is heated until the vigorous action has ceased, and the ammonium sulphate is expelled. The residue is treated with 20 cc. of strong sulphuric acid, heated to fuming and, when cold, poured into about 800 cc. of cold water. When the suspended salt has dissolved, 57.5 cc. of strong sulphuric acid are added, and the solution made up to 1000 cc. (50 cc. or more of the solution should be analyzed for TiO₂). One cc. will contain 0.001 gram TiO₂.

Standard Fluorine Solution. 2.21 grams of sodium fluoride, which has been purified by recrystallizing, washing, and igniting strongly, is dissolved in 1000 cc. of water. One cc. will contain 0.001 gram fluorine.

Sulphuric Acid. 95.5% solution, sp.gr., 1.84.

Hydrogen Peroxide. Ordinary strength.


Standard Colored Solution. The solution used in determining fluorine in materials fused with alkali carbonates contains 10 cc. of the titanium solution, 4 cc. of hydrogen peroxide, and 4 cc. of concentrated sulphuric acid.

Apparatus. Nessler Tubes 6 cm. long, 2.7 cc. in diameter are recommended by the authors. Colorimeters may be used in place of Nessler tubes. A very suitable type for this purpose is shown on page 283, Fig. 43.

Procedure. Two grams of the powdered sample are fused with 8 grams of mixed sodium and potassium carbonates, the fusion taken up with hot water, and when leached, 3 to 4 grams of ammonium carbonate added. The mix is warmed for a few minutes and then heated on the water bath till the ammonium carbonate is decomposed and the bulk of liquid is small. Silica, ferric oxide, and alumina oxide are thrown down and are removed by filtration. The filtrate, which should not exceed 75 cc., is treated with 4 cc. of hydrogen peroxide, and then 10 cc. of standard titanium solution cautiously added (H₂O₂ prevents precipitation of TiO₂ by the alkali carbonates), followed by 4 cc. of strong sulphuric acid to neutralize the alkali carbonates. The solution, neutral or slightly acid, acquires a light orange tint. A little sodium carbonate is added in just sufficient amount to discharge the color, and then a drop or so of acid to again restore it. The amount of excess acid now required depends upon the amount of fluorine present in the solution. For amounts of fluorine less than 0.0025 gram (0.125% of sample), 3 cc. of acid are added. For amounts of 0.0025 to 0.012 gram fluorine, 12 cc. of acid are added. The solution is diluted to 100 cc.

Comparison. The test solution is now compared with the standard solution containing 10 cc. titanium reagent, and the same amount of acid and hydrogen peroxide as in the test sample, in a volume of 100 cc. If Nessler tubes are used, these are held over a white surface illuminated with diffused light. In the absence of a bleaching substance, such as fluorine, the two solutions will have the same tint, but in presence of fluorine the bleaching effect will cause the test solution to appear paler than the standard. The depths of the liquids are adjusted so that the tubes will have the same intensity of color when moved from right to left or reversed. Should the left eye perceive a darker shade, the tube on the left will appear uniformly darker whether it be the test sample or the standard. The comparative depths of the liquids in the tubes are measured and the ratio obtained by dividing the depth of the fluorine solution by the depth of the standard and multiplying by 100. Reference may be made to the

plotted curve shown in Fig. 37. The ratio $\frac{\text{Depth of F Sol.}}{\text{Depth of Standard}} \times 100 = \text{the}$

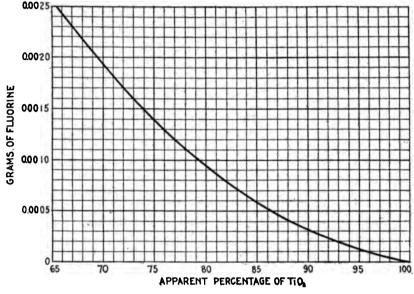

F1G. 37.

abscissa, while the ordinate represents the amount of fluorine in the 2-gram sample.

Example. Suppose the test solution = 3.6 cm. and the standard = 4.5 cm.,

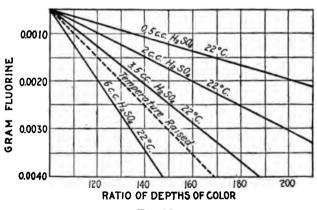


Fig. 38.

the ratio then =80, from the curve it is evident that the fluorine =0.00095 gram or 0.0475%, since a 2-gram sample was taken.

According to Merwin, however, the bleaching effect of alkali sulphates, which are present, will make the ratio much higher than it would be if they were absent. (The sulphates alone give a ratio of 125.) This ratio should be determined on two 8-gram portions of the alkali carbonate mixture used in the fusion and the correction made accordingly. If m=ratio of the blank thus obtained, and r the ratio of the final test, then the formula, according to Merwin, is $\frac{r-m}{23,000}$ =gram fluorine in the sample, 4 cc. excess sulphuric acid being used

in the samples, or $\frac{r-m-3}{6300} = \text{grams F}$, if 12 cc. of acid are used in testing larger amounts of fluorine. The plotted curve, Fig. 38, is that given by Merwin, and shows the effect of acidity on the depth of color obtained. The abscissa represents the ratio of the solutions, and the ordinate the amount of fluorine in grams. Temperature of the tests was 22° C.

VALUATION OF FLUORSPAR

The following procedure, worked out by Dr. Bidtel, meets the commercial requirements for the valuation of fluorspar. The determinations usually required are calcium fluoride, silica, and calcium carbonate; in some particular cases lead, iron, zinc, and sulphur.

Procedure. Calcium Carbonate. One gram of the finely powdered sample is placed in a small Erlenmeyer flask, 10 cc. of 10% acetic acid are added, a short-stemmed funnel inserted in the neck of the flask as a splash trap, and the mixture heated for an hour on a water bath, agitating from time to time. The calcium carbonate is decomposed and may be dissolved out as the soluble acetate, whereas the fluoride and silica are practically unaffected. The solution is filtered through a 7-cm. ashless filter, the residue washed with warm water four times, and the filter burned off in a weighed platinum crucible at as low a temperature as possible. The loss of weight minus 0.9015 gram (the amount of calcium fluoride soluble in acetic acid under the conditions named) is reported as calcium carbonate.

Silica. The residue in the platinum crucible is mixed with about 1 gram of yellow mercuric oxide, in form of emulsion in water (to oxidize any sulphide that may be present); any hard lumps that may have formed are broken up, the mixture evaporated to dryness and heated to dull redness, then cooled and weighed. About 2 cc. of hydrofluoric acid are added and the mixture evaporated to dryness. This is repeated twice to ensure complete expulsion of silica (as SiF₄). A few drops of hydrofluoric acid are then added, together with some macerated filter paper, and a few drops of ammonium hydroxide to precipitate the iron. The solution is evaporated to dryness, heated to dull redness, cooled and weighed. The loss of weight is reported as silica.

Calcium Fluoride. The residue is treated with 2 cc. of hydrofluoric acid and 10 drops of nitric acid (to decompose the oxides), the crucible covered and placed on a moderately warm water bath for thirty minutes, the lid then removed and the sample taken to dryness. The evaporation with hydrofluoric acid is repeated to ensure the transposition of the nitrates to fluorides, and if

¹ Dr. E. Bidtel, Chemist, Fairview Fluorspar and Lead Company, Jour. Ind. Eng. Chem., Vol. 4, No. 3, March, 1912.

residue is still colored, hydrofluoric acid again added and the mixture taken ryness a third time; then a few drops of hydrofluoric acid are added and c. of ammonium acetate solution (the acetate solution is made by neutral-: 400 cc. of 80% acetic acid with strong ammonia, adding 20 grams of citric and making the mixture up to 1000 cc. with strong ammonium hydroxide). mixture is digested for thirty minutes on a boiling water bath, then filtered washed with hot water containing a small amount of ammonium acetate. finally with pure hot water. (Several washings by decantation are advis-The residue is ignited in the same crucible and weighed as calcium fluoride. ddition of 0.0022 gram should be made to compensate for loss of CaF. 'ure calcium fluoride is white. To test the purity of the residue, 2 cc. of huric acid are added and the material taken to fumes to decompose the ide; 1 cc. of additional sulphuric acid is added and the excess of acid lled by heating. The residue is weighed as calcium sulphate. This is now I with sodium carbonate, and the fusion treated with hydrochloric acid cess. If barium is present the solution will be cloudy (=BaSO₄.)

ANALYSIS OF SODIUM FLUORIDE

reparation of the Sample and Insoluble Residue. Ten grams of the ple are dissolved in 250 cc. of water in a beaker, and boiled for five minutes, filtered into a liter flask through an ashless filter; the residue is washed with ral portions of water and ignited. This is weighed as insoluble residue. filtrate and washings are made to 1000 cc. with distilled water.

sodium Fluoride. Fifty cc. of the solution equivalent to 0.5 gram of ple are diluted to 200 cc. in a beaker, 0.5 gram sodium carbonate is added the mixture boiled. An excess of calcium chloride solution is now added by and boiled for about five minutes. A small amount of paper pulp is in to prevent the precipitate from running through the filter, the precipitate well to settle and then filtered, using a 9-cm. S. & S. 590, or B. & A. e A, filter paper. The fluoride is washed twice by decantation, and four we times on the filter with small portions of hot water. The final washings ald be practically free of chlorine.

The residue is ignited in a platinum dish, then treated with 25 cc. of acetic, and taken to dryness. This treatment is repeated and the residue taken with a little hot water and filtered. The calcium fluoride is washed free of um acetate with small portions of water, remembering that CaF₂ is slightly ple in water. The ignited residue is weighed as CaF₂.

$$CaF_{\bullet} \times 1.0757 = NaF$$
.

sodium Sulphate. To the filtrate from calcium fluoride is added 10 cc. ochloric acid and then a hot solution of barium chloride. The BaSO₄ is ved to settle, filtered, washed, dried, ignited, and weighed as usual.

$$BaSO_4 \times 0.6086 = Na_2SO_4$$

iodium Carbonate. Sodium carbonate is determined on a 5-gram sample he usual method for carbon dioxide as described in the chapter on Carbon. Approximate results may be obtained by adding a small excess of normal huric acid to 5 grams of the fluoride in a platinum dish, boiling off the carbon

dioxide, and titrating the excess of acid with normal caustic, using phenolphthalein indicator.

One cc. N. $H_2SO_4 = 0.053$ gram Na_2CO_3 .

 $H_{\bullet}SO_{\bullet} \times 1.0816 = Na_{\bullet}CO_{\bullet}$

Sodium Chloride. Fifty cc. of the sample is titrated with N/10 AgNO₃ solution.

Silica. This is probably present as sodium fluoride and silicate. One gram of the sample is dissolved in the least amount of water and a small excess of hydrofluoric acid added to convert the silicate to silico-fluoride, then an equal volume of alcohol. After allowing to stand for an hour, the precipitate is filtered, washed with 50% alcohol until free of acid and the filter and fluoride are placed in a beaker with 100 cc. of water, boiled and titrated with N/10 NaOH.

One cc. N/10NaOH = 0.0015 gram SiO_2 or 0.0047 gram Na_2SiF_6 .

Volatile Matter and Moisture. One-gram sample is heated to dull redness to constant weight. Loss of weight is due to moisture and volatile products.

DETERMINATION OF TRACES OF FLUORINE

An approximate estimation of traces of fluorine may be made by utilizing the method outlined for detection of this element. The apparatus 1 is the same, with the exception that the crucible rests in a paraffine 2 bath containing a thermometer to regulate the temperature. A casserole may be used to hold the paraffine. By varying the amounts of substance tested an etch is obtained that is comparable with one of a set of standard etches, obtained with known amounts of fluorine in form of calcium fluoride, added to the same class of material examined.

The conditions in obtaining the standard etches and those of the tests should be the same. This applies to the temperature of the paraffine bath, duration of the run, size of mark exposing the surface of the test-plate, and the general mode of procedure.

Note. The importance of regulating the temperature may be seen by the results obtained by Woodman and Talbot. With a temperature of 79-82° C., one part of fluorine may be detected in 25 to 100 thousand parts of material; by raising the temperature to 136° C., the delicacy of the procedure is increased to one part of fluorine in 1 to 5 million parts. The limit of delicacy is apparently reached at 213-218° C. (i.e., 1 part F per 25 million).

¹ A metal condenser, such as is recommended for mercury determinations, may be used and the paraffine bath substituted by an electric heater automatically controlled.

² Crisco is claimed to be better than paraffine, as this does not give off any unpleasant fumes when heated.

GLUCINUM (BERYLLIUM)

W. W. Scott.

Gl, at.wt. 9.1; sp.gr. 1.85^{20°}; m.p. > 960° C.; oxide, GlO.

DETECTION

In the usual course of analysis glucinum will be precipitated by ammonia along with iron and aluminum hydroxides. Silica having been removed by evaporation to dryness of the acid solution of the substance, extraction of the residue with dilute hydrochloric acid and subsequent filtration; the members of the hydrogen sulphide group are precipitated from slightly acid solution by hydrogen sul-The filtrate is concentrated to about 30 cc., and about 2 grams of sodium peroxide are added to the cooled liquid, which is now heated to boiling and filtered. Fe(OH): remains insoluble, if iron is present, while aluminum and glucinum dissolve. The filtrate is acidified with nitric acid, and ammonia then added in excess. If a precipitate forms, alumina or glucinum or both are indicated. Glucinum hydroxide and aluminum hydroxide cannot be distinguished by appearance; the solubility of the former in sodium bicarbonate solution makes it possible to separate the two. The precipitate is dissolved in acid and the solution made almost neutral with ammonia. Solid sodium bicarbonate is added in sufficient amount to make the solution contain 10% of the reagent and the mixture heated to boiling, then filtered. Alumina hydroxide remains on the filter paper and glucinum passes into the filtrate, in which it may be detected by diluting to ten volumes with water and boiling, whereupon glucinum hydroxide precipitates.

Glucinum hydroxide, Gl(OH)₂, is precipitated from neutral or acid solution by ammonia, insoluble in excess (distinction from Al(OH)₂). It is precipitated by sodium and potassium hydroxides, soluble in excess (separation from iron); if this solution is boiled Gl(OH)₂ is reprecipitated, Al(OH)₃ remains in solution. Gl(OH)₂ is soluble in an excess of ammonium carbonate, Al (OH)₃ is insoluble.

ESTIMATION

Glucinum occurs in the minerals beryl, euclase, davalite, chrysoberyl, helvite, leucophane, phencaite.

The oxide, GlO, is soluble in strong sulphuric acid. It is decomposed by fusion with potassium fluoride. The freshly precipitated hydroxide, Gl(OH)₂, is easily soluble in dilute acids, in alkalies and alkali carbonates and bicarbonates.

The methods of preparation and solution of the sample are the same as those described for the estimation of aluminum. For details of these procedures the analyst is referred to the chapter on this element.

SEPARATIONS

Removal of Silica and Members of the Hydrogen Sulphide Group. See procedure given under "Detection."

Separation of Glucinum from Iron and Manganese. The acid solution is nearly neutralized with ammonia and then poured with constant stirring into an excess of a cold mixture of ammonium sulphide and carbonate. Iron and manganese are precipitated, whereas glucinum passes into the filtrate. (Zirconium and yttrium will be found with glucinum, if they are present in the material examined.)

Separation from Zirconium and Yttrium. The filtrate obtained from the separation of iron and manganese is boiled for an hour, the precipitate is filtered and washed, then dissolved in dilute hydrochloric acid. To this solution is added an excess of sodium hydroxide, zirconium and yttrium are precipitated, whereas glucinum remains in solution. After filtering, glucinum may be precipitated by boiling the diluted filtrate.

Separation from Aluminum, Chromium and Iron. The elements precipitated as hydroxides are ignited to oxides and fused with sodium carbonate for an hour or more. Upon leaching with water, aluminum and chromium dissolve, while iron and glucinum remain insoluble. The oxides of glucinum and iron may be separated by fusion with sodium acid sulphate, extracting with water and precipitating the iron with an excess of sodium hydroxide, glucinum remaining in solution.

Separation of Glucinum from Aluminum. The hydroxides of alumina and glucinum are precipitated with ammonia and the precipitate treated with an excess of ammonium carbonate. Gl(OH)₂ dissolves, whereas Al(OH)₃ remains insoluble. See Detection, also Gravimetric Method for Determination of Glucinum.

GRAVIMETRIC DETERMINATION OF GLUCINUM

The procedure recommended by Parsons and Barnes depends upon the solubility of glucinum hydroxide in a 10% sodium bicarbonate solution, in the separation of this element from iron and aluminum hydroxide precipitate, with which it is commonly thrown out from solution. (Uranium, if present, also dissolves.)

Procedure. Silica and the members of the hydrogen sulphide group having been removed by the usual methods (See Detection), hydrogen sulphide is expelled by boiling, nitric acid is added in sufficient amount to oxidize iron (the hydrochloric acid solution turns yellow) and ammonium hydroxide added in slight excess. The precipitated hydroxides are allowed to coagulate by heating to boiling and, after settling a few minutes, filtered and washed with a 2% solution of ammonium acetate containing free ammonia.

Separation from Iron and Aluminum Hydroxide. The precipitate is dissolved in hydrochloric acid, the solution oxidized with nitric acid or hydrogen peroxide (C.P.), if necessary, and the free acid then neutralized with ammonia. To the cold solution are added 10 grams of sodium bicarbonate for each 100 cc.

⁴C. L. Parsons and S. K. Barnes, Jour. Am. Chem. Soc., 28, 1589, 1906.

of liquid. The mixture is heated to boiling and boiled for one minute, then cooled and filtered. The residue is washed with hot 10% solution of sodium bicarbonate. Iron and aluminum hydroxides remain on the filter and glucinum passes into the filtrate.

To recover occluded glucinum from the hydroxides of iron and alumina, the precipitate is dissolved in a few drops of hydrochloric acid, and the precipitation repeated. It is advisable to repeat this treatment a third time,

adding the filtrates to the first portion containing the glucinum.

Precipitation of Glucinum. The combined filtrates from the alumina and iron hydroxides are acidified with strong hydrochloric acid, the beakers covered to prevent loss by spurting and the carbon dioxide completely removed by boiling. (CO₁ remaining in solution would form ammonium carbonate, on subsequent treatment with ammonia, which would dissolve glucinum.) A slight excess of ammonia is now added, the mixture again boiled and the precipitated glucinum hydroxide allowed to settle, then filtered and washed with a 2% solution of ammonium acetate containing free ammonia, until the chlorides are removed. After ignition the residue is weighed as glucinum oxide, GlO.

$GlO \times 0.3626 = Gl.$

 $^1\mathrm{Prolonged}$ boiling would cause the loss of too much CO2, so that Al(OH)2 would be apt to pass into solution. The evolution of CO2 may be mistaken for boiling.

W. G. DERBY

Au, at.wt. 197.2; sp.gr. 19.33; m.p. 1063; b.p. 2530°C; oxides, Au₂O, Au₂O₂

DETECTION

Because of the limited application and tediousness of wet methods, the detection of a small quantity (2 parts per million or less) of gold in a mineral or base met l is most positively carried out by furnace methods of assaying. Wet methods of detection of traces of gold can be applied only to solutions free of colored salts and elements precipitated by the reagents employed. As a rule, in the treatment of an unknown substance, advantage is taken of the solubility of most metals and their compounds, and insolubility of gold by one of the mineral acids.

Detection of Gold in Alloys. In metals or alloys which produce colorless solutions with dilute nitric acid, gold, in the absence of other insoluble matter, exhibits itself as a black or brownish residue which settles readily, and from which the liquid can be separated by careful decantation. If unassociated with metals of the platinum group, this residue will become yellowish brown on heating with strong nitric acid.

In copper, nickel and such alloys, which leave a residue of sulphur, carbon or silicious matter on treatment with dilute nitric acid, the solution is filtered through double ashless filters and the filter and residue incinerated in a porcelain crucible. The residue, which may require pulverizing, is digested for a few minutes with aqua regia, and the dilute, filtered solution evaporated to dryness by heating below 200° F. Just as soon as dry, the mass is moistened with the least quantity of hydrochloric acid and the purple of Cassius test applied to its water solution in a small volume. This test is made by adding a solution of stannous chloride, containing stannic chloride. In strongly acid and concentrated gold solutions a precipitate of brown metallic gold is obtained. If the solution is but slightly acid and dilute, a reddish purple color is produced by colloidal gold and the stannic acid. The tint fades on standing. Addition of ammonia produces a red coloration.

This test applied to 1 part of gold in 600,000 of solution will impart a perceptible shade; to double this quantity, a mauve color. When gold is present in somewhat greater proportion a flocculent precipitate will form.

Test for Gold in Minerals. From minerals, in which the metal exists in unalloyed, or uncombined state, gold may be extracted by iodine in potassium iodide solution, or by chlorine or bromine water. All minerals containing sulphides should be roasted. In natural or roasted state the sample should be ve y finely pulverized, and usually yields the gold best if first digested with nitric acid and washed free of soluble salts. The sample in a flask is covered with bromine water, the flask closed with a plug and shaken frequently during a period of three

or four hours. The purple of Castius test is applied to the extract, removed by decantati n after (on entration.

If it is evident that base metals are present in the bromine water extract in quantity sufficient to mask the purple of Cassius test, hydrogen peroxide is added to the concentrated liquid, slightly alkaline with sodium or potassium hydroxide or carbonate. After boiling the solution until hydrogen peroxide is removed, precipitated hydroxides or carbonates are dissolved by hydrochloric acid. Gold in exceedingly small quantity exhibits itself as a light-brown residue on a fine filter. This indication should be confirmed by a purple of Cassius test on the aqua regia solution of the residue; the test carried out in the same manner as on the residue from a solution of a metal.

Benzidine Acetate Tests. Maletesta and Nola: make use of benzidine acetate (1 gram benzidine dissolved in 10 cc. acetic acid and 50 cc. water) as a reagent in the detection of gold and platinum in quite dilute solutions. Gold gives a blue soloration which gradually changes to violet. The coloration is green in the presence of free acetic acid, changing to blue with addition of benzidine in excess. Platinum gives a blue flocculent precipitate, the formation of which is pronoted by heating. Free mineral acids have no influence on the gold and retard the platinum reaction only in the cold. Since ferric salts give a blue coloration, stable only in excess of benzidine, their absence must be assured before application of the test for the precious metals. The limit of sensitiveness of the test is 35 parts for gold and 125 parts for platinum per 10,000,000.

Phenylhyd azine Acetate Test. E. Pozzi Escot 3 adds phenylhydrazine acetate to a very dilute gold solution which contains an excess of an organic acid (formic or citric). A violet coloration, permanent for several hours, is imparted. The depth of color is proportional to the quantity when the gold is present in less amount than one part in 500,000.

ESTIMATION

Solubility

Gold in massive form is practically insoluble in pure nitric, sulphuric or hydrochloric acids, but in the presence of oxidizing agents, is attacked appreciably by sulphuric, and actively by hydrochloric acid. Gold is found in minute quantity in the nitric acid solution of its alloys and in such as contain selenium, the amount may be a large part of the total present.

Gold is attacked energetically by aqua regia. Large amounts of gold are dissolved with requirement of least attention when the proportion of hydrochloric acid is several times that of the aqua regia formula, (3HCl: 1HNO₂).

Gold is dissolved by solutions of chlorine or bromine, by alkaline thiosulphates; in the presence of free oxygen by iodine in potassium iodide solution, by soluble cyanides, by fused potassium or sodium hydroxide; by fused potassium or sodium nitrate or sulphide. In a finely divided state, it is dissolved by a solution of potassium or sodium hydroxide.

Gold alloys quickly with molten lead. When in the form of bright, untarnished particles it alloys readily with mercury.

- Vanino and Seeman, Berichte, 32, 1968; Rossler, Zeit. Anal. Chem., 49, 733.
 Bull. Chim. Farm, 52, 461; Chem. Abs., April 20, 1397, 1914.
 Am. Chim. Anal. Appl., 1907, 12, 90; J.S.C.I., June 15, 1907, 645.
 Dewey, J.A.C.S., March, 1910, 318; E. Keller, Bull. Am. Inst. Min. Eng., 67, 681.

GRAVIMETRIC METHODS

Gold is always weighed in metallic state, and is determined most accurately in the form of the mass obtained by dilute nitric acid treatment of the silver alloy resulting from the operation of cupellation in the method of assaying by furnace processes. On account of tediousness in making complete separation from associated metals, and of uncertainty in collection of the product in a form suitable for accurate weighing, direct precipitation methods are never used for the valuation of gold-bearing material, but may be applied to the estimation of gold in plating baths, the Wohlwill parting electrolyte and solutions of similar type.

Precipitation of Gold. From such solutions of auric chloride, slightly acid with hydrochloric, freed of oxidizing agents by evaporation and displacement with hydrochloric acid, and containing but little of the salts of the alkalis or alkali earths, gold is separated from other than occluded platinum and palladium by precipitation with oxalic acid, ferrous sulphate, or hydrazine hydrochloride. The reactions are hastened by heat. When salts of the alkalis or earths are present, equally good separation and more complete precipitation can be obtained by addition of excess of sodium peroxide, boiling vigorously for a few minutes and then acidifying with hydrochloric acid. The precipitated metal is collected on an ashless filter paper, and after drying, weighed.

Gold precipitated from a very weak solution is in such fine form that it is not wholly retained by the finest paper.

Wet Gold Assay of Minerals

A wet gold assay, suitable for prospector's use, is carried out by covering one assay ton (29.17 grams), of the finely pulverized natural or roasted ore, in a porcelain mortar, with 50 cc. of a solution of 2 parts of iodine and 4 parts potassium iodide in 100 cc. of water. Sulphide ores should be roasted and digested with nitric acid before treatment with the iodine solution. Similar treatment is advantageously applied to all ores. The ore is ground in contact with the iodine solution and additions of the halogen are made whenever the liquid becomes color-The solution is then allowed to stand at least an hour. To the filtrate and washings from the pulp, in a glass-stoppered bottle or flask, are added 5 grams of gold free mercury. The liquid is shaken vigorously with the mercury until clear. The mercury is then transferred to a small porcelain casserole, washed with clean water and dissolved by warming carefully with 10 cc. nitric acid. The gold mass is washed free of nitrate of mercury by decantation, dried and annealed by heating in a casserole over a Bunsen flame, and the metal Each milligram represents an ounce per ton. Results obtained by this method of assaying are usually more than 50 per cent of the actual gold content.

Electrolytic Method. The gold content of a cyanide plating bath containing no potassium ferrocyanide may be estimated by electrolysis.²

Procedure. A measured quantity, 25 to 50 cc. in a tared platinum dish, is diluted to 1 cm. of the rim of the dish and using a carbon or platinum anode, elec-

² Electro Deposition of Metals, Langbein.

¹ De Luce, Min. Sci. Press, 100, 895; Hawson, Min. Sci. Press, 100, 936; Davis, Mines and Minerals, Oct., 1910, Feb., 1911; Austen, Inst. of Min. and Met., May 31, 1911.

trolyzed for about three hours at a current density ND₁₀₀ =0.067 amp. (.0.0043 per square inch). Completion of deposition is recognized by the lack of any deposit within fifteen minutes, on a platinum strip suspended on the rim of the dish. dish plus gold deposit is washed, rinsed with alcohol, dried at 212° and when cold weighed.

The following is a summary of the conditions of deposition of gold in compact form as described by Classen ¹ 3 grams potassium cyanide were added to a gold chloride solution containing 0.0545 grams of gold in 120 cc. This solution heated to about 55° C. when electrolyzed at a current density of ND₁₀₀=0.38 amp. (0.024 amp. per square inch) with a potential difference of 2.7-4.0 volts, deposited its gold content in one and a half hours. Time required for deposition is tripled if the electrolyte is at room temperature.

Miller deposited 0.1236 gram of gold in two and a quarter hours from 125 cc. of electrolyte at 50° C. containing 1 gram potassium cyanide by a current of ND₁₀₀= 0.03 amp. (0.002 amp. per square inch) and 2.5 volts.

Perkin and Preble suse an electrolyte containing ammonium thiocyanate in place of

potassium or sodium cyanide.

Gold is removed from the platinum electrode by warming with a solution of chromic anhydride in a saturated salt solution,4 or with a solution of potassium cyanide containing some oxidizing agent as hydrogen peroxide, sodium peroxide or alkali persulphate.

VOLUMETRIC METHODS

These methods are applicable to the determination of the strength of chloride of gold solutions used in photography, electro gilding, and as electrolyte in the Wohlwill parting process.

Preparation of the Sample. Nitric acid or nitrates in the solutions should be removed by repeated evaporations to syrup with addition of hydrochloric acid saturated with chlorine. Free chlorine or bromine should be removed by addition of ammonia to formation of permanent precipitate, then making the solution very slightly acid with hydrochloric acid and heating until the precipitate of fulminating gold dissolves. The gold solution should contain but little free hydrochloric acid, an excessive amount of which may be removed by ammonia.

Permanganate Method

Weak gold solutions should be concentrated whenever possible. The permanganate method, which is not applicable when the sample contains organic matter, depends upon the titration, after complete precipitation of gold, of the unoxidized portion of a measured quantity of an added reagent of a known gold precipitating value. The reagent may be ammonium or potassium oxalate, ferrous sulphate or ferrous ammonium sulphate in solutions varying from 5 to 25 milligrams gold precipitating value and is titrated with a permanganate solution of approximately equal oxidizing strength. One part of gold requires for precipitation 1.08 of ammonium oxalate, 1.40 of potassium oxalate, 4.22 of ferrous sulphate, 5.96

¹ Classen, "Quantitative Chemical Analysis by Electricity," Classen-Boltwood.

² J.A.C.S., Oct., 1904, 1255.

J.A.C.S., Oct., 1904, 1205.
Elec. Chem. and Met. Ind., 3, 490.
Classen-Boltwood, "Quantitative Chemical Analysis by Electricity."
Rose, "Met. of Gold," 5th Ed., 469.
Bull. Chim. Farmac., 1894, XXX, III, 35; Oestr. Zeit. f. Berg. und Hut., 182, 1880;
Sutton, "Volumetric Analysis," 10th Ed.; E. A. Smith, "Sampling and Assaying of Precious Metals"; Min. Eng. World, 37, 853.

parts ferrous ammonium sulphate, each in crystalline form. The most satisfactory precipitations are made with the iron salts. The standard solution of either should contain about 0.1 per cent of sulphuric acid. One part of gold, in solution as auric chloride, has an oxidizing value equivalent to 0.4808 part of potassium permanganate.

The precipitating value of 0.2548 gram of dry Sorenson's sodium oxalate is 250 milligrams of gold, and by titrating a solution of this amount of exalate in 250 cc. of water, aciduated with a few drops of sulphuric acid, the oxidizing value of the permanganate solution is obtained in terms of gold.

The value of the precipitating reagent and relative oxidizing value of the permanganate solution can be checked very accurately by adding a measured quantity of the reagent to an excess of gold chloride, filtering, washing thoroughly, incinerating and weighing the precipitate obtained in a tared porcelain crucible.

Procedure. In carrying out the determination of a gold solution, a measured or weighed portion is freed of oxidizing agents, a measured amount of the standard precipitating reagent added in slight excess of the amount required to decolorize the solution, and digestion on a steam bath or hot plate continued until the gold settles out, leaving a clear liquid. A few drops of sulphuric acid may be then added and, without filtering, titration performed. The gold value of the quantity of reagent added, minus that found of the excess of reagent, is the gold content of the amount of the sample taken.

Iodide Method

Small quantities of gold are determined by Gooch and Morley's iodide method. A measured or weighed portion of the gold solution is treated, as has been described for removal of oxidizing agents, with an excess of free hydrochloric acid. Potassium iodide solution is run into the cold liquid until the gold precipitated as aurous iodide is completely dissolved. Starch solution is then added, and the amount of N/1000 thiosulphate required to decolorize the liquid noted. From this amount is deducted the amount of N 1000 iodine required to just produce a perceptible rose tint in the liquid.

The reactions involved are AuCl₂+3KI = AuI+I₂+3KCl and I₂+2Na₂S₂O₂ = 2NaI+Na₂S₂O₃.

The gold value of the N/1000 solution of sodium thiosulphate should be determined by performance of the operations of the method on a known quantity of gold, similar in amount and contained in a volume of solution approximately equal to that of the analysis.

Lenher's Method. By Lenher's method ² of determining gold in solutions free of oxidizing agents, sulphurous acid of a reducing strength of 2-5 milligrams gold per cc. is used as the reagent. The sulphurous acid requires frequent standardizing by means of standard iodine or potassium iodide to which a definite amount of standard permanganate has been added or by a gold solution of known strength. Using starch as indicator, the iodine liberated by addition of potassium iodide can be titrated by sulphurous acid. Bromine liberated by potassium bromide according to the equation, AuCl₁+2KBr=AuCl+2KCl+Br₂, can be titrated by sulphurous acid. Excess of magnesium or sodium chloride gives to auric chloride a yellow color which by sulphurous acid can be titrated to the colorless or aurous state. These alkaline salts do not interfere in the potassium bromide or iodide reactions.

¹ Amer. Jour. Sci., Oct., 1899, 261; Min. and Eng. World, 37, 853; Vol. Am., 5utton, 10th Ed.; "Assaying of Precious Metal," E. A. Smith.

² Jour. Am. Chem. Soc., June, 1913, 735.

COLORIMETRIC METHODS

Practical application of these methods is made in the estimation of gold in the liquors produced in the treatment of ores by the cyanide process.

Prister's Method

By Prister's method 1 a slight excess of copper solution is added to a 100 to 200cc. portion of a cyanide solution in which the cyanide has been decomposed by boiling several minutes after acidifying with hydrochloric acid. Assurance of the presence of an excess of copper is made by spot test with a solution of potassium ferrocyanide.

The copper solution is made by boiling for ten minutes in contact with copper shavings, a solution of 1 part blue vitriol and 2 parts salt in 10 parts of water, and adding a little acetic acid on cooling. A few drops of a 1 to 2 % sodium sulphide solution are added, the liquid boiled for five minutes, the precipitate allowed to settle, and liquid separated by decantation on to a filter. The precipitate in the beaker and on the filter is dissolved with 2½ to 3 cc. of a 3 to 5% solution of potassium cyanide to which a few drops of potassium hydrate solution has been added.

Gold is precipitated from this cyanide solution (which may be turbid), by addition of 1 to 2 g ams of zinc dust and warming to 100° F. for half an hour. Liquid is separated by decantation through a filter. The residue on the filter and in the beaker is first treated with hydrochloric acid to dissolve zinc, then with 10 cc. aqua regia, the reagent being passed several times through the filter. Stannous chloride solution is then added to the liquid diluted to 20 cc. Comparison of the coloration produced is made with that from a standard solution of gold treated in the same manner.

Cassel's Method. By Cassel's method 2 0.5 gram potassium bromate is mixed with 10 to 50 cc. of the cyanide solution and concentrated sulphuric acid added gradually with constant agitation until reaction commences. When the reaction stops, saturated solution of stannous chloride is added dropwise until the liquid is just colorless. The tint produced is compared with that from a standard gold solution treated in the same manner.

Moir's Method. By Moir's method and a measured quantity of the cyanide solution is oxidized by addition of 1 to 2 grams of sodium peroxide and boiling. If sufficient sodium peroxide is present, the brown spot produced by addition of a few drops of lead acetate will immediately dissolve. The lead-aluminum couple formed by additional coup solution of aluminum powder precipitates gold which is filtered off. To the aqua regia solution of the precipitate a solution of stannous chloride is added drop by drop until the liquid is dissolved. The purple of Cassius tint developed is compared with permanent standards composed of mixtures of solutions of copper sulphate and cobalt nitrate which have been adjusted to shades corresponding to those produced by known

amounts of gold treated according to the method described.

Bettel * filters suspended matter from the cyanide solution, adds a measured quantity of a strong solution of potassium cyanide which contains some cuprous cyanide and precipitates gold by the copper zinc couple produced by addition of a measured quantity of zinc fume. The remainder of the method is the same as Prister's.

¹ Proc. Chem. Met. and Min. Soc. of So. Af., IV, 235, 1904.

² Eng. and Min. Journal, Oct. 31, 1903. ³ Proc. Chem. Met. and Min. Soc. of So. Af., Sept., 1913.

⁴ Min. World, **88**, 102 and **35**, 987.

234 GOLD

Dowsett's 1 factory test of barren cyanide solutions is capable of detecting variation in gold value of 1 cent per ton in solutions varying from one cent to about 15 cents per ton. To 500 cc. of the sample in a bottle with slight shoulder are added 10-15 cc. saturated sodium evanide solution, 2 or 3 drops saturated lead nitrate solution and 1-2 grams 200-mesh fine zinc dust. pered bottle is shaken violently until the precipitate settles rapidly. the bottle allows the precipitate to settle into a casserole. Clear liquid is removed by decantation. Zinc is dissolved by hydrochloric acid added drop by drop until reaction ceases. A few drops excess hydrochloric acid and 3-5 drops dilute nitric acid (sp.gr. 1.18) are added and the liquid concentrated to 1-2 cc. solution is transferred to a ½-in. diameter test-tube, about 1 cc. of stannous chloride reagent added and grade of cyanide solution estimated by the tint obtained after one or two minutes standing. 1/1000 oz. gold per ton of original cyanide solution gives a very slight coloration; 15/10000 a slight yellow; 1/500 a slight pinkish yellow; 3/1000 a strong pink; 1/250 the purple of Cassius. Too much nitric acid hinders the production and the presence of mercury causes modification of the color. No more lead nitrate should be used than is sufficient to produce a rapidly settling precipitate. The stannous chloride reagent is a water solution containing about 12½% crystals and 10% concentrated hydrochloric acid.

PREPARATION OF PROOF GOLD

Commercial gold may contain arsenic, antimony, selenium, tellurium, copper, lead, mercury, silver, zinc, palladium, platinum and other metals of the platinum group. The method of making pure gold depends to a certain extent upon the character and quantity of impurities.² The method described assumes the raw material to be of extreme impurity. The metal is treated in 10-g am portions.

When the metal contains silver its solution is effected most quickly by rolling extremely thin and annealing before treatment with acids.

The strips, in a covered No. 6 casserole on a steam bath, are dissolved with a mixture of 5 cc. nitric and 50 cc. hydrochloric acid. If but little silver is present the quantity of hydrochloric acid may be decreased to 25 cc. The solution is evaporated to dryness and the casserole gently heated over a Eunsen flame until all the gold is reduced to metal.

Digestion with ammonia will dissolve most of the silver and copper. After decanting the ammoniacal solution and washing with water, the gold is digested with hot nitric acid. If the solution is wine colored the digestion is continued for several hours, and reheated with fresh portions of acid until the absence of color indicates removal of palladium. The gold is now dissolved with 5 cc. of nitric and 15 to 20 cc. hydrochloric acids, evaporated to dryness, residue moistened with the least quantity of hydrochloric acid, dissolved with about 800 cc. water and liquid transferred to a 1000 cc. beaker. After the faint cloud of silver chloride settles to the bottom of the beaker, the clear liquid only is siphoned to another beaker, and allowed to stand another period of several days if it appears at all cloudy. The clear liquid is now siphoned into a 1000-cc. flask and sulphur dioxide gas passed until the gold is practically all precipitated. The gold is allowed to

¹ Trans. I.M.M., 1912–13, 190; Met. and Chem. Eng., July, 1914. ² Eng. and Min. Jour., 68, 785, 1899; "Metallurgy of Gold," Rose, 5th Ed.; Min. and Sci. Press, Nov. 14, 1903; "Manual of Fire Assaying," Fulton; "Assaying of Pretious Metals," Smith.

GOLD 235

settle, digested with hot nitric acid for a few minutes, washed by decantation several times, redissolved with aqua regia, solution transferred to a casserole, and nitric acid expelled by repeated evaporation to syrup with addition of hydrochloric acid. The product of the second evaporation is moistened with the least quantity of hydrochloric acid, dissolved with water and solution transferred to a 1000-cc. beaker or Erlenmeyer flask. To the liquid of about 500-cc. volume is added 11 grams of ammonium oxalate crystals. The beaker is permitted to remain on a steam bath until reaction is complete. The spongy mass of gold is now washed with hot water by decantation until free of salts.

The gold is dried, melted in a clay crucible which has previously been thinly glazed with borax glass and poured out into a mold of charcoal, graphite and clay or iron polished with graphite.

The ingot, which will have a volume of half a cubic centimeter, is cleaned by paring with a knife and rolled or hammered into a thin sheet. The rolls or hammer should be clean, bright and free of grease.

The gold, cut into convenient strips, is digested for several hours with hydrochloric acid and finally washed thoroughly with distilled water.

The dried gold thus prepared may be considered 1000 fine.

FURNACE METHODS OF ASSAY FOR GOLD

Details of assay for gold and silver by furnace methods will be found following the chapter on silver. See pages 451-488.

WILFRED W. SCOTT

I, at.wt. 126.92; sp.gr. 4.948¹⁷°; m.p. 113.5°; b.p. 184.4° C; acids, HI, HIO, HIO, HIO,

DETECTION

The element may be recognized by its physical properties. It is a grayish black, crystalline solid, with metallic luster, brownish-red in thin layers. It vaporizes at ordinary temperatures with characteristic odor. Upon gently heating the element the vapor is evident, appearing a deep blue when unmixed with other gases, and violet when mixed with air. It colors the skin brown. Chemically it behaves very similarly to chlorine and bromine.

Free iodine colors water yellow to black, carbon disulphide violet, ether or chloroform a reddish color, cold starch solution blue.

Tannin interferes with the usual tests for iodine, unless ferric chloride is present.

Iodide. The dry powder, heated with concentrated sulphuric acid, evolves violet fumes of iodine. Iodine is liberated from iodides by solutions of As⁵, Sb⁵, Bi⁵, Cu", Fe"', Cr⁵, H₂Fe(CN)₆, HNO₂, Cl, Br, H₂O₂, ozone.

Insoluble iodides may be transposed by treatment with H₂S, the filtered solution being tested for the halogen.

Iodate. The acidulated solution is reduced by cold solution of SO₂, or K₄Fe(CN)₆, (acidulated with dilute H₂SO₄), or by Cu₂Cl₂, H₂AsO₂, FeSO₄, etc. An iodate in nitric acid may be detected by diluting the acid with water, adding starch solution, then hydrogen sulphide water, drop by drop, a blue zone forming

in presence of the substance.

ESTIMATION

The element is found free in some mineral waters; combined as iodides and iodates in sea water; in ashes of sea plants; small quantities in a number of minerals, especially in Chili saltpeter as sodium iodate, hence in the mother liquor from the Chilian niter works from which iodine is principally produced. Sea-weed ash (drift kelp, Laminaria digitata and L. stenophylla) is an important source of iodine.

Free iodine, potassium iodide, iodoform, are the principal commercial products.

Preparation and Solution of the Sample

In dissolving the substance it will be recalled that free iodine is soluble in alcohol, ether, chloroform, glycerole, benzole, carbon disulphide, solutions of soluble iodides. One hundred cc. of water at 11° C. is saturated with 0.0182 gram iodine, at 55° with 0.092 gram.

¹Circular 35 (2d ed.) U. S. Bureau of Standards.

Iodides of silver, copper (cuprous), mercury (mercurous), and lead are insoluble, also TII, PdI₂. Iodides of other metals are soluble; those of bismuth, tin, and antimony, require a little acid to hold them in solution.

Iodates of silver, barium, lead, mercury, bismuth, tin, iron, chromium require more than 500 parts of water at 15° C. to hold them in solution. Iodates of copper, aluminum, cobalt, nickel, manganese, zinc, calcium, strontium, magnesium, sodium, and potassium are more soluble. One hundred cc. of cold water dissolves 0.00385 gram AgIO₂ and 0.000035 gram AgI at ordinary temperatures.

Free Iodine (Commercial Crystals). Iodine is best brought into solution in a strong solution of potassium iodide according to the procedure described for standardization of sodium thiosulphate under Volumetric Methods. The iodine is now best determined volumetrically by titration with standard thiosulphate or arsenic.

Iodine or Iodides in Water. The sample of water is evaporated to about one-fourth its volume and then made strongly alkaline with sodium carbonate. The precipitated calcium and magnesium carbonates are filtered off and washed. The filtrate containing the halogens is evaporated until the salts begin to crystallize The hot concentrated solution is poured into three volumes of absolute alcohol and the resulting solution again filtered. The residue is washed four or five times with 95% alcohol. All of the bromine and iodine pass into the solution, whereas a large part of chlorine as sodium chloride remains insoluble and is filtered off. About half a cc. of 50% potassium hydroxide is added and a greater part of the alcohol distilled off with a current of air. The residue is concentrated to crystallization and again poured into three times its volume of absolute alcohol and filtered as above directed. This time only one or two drops of potassium solution is added and the procedure repeated several times. The final filtrate is freed from alcohol by evaporation, the solution taken to dryness and gently ignited, then taken up with a little water and filtered. Iodine is determined in the filtrate, preferably by the volumetric procedure III, decomposition with nitrous acid, described under Volumetric Methods, p. 242.

Organic Substances. If only an iodide is present, the Carius method is followed; in presence of other halogens, the "lime method" is preferred. Details of these methods are given in the chapter on Chlorine under Preparation and Solution of the Sample, p. 145.

Silver iodide cannot be separated from the glass of the combustion-tube by solution with ammonium hydroxide as is the chloride or bromide of silver. The compound, together with the glass, is collected upon a filter paper, and washed with dilute nitric acid, followed by alcohol; then dried at 100° C. After removing most of the iodide and the glass, the filter is ignited in a weighed porcelain crucible, the main bulk of the material then added, the substance fused and weighed as AgI+glass. The mass is then covered with dilute sulphuric acid and a piece of pure zinc added. After several hours (preferably overnight) the excess zinc is carefully removed and the iodine solution decanted from the glass and metallic silver, and the residue washed by decantation. The silver is now dissolved in hot dilute nitric acid, then filtered from the residue of glass through a small filter. The glass and filter are ignited and weighed. The difference between the two weighings is due to silver iodide.

Minerals. Phosphates. The substance is decomposed by digestion with 1:1 sulphuric acid in a flask through which a current of air passes to sweep out

the iodine vapor into a solution of potassium hydroxide, the sample being boiled until all the iodine vapors have been driven into the caustic. Iodates are converted to iodides by reduction with sulphurous acid.

With the iodine content below 0.02%, a 50 to 100-gram sample should be taken.

SEPARATIONS

Separation of Iodine from the Heavy Metals. The heavy metals are precipitated as carbonates by boiling with solutions of alkali carbonates, the soluble alkali iodide being formed.

Iodine is liberated from combination by nitrous acid.

Silver iodide may be decomposed by warming with metallic zinc and sulphuric acid.

Separation of Iodine from Bromine or from Chlorine.¹ Details of separation and estimation of the halides in presence of one another are given in the chapter on Chlorine. Advantage is taken of the action of nitrous acid on dilute solutions, free iodine being liberated, while bromides and chlorides are not acted upon.

The solution containing the halogens is place in a large, round-bottom flask and diluted to about 700 cc. Through a two-holed stopper a glass tube passes to the bottom of the flask; through this tube steam is conducted to assist the volatilization of iodine. A second short tube connected to the absorption apparatus conducts the evolved vapor from the flask into a 5% caustic soda solution containing an equal volume of hydrogen peroxide (about 50 cc. of each). The absorption system may be made by connecting two Erlenmeyer flasks in series, the inlet tubes dipping below the solutions in the flasks. It is advisable to cool the receivers with ice.

Two to 3 cc. of dilute sulphuric acid (1:1) and 25 cc. of 10% sodium nitrite solution are added to the liquid containing the halogens, the apparatus is immediately connected, and the contents of the large flask heated to boiling, conducting steam into it at the same time. The iodine vapor is gradually driven over into the cooled receiving flasks.

When the solution in the large flask has become colorless it is boiled for half an hour longer. The steam is now shut off, the flask disconnected from the receiving flasks and the heat turned off. The contents of the receiving flasks are combined with the washing from the connecting tubes and the solution heated to boiling to expel, completely, hydrogen peroxide. The cooled liquid is acidified with a little sulphuric acid and the solution decolorized with a few drops of sulphurous acid. Iodine is now precepitated as silver iodide by adding an excess of silver nitrate and a little nitric acid and boiling the mixture to coagulate the precipitate. AgI is determined as directed on page 239.

Chlorine and bromine remain in the large flask in combined form and may be determined in this solution if desired.

Notes. Reactions: $2KI + 2KNO_2 + 4H_2SO_4 = I_2 + 2NO + 4KHSO_4 + 2H_2O$. $2NaOH + I_2 = NaI + NaIO + H_2O$ and $NaIO + H_2O_2 = H_2O + O_2 + NaI$.

Consult Separations in the chapter on Chlorine, p. 147.

¹ References: Method of Jannasch, Zeit. für anorg. Chem., 1, p. 144 (1892). Treadwell and Hall, "Analytical Chemistry." F. A. Gooch "Methods in Chemical Analysis."

IODINE · 239

Separation of Iodine from Chlorine and Bromine by Precipitation as Palladous Iodide. The solution containing the halogens is acidified with hydrochloric acid, and palladous chloride solution added to the complete precipitation of the iodide. The compound is allowed to settle in a warm place for twenty-four hours or more and then filtered and washed free of the other halogens. It may now be dried and weighed as palladous iodide, PdI₂, or ignited in a current of hydrogen, then weighed as metallic palladium and the equivalent iodine calculated. See Gravimetric methods.

GRAVIMETRIC METHODS

Precipitation as Silver Iodide

The procedure is practically the same as that described for determining chlorine.

Silver nitrate solution is added to the iodide solution, slightly acidified with nitric acid. The precipitate is filtered into a weighed Gooch crucible, then washed, dried, gently ignited, and weighed as silver iodide.

$$AgI \times 0.5406 = I \text{ or } \times 0.7071 = KI.$$

Nore. If filter paper is used in place of a Gooch crucible, the precipitate is removed and the filter ignited separately. A few drops of nitric and hydrochloric acid are added, the acids expelled by heat and the residue weighed as AgCl. This, multiplied by 1.638=AgI. The result is added to the weight of the silver iodide, which is ignited and weighed separately.

Determination of Iodine as Palladous Iodide

This method is applicable for the direct determination of iodine in iodides in presence of other halogens.

The method of isolation of iodine as the palladous salt has been given under Separations. The salt dried at 100° C. is weighed as PdI_2 .

$$PdI_{2} \times 0.704 = I$$
.

PdI: ignited in a current of hydrogen is changed to metallic palladium.

$$Pd \times 2.379 = I$$
.

VOLUMETRIC METHODS

Determination of Hydriodic Acid—Soluble Iodides

Free hydriodic acid cannot be determined by the usual alkalimetric methods for acids. The procedures for its estimation, free or combined as a soluble salt, depends upon the liberation of iodine and its titration with standard sodium thiosulphate, in neutral or slightly acid solution; or by means of standard arsenious acid, in presence of an excess of sodium bicarbonate in a neutral solution. The following equations represent the reactions that take place:

- I. Thiosulphate. $2Na_2S_2O_3+I_2=2NaI+Na_2S_4O_6$.
- II. Arsenite. $Na_1AsO_2+I_2+H_2O=Na_2AsO_4+2HI$.

The free acid formed in the second reaction is neutralized and the reversible reaction thus prevented:

$$HI + NaHCO_2 = NaI + H_2O + CO_2$$

The presence of a free alkali is not permissible, as the hydroxyl ion would react with iodine to form iodide, hypoiodite and finally iodate, hence sodium or potassium carbonates cannot be used. Alkali bicarbonates, however, do not react with iodine.

Standard Solutions. Tenth Normal Sodium Thiosulphate. From the reaction above it is evident that 1 gram molecule of thiosulphate is equivalent to 1 atom iodine = 1 atom hydrogen, hence a tenth normal solution is equal to one-tenth the molecular weight of the salt per liter, e.g., 24.82 grams Na₂S₂O₂·5H₂O; generally a slight excess is taken—25 grams of the crystallized salt. It is advisable to make up 5 to 10 liters of the solution, taking 125 to 250 grams sodium thiosulphate crystals and making up to volume with distilled water, boiled free of carbon dioxide. The solution is allowed to stand a week to ten days, and then standardized against pure, resublimed iodine.

About 0.5 gram of the purified iodine is placed in a weighing bottle containing a known amount of saturated potassium iodide solution (2 to 3 grams of KI free from KIO₂ dissolved in about ½ cc. of H₂O), the increased weight of the bottle, due to the iodine, being noted. The bottle and iodine are placed in a beaker containing about 200 cc. of 1% potassium iodide solution (1 gram KI per 200 cc.), the stopper removed with a glass fork and the iodine titrated with the thiosulphate to be standardized.

Calculation. The weight of the iodine taken, divided by the cc. thiosulphate required, gives the value of 1 cc. of the reagent; this result divided by 0.012692 gives the normality factor.

Note. The thiosulphate solution may be standardized against iodine, which has been liberated from potassium iodide in presence of hydrochloric acid by a known amount of standard potassium bi-iodate, a salt which may be obtained exceedingly pure.

 $KIO_3 \cdot HIO_3 + 10KI + 11HCl = 11KCl + 6H_2O + 6I_2$

A tenth normal solution contains 3.2496 grams of the pure salt per liter. (One cc. of this will liberate 0.012692 gram of iodine from potassium iodide.) The purity of the salt should be established by standardizing against thiosulphate, which-has been freshly tested against pure resublimed iodine.

About 5 grams of potassium iodide (free from iodate) are dissolved in the least amount of water that is necessary to effect solution, and 10 cc. of dilute hydrochloric acid (1:2) are added, and then 50 cc. of the standard bi-iodate solution. The solution is diluted to about 250 cc. and the liberated iodine titrated with the thiosulphate reagent; 50 cc. will be required if the reagents are exactly tenth normal.

Tenth Normal Arsenite. From the second reaction above it is evident that As_2O_3 is equivalent to $2I_2$, e.g., to 4H, hence $\frac{1}{2}$ the gram molecular weight of arsenious oxide per liter will give a normal solution: $198 \div 4 = 49.5$.

4.95 grams of pure arsenious oxide is dissolved in a little 20% sodium hydroxide solution, the excess of the alkali is neutralized with dilute sulphuric acid, using phenolphthalein indicator, the solution being just decolorized. Five hundred cc. of distilled water containing about 25 grams of sodium bicarbonate are added. If a pink color develops, this is destroyed with a few drops of weak sulphuric acid. The solution is now made to volume, 1000 cc. The

reagent is standardized against a measured amount of pure iodine. The oxide may be dissolved directly in sodium bicarbonate solution.

Note. Commercial arsenious oxide is purified by dissolving in hot hydrochloric acid, filtering the hot saturated solution, cooling, decanting off the mother liquor, washing the deposited oxide with water, drying and finally subliming.

Starch Solution. Five grams of soluble starch are dissolved in cold water, the solution poured into 2 liters of hot water and boiled for a few minutes. The reagent is kept in a glass-stoppered bottle.

The addition of a few cc. of 5% NaOH, then heating to boiling and filtering will preserve the starch.

Decomposition of the Iodide by Ferric Salts

The method takes advantage of the following reaction:

$$Fe_2(SO_4)_2 + 2KI = K_2SO_4 + I_2 + 2FeSO_4$$
.

The procedure enables a separation from bromides, as these are not acted upon by ferric salts.

Procedure. To the iodide in a distillation flask is added an excess of ferric ammonium alum, the solution acidified with sulphuric acid, then heated to boiling, and the iodine distilled into a solution of potassium iodide. The free iodine in the distillate is titrated with standard thiosulphate, or by arsenious acid in presence of an excess of sodium bicarbonate.

The reagent is added from a burette until the titrated solution becomes a pale yellow color. About 5 cc. of starch solution are now added and the titration continued until the blue color of the starch fades and the solution becomes colorless.

One cc. of tenth normal reagent =0.012692 gram iodine, equivalent to 0.012793 gram HI, or 0.016602 gram KI.

Decomposition with Potassium Iodate 1

The reaction with potassium iodate is as follows:

$$5KI + KIO_3 + 6HCl = 6KCl + 3H_2O + 3I_2$$
.

It is evident that $\frac{1}{2}$ of the titration for iodine would be equal to the iodine of the iodide, hence 1 cc. of tenth normal thiosulphate is equivalent to 0.012692 $\times \frac{1}{2} = 0.01058$ gram iodine due to the iodide. The procedure is as follows:

Procedure. A known amount of tenth normal potassium iodate is added to the iodide solution, in sufficient amount to liberate all of the iodine, combined as iodide, and several cc. in excess. Hydrochloric acid and a piece of calcite are added. The mixture is boiled until all of the liberated iodine has been expelled. To the cooled solution 2 or 3 grams of potassium iodide are added and the liberated iodine, corresponding to the excess of iodate in the solution, is titrated with standard thiosulphate. If 1 cc. of thiosulphate is equal to 1 cc. of the iodate, then the total cc. of the iodate used, minus the cc. thio-

¹H. Dietz and B. M. Margosches, Chem. Ztg., 2, 1191, 1904. Treadwell and Hall, "Analytical Chemistry," Vol. 2.

sulphate required in the titration gives a difference due to the volume of iodate required to react with the iodide of the sample.

One cc. of $N/10 \text{ KIO}_2 = 0.01058 \text{ gram I in KI}$.

Norz. Tenth normal potassium iodate contains 3.5675 grams KIO2 per 1000 cc.

Decomposition of the Iodide with Nitrous Acid (Fresenius)

Nitrous acid reacts with an iodide as follows:


 $2HNO_{2}+2HI=2NO+2H_{2}O+I_{3}$

Since neither hydrochloric nor hydrobromic acids are attacked by nitrous acid, the method is applicable to determining iodine in presence of chlorine and

bromine; hence is useful for determining small amounts of iodine in mineral waters containing comparatively large amounts of the other halogens.

Nitrous Acid. The reagent is prepared by passing the gas into strong sulphuric acid until saturated.

Procedure. The neutral or slightly alkaline solution of the iodide is placed in a glass-stoppered separatory funnel, Fig. 39, and slightly acidified with dilute sulphuric acid. A little freshly distilled colorless carbon disulphide (or chloroform) is added, then 10 drops of nitrous acid reagent. The mixture is well shaken, the disulphide allowed to settle, drawn off from the supernatant solution and saved for analysis. The liquor in the funnel is again extracted with a fresh portion of disulphide and if it becomes discolored it is drawn off and added to the first extract. If the extracted aqueous solution appears yellow, it must be again treated with additional carbon disulphide until all the iodine has been removed (e.g., until additional CS₂ is no longer colored when shaken with the solution). The combined extracts are washed with three or four portions of water, then transferred to the filter and again



The sodium thiosulphate used is standardized against a known amount of pure potassium iodide treated in the manner described above.

One cc. $N/20 \text{ Na}_2S_2O_3 = .00635 \text{ gram I}$, 1 cc. $N/50 \text{ Na}_2S_2O_3 = .002538 \text{ gram I}$.



Liberation of Iodine by Means of Hydrogen Peroxide and Phosphoric Acid ¹

Principle. Iodine is liberated from an iodide by addition of hydrogen peroxide to the solution acidified with phosphoric acid, the iodine distilled into potassium iodide and titrated with thiosulphate.

Procedure. Fifty cc. of the iodide solution are mixed with 5 cc. of pure phosphoric acid and 10 to 20 cc. hydrogen peroxide added, the mixture being placed in a round-bottomed flask, connected with a short condenser, delivering into two absorption vessels containing a 10% solution of potassium iodide. A current of air is drawn through the apparatus, and the contents of the flask gradually heated to boiling. The iodine is absorbed in the potassium iodide solution and titrated as usual with standard sodium thiosulphate. Twenty minutes' heating is generally sufficient.

One cc. Na₂S₂O₂ =0.012692 gram I, or 0.016602 gram KI.

Note. Iodine in urine may be determined by evaporating to 1/10 its volume. After adding an excess of sodium hydroxide, the mixture is taken to dryness and gently ignited. The ash may be used for the iodine determination.

Oxidation of Combined Iodine with Chlorine. (Mohr's Modification of Dupré's Method)²

When a solution of potassium iodide is treated with successive amounts of chlorine water, iodine is liberated, which reacts with an excess of chlorine with formation of chloride of iodine (ICl) and with greater excess the pentachloride (ICl₂) which is changed in presence of water to iodic acid (HIO₂).

Procedure. The weighed iodide compound is brought into a stoppered flask, and chlorine water delivered from a large burette until all yellow color has disappeared. A drop of the mixture brought in contact with a drop of starch solution should produce no blue color. Sodium bicarbonate is now added until the mixture is slightly alkaline, followed by an excess of potassium iodide and 4 to 5 cc. of starch reagent. Standard thiosulphate is now added until the blue color is removed. The excess of chlorine water is thus ascertained. From the value of the chlorine reagent the iodine of the sample may readily be calculated.

The chlorine water is standardized by running 25 to 50 cc. of the reagent into potassium iodide solution (see procedure for bromides, p. 95), and titrating the liberated iodine with standard sodium thiosulphate. The value of the reagent in terms of thiosulphate are thus ascertained and from this the value per cc. in terms of iodine.

OTHER METHODS

Volhard's Method for Determining Iodides

This procedure is very similar to those for determining chlorine or bromine, with the exception that silver iodide formed will occlude both the iodide solu-

¹E. Winterstein and E. Herzfeld, Zeit. Physiol. Chem., 63, 49-51, 1909. Chem. Zentralbl., (1), 473-474, 1910.

²Sutton, "Volumetric Analysis," 10th Ed.

tion and silver nitrate unless the additions of the silver salt are made in small portions with vigorous shaking.

Standard silver nitrate is added to the solution in a glass-stoppered flask, shaking vigorously with each addition. As long as the solution appears milky the precipitation is incomplete. When the silver iodide is coagulated and the supernatant liquid appears colorless, ferric alum solution is added, and the excess of silver nitrate titrated with potassium sulphocyanate until the characteristic reddish end-point is obtained.

The iodine is calculated from the amount of silver nitrate required. E.g., total AgNO₁ added, minus excess determined by KCNS=cc. AgNO₁ required by the iodine.

Note. The ferric salt oxidizes hydriodic acid with separation of iodine, whereas the silver iodide is not acted upon, hence the indicator is added after all the iodide has combined with silver.

Determination of Iodates

The procedure is the reciprocal of the one for determination of iodide by means of an iodate:

Reaction. $KIO_2+5KI+6HCl=6KCl+3H_2O+3I_2$.

Procedure. The solution containing the iodate is allowed to run into an excess of potassium iodide solution containing hydrochloric acid. The liberated iodine is titrated with sodium thiosulphate as usual.

One cc. N/10 Na₂S₂O₃ = 0.002932 gram HIO₃, or 0.003567 gram KIO₃.

Determination of Periodates

The procedure is the same as that described for iodates, the reaction in this case, however, being as follows:

$$KIO_4 + 7KI + 8HCl = 8KCl + 4H_2O + 4I_3$$
.

From the equation it is evident that 1 gram molecule of the iodate is equivalent to 8 atoms of iodine =8 atoms of hydrogen, hence \(\frac{1}{4} \) the molecular weight per liter of solution would equal a normal solution. Therefore, 1 cc. of a tenth normal solution would contain 0.019193 \(\div \text{8} = 0.002399 \) gram HIO₄.

One cc. N/10 Na₂S₂O₁=0.002399 gram HIO₄, or =0.002849 gram HIO₄·2H₂O, or =0.002875 gram KIO₄.

Determination of Iodates and Periodates in a Mixture of the Two

The procedure depends upon the fact that an iodate does not react with potassium iodide in neutral or slightly alkaline solutions, whereas a periodate undergoes the following reactions:

$$KIO_4+2KI+H_2O=2KOH+KIO_2+I_2$$

Procedure. The sample, dissolved in water, is divided into two equal portions.

A. To one portion a drop of phenolphthalein indicator is added and the

solution made just faintly alkaline by addition of alkali to acid solutions or hydrochloric acid to alkaline solution, as the case may require. Ten cc. of cold saturated solution of sodium bicarbonate are added and an excess of potassium iodide. The liberated iodine is titrated with tenth normal arsenious acid.¹ (Na₂S₇O₂ will not do in this case, as the solution is alkaline.)

One cc. $N/10 \text{ As}_2O_3 = 0.0115 \text{ gram KIO}_4$.

B. To the other portion potassium iodide is added in excess and the solution made distinctly acid. The liberated iodine is titrated with standard sodium thiosulphate. (As₂O₃ will not do.)

Calculation. In the acid solution, B, both iodates and periodates are titrated, whereas in the alkaline solution, A, only the periodates are affected. From the reactions for periodates it is evident that 1 cc. Na₂S₂O₂ = 4 cc. As₂O₃ for the periodate titration, hence

Cc. Na₂S₂O₃ -cc. As₂O₃ $\times 4$ =cc. thiosulphate due to KIO₃.

The difference, multiplied by 0.003567 = grams KIO₂ in the sample.

Determination of Iodine in Mineral Waters and Brines

The following procedure is given by W. F. Baughman and W. W. Skinner.² Take such a quantity of the brine or water as will contain not more than 0.1 g. iodine as iodide or more than 10 g. total salts. Adjust the volume to 100 cc. to 150 cc. and boil it with a sufficient amount of sodium hydroxide and sodium carbonate to precipitate the calcium and magnesium. Filter off the precipitate and wash with hot water. Introduce the filtrate into an Erlenmeyer flask, adjust the volume to about 100 cc., neutralize with dilute sulphuric acid, and add 1 cc. of a solution of sodium hydroxide (4 g. per 100 cc.). Heat to boiling, add an excess of potassium permanganate, continue the heating until the precipitate begins to coagulate, and then allow to cool. Add sufficient alcohol to cause the permanganate color to disappear and allow the precipitate to settle on the steam bath. Filter and wash with hot water. After cooling, add one or two grams of potassium iodide, acidify with hydrochloric acid, and titrate with standard thiosulphate. The number of cc. required, divided by 6, represents the number of cc. required by the iodine in the sample.

¹In alkaline solutions the arsenious acid titration must be made, whereas in aci ¹ solutions potassium thiosulphate is used.

² Bureau of Chemistry, Dept. Agriculture, Washington, D. C. Ref. Jour. Ind. Eng. Chem., Vol. 11, No. 6, page 563 (June, 1919).

WILFRED W. SCOTT

Fe, at.wt. 55.84; sp.gr. 7.85-7.88; m.p. pure 1530°,1 wrought 1600°,2 white pig 1075°, 1 gray pig 1275°, 1 steel 1375°; 1 b.p. 2450° 1 C.; oxides FeO, Fe₂O₂, Fe₂O₄.

DETECTION

Ferric Iron. The yellow to red color in rocks, minerals, and soils is generally due to the presence of iron.

Hydrochloric acid solutions of iron as ferric chloride are colored yellow.

Potassium or ammonium sulphocyanate produces a red color with solutions containing ferric iron. Nitric acid and chloric acid also produce a red color with potassium or ammonium sulphocyanate. This color, however, is destroyed by heat, which is not the case with the iron compound. The red color of ferric iron with the cyanate is destroyed by mercuric chloride and by phosphates, borates, certain organic acids, and their salts, e.g., acetic, oxalic, tartaric, citric, racemic, malic, succinic, etc.

Potassium ferrocyanide, K.Fe(CN), produces a deep blue color with ferric salts.

Salicylic acid added to the solution of a ferric salt containing no free mineral acid gives a violet color. Useful for detecting iron in alum and similar products.

Ferrous Iron. Potassium Ferricyanide, K, Fe(CN), gives a blue color with solutions of ferrous salts.

Distinction between Ferrous and Ferric Salts.

KCNS gives red color with Fe" and no color with Fe".

K.Fe(CN), gives a blue color with Fe" and a brown or green with Fe".

NH₄OH, NaOH or KOH precipitates red, Fe(OH), with Fe" and white,

Fe(OH), with Fe" turning green in presence of air due to oxidation.

Sodium peroxide produces a reddish-brown precipitate of Fe(OH), with either ferrous or ferric salt solutions, the former being oxidized to the higher valence by the peroxide. Chromium and aluminum remain in solution, if present in the sample.

ESTIMATION

Iron is so widely diffused in nature that its determination is necessary in practically all complete analyses of ores, rocks, minerals, etc. It is especially important in the evaluation of iron ores for the manufacture of iron and steel. Among the ores of iron the following are more common:

Oxides. Red hematite, Fe₂O₂; brown hematite, 2Fe₂O₂·3H₂O; black magnetite or magnetic iron ore, Fe₃O₄. Ferric oxide with varying amounts of water

¹Circular 35 (2d Ed.) U. S. Bureau of Standards.

² D. Van Nostrand's Chemical Annual.—Olsen.

The green salt is a hydrate of Fe₃O₄. The white precipitate can be obtained in absence of air or by using H₂SO₃ to take up oxygen in solution.

forms the substances known as hematite, göthite, limonite, yellow ochre, bog iron ore.

Sulphide. Iron pyrites or "fool's gold," FeS2; pyrrhotite, FeS.

Carbonates. Spatic iron ore, FeCO₁; combined with clay in clay ironstone with bituminous material as "black band."

Iron is determined in the cinders and in iron ore briquettes from burned iron pyrites, by-products of sulphuric acid.

It is found as an impurity in a large number of commercial salts and in the mineral acids.

Preparation and Solution of the Sample

The material should be carefully sampled and quartered down according to the general procedure for sampling. Ores should be ground to pass an 80-mesh sieve. In analysis of metals, both the coarse and fine drillings are taken.

The following facts regarding solubility should be remembered: The element is soluble in hydrochloric acid and in dilute sulphuric acid, forming ferrous salts with liberation of hydrogen. It is insoluble in concentrated, cold sulphuric acid, but is attacked by the hot acid, forming ferric sulphate with liberation of SO₂. Moderately dilute, hot nitric acid forms ferric nitrate and nitrous oxide; the cold acid gives ferrous nitrate and ammonium nitrate or nitrous oxide or hydrogen. Cold, concentrated nitric acid forms "passive iron," which remains insoluble in the acid. The oxides of iron are readily soluble in hydrochloric acid, if not too strongly ignited, but upon strong ignition the higher oxides dissolve with extreme difficulty. They are readily soluble, however, by fusion with acid potassium sulphate followed by an acid extraction. Silicates are best dissolved by hot hydrochloric acid containing a few drops of hydrofluoric acid or by fusion with sodium and potassium carbonates, followed by hot hydrochloric acid.

Soluble Iron Salts. Water solutions are acidified with HCl or H₂SO₄, so as to contain about 3% of free acid.

Ores. The samples should be pulverized to pass an 80- to 100-mesh sieve.

Sulphides, Ores Containing Organic Matter. One- to 5-gram samples should be roasted in a porcelain crucible over a Bunsen flame for about half an hour, until oxidized. The oxide is now dissolved as directed in the following procedure.

Oxides, Including Red and Brown Hematites, Magnetic Iron Ore, Spatose Iron Ore, Roasted Pyrites, and Iron Ore Briquettes. One to 5 grams of the ore, placed in a 400-cc. beaker, is dissolved by adding twenty times its weight of strong hydrochloric acid with a few drops of 5% stannous chloride solution. Addition of 4 or 5 drops of HF is advantageous if small amounts of silica are present. The solution is covered with a watch-glass and heated to 80 or 90° C. until solution is complete. Addition of more stannous chloride may be necessary, as this greatly assists solution. An excess sufficient to completely decolorize the solution necessitates reoxidation with hydrogen peroxide, hence should be avoided. If a colored residue remains, it should be filtered off, ignited and fused with a mixture of Na₂CO₃ and K₂CO₃ in a platinum crucible. The fusion dissolved in dilute HCl is added to the main filtrate.

Note. The ore placed in a porcelain boat in a red-hot combustion tube may be reduced with hydrogen (taking precaution first to sweep out oxygen with CO_2) and after cooling in an atmosphere of hydrogen the reduced iron may be dissolved in acid and titrated.

Iron Silicates. One to 5 grams of the material, placed in a deep platinum crucible, is treated with ten times its weight of 60% HF and 3 to 4 drops of conc. H_sSO₄. The mixture is evaporated to near dryness on the steam bath and taken up with dilute sulphuric acid or hydrochloric acid. The latter acid is the best solvent for iron.

Fusion with Potassium Bisulphate. The sample is mixed with ten times its weight of the powdered bisulphate and 2-3 cc. of concentrated sulphuric acid added. A porcelain or silica dish will do for this fusion. The fusion should be made over a moderate flame and cooled as soon as the molten liquid becomes clear. Complete expulsion of SQ₁ should be avoided. It may be necessary to cool and add more conc. sulphuric acid to effect solution. Iron and alumina completely dissolve, but silica remains undissolved. The melt is best cooled by pouring it on a large platinum lid.

Fusion with Carbonates of Sodium and Potassium. The residues insoluble in hydrochloric acid are fused with 5 parts by weight of the fusion mixture (Na₂CO₃+K₂CO₃) in a platinum crucible. The Méker blast will be necessary. When the effervescence has ceased and the melt has become clear, the crucible is removed from the flame, a platinum wire inserted and the melt cooled. Upon gently reheating, the fuse may be readily removed by the wire in a convenient form for solution in dilute hydrochloric acid.

The bisulphate fusion is recommended for fusion of residues high in iron and alumina. It is an excellent solvent for ignited oxides of these elements. The carbonate fusions are adapted to residues containing an appreciable amount of silica.

Iron and steel are best dissolved in hydrochloric acid with a few drops of nitric acid. The iron hydroxide should be precipitated or the solution taken to dryness to expel the nitric acid followed by resolution in dilute hydrochloric acid or sulphuric acid.

SEPARATIONS

General Procedure. In the usual course of analysis silica is removed by evaporating the acid solution to dryness, taking up with water and filtering. Mercury, lead, bismuth, copper, cadmium, arsenic, antimony, tin, molybdenum and other elements precipitated from an acid solution as sulphides are removed as such by filtration and iron, after oxidation to the ferric state, is precipitated as Fe(OH)₃. In the majority of cases it may now be determined with accuracy by titration.

Special Cases. Separation of iron, where necessary in special cases, may be accomplished according to details given in the chapters dealing with the elements from which a separation is desired.

Ether Method for Removing Iron from a Solution. Ferric chloride dissolved in HCl (sp.gr. 1.1) is more soluble in ether than in this acid. Advantage is taken of this fact when it is desired to remove a greater portion of the iron in determining copper, nickel, cobalt, chromium, vanadium and sulphur (as H₂SO₄) in steel. The hydrochloric acid solution of iron, etc., is evaporated to a syrupy consistency and then taken up with HCl (sp.gr. 1.1) and transferred by means of more of the acid to a separatory funnel. The cold acid solution is now extracted several times by shaking with ether, each time allowing the ether carrying the iron to separate before drawing off the lower layer for reextraction. Three extractions are generally sufficient for removing the iron.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF IRON

The gravimetric determination of iron may be made from solutions practically free from other metals. A number of elements such as phosphorus, arsenic, molybdenum, tungsten, vanadium, and the like, form fairly stable compounds with iron in neutral or slightly alkaline solutions, whereas others, such as lead, copper, nickel, cobalt, sodium, and potassium may be occluded in the ferric hydrate precipitate and are removed only with considerable difficulty. Aluminum, chromium, and several of the rare earths are precipitated with iron, if present. These facts taken into consideration, the volumetric methods are generally preferred as being more rapid and trustworthy.

Determination of Iron as Fe₂O₃

Iron is precipitated as the hydroxide and ignited to the oxide, Fe₂O₄, in which form it is weighed.

Reactions. $FeCl_3+3NH_4OH = Fe(OH)_3+3NH_4Cl.$ $2Fe(OH)_3+heat = Fe_2O_3+3H_2O.$

Procedure. One-gram sample or a larger amount of material if the iron content is low, is brought into solution with hydrochloric acid, aqua regia, or by fusion with potassium carbonate or potassium acid sulphate, as the case may require. Silica is filtered off and the acid solution treated with H₂S if members of that group are present. The filtrate is boiled to expel H₂S and the iron oxidized to ferric condition by boiling with 5 cc. concentrated nitric acid.

Absence of Aluminum and Chromium. About 1 gram of ammonium chloride salt or its equivalent in solution is added, the volume made to about 200 cc. and ammonium hydroxide added in slight excess to precipitate Fe(OH)₃. The solution is boiled for about five minutes, then filtered through an ashless filter.

If Aluminum and Chromium are Present. In place of ammonium hydroxide powdered sodium peroxide is added in small portions until the precipitate first formed clears, the solution being cold and nearly neutral. It is diluted to about 300 cc. and boiled ten to fifteen minutes to precipitate the iron. Aluminum and chromium are in solution. (Mn will precipitate with Fe, if present.) The precipitate is filtered onto a rapid filter and washed with hot water.

Second Precipitation. In either case dissolve the precipitate with the least amount of hot dilute hydrochloric acid and wash the paper free of iron. Add a few cc. of 10% ammonium chloride solution and reprecipitate the hydroxide of iron by adding an excess of ammonium hydroxide, the volume of the solution being about 200 cc. Washing the precipitate by decantation is advisable. Three such washings, 100-cc. portions, followed by two or three on the filter paper, will remove all impurities.

Ignition. The precipitate is ignited wet over a low flame, gradually increasing the heat. Blasting is not recommended, as the magnetic oxide of iron, Fe₃O₄, will form with high heating. The oxide heated gently appears a reddish-brown. Higher heat gives the black oxide, Fe₃O₄. Twenty minutes' ignition, at red heat, is sufficient.

The crucible, cooled in a desiccator, is weighed and Fe₂O₄ obtained.

Factors. $Fe_2O_3 \times 0.6994 = Fe$. $Fe_2O_3 \times 0.8998 = FeO$.

Precipitation of Iron with "Cupferron," Amino nitrosophenylhydroxylamine 1

By this procedure iron may be precipitated directly in acid solution in presence of a number of elements. Mercury, lead, bismuth, tin, and silver may be partially precipitated. Copper precipitates with iron, but may be easily removed by dissolving it out with ammonia. The method is especially adapted for separation of iron from aluminum, nickel, cobalt, chromium, cadmium, and zinc.

Procedure. The solution containing the iron is made up to 100 cc. and 20 cc. of concentrated hydrochloric acid added. To this cool solution (room temperature) Baudisch's reagent, cupferron, is slowly added with constant stirring, until no further precipitation of iron takes place, and crystals of the reagent appear. The iron precipitate is a reddish-brown. Copper gives a grayish-white flocculent compound. An excess of the reagent equal to one-fifth of the volume of the solution is now added, the precipitate allowed to settle for about fifteen minutes, then poured into a filter paper and washed, first with 2N. HCl, followed by water, then with ammonia and finally with water. The drained precipitate is slowly ignited in a porcelain or platinum crucible and the residue weighed as Fe₂O₂

$Fe_2O_3 \times 0.6994 = Fe$.

Notes. Baudisch's reagent, amino nitrosophenyl-hydroxylamine (cupferron), is made by dissolving 6 grams of the salt in water and diluting to 100 cc. The reagent keeps for a week if protected from the light. It decomposes in the light, forming nitrobenzine. Turbid solutions should be filtered.

The precipitates of copper or iron are but slowly attacked by twice normal hydrochloric acid in the cold, but decomposed by hot acid, hence the solution and reagent should be cold.

Cold, dilute potassium carbonate solution, or ammonium hydroxide, have no action on the iron precipitate; the copper compound dissolves readily in ammonia. Alkaline hydroxide causes rapid decomposition.

The precipitation is best made in comparatively strong acid solutions (HCl, H₂SO₄, or acetic acid).

VOLUMETRIC DETERMINATION OF IRON IN ORES AND METALLURGICAL PRODUCTS

General Considerations. Two general procedures are commonly employed in the determination of iron.

- A. Oxidation of ferrous to ferric condition by standard oxidizing agents.
- B. Reduction of ferric iron to ferrous condition.

The sample is dissolved as directed under Preparation and Solution of the Sample.

¹O. Baudisch, Chem. Ztg., 33, 1298, 1905. Ibid., 35, 913, 1911. O. Baudisch and V. L. King, Jour. Ind. Eng. Chem., 3, 627, 1911.

Determination of Iron by Oxidation Methods

Some modification of either the dichromate or permanganate methods is commonly employed in the determination of iron by oxidation. To accomplish this quantitatively, the iron must be reduced to its ferrous condition. This

may be accomplished in the following ways:

1. Reduction by Hydrogen Sulphide. During the course of a complete analysis of an ore, H₂S is passed into the acid solution to precipitate the members of that group (Hg, Pb, Bi, Cu, Cd, As, Sb, Sn, Pt, Au, Se, etc.). The filtrate contains iron in the reduced condition suitable for titration with either dichromate or permanganate, the excess of H₂S having been boiled off. If the expulsion of H₂S is conducted in an Erlenmeyer flask there is little chance for reoxidation of the iron during the boiling. Reduction by H₂S is very effective and is frequently advisable. This is the case when titanium is present, since this is not reduced by H₂S, but by methods given below. Arsenic, antimony, copper, and platinum, which, if present would interfere, are removed by this treatment.

Reaction. $2 \text{FeCl}_2 + \text{H}_2 \text{S} = 2 \text{FeCl}_2 + 2 \text{HCl} + \text{S}$.

2. Reduction with Stannous Chloride. SnCl₂ solution acts readily in a hydrochloric acid solution of the ore; the reduction of the iron is easily noted by the disappearance of the yellow color. The excess of the reagent is oxidized to SnCl₄ by addition of HgCl₂.

Reactions. 1. $2\text{FeCl}_2 + \text{SnCl}_2 = 2\text{FeCl}_2 + \text{SnCl}_4$.

2. Excess SnCl₂+2HgCl₂=SnCl₄+2HgCl precipitated.

An excess of SnCl₂ is advisable, but a large excess is to be avoided, as a secondary reaction would take place, as follows: $2\text{SnCl}_2+2\text{HgCl}_2=2\text{SnCl}_4+2\text{Hg}$. This reaction is indicated by the darkening of the solution upon the addition of HgCl₂. Precipitation of metallic mercury would vitiate results. The solution should be cooled before addition of mercuric chloride. About 15-20 cc. of saturated mercuric chloride, HgCl₂, solution should be sufficient.

- 3. Reduction by a Metal such as Test Lead, Zinc, Magnesium, Cadmium, or Aluminum, in Presence of Either Hydrochloric Acid or Sulphuric Acid. The former acid is preferred with the dichromate titration, and the latter with the permanganate. Two methods of metallic reduction are in common use—reduction by means of test lead, and reduction with amalgamated zinc by means of the Jones reductor.
- (a) Reduction with Test Lead. By this method copper is precipitated from solution and small amounts of arsenic and antimony expelled. Sufficient test lead is added to the acid ferric solution to completely cover the bottom of the beaker. The solution is covered and boiled vigorously until the yellow color has completely disappeared, and the solution is colorless. The reduced iron solution, cooled, is decanted into a 600-cc. beaker, the remaining iron washed out from the lead mat by several decantations with water; two or three 50-cc. portions of water should be sufficient; the washings are added to the first portion. If the solution becomes slightly colored, a few drops of stannous chloride, SnCl₂, solution are added, followed by 10 cc. mercuric chloride, HgCl₂, solution. The sample is now ready for titration.

- (b) Reduction with Zinc, Using the Jones Reductor. The axid solution of iron, preferably sulphuric acid, is passed through a column of amalgamated zinc. The hydrogen evolved in presence of the zinc reduces the ferric iron to ferrous condition. The procedure is described in detail under the Permanganate Method for Determination of Iron, page 254. Titanium if present will also be reduced.
- 4. Reduction with Sulphurous Acid, Sodium Sulphite or Metabisulphite. SO₂ gas is passed into a neutral solution of iron, since iron is not reduced readily in an acid solution by this method. The excess SO₂ is expelled by acidifying the solution and boiling.
- 5. Reduction with potassium iodide, the liberated iodine being expelled by heat.

In the solution of the ore with stannous chloride and hydrochloric acid, if an excess of the former has been accidentally added, it will be necessary to oxidize the iron before reduction. This may be accomplished by addition of hydrogen peroxide until the yellow color of ferric chloride appears (or by addition of KMnO4 solution), the excess H₂O₂ may be removed by boiling. The iron may now be reduced by one of the above methods.

Volumetric Determination of Iron by Oxidation with Potassium Dichromate

Principle. This method depends upon the quantitative oxidation of ferrous salts in cold acid solution (HCl or H₂SO₄) to ferric condition by potassium dichromate, the following reaction taking place:

$$6FeCl_2+K_2Cr_2O_7+14HCl=6FeCl_3+2CrCl_3+2KCl+7H_2O.$$

Potassium ferricyanide is used as an outside indicator. This reagent produces a blue compound with ferrous salts and a yellowish-brown with ferric. The chromic salt formed by the reaction with iron colors the solution green.

Reagents Required. Standard Potassium Dichromate. When oxygen reacts with ferrous salts, the following reaction takes place:

$$6FeCl_2+6HCl+3O=6FeCl_3+3H_2O$$
.

Comparing this reaction with that of dichromate, it is evident that a normal solution of dichromate contains one-sixth of the molecular weight of $K_2Cr_2O_7$ per liter, namely, 49.033 grams. For general use it is convenient to have two strengths of this solution, N/5 for ores high in iron and N/10 for products containing smaller amounts.

Standardization. For N/5 solution 9.807 grams of the recrystallized dehydrated salt are dissolved and made up to one liter; N/10 potassium dichromate contains 4.903 grams of the pure salt per liter. It is advisable to allow the solution to stand a few hours before standardization. The Sibley iron ore furnished by the U. S. Bureau of Standards, Washington, D. C., is recommended as the ultimate standard. Other ores uniform in iron may be standardized against the Sibley ore and used as standards. The ore in question contains 69.20% Fe (1914). For accurate work it is desirable to use a chamber burette

¹ Amalgamated zinc is best prepared by dissolving 5 grams of mercury in 25 cc. of concentrated nitric acid with an equal volume of water, 250 cc. of water are added and the solution poured into 500 grams of shot zinc, 20-mesh. When thoroughly amalgamated the solution is poured off, and the zinc dried.

with graduations from 75 to 90 cc. in tenths and from 90 to 100 in twentieths of a cc. A titration of 90 to 100 cc. of the dichromate would require 0.9 to 1.1 gram of iron for a fifth normal solution and half this amount for a tenth normal solution of dichromate. In the first case 1.4 gram of Sibley iron ore should be taken and for N/10 0.7 gram of the ore. The ore is best dissolved in strong HCl, adding a few drops of stannous chloride solution and heating just below boiling. In case of an ore or iron ore briquette, containing silica in an appreciable amount, a carbonate fusion of the residue may be necessary. Reduction and titration of the ore is done exactly as prescribed under Procedure below.

The equivalent iron in the ore divided by the cc. titration required for complete oxidation gives the value in terms of grams per cc., e.g., 1.4 gram of ore containing 69.2% Fe required a titration of 95 cc. K₂Cr₂O₇ solution, then,

1 cc. =
$$\frac{(69.2 \times 1.4)}{100}$$
 ÷ 95 = 0.0102 gram Fe.

Stannous Chloride. Sixty grams of the crystallized salt dissolved in 600 cc. of strong HCl and made up to one liter. The solution should be kept well stoppered.

Mercuric Chloride. Saturated solution of HgCl₁ (60 to 100 grams per liter). Potassium Ferricyanide, K₂Fe(CN)₆. The salt should be free of ferrocyanide, as this produces a blue color with ferric salts, which would destroy the endpoint. It is advisable to wash off the salt before using. A crystal the size of a pinhead dissolved in 50 cc. of water is sufficient for a series of determinations. The solution should be made up fresh for each set of determinations.

Apparatus. Chamber burette. This should read from 75 to 90 cc. in tenths and from 90 to 100 cc. in twentieths of a cc.

Test Plate. The usual porcelain test-plate with depressions may be replaced by a very simple and efficient test-sheet made by dipping a white sheet of paper in paraffin. The indicator does not cling to this surface, the drops assuming a spherical form, which renders the detection of the end-point more delicate.

Procedure. Iron Ores. The amount of sample taken should be such that the actual iron present would weigh between 0.9 to 1.1 gram. This weight can be estimated by dividing 95 by the approximate percentage of iron present, e.g., for 50% Fe ore take $\frac{95}{50} = 1.9$ gram; 95% iron material would require 1 gram, whereas 20% Fe ore would require 4.75 grams.

For samples containing less than 20% Fe it is advisable to use N/10 K₂Cr₂O₇ solution.

The sample should be finely ground (80-mesh).

Solution. The hydrochloric acid method for solution of the oxidized ore with subsequent carbonate fusion of the residue is recommended as being suitable for iron ores, briquettes, and materials high in iron.

Reduction. H.S reduction is recommended in ores containing arsenic or titanium. SnCl₂ in very slight excess, followed by mercuric chloride, HgCl₂, gives excellent results in absence of other reducible salts of elements, Cu, As, etc.

Test Lead. The easy manipulation and efficiency of this method of reduction makes it applicable for a large variety of conditions. The acid solution preferably, HCl, is diluted to about 150 to 200 cc., containing 15 to 20 cc. concentrated hydrochloric acid (sp.gr. 1.19). Sufficient test lead is added to cover the bottom of a No. 4 beaker. The solution covered is boiled vigorously until it becomes colorless. Copper, if present, is precipitated, as well as platinum,

and small amounts of arsenic and antimony eliminated from the solution during the reduction of the iron. The cooled solution is poured into a 600-cc. beaker and the mat of lead remaining in the No. 4 beaker washed free of iron, two or three 50-cc. washings being sufficient. The main solution and washings are combined for titration. If the solution is slightly colored, due to reoxidation of iron, a few drops of stannous chloride solution are added to reduce it, followed by an excess of HgCl₂ solution, 20 to 25 cc., and allowed to stand five minutes.

The standard potassium dichromate is run into the solution to within 5 to 10 cc. of the end-point, this having been ascertained on a portion of the sample. The dichromate is run in slowly near the end-reaction, and finally drop by drop until a drop of the solution mixed with a drop of potassium ferricyanide solution produces no blue color during thirty seconds. A paraffined surface is excellent for this test.

Cc.
$$K_2Cr_2O_7$$
 multiplied by value per cc. = Fe present in sample. $\% = \frac{\text{Fe} \times 100}{\text{wt. taken}}$

Notes. If SnCl₂ solution has been used for reduction of the iron, it is necessary to add the HgCl₂ rapidly to a cold solution, as slow addition to a warm solution is

apt to precipitate metallic mercury.

In case an excess of dichromate has been added in the titration, as often occurs, back titration may be made with ferrous ammonium sulphate (NH₄)₂SO₄·FeSO₄·6H₂O. N/10 solution of this reagent may be prepared by dissolving 9.31 grams of the clear crystals in about 100 cc. or water, adding 5 cc. of concentrated H₂SO₄ and making to 250 cc. The solution should be standardized against the dichromate solution to get the equivalent values, by running the dichromate directly into the ferrous solution.

The ferricyanide indicator should be made up fresh each time it is required.

Large amounts of manganese in the iron solution titrated cause a brown coloration, which masks the end-point. Nickel and cobalt, present in large amounts are objectionable for the same reason. This interference may be overcone by using very dilute acid solutions of ferricyanide indicator, so that the insoluble ferricyanide of these metals will not form.

Potassium Permanganate Method for Determination of Iron

Introduction. The method depends upon the quantitative oxidation of ferrous salts to the ferric condition when potassium permanganate is added to their cold solution, the following reaction taking place:

$$10\text{FeSO}_4 + 2\text{KMnO}_4 + 8\text{H}_2\text{SO}_4 = 5\text{Fe}_2(\text{SO}_4)_2 + \text{K}_2\text{SO}_4 + 2\text{MnSO}_4 + 8\text{H}_2\text{O}$$
.

Hydrochloric acid in presence of iron salts has a secondary reaction upon the permanganate, e.g.,

$$2KMnO_4 + 16HCl = 2KCl + 2MnCl_2 + 8H_2O + 10Cl.$$

This reaction may be prevented by addition of large amounts of zinc or manganous sulphates together with an excess of phosphoric acid. It is preferable, however, to expel HCl, when this has been used as a solvent, by adding sulphuric acid and taking to fumes. The solution is diluted and reduced with zinc and titrated as directed.

The reduction of ferric sulphate is best accomplished by passing the solution through a column of amalgamated zinc in the Jones reductor. In presence of titanium, reduction is accomplished by H2S in a hydrochloric acid solution of the iron.

¹ Jour. Am. Chem. Soc.. 17, 405.

Since potassium permanganate enters into reaction with acid solutions of antimony, tin, platinum, copper and mercury, when present in their lower state of oxidation, (also with manganese in neutral solutions) and with SO₂, H₂S, N₂O, ferrocyanides and with most soluble organic bodies, these must be absent from the iron solution titrated.

Potassium permanganate produces an intense pink color in solution, so that it acts as its own indicator.

Solutions Required. Standard Permanganate Solutions. As in case of Potassium dichromate, it is convenient to have two standard solutions, N/5 and N/10.

From the reaction given above it is evident that 2 KMnO₄ are equivalent to 5 oxygens, e.g., 2KMnO₄=K₂O+2MnO+5O, hence a normal solution would contain one-fifth of the molecular weight of KMnO₄=31.6 grams of the pure salt. Hence a N/5 solution would contain 6.32 grams per liter and a N/10 solution 3.16 grams.

Since commercial potassium permanganate is seldom pure, it is necessary to determine its exact value by standardization. This is commonly accomplished by any of the following methods:

(a) By a standard electrolytic iron solution.

(b) By ferrous salt solution, e.g., (NH₄)₂SO₄·FeSO₄·6H₂O.

(c) By oxalic acid or an oxalate.

Reaction. $2KMnO_4+5Na_2C_2O_4+8H_2SO_4$ = $K_2SO_4+2MnSO_4+5Na_2SO_4+10CO_2+8H_2O$.

Standardization of KMnO₄ against sodium oxalate is recommended as the most accurate procedure. The salt has no water of crystallization and is not hygroscopic. It can be obtained from the Bureau of Standards with a guarantee of purity. Traces of moisture can be expelled by heating the salt to 120° C. for two hours, then cooling in a desiccator.

N/5 Na₂C₂O₄ contains 13.40 grams per liter, N/10 solution contains 6.7 grams. For standardization of N/5 KMnO₄, 3.35 grams of the sodium oxalate are dissolved in warm (70°C.) water (about 200 cc.), 50 cc. of 2N. H₂SO₄ are added and the solution made up to 250 cc.

N/5 KMnO₄ contains 6.32 grams of the salt per liter. It is advisable to dissolve 6.4 grams of the salt in about 500 cc. of hot water and filter the solution through asbestos to remove any dioxide of manganese that may be present, as MnO₂ aids in the decomposition of KMnO₄ solution. The reagent should be kept tightly sealed in a dark bottle well protected from the light. This solution should stand two or three days before standardization.

To standardize the solution 100 cc. of the N/5 sodium oxalate solution is heated to about 70° C. and the permanganate solution added from a 100-cc. burette very slowly in small portions at a time, allowing the color to fade after each addition before adding more. When within 5-10 cc. of the end-point the permanganate solution should be added drop by drop until a faint permanent pink color persists.

Procedure for the Determination of Iron by the Jones Reductor

Preparation of Sample. Such an *amount* of the sample is taken that the iron content is between two- and three-tenths of a gram (0.2 to 0.3 gram). If hydrochloric acid has been required to effect solution, or hydrochloric acid and

nitric acid (25 cc. : 1 cc.), as in case of iron and steel, 4 to 5 cc. conc. sulphuric are added, and the solution evaporated to small bulk on the steam bath and to SO₂ fumes to remove hydrochloric acid. The iron is taken up with about 50 cc. dilute sulphuric acid, 1:4, heating if necessary, and filtering if an insoluble residue remains.

Preparation of the Reductor. Cleaning out the apparatus. See Fig. 40. The stop-cock of the reductor is closed, a heavy-walled flask or bottle is put into

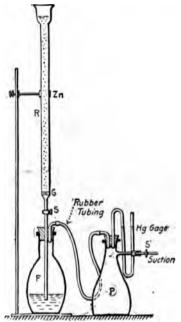


Fig. 40.—Jones Reductor.

position at the bottom, and 50 cc. of dilute sulphuric acid poured into the funnel. cock is opened and the acid allowed to flow slowly through the zinc in the tube, applying a gentle suction. Before the acid has drained out of the funnel, 50 cc. of water are added, followed by 50 cc. more of dilute sulphuric acid and 50 cc. of water in turn. The stopcock is turned off before the water has drained completely from the funnel so that the zinc is always covered by a solution of acid or water. This precaution should be observed in all determinations with the Jones reductor to prevent the inflow of air into the column of zinc. The contents of the flask being emptied and the flask replaced, the apparatus is ready for the determination of the blank.

Determination of the Blank. Fifty cc. of dilute sulphuric acid, 1:4, are passed through the reductor, followed by 250 cc. of distilled water, according to the directions given above. The acid solution in the flask is then titrated with N/10 KMnO₄ solution. If more than 3 or 4 drops of the permanganate are required, the operation must be repeated until the blank titration does not exceed this amount. The final blank obtained

should be deducted from the regular determinations for iron. The end-point of the titration is a faint pink, persisting for one minute.

Reduction and Titration of the Iron Solution. The sample is diluted to 200 cc., and, when cold, is run into the funnel, the stop-cock opened and the solution drawn slowly through the column of zinc into the flask, about four minutes being required for 200 cc. of solution. Before the funnel has completely drained, rinsings of the vessel which contained the sample are added; two 50-cc. portions are sufficient, followed by about 50 cc. of water. The stop-cock is closed before the solutions have completely drained from the funnel.

Titration. The flask is removed and tenth normal solution of permanganate added until a faint pink color, persisting one minute, is obtained. The blank is deducted from the cc. reading of the burette.

Cc. KMnO₄ thus found multiplied by the value of the reagent in terms of N/10 =true value of N/10 KMnO₄ required to oxidize the reduced iron.

One cc. N/10 KMnO₄ = .005584 gram Fe; or .007984 gram Fe₂O₃.

IRON 256a

Determination of Ferric Iron by Titration with Titanous Salt Solution

Method of Knecht and Hibbert¹ (modified by Thornton and Chapman²)

Introduction. The iron solution, which may contain hydrochloric acid, sulphuric acid or hydrofluoric acid (provided boric acid be added in considerable

excess) — but not nitric acid, is titrated while cold (15-20° C.) with a standard solution of titanous sulphate, using ammonium thiocyanate as indicator, until the red color of the ferric thiocyanate just disappears.

Any substance that might reduce the ferric iron or oxidize the titanous salt should, of course, be absent. Many forms of organic matter, however, do not interfere. Copper is quantitatively precipitated as cuprous thiocyanate, and certain other metals of the hydrogen sulphide group are not without effect. Platinum salts, chromic acid (not chromic salts) and vanadic acid exert an oxidizing action

on the titanium compound.

Reagents. Titanous Sulphate
Solution (1/10 Normal). The titanium solution is prepared by
mixing 100 cc. of a 20% solution
of titanous sulphate with 80 cc. of
sulphuric acid (1:1) and making
up the volume to 1 liter with cold
water.

Ammonium Thiyanate Solution. One hundred grams of the crystals are dissolved in water, filtered and the clear solution diluted to 1 liter.

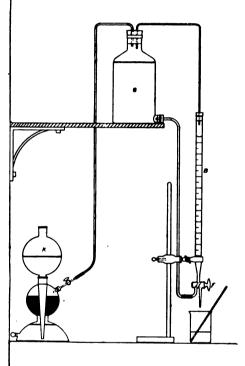


Fig. 40a.—Apparatus for Storing and Using Titanous Salt.

Ferric Ammonium Sulphate Solution. Forty eight grams of ferric alum crystals are dissolved in water, the solution acidified with 50 cc. of concentrated sulphuric acid and after filtration the volume made up to 1 liter.

¹ E. Knecht and E. Hibbert, "New Reduction Methods in Volumetric Analysis," 1918, pp. 12, 49, 51 and 53.

² Wm. M. Thornton, Jr. and J. E. Chapman, J. Am. Chem. Soc., 43, 91 (1921).

³ Wm. M. Thornton, Jr. and J. E. Chapman, J. Am. Chem. Soc., 43, 91 (1921).

³ Knecht and Hibbert employ titanous chloride, which for most purposes is equally efficient. Either salt, in the form of a 20% solution, may be obtained from The La Motte Chemical Products Co. 13 W. Saratoga St. Baltimore, Md.

Motte Chemical Products Co., 13 W. Saratoga St., Baltimore, Md.

4 The ferric alum solution will serve for a "back titer" in any analysis, and it will enable the operator to quickly detect any change in the oxygen consuming capacity of

the titanous salt solution.

256b IRON

Apparatus. The titanous sulphate solution, prepared as described above, is charged into the storage bottle S, Fig. 40a, the volume being so regulated as to fill the container to its neck. The stopcock F is then turned so that the liquid rises in the burette B and on up until hydrostatic equilibrium has been reached. With the hydrogen supply turned on from the Kipp generator K, the burette is allowed to empty itself by properly manipulating the cock F, and a current of pure hydrogen is maintained through the apparatus till it is reasonably certain that all air from within the system has been displaced. On being refilled the burette will be ready for service.

One and five tenths grams of ferrous ammonium sulphate Standardization. (C. P. crystals) are weighed with exactness into a 500 cc. Erlenmeyer flask and dissolved in about 150 cc. of water. Ten cc. of sulphuric acid (1:1) are added and the solution titrated at once with potassium permanganate, which has previously been standardized against Bureau of Standards sodium oxalate. until the end-point is just reached. After boiling for 10 minutes, the liquid is cooled at the tap to about 15° C. and titrated carefully with titanous sulphate in the presence of 10 cc. of the ammonium thiocyanate solution to complete Another 1.5 gram portion of the same ferrous ammonium sulloss of color. phate is titrated with titanous sulphate—omitting, however, the preliminary oxidation with permanganate. If the second small titer be deducted from the first titer, the difference will give the iron value of the titanium solution against sodium oxalate; while the main titer (uncorrected) will serve as a basis on which to calculate the standard against ferrous ammonium sulphate. specimens of ferrous ammonium sulphate of good quality, the results will be found to be in close agreement; but in case there is any considerable discrepancy, preference should be given to the sodium oxalate value.

Procedure. Ferric Iron. The solution, which may conveniently contain any amount of iron up to 0.28 gram and whose initial volume should not at the most exceed 500 cc., is titrated with titanous sulphate—using the same

quantities of reagents and otherwise as prescribed above.

Total Iron. To determine the entire amount of iron present, notwith-standing its state of oxidation, the whole must be gotten into the ferric condition. This may be accomplished in one of three ways: (1) the solution is treated with hydrogen peroxide in ammoniacal solution and boiled to decompose the excess of the peroxide and finally acidified with hydrochloric acid; (2) the sulphuric acid solution is titrated with potassium permanganate (the exact strength of which need not be known) as detailed under standardization; (3) the solution is oxidized with potassium chlorate and hydrochloric acid and the excess chlorate removed by evaporation. The second method is generally to be preferred. Large amounts of hydrochloric acid may be removed by evaporation on the water bath with sulphuric acid in excess; but with small concentrations of said acid the evil effect upon permanganate may be offset by adding a sufficient quantity of the Zimmermann-Reinhardt preventive reagent. 67 g. MnSO₄.4H₂O + 500 cc. H₂O + 138 cc. H₃PO₄ (sp. gr. 1.7) + 130 cc. H₂SO₄ (sp. gr. 1.82). Mixture diluted to 1000 cc.

R

Stannous Chloride Method for Determination of Ferric Iron

The procedure is based upon the reduction of the yellow ferric chloride to the colorless ferrous salt by stannous chloride, the following reaction taking place:

The method is of value in estimating the quantity of ferric iron in presence of ferrous, where the two forms are to be determined. In order to obtain the

total iron the ferrous is oxidized by adding a few crystals of potassium chlorate and taking to dryness to expel chlorine, and then titrated with stannous chloride.

The accuracy of the method depends upon the uniformity of conditions of temperature, concentration, etc., of making the run with the sample and of standardizing the stannous chloride. The solution should be free from other oxidizing agents, or from salts that give colored solutions.

The amount of iron in terms of ferric oxide that can be estimated by this procedure ranges from 0.002 gram to 0.05 gram.

Reagents. Stannous Chloride Solution. The reagent is prepared by dissolving 2 grams of stannous chloride crystals in hot concentrated hydrochloric acid and making up to 1 liter. The solution should be kept in a dark bottle to which the titrating burette is attached in such a way that the liquid may be siphoned out into this, as shown in the illustration, Fig. 41. The air entering the bottle passes through phosphorous or pyro-

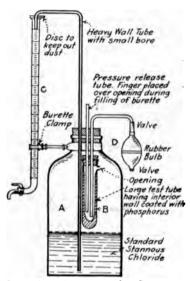


Fig. 41.—Apparatus for Stannous Chloride Titration of Iron.

gallic acid to remove the oxygen. In this way, protected from the air, the reagent will keep nearly constant for several weeks. It is advisable, however, to restandardize the solution about every ten to fifteen days. One cc. will be equivalent to about 0.001 gram Fe.

Standard Iron Solution. 8.6322 grams of ferric ammonia alum is dissolved in dilute hydrochloric acid and made up to one liter. The iron is determined in 100-cc. portions by the dichromate method. One cc. will contain about 0.01 gram Fe.

Procedure. To the sample in a casserole is added 25 cc. of concentrated hydrochloric acid and an equal volume of water. The resulting solution is heated to boiling and quickly titrated with the stannous chloride reagent, until the yellow color fades out and the solution becomes colorless.

Note. The titration should be done quickly, as the iron will reoxidize on standing and the solution again become yellow. The true end-point is the first change to a colorless solution.

COLORIMETRIC METHODS FOR THE DETERMINATION OF SMALL AMOUNTS OF IRON

Iron Traces. Sulphocyanate (Thiocyanate) Method 1

Introduction. By this method 1 part of iron may be detected in 50 million parts of water. The presence of free mineral acid increases the sensitiveness of the method, so that it is especially applicable to the determination of small amounts of iron in mineral acids. It is available in presence of many of the ordinary metals and in presence of organic matter. Silver, copper, cobalt, mercuric chloride, however, interfere.

Nitric acid gives a color with sulphocyanates that may be mistaken for iron

This method, like the stannous chloride method, determines only the ferric iron. It is based on the fact that ferric iron and an alkali sulphocyanate. ammonium or potassium sulphocyanates, in an acid solution gives a red color. the intensity of which is proportional to the quantity of iron present. The color is due to the formation of the compound, Fe(CNS), 9KCNS-4H2O.

Reagents Required. Standard Iron Solution. A ferric solution, the iron content of which has been determined, is diluted and divided so as to obtain 0.0004 gram Fe. This is made up to 2 liters with water containing 200 cc. of iron-free, C.P. H.SO4. One hundred cc. of this solution, together with 10 cc. of normal ammonium sulphocyanate solution, is used as a standard. One hundred cc. contains 0.00002 gram Fe.

Normal sulphocyanate contains 76.1 grams of NH₄CNS per liter.

Procedure. The weighed sample, 1 to 10 grams, or more if necessary, is dissolved in dilute H2SO4 and oxidized by adding dilute permanganate, KMnO4, solution drop by drop until a faint pink color is obtained. The sample is diluted to exactly 100 cc. and is poured into a burette graduated to $\frac{1}{10}$ cc. Two colorless glass cylinders of the 100-cc., Nessler type are used for comparison of standard and sample. Into one cylinder is poured 100 cc. of the standard solution, made as directed above. Into the second cylinder containing 10 cc. of sulphuric acid with 10 cc. ammonium sulphocyanate, NH4CNS, diluted to 60 or 70 cc., the sample is run from the burette until the depth of the color thus produced on dilution to 100 cc. exactly matches the standard. From the number of cc. used the weight of the sample is calculated. One hundred cc. of the standard contains 0.00002 gram Fe.

Dividing the weight of iron in the standard by the weight of sample used and multiplying by 100 gives the per cent of iron in the sample.

Notes. If other metals are present, that form two series of salts, they must be in the higher state of oxidation, or the color is destroyed. (Sutton.) Oxalic acid, if present, destroys the color. Oxidation with KMnO4 or KClO2 with subsequent removal of Cl2 prevents this interference. (Lunge, C. N., 73, 250.)

Chlorides of the alkaline earths retard or prevent the sulphocyanate reaction.

(Weber, C. N., 47, 165.)

The colorimeter used for the determination of minute quantities of lead would serve admirably for the determination of traces of iron by the sulphocyanate method.

Acids, hydrochloric or sulphuric (diluted), may be added directly to the ammonium sulphocyanate solution.

¹. Thomson, J. C. S., 493, 1885, and C. N., 51, 259. Kruss and Moraht, C. N., 64. 255. Davies, C. N., 8, 163.

Salicylic Acid Method for Determining Small Amounts of Iron 1

Salicylic acid produces an amethyst color with neutral solutions of ferric salts, the depth of the color being proportional to the concentration of the ferric iron in the solution. The reaction is useful in determining small amounts of iron in neutral salts, such as sodium, ammonium, or potassium alums, sulphates, or chlorides, zinc chloride, etc. Phosphates, fluorides, thiosulphates, sulphites, bisulphites and free mineral acids should be absent. The sample should not contain over 0.0002 gram iron, as the depth of color will then be too deep for colorimetric comparisons. As low as 0.00001 gram ferric iron may be detected. Ferrous iron produces no color with the reagents, hence the procedure serves for determining ferric iron in presence of ferrous.

The material is dissolved in 20 cc. of pure water, the sample filtered if cloudy. and transferred to a Nessler tube. Dilute potassium permanganate solution is added until a faint pink color is produced and then 5 cc. of a saturated solution of salicylic acid. (The reagent is filtered and the clear solution used.) Comparison is made with standard solutions containing known amounts of ferric iron, the standards containing the same reagents as the sample. If desired the standard iron solution (0.086 gram ferric ammonium alum, clear crystals, dissolved in water containing 2 cc. of dilute sulphuric acid and made to 1000 cc.. each cc. contains approximately 0.00001 gram Fe") is added from a burette to 5 cc. of salicylic acid diluted to 25 cc. in a Nessler tube, until the color of the standard matches the sample. A plunger is used to stir the liquids.

TECHNICAL ANALYSIS OF IRON AND STEEL

The elements carbon, manganese, phosphorus, sulphur, and silicon are invariable constituents of iron and steel, and are always included in an analysis.

Copper and arsenic are sometimes found; aluminum, chromium, nickel, molybdenum, tin, titanium, tungsten, vanadium, and zinc occur in special alloy steels. Minute traces of oxygen, hydrogen, and of many other elementary constituents frequently are present, but are of so little importance that they are seldom considered in an analysis.

Our attention is drawn in this chapter to the more important constituents, whose estimation is required in the daily routine analysis of a steel works laboratory. The elements considered are carbon-carbide or combined carbon and graphitic carbon, manganese, phosphorus, sulphur, and silicon. Determination of the elements of special alloy steels containing aluminum, chromium, nickel, titanium, tungsten, vanadium, etc., are given in the chapters on the elements in question; for example the determination of vanadium in steel will be found in the chapter on Vanadium, chromium and copper in

the chapters on Chromium and Copper, etc. As is generally the case, a large number of determinations are required in the steel works laboratories and it is not an Dividing Pipette. uncommon thing for one man to turn out 50 to 100 determina-

Fig. 42.

tions a day. To accomplish this, simple and rapid procedures are required. When the metal is unusually high in an undesirable constituent it is indicated ¹ Method of W. S. Allen, by courtesy of the General Chemical Company.

by the test, and a confirmation of the result is obtained by an additional test, exercising extreme care, and using a procedure giving results of the highest accuracy. Fortunately the analysis of steel has received considerable attention and rapid methods have been worked out which are extremely accurate.

The procedures briefly outlined have proven of value to analysts of iron and steel. While in charge of the laboratory at Baldwin Locomotive Works, the author found that a skilled analyst was able to turn out 125 determinations of combined carbon, or 100 of manganese, or of sulphur, or 50 determinations of phosphorus, or 25 determinations of silicon per day by the procedures given. This necessitates the use of a large number of beakers and flasks, ample desk room, individual balances, hot plates, and hoods to accommodate a dozen to two dozen beakers or flasks at a time, and a carefully planned system.

The dividing pipette, shown in Fig. 42, is useful for adding a definite amount of reagent to the sample.

In addition to the short methods, we include the procedures recommended by the U. S. Bureau of Standards, for cases where accuracy is essential and time a secondary consideration.

Preparation of the Sample

The metal is sampled by drilling with a clean twist drill, using no water or oil.

Hard grades of pig iron, chilled iron, ferromanganese, quenched steel, etc., are broken down to a coarse powder in a chilled steel mortar.

Combined or Carbide Carbon—Colorimetric Method

Rapid Method. 0.2 gram of well-mixed drillings is placed in a test-tube $6 \times \frac{3}{4}$ ins. and 4 to 10 cc. of nitric acid (sp.gr. 1.2) added from a burette, the test-tube being placed in cold water to prevent too violent action. The amount of acid added is governed by the carbon-content of the steel (see chapter on Carbon, page 128). After the violent action has ceased, the tube is placed in a specially-designed water bath, the water heated to boiling and boiled for twenty minutes or more until the solution in the tube has become perfectly clear. The sample is now removed, washed into a color carbon tube and compared with a standard steel of the same class of material as that examined. Full details of the procedure may be found in the chapter on Carbon.

Iron and steel containing graphite must be filtered before making comparisons. The solution, diluted with one-half its volume of water, is filtered through a small filter paper into a test-tube. The residue is washed with a fine jet of distilled water until free of color. The filtrate is compared with a standard sample of similar composition treated in the same way.

Steel containing chromium, copper, nickel, and elements yielding a colored solution should not be examined by the colorimetric methods.

Method of the Bureau of Standards. Total and graphitic carbon are determined and the difference taken as combined carbon.

Specifications for Combined Carbon.

Material.	Per cent Carbon.
Boiler rivets	. 0.15
Seamless boiler tubes	. 0.18-0.25
Boiler and fire-box plates	. 0.15-0.25
Cylinder grade pig iron	. 0.25-0.50
Forged and rolled steel wheels.	. 0.70-0.75
Steel blooms for forgings, open hearth, basic	. 0.40 0.55
Steel blooms for forgings, acid	. 0.35-0.40
Bolt steel	. 0.22-0.28
Spring steel	
Crank axles forged	
Castingno	
Tire steel	
Floor grade pig ironn	

Total Carbon

The determination is required for an accurate estimation of carbon where the color test indicates the carbon content outside the limits of requirement, or in cases where interfering substances are present. In material where the carbon content is of extreme importance, the color method is not used. Details of the procedure for determining carbon by direct combustion are given in the chapter on Carbon. The following procedure is recommended by the Bureau of Standards:

- (a) In Irons. Two grams of iron are mixed with about twice the weight of purified ferric oxide. The mixture is placed in a platinum boat, which is lined with a suitable bed material, and is burned in a current of oxygen, as described below.
- (b) In Steels. The method is the same as for irons with omission of the ferric oxide mixture.

Details of Direct Combustion Method. Furnaces and Temperature of Burning. Porcelain tubes wound with "nichrome" wire, provided with suitable heat insulation and electrically heated, are used, and readily give temperatures to 1100° C. Type FB 301 Hoskins tube furnace and the hinged type, Fig. 32b, are satisfactory. The temperature control is by means of an ammeter and rheostat in series with the furnace, with occasional check by a thermocouple.

Boats and Lining. Platinum boats provided with a long platinum wire for manipulation in the tube are mostly used; alundum ones occasionally. The bed or lining on which the steel rests is 90-mesh "RR alundum, alkali-free, specially prepared for carbon determination." A layer of this alundum is also placed in the bottom of the combustion tube to prevent the boat sticking to the glaze. A platinum cover for the boat is sometimes used, and is essential when the combustion is forced.

The nature and quality of the bed material are matters of great importance. Alumina as prepared from the sulphate or from alum may not be free from sulphate or alkali, both of which have given serious trouble at the Bureau. The alkali, if present, may not manifest itself by an alkaline reaction until after one or two combustions have been made, using the same bed material. Even the ordinary white "alundum" on the market carries a few hundredths of 1% of alkali. Iron oxide has been tried, and when pure should, apparently, give good

262 IRÓN

service. As yet, however, it has been difficult to obtain or prepare acceptable material for use with steels. Quartz sand gives rise to a fusible slag, which melting before combustion is complete, incloses bubbles of carbon dioxide gas. This defect would probably inhere in any other material of an acid character. The presence in the silica bed after combustion of crystals which appear to be carborundum, have occasionally been noted.¹

Purity of Oxygen. Blanks. The Bureau makes its oxygen electrolytically, and its content of this element is usually 99 to 99.5%, and sometimes higher. Even with this gas a slight blank is usually obtained. When running a blank, in addition to the usual precautions, the rate at which the oxygen is introduced should be the same as when burning a sample, and the time should be three to five times as long.

Method of Admitting Oxygen and Rate of Combustion. The furnace being at the proper temperature, the boat containing the sample is introduced. Oxygen is admitted either at once or after the boat has reached the temperature of the furnace, as the operator prefers, or as the nature of the steel may demand. The rate of flow of the oxygen varies with the absorption apparatus used and with the preference of the operator, and may be considerably more rapid when absorbing carbon dioxide in soda lime than in an alkaline solution. A rapid flow of oxygen also facilitates the burning of resistant samples. A continuous forward movement of the gas current is maintained at all times. The time for a determination varies, of necessity, with the nature of the sample and the rate of flow of the oxygen, ranging from ten to thirty minutes. The endeavor is to obtain a well-fused oxide. With all samples close packing in a small space is conducive to rapid combustion and to fusion of the resulting oxide.

Authorities differ as to the advisability of allowing the oxide of iron to fuse thoroughly. Even when fusion does take place additional carbon dioxide is obtained very frequently by grinding the oxide and reburning. Often more than one regrinding and reburning is necessary in order to reduce the amount of carbon dioxide obtained to that of the constant blank.

Oxides of sulphur have been found very difficult to eliminate from the gases leaving the tube. Lead peroxide ("nach Dennstedt") heated to 300° C. and zinc at room temperature appear to retain them best

Attention is called to the inadmissibility of using dry agents of different absorptive power in the same train, in positions where a difference could possibly affect results.

Weighing of Tubes. There is much greater difficulty in securing constant conditions when weighing absorption tubes than is usually considered to be the case. Electrical effects, caused by wiping as a preliminary to weighing, may occasionally cause errors in weight running into the milligrams. The use of counterpoises of equal volume and similar material and shape is recommended

If tubes are weighed full of oxygen, care is necessary to secure a uniform atmosphere in them. Even though the attempt is made to keep the apparatus always full of oxygen, some air is admitted when the boat is pushed into the combustion tube, and a much longer time is required to displace this than is usually allowed, unless the flow of oxygen during aspiration is rapid. The same is true if the tubes are weighed full of air by displacing the oxygen left in them after the steel is burned. Another source of error may arise from the

¹ Statement of Mr. George M. Berry, of the Halcomb Steel Co.

air admitted when putting the boat into the tube, if this air contains much carbon dioxide, as is the case when a gas furnace is used. The boat is usually pushed at once into the hot furnace, and as combustion begins almost immediately, there is no opportunity for displacing this air before the steel begins to burn.

Graphite in Iron

Two grams of iron are dissolved in nitric acid (sp.gr. 1.20), using 35 cc. and heating very gently. The residue is collected on an asbestos felt, washed with hot water, then with a hot solution of potassium hydroxide (sp.gr. 1.10), followed by dilute hydrochloric acid and finally by hot water. After drying at 100° C., the graphite is burned in the same manner as the total carbon, but without admixture of ferric oxide.

Manganese in Iron and Steel. Ammonium Persulphate Method

Small amounts of manganese may be determined colorimetrically by the persulphate method, provided the sample does not contain over 1.5% of manganese. The procedure given in detail in the chapter on Manganese, page 305, in brief is as follows:

Reaction.
$$2\text{Mn}(\text{NO}_3)_2 + 5(\text{NH}_4)_2\text{S}_2\text{O}_5 + 8\text{H}_2\text{O}$$

= $5(\text{NH}_4)_2\text{SO}_4 + 5\text{H}_2\text{SO}_4 + 4\text{HNO}_3 + 2\text{HMnO}_4$.

0.1 to 0.2 gram of steel, according to the amount of manganese in the sample, is placed in a 10-in. test-tube and 10 cc. of nitric acid (sp.gr. 1.2) are added. The sample is heated in a water bath until the nitrous fumes are driven off and the steel is completely in solution. 15 cc. AgNO₂ sol. (1.5 g. per l.) are added to the cooled sample, followed immediately with about 1 gram of ammonium persulphate crystals. The solution is warmed (80 to 90° C.) until the color commences to develop, and then for half a minute longer, and then placed in a beaker of cold water until the solution is cold. Comparison is now made with a standard steel treated in the same way. The comparison being made exactly as indicated for determining carbon by the color method. See chapter on Carbon.

Example. If the standard, containing 0.6% Mn is diluted to 15 cc., each cc. =0.04% Mn. If the sample required a dilution of 20 cc. to match the standard, then $0.04\times20=0.8\%$ Mn.

Lead Oxide Method (Deshey).

Oxidation of the manganese in the steel is effected in a nitric acid solution by addition of red lead (or by lead peroxide); the lead peroxide, formed oxidizes the manganese nitrate to permanganic acid. The solution is now titrated with standard sodium arsenite, the following reaction taking place:

$$2HMnO_4 + 5Na_2AsO_3 + 4HNO_3 = 5Na_2AsO_4 + 3H_2O + 2Mn(NO_3)_2$$

0.5 gram of steel is placed in a 150-cc. beaker and dissolved with about 30 cc. of nitric acid (sp.gr. 1.12). After violent action has subsided, the beaker

is placed on a hot plate and when the iron has dissolved, 20 cc. of water added. The manganese is now oxidized by adding red lead in small portions at a time, until the solution appears brown with a pinkish purple foam on the surface. The solution is diluted with hot water until the volume is about 100 cc. and then boiled for a few minutes. It is now placed in a dark closet to cool. (A fresh batch of samples may be started in the meantime.) The solution is carefully decanted off from the peroxide, and with the washings of the peroxide residue, titrated with standard sodium arsenite to the yellowish green endpoint. The sodium arsenite is made by dissolving 4.96 grams of pure arsenous acid together with 25 grams of sodium carbonate in 200 cc. of hot water and the solution diluted to 2500 cc. The arsenite is standardized against a steel sample of known manganese content, or against standard permanganate solution.

Bismuthate Method for Determining Manganese, Recommended by the U. S. Bureau of Standards 1

This is the most accurate method for determining manganese in iron and steel. The procedure is as follows:

Procedure. One gram of drillings is dissolved in 50 cc. of nitric acid (sp.gr. 1.135) in a 200-cc. Erlenmeyer flask. Irons should be filtered. The solution is cooled, about 0.5 gram of sodium bismuthate is added, and it is then heated until the pink color has disappeared. Any manganese dioxide separating is dissolved in a slight excess of a solution of ferrous sulphate or sodium sulphite. The solution is boiled till free from nitrous fumes. After cooling to 15° C., a slight excess of bismuthate is added and the flask is shaken vigorously for a few minutes. Then 50 cc. of 3% nitric acid is added and the solution is filtered through asbestos. A measured excess of ferrous sulphate is run in and the excess titrated against permanganate solution which has been compared with the iron solution on the same day. A great many steels now carry small amounts of chromium as impurity. In such cases titration against arsenite solution is recommended, or removal of the chromium by zinc oxide and subsequent determination of the manganese by the bismuthate method.

Permanganate solutions are standardized against sodium oxalate (Bur. Stds. Sample No. 40) as prescribed by McBride.²

Specifications for Manganese in Iron and Steel

Material.	Percentage of Manganese.
Material. Boiler rivets	
Boiler and fire-box plates	not over 0.45
Seamless boiler tubes	0.40-0.65
Floor-grade pig iron	not over 0.80
Cylinder-grade pig iron	0.50-0.80
Forged and rolled steel wheels	0.60-0.80
Steel blooms for forgings	not over 0.70
Bolt steel	
Spring steel not	over 0.50 (0.25 desired)
Crank axles, forged	not over 0.75
Castings	
Tire steel	0. 50-0.75

¹See page 263.

² Bull. Bur. Sds., 8, 641. J. Am. Chem. Soc., **34**, 393, 1912.

IRON 265 ·

Determination of Phosphorus

The procedures outlined by the Bureau of Standards are generally used in steel works laboratories.

- (a) Preparation of Solution and Precipitation of Phosphorus. Two grams of sample are dissolved in nitric acid (sp.gr. 1.135) and the solution is boiled until brown fumes no longer come off. Ten cc. of permanganate solution (15 grams to 1 liter) are added, and the boiling is continued. Sodium sulphite solution is added to dissolve the oxide of manganese, and the solution is again boiled and then filtered. With irons the insoluble residue should be tested for phosphorus. After cooling the filtrate, 40 cc. of ammonia (sp.gr. 0.96) are added. the solution is agitated, and when the temperature is at 40° C., 40 cc. of molybdate solution are added and the solution is shaken vigorously for five minutes. After settling out, the yellow precipitate is treated according to one of the following methods, b or c:
- (b) Alkalimetric Method. The precipitate is washed with 1% nitric acid solution followed by 1% potassium nitrate solution until the washings are no longer acid. The precipitate is dissolved in a measured excess of standardized sodium hydroxide solution and titrated back with standardized nitric acid using phenolphthalein. The solutions are standardized against a steel with a known amount of phosphorus.
- (c) Molybdate Reduction Method. The precipitate is washed ten to fifteen times with acid ammonium sulphate (prepared according to Blair) or until the washings no longer react for iron or molybdenum. It is dissolved in 25 cc. of ammonia (5 cc. ammonia of 0.90 sp.gr. to 20 cc. water). The filter is washed well with water and 10 cc. of strong sulphuric acid added to the filtrate, which is run through the reductor at once and titrated against a N/30 permanganate solution which has been standardized against sodium oxalate. as prescribed by McBride.2

Specifications for the Amount of Phosphorus

Class of Material.	Limit of Phon- phorus Allowed, per cent.
Boiler steel.	0 . 0 5
Forged and rolled steel wheels	0 . 05
Steel blooms for forgings	0.05
Crank axles	
Tire and bolt steel	0.05
Spring steel	0.05
Spring steel desired	0.03
Fire-box plates	0 . 03
Castings	0 . 06
Floor-grade pig iron	0.5–0.9
Cylinder iron	0.5–0.9

Determination of Sulphur

Rapid-evolution Method. Volumetric. Five grams of iron or steel are placed in a 500-cc. Erlenmeyer flask, provided with a two-holed rubber stopper. through which passes a long-stem thistle tube reaching to the bottom of the

Blair, "Chemical Analysis of Iron," (7th Ed.), p. 97.
 Bull. Bur. Stds., 8, 641. J. Am. Chem. Soc., 34, 393, 1912.

flask, and a delivery-bulb condenser, connected by means of a rubber tube to an absorption bulb. (See sketch of apparatus in the chapter on Sulphur, volumetric methods, page 501.)

About 25 to 35 cc. of an ammoniacal solution of cadmium chloride are placed in the absorption bulb, the apparatus connected and about 100 cc. of dilute hydrochloric acid (sp.gr. 1.1) poured through the thistle tube into the flask containing the drillings. The mixture is heated gently until the sample goes into solution and then boiled until steam escapes from the apparatus. The reagent in the absorption bulb should remain alkaline, otherwise a loss of sulphur

The absorption bulb is now disconnected and the contents emptied into a 400-cc. beaker and the bulb washed out with dilute hydrochloric acid after first rinsing out once or twice with water. The solution is now diluted to about 300 cc., and if not already acid, is made so by addition of more hydrochloric acid.

Two to 3 cc. of starch indicator are added and the mixture titrated with standard iodine, stirring constantly during the titration. A permanent blue color in the end-point sought. If much cadmium sulphide is present additional hydrochloric acid may be required.

The number of cc. of iodine solution required multiplied by the factor of iodine to sulphur gives the amount of sulphur present in the sample taken.

Notes. For a more complete description of the procedure see chapter on Sulphur. With certain pig irons low results are apt to be obtained by the evolution method. For such the gravimetric method given is recommended.

Gray iron will evolve all its sulphur as H₂S, white iron, gray water-chilled iron, gives up only part of its sulphur by the evolution method. The method gives low results for high carbon steel.

In place of absorbing the H_2S in cadmium chloride, the Bureau of Standards recommends absorption in an ammonicaal solution of hydrogen peroxide (5 cc. H_2O_1 3% + 25 cc. NH_4OH , sp.gr., 0.90). The sulphuric acid formed is precipitated from a slightly hydrochloric acid solution, by barium chloride and weighed as $BaSO_4$.

Method by the U. S. Bureau of Standards. Gravimetric Sulphur by Oxidation

Five grams of iron or steel are dissolved in a 400-cc. Erlenmeyer flask, using 50 cc. of strong nitric acid. A little sodium carbonate is added, the solution is evaporated to dryness, and the residue baked for an hour on the hot plate. To the flask 30 cc. of strong hydrochloric acid are added, and the evaporation and baking are repeated. After solution of the iron in another 30 cc. of strong hydrochloric acid and evaporation to a sirupy consistency, 2 to 4 cc. of the same acid are added, followed by 30 to 40 cc. of hot water. The solution is then filtered and the residue washed with hot water. The sulphur is precipitated in the cold filtrate (about 100 cc.) with 10 cc. of a 10% solution of barium chloride. After forty-eight hours the precipitate is collected on a paper filter, washed first with hot water (containing 10 cc. of concentrated hydrochloric acid and 1 gram of barium chloride to the liter) until free from iron and then with hot water till free from chloride; or, first with cold water, then with 25 cc. of water containing 2 cc. of concentrated hydrochleric acid to the liter. The

washings are kept separate from the main filtrate and are evaporated to recover dissolved barium sulphate.

With irons the paper containing the insoluble residue above mentioned is put into a platinum crucible, covered with sodium carbonate free from sulphur, and charred without allowing the carbonate to melt. The crucible should be covered during this operation. Sodium nitrate is then mixed in and the mass fused with the cover off. An alcohol flame is used throughout. The melt is dissolved in water and evaporated with 'hydrochloric acid in excess to dryness in porcelain. The evaporation with water and hydrochloric acid is repeated to insure removal of nitrates. The residue is extracted with a few drops of hydrochloric acid and water, the insoluble matter is filtered off, and barium chloride is added to the filtrate. The barium sulphate obtained is added to the main portion.

Careful blanks are run with all reagents.

Specifications for Sulphur in Iron and Steel

Material.	Specifications, per cent.
Seamless boiler tubes must be be	low 0.05
Cylinder iron	0.05
Forged and rolled steel wheels	0.05
Steel blooms for forgings, basic and acid open hearth	0.05
Bolt steel	0.05
Spring steel	0.05
Crank axles	0.05
Tire steel	0.05
Castings	0.06
Boiler rivets	0.04
Floor-grade iron	0.04
Boiler plates	0.035
Fire-box plates	0.035
Amount desired in spring steel	0.030
Muck bar iron	0.02

Determination of Silicon

One gram of pig iron, cast iron, and high silicon iron, or 5 grams of steel, wrought iron, and low silicon iron are taken for analysis. (By taking multiples of the factor weight 0.4693, SiO₂ to Si, the final calculation is simplified.) The sample is placed in a 250-cc. beaker and 20 to 50 cc. of dilute nitric acid added. If the action is violent, cooling the beaker in water is advisable. When the reaction subsides, 20 cc. of dilute sulphuric acid, 1:1, are added, the mixture placed on the hot plate and evaporated to dense white fumes. The residue is taken up with 150 cc. of water containing 2 to 5 cc. of sulphuric acid and heated until the iron completely dissolves.

The solution is filtered and the silica residue washed first with hot dilute hydrochloric acid, sp.gr. 1.1, and then with hot water added in small portions to remove the iron sulphate. The residue is now ignited and weighed as silica.

Note. If the ash is colored by iron oxide, silica is determined by difference, after expelling the silica by adding 4 to 5 cc. of hydrofluoric acid and a few drops of sulphuric, taking to dryness and igniting he esidue.

The following acid mixtures are recommended by the U. P. Ry. For steel, wrought iron and low silicon iron, 8 parts by volume of HNO₃, sp.gr. 1.42; 4 parts of conc. H₂SO₄, sp.gr. 1.84; 6 parts HCl, sp.gr. 1.2 and 15 parts by volume of water. For

268 IRON

dissolving pig iron, cast iron and high silicon iron, a mixture of 8 parts by volume of strong nitric acid and 5 parts of strong sulphuric acid, diluted with 17 volumes of water is used.

Rapid Method for Determining Silicon in Foundry Work. Liquid iron, dropped into cold water from a ladle 3 ft. above the water, will form shot shaped according to forms resulting from its chemical constitution, silicon being an important factor. Round shot, concave upper surface, $\frac{1}{4}$ to $\frac{3}{8}$ in. in diameter, indicate over 2% silicon. Flat, or irregular shot indicate low silicon. Shot with elongated tails indicate very low silicon.

Method of the U.S. Bureau of Standards for Silicon

The insoluble residue obtained in preparing the iron or steel for the gravimetric sulphur determination is filtered off, ignited in platinum, and weighed. Evaporation with a little hydrofluoric acid and 1 drop of sulphuric acid and subsequent ignition gives by the loss of weight silica corresponding to the silicon of the sample.

Specifications for Silicon in Iron and Steel

Material.	Amount of Silicon, per cent.
Boiler and fire-box plates	not over 0.03
Floor-grade pig iron	
Cylinder-grade pig iron	1.25-1.60
Cylinder-grade pig iron	not over 0.20
Spring steel	not over 0.25 (0.15 desired)
Tire steel.	under 0.25

Determination of Silicon, Aluminum, Titanium, Zirconium in Steel¹

This method developed by Lundell and Knowles, Bureau of Standards, provides for the determination of silicon, aluminum, titanium and zirconium in one portion of steel in presence of one or more of the following: tungsten, chromium, uranium, cerium, manganese, phosphorus, vanadium, molybdenum, copper, nickel and cobalt.

Procedure. Dissolve five grams of the steel in 50 cc. of hydrochloric acid (sp.gr. 1.2) by gentle warming and the addition of 1 cc. portions of nitric acid from time to time to insure solution of the zirconium and titanium and also oxidation of the iron.

When solution is complete, evaporate to dryness, take up in 10 cc. of hydrochloric acid (sp.gr. 1.2), again evaporate to dryness, and finally bake at a gentle heat in order to decompose nitrates.

Cool, take up in 50 cc. of 1:1 hydrochloric acid, and filter when the iron is completely in solution. Wash the residue with cold 1:1 hydrochloric acid. Save the filtrate and washings.

¹ Communicated to the editor by W. F. Hillebrand, U. S. Bureau of Standards, and published by his permission and the courtesy of the authors, G. E. F. Lundell and H. B. Knowles, Bureau of Standards.

IRON 269

Ignite the residue and paper in a platinum crucible, cool and weigh. Treat with 1 cc. of sulphuric acid (1:1) and sufficient hydrofluoric acid, fume off in the usual manner, ignite and weigh to obtain silica, and calculate silicon.

Fuse the slight residue left after the hydrofluoric acid treatment with a small amount of potassium pyrosulphate, dissolve in 10-20 cc. of 5% sulphuric acid and add the solution to the acid extract from the ether separation obtained as described below.

Evaporate the filtrate and washings from the silica determination to a syrupy consistency, take up in 40 cc. of hydrochloric acid (sp.gr. 1.1) and extract with ether in the usual manner. (The *ether* extract will contain most of the molybdenum, and this element may be qualitatively tested for in it. If molybdenum is present it is more conveniently determined in a separate portion of steel.) The acid extract will contain some iron, and all of the zirconium, titanium, aluminum, nickel, chromium, etc.

Gently boil off the ether in the acid extract, add the matter recovered from the silica, oxidize ferrous iron with a little nitric acid, dilute to 300 cc., cool and precipitate with 20% sodium hydroxide solution, adding 10 cc. in excess. Filter, and save the filtrate. Dissolve the precipitate in warm dilute 1:1 hydrochloric acid and reserve the solution for subsequent analysis.

(In precise work, it is advisable to treat as follows the filter used above: Ignite in platinum, fuse with sodium carbonate, digest with hot water, filter, wash, dissolve the residue in hot 1:1 hydrochloric acid and add to the main acid solution. This precaution makes certain the recovery of any zirconium held back on the filter as zirconium phosphate insoluble in acid.)

Determination of Aluminum in the Absence of Chromium

Acidify the sodium hydroxide filtrate with hydrochloric acid, add a few drops of methyl red, boil, and make barely alkaline with ammonium hydroxide. After two minutes, filter and wash thoroughly, with warm 2% ammonium chloride solution. It is imperative that all sodium chloride be washed out of the filter paper. Ignite for aluminum oxide in the usual manner and calculate aluminum. (The sodium hydroxide reagent must be tested for substances precipitable by ammonia, and appropriate corrections must be made in the aluminum determination when these are present.)

Determination of Aluminum in the Presence of Chromium

Proceed as above until the sodium hydroxide filtrate is obtained. Then oxidize with a little bromine water, make just acid with 1:2 nitric acid, add ammonium hydroxide in slight excess, heat to boiling, filter, wash and ignite the aluminum hydroxide as directed above.

Determination of Zirconium and Titanium

Dilute the hydrochloric acid solution to 250 cc., neutralize with ammonium hydroxide so as to leave approximately 5% (by volume) of hydrochloric acid, add 2 grams of tartaric acid, and treat with hydrogen sulphide until the iron has been reduced. Filter if the sulphide group is indicated. Make the hydrogen sulphide solution ammoniacal and continue the addition of the gas for 5 minutes. Filter carefully and wash with dilute ammonium sulphide-ammonium chloride solution. Filter through a new filter if the presence of iron sulphide in the filtrate is indicated. Save the filtrate.

1

270 IRON

(The sulphide precipitate consists of ferrous sulphide, in addition to the greater part of any nickel, and manganese present in steel. It is preferable to determine these in separate portions of the steel.)

Acidify the ammonium sulphide filtrate with sulphuric acid, add 30 cc. in excess and dilute with water to 300 cc. Digest on the steam bath until sulphur and sulphides have coagulated, filter, wash with 100 cc. of 10% sulphuric acid and cool the filtrate in ice water.

Add slowly and with stirring an excess of a cold 6% water solution of cupferron. (The presence of an excess is shown by the appearance of a white cloud which disappears, instead of a permanent coagulated precipitate.) Immediately filter on paper, using a cone and very gentle suction, and wash thoroughly with cold 10% hydrochloric acid.

Carefully ignite in a tared platinum crucible, completing the ignition over a blast lamp or large Meker, cool and weigh the combined zirconium and titanium oxides.

Fuse with potassium pyrosulphate, dissolve in 50 cc. of 10% (by volume) sulphuric acid and determine titanium colorimetrically or volumetrically. Calculate titanium oxide and subtract the weight found from that of the combined oxides and calculate zirconium.

Notes. 1. Phosphorus pentoxide contaminates the precipitate to so slight an

extent that it can be disregarded.

2. Vanadium interferes no matter what its valency. The interference is not quantitative. If present in the steel, proceed as usual through the weighing of the cupferron precipitate. Then fuse thoroughly with sodium carbonate, cool, extract with water, filter, and determine the vanadium in the filtrate by adding sulphuric acid, reducing through a Jones' reductor into a solution of ferric phosphate acid and then titrating with standard permanganate. Ignite in the original crucible the matter insoluble in water, fuse with potassium pyrosulphate and proceed as directed for titanium.

3. Tungsten does not interfere since it is separated from zirconium and titanium by the sodium hydroxide treatment, and from aluminum by the ammonium hydroxide precipitation. If tungsten is present in large amount it may be found desirable to fuse the non-volatile residue from the silicon determination with sodium carbonate, extract with water, fiter, dissolve the residue in hot 1:1 hydrochloric acid and add

to the acid extract from the ether separation.

4. Uranium is partially carried down when present in the tetravalent condition, but not at all in the hexavalent state. If this element is suspected, boil out all hydrogen sulphide before the cupferron precipitation, oxidize with permanganate to a faint pink,

cool and proceed with the cupferron precipitation.

5. Thorium and cerium interfere, but they are not thrown down quantitatively. In case these elements are suspected, the peroxidized solution used for the titanium determination must be quantitatively preserved and reduced with a little sulphurous acid. The solution is then treated with a few drops of a 0.2% alcoholic solution of methyl red, and made just alkaline with ammonium hydroxide. The precipitated zirconium hydroxide is then dissolved by warming with 5 cc. hydrochloric acid and the clear solution treated with 3 to 5 grams of oxalic acid. The solution is then diluted to 300 cc.. allowed to stand over night, the precipitate filtered, washed with hot water, ignited, weighed, and the weight of the rare earth oxides subtracted from the original weight of the combined oxides.

6. Instead of the prescribed treatment for the removal of the bulk of the iron, Johnson's metbod of fractional ammonium hydroxide precipitation may be used.

Other Methods for Determination of the Less Common Elements in Steel. See under the chapter dealing with the element in question. See Index.

¹C. M. Johnson, Chem. and Met. Eng., 20, 1919, p. 588.

WILFRED W. SCOTT

Pb, at.wt. 207.2; sp.gr. 11.34; m.p. 327°; b.p. 1525°C; oxides, PbO, PbO, PbO,

DETECTION

Hydrochloric acid precipitates lead incompletely from its cold solution as white PbCl₂, soluble in hot water by which means it is separated from mercurous chloride and silver chloride. PbCl₂ forms needle-like crystals upon cooling the extract.

Hydrogen sulphide precipitates black PbS from slightly acid solutions along with the other elements of the group. Yellow ammonium sulphide, sodium sulphide and the fixed alkalies dissolve out arsenic, antimony and tin. The sulphide of lead, together with bismuth, copper and cadmium, dissolve in hot dilute nitric acid, leaving mercuric sulphide insoluble. The extract evaporated to dryness and then to SO₂ fumes, after addition of sulphuric acid, expels nitric acid. Upon adding water to the residue and boiling with a little additional sulphuric acid the sulphates of bismuth, copper and cadmium are dissolved out, lead sulphate remaining as a white residue.

Lead may be further confirmed by dissolving the sulphate in ammonium acetate (barium sulphate is very slightly soluble,) and precipitating the yellow chromate, PbCrO₄, by addition of potassium dichromate solution.

ESTIMATION

The determination of lead is required in valuation of its ores—galena, PbS; anglesite PbSO₄; cerussite, PbCO₂; krokoite, PbCrO₄; pyromorphite, 3Pb₂P₂O₄·PbCl₂. It is determined in lead mattes; certain slags; drosses from hard lead; cupel bottoms; skimmings; lead insecticides (arsenate of lead); paint pigments such as white lead, red lead, yellow and red chromates, etc. It is determined in alloys such as solder, type metal, bell metal, etc. The estimation is necessary in the complete analysis of a large number of ores, especially in minerals of antimony and arsenic. Traces of lead are determined in certain food products where its presence is undesirable.

Preparation and Solution of the Sample

In dissolving lead, its alloys, or ores the following facts will be recalled. Hot, dilute nitric acid is the best solvent of the metal. Lead nitrate is insol-

¹Lead precipitates best from solutions containing 1 cc. of concentrated free hydrochloric acid (sp.gr. 1.19) for each 100 cc. of solution. The sulphide is appreciably soluble if the acidity is increased to 3 cc. HCl per 100 of solution.

uble in concentrated nitric acid, but dissolves readily upon dilution with water. The metal is insoluble in dilute sulphuric acid, but dissolves in the hot, concentrated acid. Although not soluble in dilute hydrochloric, it dissolves in the hot, concentrated acid, especially in presence of the halogens chlorine, bromine and iodine. The metal is soluble in glacial acetic acid. The salts are soluble in hot, dilute nitric acid. In dissolving sulphide ores it should be kept in mind that strong nitric acid will form some lead sulphate which will be precipitated upon dilution of the solution. Oxidation is less apt to occur with the dilute acid. Silicates and slags require fusion with sodium carbonate and potassium carbonate. The cooled mass may then be extracted with hot water to remove silica and the residue containing the carbonates of the heavy metals dissolved in dilute nitric acid. Lead salts are soluble in ammonium acecate.

Ores, Minerals of Lead, etc. One gram of ore if rich in lead (galena), or more if the lead content is low, is placed in a platinum dish and 40 to 50 cc. of a mixture of one part concentrated sulphuric acid (sp.gr. 1.84) and three parts of concentrated nitric acid (sp.gr. 1.42) added. The covered dish is heated gently until the violent action has ceased, the cover is then rinsed off and 10 to 15 cc. of hydrofluoric acid, HF, added. The mixture is evaporated to SO₃ fumes (hood), but not to dryness, and cooled. The concentrate is diluted with 100 cc. of distilled water and digested on the steam bath until the salts are in solution. The insoluble lead sulphate is filtered and washed with 10% sulphuric acid solution and finally with 50% alcohol.

It may be advisable, in certain cases, to open up the ore with nitric acid or aqua regia, followed by sulphuric acid and hydrofluoric acid.

Iron Pyrites and Ores with Large Amounts of Impurities with Small Amounts of Lead. Ten grams of the sample or more, if lead is present in very small amounts (less'than 0.1%), are taken for analysis, and 50 cc. of a mixture of potassium bromide and bromine solution added (75 grams of KBr dissolved in 400 cc. of water and 50 cc. of bromine added). After ten to fifteen minutes about 50 cc. of concentrated nitric acid are added and after the violent reaction has ceased 25 to 30 cc. of concentrated hydrochloric acid and the solution is evaporated on the hot plate to near dryness. Fifty cc. of C.P. (lead free) concentrated sulphuric acid is now added and the sample taken to furres of SO₃ on a sand bath. After cooling, the concentrate is diluted to 500 cc. with water, about 5 cc. of strong sulphuric acid added, the solution heated to boiling and cooled. The precipitate is filtered by decantation onto a fine-grained filter (quality of an S. & S. 590 or B. & A. grade A), the residue boiled with more water containing H2SO4 and again decanted. This is repeated until all the iron sulphate is removed. (The filtrates should be kept several hours to see whether any of the lead has passed through the paper in a colloidal condition.) precipitate is finally poured on the filter and washed with 2% H₂SO₄. Impute residues are extracted for lead with ammonium acetate.

Solution of Lead Alloys. As a rule these are best decomposed by treating 0.5 to 1.0 gram of the material, or more as the case may require, with a hot solution of nitric acid, 1:1, and evaporating the solution to low bulk, but not to dryness. Hot water is now added and the material boiled and the soluble portion filtered off. The insoluble material is digested with concentrated hydrochloric acid to which a little bromine has been added. Boiling the mixture will generally effect solution. (It must be remembered that lead chloride is ultly soluble in cold dilute solutions.) The lead is converted to PbSO₄

by addition of sulphuric acid and taking to SO₃ fumes as in case of ores. The purification of the impure sulphate will be given later.

Lead may be precipitated as the chloride in the presence of a large excess of

absolute alcohol and filtered free practically 'rom impurities.

Brass and bronze may be dissolved in hot dilute nitric acid, 1:1. Bearing metal is best treated with a mixture of hydrochloric acid 5 parts and nitric acid 1 part.

SEPARATIONS

Separation of Lead as Sulphate. Lead is most frequently separated from other metals by precipitation as sulphate, PbSO₄, according to the details given under "Preparation and Solution of the Sample." In the presence of much bismuth or iron it is necessary to wash the precipitate with a 10% sulphuric acid solution to ke p the bismuth in solution and to prevent the formation of the difficultly soluble basic ferric sulphate. In absence of appreciable amounts of these elements the lead sulphate is more completely separated by adding to the dilute sulphuric acid solution an equal volume of alcohol, filtering and washing the residue with 50% alcohol.

Separation of Lead from Barium. In the analysis of minerals containing barium, the insoluble sulphate, BaSO₄, will be precipitated with lead. Since barium sulphate is slightly soluble in ammonium acetate it will contaminate the lead in the subsequent extraction by this reagent. The presence, however, of a little sulphuric acid, renders this solubility practically neglig ble. The sulphuric acid should not exceed 1–2% in the ammonium acetate reagent, as lead sulphate will precipitate if sufficient sulphuric acid is added to the acetate extract. (Lead sulphate is precipitated almost completely if the acetate solution contains 10% sulphuric acid.)

Lead may be separated from barium sulphate by digesting the mixed sulphates with ammonium carbonate solution, whereby the lead sulphate is transposed to lead carbonate and ammonium sulphate, while barium sulphate is not changed. The soluble ammonium sulphate may be washed out with ammonium solution followed by water. Since lead carbonate is slightly soluble in the ammonium salt, the filtrate is treated with hydrogen sulphide and the dissolved lead recovered as PbS. The residue containing lead carbonate and barium sulphate is treated with dilute nitric or acetic acid. Lead passes into solution, while barium sulphate remains insoluble.

Extraction of Lead from the Impure Sulphate by Ammonium Acetate. The filter containing the impure sulphate, obtained by one of the procedures for solution of the sample, is placed in a casserole and extracted with about 50 cc. of hot, slightly ammoniacal ammonium acetate, the stronger the acetate the better. The clear liquid is decanted through a filter and the extraction repeated until the residue is free from lead (i.e., no test is obtained for lead with $K_2Cr_2O_7$). A very effective method of extraction is by adding solid ammonium acetate directly to the sample on a filter and pouring over it a hot solution of ammonium acetate. The filtrate containing the pure lead acetate solution may now be examined by one of the following procedures.

Lead sulphate containing arsenic should be dissolved in ammonium acetate, the extract made alkaline and lead precipitated as PbS. Arsenic remains in solution.

The isolation of minute quantities of lead from large amounts of other substances is described under "Gravimetric Methods for Traces of Lead."

GRAVIMETRIC METHODS

Determination of Lead as the Sulphate, PbSO₄

Procedure. The sample having been dissolved according to a method outlined, the lead precipitated as PbSO₄ by addition of an excess of sulphuric acid, and taking to SO₂ fumes, the lead sulphate is filtered off, upon cooling and diluting the sample. The PbSO₄ is washed with water containing 10% H₂SO₄ until free from soluble impurities. If insoluble sulphates or silica are present the lead must be purified. If such impurities are known to be absent (alloys), the sulphate may be filtered directly onto an asbestos mat in a tared Gooch crucible, dried, then ignited to dull red heat, cooled and finally weighed as PbSO₄. In the analysis of orea, however, it is generally advisable to purify the sulphate.

Purification of Lead Sulphate. Details of the procedure have been given under Separations—Extraction of Lead from the Impure Sulphate. The lead sulphate having been brought into solution by extraction with strong ammonium acetate solution, the excess acetic acid is volatilized by evaporation, the residue cooled and diluted with water. An excess of sulphuric acid is added and the precipitated sulphate is filtered off, washed with dilute sulphuric acid and alcohol, dried at about 110° C., or if preferred by ignition at dull red heat, and weighed

PbSO₄×0.6831 = Pb. Pb multiplied by 100 and divided by weight of sample taken equals per cent.

Notes. Lead sulphate may be precipitated from ammonium acetate solution by adding sulphuric acid until the solution contains approximately 10% H₂SO₄.

An acetate extraction may not be necessary, as is generally the case in the analysis of alloys. In analysis of ores, however, PbSO₄ may be contaminated by sulphates of the alkaline earths and by silica. The difficultly soluble oxides of iron and alumina may also be present.

If arsenic is in the sulphate it will pass into the filtrate with the lead.

Determination of Lead as the Chromate, PbCrO₄

This excellent method is applicable to a large class of materials and is of special value in precipitation of lead from an acetic acid solution, the method depending upon the insolubility of lead chromate in weak acetic acid.

Procedure. The solution of the sample, precipitation of the lead as the sulphate and extraction of lead with ammonium acetate have been given in detail.

The filtrate, containing all the lead in solution as the acetate, is acidified slightly with acetic acid and heated to boiling. Lead is precipitated by addition of potassium dichromate solution in excess (10 cc. of 5% $K_2Cr_2O_7$ solution are generally sufficient). The solution is builed until the yellow precipitate turns to a shade of orange or red. The precipitate is allowed to settle until the supernatant solution is clear. (This should appear yellow with the excess of dichromate reagent.) The PbCrO₄ is filtered onto an asbestos mat in a tared Gooch cru-

¹ The yellow precipitate gives high results, since it is difficult to wash. The crystalline orange or red compound may be quickly filtered and washed.

cible, washed with water, dried in an oven at about 110° C. and the cooled compound weighed as PbCrO₄.

PbCrO₄×0.641 = Pb.
$$\frac{\text{Pb.} \times 100}{\text{Wt. of sample}}$$
 = per cent Pb.

Notes. Impurities, such as iron, copper, cadmium, etc., in the acetate solution of lead seriously interfere in the chromate precipitation. These should be leached out with water containing a little sulphuric acid before extracting the lead sulphate with ammonium acetate. See remarks under section on Traces of Lead.

If a standard solution of potassium dichromate is used in the precipitation

of lead the excess of the reagent, upon filtering of the precipitate, may be titrated and the lead determined volumetrically. A known amount of dichromate solution (added from a burette) sufficient to precipitate all the lead and about one-third of the volume in excess is added to the hot solution. After boiling about two minutes the precipitate is filtered off quickly and washed several times with hot water. The filtrate, or an aliquot part of it, is made acid with 5 cc. concentrated sulphuric acid and titrated with standard ferrous sulphate at about 60° C., using potassium ferricyanide as an outside indicator; the end-point is a blue color produced by the slight excess of the ferrous salt reacting with the indicator. The excess of dichromate may excess of the ferrous sait reacting with the indicator. The excess of dichromate may be determined by adding 3 to 4 grams of solid potassium iodide, KI, to the solution diluted to about 500 cc. with water to which 15 cc. of concentrated sulphuric acid has been added. The liberated iodine is titrated with standard thiosulphate, the end-point being colorless, with starch solution internal indicator, changing from blue. Bi, Sb, Ba, Sr and Ca interfere slightly.

One cc. N/10 K₂Cr₂O₇ = 0.010355 gram Pb. One cc. N/5 K₂Cr₂O₇ = 0.02071 gram Pb.

Determination of Lead as the Molybdate, PbMoO₄

This method is rapid and has the following advantages:

a. The sulphation of lead is avoided. b. The acetate extraction is eliminated. c. The precipitate may be ignited. d. The ratio of lead to its molybdate co.npound is greater than either lead to PbSO₄ or to PbCrO₄, lessening the chance of error through weighing.

Cobalt, calcium, strontium and barium have little effect in presence of

ammonium acetate. In absence of this salt they interfere slightly.

Procedure. The ore or alloy is decomposed with nitric acid or aqua regia as the case may require. (Silica if present is eliminated by taking to dryness, dehydrating, taking up with dilute nitric acid and filtering.) To the clear liquid ammonium chloride is added and then sufficient ammonium oxalate to destroy the excess of free nitric acid.

Lead is now precipitated by adding 20 to 30 cc. of ammonium molybdate (4 grams per liter+acetic acid) stirring the mixture during the addition. After boiling for two or three minutes the precipitated lead molybdate is allowed to sittle, then filtered through pulp, washed with small portions of hot water and ignited over a Bunsen burner.

The cooled residue is weighed as PbMoO4.

$PbMoO_4 \times 0.5642 = Pb$.

Notes. If antimony or other members of the group are present in the original sample it is advisable to dissolve the residue in HCl and reprecipitate the lead with molybdate reagent.

If lead is in the form of the sulphide, as may be the case in a complete analysis of a substance, it is decomposed with hot dilute HNO; and precipitated as PbMoO.

Electrolytic Determination of Lead as the Peroxide, PbO₂

An electric current passed through a solution of lead containing sufficient free nitric acid will deposit all the lead on the anode as lead peroxide. The method is excellent for analysis of lead alloys.

Procedure. The sample containing not over 0.5 gram lead is brought into solution by heating with dilute nitric acid, 1:1. The solution is washed into a large platinum dish with unpolished inner surface. Twenty to 25 cc. concentrated nitric acid (sp.gr. 1.4) are added and the solution diluted to about 150 cc.

The sample is electrolyzed in the cold with 0.5 to 1 ampere current and 2 to 2.5 volts, the platinum dish forming the anode of the circuit, a spiral platinum wire or a platinum crucible dipped into the solution being the cathode. Three hours are generally sufficient for the deposition of 0.5 gram Pb. Overnight is advisable, a current of 0.05 ampere being used.

A rapid deposition of the lead may be obtained by heating the solution to 60 to 65° C. and electrolyzing with a current $ND_{100} = 1.5$ to 1.7 amperes, the E.M.F. varying within wide limits. Stirring the solution with a rotating cathode aids in the rapid deposition of the PbO₂.

To ascertain whether all the lead has been removed from the solution, more water is added so as to cover a fresh portion of the dish with water. The electrolysis is complete if no fresh deposition of the peroxide takes place after half an hour.

The water is siphoned off while more water is being added until the acid is removed, the current is then broken, the dish emptied of water and the deposits dried at 180° C. and weighed as PbO₂.

The deposit of lead peroxide gently ignited forms lead oxide, PbO, a procedure recommended by W. C. May, confirmed by Treadwell and Hall as giving more accurate results than the peroxide, PbO₂.

 $PbO_2 \times 0.8662 = Pb.$ $PbO \times 0.9283 = Pb.$

Note. The deposits of lead oxide or peroxide may be removed by dissolving off with warm dilute nitric acid.

For volumetric procedure-titration of the peroxide PbO2 see page 278.

VOLUMETRIC METHODS

Volumetric Ferrocyanide Method for the Determination of Lead

Although the gravimetric methods for the determination of lead are considered the more accurate, yet the volumetric procedures may be frequently used with advantage. The ferrocyanide method has been pronounced by Irving C. Bull to be the best of the procedures in common use, the results being accurate.

Procedure. Lead sulphate is obtained according to the method outlined under Preparation and Solution of the Sample. The lead sulphate is transferred to a small beaker and gently boiled with 10 to 15 cc. of a saturated solution of ammonium carbonate, the liquid having been added cold and brought up to

² C. N., 2253, 87, 1903.

¹ Am. Jour. Sci. and Arts (3) 6, 255.

boiling. After cooling, the precipitate is filtered onto the original filter paper from which the lead sulphate was removed. The lead carbonate is washed free of alkali with cold water. The filter with the precipitate is dropped into a flask containing a hot mixture of 5 cc. of glacial acetic acid with 25 cc. of water. The lead carbonate is decomposed by boiling and the solution diluted to 150 cc.

Titration. The sample warmed to 60° C. is titrated with a standard solution of potassium ferrocyanide, using a saturated solution of uranium acetate. as an outside indicator. The excess of ferrocyanide produces a brown color with the uranium acetate drop on the tile.

Free ammonia must be absent, as it reacts with uranium acetate and gives low results. NH4OH precipitates reddish brown, gelatinous uranous hydroxide, U(OH)4.

The bulk of solution to be titrated should be as near as possible to 100 cc.,

including 10 cc. of 50% acetic acid.

One per cent potassium ferrocyanide reagent is used in the titration. This reagent is standardized against a known amount of lead in solution as an acetate.

A correction of 0.8 cc. is generally necessary on account of the indicator.

This is determined by a blank titration.

Antimony, bismuth, barium, strontium and calcium interfere only to a very slight extent, the error being negligible.

The Permanganate Method for Lead

By Albert H. Low

The following method for the determination of lead in ores has proved very satisfactory in the great majority of cases. It depends upon the separation of the lead as sulphate, the conversion of the sulphate to carbonate, the solution of the carbonate in acetic acid, followed by the precipitation of the lead as oxalate. The lead oxalate is then decomposed in dilute sulphuric acid and the separated oxalic acid titrated with standard permanganate.

Ordinary constituents of lead ores do not interfere, with the exception of lime. As high as 10% of CaO in an ore, however, is without effect. Barium interferes only by forming a combination with lead that resists the reactions, with consequent low results. The remedy is easy and is described below.

Procedure. Decompose 0.5 gram of the ore in an 8-oz., pear-shaped flask, such as is commonly called a "copper-flask." The treatment may usually be a very gentle boiling with 10 cc. of hydrochloric acid for a short time, then adding 5 cc. of nitric acid and continuing the gentle boiling until decomposition is Now add 6 cc. of sulphuric acid and boil over a free flame to strong complete. fumes. Allow to cool.

Add 100 c.c of cold water and 5 cc. of sulphuric acid and heat to boiling. Remove from the heat, add 10 cc. of alcohol (cautiously) and cool under the tap.

Fold a 9-cm. filter with particular care to creasing the fold that will come next to the precipitate as thin as possible, so it will lie flat and not easily allow material to get under the edge. Filter the mixture through this. first portions of the filtrate if not clear. Wash 6 times with cold water containing 10% of alcohol. Any trace of lead sulphate remaining in the flask will be recovered subsequently.

With a jet of hot water, using as little as possible, rinse the precipitate from the filter, through a short funnel, back into the flask. (In the known or assumed presence of barium, interpolate the following short procedure: Add 10 cc. of hydrochloric acid and boil over a free flame almost to dryness. Allow to cool, add 20 cc. of water and a few drops of ammonia, sufficient to neutralize the acid.) Place the flask again under the original funnel and pour through

the filter 10 cc. of a cold saturated solution of ammonium carbonate. Remove the flask and heat the contents just to boiling, then cool completely under the tap. Pour the cold mixture through the original filter. Wash out the flask well with cold water, pouring through the filter, and then wash filter and precipitate 10 times with cold water containing about 5% of the ammonium carbonate solution. Reject the filtrate.

Again using a jet of hot water, wash the precipitate from the filter into a small beaker. Add 5-6 cc. of glacial acetic acid and heat to boiling. Replace the flask under the funnel and pour the hot acid mixture through the filter. Wash out the beaker with hot water and then wash the filter 10 times with hot water slightly acidulated with acetic acid. (Small amounts of lead carbonate may be dissolved directly upon the filter, without previous transference to a beaker.)

Add to the filtrate 10 cc. of a cold saturated solution of oxalic acid, heat to boiling and then cool completely under the tap. Be particular to get as cold as possible. Now filter the lead oxalate through a 9-cm. filter. Using cold water, wash out the flask thoroughly and then wash filter and precipitate 10 times.

Place about 25 cc. of cold water in the flask, add 5-6 cc. of sulphuric acid and then about 100 cc. of hot water. Drop the filter and precipitate into this. Wipe out any lead oxalate adhering in the funnel with a small piece of dry filter paper and drop into the flask. Heat the acid mixture nearly to boiling and then titrate it with standard potassium permanganate solution to a faint pink tinge. Calculate the result from the known lead value of the permanganate.

The permanganate commonly used for iron titrations will serve, although rather strong for lead. Theoretically, 1.857 times the iron factor will give the lead factor. Owing to slight losses of lead an empirical factor must be used. This is 1.879 times the iron factor. Based on this factor and on 0.5 gram of ore taken for assay, 1 cc. of a permanganate solution containing 1.544 grams per liter will equal 1% lead. It may be standardized directly on lead as follows: Convert about 0.250 gram of pure lead foil to sulphate by boiling with 6 cc. of sulphuric acid. Continue according to the above entire process. Finally, divide the percentage value of the lead taken by the cc. of permanganate required, to obtain the percentage value of 1 cc. in lead. A comparison of this figure with the iron value of the permanganate may be made, to check the conversion factor given above. The personal equation may cause a slight difference.

Volumetric Determination of Lead by the Molybdate Method¹

Lead is precipitated as molybdate from an acetic acid solution by a standard molybdic solution, the termination of the reaction being recognized by the yellow color produced by the excess of molybdic reagent when a drop of the mixture comes in contact with a drop of tannin solution used as an outside indicator.

The details of the procedure may be found in previous editions of this work. The method is still generally used although the results are not very trustworthy.

Reduction and Titration of Lead Peroxide Deposited Electrolytically

The electrolytic deposition of lead as the peroxide, PbO₂, has been given on page 276. To avoid error that may result from imperfect drying, a volumetric procedure is suggested. The peroxide is dissolved from the electrode with a hot mixture of 25 cc. N/5 oxalic acid and 10 cc. nitric acid (sp.gr. 1.2). The excess of oxalic acid is titrated hot with N/10 potassium permanganate.

1 cc. N/5 oxalic acid is equivalent to 0.02071 gram lead.

¹ Method of D. H. H. Alexander.

DETERMINATION OF SMALL AMOUNTS OF LEAD

The determination of minute quantities of lead is required in baking powders canned goods and like products in which small amounts of lead are objectionable. Traces of lead ranging from 5 to 100 parts per million (0.0005 to 0.01% Pb) are best determined colorimetrically on 0.5 to 1 gram samples; larger amounts of lead should be determined gravimetrically.

Gravimetric Methods for Determining Traces of Lead

The determination of extremely small amounts of lead cannot be accomplished by the usual methods of precipitation, as the lead compounds remain in solution in a colloidal state. The addition, however, of certain substances, which form amorphous precipitates with the reagents used for throwing out lead causes the removal of lead from the solution by occlusion. For example, the addition of a sufficient quantity of a soluble salt of mercury, copper, or arsenic to a solution containing a trace of lead, and then saturating the solution with H₂S, will cause the complete removal of lead from the solution. Iron and alumina thrown out of the solution as hydroxides will carry down small amounts of lead, and completely remove it from the solution, if they are present in sufficient quantity. Lead may be extracted from finely pulverized substances by means of hot ammonium acetate and precipitated from the extract as lead sulphide. Advantage may be taken of these facts in determining traces of lead in presence of large amounts of other substances.

Amount of the Sample. It is advisable to have the final isolated lead compound over 0.01 gram in weight, hence, in a sample containing 10 parts of lead per million, 800 to 1000 grams of the material should be taken, since a kilogram of the material would contain 0.01 gram, Pb or 0.0156 gram PbCrO₄, or 0.01464 gram PbSO₄, or 0.0177+ gram PbMoO₄. Large samples should be divided into several portions of 100 to 250 grams each, the lead isolated in each, and the final extracts, containing the lead, combined. For the given amount of occluding agent, stated in the procedure, the treated portion should contain not over 0.01 gram lead.

I.—Extraction of Lead with Ammonium Acetate and Subsequent Precipitation

It is frequently desirable to extract the lead from the mass of material and precipitate it from the liquor thus obtained. The procedure worked out by the writer is applicable to determining traces of lead in aluminum salts, but with modifications may be applied to a wide range of substances.

Extraction of Lead. The desired weight of finely powdered substance, in 100-gram portions, is placed in 6-inch porcelain casseroles (1000 cc. capacity). To each portion are added, with vigorous stirring, 500 cc. of lead-free, boiling hot ammonium acetate solution (33%). The reaction is apt to be energetic, so that

¹ The reagent must be boiling, when added, to obtain best results. Experiments have shown that considerable alumina and iron dissolve if the proportion of the reagent falls much below 5 cc. of 33% acetate per gram of sample. With twice this amount of reagent the extract is free from iron and alumina. Small amounts of alumina and iron, however, do not interfere in the lead determination.

care must be exercised to avoid boiling over. The residue from aluminum salts is crystalline and may be separated from the extract very readily by filtering through two filter papers in a large Büchner funnel and applying suction. The residue is tamped down to squeeze out the adhering extract and washed with 100 cc. more of hot ammonium acetate followed by 100 to 200 cc. of hot water, again tamped down and sucked as dry as possible. The lead extracts are now combined and lead precipitated as sulphide.

The reagent is made by dissolving one part of lead-free ammonium acetate in two parts of distilled water. The purity of the reagent should be tested.

Precipitation of Small Amounts of Lead. To the solution containing lead is added 2-3 cc. of a 10% copper sulphate or cadmium sulphate reagent. Hydrogen sulphide is passed into the liquor until it is saturated. The copper or cadmium sulphide assists the settling of lead sulphide. Gently warming on the steam bath for half an hour coagulates the precipitate and facilitates settling. The liquor is decanted through a double filter in a small Büchner funnel and the residue washed onto the filter with water saturated with H₂S gas.

The precipitate is washed several times with ammonium sulphide to remove sulphides of the arsenic group and the residue then dissolved in a hot mixture of hydrochloric and nitric acids (1 part HCl. 5 parts HNO₃ and 15 parts H₂O). Ten cc. of strong sulphuric acid are added to the solution, and the mixture is evaporated to SO₃ fumes but not to dryness. The residue is taken up with 100-125 cc. of water containing 2 cc. of sulphuric acid and boiled to dissolve the soluble salts of iron, alumina, copper, etc. After cooling, one-third the volume of 95% alcohol is added (30-40 cc.), the lead sulphate allowed to settle for an hour or more, then filtered and washed several times with 30% alcohol. The residue is extracted with hot ammonium acetate and lead chromate precipitated from the filtrate, and slightly acid with acetic acid, by adding 10 cc. of potassium dichromate reagent and boiling, according to the standard procedure. (Page 274.)

 $PbCrO_4 \times 0.641 = Pb.$

II.—Precipitation of Lead by Occlusion with Iron Hydroxide

Wilkie found that ferric hydroxide has the property of occluding lead, five parts of Fe(OH), removing one part of lead from solution. Advantage is taken of this property of iron hydroxide in precipitating small amounts of lead.

Procedure. The required amount of material is weighed out in 50-gram lots and brushed into No. 8 beakers. If the material contains organic matter, it is treated with 200-cc. portions of concentrated hydrochloric acid, the mixture heated just below the boiling-point of HCl solution, and potassium chlorate added, a few crystals at a time, until the organic matter is decomposed (hood). If the material dissolves in water, the water solution is treated with 5 cc. of concentrated hydrochloric acid and a few crystals of potassium chlorate and the liquor boiled.

¹ 200 to 300 grams of material may be handled in a 6-inch Büchner funnel.

² Should lead chromate fail to precipitate, the solution should be treated with H₂S to complete saturation, the sulphide collected on a filter, then dissolved in acid and the procedure described above repeated. If the solution still remains clear, the absence of lead is confirmed.

³ J. M. Wilkie C. N., 2597, 117, 1909.
⁴ Occlusion of lead by zinc sulphide, precipitated by H₂S from a formic acid solution, is suggested; iron and alumina would not interfere.

Addition of Ferric Iron. If sufficient iron is not already present, ferric chloride is added in such quantity that the iron content of the sample will be from twenty to fifty times that of the lead (larger amounts of iron will do no harm) present in the solution. Five to 10 cc. of concentrated nitric acid are added and the sample boiled for ten to fifteen minutes.

Precipitation of Iron and Lead. If alumina is present, iron is precipitated by addition of a large excess of potassium hydroxide, the alumina going into solution as potassium aluminate. In absence of alumina, ammonia may be used to precipitate the ferric hydroxide. Lead is completely occluded by the precipitate and carried down. The solution is filtered hot through Baker and Adamson's fast filters, threefold. The filtering must be rapid and the liquid kept hot to prevent clogging of the filters.

Separation of Lead from Iron. The precipitate is dissolved in hot hydrochloric acid (free from lead). The solutions are combined, if several portions of the sample are taken. Concentrated sulphuric acid is added and the sample evaporated to small volume and heated until the white sulphuric acid fumes appear. The usual procedure is now followed for separation of the lead sulphate. acetate extraction of lead and final precipitation of lead chromate.

$$PbCrO_4 \times 0.641 = Pb.$$

NOTE. In place of using alcohol to decrease the solubility of lead sulphate, many prefer to add sulphuric acid so that the acidity of the solution will be 2-10% free H₂SO₄.

III. Modification of Seeker-Clayton Method for Traces of Lead in Baking Powder

One hundred grams of baking powder are treated with 25 cc. of water followed by 75 cc. of strong hydrochloric acid added in small portions to avoid excess frothing. The mixture is heated until the starch has decomposed (iodine test gives blue color with starch), the solution becoming clear and turning yellow. The free acid is neutralized and when the solution is cold, 400 cc. of lead-free ammonium citrate, saturated with H₂S, are added. Additional H₂S is passed into the slightly alkaline solution, the sulphides of iron and lead allowed to settle, the clear supernatant liquor decanted off, the sulphides collected on a filter and washed. The precipitate is dissolved in nitric acid, lead separated as a sulphate, extracted with acetate and precipitated as dichromate according to the procedure recommended under the acetate extraction method I.1

COLORIMETRIC ESTIMATION OF SMALL AMOUNTS OF LEAD

Introduction. Estimation of small amounts of lead by the intensity of the brown coloration produced by the sulphide in colloidal solution was first proposed The procedure was modified by Warington and by Wilkie by Pelouze.²

¹ See Referee's modification Jour. Assoc. Off. Ag. Chemists, 1, 3, 512 (Nov., 1915.)

T. J. Pelouze, Ann. Chim. Phys., 3, 79-108, 1841.
 R. Warington, Jour. Soc. Chem. Ind., 12, 97, 1893.
 J. M. Wilkie, Jour. Soc. Chem. Ind., 28, 636, 1909.

to overcome the color produced by accompanying impurities, among these, of iron, which is almost invariably associated with lead. The method is useful in determining traces of lead in drinking water, in food products, baking powders, canned goods, phosphates, alums, acids such as sulphuric, hydrochloric, citric, tartaric and the like. By this procedure on a gram sample one part of lead per million may be detected and as high as 50 parts may be estimated. For larger amounts of lead, a smaller sample must be taken. Nickel, arsenic, antimony, silver, zinc, tin, iron, and alumina, present in amounts such as commonly occur in these materials, do not interfere.1

In order to obtain accurate results it is necessary to have the solutions under comparison possess the same general character. "It must be remembered that the tint depends to a large extent on the size of the colloidal particles of lead. which in turn depend upon the nature of the salts in the solution and upon the way that the solution has been prepared." 2 Vigorous agitation, salts of the alkalies and alkaline earths tend to coagulate the colloidal sulphide.

Reagents Required. Standard Lead Solution. A convenient solution may be made by dissolving 0.1831 gram of lead acetate, Pb(C₂H₂O₂)₂·3H₂O in 100 cc. of water, clearing any cloudiness with a few drops of acetic acid and diluting to 1000 cc. If 10 cc. of this solution is diluted to 1000 cc. each cc. will contain an equivalent of 0.000001 gram Pb.

Harcourt suggests a permanent standard made by mixing ferric, copper and cobalt salts. For example 12 grams of FeCl, together with 8 grams of CuCl. and 4 grams of Co(NO₃)₂ are dissolved in water, 400 cc. of hydrochloric acid added and the solution diluted to 4000 cc. 150 cc. of this solution together with 115 cc. of hydrochloric acid (1:2) diluted to 2000 cc. will give a shade comparable to that produced by the standard lead solution above, when treated with the sulphide reagent. The exact value per cc. may be obtained by comparison with the lead standard.

Alkaline Tartrate Solution. Twenty-five grams of C.P. sodium potassium tartrate, NaKC₄H₄O₆·4H₂O, is dissolved in 50 cc. of water. A little ammonia is added and then sodium sulphide solution. After settling some time the reagent is filtered. The filtrate is acidified with hydrochloric acid, boiled free of H.S and again made ammoniacal and diluted to 100 cc.

Ammonium Citrate Solution. Ammonium citrate solution is prepared in the same way as the tartrate solution above, 25 grams of the salt being dissolved in 50 cc. of water.

Potassium Cyanide. Ten per cent solution. The salt should be lead-free. Sodium Sulphide. Ten per cent solution, made from colorless crystals. Sodium sulphide may be made by saturating a strong solution of sodium hydroxide with hydrogen sulphide gas, and then adding an equal volume of the sodium hydroxide. The solution is diluted to required volume, allowed to stand several days, and filtered.

Sodium metabisulphite. Solid salt of Na₂S₂O₅. 4

Apparatus. The color comparison may be made in Nessler tubes, or in a colorimeter. The Campbell and Hurley modification of the Kennicott-Sargent

¹ Ni up to 0.1%, As up to 0.2%, Zn 0.2%, Sb 0.05%, Cu 0.25%, Fe 1.0%, Al 10%, Sn up to 1.4% do not interfere.

J. W. Mellor, "A Treatise on Quantitative Inorganic Analysis."

A. G. V. Harcourt, Jour. Chem. Soc.. 97, 841, 1909.

Recommended by W. S. Allen for reduction of iron.

colorimeter is excellent for this purpose, Fig. 43. The colorimeter is simple in construction and operation.

The tubes for holding the solutions to be compared are those of one of the well-known colorimeters, in which the unknown solution is placed in the left-hand

tube while the color is matched by raising or lowering the level of a standard solution in the right-hand tube by means of a glass plunger working in an attached reservoir.

The accompanying diagram shows the essential features of construction of the colorimeter employed in the tests described below. The unknown solution is placed in the left-hand tube A, which is 19 cm. long, 3 cm. in diameter, and graduated for 15 cm. The standard solution is placed in the right-hand tube B, which is the same size as A, the graduated portion being divided into 100 divisions of 1.5 mm. The tube B is permanently connected by a glass tube with the reservoir C in which the glass plunger D works, so that the level of the liquid in B can be readily controlled by raising or lowering the plunger. As the tube B and reservoir C are made in one piece, the liquid used for the standard solution comes in contact with glass only, thus preventing any possibility of

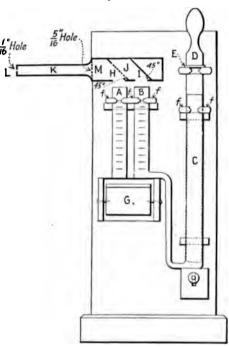


Fig. 43.—Hurley's Colorimeter.

chemical change due to contact with the container. The plunger is provided with a rubber collar E, so placed as to prevent the plunger from accidentally striking and breaking the bottom of the reservoir. The tubes A and B, with the connecting reservoir, rest on wooden supports, the one under A and B being provided with holes for the passage of the light, and are held in position by spring clips FF. This arrangement allows the glass parts to be readily removed for cleaning and filling. The light for illuminating the solution is reflected upward through the tubes A and B by means of the adjustable mirror G. The best results are obtained by facing the colorimeter toward a north window in order to get reflected skylight through the tubes, care being taken to avoid light reflected from adjacent objects. The black wooden back of the colorimeter serves the double purpose of a support for the parts of the instrument and of a screen, as it is interposed between the color tubes and the source of light.

The light, passing upward through the tubes A and B, impinges on the two mirrors H and I cemented to brass plates sliding in grooves cut at an angle of 45° in the sides of the wooden box J. This box is supplied with a loosely-fitting cover, thus allowing easy access for the purpose of removing and cleaning the Jour. Am. Chem. Soc., 33, 1112, July, 1911.

mirrors. The mirror H is cut vertically and cemented in such a position as to reflect one-half of the circular field of light coming through the tube A. The light passing upward through B is reflected horizontally by the mirror I, through a hole in the brass plate supporting the mirror H. One-half of the circular field of light from the tube B is cut off by the mirror H, the vertical edge of which acts as a dividing line between the two halves of the circular field. The image of one-half of the tube B is then observed in juxtaposition to the opposite half of the image of the tube A.

The juxtaposed images are observed through a tube K, 2.5 cm. in diameter and 16 cm. long, lined with black felt and provided with an eye-piece having a hole 1.5 mm. in diameter. At the point M in the tube K is placed a diaphragm having an aperture 8 mm. in diameter. All parts inside the box J except the mirrors are painted black so that no light except that coming through the tubes A and B passes through the tube K. By having the apertures in the eye-piece and diaphragm properly proportioned only the image of the bottoms of the tubes A and B can be seen, thus preventing interference of light reflected from the vertical sides of the tubes A and B.

A person looking through the eye-piece observes a single circular field divided vertically by an almost imperceptible line when the two solutions are of the same intensity. By manipulating the plunger D, the level of the liquid in B can be easily raised or lowered, thus causing the right half of the image to assume a darker or lighter shade at will. In matching colors with an ascending column in B, that is, gradually deepening the color of the right half of the field, the usual tendency is to stop a little below the true reading while in a comparison with a descending column the opposite is the case.

Procedure. If lead is between 10 to 50 parts per million a 1-gram sample is taken. If it is above or below these extremes the amount of sample is regulated accordingly. In materials containing organic matter it is not advisable to take more than a 1-gram sample.

Substances containing organic matter, such as starch in baking powder, should be decomposed by fusion with sodium peroxide, sodium or potassium sulphate containing a few drops of sulphuric acid. A Kjeldahl digestion with concentrated sulphuric acid and potassium bisulphate may occasionally be advisable. Sulphuric acid discolored by organic matter should be mixed with 4 to 5 grams of potassium bisulphate, taken to fumes and then diluted with water. The material may be extracted with ammonium acetate and lead determined in the extract. See notes.

To the solution containing the sample are added 10 cc. of tartrate solution (or 20 cc. of citrate solution with phosphates of lime, etc.), 10 cc. of hydrochloric acid and the mixture brought to boiling. Small amounts of ferric iron are now reduced by adding 0.5 gram sodium metabisulphite. Sufficient ammonium hydroxide is added to neutralize the free acid and 5 cc. in excess; then 3 cc. potassium cyanide (to repress any copper color that may be present to reduce higher oxides), and the mixture heated until the solution becomes colorless. The entire solution or an aliquot portion is placed in the comparison cylinder, and diluted to nearly 100 cc. If the Kennicott-Sargent apparatus is used the standard color solution is forced into the adjacent cylinder, until the color in this cylinder matches the one containing the sample. The number of cc. of the standard is noted. This blank is due to the slight color that the solutions of the samples invariably have. Four drops of the sulphide reagent are added to the sample and this is mixed

by means of a plunger, avoiding any more agitation than is absolutely necessary to make the solution homogeneous. After one minute the comparison is again made, the colored standard being forced into the cylinder until its color matches the sample. It is advisable to take several readings with ascending and descending column of standard reagent, taking the average as the true reading.

Calculation. Suppose the standard = 0.000001 gram Pb per cc., blank = 5 cc., total reading = 22 cc., one gram of sample being taken for analysis. Then

22-5=17 cc. =0.0017% Pb or 17 parts per million.

Notes. Iron must be completely reduced before adding ammonium hydroxide

and potassium cvanide.

Allen's method of reducing iron with so lium metabisulphite is excellent. The salt may be made by passing SO₂ into a saturated solution of sodium carbonate at boiling temperature, until the liquor is just acid to methyl orange. The water evaporated during the treatment is replaced during the action. Na₂S₂O₈ separates and may be filtered off and the water removed by centrifuging.

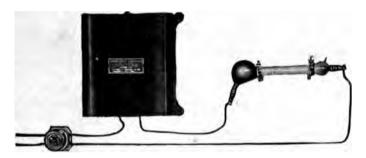


Fig. 44.—Cooper Hewitt Mercury Light.

The Cooper Hewitt Mercury light is excellent for colorimetric lead determinations, where an artificial light is desired. The yellow shades appear yellowishgreen and may be matched more readily than the yellows obtained by daylight.

The illustration, Fig. 44, shows the type of light recommended for this work.

If a separation from iron is desired, the lead may be extracted with ammonium acetate solution. Ten grams of the powdered material are mixed with 75 cc. of a 33% ammonium acetate solution 1 (25 grams of the salt dissolved in 50 cc. H₂O), the reagent being added boiling hot. The mixture is diluted to 500 cc., a portion filtered, and the determination made on an aliquot part of the total, following the directions above.

¹ The ammonium acetate should be free from lead.

ANALYSIS OF METALLIC LEAD

Determination of Impurities in Pig Lead—Complete Analysis 1

The following substances are generally estimated in the complete analysis of lead; silver, bismuth, copper, cadmium, arsenic, antimony, tin, iron, cobalt, nickel, manganese and zinc.

Determination of Silver

This is determined by assay of 100 grams of lead. The substance is placed in a 3-in. scorifier and heated in a muffle furnace until the assay "covers." It is then poured into a mould, allowed to cool and the button thus obtained again scorified until a final button weighing about 20 grams is obtained. This is cupeled and silver determined as usual. If the silver bead is large it should be parted for gold.

Determination of Bismuth

In determining bismuth three cases arise: A. The ordinary method. B. Procedure for determining minute amounts of bismuth. C. Method in presence of comparatively large amounts of antimony and tin.

A. Twenty grams of lead are dissolved in 100 cc. of hot dilute nitric acid (1:4). If the solution is complete, dilute ammonium hydroxide is added, drop by drop, until a faint opalescence is observed in the solution. If a precipitate is formed, this must be dissolved by addition of nitric acid and the ammonia treatment repeated. Now 5 cc. of dilute hydrochloric acid are added (1:9) and the solution diluted to 400 cc. and heated to boiling. The bismuth oxychloride is allowed to settle on the steam bath for several hours, the clear solution is then decanted through a 7 cm. filter (S. & S. No. 589), the precipitate transferred to the paper and washed with hot water. (The solution is refiltered if cloudy.) The precipitate is dissolved with 5 cc. hot hydrochloric acid (1:9), the acid being added around the edge of the filter with a pipette. The paper is washed and the solution diluted to 400 cc. and brought to boiling. The precipitate is filtered into a weighed Gooch crucible, washed several times with water, then once with alcohol and finally with ether. It is dried in the oven and weighed as BiOCl.

$BiOCl \times .802 = Bi$.

- B. Determination of minute amounts of bismuth is made as follows: 100 grams of lead are dissolved in 500 cc. of dilute nitric acid (1:4), and the cooled solution treated with sufficient saturated solution of sodium carbonate to produce a heavy precipitate. After settling, then decanting off the clear solution, the precipitate is filtered onto a filter and drained. Without washing this is dissolved with the least amount of nitric acid that is required. The solution is then neutralized with ammonia as before (method A), litmus paper being used as an indicator, and bismuth determined as directed under the first procedure.
- C. In presence of considerable amounts of antimony and tin, the bismuth is precipitated as in case A, the precipitate dissolved in hot hydrochloric acid (1:2), and the solution diluted to 200 cc. The sulphides of antimony, tin, etc.,

¹ Method of the National Lead Company, modified.

are precipitated with H₂S, antimony and tin dissolved out with a solution of potassium hydroxide and sulphide water (1 part 20% KOH to 4 parts H₂S water), and the residue washed. This is dissolved in 20 cc. of hot nitric acid (1:4), and bismuth determined as usual in the filtrate.

Determination of the Remaining Elements

222.23 grams of the sample of lead are dissolved in 1100 cc. of dilute nitric acid (1:4) in a large beaker. If the solution is turbid, appreciable amounts of antimony and tin are indicated with possible sulphur combined as PbSO₄. In this case it is filtered into a 2000-cc. flask. If the solution is clear it is transferred directly to the flask.

Residue I. May contain As, Sb, Sn,
PbSO₄.

Filtrate I. Contains all the elements present in the sample.

Residue I. The residue and filter is treated with 20 cc. of tartaric acid mixture (50 grams tartaric acid, 250 cc. of water and 250 cc. of concentrated hydrochloric acid). After boiling the mixture is digested on the steam bath for half an hour, then 50 cc. of hot water added and the solution filtered. The filter paper is ignited and any residue is dissolved by fusion with 1 gram of potassium hydroxide in a silver dish. The water extract of this fusion is added to the tartrate solution. Now ammonia is added until the solution is alkaline and then hydrochloric acid until it is slightly acid. Hydrogen sulphide is now passed in to saturation, the precipitate digested on the steam bath for fifteen to twenty minutes and hydrogen sulphide again passed into the solution about fifteen minutes. The sulphides are filtered off, arsenic, antimony and tin sulphides dissolved with 5 cc. (1:5) potassium hydroxide in 25 cc. of saturated H₂S water. The solution is diluted to 111 cc., and 100 cc.—equivalent to 200 grams of sample—preserved for subsequent analysis. This solution is marked "Extract C."

Filtrate I. This solution, containing practically all of the material, is treated with 150 cc. of dilute sulphuric acid (1:1), and the solution made to volume—2000 cc. It is now transferred to a 3-liter flask, the graduated flask rinsed out into the main solution with 50 cc. of water. (The PbSO₄ precipitate found to occupy space of 50 cc.) When the precipitate has settled, 1800 cc. are decanted off. This represents 200 grams of the sample. The solution is boiled down in a No. 9 porcelain evaporating dish, heating first over the free flame and finally on the steam bath until only a moist residue remains. Fifty cc. of water is added, the residue transferred to a beaker and digested for several hours, preferably overnight, and then filtered.

Residue II. This may contain PbSO₄,
As, Sb, Sn salts.

Filtrate II. This may contain Cu,
Bi, Cd, Sn, Sb, As, Fe, Co, Ni
and Zn.

Residue II. This is treated as has been described for residue I. The entire solution is added to the Extract C. The residue, consisting of PbSO₄, is rejected.

Filtrate II. This is made neutral with ammonium hydroxide and then concentrated hydrochloric acid added in such an amount that the solution will contain 4% free acid. (HCl sp.gr. 1.2, 4 cc. per 100 of solution.) Hydrogen sulphide is now passed into the hot solution until it is saturated, the precipitate

settled on the steam bath for half an hour and hydrogen sulphide again passed in for fifteen minutes. The precipitate is filtered off and washed with H₂S water slightly acidified with hydrochloric acid.

Residue III. May contain CuS, Bi₂S₂, CdS, As₂S₂, Sb₂S₂, SnS.

Filtrate III. May contain ions of Fe, Al, Co, Ni, Mn and Zn. This filtrate is marked "B."

Residue III. The sulphides are extracted with potassium hydroxide and hydrogen sulphide solution. This dissolves out arsenic, antimony and tin. This extract is combined with the extract marked "C."

The residue remaining is marked "Residue A."

The constituents of the sample have now been isolated in the groups.

Residue "A" contains the sulphides of copper, bismuth and cadmium.

Filtrate "B" contains such elements as do not precipitate as sulphides in acid solution—iron, aluminum, manganese, cobalt, nickel and zinc.

Extract "C" includes the elements arsenic, antimony and tin.

Determination of Arsenic, Antimony, and Tin in Pig Lead

The combined alkali sulphide solutions: "Extract C" is washed into a beaker and acidified with 20 cc. of nitric acid and 5 cc. of hydrochloric acid. The solution is evaporated to dryness on the steam bath. The residue is dissolved in 200 cc. of water and 10 grams of oxalic acid added, together with 10 grams of ammonium oxalate, and the solution heated until clear.

Hydrogen sulphide gas is now passed into the hot solution for forty-five minutes.

Precipitate. As₂S₁, Sb₂S₂.

Filtrate contains Sn.

Arsenic. The precipitate containing arsenic and antimony is placed in a distilling flask, strong hydrochloric acid added and arsenic separated from antimony by distillation with a current of HCl gas according to the regular procedure. If a precipitate of arsenic sulphide forms in the distillate, it is advisable to precipitate the arsenic as sulphide, oxidize the compound to form sulphate and arsenic acid, and after reduction of the arsenic to titrate it with standard iodine. This oxidation may be accomplished, before distillation with hydrochloric acid. For details of the procedure see chapter on Arsenic, page 37.

Antimony is determined in the residue in the flask by titration with N/10 potassium bromate or by the potassium iodide method.

- I. $2KBrO_3 + 2HCl + 3Sb_2O_3 = 2KCl + 2HBr + 3Sb_2O_5$.
- II. (a) $Sb_2Cl_5+2KI=Sb_2Cl_2+2KCl+I_2$.
 - (b) $I_2+2Na_2S_2O_3=2NaI+Na_2S_4O_6$.

For details of the procedure see chapter on Antimony, pages 25 and 26.

Determination of Copper and Cadmium in Pig Lead

The residue "A" is taken for this analysis. If copper exceeds 0.0025% method I is used. If the copper percentage is below this amount the procedure II is followed.

Method I. The residue is dissolved by heating with 20 cc. of nitric acid (1:4) and the solution filtered into a beaker. The filter is ignited and the residue dissolved in nitric acid (1:1) and the solution added to the first portion. The volume should not exceed 100 cc. Ammonium hydroxide is added until the solution is strongly ammoniacal and then 5 grams of potassium cyanide. Hydrogen sulphide is passed into the cold solution to saturation, and the solution filtered.

Precipitate = AgS, Bi₂S₂, CdS.

Filtrate = Cu in solution.

The filtrate containing the copper is evaporated on the steam bath to a volume of 20 to 30 cc. in a 4-in. casserole. Now 20 cc. of sulphuric acid (1:1) are added (hood), and the solution evaporated until SO₁ fumes are evolved. The cooled concentrate is diluted with water and filtered, if necessary. Three cc. of nitric acid are added per 100 cc. of solution and the copper deposited by electrolysis according to the regular procedure and weighed as metallic copper. For detailed method see chapter on Copper, page 185.

The precipitate containing silver, bismuth and cadmium is dissolved in 20 cc. of nitric acid (1:4), 1 cc. of 1% sodium chloride solution is added, the solution digested half an hour and then filtered and the filter washed with water.

Precipitate - AgCl, reject.

Filtrate - Cd(NO₃)₂ and Bi(NO₃)₃.

The filtrate is made slightly alkaline with sodium carbonate added in slight excess, and 5 grams of potassium cyanide are then added. After digesting on the steam bath for half an hour the solution is filtered and the residue washed with 5% sodium carbonate solution.

Precipitate contains bismuth, reject. Filt

Filtrate contains cadmium.

The filtrate is now treated with a few cc. of ammonium sulphide and the yellow cadmium sulphide is filtered into a weighed Gooch crucible, then washed, dried and finally weighed as CdS.

 $CdS \times 0.778 = Cd$.

•Method II. Small amounts of copper. The filter containing the sulphides is ignited in a porcelain crucible and the residue dissolved in 5 to 10 cc. of nitric acid (1:1), and the solution evaporated to pastiness. One cc. of sulphuric acid (1:1) is added together with a few drops of 10% sodium chloride solution and the mixture evaporated to SO₁ fumes, the cooled product then diluted with water and filtered from the lead and silver precipitates.

Ammonia is now added to the filtrate together with 5 grams of potassium cyanide and CdS and Bi₂S₂ are precipitated with H₂S, as in case I, and filtered off.

Precipitate—CdS and Bi₂S₂. Bismuth is removed as before and cadmium sulphide again precipitated and the compound titrated with N/10 iodine solution.

1 cc. N/10 I = 0.00562 gram Cd.

Filtrate. The solution is made acid in the hood with H₂SO₄, then taken to SO₃ fumes and copper determined by the potassium iodide method.

Determination of Iron, Cobalt, Nickel, Manganese and Zinc in Pig Lead

Iron and Alumina. The filtrate "B" from members of the Hydrogen Sulphide Group is evaporated to 100 and the iron oxidized with a few drops of nitric acid as usual. Iron (and alumina) hydroxide is now precipitated by addition of ammonia. It is advisable to dissolve this precipitate in hydrochloric acid and reprecipitate the iron to recover the occluded manganese and zinc. The combined filtrates are reserved for the determination of the remainder of the elements. The hydroxide of iron is ignited and weighed as Fe₂O₃. If alumina is suspected, the residue is dissolved in hydrochloric acid and iron determined volumetrically. Fe₂O₃ thus obtained is subtracted from the weight of the first determination, the difference being due to the alumina present.

 $Fe_2O_3 \times 0.6994 = Fe$ Reciprocal factor = 1.4298 Al₂O₃×0.5303 = Al Reciprocal factor = 1.8856

Zinc. The filtrate from iron precipitate is made neutral with hydrochloric acid and then 15 drops of 2N. HCl added in excess and zinc precipitated in the pressure flask with H₂S. (See Figs. 3 and 4 in chapter on Arsenic.) The sulphide of zinc is filtered off, and either ignited to the oxide ZnO and so weighed or determined by a volumetric procedure. See chapter on Zinc.

 $ZnO \times 0.8034 = Zn$.

 $H_2SO_4 \times 0.6665 = Zn.$

Cobalt and Nickel. These are best determined by electrolysis, being deposited from an ammonium sulphate solution.

If a separation of the elements is desired the deposit is dissolved in acid, nickel determined by O. Brunck's dimethylglyoxime method, and cobalt determined by difference.

Manganese. The solution from nickel and cobalt is taken to dryness, and the residue heated to expel the ammonium salts and destroy any organic matter present. This is taken up with a little hydrochloric acid, then 2 to 3 cc. of sulphuric acid added and the mixture evaporated to SO, fumes to expel the hydrochloric acid. When nearly all the free acid is driven off, the moist residue, cooled, is treated with 50 cc. of nitric acid (1:3), and manganese determined in the solution preferably by the bismuthate method. For minute amounts of manganese the colorimetric procedure is used. See chapter on Manganese, page 305.

Determination of Lead Peroxide in Minium (Red Lead)

Lead per oxide is reduced by oxalic acid according to the reaction: $PbO_2 + H_2C_2O_4 = PbO + 2CO_2 + H_2O.$

The peroxide reduced by an excess of oxalic acid is determined by titrating this excess with standard potassium permanganate.

Procedure. About 0.2 g. minium is heated with 25 cc. of 2N HNO₃ (one volume of HNO₃, sp.gr. 1.2, to two volumes H_2O) and then 50 cc. N/5 oxalic acid added. The solution is heated to boiling and the excess oxalic acid titrated with N/5 potassium permanganate. 1 cc. N/5 KMnO₄ = .0239 g. PbO₂.

MAGNESIUM

WILFRED W. SCOTT

Mg, at.wt. 24.32; sp.gr. 1.69-1.75; m.p. 651°; b.p. 1120° C.'; oxlde M.O.

DETECTION

In the usual course of analysis magnesium is found in the filtrate from the precipitated carbonates of barium, calcium, and strontium. The general procedure for removal of the preceding groups may be found in the section on Separations given on the following page, 292. Magnesium is precipitated as white magnesium ammonium phosphate, MgNH₄PO₄, by an alkali phosphate, Na₂HPO₄, NaNH₄HPO₄, etc., in presence of ammonium chloride and free ammonia. The precipitate forms slowly in dilute solution. This is hastened by agitation and by rubbing the sides of the beaker during the stirring with a glass rod. Crystals soon appear on the sides of the beaker in the path of contact, and finally in the solution.

Baryta or lime water added to a solution containing magnesium produces a white precipitate of magnesium hydroxide.

Both the phosphate and the hydroxide of magnesium are soluble in acids.

ESTIMATION

The element is determined in the complete analysis of a large number of substances; in the analysis of ores, minerals, rocks, soils, cements, water, etc. The following are the more important ores in which the element occurs: Magnesite, MgCO₂; dolomite, CaCO₂·MgCO₂; kieserite, MgSO₄·H₂O; kainite, MgSO₄·KCl·6H₂O; carnallite, MgCl₂·KCl·6H₂O; in the silicates, enstatite, MgSiO₂; talc, H₂Mg₂(SiO₂)₄; meerschaum, forsterite, Mg₂SiO₄; titanate, MgTiO₂; olivine, MgSiO₄·Fe₂SiO₄; serpentine, H₄Mg₂Si₂O₄. It occurs as boracite, 4MgB₄O₇·2MgO·MgCl₂. It is found in sea-water, and in certain mineral waters. It occurs as a phosphate and carbonate in the vegetable and animal kingdoms, especially in seeds and bones.

Preparation and Solution of the Sample

In solution of the material it will be recalled that the metal is soluble in acids and is also attacked by the acid alkali carbonates. It is soluble in ammonium salts. The oxide, hydroxide, and the salts of magnesium are soluble in acids. Combined in silicates, however, the substance requires fusion with alkali carbonates to bring it into solution.

General Procedure for Ores. One gram of the ore is treated with 20 cc. of strong hydrochloric acid and heated gently until the material is decomposed. If sulphides are present, 5 to 10 cc. of strong nitric acid are added and the material decomposed by the mixed acids. If silicates are present and the decomposed

¹Circular 35 (2d Ed.) U. S. Bureau of Standards.

² Van Nostrand's Chem. Annual—Olsen.

sition is not complete by the acid treatment, the insoluble material is decomposed by fusion with sodium carbonate, or the entire sample may be fused with the alkali carbonate, the fusion is dissolved in hydrochloric acid and taken to dryness. Silica is dehydrated as usual by heating the residue from the evaporated solution. This is taken up with 50 cc. of water containing about 5 cc. strong hydrochloric acid, the silica filtered off and, after removal of the interfering substances according to procedures given under the next section on Separations, magnesium is determined as directed in the sections on Methods.

SEPARATIONS

Removal of Members of the Hydrogen Sulphide Group. Copper, Lead, Bismuth, Cadmium, Arsenic, etc. The filtrate from silica is diluted to about 200 cc. and hydrogen sulphide gas passed in until the members of this group are completely precipitated. The sulphides are filtered off and washed with H₂S water and the filtrate and washings concentrated by boiling. This treatment is seldom necessary in analysis of many silicates and carbonates in which these elements are absent.

Removal of Iron, Aluminum, Manganese, Zinc, etc. The concentrated filtrate from the hydrogen sulphide group, or in case the treatment with hydrogen sulphide was not required, the filtrate from silica, is boiled with a few cc. of nitric acid to oxidize the iron (solution turns yellow), about 5 cc. of concentrated hydrochloric acid added, and if manganese is present, 15 to 20 cc. of a saturated solution of bromine water, and the solution made alkaline to precipitate iron, aluminum, manganese. If zinc, cobalt, and nickel are present, these are best removed as sulphides by passing hydrogen sulphide into the ammoniacal solution under pressure. (See Fig. 3 and Fig. 4, pages 42 and 43.)

Separation of Magnesium from the Alkaline Earths. The alkaline earths are precipitated either as oxalates, recommended when considerable calcium is present, or as sulphates, recommended in presence of a large proportion of barium, the magnesium salts being soluble. Magnesium is precipitated from the filtrates as a phosphate, according to directions given later. Details of the separation of magnesium from the alkaline earths may be found in the chapter on Barium, page 59.

An excellent procedure for the separation by means of sulphuric acid is to evaporate the solution to dryness, concentrating first in a porcelain dish and finally to dryness in a platinum dish, and then adding about 50 cc. of 80% alcohol and sufficient sulphuric acid to combine with the alkaline earths and magnesium, with slight excess. This precipitates barium, strontium, and calcium as sulphates, while the greater part of the magnesium is in solution. After settling, the precipitate is filtered and washed free of sulphuric acid by means of absolute alcohol, then with 40% alcohol to remove any magnesium sulphate remaining with the precipitate. Magnesium is determined in the filtrate by expelling the alcohol by evaporation, and then precipitating as magnesium ammonium phosphate according to directions given for the determination of this element.

Note. Magnesium is prevented from precipitation as a hydroxide by the presence of ammonium salts. See note, bottom of page 8.

¹ See previous paragraph.

GRAVIMETRIC DETERMINATION OF MAGNESIUM

Precipitation of Magnesium by a Soluble Phosphate as Ammonium Magnesium Phosphate

Magnesium is determined in the filtrate from calcium oxalate by the addition of sodium ammonium phosphate to a hot slightly acid or neutral solution followed by a definite amount of ammonia. The practice of precipitating magnesium from a cold solution necessitates a double precipitation as the composition of the phosphate is considerably modified by that of the solution in which the precipitation takes place, so that it is necessary to adjust conditions by having a definite amount of ammonia, ammonium salts and phosphate for the approximate amount of magnesium present.1 Accurate results are obtained by precipitation of the compound from a hot solution by the method of B. Schmitz,² by addition of the soluble phosphate to a slightly acid solution and then making ammoniacal, or that of W. Gibbs, by precipitation of the amorphous magnesium hydrogen phosphate in a neutral solution and transforming the precipitate to magnesium ammonium phosphate by addition of ammonia to the hot solution. Upon ignition of the precipitate, magnesium pyrophosphate (Mg₂P₂O₇) is formed.

Reactions.

A. $Na_2NH_4PO_4+MgCl_2=2NaCl+MgNH_4PO_4$ (B. Schmitz).

B. $NaHNH_4PO_4+MgCl_2=NaCl+NH_4Cl+MgHPO_4$ and

 $MgHPO_4+NH_2=MgNH_4PO_4$ (W. Gibbs).

Decomposition with Heat.

 $2MgNH_4PO_4 = 2NH_2 + H_2O + Mg_2P_2O_7$.

The following procedure gives accurate results.

Procedure. The neutral or slightly acid solution, containing magnesium in presence of ammonium salts, is heated to boiling and treated, drop by drop, with an excess of sodium or ammonium phosphate, or microcosmic salt (10% solutions), stirring constantly during the addition. Then ammonium hydroxide (sp.gr. 0.96) is added, its volume measuring one-third that of the magnesium solution. crystalline precipitate is allowed to cool and settle for two hours or more. supernatant liquid is filtered off, the precipitate washed by decantation two or three times, then transferred to the filter, using dilute ammonia water (2%). precipitate is dried and then transferred as completely as possible to a weighed platinum crucible, the ash of the filter paper, burned separately, is added and the compound heated gently at first, the crucible being covered until the ammonia is driven off, and then more strongly until the mass is snow white. The residue is cooled in a desiceator and weighed as Mg₂P₂O₄. The ammonium magnesium phosphate may be filtered directly into a weighed Gooch crucible and ignited, thus avoiding the carbon of the filter paper, and shortening the period of ignition, less heat being required to obtain the white magnesium pyrophosphate.

F. A. Gooch and M. Austin, Am. Jour. Sci. (4), 7, 187, 1899. W. Gibbs, C. N. 28, 51, 1873. H. Struve, Zeit, anal. Chem., 36, 289, 1897.
 Z. anal. Chem., 512, 1906.
 Am. Jour. Sci. (3), 5, 114, 1873.

Factors. $Mg_2P_2O_7 \times 0.3621 = MgO$ or 0.2184 = Mg or $\times 0.7572$ $= MgCO_{4} \text{ or } \times 1.0811 = MgSO_{4} \text{ or } \times 2.2143 = MgSO_{4} \cdot 7H_{2}O_{4}$

Notes on Magnesium

The ignition is conducted gently at first to gradually oxidize the carbon that the precipitate contains. With rapid ignition the particles are inclosed in the mass in a form that it is almost impossible to completely oxidize, so that the final residue is gray instead of white. L. L. de Koninck considers that the blackening of the precipitate is frequently due to the presence of organic bases in commercial ammonia and its salts, rather than to the fibers of filter paper occluded in the mass. With caution, the filter and residue may be ignited wet, the heat being low until the filter completely

chars and then being increased, with the cover removed, until the residue is white.

Impurities. The precipitate may contain traces of lime that remained soluble in ammonium oxalate. This may be determined by dissolving the pyrophosphate in dilute sulphuric acid followed by addition of 9 to 10 volumes of absolute alcohol. Calcium sulphate, CaSO₄, precipitates and settles out on standing several hours. It may be filtered off, dissolved in hydrochloric acid and precipitated as oxalate in the usual way and so determined.

A residue remaining after treating the pyrophosphate with acid is generally SiO₂. The presence of manganese may be detected by dissolving the magnesium pyrophosphate, Mg₂P₂O₇, in nitric acid and oxidizing with sodium bismuthate. (See method under Manganese.)

Properties of Ammonium Magnesium Phosphate. Readily soluble in dilute acids. One hundred cc. of pure water at 10° C. will dissolve 0.0065 gram. The presence of ammonia greatly decreases the solubility of the salt, e.g., 2.5% ammonia decreases the solubility to 0.00006 gram MgO per 100 cc. The presence of ammonium salts increase the solubility of the precipitate, e.g., 1 gram of ammonium chloride will increase the solubility to 0.0013 gram MgO.³

VOLUMETRIC DETERMINATION OF MAGNESIUM Titration of the Ammonium Magnesium Phosphate with Standard Acid

The procedure known as Handy's volumetric method for magnesium, depends upon the reaction MgNH₄PO₄+H₂SO₄=MgSO₄+NH₄H₂PO₄. An excess of standard sulphuric acid is added to the precipitate and the excess of acid titrated back with standard ammonium hydroxide.

Procedure. The method of precipitation of the magnesium ammonium phosphate is the same as has been described under the gravimetric method. The precipitate is washed several times by decantation with 10% ammonium hydroxide solution (1 part NH₄OH, sp.gr. 0.90 to 9 parts water), and finally on the After draining, the filter is opened out, the moisture removed as much as possible by means of dry filter papers. The residue may be dried in the room for about forty-five minutes or in the air oven at 50 to 60° C. for fifteen to twenty minutes. When the filter has dried, ammonia will have been expelled. The substance is placed in a dry beaker, N/10 sulphuric acid added in excess (methyl orange indicator), the solution diluted to 100 cc. and the excess of acid titrated with N/10 sodium hydroxide.

One cc. $N/10 H_2SO_4 = 0.002 gram MgO$.

¹ Based on atomic weights of 1916.

² Zeit. analy. Chem., 29, 165, 1890. ³ Mellor, "Quantitative Inorganic Analysis," J. B. Lippincott Co., Pub. ⁴ James Otis Handy, Jour. Am. Chem. Soc., 22, 31. ⁵ Low, "Technical Methods of Ore Analysis," Wiley & Sons, Pub.

MANGANESE

WILFRED W. SCOTT

Mn, at.wt. 54.93; sp.gr. 7.42¹; m.p. 1260°²; b.p. 1900° C¹; oxides, MnO, Mn₂O₁, (Mn₂O₄ ignition in air), MnO₂, MnO₂, Mn₂O₇.

DETECTION

In the usual course of analysis manganese is found in the filtrate from the hydroxides of iron, aluminum and chromium, the previous groups having been removed with hydrochloric acid, hydrogen sulphide and ammonium hydroxide in presence of ammonium chloride. Manganese, cobalt, nickel and zinc are precipitated as sulphides in an ammoniacal solution. The sulphides of manganese and zinc are dissolved by cold dilute hydrochloric acid, H₂S expelled by boiling and manganese precipitated as the hydroxide by addition of potassium hydroxide in sufficient amount to dissolve the zinc (sodium zincate). Manganese is now confirmed by dissolving this precipitate in nitric acid and adding red lead or lead peroxide to the strong nitric acid solution. A violet-colored solution is produced in presence of manganese. Chlorides should be absent.

Manganese in soils, minerals, vegetables, etc., is detected by incinerating the substance, treating the ash with nitric acid and taking to dryness, the residue is taken up with water and the mixture filtered. To the filtrate is added a few cc. of 40% ammonium persulphate and a little 2% silver nitrate solution. A pink color is produced in presence of manganese.

Manganese compounds heated with borax in the oxidizing flame produce an amethyst red color. The color is destroyed in the reducing flame.

Fused with sodium carbonate and nitrate on a platinum foil manganese compounds produce a green-colored fusion ("robin egg blue").

ESTIMATION

Manganese may be determined accurately gravimetrically or volumetrically. The former methods may be used for high-grade manganese ores, the latter are generally preferred for determining manganese in steel and in alloys and are applicable to a wide range of substances.

The most important ore of manganese is pyrolusite, MnO₂. Other ores are braunite, Mn₂O₃; hausmannite, Mn₂O₄; manganite, Mn₂O₃·H₂O; albanite, MnS; haurite, MnS₂; dialogite, MnCO₃; rhodonite, MnSiO₃.

Speigeleisen or ferromanganese is an important alloy for the steel industry. In addition to the requirement of the element in the analysis of the above substances it is determined in certain paint pigments—green and violet manganous oxides, in dryers of oils, etc. It occurs in a number of alloys.

¹Van Nostrand's Chem. Annual—Olsen.

²Circular 35 (2d Ed.) U. S. Bureau of Standards.

Preparation and Solution of the Sample

In dissolving the sample the following facts will be recalled: The metal dissolves in dilute acids, forming manganese salts. The oxides and hydroxides of manganese are soluble in hot hydrochloric acid. Manganous oxide is soluble in nitric or in sulphuric acid; the dioxide is insoluble in dilute or concentrated nitric acid, but is soluble in hot concentrated sulphuric acid.

Ores of Manganese. A sample of powdered ore weighing 1 gram is brought into solution by digesting with 25 to 50 cc. of strong hydrochloric acid for fifteen to thirty minutes on the steam bath. If much silica is present 5 to 10 cc. hydrofluoric acid will assist solution. Five cc. of sulphuric acid are added and the mixture evaporated and heated until fumes of sulphur trioxide are evolved. The residue is taken up with a little water and warmed until the sulphates have dissolved. If decomposition is incomplete and a colored residue remains, this is filtered off, ignited in a platinum dish and fused with a little potassium bisulphate. The fusion is dissolved in water containing a little nitric acid and the solution added to the bulk of the sample.

If manganese is to be determined volumetrically the removal of iron is not necessary. If, however, a gravimetric procedure is to be followed, iron and alumina are removed by the basic acetate method given under separations and manganese precipitated in the filtrate. In presence of small amounts of iron and alumina, precipitation with ammonia in presence of ammonium chloride will remove these elements without appreciable loss of manganese, a double precipitation being usually advisable. For volumetric procedures in ores containing over 2% manganese an aliquot portion of the sample is taken for the determination. The portion should not contain over 0.01 gram of manganese.

Sulphide Ores—Pyrites, etc. The sample is either roasted to oxidize the sulphide and then dissolved in hydrochloric acid as above stated or it is treated according to the procedure given for iron pyrites under sulphur.

Slags. These may be decomposed with hydrofluoric and hydrochloric acid with final expulsion of these acids with sulphuric acid. Manganese is best determined in the extract by a volumetric method.

Iron Ores. The treatment is the same as that recommended for ores of manganese. The residue remaining upon evaporation with sulphuric acid is dissolved in a little water and about 30 cc. of nitric acid (sp.gr. 1.135) added. Manganese is now determined by the bismuthate method.

Alloys. Manganese Alloys. One gram of ferromanganese is dissolved in 50 cc. of dilute nitric acid (sp.gr. 1.135) and oxidized with sodium bismuthate with boiling. The cooled solution is diluted to 500 cc. and 10 to 25 cc. is treated with about 30 cc. of dilute nitric acid and manganese determined by the bismuthate method. The amount of sample taken is governed by the manganese content. This should not exceed 0.01 gram of the element if the volumetric procedure is to be followed.

Manganese Bronze. Five grams of drillings are dissolved in dilute nitric acid (1.2), in a large beaker, using only sufficient acid to cause solution. If much free acid is present evaporation to small volume is necessary to expel the nitric acid. The concentrate is diluted to 200 cc. and hydrogen sulphide passed in to precipitate copper. The solution is diluted to 250 cc. and 50 cc. filtered off (=1 gram). The H_2S gas is expelled by boiling, the solution being concentrated to about 15 cc. Twenty-five cc. of nitric acid are added and manganese precipitated

by adding potassium chlorate in small portions. The chlorine is boiled off and the precipitate filtered onto asbestos and washed with concentrated nitric acid. This is now determined volumetrically by treating with an excess of ferrous sulphate of known strength and titrating the excess with standard permanganate.

Ferro-titanium Alloy. This is best decomposed by fusion with sodium carbonate, to which a pinch of sodium peroxide has been added. The fusion is extracted with water and the residue containing iron, manganese and nickel filtered onto asbestos. Manganese is dissolved in 25 to 30 cc. of nitric acid by treating with SO₂ gas or hydrogen peroxide and manganese determined by the bismuthate method.

Ferro-chromium, Metallic Chromium. These are best decomposed by fusion with sodium peroxide (five times the weight of sample taken), the fusion being made in a nickel crucible. The treatment is now the same as that recommended for ferro-titanium.

Ferro-aluminum, Vanadium Alloys. The method used for steel is suitable to either of these substances.

Molybdenum Alloys. The alloy is decomposed with hydrochloric acid, and iron separated by the basic acetate method, a large excess of acetate being used. Manganese is precipitated as the dioxide by means of bromine and ammonia by the detailed procedure given later. Manganese is dissolved in nitric acid after reduction in the acid solution by addition of a little sodium thiosulphate or SO₂ gas. It is now oxidized to permanganate by means of red lead and determined either colorimetrically or by titration with a standard solution of sodium arsenite.

Tungsten Alloys. These are best decomposed by treating 1 gram of the substance with 5 to 10 cc. of hydrofluoric acid and a few cc. of strong nitric acid and digesting until the solution is complete. The hydrofluoric acid is expelled 1 by taking to dryness, a few drops of sulphuric acid having been added. The residue is taken up with water and boiled with SO₂ water. The solution is made to definite volume and manganese determined volumetrically on an aliquot portion.

Silicon Alloys. One gram of the alloy is treated with 50 cc. of dilute nitric acid (sp.gr. 1.2) and 5 cc. of hydrofluoric acid. The graphite is filtered off and the hot solution treated with sodium bismuthate and kept boiling for about fifteen minutes after the manganese dioxide has been precipitated. The bismuthate method for estimating manganese is recommended.

Iron and Steel. 0.5 to 1 gram of steel is dissolved by heating with 30 to 50 cc. of dilute nitric acid (1.135). The volumetric method by oxidation with sodium bismuthate is generally recommended, no separations of other substances being required, as manganese may be determined directly in the sample.

Pig Iron. One gram of the drillings is dissolved in 30 cc. of dilute nitric acid (1.135 sp.gr.), and as soon as the action has ceased the sample is filtered through a 7-cm. filter and the residue washed with 30 cc. more of the acid. The filtrate containing the manganese is now treated according to the procedure for steel.

¹ Brearly and Ibbotson state that although neither tungsten nor hydrofluoric acid interfere with the bismuthate method of determining manganese, the two combined lead to erratic results, hence the removal of hydrofluoric acid is necessary.

SEPARATIONS

This section includes methods of special separations of manganese from elements that may interfere in its determination. As is frequently the case, measure of manganese is not necessary, since it may be determined volumetrically in presence of a number of elements, which would interfere it its gravitatoric determination. The analyst should be sufficiently familiar with the material securid measurements manipulations, which not only waste time, but frequently lead as interprete results.

Removal of Elements of the Hydrogen Sulphide Group. This separation may be required in the analysis of certain alloys where a separation of manuscrases from copper is required.

The sold solution containing about 4% of free hydrocidesic sold (spage, 1.2), is saturated with hydrogen sulphible and the sulphibles filtered off. Manganese passes into the filterate. This treatment will effect a separation of manganese from mercury, lead, bismutin estimate, expert, assente, assistency, tin and the less common elements of the group.

Separation of Manganese from the Alkaline Barths and the Alkalines. The separation is conssistantly required in the analysis of clays, limestone, dolumns, etc. It is required in the complete analysis of cres. In the usual course of a complete analysis of a substance, the filtrate from the hydrogen sulphible group is boiled free of H₂S and is treated with a few on of nitric acid to confine the iron. The solution is made slightly assumediated with ammonia, in presence of ammonium chloride, whereby iron, aluminum and chromium are precipitated as hydroxides. The filtrate is treated with hydrogen sulphible or solutions ammonium sulphible, whereby manganese, nickel, exists and aims are thrown out as sulphibles and the alkaline earths and alkalies remain in solution.

Separation of Manganese from Nickel and Cobalt

The free soil of the sulphase or chloride solution of the elements is neutralized with solution enricents and a slight excess added. It is now made strongly acid with assens and and 5 grams of ammonium accesses added for every gram of nickel and coloub present. The solution is now diluted to about 200 cc. and saturated with hydrogen sulphide, whereby nickel and coloub are precipitated as sulphides and manganese remains in solution.

Separation of Manganese from Iron and Aluminum, Basic Acetate Method

The procedure effects a separation of from aluminum, titanium, nirconium and vanadium from manganese, sinc, cobalt and nickel.

The separation depends upon the fact that solutions of accesses of iron, illuminant marking absorbing and variation are decomposed when heated and the institute basic accesses precipitated, whereas the accesses of manganese, and could and rackel remain undecomposed when boiled for a short time.

 $F \in C_{\mathbf{H}}(A_{\mathbf{h}})$, $-2HOH = 2HC_{\mathbf{H}}(A_{\mathbf{h}}) + F_{\mathbf{h}}OH + C_{\mathbf{H}}O_{\mathbf{h}}$

The solvent action of the liberated acetic acid is prevented by the addition of sodium acetate 1 which checks ionization of the acid. The method requires care and is somewhat tedious, but the results attained are excellent.

Procedure. To the cooled acid solution of the chlorides is added a concentrated aqueous solution of sodium carbonate from a burette with constant stirring until the precipitate that forms dissolves slowly. A dilute solution of the carbonate is now added until a slight permanent opalescence is obtained. the weak reagent and careful addition of the carbonate drop by drop the proper neutralization of the free acid is obtained. With considerable iron present the solution appears a dark red color, fading to colorless as the quantity of iron decreases to a mere trace in the solution. Three cc. of acetic acid (sp.gr. 1.044) are added to dissolve the slight precipitate. The more perfect the neutralization before heating the less amount of reagent required for precipitating iron—an excess of reagent does no harm. If this does not clear the solution in two minutes, more acetic acid is added a drop at a time until the solution clears, allowing a minute or so for the reaction to take place with each addition. The solution is diluted to about 500 cc. and heated to boiling and 6 cc. of a 30% sodium The solution is boiled for one minute and removed acetate solution added. from the flame, (Longer boiling will form a gelatinous precipitate, difficult to wash and filter.) The precipitate is allowed to settle for a minute or so, then filtered, while the liquid is hot, through a rapid filter and washed with hot, 5% sodium acetate solution three times. The apex of the filter is punctured with a glass stirring rod and the precipitate washed into the original beaker in which the precipitation was made with a fine stream of hot, 1:1 hydrochloric acid solution from a wash bottle. (Dilute HNO, may be used in place of HCl.)

A second precipitation with neutralization of the acid and addition of sodium acetate is made exactly as directed above. It is advisable to evaporate the solution to small volume to expel most of the free mineral acid before addition of Na₂CO₃ to avoid large quantities of this reagent. The filtrates contain manganese, zinc, cobalt and nickel; the precipitate iron. aluminum, titanium, zirconium, vanadium.

Separation of Manganese as the Dioxide, MnO₂

The procedure is of special value in the complete analysis of ores where a basic acetate separation of iron and aluminum has been made, and a gravimetric estimation of other constituents in the solution are desired.

The procedure depends upon the principle that manganese in a dilute solution of manganous salt is oxidized to manganese dioxide and so precipitated, when boiled with bromine or certain other oxidizing agents:

$$MnCl_2+Br_2+2H_2O=MnO_2+2HCl+2HBr$$
.

The free acid formed by the reaction must be neutralized either by ammonia or by the presence of a salt of a weak acid such as sodium acetate, otherwise the precipitation of manganese will be incomplete. In presence of ammonium salts much of the bromine is used up reacting with ammonia,

$$MnCl_2+Br_2+3NH_3+2H_2O=MnO_2+2NH_4Cl+NH_4Br+HBr.$$

¹ Sodium acetate is preferred to ammonium acetate, though the latter may be used.

At the same time an acid is formed, which reacts with the free ammonia. It is necessary to have the solution ammoniacal throughout the reaction to prevent resolution of the manganese.

Procedure. To the solution containing manganese is added 4 to 5 grams of sodium acetate (unless already present in excess), the solution being diluted to about 200 cc. Bromine water is added until a distinct color of bromine is evident. The mixture is boiled and kept boiling for ten to fifteen minutes, additional bromine being added in small portions. The precipitate is allowed to settle and filtered off. The filtrate is boiled with additional bromine to ascertain whether the manganese has been completely removed from the solution.

If ammonia is present, as is frequently the case, it is advisable to add more of the reagent from time to time, the solution having a distinct odor of ammonia after the last portion of bromine has been added. When large amounts of manganese are present, several separations may be required to remove the element from the subsequent filtrates.

The precipitated dioxide may be dissolved in sulphuric acid and manganese determined volumetrically or gravimetrically.

It may be ignited directly and weighed as Mn₂O₄.

It may be evaporated with sulphuric acid and manganese determined as MnSO₄.

Manganates of zinc or calcium will be precipitated if present in large amounts.

Manganese may also be precipitated by ammonium persulphate in an ammoniacal solution, potassium chlorate and chloride of lime in presence of zinc chloride in a neutral solution.¹

GRAVIMETRIC METHOD

Determination of Manganese as Pyrophosphate

Manganese is precipitated as ammonium manganese phosphate, NH₄MnPO₄, and then ignited to pyrophosphate, Mn₂P₂O₇. The method is known as Gibbs' Phosphate Process.²

Procedure. The cold solution of manganese chloride * obtained as directed in previous sections, should be diluted so as to contain not over 0.1 gram of manganese oxide equivalent per 100 cc. of solution. A cold saturated solution of ammonium sodium phosphate (microcosmic salt, 170 grams per liter; 9 cc. precipitates an equivalent of 0.1 gram of the oxide) is now added in slight excess. The solution is made strongly ammoniacal and heated to boiling, the boiling being continued until the precipitate becomes crystalline. After allowing to settle until cold, the precipitate is filtered off (the filtrate being tested with more of the precipitating reagent to assure that an excess had been added), and dissolved in a little dilute hydrochloric or sulphuric acid.

Reprecipitation of the phosphate. The free acid is neutralized with ammonia added in slight excess until the odor is quite distinct, the solution heated to boiling, and a few cc. of additional phosphate reagent added. The crystalline

¹ J. Pattinson's Method, Jour. Chem. Soc., **35**, 365, 1809. | § 7 9 Gibbs' C.N., **17**, 195, 1868.

³ Some analysts prefer to add the phosphate reagent to the strongly ammoniscal solution, boiling hot.

precipitate is filtered into a weighed Gooch crucible, washed free of chlorides with very dilute ammonia (AgNO₃+HNO₂ test), dried and ignited to the pyrophosphate. The ignition is conducted, as in case of magnesium, by heating first over a low flame and gradually increasing the heat to the full power of the burner. The final residue will appear white or a pale pink.

 $Mn_2P_2O_7\times 0.4996 = MnO$, $Mn_2P_2O_7\times 0.3869 = Mn$.

Notes. Zinc, nickel, copper and other elements precipitated as phosphates should be absent from the solution. The separation from iron is generally made by the basic acetate method and manganese precipitated from the filtrate, free of other elements, as the peroxide MnO₂, by means of brom ine added to the ammoniacal solution. Other oxidizing reagents may be used, as has been stated. The dioxide is dissolved in strong hydrochloric acid and the above precipitation effected.

VOLUMETRIC METHODS

Bismuthate Method for Determination of Manganese ¹

The method is based on the fact that a manganous salt in the presence of an excess of nitric acid is oxidized to permanganic acid by bismuth tetroxide. The permanganic acid formed is very stable in nitric acid of 1.135 sp.gr., when the solution is cold, but in hot solutions the excess of the bismuth tetroxide is rapidly decomposed, and then the nitric acid reacts with the permanganic acid, and, as soon as a small amount of manganous salt is formed, the remainder of the permanganic acid is decomposed, manganous nitrate dissolves, and manganese dioxide precipitates.

In the cold, however, the excess of the bismuth salt may be filtered off, and to the clear filtrate an excess of ferrous sulphate added, and the amount necessary to deoxidize the permanganic acid determined by titrating with permanganate. The end reactions are very sharp and the method is extremely accurate, but the presence of even traces of hydrochloric acid utterly vitiates the results. As pointed out by Reddrop and Ramage, bismuth tetroxide, which was used by Schneider, is difficult to obtain free from chlorides, and they recommended sodium bismuthate, which they prepare as follows: Heat 20 parts of caustic soda nearly to redness in an iron or nickel crucible, and add, in small quantities at a time, 10 parts of basic bismuth nitrate, previously dried in a water oven. Then add 2 parts of sodium peroxide and pour the brownish-yellow fused mass on an iron plate to cool; when cold, break it up in a mortar, extract with water, and collect on an asbestos filter. The residue, after being washed four or five times by decantation, is dried in the water oven, then broken up and passed through a fine sieve.

Nitric acid (sp.gr. 1.135). A mixture of 3 parts of water and 1 part of strong nitric acid.

Nitric acid (3%). Thirty cc. of strong acid to the liter.

Permanganate Solution and Ferrous Sulphate Solution. One gram of potassium permanganate to the liter gives a solution of convenient strength, and 12.4 grams of ferrous ammonium sulphate and 50 cc. of strong sulphuric acid,

¹A. A. Blair, "Chemical Analysis of Iron," J. B. Lippincott Co., Pub.

made up to 1 liter, gives a solution which is almost exactly equal to the permanganate solution. As the strength of the ferrous sulphate solution changes quite rapidly while the permanganate remains unaltered for months, it is unnecessary and troublesome to keep them of the same strength. By using a constant volume of the ferrous sulphate solution and testing it against the permanganate solution every day, the calculation of the results is very simple. It is necessary that the conditions should be the same in getting the strength of the ferrous solution as in titrating a solution for manganese, and after many experiments the following method was adopted: Measure into a 200-cc. flask 50 cc. of nitric acid (1.135), cool, and add a very small amount of bismuthate, dilute with 50 cc. of 3% nitric acid, filter into a 300-cc. flask, and wash with 50 cc. of 3% nitric acid. If the felt is well coated with bismuthate it is unnecessary to add any to the nitric acid in the flask, as filtration through the mass of bismuthate on the felt will answer the purpose. Run in from the pipette (see Fig. 46) 25 cc. of ferrous sulphate solution and titrate with the permanganate to a faint pink. This gives the value in permanganate of the ferrous sulphate solution.

The permanganate solution may be standardized in three ways:

First, by getting its value in iron, in the usual way, and calculating its value in manganese. The proportion is 5Fe: Mn or 279.2:54.93 = 0.1967.

Second, by titrating a steel containing a known amount of manganese and getting the value of the solution by dividing the percentage of manganese by the number of cc. of the permanganate used.

Third, by making a solution of pure manganese sulphate and determining the manganese in it by evaporating a weighed amount of the solution to dryness, heating to dull redness, and weighing as manganese sulphate, which, multiplied by 0.36377, gives the amount of manganese. Five grams of C.P. manganese sulphate dissolved in 500 cc. of water and filtered will give a solution containing about 0.0035 gram of manganese to the gram of solution. Weigh 1 to 3 grams of the solution in a crucible, transfer to a 200-cc. flask, using 50 cc. of nitric acid (sp.gr. 1.135), cool, and add 0.5 to 1 gram bismuthate, and allow it to stand for three or four minutes, shaking at intervals. Add 50 cc. of 3\% nitric acid and filter through the asbestos filter and wash with 50 or 60 cc. of the same acid. Run 25 cc. of the ferrous sulphate solution into the flask from the pipette and titrate with the permanganate solution to a faint pink. Subtract the number of cc. of the permanganate solution obtained from the value of the 25 cc. of the ferrous sulphate solution in permanganate, and the result is the number of cc. of the permanganate corresponding to the manganese in the manganese sulphate solution used. Divide the weight of the manganese in the manganese sulphate used by the number of cc. of permanganate and the result is the value of 1 cc. of the permanganate solution in manganese.

Example. One gram manganese sulphate solution contains 0.003562 gram manganese; 2.0372 grams manganese sulphate solution equal 0.0072565 gram manganese; 25 cc. ferrous sulphate solution equal 24.5 cc. permanganate solution; 2.0372 grams manganese sulphate solution, after oxidation and addition of 25 cc. ferrous sulphate solution, require 3.6 cc. permanganate solution; 24.5 cc. -3.6 cc. =20.9 cc.; 0.0072565 divided by 20.9 = 0.0003472, or 1 gram permanganate equals 0.0003472 gram manganese. If, then, 1 gram of steel, after oxidation and addition of 25 cc. ferrous sulphate solution, requires 6.2 cc. permanganate solution to give the pink color, $24.5 - 6.2 = 18.3 \times 0.0003472 = 0.006354$ gram, or the sample contains 0.635% manganese.

Procedure. The nitric acid solution of the sample placed in a 200-cc. Erlenmeyer flask is treated as follows:

Cool, and add about 0.5 gram of bismuthate. The bismuthate may be measured in a small spoon, and experience will soon enable the operator to judge

of the amount with sufficient accuracy. Heat for a few minutes, or until the pink color has disappeared. with or without the precipitation of manganese dioxide. Add sulphurous acid, solution of ferrous sulphate, or sodium thiosulphate, in sufficient amount to clear the solution, and heat until all nitrous oxide has been Cool to about 15° C.. driven off. add an excess of bismuthate, and agitate for a few minutes. Add 50 cc. of water containing 30 cc. of nitric acid to the liter, and filter through an asbestos felt on a platinum cone into a 300-cc. Erlenmeyer flask, using suction (see Fig. 45), and wash with 50 to 100 cc. of the same acid. Run into the flask from a pipette (Fig. 46) a measured volume of ferrous sulphate

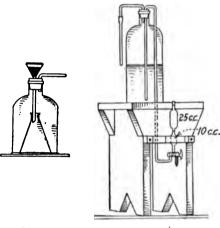


Fig. 45. Fig. 46.

solution and titrate to a faint pink color with permanganate. The number of cc. of the permanganate solution obtained, subtracted from the number corresponding to the volume of ferrous sulphate used, will give the volume of permanganate equivalent to the manganese in the sample, which, multiplied by the value of the permanganate in manganese, gives the amount of manganese in the sample.

NOTE. In the analysis of white irons it may be necessary to treat the solution several times with bismuthate to destroy the combined carbon. The solution, when cold, should be nearly colorless; if not, another treatment with bismuthate is necessary.

Notes and Precautions

Special Steels. Steels containing chronium offer no special difficulties, except that it must be noted that while in hot solutions the chromium is oxidized to chromic acid, which is reduced by the addition of sulphurous acid, the oxidation proceeds so slowly in cold solutions that if there is no delay in the filtration and titration the results are not affected. Steels containing tungsten are sometimes troublesome on account of the necessity for getting rid of the tungstic acid. Those that decompose readily in nitric acid may be filtered and the filtrate treated like pig iron, but when it is necessary to use hydrochloric acid it is best to treat with aqua regia, evaporate to dryness, redissolve in hydrochloric acid, add a few drops of nitric acid, dilute, boil, and filter. Get rid of every trace of hydrochloric acid by repeated evaporations with nitric acid, and proceed as with an ordinary steel.

The delicacy of the reaction of manganese in nitric acid solution with sodium

The delicacy of the reaction of manganese in nitric acid solution with sodium bismuthate is extraordinary; 0.000005 gram of manganese gave an appreciable color

in 50 cc. of solution.

As will be seen in the description of the various methods of solution, the use of hydrochloric acid has been avoided, because the presence of even traces of this reagent is fatal to the accuracy of the method. Where it is impossible to avoid its use, and its presence is suspected in the final nitric acid solution, the addition of a

drop or two of silver nitrate will overcome the difficulty, but the filter must be

rejected after using it for filtering a solution so treated.

Any form of asbestos filtering tube may be used for filtering off bismuthate, but Any form of aspectos meaning tube may be used for intering on bishutnate, but the perforated cone with bell jar is the most satisfactory, because it has the largest area of filtering service. One filter may be used for fifty or more determinations, and the time occupied in filtering and washing one determination is only from one minute and a half to three minutes. The filtrate must be clear, for the least particle of bismuthate carried through will vitiate the result by reacting with the excess of ferrous sulphate. As soon as the filtration and washing are completed, the ferrous sulphate should be added, and the excess titrated with the permanganate solution, as the permanganic acid gradually decomposes on standing, and the warmer the solution the more rapid is the decomposition. At a temperature of 5° C. the solution will remain unaltered for several hours, but at 40° C., fifteen minutes will show an appreciable change. The larger the amount of manganese the more rapid the change.

It is especially important not to allow the solution to stand after adding the ferrous sulphate, as the excess of this reagent reacts with the nitric acid in a few minutes and the formation of the smallest amount of nitrous oxide is fatal to the accuracy of the determination. For this reason it is important to boil off every trace of nitrous oxide when, in the earlier part of the operation, sulphurous acid or other

deoxidizing agent is added.

When working with steels of unknown manganese content, it may often happen that 25 cc. of ferrous sulphate solution are insufficient to entirely reduce the permanganic acid, in which case an additional amount of ferrous sulphate must be added. It will be noticed that the solution of permanganic acid upon the addition of an insufficient amount of ferrous sulphate does not necessarily retain its pink or purple color, but usually changes to a dirty brown. When this occurs 10 cc. more of ferrous sulphate is added to the flask and the value of the two additions taken as the amount from which the number of cc. of permanganate, corresponding to the excess of ferrous sulphate, must be subtracted. When the sample is low in manganese, the 10 cc. ferrous sulphate alone may be used.

These is no advantage in using permanganate solutions differing in strength from the one given above, but the strength of the ferrous sulphate solution may be changed to meet special cases.

Volhard's Method for Manganese 1

The method is based on the principle that when potassium permanganate is added to a neutral manganese salt all of the manganese is oxidized and precipitated. When this stage is reached any excess of permanganate is immediately evident by the color produced. The calculation of results may be based on the reaction,

 $3MnSO_4 + 2KMnO_4 + 2H_2O = 5MnO_2 + K_2SO_4 + 2H_2SO_4$

or

 $5ZnSO_4 + 6MnSO_4 + 4KMnO_4 + 14H_2O = 4KHSO_4 + 7H_2SO_4 + 5ZnH_2 \cdot 2MnO_3$

the ratio in either case being $2KMnO_4 = 3Mr$.

Procedure. The material decomposed with hydrochloric and nitric acid and taken to fumes with sulphuric acid, as stated for the preparation of the sample, is cooled and boiled with 25 cc. of water until the anhydrous ferric sulphate has dissolved and continue as follows: Transfer the mixture to a 500-cc. graduated flask and add an emulsion of zinc oxide in slight excess to precipitate the iron (C.P. ZnSO, precipitated by KOH added to slight alkalinity. The washed precipitate is kept in a stoppered bottle with sufficient water to form an emulsion).

A. H. Low, "Technical Methods of Ore Analysis," 7th Ed., John Wiley & Sons. Pub. (See procedure for Analysis of Spiegel Iron.)

Agitate the flask to facilitate the precipitation and see that a slight excess of zinc oxide remains when the reaction is complete. Now dilute the contents of the flask up to the mark with cold water, mix thoroughly and allow to stand a short time and partially settle. By means of a graduated pipette draw off 100 cc. of the clear supernatant liquid and transfer it to an 8-oz. flask. While the precipitate in the 500-cc. flask may appear large, it actually occupies but a very small space, and any error caused by it may consequently be neglected. Likewise the error in measurement due to change of temperature during the manipulation is insignificant. Heat the solution in the small flask to boiling, add two or three drops of nitric acid (which causes the subsequent precipitate to settle more quickly) and titrate with a standard solution of potassium permanganate. The permanganate causes a precipitate which clouds the liquid and it is therefore necessary to titrate cautiously and agitate the flask after each addition, and then allow the precipitate to settle sufficiently to observe whether or not the solution is colored pink. A little experience will enable one to judge by the volume of the precipitate formed, about how rapidly to run in the permanganate. The final pink tinge, indicating the end of the reaction, is best observed by holding the flask against a white background and observing the upper edges of the liquid. When this point is attained, bring the contents of the flask nearly to a boil once more and again observe if the pink tint still persists, adding more permanganate if necessary. In making this endtest avoid actually boiling the liquid, as a continual destruction of the color may sometimes thus be effected and the true end-point considerably passed. When the color thus remains permanent the operation is ended. Observe the number of cc. of permanganate solution used and calculate the result.

It is customary to use the same permanganate solution for both iron and manganese. Having determined the factor for iron, this may be multiplied by 0.2952 to obtain the factor for manganese. It will be observed that 2KMnO₄ are required for 3Mn, and in the reaction for iron that 2KMnO₄ are required for 10Fe. Therefore 558.4 parts of iron are equivalent to 164.79 parts of manganese, or, 1 part of iron to 0.2951 part of manganese.

 $3MnSO_4 + 2KMnO_4 + 2H_2O = 5MnO_2 + K_2SO_4 + 2H_2SO_4,$ $10FeSO_4 + 2KMnO_4 + 8H_2SO_4 = 5Fe_2(SO_4)_2 + 2MnSO_4 + K_2SO_4 + 8H_2O.$

Ammonium Persulphate Method for Determining Small Amounts of Manganese by Colorimetric Comparison or by Titration

The process depends upon the oxidation of manganous salts to permanganate by ammonium persulphate in presence of a catalytic agent such as silver nitrate:

 $2Mn(NO_3)_2 + 5(NH_4)_2S_2O_8 + 8H_2O = 5(NH_4)_2SO_4 + 5H_2SO_4 + 4HNO_2 + 2HMnO_4$

The reaction takes place equally well in sulphuric or in nitric acid solution, or in a mixture of the two. The essential point is the presence of a sufficient amount of silver nitrate catalyst.

Procedure. One gram of ore is dissolved in hydrochloric acid, followed by sulphuric and taken to fumes as directed under Preparation and Solution of the Sample. The sulphate taken up with water is made to a volume of 100 cc. If the color comparison is to be made the solution should be filtered through a dry filter, otherwise the filtration may be omitted. Twenty cc. (equal to 0.2)

gram) of the material is taken for the test. In the case of steel, 0.1 to 0.2 gram of the drilling, dissolved in dilute nitric acid, is taken.

Oxidation. The solution is transferred to a test-tube, 1×10 ins., if the color comparison is to be made, or into a 150-cc. Erlenmeyer flask, if the sample is to be titrated. Fifteen cc. of silver nitrate solution (1.5 grams AgNO₂ per liter of water), are added; the solution heated to 80 to 90° C. by placing the receptacle in hot water, and then 1 gram of ammonium persulphate added. When the color commences to develop the sample is cooled in cold water, while the evolution of oxygen continues. The sample is poured into the comparison tube and the color compared with that obtained from an ore or steel sample of known manganese content, run in the same way.

In the titration method the solution in the Erlenmeyer flask is diluted to about 100 cc., 10 cc. of 0.2% salt solution added, and the sample titrated with standard sodium arsenite until the permanganate color is destroyed. The cc. of the reagent used multiplied by the factor per cc. in terms of manganese equals weight of manganese in the sample titrated.

Note. Arsenious acid reagent is made by dissolving 10 grams of arsenious oxide in water containing 30 grams of sodium carbonate. The solution is diluted to 1 liter. 125 cc. of this solution are diluted to 2000 cc. This latter reagent is standardized against an ore or sample of steel of known manganese content, following the directions given under the procedure outlined.

Oxidation of Manganese to Permanganate by Red Lead

Red lead oxidizes manganese in nitric acid solution to permanganate. method is suitable for determining this element in steel and iron in presence of molybdenum, aluminum, tungsten, copper and nickel, in amounts such as are apt to be present. The method is given in the chapter on Iron in the Analysis of Iron and Steel, page 263.

ANALYSIS OF SPIEGEL IRON FOR MANGANESE¹

Procedure. Weigh 0.5 gram of the sample in a 250-cc. beaker, add 40 cc. dilute HNO₃ (1-2), cover with a watch-crystal, heat over Bunsen burner and finally expel nitrous fumes by boiling down to a small volume (5 cc.).2 Wash into a 500-cc. graduated flask, fill about half full, neutralize with an emulsion of zinc oxide, adding enough to precipitate the iron and a slight excess. Dilute to the mark, shake well, pour into a 600-cc. beaker and mix by pouring back into the flisk and then into beaker. Allow the precipitate to settle, decant off two 100-cc. portions of clear solution into 350-cc. casseroles. Add 100 cc. water, heat to boiling and titrate with standard KMnO, stirring thoroughly with heavy glass rod. Run in about 1 cc. at a time until the end-point is passed.4 Titrate the second portion, running it up to within 1 cc. of the end-point, and finishing a drop or two at a time, stirring thoroughly between each addition. The burette reading gives percentage of Mn directly.

¹ Procedure communicated to the author by Dr. Breyer.

²It is necessary to boil off nitrous fumes, as they will consume KMnO₄.

³Always test the zinc oxide for reducing substances.

In samples in which the percentage of Mn is known approximately, almost the full amount of KMnO₄ can be added at once.

 $^{\circ}$ Do not mistake the reflection of precipitated MnO₂ for excess of KMnO₄. If properly carried out the MnO₂ should collect in center of casserole.

Preparation and Standardization of Permanganate. Dissolve 23.23 grams C.P. KMnO₄ in 12 liters of distilled water, shake thoroughly and allow to stand a week or two before using.

Standardization. Weigh .15 gram C.P. sodium oxalate (Bureau of Standards) into a 400-cc. beaker. Dissolve in 200 to 250 cc. hot water (80 to 90°), add 10 cc. (1:1) sulphuric acid. Titrate at once with KMnO₄, until 1 drop gives a permanent pink.

When .15 gram sodium oxalate is taken, it should consume 36.87 cc. KMnO₄, if the permanganate is of correct strength, i.e., 1 cc. =1% in .1 gram sample

titrated.

DETERMINATION OF MANGANESE IN ORES, OXALIC ACID METHOD 1

Half a gram of ore is dissolved in 10 cc. HCl; if sulphides are present 5 cc. HNO₃ are added and the sample heated to effect solution. 5 cc. H₂SO₄ are added and the solution evaporated to near dryness to expel the large excess of acid. 100 cc. of water are added and the solution heated to boiling and allowed to stand until all ferric sulphate (anhydrous) has dissolved.

Zinc oxide, either as a powder or suspended emulsion, is added to completely precipitate the iron and then a slight excess, some oxide remaining undissolved. The precipitate is filtered off and washed with hot water 10 times. The filtrate contains the manganese.

3-4 grams of sodium acetate (or 5 cc. saturated solution) to neutralize the acid formed by the subsequent treatment are added, and then an excess of bromine water (saturated solution) and the solution boiled several minutes, adding more bromine if necessary. Bromine vapor should be evident on boiling. MnO₂ precipitates. After settling slightly it is filtered off and washed 10 times with hot water. (If lead is present in the ore it should be removed by adding K₂Cr₂O₇ sol. during the zinc oxide treatment to remove iron, otherwise lead would precipitate with MnO₂ and give high results.)

The filter with the precipitate is placed in a beaker with an excess of standard oxalic acid (1 cc. N/10 = 0.0063025 g· $H_2C_2O_4$ · $2H_2O$ or 0.0027465 g· Mn) 50 cc. dilute H_2SO_4 (1:10) are added, the solution heated to boiling (adding more oxalic if any MnO_2 remains). The solution is diluted to 200 cc. with hot water and the excess of oxalic acid titrated with standard $KMnO_4$ (N/10). The cc. oxalic acid minus cc. $KMnO_4$ gives cc. oxalic acid used by MnO_2 . Each cc. N/10 reagent = 0.0027465 g· Mn.

¹ Method of A. H. Low modified by W. W. Scott.

Preparation and Solution of the Sample

In dissolving the sample the following facts will be recalled: The metal dissolves in dilute acids, forming manganese salts. The oxides and hydroxides of manganese are soluble in hot hydrochloric acid. Manganous oxide is soluble in nitric or in sulphuric acid; the dioxide is insoluble in dilute or concentrated nitric acid, but is soluble in hot concentrated sulphuric acid.

Ores of Manganese. A sample of powdered ore weighing 1 gram is brought into solution by digesting with 25 to 50 cc. of strong hydrochloric acid for fifteen to thirty minutes on the steam bath. If much silica is present 5 to 10 cc. hydrofluoric acid will assist solution. Five cc. of sulphuric acid are added and the mixture evaporated and heated until funces of sulphur trioxide are evolved. The residue is taken up with a little water and warmed until the sulphates have dissolved. If decomposition is incomplete and a colored residue remains, this is filtered off, ignited in a platinum dish and fused with a little potassium bisulphate. The fusion is dissolved in water containing a little nitric acid and the solution added to the bulk of the sample.

If manganese is to be determined volumetrically the removal of iron is not necessary. If, however, a gravimetric procedure is to be followed, iron and alumina are removed by the basic acetate method given under separations and manganese precipitated in the filtrate. In presence of small amounts of iron and alumina, precipitation with ammonia in presence of ammonium chloride will remove these elements without appreciable loss of manganese, a double precipitation being usually advisable. For volumetric procedures in ores containing over 2% manganese an aliquot portion of the sample is taken for the determination. The portion should not contain over 0.01 gram of manganese.

Sulphide Ores—Pyrites, etc. The sample is either roasted to oxidize the sulphide and then dissolved in hydrochloric acid as above stated or it is treated according to the procedure given for iron pyrites under sulphur.

Slags. These may be decomposed with hydrofluoric and hydrochloric acid with final expulsion of these acids with sulphuric acid. Manganese is best determined in the extract by a volumetric method.

Iron Ores. The treatment is the same as that recommended for ores of manganese. The residue remaining upon evaporation with sulphuric acid is dissolved in a little water and about 30 cc. of nitric acid (sp.gr. 1.135) added. Manganese is now determined by the bismuthate method.

Alloys. Manganese Alloys. One gram of ferromanganese is dissolved in 50 cc. of dilute nitric acid (sp.gr. 1.135) and oxidized with sodium bismuthate with boiling. The cooled solution is diluted to 500 cc. and 10 to 25 cc. is treated with about 30 cc. of dilute nitric acid and manganese determined by the bismuthate method. The amount of sample taken is governed by the manganese content. This should not exceed 0.01 gram of the element if the volumetric procedure is to be followed.

Manganese Bronze. Five grams of drillings are dissolved in dilute nitric acid (1.2), in a large beaker, using only sufficient acid to cause solution. If much free acid is present evaporation to small volume is necessary to expel the nitric acid. The concentrate is diluted to 200 cc. and hydrogen sulphide passed in to precipitate copper. The solution is diluted to 250 cc. and 50 cc. filtered off (=1 gram). The H_2S gas is expelled by boiling, the solution being concentrated to about 15 cc. Twenty-five cc. of nitric acid are added and manganese precipitated

by adding potassium chlorate in small portions. The chlorine is boiled off and the precipitate filtered onto asbestos and washed with concentrated nitric acid. This is now determined volumetrically by treating with an excess of ferrous sulphate of known strength and titrating the excess with standard permanganate.

Ferro-titanium Alloy. This is best decomposed by fusion with sodium carbonate, to which a pinch of sodium peroxide has been added. The fusion is extracted with water and the residue containing iron, manganese and nickel filtered onto asbestos. Manganese is dissolved in 25 to 30 cc. of nitric acid by treating with SO₂ gas or hydrogen peroxide and manganese determined by the bismuthate method.

Ferro-chromium, Metallic Chromium. These are best decomposed by fusion with sodium peroxide (five times the weight of sample taken), the fusion being made in a nickel crucible. The treatment is now the same as that recommended for ferro-titanium.

Ferro-aluminum, Vanadium Alloys. The method used for steel is suitable to either of these substances.

Molybdenum Alloys. The alloy is decomposed with hydrochloric acid, and iron separated by the basic acetate method, a large excess of acetate being used. Manganese is precipitated as the dioxide by means of bromine and ammonia by the detailed procedure given later. Manganese is dissolved in nitric acid after reduction in the acid solution by addition of a little sodium thiosulphate or SO₂ gas. It is now oxidized to permanganate by means of red lead and determined either colorimetrically or by titration with a standard solution of sodium arsenite.

Tungsten Alloys. These are best decomposed by treating 1 gram of the substance with 5 to 10 cc. of hydrofluoric acid and a few cc. of strong nitric acid and digesting until the solution is complete. The hydrofluoric acid is expelled 1 by taking to dryness, a few drops of sulphuric acid having been added. The residue is taken up with water and boiled with SO₂ water. The solution is made to definite volume and manganese determined volumetrically on an aliquot portion.

Silicon Alloys. One gram of the alloy is treated with 50 cc. of dilute nitric acid (sp.gr. 1.2) and 5 cc. of hydrofluoric acid. The graphite is filtered off and the hot solution treated with sodium bismuthate and kept boiling for about fifteen minutes after the manganese dioxide has been precipitated. The bismuthate method for estimating manganese is recommended.

Iron and Steel. 0.5 to 1 gram of steel is dissolved by heating with 30 to 50 cc. of dilute nitric acid (1.135). The volumetric method by oxidation with sodium bismuthate is generally recommended, no separations of other substances being required, as manganese may be determined directly in the sample.

Pig Iron. One gram of the drillings is dissolved in 30 cc. of dilute nitric acid (1.135 sp.gr.), and as soon as the action has ceased the sample is filtered through a 7-cm. filter and the residue washed with 30 cc. more of the acid. The filtrate containing the manganese is now treated according to the procedure for steel.

¹ Brearly and Ibbotson state that although neither tungsten nor hydrofluoric acid interfere with the bismuthate method of determining manganese, the two combined lead to erratic results, hence the removal of hydrofluoric acid is necessary.

SEPARATIONS

This section includes methods of special separations of manganese from elements that may interfere in its determination. As is frequently the case, isolation of manganese is not necessary, since it may be determined volumetrically in presence of a number of elements, which would interfere in its gravimetric determination. The analyst should be sufficiently familiar with the material to avoid needless manipulations, which not only waste time, but frequently lead to inaccurate results.

Removal of Elements of the Hydrogen Sulphide Group. This separation may be required in the analysis of certain alloys where a separation of manganese from copper is required.

The acid solution containing about 4% of free hydrochloric acid (sp.gr. 1.2), is saturated with hydrogen sulphide and the sulphides filtered off. Manganese passes into the filtrate. This treatment will effect a separation of manganese from mercury, lead, bismuth, cadmium, copper, arsenic, antimony, tin and the less common elements of the group.

Separation of Manganese from the Alkaline Earths and the Alkalies. The separation is occasionally required in the analysis of clays, limestone, dolomite, etc. It is required in the complete analysis of ores. In the usual course of a complete analysis of a substance, the filtrate from the hydrogen sulphide group is boiled free of H₂S and is treated with a few cc. of nitric acid to oxidize the iron. The solution is made slightly ammoniacal with ammonia, in presence of ammonium chloride, whereby iron, aluminum and chromium are precipitated as hydroxides. The filtrate is treated with hydrogen sulphide or colorless ammonium sulphide, whereby manganese, nickel, cobalt and zinc are thrown out as sulphides and the alkaline earths and alkalies remain in solution.

Separation of Manganese from Nickel and Cobalt

The free acid of the sulphate or chloride solution of the elements is neutralized with sodium carbonate and a slight excess added. It is now made strongly acid with acetic acid and 5 grams of ammonium acetate added for every gram of nickel and cobalt present. The solution is now diluted to about 200 cc. and saturated with hydrogen sulphide, whereby nickel and cobalt are precipitated as sulphides and manganese remains in solution.

Separation of Manganese from Iron and Aluminum, Basic Acetate Method

The procedure effects a separation of iron, aluminum, titanium, zirconium and vanadium from manganese, zinc, cobalt and nickel.

The separation depends upon the fact that solutions of acetates of iron, aluminum, titanium, zirconium and vanadium are decomposed when heated and the insoluble basic acetates precipitated, whereas the acetates of manganese, zinc, cobalt and nickel remain undecomposed when boiled for a short time.

 $Fe(C_2H_2O_2)_2 + 2HOH = 2HC_2H_2O_2 + Fe(OH)_2 \cdot C_2H_2O_2$

The solvent action of the liberated acetic acid is prevented by the addition of sodium acetate 'which checks ionization of the acid. The method requires care and is somewhat tedious, but the results attained are excellent.

Procedure. To the cooled acid solution of the chlorides is added a concentrated aqueous solution of sodium carbonate from a burette with constant stirring until the precipitate that forms dissolves slowly. A dilute solution of the carbonate is now added until a slight permanent opalescence is obtained. the weak reagent and careful addition of the carbonate drop by drop the proper neutralization of the free acid is obtained. With considerable iron present the solution appears a dark red color, fading to colorless as the quantity of iron decreases to a mere trace in the solution. Three cc. of acetic acid (sp.gr. 1.044) are added to dissolve the slight precipitate. The more perfect the neutralization before heating the less amount of reagent required for precipitating iron—an excess of reagent does no harm. If this does not clear the solution in two minutes, more acetic acid is added a drop at a time until the solution clears, allowing a minute or so for the reaction to take place with each addition. The solution is diluted to about 500 cc. and heated to boiling and 6 cc. of a 30% sodium acetate solution added. The solution is boiled for one minute and removed (Longer boiling will form a gelatinous precipitate, difficult to from the flame. wash and filter.) The precipitate is allowed to settle for a minute or so, then filtered, while the liquid is hot, through a rapid filter and washed with hot, 5% sodium acetate solution three times. The apex of the filter is punctured with a glass stirring rod and the precipitate washed into the original beaker in which the precipitation was made with a fine stream of hot, 1:1 hydrochloric acid solution from a wash bottle. (Dilute HNO, may be used in place of HCl.)

A second precipitation with neutralization of the acid and addition of sodium acetate is made exactly as directed above. It is advisable to evaporate the solution to small volume to expel most of the free mineral acid before addition of Na₂CO₂ to avoid large quantities of this reagent. The filtrates contain manganese, zinc, cobalt and nickel; the precipitate iron. aluminum, titanium, zirconium, vanadium.

Separation of Manganese as the Dioxide, MnO₂

The procedure is of special value in the complete analysis of ores where a basic acetate separation of iron and aluminum has been made, and a gravimetric estimation of other constituents in the solution are desired.

The procedure depends upon the principle that manganese in a dilute solution of manganous salt is oxidized to manganese dioxide and so precipitated, when boiled with bromine or certain other oxidizing agents:

$$MnCl_2+Br_2+2H_2O=MrlO_2+2HCl+2HBr$$
.

The free acid formed by the reaction must be neutralized either by ammonia or by the presence of a salt of a weak acid such as sodium acetate, otherwise the precipitation of manganese will be incomplete. In presence of ammonium salts much of the bromine is used up reacting with ammonia,

$$MnCl_2+Br_2+3NH_3+2H_2O=MnO_2+2NH_4Cl+NH_4Br+HBr.$$

Sodium acetate is preferred to ammonium acetate, though the latter may be used.

The weighed silver cover is placed on the crucible and the apparatus set up as shown in the illustration, Fig. 48.

The bottom of the crucible is gradually heated with a small Méker flame until it glows slightly. Overheating should be avoided. The upper portion of the crucible should never become hot and the lid should remain cold. After heating for about thirty minutes the system is allowed to cool without disconnecting the condenser. The disk is now removed, dipped in alcohol and dried in a desiccator over fused potash or soda. The increase of weight of the dried disk is due to metallic mercury.

Notes. If the sample contains less than 1% mercury, take 2 grams; if 1 to 2% mercury, take 1 gram; if the sample contains 2 to 5%, take 0.5-gram sample. If high in mercury, grind sample with sand and take an aliquot portion.

It is advisable to repeat the test with a clean foil to be sure that all the mercury has been driven out of the sample. The foil may be freed from mercury by heating.

VOLUMETRIC DETERMINATION OF MERCURY

Seamon's Volumetric Method 1

Seamon's Volumetric Method.² Weigh 0.5 gram of the finely ground ore into an Erlenmeyer flask of 125 cc. capacity. Add 5 cc. of strong hydrochloric acid and allow it to act for about ten minutes at a temperature of about 40°C., then add 3 cc. of strong nitric acid and allow the action to continue for about ten minutes longer. The mercury should now all be in solution. Now if lead be present, add 5 cc. of strong sulphuric acid; it may be omitted otherwise. Dilute with 15 cc. of water and then add ammonia cautiously until the liquid is slightly alkaline. Bismuth, if present, will be precipitated. Acidify faintly with nitric acid, filter, receiving the filtrate in a beaker, and wash thoroughly.

Add to the filtrate 1 cc. of strong nitric acid that has been made brownish in color by exposure to the light, and titrate with a standard solution of potassium iodide until a drop of the liquid brought into contact with a drop of starch liquor, on a spot-plate, shows a faint bluish tinge. It is a good plan to set aside about one-third of the mercury solution and add it in portions until the endpoint is successively passed, finally rinsing in the last portion and titrating to the end-point very carefully.

Deduct 0.5 cc. from the burette reading and multiply the remaining cc. used by the percentage value of 1 cc. in mercury to obtain the percentage in the ore.

The standard potassium iodide solution should contain 8.3 grams of the salt per liter. Standardize against pure mercuric chloride. Dissolve a weighed amount of the salt in water, add 2 cc. of the discolored nitric acid and titrate as above. One cc. of standard solution will be found equivalent to about 0.005 gram of mercury, or about 1% on the basis of 0.5 gram of ore taken for assay.

The precipitate of red mercuric iodide which forms during the titration may not appear if the amount of mercury present is very small, but this failure to precipitate does not appear to affect the result.

Iron, copper, bismuth, antimony, and arsenic, when added separately to the ore, did not influence the results in Seamon's tests. Silver interferes. Duplicate results should check within 0.1 to 0.2 of 1%.

¹ A. H. Low, "Technical Methods of Ore Analysis." ² "Manual for Assayers and Chemists," p. 112.

MOLYBDENUM

WILIPED W. SCOTT, A. M. SMOOTI AND J. A. HOLLADAY2

Mo, at.wt. 96.0; sp.gr. 8.6-9.01; m.p. 2500°C; oxides, Mo₂O₂, MoO₂, MoO₃

DETECTION

Molybdenum appears in the hydrogen sulphide group, being precipitated by HS in acid solution as the sulphide. It passes into solution by digestion with anmonium sulphide or sodium sulphide along with arsenic, antimony, tin, gold and platinum. By addition of metallic zinc, antimony, together with tin, gold and platinum are precipitated as metals while molybdenum remains in solution. Arsenic, that has not volatilized as arsine, is expelled by evaporation. Nitric acid is now added and the solution taken to dryness. Molybdenum is extracted from the residue with ammonium hydroxide.

A dilute solution of ammonium molybdate treated with a soluble sulphide

gives a blue solution.

Sodium thiosulphate added to a slightly acid solution of ammonium molybdate produces a blue precipitate with a supernatant blue solution. With more

acid a brown precipitate is formed.

Sulphur dioxide produces a bluish-green precipitate if sufficient molybdenum is present, or a colored solution with small amounts. The reducing agents, stannous chloride, or zinc in acid solution, produce a play of colors when they react with molybdenum solutions, due to the formation of the lower oxides. The solution becomes blue, changing to green, brown and yellow.

Molybdenum present as molybdate is precipitated by disodium phosphote as yellow ammonium phosphomolybdate from a nitric acid solution. The pre-

cipitate is soluble in ammonium hydroxide.

A pinch of powdered mineral on a porcelain lid, moistened with a few drops of strong sulphuric acid, stirred and heated to funes, then cooled, will produce a blue color when breathed upon. The color disappears on heating, but reappears on cooling. Water destroys the color.

Molybdenite is very similar to graphite in appearance. It is distinguished from it by the fact that nitric acid reacts with molybdenite, MoS₂, leaving a white residue, but has no action upon graphite. The blowpipe gives SO₂ with molybdenite and CO₂ with graphite.

ESTIMATION

The determination is required in the ores—molybdenite, MoS₂, (60% Mo); molybdite, MoO₄ (straw yellow); wulfenite, PbMoO₄ (yellow, bright red, olive green or colorless); Ilsemannite, MoO₃+MoO₂; powellite, CaMoO₄; pateraite, CoMoO₄; belonesite, MgMoO₄; eosite, lead-vanado-molybdate; achromatite,

¹ Technical Director, Ledoux and Co. ² Chemist Electro Metallurgical Co.

lead molybdate and arsenate with tin oxide and lead chloride. Some iron and copper ores also contain molybdenum.

The metal is determined in certain self-hardening steels and alloys.

The reagents ammonium molybdate and the oxide-molybdic acid, MoO₂, are valuable for analytical purposes. Tests of their purity may be required.

Preparation and Solution of the Sample

In dissolving the substance the following facts should be kept in mind: The metal is easily soluble in aqua regia; soluble in hot concentrated sulphuric acid, soluble in dilute nitric acid, oxidized by excess to MoO₁. It is dissolved by fusion with sodium carbonate and potassium nitrate mixture. It is insoluble in hydrochloric, hydrofluoric and dilute sulphuric acids.

The oxide MoO₂ is but slightly soluble in acids and alkalies; MoO₂ is insoluble in hydrochloric and hydrofluoric acids. MoO₃, as ordinarily precipitated, is soluble in inorganic acids and in alkalies. The oxide sublimed is difficultly soluble.

Molybdates of the heavy metals are insoluble in water, the alkali molybdates are soluble.

Ores. Molybdenum ores are decomposed by fusion with a mixture of sodium carbonate and potassium nitrate, or with sodium peroxide, in an iron crucible, 0.5 gram of the sample being taken and 10 times its weight of fusion mixture. The melt is disintegrated with about 150 cc. of water, the alkali partly neutralized with $(NH_4)_2CO_3$ and filtered. The molybdenum is in the filtrate, the iron remains in the residue.

It is advisable to dissolve the residue in a little dilute HCl, pour this solution a hot solution of an excess of NaOH and again filter off the iron hydroxide, adding the filtrate to the first lot.

The combined filtrates and washings are treated with about 5 cc. of a 50% tartaric acid solution or its equivalent in crystals. (This prevents W and V from separating out) and the solution saturated with H_2S . The thiomolybdate solution is made slightly acid with H_2SO_4 (1:2) MoS₃ precipitates. Further details are the same as those given on page 323.

For Acid Decomposition see procedure on page 322.

Steel and Iron. One to 2 grams of the drillings are dissolved, a mixture of \$25 cc. HCl and 2 cc. HNO₃, additional HNO₃ (1:1) being added to oxidize the iron, if necessary. (KClO₃ crystals may be used.) A large excess of the oxidizing agent is to be avoided. The solution is evaporated to near dryness and the pasty residue taken up with about 25 cc. water and 10 cc. HCl, and gently heated. A yellow residue is due to WO₃. This is removed by filtration and washed. The filtrate contains the molybdenum. This is now treated according to the procedure given under "Separations" for removal of iron.

Separations

Separation of Molybdenum from Iron. The solution containing the molybdenum is treated very cautiously with 2 N.NaOH solution to neutralize the greater part of the free acid, but not with such an amount that would color the solution red. The yellow solution is heated to boiling.

In a separate vessel is placed 2 N.NaOH in sufficient quantity to combine with all the iron of the sample and about 50% excess (1 cc. of 2 N.NaOH = 0.1 g. Fe) 30 cc. should be sufficient. This solution is heated to boiling

and to it is added the hot solution containing the molybdenum. The sample should be added very slowly, preferably through a special funnel with capillary tube, stirring the solution vigorously during the addition. With care a complete separation of iron, free from molybdenum, may be effected, the molybdenum remaining in solution. The mixture is transferred to a 500 cc. volumetric flask.

The volume is made up to exactly 500 cc. and the precipitate allowed to settle. A portion is now filtered off, the first 5-10 cc. being rejected and the following 250 cc. of filtrate, carefully measured, being retained for analysis of molybdenum. Methyl orange is added as an indicator and the caustic neutralized with HCl. If Ba, Sr, U, As, Cd and Al are present, 10-15 cc. of the strong acid are added in excess, followed by sufficient ammonium acetate to combine with the free mineral acid. (About 25 grams of NaC₂H₃O₂-3H₂O or its equivalent of solution per 15 cc. HCl.)

Molybdenum is precipitated from this solution as lead molybdate according to directions given under Gravimetric Methods.

Separation from the Alkaline Earths. Fusion of the substance with sodium' carbonate and extraction of the melt with water gives a solution of molybdenum, whereas the carbonates of barium, calcium and strontium remain undissolved as carbonates.

Separation from Lead, Copper, Cadmium and Bismuth. The sulphides of the elements are treated with sodium hydroxide and sodium sulphide solution and are digested by gently heating in a pressure flask. Molybdenum dissolves, whereas lead, copper, cadmium and bismuth remain insoluble. If the solution of the above elements is taken, made strongly alkaline, and treated with H_sS, the sulphides of the latter elements are precipitated and molybdenum remains in solution. The precipitates are filtered off and the filtrate containing molybdenum is placed in the pressure flask, the solution made slightly acid with sulphuric acid and the mixture heated under pressure, until the liquid appears colorless, MoS₂ is precipitated and may be converted into the oxide as described later.

Separation from Vanadium is effected by a molybdenum sulphide precipitation in acid solution.

Separation from Arsenic. Arsenic, present in the higher state of oxidation, is precipitated by magnesia mixture, added to a slightly acid solution (5 cc. of concentrated hydrochloric acid per 100 cc. of solution for each 0.1 gram arsenic). The solution is neutralized with annuonia (methyl orange), and the arsenic salt filtered off. MoS₂ is now precipitated with H₂S in presence of free sulphuric acid in the pressure flask.

Separation from Phosphoric Acid. Phosphoric acid is precipitated from an ammoniacal solution as magnesium ammonium phosphate. Molybdenum may then be precipitated as the sulphide from the filtrate.

Separation from Titanium. The metals of the ammonium sulphide group are precipitated by adding ammonium hydroxide and ammonium sulphide. Molybdenum remains in solution and passes into the filtrate. H₂S is passed into the solution until it appears red; sulphuric acid is then added until the solution is acid, when molybdenum sulphide precipitates.

Separation from Tungsten. Molybdenum may be precipitated by H₂S as MoS₂ in presence of tartaric acid. Tungsten does not precipitate.

See subject under Tungsten.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF MOLYBDENUM

Precipitation as Lead Molybdate

Preliminary Remarks. This method, suggested by Chatard, has been pronounced by Brearly and Ibbotson to be "one of the most stable processes found in analytical chemistry." "It is not interfered with by the presence of large amounts of acetic acid, lead acetate, or alkali salts (except sulphates). The paper need not be ignited separately and prolonged ignition at a much higher temperature than is necessary to destroy the paper does no harm. From faintly acid solution lead molybdate may be precipitated free from impurities in the presence of copper, cobalt, nickel, manganese, zinc, magnesium and mercury salts." It may be readily separated from iron and chromium. Barium, strontium, uranium, arsenic, cadmium and aluminum do not interfere if an excess of hydrochloric acid has been added to the solution followed by lead acetate and sufficient ammonium acetate to destroy the free mineral acid.

The method is not adapted to use with molybdenite, MoS₂, because of the sulphate that forms on oxidation.

Vanadium and tungsten, if present, must be removed.

Special Reagents. Lead Acetate. A 4% solution is made by dissolving 20 grams of the salt in 500 cc. of warm water. A few cc. of acetic acid are added to clear the solution.

Precipitation of Lead Molybdate. The solution acidified with acetic acid (5 cc. per 200 cc.) and free from iron, is heated to near boiling and the lead acetate reagent added slowly until no further precipitation occurs and then about 5% excess. (1 cc. of the 4% lead acetate reagent will precipitate about 0.01 gram of molybdenum.) The precipitate is allowed to settle a few minutes and filtered hot into a weighed Gooch crucible or into a filter paper. (Refiltering first portion if cloudy.) The precipitate is washed with hot water until free of chlorides and the excess of the lead acetate.

The precipitate dried and ignited in a porcelain crucible at red heat for about twenty minutes is weighed as PbMoO₄.

PbMoO₄ \times 0.2615 = Mo. PbMoO₄ \times 0.3923 = MoO₃. Mo \times 3.8241 = PbMoO₄. MoO₃ \times 2.5491 = PbMoO₄.

Determination of Molybdenum as the Oxide, MoO₃

Especially applicable where fusion with an alkali carbonate has been required. Decomposition of Ore. One gram of the ore is fused with 4 grams of fusion mixture, (Na₂CO₃+K₂CO₃+KNO₃), and the cooled melt extracted with hot water.

If manganese is present, indicated by a colored solution, it may be removed by reduction with alcohol, the manganese precipitate filtered off and washed with hot water, the solution evaporated to near dryness and taken up with water, upon addition of nitric acid as stated below.

The solution containing the alkaline molybdate is nearly neutralized by adding HNO₃, the amount necessary being determined by a blank, and to the cold, slightly alkaline solution, a faintly acid solution of mercurous nitrate is

¹ Note. Addition of ammonium nitrate to the solution tends to prevent formation of colloidal PbMoO₄. Paper pulp (ashless) may be added to assist rapid filtration.

added until no further precipitation occurs. The precipitate consists of mercurous molybdate and carbonate (chromium, vanadium, tungsten, arsenic and phosphorus will also be precipitated if present). The solution containing the precipitate is boiled and allowed to stand ten to fifteen minutes to settle, the black precipitate is filtered off and washed with a dilute solution of mercurous nitrate. The precipitate is dried, and as much as possible transferred to a watch-glass. The residue on the filter is dissolved with hot dilute nitric acid, and the solution received in a large weighed porcelain crucible. The solution is evaporated to dryness on the water bath and the main portion of the precipitate added to this residue, and the product heated cautiously over a low flame ¹ until the mercury has completely volatilized. The cooled residue is weighed as MoO₃.

$$M_0O_1 \times 0.6667 = M_0.$$

Note. If Cr, V, W, As or P are present a separation must be effected. Molybdenum should be precipitated in an H₂SO₄ solution in a pressure flask as the sulphide by H₂S as given in the following method, and arsenic if present removed by magnesia mixture as indicated in the procedure for separation of arsenic from molybdenum. If these impurities are present the molybdenum oxide may be fused with a very little Na₂CO₃, and leached with hot water and the filtrate treated with H₂S as directed.

Precipitation of Molybdenum as the Sulphide by H₂S

A. Precipitation from Acid Solution. By this procedure molybdenum is precipitated along with members of the hydrogen sulphide group, if present, but free from elements of the following groups.

The cold molybdenum solution slightly acid with sulphuric acid (in presence of Ba, Sr or Ca an HCl solution is necessary) is placed in a small pressure flask and saturated with H₂S, the flask closed and heated on the water bath until the precipitate has settled. The solution is cooled and filtered through a weighed Gooch crucible.

B. Precipitation from an Ammoniacal Solution. By this procedure molybdenum is precipitated with antimony, arsenic, tin if present, but is free from mercury, lead, bismuth, copper and cadmium.

Hydrogen sulphide is passed into the cold ammoniacal solution of molybdenum (in presence of tungsten or vanadium add tartaric acid) until it assumes a bright red color, it is now acidified with dilute sulphuric acid, the precipitate allowed to settle and the solution filtered through a weighed Gooch crucible.

In either case A or B the precipitate is washed into the Gooch crucible with very dilute sulphuric acid followed by several washings with the acid and then with alcohol until free from acid. The Gooch is placed within a larger nickel crucible and covered with a porcelain lid. After drying at 100° C. it is placed over a small flame and carefully heated until the odor of SO₂ can no longer be detected. The cover is now removed and the open crucible heated to constant weight. The residue consists of MoO₂.

$$MoO_3 \times 0.6667 = Mo.^1$$

Note. Arsenic will contaminate the residue if present. The method for its removal has been given.

¹ The oxide, MoO₃, sublimes at bright red heat. The volumetric method is more reliable. See page 319.

VOLUMETRIC METHODS FOR THE DETERMINATION OF MOLYBDENUM OR MOLYBDIC ACID

The Iodometric Reduction Method 1

Principle. When a mixture of molybdic acid and potassium iodide in presence of hydrochloric acid is boiled, the volume having defined limits, free iodine is liberated and expelled and the molybdic acid reduced to a definite lower oxide; by titrating with a standard oxidizing agent the molybdic acid is determined.

Reaction. $2\text{MoO}_2+4\text{KI}+4\text{HCl}=2\text{MoO}_2\text{I}+\text{I}_2+4\text{KCl}+2\text{H}_2\text{O}$.

Reagents. N/10 solutions of iodine, sodium arsenite, potassium permanganate, sodium thiosulphate.

Analytical Procedure.² Reduction. The soluble molybdate in amount not exceeding an equivalent of 0.5 gram MoO₂ is placed in a 150-cc. Erlenmeyer flask, 20 to 25 cc. of hydrochloric acid (sp.gr. 1.2) added together with 0.2 to 0.6 gram potassium iodide. A short stemmed-funnel is placed in the neck of the flask to prevent mechanical loss during the boiling. The volume of the solution should be about 60 cc. The solution is boiled until the volume is reduced to exactly 25 cc. as determined by a mark on the flask. The residue is diluted immediately to a volume of 125 cc. and cooled. Either process A or B may now be followed.

A. Reoxidation by Standard Iodine. A solution of tartaric acid, equivalent to 1 gram of the solid, is now added, and the free acid nearly neutralized with sodium hydroxide solution (litmus or methyl orange indicator) and finally neutralized with sodium acid carbonate, NaHCO₁, added in excess. A measured amount of N/10 iodine is now run in. The solution is set aside in a dark closet for two hours, in order to cause complete oxidation, as the reaction is slow. The excess iodine is now titrated with N/10 sodium arsenite.

One cc. N/10 iodine = .0144 gram $MoO_3 = .0096$ gram Mo.

On long standing a small amount of iodate is apt to form. This is determined by making acid with dilute HCl and titrating with N/10 sodium thiosulphate.

B. Reoxidation of the Residue by Standard Permanganate. To the reduced solution about 0.5 gram of manganese sulphate in solution is added, followed by a measured amount of N/10 permanganate solution, added from a burette until the characteristic pink color appears. A measured amount of standard N/10 sodium arsenite, equivalent to the permanganate is then run in and about 3 grams of tartaric acid added. The acid is neutralized by acid sodium or potassium carbonate, the stopper and the sides of the flask rinsed into the main solution. The residual arsenite is now titrated by N/10 iodine, using starch indicator.

Notes. Tartaric acid prevents precipitation during the subsequent neutralization with NaHCO₁. A and B.

The addition of manganese salt in B is to prevent the liberation of free chlorine

by the action of KMnO4 on HCl.

In addition to the oxidation of the lower oxides to molybdic acid, potassium permanganate added in B liberates free iodine from HI, it produces iodic acid, and forms the higher oxides of manganese. The standard arsenite, on the other hand, converts free iodine and the iodate to HI and reduces the higher oxides of manganese.

¹ F. A. Gooch and Charlotte Fairbanks, Am. Jour. Sc. (4), 2, 160. ² F. A. Gooch and O. S. Pulman, Jr. Am. Jour. Sc. (4), 12, 449.

Estimation by Reduction with Jones Reductor and Oxidation by Standard Permanganate Solution

Principle. The procedure depends upon the reduction of molybdic acid to Mo₂O₂ by passing its solution through a column of amalgamated zinc into a solution of ferric alum, and subsequent oxidation to MoO, by standard potassium permanganate solution.

Reactions. $2\text{MoO}_3 + 3\text{Zn} = \text{Mo}_2\text{O}_3 + 3\text{ZnO}$.

 $5\text{Mo}_2\text{O}_3 + 6\text{KM}\text{nO}_4 + 9\text{H}_2\text{SO}_4 = 10\text{MoO}_3 + 3\text{K}_2\text{SO}_4 + 6\text{MnSO}_4 + 9\text{H}_2\text{O}_4$

Potassium permanganate approximately N/I0 standardized Reagents. against a standard molybdic acid solution.

10% solution of ferric alum.

2.5% solution of sulphuric acid.

Apparatus. Jones Reductor.

R = reductor tube 50 cm. long, 2 cm. inside diameter. Smaller tube prolongation length 20 cm. inside diameter 0.5 cm.

Zn = column of zinc 40 cm. long. Zn shot 8 mesh

to sq.cm.;

F = receiving flask;

P = pressure regulator with gauge, set to give pressure in receiving flask of less than 20 cm. water:

G = platinum cone or gauze with mat of fine glass wool 2 cm. thick;

The zinc in reductor should be protected from the air by covering with water, stop-cock S being closed when not in use.

Procedure. The receiving flask of the Jones reductor, Fig. 49, is charged with about 30 cc. of 10% ferric alum and 4 cc. of phosphoric acid.2 Through the 40-cm. column of amalgamated zinc in the reductor are passed in succession 100 cc. of dilute sulphuric acid (2.5% sol.), the molybdic acid in the form of ammonium molybdate dissolved in 10 cc. of water and acidified with 100 cc. of dilute sulphuric acid followed by 200 cc. more of the

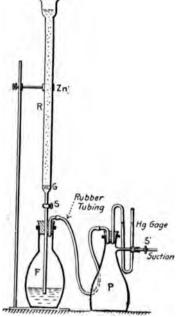


Fig. 49.—Jones Reductor.

dilute sulphuric acid and 100 cc. of water. The reduced green molybdic acid upon coming in contact with the ferric alum solution produces a bright red color.

The solution is titrated with N/10 KMnO₄ solution

One cc. of N/10 KMnO₄ =
$$\frac{.0144}{3}$$
 gram MoO₄ = $\frac{.0096}{3}$ gram molybdenum.

1 W. A. Noyes and Frohman, Jr. Am. Chem. Soc., 35, 919. After a thorough examination of the various methods for determining molybdenum, Messrs. Smoot, Lundill and Holladay pronounce this method to be superior to any other.

Notes on Reductor Technique

Use of the following greatly simplified and correspondingly more rapid reductor technique is recommended by J. A. Holladay.

1. The reductor should contain a column of 20×30 mesh amalgamated zinc $\frac{3}{4}$ " in diameter and 10 inches long. If the molybdenum solution is given a preliminary reduction by heating with 2 grams of 20 mesh zinc for the purpose




Fig. 49a.—Reductor Tube.

- of precipitating copper (which is subsequently removed by filtration on asbestos), the length of the zinc column may safely and advantageously be reduced to 8". The lengths specified apply only to a column $\frac{3}{4}$ " in diameter; the lengths for tubes of different diameters would have to be determined experimentally. The zinc should be as free from iron and as low in other impurities as possible.
- 2. If the reductor has been standing idle for longer than one day it is cleaned by passage of 50 cc. of 6% sulphuric acid, and 50 cc. of water, both at room temperature, a small amount of the water being left in the funnel which forms the reductor inlet. The acid and water are discarded after having been passed through the reductor. These operations are only necessary when the reductor has been standing idle for some time.
- 3. The required amount of ferric phosphate solution and sufficient water (about 50 cc.) to cause the tip of the reductor outlet tube to dip beneath the surface of the liquid are added to the flask.
- 4. The molybdenum solution (volume 50 to 100 cc., acidity 6% H₂SO₄) which may be at room temperature or slightly warm, is passed through the reductor rapidly. The total time required for the passage of the molybdenum solution and the liquids which follow it need not exceed from 1 to 3 minutes. No advantage results from having the solution hot—on the contrary, the greater action of the hot acid solution on the zinc is a disadvantage. No increase in accuracy is obtained by passing the solution through the reductor at a slower rate than that specified.
- 5. When the funnel which forms the inlet of the reductor is nearly but not entirely empty, 150 cc. of water at room temperature are passed through the reductor. In the case of samples containing relatively small amounts of molybdenum, 100 cc. of water is sufficient. In no case is the funnel

permitted to become entirely empty and the stopcock is closed while some of the wash water remains above the surface of the zinc.

Method for Determining Molybdenum and Vanadium in a Mixture of their Acids

Principle of the Method. The procedure depends upon the fact that vanadic acid alone is reduced by SO₂¹ in a sulphuric acid solution, whereas both vanadic and molybdic acids are reduced by amalgamated zinc, in each case the reducing agents forming definite lower oxides which are readily oxidized to definite higher oxides by KMnO₄.

Reactions.

SO₂ Reduction:

1. $V_2O_5 + SO_2 = V_2O_4 + SO_3$. (No action on MoO₃.)

Zn Reduction:

- 2. $V_2O_4 + 3Zn = V_2O_2 + 3ZnO$.
- 3. $2\text{MoO}_2 + 3\text{Zn} = \text{Mo}_2\text{O}_2 + 3\text{ZnO}$.

KMnO4 Oxidation:

- 4. $5V_2O_4 + 2KMnO_4 + 3H_2SO_4 = 5V_2O_5 + K_2SO_4 + MnSO_4 + 3H_2O_5$
- 5. $5V_2O_2 + 6KMnO_4 + 9H_2SO_4 = 5V_2O_5 + 3K_2SO_4 + 6MnSO_4 + 9H_2O$.
- 6. $5\text{Mo}_2\text{O}_3 + 6\text{KMnO}_4 + 9\text{H}_2\text{SO}_4 = 10\text{MoO}_3 + 3\text{K}_2\text{SO}_4 + 6\text{MnSO}_4 + 9\text{H}_2\text{O}$.

From the reactions "4" and "5" it is seen that three times the amount of KMnO₄ is required to oxidize V₂O₂ to V₂O₄ as is required in the case of V₂O₄, hence—total cc. KMnO₄ required in oxidation of the zinc-reduced oxides minus three times the cc. KMnO₄ required in oxidizing the tetroxide of vanadium formed by the sulphur dioxide reduction = cc. KMnO₄ required to oxidize Mo₂O₃ to MoO₃. From these data molybdenum and vanadium may readily be calculated.

Method of Procedure. A. Vanadic Acid. The solution containing the vanadic and molybdic acids in a 250- to 300-cc. Erlenmeyer flask, is diluted to 75 cc. acidified with 2 to 3 cc. of strong sulphuric acid, heated to boiling and the vanadic acid reduced by a current of SO₂ passed into the solution until the clear blue color indicates the complete reduction of the vanadic acid to V₂O₄. The boiling is now continued and CO₂ passed into the flask to expel the last trace of SO₂.

Standard N/10 KMnO₄ is now run into the reduced solution to the character istic faint pink. From reaction "4," vanadic acid may be calculated.

One cc. N/10 KMnO₄ = .0182 gram
$$V_2O_5$$
 = .0051 gram vanadium.

B. Molybdic Acid. The reduction by Jones' reductor, and titration of the combined acids reduced by amalgamated zinc with N/10 potassium permanganate solution, is carried out exactly as described in the determination of molybdic acid alone. In this case 50 cc. of 10% ferric alum and 8 cc. of the phosphoric acid is placed in the receiving flask.

Calculation. Total permanganate titration in B minus three times the titration in A gives the permanganate required to oxidize Mo₂O₃ to MoO₃. From equation 6 the molybdic acid may now be calculated.

One cc. N/10 KMnO₄ =
$$\frac{.0144}{3}$$
 gram MoO₃ = $\frac{.0096}{3}$ gram molybdenum.

¹Reduction of vanadium by SO₂ in presence of molybdenum, Graham Edgar, Am. Jour. Sc., (4) 25, 332. No reduction of MoO₃ when 0.4 gram is present with 5 cc. H₂SO₄ in 25 cc. volume.

For theoretical considerations and data on accuracy of method see "Methods in Chemical Analysis," F. A. Gooch.

DETERMINATION OF MOLYBDENUM IN ORESI

The commercial ores of molybdenum are molybdenite, the native sulphide (MoS₂), and wulfenite, lead molybdate. Occasionally molybdenum ochre (the trioxide) may be met with, but this mainly occurs in very small proportion associated with molybdenite as an oxidation product of the sulphide.

Molybdenite is sold either as high grade selected mineral or as concentrates which are usually the product of flotation processes. The important determinations in molybdenite are molybdenum, arsenic, copper and phosphorus; sometimes bismuth is present and occasionally lead.

Owing to the complex nature of wulfenite the determination of molybdenum is more difficult and the number of impurities which may be sought for is much greater.

The following methods for the determination of molybdenum in commercial ores and concentrates are the result of co-operative work between the laboratories of the Electro Metallurgical Company and Ledoux & Company. It is believed that all important sources of error have been considered and eliminated so far as the usual commercial ores are concerned.

Determination of Molybdenum in Wulfenite or Molybdenite

One gram of the finely ground ore is dissolved by treatment with 15 cc. of nitric acid (sp.gr. 1.42) and 7 cc. of sulphuric acid (sp.gr. 1.84) at a temperature just short of boiling in a 150 cc. covered beaker. When practically complete decomposition has been effected, the liquid is evaporated until Yumes of sulphur trioxide are freely expelled. After cooling addition is made of about 40 cc. of water, the solution is boiled to dissolve the molybdenum, cooled to room temperature and filtered into a 250 cc. beaker. The residue, consisting of lead sulphate, silica, etc., is washed with very dilute H₂SO₄. The residue rarely, if ever, contains Mo, nevertheless it should be examined to make sure that decomposition is complete. To this end it is digested with 15 cc. to 25 cc. of ammonium acetate solution (prepared by mixing 8 cc. of (NH₄)OH (0.90) with 10 cc. H₂O and adding 7 cc. of 99% C₂H₄O₂) to remove all lead sul-The filter paper is washed with hot dilute acetic acid and with water. It is then ignited in a platinum crucible and the silica is removed by treatment with a drop of sulphuric acid and several cc. of hydrofluoric acid and evaporating to the expulsion of sulphuric acid. If an appreciable residue remains after this treatment, it is fused with potassium pyrosulphate and tested for molybdenum by means of tartaric acid and ammonium sulphide as described later.

To the solution containing all of the molybdenum there is added sufficient ferric sulphate to provide ten times as much iron as there is arsenic present: from 0.2 to 0.3 gram of iron is usually ample. The acid solution is then nearly neutralized with ammonia (addition of a sufficient amount to impart a red tint to the clear yellow solution is to be avoided), heated nearly to boiling and poured very slowly and with vigorous stirring into 75 cc. of warm ammonia solution (15 cc. (NH₄)OH 1.90 sp.gr. 60 cc. H₂O) contained in a 250 cc. beaker. When it has settled the ferric hydroxide (which will carry down quantitatively all arsenic in the ore) is filtered and washed thoroughly with hot water; it is then dissolved in a slight excess of hot dilute (1 to 4) sulphuric acid and the resulting solution is again heated to boiling and poured into 75 cc. of warm

¹ By James A. Holladay and A. M. Smoot.

ammonia solution as before; the iron hydrate is again washed. The two filtrates, which will contain all the molybdenum, are collected in a 600 cc. beaker. It is essential that arsenic, which is usually present in these ores, be eliminated, and the method described furnishes a simple and effective way for accomplishing this. The addition of ferric sulphate would be omitted only in case arsenic is known to be absent or when the ore itself carries sufficient iron to take care of the arsenic.

To the combined ammoniacal filtrates there are added 2 grams of tartaric acid and when the acid has dissolved the liquid is saturated with hydrogen sulphide. The presence of tartaric acid is necessary to prevent precipitation of vanadium and tungsten along with the molybdenum. Both of these elements are ordinary constituents of wulfenite concentrates. Under these conditions the molybdenum remains in the solution as ammonium thiomolybdate, (NH₄)₂MoS₄, which imparts a deep red color to the solution. If a small precipitate of insoluble sulphides separates out, it is filtered off and washed with dilute ammonium sulphide solution; if the solution remains clear this step is omitted. Copper in the amounts usually present remains entirely in solution at this point and is reprecipitated with molybdenum when the solution is subsequently acidified. The thiomolybdate solution is then made slightly acid with sulphuric acid (1 to 2). Molybdenum is thus precipitated as trisulphide.

The cessation of effervescense on addition of more acid and the disappearance of the red color of the ammonium thiomolybdate mark the point where sufficient acid has been added to complete the reactions.

After heating for a short time, the precipitate is allowed to settle and filtered on an 11 cm. paper and washed thoroughly with hydrogen sulphide water containing a small amount of sulphuric acid.

The filtrate from the molybdenum sulphide sometimes contains appreciable amounts of molybdenum; addition is made to it of 15 cc. of nitric acid (sp.gr. 1.42) and the solution is evaporated to fumes of sulphur trioxide, more sulphuric acid being added if sufficient is not already present. After allowing it to cool, 5 cc. of concentrated nitric acid are added and the solution is again evaporated to fumes. The addition of nitric acid and evaporation to strong fumes is repeated once more to insure the destruction of all organic compounds. After allowing to cool, sufficient water is added to dissolve all salts, two grams of tartaric acid are added, and after addition of an excess of ammonia (sp.gr. 0.90) the warm liquid is thoroughly saturated with washed hydrogen sulphide and filtered. The filtrate is acidified with sulphuric acid (1 to 2) and if after standing for fifteen to thirty minutes in a warm place any molybdenum trisulphide has separated out it is filtered, washed well with hydrogen sulphide water containing a small amount of sulphuric acid, and combined with the main precipitate. The precipitation of the molybdenum as sulphide when carried out as described effects the separation and removal of tungsten, vanadium and chromium.

The molybdenum sulphide precipitate and paper, or precipitates and papers, are put into a 250 cc. beaker and treated with 6 cc. of sulphuric acid (sp.gr. 1.84) and 10 cc. of nitric acid (sp.gr. 1.42) and the liquid is cautiously boiled until dense fumes of sulphur trioxide are freely evolved. After allowing it to cool somewhat, 5 cc. of nitric acid (sp.gr. 1.42) are added and the evaporation is repeated. The evaporation with 5 cc. portions of strong nitric acid is repeated several times until the filter paper has been completely destroyed and

every trace of yellow color, due to carbonaceous matter, has disappeared. When this has been accomplished the solution is fumed strongly for a short while, cooled, 5 cc. of water are added and the liquid is again taken to fumes of sulphur trioxide in order to insure the expulsion of every trace of nitric acid. When cool, addition is made of approximately 75 cc. of water and the contents of the beaker are boiled for a few minutes, which should give a perfectly clear solution. Five grams of granulated zinc (0.002% iron or under) are then added and the solution is warmed until most of it has dissolved; this results in partial reduction of molybdenum and complete precipitation of copper, which is usually present. The liquid is then filtered on an asbestos or "alundum" filter to remove the undissolved zinc and the copper.

All the molybdenum in the solution is then reduced from the sexivalent to the trivalent condition by passage through the zinc reductor into a solution of ferric sulphate containing phosphoric acid—the solution is then titrated with N/10 permanganate. The details of the reductor and the method of preparing

it are given on page 319 and 320.

It is essential to run a blank determination, using the same quantity of zinc that was used to separate copper and the same volumes of water and acid—passing the solution through the reductor under the same conditions. With good zinc the correction may be about 0.2 cc.

Method for Molybdenum in Pure Molybdenite Concentrates

Molybdenum may be determined in the same way as in wulfenite, but owing to the higher Mo content of the material only 0.5 gram may be taken for the determination.

In case of very pure and high-grade molybdenite, which rarely contains any interfering element except traces of arsenic, the method may be simplified.

It suffices to treat 0.5 gram of the pulp with 10 cc. of strong HNO₃ and 7 cc. of H₂SO₄ and evapoate to fumes. A single treatment usually results in complete decomposition, but if the solution shows any particle of undecomposed material a further addition of 5 cc. of HNO₃ and a second evaporation to fumes may be necessary. In order to remove all HNO₃, the H₂SO₄ solution is diluted by washing down the sides of the beaker with 5 cc. of water and the evaporation to fumes is repeated.

After cooling, 35 cc. of water and ferric sulphate equivalent to about 0.1 gram of metallic iron are added. The solution is poured into an ammonia solution, the same as in the longer method, the iron hydrate carrying any arsenic is filtered off, dissolved in H_2SO_4 and reprecipitated. The united filtrates contain all the molybdenum; they are concentrated by evaporation to a volume of 150 cc. which also serves to expel the excess of ammonia. The solution is acidulated with H_2SO_4 , reduced and titrated as in the longer method.

This method, of course, is not applicable in the presence of vanadium, tungsten or other impurities which might be reduced and reoxidized in the final operations, but it serves very well for the analysis of high grade molybdenite.

Determination of Commonly Occurring Substances in Molybdenum Ores

Determination of Arsenic

Two grams of the 100-mesh sample are treated with 20 cc. of nitric acid (sp.gr. 1.42) and 7 cc. of sulphuric acid (sp.gr. 1.84) in a 150 cc. beaker. The liquid is heated for a short time at a temperature just below the boiling point and is then evaporated until fumes of sulphuric anhydride are freely evolved. The residue is taken up with 40 cc. of water and boiled for a few minutes. Approximately one gram of cuprous chloride and five grams of ferrous ammonium sulphate are added, and transfer is made of the solution to the distillation flask of the apparatus shown on page 39, arsenic chapter, the beaker being rinsed with 40 cc. of hydrochloric acid (sp.gr. 1.20). It is important that the amount of water used be kept to a minimum so as to insure presence of sufficiently concentrated hydrochloric acid in the distillation flask to rapidly and completely volatilize the arsenic.

For distillation of the arsenic, the Knorr Arsenic and Antimony Distillation Apparatus (mentioned above see page 39) is very satisfactory. The rate at which arsenic distills over is greatly influenced by the size and form of apparatus employed; by use of the Knorr apparatus it is rapidly and completely volatilized. After having attached the flask, the inlet funnel is filled about half full of hydrochloric acid (sp.gr. 1.20). The outlet of the condenser tube is caused to dip just beneath the surface of 100 cc. of distilled water in a 350 cc. beaker containing a lump of ice. The solution in the distillation flask is heated to boiling; concentrated hydrochloric acid is introduced through the funnel tube drop by drop at a rate sufficient to replace the evaporation, or in other words, in amount sufficient to keep the level of liquid in the flask constant. It is necessary to keep a steady flame under the flask; if the solution in the beaker starts to be sucked back into the condenser tube, the apparatus is quickly raised so as to lift the lower end of the condenser out of the distillate. All of the arsenic will usually distill over in 30 or 35 minutes; at the end of this time the beaker holding the condensate is replaced by another one containing about 100 cc. of water and a lump of ice, and the distillation is continued for another 15 minutes. The second distillate is tested separately to

determine whether it contains any arsenic.

By the above described procedure the arsenic is separated from any other elements likely to be present by volatilization as arsenious chloride, AsCl₃; it may be determined in the resulting solution by either gravimetric or volumetric methods. Where only occasional determinations have to be made, the gravimetric method is perhaps the more convenient. The hydrochloric acid distillate is warmed and saturated with hydrogen sulphide by passage of a rapid stream of gas. Filtration is made of the arsenious sulphide, As₂S₁, and it is washed with hydrogen sulphide water. The yellow precipitate is dissolved in the least necessary amount of ammonia (1 to 1) and the paper washed with hot water; the volume is kept as low as possible, the filtrate being received in a 150 cc. beaker. To the filtrate there are added 6-10 cc. of "perhydrol" (30% H₂O₂) for every 0.1 gram of arsenic supposed to be present; if "perhydrol" is not available, there are used instead 60-100 cc. of 3% hydrogen peroxide (free from phosphorus), but use of the former is preferable since it permits keeping the volume small. It is essential that enough hydrogen peroxide be used to oxidize the arsenic completely to the arsenic condition. Some commercial brands of hydrogen peroxide contain considerable amounts of phosphorus, making it always necessary to determine it and make a correction for the weight of magnesium pyrophosphate formed from it which would otherwise be counted as arsenic. The resulting solution is evaporated on a hot plate for some time, boiled for ten minutes with the cover glass on, and cooled in ice water. Ten cc. of "magnesia mixture" are added, followed by ammonia (sp.gr. 0.90) to the extent of one-third the volume of the solution, and the liquid is stirred vigorously for some time and then allowed to stand in a cool place for at least 15 hours. The magnesium ammonium arsenate is filtered on a weighed Gooch crucible and washed 10-15 times with small amounts of cold 2.5% ammonia water. It is then drained as completely as possible

When more than occasional analyses have to be made, the following volumetric method can be used to advantage; the only superiority of the gravimetric process is that visual evidence of the presence of arsenic is furnished by the yellow arsenious sulphide. The distillate containing the arsenic in the form of arsenious chloride, As₇Cl₃, is made slightly ammonical, litmus paper being used as indicator, and the solution being kept cool. Sufficient sulphuric acid (1 to 1) to render the liquid slightly acid is next added. To the cold, slightly acid solution there is added 8–10 grams of sodium bicarbonate, 0.3 gram of potassium iodide and several cc. of starch solution (a water solution of Kahlbaum's "Lösliche Starke" or soluble starch is used) and the solution is titrated with a standard iodine solution each cc. of which is equal to 0.001 gram of arsenic. The titration is based on the reaction:

 $KH_2AsO_1+l_2+2NaHCO_3=KHAsO_4+2Nal+2CO_2+H_2O.$

The reaction between arsenic and iodine is shown by the equation:

 $As_2O_3 + 2l_2 + 2H_2O = As_2O_5 + 4Hl.$

A "blank" must be run and deducted.

The iodine solution is prepared by dissolving 3.5 grams of pure resublimed iodine with 7 grams of potassium iodide and a very small amount of water. When the iodine has completely dissolved, the solution is diluted to 1 liter and mixed thoroughly; it is standardized against pure As₇O₂. This is accomplished by carefully weighing 0.0600 gram of pure resublimed As₇O₂ and transferring it to a 350 cc. beaker. Eight to ten grams of sodium bicarbonate and sufficient hot water to dissolve it are added and the solution is heated until the As₇O₂ has completely dissolved. The solution is then diluted to 250 cc., cooled, 0.3 gram of potassium iodide and 2–3 cc. of starch solution are added and the liquid is titrated with the iodine solution to the usual blue end point. The weight of As₇O₂ used (0.0600 gram) contains exactly 0.04545 gram of arsenic so the number of cc. used in the titration, divided into 0.04545, gives the arsenic value of one cc. of the iodine.

Determination of Copper

(a) In Molybdenite. Four grams of finely ground sample are treated with 35 cc. of nitric acid (sp.gr. 1.42) and 10 cc. of sulphuric acid (sp.gr. 1.84) in a 250 cc. beaker provided with a clock-glass cover. The solution is digested at a temperature somewhat below the boiling point until most of the molybdenite has dissolved. Subsequently the liquid is boiled until strong fumes of sulphur trioxide are expelled. After having allowed the beaker and its contents to cool, 50 cc. of water are added and the solution is boiled briskly for a few minutes and filtered on a 9 cm. paper into a 250 cc. beaker. The residue is washed thoroughly with hot water and discarded.

An excess of sodium hydroxide solution is added to the filtrate and the solution is boiled for several minutes and filtered on a 9 cm. paper. The precipitate of ferric hydroxide, etc., is washed with hot water to remove the molybdenum. Solution is then made of this precipitate, which will contain all of the copper, in 30 cc. of hot dilute (1 to 3) sulphuric acid, the paper being washed with about 50 cc. of hot water and the

filtrate and washings being collected in a 150 cc. beaker.

The copper in the solution obtained as above described is completely precipitated in the metallic condition by placing a sheet of pure aluminum (conveniently bent into the form of a triangle 1 inch in height which stands on its edge in the beaker) in the beaker and boiling for about ten minutes. Complete precipitation is not obtained until the iron has been reduced, when the aluminum should appear clean and the precipitated copper be detached or only loosely adherent. After removal from the source of heat, the clock glass and sides of the beaker are rinsed with a jet of hydrogen sulphide water. The aluminum, the copper content of which should be accurately determined, is weighed before and after use and a correction is applied for the copper introduced from it.

Filtration is made of the solution on a very small filter paper, the copper being transferred to the paper and the aluminum being left as clean as possible in the beaker. The precipitate is washed with hot water and the filtrate and washings are discarded. Solution is then made of the copper in 5 cc. of hot nitric acid (1 to 1), this being accomplished by first dropping the acid over the aluminum and then pouring it on the copper. The aluminum and filter paper are both washed with hot water, the filtrate and washings being collected in a 100 cc. lipless beaker. After boiling the solution to expel oxides of nitrogen, 2 cc. of sulphuric acid (sp.gr. 1.84) are added and determination is made of the copper by electrolysis, a platinum gauze cathode and spiral anode being employed.

·

Determination of Copper

(b) In Wulfenite. Four (4.0000) grams of the 100-mesh sample are treated with approximately 30 cc. of 10% sodium hydroxide solution in a 250 cc. beaker provided with a clock-glass cover. The solution is boiled briskly for 10 minutes, which is usually sufficient to insure practically complete decomposition of the wulfenite. Addition is then made of about 70 cc. of hot water and the precipitate of iron oxide, etc., which will contain all of the copper, is allowed to settle. The supernatant liquid is decanted through a 9 cm. filter paper and the precipitate is then transferred to the paper and washed well with hot water. The filtrate and washings are discarded. As a result of these operations separation of the copper from practically all of the molybdenum and from the greater part of the lead is accomplished.

The paper containing the residue is returned to the original 250 cc. beaker and The paper containing the residue is returned to the original 250 cc. bearer and treated with 6 cc. of sulphuric acid (sp.gr. 1.84) and 10 cc. of nitric acid (sp.gr. 1.42). The contents of the beaker are cautiously heated until frothing is nearly over, and then boiled briskly until fumes of sulphuric anhydride are evolved. After having permitted the liquid to partly cool, 10 cc. of nitric acid (sp.gr. 1.42) are added and the evaporation to fumes is repeated. The cover glass and sides of the beaker are cleaned with a few cc. of water and the solution is once more evaporated to fumes in order to insure destruction of all carbonaceous matter from the filter paper and complete expulsion of nitric acid. In practice the total time consumed in making these evaporations is small.

Having allowed the beaker and its contents to cool somewhat, addition is made of 50 cc. of water and the solution is boiled for a short while, cooled, and filtered on a 9 cm. paper into a 150 cc. beaker. The precipitate of lead sulphate, etc., is washed with cold 10% sulphuric acid and discarded, the copper passing completely into the filtrate and washings, which should have a total volume of not more than 100 cc.

The copper in the solution obtained as above described is completely precipitated in the metallic condition by placing a sheet of pure aluminum (conveniently bent into the form of a triangle 1 inch in height which stands on its edge in the beaker) in the beaker and boiling for about ten minutes. Complete precipitation is not obtained until the iron has been reduced, when the aluminum should appear clean and the precipitated copper be detached or only loosely adherent. After removal from the source of heat, the clock-glass and sides of the beaker are rinsed with a jet of hydrogen sulphide water. The aluminum, the copper content of which must be accurately determined, is weighed before and after use and a correction is applied for the copper introduced into the solution from it.

Filtration is made of the solution on a very small filter paper, the copper being transferred to the paper and the aluminum being left as clean as possible in the beaker. The precipitate is washed with hot water and the filtrate and washings are discarded. Solution is then made of the copper in 5 cc. of hot nitric acid (1 to 1), this being accomplished by first dropping the acid over the aluminum and then pouring it on the copper. The aluminum and filter paper are both washed with hot water, the filtrate and washings being collected in a 100 cc. lipless beaker. After boiling the solution to expel oxides of nitrogen, 2 cc. of sulphuric acid (sp.gr. 1.84) are added and determination is made of the copper by electrolysis, a platinum gauze cathode and spiral anode being employed.

Determination of Phosphorus

(a) Molybdenite. Four grams of the finely ground sample are treated with 35 cc. of nitric acid (sp.gr. 1.42) and 10 cc. of sulphuric acid (sp.gr. 1.84) in a 250 cc. beaker provided with a cover glass. The liquid is heated at a temperature somewhat below the boiling point until decomposition of the mineral appears to have been secured, when it is boiled until strong fumes of sulphuric anhydride are given off. When the residue has cooled, 40 cc. of water are added and the solution is boiled for several minutes and filtered on a 9 cm. paper into a 300 cc. Erlenmeyer flask. The residue is washed well with hot water, ignited in a porcelain crucible and transferred to a platinum crucible and evaporated with 2 or 3 drops of sulphuric acid (sp.gr. 1.84) and several cc. of hydrofluoric acid. After completely expelling the sulphuric acid, any small residue remaining is fused with a pinch of potassium pyrosulphate and dissolved in water and added to the main solution.

A few drops of strong permanganate solution (25 grams per liter) are added to the solution obtained as previously described, and it is boiled to insure complete oxidation of the phosphorus to the tribasic condition. Just sufficient sulphurous acid to decompose the excess of permanganate or separated manganese oxide is then added and the

boiling is continued for a few minutes longer. A slight excess of ammonia is added and the ferric hydroxide, etc., which will carry down practically all of the phosphorus, is filtered and washed thoroughly with hot water. Solution is made of the precipitate in hot dilute (sp.gr. 1.135) nitric acid and the phosphorus is precipitated with "molybdate

(b) Wulfenite. Two (2.000) grams of the agate ground sample of wulfenite are treated with 20 cc. of nitric acid (sp.gr. 1.42) and 10 cc. of sulphuric acid (sp.gr. 1.84) in a 150 cc. beaker. The liquid is heated for a short while at a temperature just below the boiling point and then boiled until fumes of sulphuric anhydride are freely evolved. The residue is taken up with 40 cc. of water, boiled a few minutes, cooled, filtered into a 300 cc. Erlenmeyer flask, and the lead sulphate, silica, etc., are washed with cold 10% sulphuric acid and discarded.

A few drops of strong permanganate solution (25 grams per liter) are added to the filtrate from the lead sulphate and it is boiled to insure complete oxidation of the phosphorus to the tribasic condition. Just sufficient sulphurous acid is added to decompose the excess of permanganate or separated manganese oxide and the boiling is continued

for a minute or two longer.

The acid solution is nearly neutralized with ammonia, partly cooled, and to it there are added one gram of tartaric acid and then a slight excess of ammonia. 2 grams of sample should be employed, as in case of very high phosphorus ores, correspondingly less tartaric is to be used, since an excess tends to prevent complete precipi-

tation of the phosphorus.

Twenty cc. of "magnesia mixture" and 4 or 5 glass beads (6 mm. diameter) are added to the warm solution and it is thoroughly chilled by immersion in a mixture of crushed ice and salt. The contents of the flask are then vigorously shaken (an efficient shaking machine can be used to advantage) for about 15 minutes, the solution being chilled several times during the shaking. The glass beads aid in starting the precipitation of the magnesium ammonium phosphate. Fifteen cc. of ammonia (sp.gr. 0.90) are next introduced and the contents of the flask are again thoroughly chilled and shaken briskly for 10-15 minutes longer. The flask is then packed in ice in a refrigerator and allowed to stand for 15 hours.

The magnesia precipitate, which may contain small amounts of basic magnesia compounds, iron, and possibly tartrates, is filtered on a 9 cm. paper and washed thoroughly with cold 10% ammonia water. The glass beads are transferred to the filter but no attempt is made to remove all of the precipitate from the flask. Under the conditions described, molybdenum, tungsten, and vanadium should all pass completely

into the filtrate.

Solution is made of the magnesium ammonium phosphate in the least necessary amount of hot dilute hydrochloric acid and the paper is washed with hot water. The filtrate and washings are caught in the same 300 cc. Erlenmeyer flask and evaporated down to a volume of approximately 5 cc. After cooling, addition is made of 10 cc. of a saturated solution of sulphurous acid, the flask and its contents are permitted to stand in a warm place for 5 or 10 minutes, 20 cc. of hydrochloric acid (sp.gr. 1.20) are added and the solution is evaporated to a bulk of about 5 cc. to expel completely arsenic. Twenty cc. of nitric acid (sp.gr. 1.42) are added and the solution is again boiled down to a volume of about 10 ca in order to eliminate practically all of the hydrochloric acid. After having been diluted with 50 cc. of water, the solution is oxidized by boiling with an excess of strong permanganate solution (25 grams per liter) and then cleared by the addition of a few cc. of sulphurous acid. The liquid is boiled for a minute or two to expel nitrous fumes, and then cooled. A piece of litmus paper is dropped into the solution and a slight excess of ammonia (sp.gr. 0.90) is added. This is followed by addition of an excess of 1 or 2 cc. of colorless nitric acid (sp.gr. 1.42). The temperature of the solution is brought to 40° C. and the phosphorus is precipitated by addition of 40 cc. of "molybdate solution" and five minutes' vigorous shaking. Determination is made of the phosphorus in the ammonium phosphomolybdate by either the Alkalimetric or

the Molybdenum Reduction (Emmerton) Method.

The "magnesia mixture" is prepared in the following manner: Fifty-five grams of the enhydrous crystallized magnesium chloride, MgCl₂·6H₂O, or twenty-five grams of the anhydrous salt, are dissolved in water and filtered. Fourteen grams of ammonium chloride are dissolved in water, a little bromine water and a slight excess of ammonia are added and the solution is filtered. The two solutions are mixed, sufficient ammonia is added to give a decided odor, and enough water is added to bring the volume up to one liter. The solution is allowed to stand for several days with occasional vigorous shaking and is filtered into one or more ceresin bottles. Ten cc. of the reagent will precipitate about

gram of phosphorus.

NICKEL

W. L. SAVELL

Ni, al. wl. 58.68; sp. gr. 8.6-3.9; m. p. 1452° C.; oxides, NiO, Ni₂O₃, Ni₂O₄.

DETECTION

After bringing the sample into solution by one of the methods described under Preparation and Solution of the Sample, silica is removed, if present, in the usual manner, by evaporating the solution to dryness in the presence of an excess of hydrochloric acid, dissolving the residue and boiling with hydrochloric acid and filtering off the silica.

Hydrogen sulphide is then passed through the solution to remove the elements precipitated by this reagent. The filtrate from this precipitation is then boiled to expel the excess of hydrogen sulphide and a little nitric acid added to oxidize any ferrous iron to the ferric state. (See page 331, Separations.) Ammonium hydroxide is then added to precipitate iron, aluminum and chromium. Cobalt, nickel, manganese and zinc are precipitated from the filtrate by adding a solution of colorless ammonium sulphide or by passing hydrogen sulphide through the ammoniacal solution. Manganese and zinc are separated from the precipitate by washing with cold hydrochloric acid of about 1.035 sp.gr. A small quantity of the precipitate is fused with borax in the loop of a clean platinum wire. A green color in the cool bead indicates nickel. Fairly small quantities of cobalt interfere with this test, so if the bead is colored blue it will be necessary to make further tests for nickel.

Dimethylglyoxime will precipitate nickel as oxime from an acetic acid solution containing sodium acetate and in this manner separate it from cobalt, manganese and zinc. After precipitating iron, aluminum and chromium and filtering them off, the solution is slightly acidified with hydrochloric acid, then is neutralized with sodium hydroxide, and acidified with acetic acid. A solution of dimethylglyoxime is added, when nickel, if present, will be precipitated as a flocculent red precipitate.

Nickel may be detected in the presence of cobalt by adding a solution of sodium hydroxide to the solution of cobalt and nickel until a slight precipitate is formed, then somewhat more potassium cyanide then is necessary to redissolve the precipitate and finally two volumes of bromine water. Warm gently and allow to stand for some time. If a precipitate of nickel hydroxides separates, filter, wash and test with the borax bead.

Nickel may also be detected in the presence of cobalt by precipitating the cobalt as nitrite, as described in the chapter on cobalt, and then precipitating the nickel as hydroxide with sodium hydroxide and bromine water and testing the precipitate with the borax bead.

Alpha benzildioxime added to an ammoniacal solution of nickel precipitates an intensely red salt having the composition C₂₂H₂₂N₄O₄Ni. This precipitate is very voluminous. Silver, magnesium, chromium, manganese and zinc do not interfere with this reaction.

boiling is continued for a few minutes longer. A slight excess of ammonia is added and the ferric hydroxide, etc., which will carry down practically all of the phosphorus, is filtered and washed thoroughly with hot water. Solution is made of the precipitate in hot dilute (sp.gr. 1.135) nitric acid and the phosphorus is precipitated with "molybdate colution" and the phosphorus is precipitated with "molybdate colution".

and determined as described for wulfenite.

(b) Wulfenite. Two (2.000) grams of the agate ground sample of wulfenite are treated with 20 cc. of nitric acid (sp.gr. 1.42) and 10 cc. of sulphuric acid (sp.gr. 1.84) in a 150 cc. beaker. The liquid is heated for a short while at a temperature just below the boiling point and then boiled until fumes of sulphuric anhydride are freely evolved. The residue is taken up with 40 cc. of water, boiled a few minutes, cooled, filtered into a 300 cc. Erlenmeyer flask, and the lead sulphate, silica, etc., are washed with cold 10% sulphuric acid and discarded.

A few drops of strong permanganate solution (25 grams per liter) are added to the filtrate from the lead sulphate and it is boiled to insure complete oxidation of the phosphorus to the tribasic condition. Just sufficient sulphurous acid is added to decompose the excess of permanganate or separated manganese oxide and the boiling is continued

for a minute or two longer.

The acid solution is nearly neutralized with ammonia, partly cooled, and to it there are added one gram of tartaric acid and then a slight excess of ammonia. 2 grams of sample should be employed, as in case of very high phosphorus ores, correspondingly less tartaric is to be used, since an excess tends to prevent complete precipi-

tation of the phosphorus.

Twenty cc. of "magnesia mixture" and 4 or 5 glass beads (6 mm. diameter) are added to the warm solution and it is thoroughly chilled by immersion in a mixture of crushed ice and salt. The contents of the flask are then vigorously shaken (an efficient shaking machine can be used to advantage) for about 15 minutes, the solution being chilled several times during the shaking. The glass beads aid in starting the precipion. tation of the magnesium ammonium phosphate. Fifteen cc. of ammonia (sp.gr. 0.90) are next introduced and the contents of the flask are again thoroughly chilled and shaken briskly for 10-15 minutes longer. The flask is then packed in ice in a refrigerator and allowed to stand for 15 hours.

The magnesia precipitate, which may contain small amounts of basic magnesia compounds, iron, and possibly tartrates, is filtered on a 9 cm. paper and washed thoroughly with cold 10% ammonia water. The glass beads are transferred to the filter but no attempt is made to remove all of the precipitate from the flask. Under the conditions described, molybdenum, tungsten, and vanadium should all pass completely

into the filtrate.

Solution is made of the magnesium ammonium phosphate in the least necessary ount of hot dilute hydrochloric acid and the paper is washed with hot water. The amount of hot dilute hydrochloric acid and the paper is washed with hot water. The filtrate and washings are caught in the same 300 cc. Erlenmeyer flask and evaporated down to a volume of approximately 5 cc. After cooling, addition is made of 10 cc. of a saturated solution of sulphurous acid, the flask and its contents are permitted to stand in a warm place for 5 or 10 minutes, 20 cc. of hydrochloric acid (sp.gr. 1.20) are added and the solution is evaporated to a bulk of about 5 cc. to expel completely arsenic. Twenty cc. of nitric acid (sp.gr. 1.42) are added and the solution is again boiled down to a volume of about 10 cc. in order to eliminate practically all of the hydrochloric acid. After having been diluted with 50 cc. of water, the solution is oxidized by boiling with an excess of strong permanganate solution (25 grams per liter) and then cleared by the addition of a few cc. of sulphurous acid. The liquid is boiled for a minute or two to expel nitrous fumes, and then cooled. A piece of litmus paper is dropped into the solution and a slight excess of ammonia (sp.gr. 0.90) is added. This is followed by addition of an excess of 1 or 2 cc. of colorless nitric acid (sp.gr. 1.42). The temperature of the solution is brought to 40° C. and the phosphorus is precipitated by addition of 40 cc. of "molybdate solution" and five minutes' vigorous shaking. Determination is made of the phosphorus in the ammonium phosphomolybdate by either the Alkalimetric or

the Molybdenum Reduction (Emmerton) Method.

The "magnesia mixture" is prepared in the following manner: Fifty-five grams of the arrhydrous crystallized magnesium chloride, MgCl₂·6H₂O, or twenty-five grams of the anhydrous salt, are dissolved in water and filtered. Fourteen grams of ammonium chloride are dissolved in water, a little bromine water and a slight excess of ammonia are added and the solution is filtered. The two solutions are mixed, sufficient ammonia is added to give a decided odor, and enough water is added to bring the volume up to one liter. The solution is allowed to stand for several days with occasional vigorous shaking and is filtered into one or more ceresin bottles. Ten cc. of the reagent will precipitate about

0.065 gram of phosphorus.

NICKEL

W. L. SAVELL

Ni, al. wt. 58.68; sp. gr. 8.6-9.9; m. p. 1452° C.; oxides, NiO, Ni₂O₂, Ni₂O₄.

DETECTION

After bringing the sample into solution by one of the methods described under Preparation and Solution of the Sample, silica is removed, if present, in the usual manner, by evaporating the solution to dryness in the presence of an excess of hydrochloric acid, dissolving the residue and boiling with hydrochloric acid and filtering off the silica.

Hydrogen sulphide is then passed through the solution to remove the elements precipitated by this reagent. The filtrate from this precipitation is then boiled to expel the excess of hydrogen sulphide and a little nitric acid added to oxidize any ferrous iron to the ferric state. (See page 331, Separations.) Ammonium hydroxide is then added to precipitate iron, aluminum and chromium. Cobalt, nickel, manganese and zinc are precipitated from the filtrate by adding a solution of colorless ammonium sulphide or by passing hydrogen sulphide through the ammoniacal solution. Manganese and zinc are separated from the precipitate by washing with cold hydrochloric acid of about 1.035 sp.gr. A small quantity of the precipitate is fused with borax in the loop of a clean platinum wire. A green color in the cool bead indicates nickel. Fairly small quantities of cobalt interfere with this test, so if the bead is colored blue it will be necessary to make further tests for nickel.

Dimethylglyoxime will precipitate nickel as oxime from an acetic acid solution containing sodium acetate and in this manner separate it from cobalt, manganese and zinc. After precipitating iron, aluminum and chromium and filtering them off, the solution is slightly acidified with hydrochloric acid, then is neutralized with sodium hydroxide, and acidified with acetic acid. A solution of dimethylglyoxime is added, when nickel, if present, will be precipitated as a flocculent red precipitate.

Nickel may be detected in the presence of cobalt by adding a solution of sodium hydroxide to the solution of cobalt and nickel until a slight precipitate is formed, then somewhat more potassium cyanide then is necessary to redissolve the precipitate and finally two volumes of bromine water. Warm gently and allow to stand for some time. If a precipitate of nickel hydroxides separates, filter, wash and test with the borax bead.

Nickel may also be detected in the presence of cobalt by precipitating the cobalt as nitrite, as described in the chapter on cobalt, and then precipitating the nickel as hydroxide with sodium hydroxide and bromine water and testing the precipitate with the borax bead.

Alpha benzildioxime added to an ammoniacal solution of nickel precipitates an intensely red salt having the composition C₂₈H₂₂N₄O₄Ni. This precipitate is very voluminous. Silver, magnesium, chromium, manganese and zinc do not interfere with this reaction.

ESTIMATION

The determination of nickel is required, principally, in the analysis of ores, metallic nickel and its alloys, but is also required in the analysis of metallic cobalt and cobalt products as well as in a host of miscellaneous materials.

In the majority of cases the results of a nickel determination are calculated in terms of metallic nickel. Even in the determination of nickel in nickel-plating solution the results are calculated in terms of metallic nickel since this is the factor by which the solutions are controlled.

Preparation and Solution of the Sample

The materials in which nickel occurs ordinarily, may, in general, be brought into solution by treatment with acids, but in the case of some refractory ores and alloys, a fusion is required first to make the acid treatment effective. When treating ores containing sulphides or arsenides a strong oxidizing treatment is necessary to break up these compounds. Metallic nickel may be dissolved easily in nitric acid, more slowly in hydrochloric acid and still more slowly by sulphuric. Nickel alloys may be dissolved in a mixture of hydrochloric acid and nitric acid.

General Procedure for Ores. One gram of the finely powdered ore is weighed into a porcelain dish and mixed intimately with 3 grams of powdered potassium chlorate. The dish is covered with a watch-glass and 40 cc. concentrated nitric acid added slowly. The dish is allowed to stand in a cool place for a few minutes, then placed on a water bath and digested until the sample is completely decomposed, stirring the mixture frequently with a glass stirring rod, and adding a little potassium chlorate from time to time until the decomposition is complete. The watch-glass is then removed and any particles that may have spattered on it are washed back into the dish and the evaporation continued to dryness. This evaporation to dryness is repeated with the addition of 10 cc. of concentrated hydrochloric acid, and the silica dehydrated by heating for an hour or more in an air oven at 110° C. The dry residue is moistened with concentrated hydrochloric acid and the sides of the dish washed down with hot water, the mixture heated to boiling and allowed to boil for a few minutes, then withdrawn from the heat and filtered, hot, after the insoluble matter has settled.

Treat the filtrate for the removal of interfering elements as directed under Separations.

Fusion Method. The above method is used where it is desired to determine insoluble matter or "gangue." As a method of bringing the nickel in the sample into solution it is quite satisfactory and when the insoluble matter burns to a pure white ash the ignited residue may be weighed as silica, but in some cases this method does not give sufficient information regarding the composition of the gangue.

If it is necessary to make a complete analysis it is usually better to fuse the sample with the sodium and potassium carbonate mixture containing a little potassium nitrate and then treat in the usual manner to determine silica.

Potassium Bisulphate Fusion. In the treatment of nickel and cobalt oxides these are ground to a fine powder and a representative sample of 1 gram is fused with 10 grams of potassium bisulphate. This may be done in a porcelain or silica crucible or dish. The melt is extracted with water and the silica filtered off.

A small casserole has been found to be very useful for this fusion.

NICKEL 331

Solution of Metallic Nickel and Its Alloys. From 1 to 5 grams of the well-mixed drillings are treated with a minimum quantity of nitric acid and 20 cc.

1: 1 sulphuric acid added and the solution evaporated to fumes of sulphur trioxide. Allow the fuming to continue for ten minutes. Dilute carefully with a
little water and filter off the insoluble. Continue as directed in the following
detailed analyses.

It may be necessary to use a mixture of nitric and hydrochloric acids to bring certain alloys into solution, after which the procedure is the same as above.

SEPARATIONS

Separation of the Ammonium Sulphide Group, Containing Nickel from the Hydrogen Sulphide Group. Mercury, Lead, Bismuth, Copper, Cadmium, Arsenic, Antimony, Tin, Gold, Molybdenum, etc.

The hydrogen sulphide group elements are precipitated from an acid solution (HCl) by H₂S, and removed by filtration, nickel, etc., passing into the filtrate.

Separation of the Ammonium Sulphide Group from the Alkaline Earths and Alkalies. Nickel is precipitated with other members of the group by passing H₂S into its ammoniacal solution, or by adding (NH₄). Solution. The alkaline earths and alkalies are not precipitated.

Separation of Nickel from Cobalt. This procedure can be carried out in exactly the same manner as the method given for the determination of nickel by precipitation of nickel with dimethylglyoxime, since cobalt is soluble as oxime. In case more cobalt is present than nickel a larger excess of the reagent must be used. The excess of acid is best neutralized with ammonium hydroxide. If both metals are to be determined, cobalt may be determined electrolytically in the filtrate.

An alternate method is to determine the cobalt and nickel as oxides, or metal by electrolysis, together. The oxides, or plate, are dissolved in nitric acid and the nickel determined in the solution, cobalt being found by difference.

For other methods see Separation of Cobalt from Nickel, under Cobalt, page 168. Separation of Nickel from Manganese. Nickel is precipitated by dimethylglyoxime from an acetic acid solution containing sodium acetate, manganese being determined in the filtrate.

Separation of Nickel from Zinc. Zinc does not interfere in the dimethylglyoxime precipitation of nickel when ammonium salts are present. It is advisable to precipitate the nickel in a dilute acetic acid solution, thus avoiding the addition of a large amount of ammonium salts as would be necessary if the precipitation took place in an ammoniacal solution. Zinc readily remains in solution, and may be determined in the filtrate from the nickel oxime precipitate. The following procedure is recommended:

The solution containing the two metals is neutralized with ammonium hydroxide and then made just slightly acid with acetic acid and sodium acetate added. Dimethylglyoxime solution is now added to the solution, which is nearly boiling, and the procedure given for the determination of nickel by this reagent is followed.

Separation of Nickel from Iron. Nickel cannot be separated satisfactorily from iron by precipitating the latter with ammonium hydroxide, as some of the nickel is invariably occluded by the ferric hydroxide precipitate. Two modifications of the oxime method may be used.

(1) The iron, if present as a ferric salt, is converted into a complex salt by

ESTIMATION

The determination of nickel is required, principally, in the analysis of ores, metallic nickel and its alloys, but is also required in the analysis of metallic cobalt and cobalt products as well as in a host of miscellaneous materials.

In the majority of cases the results of a nickel determination are calculated in terms of metallic nickel. Even in the determination of nickel in nickel-plating solution the results are calculated in terms of metallic nickel since this is the factor by which the solutions are controlled.

Preparation and Solution of the Sample

The materials in which nickel occurs ordinarily, may, in general, be brought into solution by treatment with acids, but in the case of some refractory ores and alloys, a fusion is required first to make the acid treatment effective. When treating ores containing sulphides or arsenides a strong oxidizing treatment is necessary to break up these compounds. Metallic nickel may be dissolved easily in nitric acid, more slowly in hydrochloric acid and still more slowly by sulphuric. Nickel alloys may be dissolved in a mixture of hydrochloric acid and nitric acid.

General Procedure for Ores. One gram of the finely powdered ore is weighed into a porcelain dish and mixed intimately with 3 grams of powdered potassium chlorate. The dish is covered with a watch-glass and 40 cc. concentrated nitric acid added slowly. The dish is allowed to stand in a cool place for a few minutes, then placed on a water bath and digested until the sample is completely decomposed, stirring the mixture frequently with a glass stirring rod, and adding a little potassium chlorate from time to time until the decomposition is complete. The watch-glass is then removed and any particles that may have spattered on it are washed back into the dish and the evaporation continued to dryness. This evaporation to dryness is repeated with the addition of 10 cc. of concentrated hydrochloric acid, and the silica dehydrated by heating for an hour or more in an air oven at 110° C. The dry residue is moistened with concentrated hydrochloric acid and the sides of the dish washed down with hot water, the mixture heated to boiling and allowed to boil for a few minutes, then withdrawn from the heat and filtered, hot, after the insoluble matter has settled.

Treat the filtrate for the removal of interfering elements as directed under Separations.

Fusion Method. The above method is used where it is desired to determine insoluble matter or "gangue." As a method of bringing the nickel in the sample into solution it is quite satisfactory and when the insoluble matter burns to a pure white ash the ignited residue may be weighed as silica, but in some cases this method does not give sufficient information regarding the composition of the gangue.

If it is necessary to make a complete analysis it is usually better to fuse the sample with the sodium and potassium carbonate mixture containing a little potassium nitrate and then treat in the usual manner to determine silica.

Potassium Bisulphate Fusion. In the treatment of nickel and cobalt oxides these are ground to a fine powder and a representative sample of 1 gram is fused with 10 grams of potassium bisulphate. This may be done in a porcelain or silica crucible or dish. The melt is extracted with water and the silica filtered off.

A small casserole has been found to be very useful for this fusion.

331

Solution of Metallic Nickel and Its Alloys. From 1 to 5 grams of the well-mixed drillings are treated with a minimum quantity of nitric acid and 20 cc. 1:1 sulphuric acid added and the solution evaporated to fumes of sulphur tri-oxide. Allow the fuming to continue for ten minutes. Dilute carefully with a little water and filter off the insoluble. Continue as directed in the following detailed analyses.

It may be necessary to use a mixture of nitric and hydrochloric acids to bring certain alloys into solution, after which the procedure is the same as above.

SEPARATIONS

Separation of the Ammonium Sulphide Group, Containing Nickel from the Hydrogen Sulphide Group. Mercury, Lead, Bismuth, Copper, Cadmium, Arsenic, Antimony, Tin, Gold, Molybdenum, etc.

The hydrogen sulphide group elements are precipitated from an acid solution (HCl) by H₂S, and removed by filtration, nickel, etc., passing into the filtrate.

Separation of the Ammonium Sulphide Group from the Alkaline Earths and Alkalies. Nickel is precipitated with other members of the group by passing H₂S into its ammoniacal solution, or by adding (NH₄) S solution. The alkaline earths and alkalies are not precipitated.

Separation of Nickel from Cobalt. This procedure can be carried out in exactly the same manner as the method given for the determination of nickel by precipitation of nickel with dimethylglyoxime, since cobalt is soluble as oxime. In case more cobalt is present than nickel a larger excess of the reagent must be used. The excess of acid is best neutralized with ammonium hydroxide. If both metals are to be determined, cobalt may be determined electrolytically in the filtrate.

An alternate method is to determine the cobalt and nickel as oxides, or metal by electrolysis, together. The oxides, or plate, are dissolved in nitric acid and the nickel determined in the solution, cobalt being found by difference.

For other methods see Separation of Cobalt from Nickel, under Cobalt, page 168. Separation of Nickel from Manganese. Nickel is precipitated by dimethylglyoxime from an acetic acid solution containing sodium acetate, manganese being determined in the filtrate.

Separation of Nickel from Zinc. Zinc does not interfere in the dimethylglyoxime precipitation of nickel when ammonium salts are present. It is advisable to precipitate the nickel in a dilute acetic acid solution, thus avoiding the addition of a large amount of ammonium salts as would be necessary if the precipitation took place in an ammoniacal solution. Zinc readily remains in solution, and may be determined in the filtrate from the nickel oxime precipitate. The following procedure is recommended:

The solution containing the two metals is neutralized with ammonium hydroxide and then made just slightly acid with acetic acid and sodium acetate added. Dimethylglyoxime solution is now added to the solution, which is nearly boiling, and the procedure given for the determination of nickel by this reagent is followed.

Separation of Nickel from Iron. Nickel cannot be separated satisfactorily from iron by precipitating the latter with ammonium hydroxide, as some of the nickel is invariably occluded by the ferric hydroxide precipitate. Two modifications of the oxime method may be used.

(1) The iron, if present as a ferric salt, is converted into a complex salt by

adding from 1 to 2 grams of tartaric acid, and the solution diluted to 200 or 300 cc., boiled and the nickel precipitated as the oxime in an ammoniacal solution by the prescribed method. Iron forms no oxime under these conditions.

The iron may be precipitated from this filtrate by colorless ammonium sul-

phide and the sulphide converted to ferric oxide (Fe₂O₃) by ignition.

(2) Ferric iron is reduced to the ferrous condition by warming with sulphurous acid, in a nearly neutral solution. If the original solution has an excess of acid, it is treated with a solution of sodium hydroxide until a permanent precipitate is formed. This is dissolved with a few drops of hydrochloric acid and the iron reduced by adding from 5 to 10 ce. of a saturated solution of sulphur dioxide or by passing dioxide through the solution. The solution is diluted to 200 or 300 cc. and the solution of dimethylglyoxime added in slight excess, followed by sodium acetate until a permanent precipitate of nickel oxime is formed. After adding 2 grams more of sodium acetate the solution is filtered immediately. The iron is precipitated from the filtrate by oxidizing with bromine water and adding ammonium hydroxide to precipitate the basic acetate of iron.

Procedure (1) is suitable for the determination of nickel in iron and steel.

Separation of Nickel from Aluminum. This method is the same as procedure (1) given above.

Separation of Nickel from Chromium. This separation cannot be carried out in an acetic acid solution. From 1 to 2 grams of tartaric acid are added and from 5 to 10 cc. of a 10% ammonium chloride solution, subsequently. The solution is made ammoniacal, but no precipitate should form. If the solution becomes cloudy, it is acidified with hydrochloric acid and additional ammonium chloride added and again made ammoniacal and the nickel precipitated as oxime according to directions given from this precipitation.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF NICKEL

Precipitation of Nickel by Alpha Benzildioxime

The alcoholic solution of alpha benzildioxime gives an intensely red precipitate of C23H22N4O4Ni, when added to ammoniacal solutions containing nickel. The reaction is more characteristic for nickel than is that with dimethylglyoxime and is more delicate. In a volume of 5 cc. (according to F. H. Atack), 1 part of nickel in 2,000,000 parts of water may be detected. In the presence of 100 times as much as cobalt only a faint yellow color is produced by the cobalt. One part of nickel per million of water will cause precipitation with the compound, whereas no precipitate is formed with dimethylglyoxime under the same conditions. With glyoxime iron produces a pink color, with alpha benzildioxime ferrous salts give a faint violet color, hence do not interfere in the detection of nickel. Silver, magnesium, chromium, manganese, and zinc do not interfere. Since the nickel precipitate with this reagent is exceedingly voluminous it is advisable to have not more than 0.025 gram of nickel in the solution in which the nickel is being determined. The method is adapted to the detection and determination of minute traces of the element up to small amounts of less than 10% nickel.

NICKEL 333

Reagent, Alpha Benzilaioxime. This may be prepared by boiling 10 grams of benzil (not necessarily pure) with 8 to 10 grams of hydroxylamine hydrochloride in methyl alcohol solution. After boiling for three hours the precipitate is filtered off and dried, washed with hot water and then with a small amount of 50% alcohol, and dried. This dried precipitate consists of pure benzildioxime (m.p. 237° C.). A further yield may be obtained by boiling the filtrate with hydroxylamine hydrochloride. The reagent is prepared by dissolving 0.2 gram of the salt per liter of alcohol to which is added ammonium hydroxide to make 5% solution, sp.gr. 0.96 (50 cc. per liter).

Procedure. A slight excess of the warmed solution of the above reagent is stirred into the ammoniacal solution containing nickel and the whole heated on the water bath for a few moments to coagulate the precipitate. Quantitative precipitation is complete after one minute. The liquid is filtered through a Gooch crucible, with suction, or onto a filter paper, for which a counterpoise has been selected. The counterpoise paper is treated in exactly the same manner as the one containing the precipitate. The precipitate is washed with 50% alcohol, followed by hot water, and is then dried at 110° C. In weighing the precipitate the counterpoise filter is placed in the weight pan of the balance. precipitate contains 10.93\% nickel. Weight of C₂₂H₂₂N₄O₄Ni×0.1093 = Ni.

Acetone may be used instead of alcohol as a solvent of the reagent.

compound is more soluble in acctone than in alcohol.

The precipitate does not pass through the filter as does the compound with dimethyl-

glyoxime.

The method is affected by the presence of nitrates, hence these must be removed by evaporation of the solution with sulphuric acid to fumes, before the addition of the reagent to the nickel solution.

In the presence of cobalt an excess of the reagent must be used, as in the case of

the dimethylglyoxime precipitation.

In the presence of iron and chromium Rochelle salt, sodium citrate or tartaric acid are added to prevent precipitation of the hydroxides of these metals upon making the solution alkaline.

In the presence of manganese a fairly large excess of the reagent is required, the

solution being slightly acid with acetic acid.

Zinc and magnesium are kept in solution by addition of ammonium chloride.

Large amounts of copper must be removed by precipitating with hydrogen sul-

phide before addition of the reagent.

The nickel salt with the reagent forms an extremely voluminous precipitate so that a concentration of 0.09 gram of nickel per 250 cc. is as high as is desirable. The process is applicable to the determination of nickel in the filtrate obtained in the separation of zinc after the removal of the hydrogen sulphide, formic acid, etc.

Method by F. W. Atack, The Analyst, 38, 448, 318. Cockburn, Gardiner and Black, Analyst, 38, 439, 443.

Precipitation of Nickel by Dimethylglyoxime

Preliminary Considerations. This method has been demonstrated by O. Brunck to be the most accurate and expeditious procedure known for nickel.1 By this method 1 part of nickel may be detected when mixed with 5000 parts of cobalt or 1 part of nickel may be detected in 400,000 parts of water. The nickel precipitate with this reagent is almost completely insoluble in water and is only very slightly soluble in acetic acid, but is easily decomposed by strongly dissociated acids, so that the precipitation is incomplete in neutral solutions of nickel chloride, sulphate or nitrate. If, however, the free acid formed is neutral-

¹Zeit. f. ang. Chem., 20, 1844.

adding from 1 to 2 grams of tartaric acid, and the solution diluted to 200 or 300 cc., boiled and the nickel precipitated as the oxime in an ammoniacal solution by the prescribed method. Iron forms no oxime under these conditions.

The iron may be precipitated from this filtrate by colorless ammonium sul-

phide and the sulphide converted to ferric oxide (Fe₂O₂) by ignition.

(2) Ferric iron is reduced to the ferrous condition by warming with sulphurous acid, in a nearly neutral solution. If the original solution has an excess of acid, it is treated with a solution of sodium hydroxide until a permanent precipitate is formed. This is dissolved with a few drops of hydrochloric acid and the iron reduced by adding from 5 to 10 ee. of a saturated solution of sulphur dioxide or by passing dioxide through the solution. The solution is diluted to 200 or 300 cc. and the solution of dimethylglyoxime added in slight excess, followed by sodium acetate until a permanent precipitate of nickel oxime is formed. After adding 2 grams more of sodium acetate the solution is filtered immediately. The iron is precipitated from the filtrate by oxidizing with bromine water and adding ammonium hydroxide to precipitate the basic acetate of iron.

Procedure (1) is suitable for the determination of nickel in iron and steel.

Separation of Nickel from Aluminum. This method is the same as procedure (1) given above.

Separation of Nickel from Chromium. This separation cannot be carried out in an acetic acid solution. From 1 to 2 grams of tartaric acid are added and from 5 to 10 cc. of a 10% ammonium chloride solution, subsequently. The solution is made ammoniacal, but no precipitate should form. If the solution becomes cloudy, it is acidified with hydrochloric acid and additional ammonium chloride added and again made ammoniacal and the nickel precipitated as oxime according to directions given from this precipitation.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF NICKEL

Precipitation of Nickel by Alpha Benzildioxime

The alcoholic solution of alpha benzildioxime gives an intensely red precipitate of C22H22N4O4Ni, when added to ammoniacal solutions containing nickel. The reaction is more characteristic for nickel than is that with dimethylglyoxime and is more delicate. In a volume of 5 cc. (according to F. H. Atack), 1 part of nickel in 2,000,000 parts of water may be detected. In the presence of 100 times as much as cobalt only a faint yellow color is produced by the cobalt. One part of nickel per million of water will cause precipitation with the compound, whereas no precipitate is formed with dimethylglyoxime under the same conditions. With glyoxime iron produces a pink color, with alpha benzildioxime ferrous salts give a faint violet color, hence do not interfere in the detection of nickel. Silver, magnesium, chromium, manganese, and zinc do not interfere. Since the nickel precipitate with this reagent is exceedingly voluminous it is advisable to have not more than 0.025 gram of nickel in the solution in which the nickel is being determined. The method is adapted to the detection and determination of minute traces of the element up to small amounts of less than 10% nickel.

NICKEL 333

Reagent, Alpha Benzilatoxime. This may be prepared by boiling 10 grams of benzil (not necessarily pure) with 8 to 10 grams of hydroxylamine hydrochloride in methyl alcohol solution. After boiling for three hours the precipitate is filtered off and dried, washed with hot water and then with a small amount of 50% alcohol, and dried. This dried precipitate consists of pure benzildioxime (m.p. 237° C.). A further yield may be obtained by boiling the filtrate with hydroxylamine hydrochloride. The reagent is prepared by dissolving 0.2 gram of the salt per liter of alcohol to which is added ammonium hydroxide to make 5% solution, sp.gr. 0.96 (50 cc. per liter).

Procedure. A slight excess of the warmed solution of the above reagent is stirred into the ammoniacal solution containing nickel and the whole heated on the water bath for a few moments to coagulate the precipitate. Quantitative precipitation is complete after one minute. The liquid is filtered through a Gooch crucible, with suction, or onto a filter paper, for which a counterpoise has been selected. The counterpoise paper is treated in exactly the same manner as the one containing the precipitate. The precipitate is washed with 50% alcohol, followed by hot water, and is then dried at 110° C. In weighing the precipitate the counterpoise filter is placed in the weight pan of the balance. precipitate contains 10.93\% nickel. Weight of C₂₂H₂₂N₄O₄Ni×0.1093 = Ni.

Acetone may be used instead of alcohol as a solvent of the reagent. The

compound is more soluble in acetone than in alcohol.

The precipitate does not pass through the filter as does the compound with dimethyl-

glyoxime.

The method is affected by the presence of nitrates, hence these must be removed by evaporation of the solution with sulphuric acid to fumes, before the addition of the reagent to the nickel solution.

In the presence of cobalt an excess of the reagent must be used, as in the case of

the dimethylglyoxime precipitation.

In the presence of iron and chromium Rochelle salt, sodium citrate or tartaric acid are added to prevent precipitation of the hydroxides of these metals upon making the solution alkaline.

In the presence of manganese a fairly large excess of the reagent is required, the

solution being slightly acid with acetic acid.

Zinc and magnesium are kept in solution by addition of ammonium chloride.

Large amounts of copper must be removed by precipitating with hydrogen sulphide before addition of the reagent.

The nickel salt with the reagent forms an extremely voluminous precipitate so that a concentration of 0.09 gram of nickel per 250 cc. is as high as is desirable. The process is applicable to the determination of nickel in the filtrate obtained in the separation of zinc after the removal of the hydrogen sulphide, formic acid, etc.

Method by F. W. Atack, The Analyst, 38, 448, 318. Cockburn, Gardiner and Black, Analyst, 38, 439, 443.

Precipitation of Nickel by Dimethylglyoxime

Preliminary Considerations. This method has been demonstrated by O. Brunck to be the most accurate and expeditious procedure known for nickel.1 By this method 1 part of nickel may be detected when mixed with 5000 parts of cobalt or 1 part of nickel may be detected in 400,000 parts of water. The nickel precipitate with this reagent is almost completely insoluble in water and is only very slightly soluble in acetic acid, but is easily decomposed by strongly dissociated acids, so that the precipitation is incomplete in neutral solutions of nickel chloride, sulphate or nitrate. If, however, the free acid formed is neutral334 NICKEL

ized with sodium, potassium or ammonium hydroxides or by addition of the acetate salts of these bases, nickel will be completely precipitated, not even a trace being found in the filtrate.

"The quantitative determination of nickel in the presence of other metals is a simple operation. The nickel should be in the form of a convenient salt.

"The concentration of the solution does not matter; the precipitation can take place either in a solution of the greatest concentration, or in a very dilute solution. The reaction is not hindered by the presence of ammonium salts."

Iron, aluminum, chromium, cobalt, manganese and zinc do not interfere. Theoretically 4 parts of dimethylglyoxime, added as a 1% alcoholic solution, are necessary; a certain excess does no harm provided the alcohol volume does not exceed more than half that of the water solution containing the nickel salt, as alcohol has a solvent action on the oxime. The compound is very stable and volatilizes undecomposed at 250° C.

An excess of ammonium hydroxide is also to be avoided in the solution in which the precipitation takes place.

It has been observed that the precipitate of nickel with dimethylglyoxime may be safely ignited to the oxide NiO without loss, if the filter is first carefully charred without allowing it to take fire, then gradually heated to redness.

Procedure. Such an amount of the sample should be taken that the nickel be not over 0.1 gram, as glyoxime of nickel is very voluminous and a larger amount would be difficult to filter. If cobalt is present it should not exceed 0.1 gram in the sample taken.

If hydrogen sulphide has been used to precipitate members of the second group, it is expelled by boiling the acid solution and the volume brought to 250 cc.

One or 2 grams of tartaric acid are added to prevent the precipitation of the hydroxides of iron, aluminum and chromium by ammonium hydroxide (this treatment is omitted if these are absent), and 5 to 10 cc. of a 10% solution of ammonium chloride added to keep zinc and manganese in solution, should they be present. Ammonium hydroxide is now added until the solution is slightly alkaline. If a precipitate forms, ammonium chloride is added to clear the solution, followed by ammonium hydroxide to neutralize the acid. The solution should remain clear after this treatment, otherwise the ammonium chloride is added in solution or as salt until the solution of the sample will remain clear. It is then heated to nearly boiling and the alcoholic solution of dimethylglyoxime added until the reagent is approximately seven times, by weight, the weight of nickel present. Ammonium hydroxide is now added until the solution has a distinct odor of this reagent. The precipitation of the scarlet red nickel salt is hastened by stirring. It is advisable to place the mixture on the steam bath for fifteen to twenty minutes to allow the reaction to go to completion before filter-The precipitate is filtered off, into a platinum sponge Gooch crucible, sometimes known as a Neubauer Gooch crucible. (Other forms of Gooch crucible are used for this purpose, but the Neubauer crucible has been found to be most satisfactory.) The precipitate is dried for about two hours at 110 to 120° C. and weighed as C₈H₁₄N₄O₄Ni, which contains 20.32% Ni.

Weight of precipitate multiplied by 0.2032 = weight of nickel.

¹ If the sample contains more than 0.1 gram of cobalt, a large excess of ammonium hydroxide and dimethylglyoxime is necessary to prevent its precipitation, hence it is advisable to take such weights of samples that the cobalt content will be less than this weight.

NICKEL 335

In place of a Gooch crucible a tared filter paper may be used. It must be remembered, however, that a blank filter paper of the same kind as used for the precipitate must be used as a counterbalance, after treating in exactly the same manner as the one containing the precipitate. This is necessary because it has been found that filter paper loses weight during washing and drying.

Precipitation of Nickel by Electrolysis 1

This precipitation is conducted in exactly the same manner as the one described under Cobalt for the Precipitation of Cobalt by Electrolysis, and requires that the same precautions be exercised in the practice of the method.

In the presence of cobalt the two elements may be determined together by electrolysis as described below and the deposited metal redissolved and the two elements separated by one of the methods given under Cobalt or Nickel.

Procedure. After the sample has been brought into solution by one of the methods outlined under Preparation and Solution of the Sample, the solution is evaporated with 20 cc. of 1:1 sulphuric acid for every gram of metal in the sample. The evaporation is continued until the solution has fumed strongly for ten minutes. Cool carefully and dilute with 20 cc. of water. Heat the solution to nearly boiling and pass hydrogen sulphide for one hour to precipitate members of the second group. This long treatment is necessary to insure complete precipitation of arsenic. Filter and boil to expel hydrogen sulphide. Add 5 cc. nitric acid to insure oxidation of iron compounds to the ferric state and add ammonium hydroxide until just slightly alkaline. Filter off the ferric hydroxide and wash with water containing a small quantity of ammonium hydroxide. To recover occluded nickel dissolve the precipitate in hydrochloric acid and reprecipitate the iron with addition of a little hydrogen peroxide. Combine the filtrates. Evaporate to about 250 cc. and add 50 cc. of strong ammonium hydroxide and electrolyze as described under Cobalt, page 170.

The increase in weight of the electrode is the weight of cobalt and nickel in the sample. The percentage of cobalt and nickel in the sample is found by multiplying the increase in weight of the electrode by 100 and dividing by the weight of the sample.

NOTE. The deposition of cobalt and nickel by the above method has been found to be the most accurate of the electrolytic methods. In the solutions containing the organic acids there is always more or less carbide deposited on the cathode with the metal. This causes high results.

Nickel in Metallic Nickel

This determination may be made in the manner described under Precipitation of Nickel by Electrolysis, separating cobalt before or after the electrolysis or by the method described under Precipitation of Nickel by Dimethylglyoxime. The latter method is recommended.

Nickel in Cobalt and Cobalt Oxide

The dimethylglyoxime precipitation is used in combination with the electrolytic precipitation. See chapter on Cobalt.

¹ W. J. Marsh, J. Phys. Chem., 18, 705-16, 1914.

336 NICKEL

VOLUMETRIC DETERMINATION OF NICKEL Determination of Nickel in Alloys

This method, as described by S. W. Parr and J. M. Lindgren, consists of a modification of the dimethylgloxime method. The precipitation takes place in the usual manner and the precipitate is dissolved in sulphuric acid and the excess titrated with a standard solution of potassium hydroxide.

Procedure. The alloy is dissolved in nitric or hydrochloric acids and if iron, aluminum or chromium are present twice their weight of tartaric acid is added to prevent their precipitation. If chromium is present ammonium chloride is also added. If manganese or zinc is present hydrochloric acid should be used and most of the free acid evaporated. Add a few cc. of hydrogen peroxide to oxidize any ferrous iron to the ferric state. Dilute to 300 or 400 cc. and neutralize the free acid by sodium acetate. Heat the solution to nearly boiling and add five times as much dimethylglyoxime, in 1% alcoholic solution, as the nickel present. Then completely neutralize with ammonium hydroxide, using a very slight excess (or the solution may be neutralized with sodium acetate). Heat until all the nickel is precipitated. Filter and wash. Place the precipitate and filter in a beaker, add an excess of 0.05N sulphuric acid, dilute to 200 cc., heat until solution is complete and titrate back with 0.1N potassium hydroxide solution, taking the first faint yellowish tinge as the end-point. The solutions are standardized against pure nickel.

NOTE. Cobalt should not exceed 0.1 gram per 100 cc. and an excess should be used of the dimethylglyoxime.

Nickel in Nickel-plating Solutions

In most cases it is quite unnecessary to separate the cobalt from the nickel in making this determination and, as the principal impurity is usually iron, the post practice is to follow the method given under Precipitation of Cobalt by Electrolysis, page 170.

If chlorides or organic matter are present in the solution the preparation of the solution for electrolysis is accomplished in the following manner:

From the well-stirred solution in the plating tank, withdraw about 200 cc. and place in a small beaker. Prepare a 100-cc. burette by thoroughly cleaning it with the sulphuric acid and potassium bichromate mixture and distilled water. Wash finally with a few cc. of the nickel solution and fill the burette with the solution from the plating tank.

Run 66.7 cc. into an evaporating dish and add 2 cc. 1:1 sulphuric acid. Evaporate to fumes of sulphur trioxide and allow to fume strongly for ten minutes. Dissolve in a little water. Dilute to 200 cc. carefully, neutralize with a solution of ammonium hydroxide and add 50 cc. of strong ammonium hydroxide and electrolyze. (See Precipitation of Cobalt by Electrolysis.)

The increase in weight of the cathode in grams multiplied by 2 gives the weight in ounces of nickel in one United States gallon of the plating solution.

¹ S. W. Parr and J. M. Lindgren, Trans. Am. Brass Founders' Assoc., 5, 120-9.

NICKEL 336a

Potassium Cyanide Method for Nickel¹

The method is rapid and accurate and is especially adapted for determining nickel in steel. Iron, manganese, chromium, zinc, vanadium, molybdenum and tungsten do not interfere. Copper, however, should be removed if present. The method depends upon the selective action of potassium cyanide for nickel in preference to silver iodide, used as an indicator, the reactions taking place as indicated, the solution being slightly alkaline with ammonia—

(a) $Ni(NH_3)_6SO_4 + 4KCN = K_2Ni(CN)_4 + K_2SO_4 + 6NH_3$

(b) $AgI + 2KCN = KAg(CN)_2 + KI$ (N.B. $4KCN \approx Ni$) (N.B. $2KCN \approx Ag$)

Reagents.

N/10 Silver Nitrate.—10.188 grams of pure silver are dissolved in nitric acid and made to 1000 cc. or 16.99 g. of the silver nitrate salt. (See Index for reagent.) 1 cc. ≈ 0.01302 g. KCN.

If preferred the reagent may be made to be equivalent to about 0.001 gram Ni per cc. by dissolving 5.85 grams of AgNO₃ per liter.

Potassium Iodide.—25% solution.

N/10 Potassium Cyanide.—13.5 grams of pure KCN are dissolved in water, 5 grams of KOH added and the solution made to 1000 cc.

The cyanide solution is standardized against the silver nitrate solution.

If it is desired to have a solution equivalent to 0.001 g. Ni, 5 grams of KCN

per liter is the approximate strength required.

Standardization of the Cyanide.—Fifty cc. of the KCN solution are diluted to about 150 cc., 5 cc. of the KI reagent added and the solution titrated with the standard AgNO₂ reagent until a faint permanent opalescence is obtained. A drop of the KCN solution should be sufficient to clear this. Note the number of cc. required and calculate the normality factor of the cyanide in terms of the silver nitrate reagent.

Example.—Suppose 49 cc. of the silver nitrate reagent were required for the 50 cc. of the cyanide solution, then the normality would be $49 \div 50 \times N/10$ or 0.98 N/10.

1 cc. N/10 solution is equivalent to 0.002934 gram nickel.

The reagent may be standardized against a nickel steel of the U.S. Bureau of Standards, following the procedure given below and calculating as follows:

Nickel factor = $\frac{\text{Gram Ni in standard taken}}{(\text{cc. KCN required}) - (\text{cc. KCN equivalent to 5 cc. AgNO}_3)}$

Citric Solution.—200 grams of (NH₄)₂SO₄, 150 cc. concentrated NH₄OH and 120 grams of citric acid per 1000 cc.

Procedure.1

One gram of the steel drillings or such an amount of material as contains not over 0.1 g. Ni, is dissolved in a beaker with 20 cc. of hydrochloric acid (1:1). When action ceases 10 cc. of nitric acid (1:1) are added and the solution boiled until the red nitrous acid fumes are driven off.

About 100 cc. of the citrate solution are added. If 2 per cent. or more of chromium is present the amount of citrate solution is doubled. The solution is now diluted to about 250 cc.

Exactly 5 cc. of the standard silver nitrate solution are now added from a pipette or burette, and then ammonium hydroxide, drop by drop, until the cloudiness caused by the silver chloride just disappears. Two cc. of the potassium iodide solution are now added.

The solution is titrated with the standard potassium cyanide solution with constant stirring until the turbidity just disappears. The end point is reached when there is no longer a distinction in clearness of the drop of the reagent and its surrounding liquid to which it is added.

If the end point is passed, a measured amount of silver nitrate (5-10 cc.)

is added and the cyanide titration repeated.

Calculation.—Deduct the cc. KCN equivalent of the total silver nitrate solution used from the total cc. of the KCN solution required in the titration. The remainder is the potassium cyanide required by the nickel.

The cc. KCN required by Ni multiplied by the factor for Ni = gram nickel

in the sample.

- 1. A large excess of ammonia is to be avoided as the AgI is soluble in a large excess.
 - 2. The presence of sulphates increases the sensibility of the end point.
- 3. The silver nitrate solution should not be stronger than that indicated in the method as there is danger of the iodide of silver settling out as a curdy precipitate in stronger solutions.
- 4. A white film is apt to form on the surface of the liquid if exposed to the air for some time. This produces no error.

REFERENCES.

Griffin, "Technical Methods of Analysis."
Low "Technical Methods of Ore Analysis."
Johnson, "Chemical Analysis of Special Steels, Alloys and Graphites."
Jamieson, J. Am. Chem. Soc. XXXII, 757.
Boyle, Chem. Eng. XIV, 228.

NITROGEN

WILFRED W. SCOTT

Element. N_1 , at.wt. 14.01; D. (air) 0.9674; m.p. -210° ; b.p. -195.5° C.; oxides, N_1O_1 , N_2O_2 , N_2O_3 , N_2O_4 , N_2O_4 , N_2O_5 .

Ammonia. NH₁, m.w. 17.03; D. (air) 0.5971; sp.gr. liquid 0.6234; m.p. -77.3°; b.p. -38.5° C. Crit. temp. 130°; liquid at 0° with 4.2 atmospheres pressure. Commercial 28% NH₁, sp.gr. 0.90.

Nitric Acid. HNO₃, m.w., 63.02; sp.gr. 1.53; m.p. -41.3; b.p. 86° C. Boiling-point of commercial 95% acid is a little above 86° , but gradually rises to 126° and the strength of acid falls to 68.9%, sp.gr. is then 1.42. The acid now remains constant, the distillate being of the same strength.

DETECTION

Element. Organic Nitrogen. Organic matter is decomposed by heating in a Kjeldahl flask with concentrated sulphuric acid as described under preparation and solution of the sample. Ammonia may now be liberated from the sulphate and so detected.

Nitrogen in Gas. Recognized by its inertness towards the reagents used in gas analysis. The element may be recognized by means of the spectroscope.

Ammonia. Free ammonia is readily recognized by its characteristic odor. A glass rod dipped in *hydrochloric acid* and held in fumes of ammonia produces a white cloud of ammonium chloride, NH₄Cl.

Moist red litmus paper is turned blue by ammonia. Upon heating the paper the red color is restored, upon volatilization of ammonia (distinction from fixed alkalies).

Nessler's Test.¹ Nessler's reagent added to a solution containing ammonia, combined or free, produces a brown precipitate, NHg₂I·H₂O. If the ammoniacal solution is sufficiently dilute a yellow or reddish-brown color is produced, according to the amount of ammonia present. The reaction is used in determining ammonia in water.

Salts of ammonia are decomposed by heating their solutions with a strong base such as the hydroxides of the fixed alkalies or the alkaline earths. The odor of ammonia may now be detected.

Nitric Acid. Ferrous Sulphate Test. About 1 to 2 cc. of the concentrated solution of the substance is added to 15 to 20 cc. of strong sulphuric acid in a test-tube. After cooling the mixture, the test-tube is inclined and an equal volume of a saturated solution of ferrous sulphate is allowed to flow slowly down over the surface of the acid. The tube is now held upright and gently tapped. In the presence of nitric acid a brown ring forms at the junction of the two solutions.

¹The reagent is made by dissolving 20 grams of potassium iodide in 50 cc. of water, adding 32 grams of mercuric iodide and diluting to 200 cc. To this is added a solution of potassium hydroxide—134 grams KOH per 260 cc. H₂O.

The test for nitrate may be made according to the quantitative procedure given for determining of nitric acid (see later). It should be remembered that ferrous sulphate should be present in excess, otherwise the brown color is destroyed by the free nitric acid. Traces of nitric acid in sulphuric produce a pink color with the sulphuric acid solution of ferrous sulphate. (See Determination of Nitric Acid—Ferrous Sulphate Method.)

Ferro- and ferricyanides, chlorates, bromides and bromates, iodides and

iodates, chromates and permanganates interfere.

Diphenylamine Tests for Nitrates. (C₀H₀)₂NH dissolved in sulphuric acid is added to 2 or 3 cc. of the substance in solution on a watch-glass. Upon gently warming a blue color is produced in presence of nitrates. Nitric acid in sulphuric acid is detected by placing a crystal of diphenylamine in 3 or 4 cc. of the acid and gently warming. Cl', Cl^v, Br^v, I^v, Mn^{vii}, Cr^{vi}, Se^{vi}, Fe''' interfere.

Copper placed in a solution containing nitric acid liberates brown fumes.

Phenolsulphonic Acid Test. See chapter on Water Analysis.

Detection of Nitrous Acid. Acetic Acid Test. Acetic acid added to a nitrite in a test-tube (inclined as directed in the nitric acid test with ferrous sulphate), produces a brown ring. Nitrates do not give this. If potassium iodide is present in the solution, free iodine is liberated. The free iodine is absorbed by chloroform, carbon tetrachloride or disulphide, these reagents being colored pink. Starch solution is colored blue.

Nitrous acid reduces iodic acid to iodine. The iodine is then detected with

starch, or by carbon disulphide, or carbon tetrachloride.

Potassium Permanganate Test. A solution of the reagent acidified with sulphuric acid is decolorized by nitrous acid or nitrite. The test serves to detect nitrous acid in nitric acid. Other reducing substances must be absent.

ESTIMATION

Occurrence. Element. Free in air to extent of 78% + by volume and 76% - by weight.

Air weight of 1 liter = 1.293 grams. With oxygen as 32, air = 28.95.

Composition of Air. On the Basis of 1000 Liters of Atmosphere

Element.	Liters per	Weight per	Per cent by	Per cent by
	1000 l.	1000 l. grams	Vol.	Wt.
Nitrogen Oxygen Argon Carbon dioxide Hydrogen Neon Helium Krypton Xenon	209.9 9.4 0.3 0.1 0.015 0.0015 0.00005	975.80 299.84 16.76 0.59 0.01 0.01027 0.00027 0.00018 0.00003	78 1 21.0 0.9 0.04	75.47 — 23.19 — 1.296 + 0.045

Water-saturated air contains 2.4 grams H_2O at -10° ; 4.9 grams at 0° ; 17.2 grams at 20° and 55 grams H_2O at 40° C. Ordinarily 50 to 70% of this is present.

Nitrogen is found combined in nature as potassium nitrate (saltpeter), KNO₂; sodium nitrate (Chili saltpeter), NaNO₂, and to a less extent as calcium nitrate,

Ca(NO₃)₂. It occurs in plants and in animals, in the substances proteids, blood, muscle, nerve substance, in fossil plants (coal), in guano, ammonia and ammonium salts.

Free nitrogen is estimated in the complete analysis of gas mixtures. In illuminating gas the other constituents are removed by combustion and absorption and the residual gas measured as nitrogen.

Total nitrogen in organic substances is best determined by decomposition of the materials with sulphuric acid as described later, and estimating the nitrogen from the ammonia formed.

Combined nitrogen in the form of ammonia and nitric acid specially concerns the analyst. In the evaluation of fertilizers, feedstuffs, hay, fodders, grain, etc., the nitrogen is estimated after conversion to ammonia. Ammonia, nitrates and nitrites may be required in an analysis of sewages, water, and soils. Nitric acid is determined in Chili saltpeter, in the evaluation of this material for the manufacture of nitric acid or a fertilizer, the nitrate being reduced to ammonia and thus estimated.

We will take up a few of the characteristic substances in which nitrogen estimations are required, e.g., in organic substances as proteids, in soils and fertilizers; in ammonium salts, nitrates, and nitrites, free ammonia in ammoniacal liquors, nitric acid in the evaluation of the commercial acid and in mixed acids.

In general nitrogen is more accurately and easily measured as ammonia, to which form it is converted by reduction methods. Large amounts are determined by titration, whereas small amounts are estimated colorimetrically. Nitric acid and nitrates may be determined by direct titration by the Ferrous Sulphate Method outlined later. The procedure is of value in estimation of nitrates in mixed acids. The nitrometer method for determining nitrates (including nitrites), and the free acid in mixed acids, is generally used by manufacturers of explosives.

Preparation of the Sample

It will be recalled that compounds of ammonia and of nitric acid are generally soluble in water. All nitrogen compounds, however, are not included. Among those which are not readily soluble the following deserve mention: compounds of nitrogen in many organic substances; nitrogen bromophosphide, NPBr₂; nitrogen selenide, NSe; nitrogen sulphide, N₂S₆; ammonium antimonate, NH₆SbO₃·2H₂O; ammonium iodate, HN₄IO₂ (2.6 grams per 100 cc. H₂O); ammonium chlorplatinate, (NH₄)₂PtCl₆ (0.67 gram); ammonium chloriridate, (NH₄)₂IrCl₆ (0.7 gram); ammonium oxalate, (NH₄)₂C₂O₄·H₂O (4.2 grams); ammonium phosphomolybdate, (NH₄)₂PO₄·12MoO₃ (0.03 gram); nitron nitrate, C₂₀H₁₆N₄·HNO₃.

Organic Substances

By oxidation of nitrogenous organic substances with concentrated sulphuric acid, containing mercuric oxide, or potassium permanganate, the organic matter is destroyed and the nitrogen is changed to ammonia, which is held by the sulphuric acid as sulphate. Nitrates are reduced by addition of salicylic acid, zinc dust, etc., previous to the oxidation process. Practically all the procedures are based on the Kjeldahl method of acid digestion. The modification, commonly known as the Kjeldahl-Gunning-Arnold Method, is as follows:

Method in Absence of Nitrates. Weight of Sample. Fertilizers 0.7 to 3.5 grams. Soils 7 to 14 grams. Meat and meat products 2 grams. Milk 5 grams. The amount of the substance to be taken should be governed by its nitrogen content.1

Acid Digestion.2 The material is placed in a Kjeldahl flask of about 550 cc. capacity. Approximately 0.7 gram of mercuric oxide or an equivalent amount

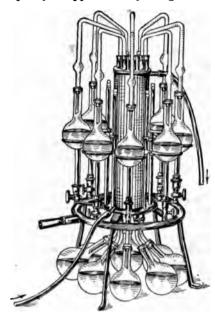


Fig. 50. Apparatus for Determining Nitrogen.

of metallic mercury together with 10 grams of powdered potassium sulphate followed by 20 to 30 cc. of concentrated sulphuric acid (sp.gr. 1.84) are added. The flask is placed in an inclined position, resting in a large circular opening of an asbestos board. The flask is heated with a small flame until the frothing has ceased. (A piece of paraffin may be added to prevent extreme frothing.) The heat is then raised and the acid brought to brisk boiling, the heating being continued until the solution becomes a pale straw color, or practically water white. (In case of leather, scrap, cheese, milk products, etc., a more prolonged digestion may be required. With a good flame from one-half to one hour of acid digestion is generally sufficient to completely decompose the material.) The flask is now reployed from the flame and after cooling the solution is diluted with about 200 cc. of water and a few pieces of granulated zinc added to prevent "bumping" (50 mg. or so of No. 80 granulated zinc). The solution is now alkalized strongly by addition of a

mixture of sodium hydroxide and sodium sulphide solution (about 75 cc. of a mixture containing 25 grams of NaOH and 1 gram Na₂S). Phenolphthaleinindicator added to the solution will show when the acid is neutralized. The flask is connected by means of a Hopkins distillation tube (Fig. 53) to a condenser and about 150 cc. of the solution distilled into an excess of standard sulphuric acid and the excess of the acid determined by titration with standard sodium hydroxide. (Methyl red indicator.)

The ammonia may be absorbed in a saturated solution of boric acid and titrated directly with standard acid. (Methyl orange indicator.)

One cc. N/10 $H_2SO_4 = 0.001704$ gram NH₃.

¹See data of approximate nitrogen content in certain nitrogenous substances, Jour. Ind. Eng. Chem., 7, 357, 1915.
 Fig. 50 shows a compact apparatus with several sets of flasks and condensers,

which enable half a dozen or more determinations to be made at one time.

³ L. W. Winkler, Z. angew. Chem., 27, 1, 630-2, 1914. E. Bernard, ibid., 27, 1, 664, 1914.

In Presence of Nitrates. The procedure differs from the former in the preliminary treatment to reduce the nitrates. The material in the flask is treated with a mixture of 30 to 35 cc. of strong sulphuric acid containing 1 gram of salicylic acid and the mixture shaken and allowed to stand for five to ten minutes with frequent agitation. About 5 grams of sodium thiosulphate are now added and the solution heated for five minutes. After cooling, mercuric oxide or metallic mercury and potassium sulphate are added, and the solution treated as directed above.

NOTES. Mercuric oxide or metallic mercury are added as a catalyzer to assist the oxidation of the organic matter. The digestion process is shortened considerably by its use. In place of mercuric oxide or the metal, copper sulphate may be used. In this case the addition of sodium sulphide is omitted. Copper sulphate acts as an indicator in the neutralization of the sample with caustic.

Potassium sulphide is added to remove the mercury from the solution and prevent the formation of mercur-ammonium compounds, which are not completely decomposed

by sodium hydroxide.

Ferric chloride, FeCl₂, may be used in place of copper or mercury salts or oxides to assist in the oxidation of organic matter.

Soils. Available Nitrates. Five hundred to 1000 grams of the air-dried soil is extracted with 1 to 2 liters of water containing 10 to 20 grams of dextrose. Fifteen to twenty hours of leaching is sufficient. An aliquot portion is taken for analysis.

Ammonium Salts. The sample is placed in the distillation flask with splash bulb as described in the modified Kjeldahl procedure for organic substances, and the material decomposed with ammonia-free caustic solution. The ammonia is distilled into an excess of standard acid or a saturated solution of boric acid (neutral to methyl orange), and the ammonia determined as usual, either by titration of the excess of acid, or by direct titration with acid, according to the absorbent used.

Nitrates. The sample, broken down as fine as possible, is dissolved in water, decomposed with Devarda alloy and distilled as described by the modified Devarda methods given later.

Nitrites. The material, dissolved in water, is titrated with standard permanganate solution according to the procedure described later.

Mixtures of Ammonium Salts, Nitrates, and Nitrites. Ammonia is determined by distillation with caustic as usual. The nitrite is titrated with permanganate. Total nitrogen is determined by the modified Devarda methods. Nitric acid is now estimated by difference, e.g., from the total nitrogen is deducted the nitrogen due to ammonia together with the nitrogen of the nitrite and the difference calculated to the nitrate desired. The nitrate may be determined in presence of nitrite and ammonia by direct titration with ferrous sulphate. The detailed procedures may be found under the Volumetric Methods.

Nitric Acid in Mixed Acid. This is best determined by the ferrous sulphate method for nitric acid. The nitrometer method is also excellent.

SEPARATIONS

Ammonia. No special separation need be considered in the determination of ammonia. The general method has already been mentioned by which ammonia is liberated from its salts by a strong base and volatilized by heat. This effects a separation from practically all substances.

Nitric Acid. The compound may be isolated as the fairly insoluble, crys-

talline nitron nitrate, C₂₀H₁₆N₄·HNO₃ by the following procedure.

Such an amount of the substance is taken as will contain about 0.1 gram nitric acid, and dissolved in about 100 cc. of water with addition of 10 drops of dilute sulphuric acid. The solution is heated nearly to boiling and about 12 cc. of nitron acetate solution added (10 grams of nitron in 100 cc. of 5% acetic acid).² The solution is cooled and placed in an ice pack for about two hours, and the compound then transferred to a Gooch or Munroe crucible (weighed crucible if gravimetric method is to be followed), and after draining, it is washed with about 10 to 12 cc. of ice-water added in small portions. The nitrate may now be determined gravimetrically by drying the precipitate to constant weight at 110° C., 16.53% of the material being due to NO₂.

The base diphenyl-endo-anilo-hydro-triazole (nitron) also precipitates the following acids: nitrous, chromic, chloric, perchloric, hydrobromic, hydriodic, hydroferro- and hydroferricyanic, oxalic, picric and thiocyanic acids. Hence these must be absent from the solution if precipitation of nitric acid is desired for

quantitative estimation.

Removal of Nitrous Acid. Finely powdered hydrazine sulphate is dropped into the concentrated solution. (0.2 gram substance per 5 or 6 cc.)

Chromic acid is reduced by addition of hydrazine sulphate.

Hydrobromic acid is decomposed by chlorine water added drop by drop to the neutral solution, which is then boiled until the yellow color has disappeared.

Hydriodic acid is removed by adding an excess of potassium iodate to

the neutral solution and boiling until the iodine is expelled.

PROCEDURES FOR THE DETERMINATION OF COMBINED NITROGEN

Ammonia

The volumetric procedures for determination of ammonia are preferred to the gravimetric on account of their accuracy and general applicability. The following gravimetric method may occasionally be of use:

Gravimetric Determination of Ammonia by Precipitation as Ammonium Platinochloride, (NH₄)₂PtCl₆

Ammonia in ammonium chloride may be determined gravimetrically by precipitation with chlorplatinic acid. The method is the reciprocal of the one for

determining platinum.

Procedure. The aqueous solution of the ammonium salt is treated with an excess of chlorplatinic acid and evaporated on the steam bath to dryness. The residue is taken up with absolute alcohol, filtered through a weighed Gooch crucible, and washed with alcohol. The residue may now be dried at 130° C. and weighed as (NH₄)₂PtCl₆, or it may be gently ignited in the covered crucible until

² Keep nitron reagent in a dark-colored bottle.

¹ M. Busch, Ber., 38, 861 (1905), Treadwell and Hall, "Analytical Chemistry."

ammonium chloride has been largely expelled and then more strongly with free access of air. The residue of metallic platinum is weighed. If the ignition method is to be followed, the ammonium platinic chloride may be filtered into a small filter, the paper with the washed precipitate placed in a porcelain crucible and then gently heated until the paper is charred (crucible being covered) and then more strongly with free access of air until the carbon has been destroyed.

Factors.¹ $(NH_4)_2PtCl_4 \times 0.2400 = NH_4Cl$, or $0.08095 = NH_4$, or $\times 0.0767 = NH_4$. $Pt \times 0.5453 = NH_4Cl$, or $\times 0.1839 = NH_4$, or $\times 0.1736 = NH_4$.

VOLUMETRIC METHODS FOR DETERMINATION OF AMMONIA

Two conditions are considered:

- A. Estimation of free ammonia in solution.
- B. Determination of ammonia in its salts—combined ammonia.

Analysis of Aqua Ammonia

Provided no other basic constituent is present, free ammonia in solution is best determined by direct titration with an acid in presence of methyl orange or methyl red as indicator.

Procedure. About 10 grams of the solution in a weighing bottle with glass stopper is introduced into an 800-cc. Erlenmeyer flask containing about 200 cc. of water and sufficient ½ normal sulphuric acid to combine with the ammonia and about 10 cc. in excess. The flask is stoppered and warmed gently. This forces out the stopper in the weighing bottle, the ammonia combining with the acid. Upon thorough mixing, the solution is cooled, and the excess of acid is titrated with half normal caustic.

One cc. $\frac{1}{2}$ N. $H_2SO_4 = 0.0085$ gram NH_3 .

Factor. $H_2SO_4 \times 0.3473 = NH_3$.

Note. The aqua ammonia exposed to the air will lose ammonia, hence the sample should be kept stoppered. This loss of ammonia is quite appreciable in strong ammoniacal solutions.

Determination of Combined Ammonia. Ammonium Salts.

Strong bases decompose ammonium salts, liberating ammonia. This may be distilled into standard acid or into a saturated solution of boric acid (neutral to methyl orange) and titrated.

Procedure. About 1 gram of the substance is placed in a distillation flask (see Fig. 50) and excess of sodium or potassium hydroxide added and the ammonia distilled into a saturated solution of boric acid or an excess of standard sulphuric acid. Ammonia in boric acid solution may be titrated directly with standard acid (methyl orange or methyl red indicator) or in case a mineral acid

¹ Factors recommended by Treadwell and Hall, "Analytical Chemistry," 2, John Wiley & Sons.

was used to absorb the ammonia, the excess of acid is titrated with standard caustic solution.

One cc. half normal sulphuric acid = 0.0085 gram NH₂.

One cc. normal acid = 0.01703 gram NH₃.

Factors. $H_2SO_4 \times 0.3473 = NH_1$ and $NH_2 \times 2.8792 = H_2SO_4$.

ANALYSIS OF AMMONIACAL LIQUOR

The crude liquor by-product from coal gas in addition to ammonia contains hydrogen sulphide, carbon dioxide, hydrochloric acid, sulphuric acid, combined with ammonia, also sulphites, thiosulphates, thiocyanates, cyanides, ferrocyanides, phenols.

Determination of Ammonia

Volatile Ammonia. This is determined by distillation of the ammonia into an excess of standard sulphuric acid and titrating the excess of acid. With the exception that caustic soda is omitted in this determination, the details are the same as those for total ammonia as stated in the next paragraph.

Total Ammonia. The true value of the liquor is ascertained by its total ammonia content. Ten to 25 cc. of the sample is diluted to about 250 cc. in a distilling flask with a potash connecting bulb, as previously described, 20 cc. of 5% sodium hydroxide are added and about 150 cc. of solution distilled into an excess of sulphuric acid. The excess is then titrated according to the standard procedure for ammonia.

One cc. N. $H_2SO_4 = 0.01703$ gram NH_3 .

Fixed Ammonia is the difference between the total and the volatile ammonia.

Carbon Dioxide

Ten cc. of the liquor are diluted to 400 cc. and 10 cc. of 10% ammoniacal calcium chloride added and the mixture, placed in a flask with Bunsen valve, is digested on the water bath for two hours. The precipitated calcium carbonate is washed, placed in a flask and an excess of N/2 HCl added and the excess acid titrated with N/2 NaOH.

N/2 HCl = 0.011 gram CO₂.

Hydrochloric Acid

Ten cc. of the liquor is diluted to 150 cc. and boiled to remove ammonia. Now hydrogen peroxide is added to oxidize organic matter, etc., the mixture being boiled to remove the excess of the peroxide. Chlorine is titrated in presence of potassium chromate as indicator by tenth normal silver nitrate after neutralizing with dilute nitric acid.

One cc. $N/10 \text{ AgNO}_2 = 0.00364 \text{ gram HCl.}$

Hydrogen Sulphide

To 10 cc. of the liquor are added an excess of ammoniacal zinc chloride or acetate, the mixture diluted to about 80 cc. and warmed to 40°. After settling for half an hour the zinc sulphide is filtered off and washed with warm water (40 to 50°); the precipitate is washed from the filter into an excess of N/10 iodine solution, the sulphide clinging to the paper washed into the main solution with hydrochloric acid. The mixture is acidified and the excess iodine titrated with N/10 sodium thiosulphate.

One cc. $N/10 I = 0.0017 \text{ gram } H_2S$ or 0.0016 gram S.

Sulphuric Acid

250 cc. of the liquor is concentrated to 10 cc., 2 cc. of concentrated hydrochloric added and the mixture heated to decompose any thiosulphate, sulphide or sulphite present. The concentrate is extracted with water, filtered and made to 250 cc. The sulphuric acid is now precipitated in an aliquot portion with barium chloride.

BaSO₄ \times 0.4202 = H₂SO₄, or \times 0.1374 = S present as H₂SO₄.

Total Sulphur. Fifty cc. of the liquor is run by means of a pipette into a deep beaker (250 cc. capacity), containing an excess of bromine covered by dilute hydrochloric acid. The mixture is evaporated to dryness on the steam bath and the residue taken up with water and diluted to 250 cc. Sulphur is now precipitated as barium sulphate as usual, preferably on an aliquot portion.

For a more complete analysis of crude liquor determining sulphite, thiosulphate, thiocyanate, hydrocyanic acid, ferrocyanic acid, and phenols the analyst is referred to Lunge, "Technical Methods of Chemical Analysis," Part II, Vol. II, D. Van Nostrand Co.

Determination of Traces of Ammonia

The determination of traces of ammonia is best accomplished by the colorimetric method with Nessler's reagent. Details of the procedure are given in the chapter on water analysis.

NITRIC ACID. NITRATES

The alkalimetric method for determining free nitric acid, and the complete analysis of the commercial product are given in the chapter on Acids. Special procedures for determining the combined acid are herein given.

Gravimetric Method for Determining Nitric Acid by Precipitation as Nitron Nitrate, C₂₀H₁₆ N₄·HNO₃

As in case of ammonia the volumetric methods are generally preferable for determining nitric acid, combined or free. Isolation of nitric acid by precipitation as nitron nitrate may occasionally be used. The fairly insoluble, crystalline compound, C₂₀H₁₆N₄·HNO₂ is formed by addition of the base diphenyl-endo-

anilo-hydro-triazole (nitron) to the solution containing the nitrate as directed under Separations. The precipitate washed with ice-water is dried to constant weight at 110° C. 16.53% of the compound is NO₂.

Note. The following acids should not be present in the solution, since their nitron salts are not readily soluble: nitrous, chromic, chloric, perchloric, hydrobromic, hydroidic, hydroferrocyanic, hydroferricyanic, oxalic, picric and thiocyanic acids. Solubility of less soluble nitron salts in 100 cc. of water. Nitron nitrate = 0.0099

Solubility of less soluble nitron salts in 100 cc. of water. Nitron nitrate = 0.0099 gram, nitron bromide = 0.61 gram, iodide = 0.017 gram, nitrite = 0.19 gram, chromate = 0.06 gram, chlorate 0.12 gram, perchlorate = 0.008 gram, thiocyanate = 0.04 gram. (Treadwell and Hall, "Analytical Chemistry, Quantitative Analysis.")

VOLUMETRIC METHODS

Direct Estimation of Nitrates by Reduction to Ammonia. Modified Devarda Method ¹

An accurate procedure for the determination of nitrogen in nitrates is Allen's modification of the Devarda method. The method is based upon the quantitative reduction of nitrates to ammonia in an alkaline solution by an alloy consisting of 45 parts of aluminum, 50 parts of copper and 5 parts of zinc. The ammonia evolved is distilled into standard sulphuric acid and thus estimated. The method, originally designed for the valuation of sodium or potassium nitrates, is also of value in the determination of nitric acid, nitrites or ammonia. In the latter case the alloy is omitted.

Reagents Required. Devarda's Alloy. Forty-five parts aluminum, 50 parts copper and 5 parts zinc. The aluminum is heated in a Hessian crucible in a furnace until the aluminum begins to melt, copper is now added in small portions until liquefied and zinc now plunged into the molten mass. The mix is heated for a few moments, covered and then stirred with an iron rod, allowed to cool slowly with the cover on and the crystallized mass pulverized.

Standard Sulphuric Acid. This is made from the stock C.P. acid by dilution so that 1 cc. is equal to 0.0057 gram H₂SO₄, 100 cc. of acid of this strength being equivalent to approximately 1 gram of sodium nitrate. (A tenth normal acid will do, a smaller sample being taken for analysis.) Since it is necessary to standardize this acid against a standard nitrate, it is advisable to have an acid especially for this determination rather than a common reagent for general use.

Standardization of the Acid. 11.6 grams of standard potassium nitrate, equivalent to about 9.6 grams of NaNO₃, is dissolved and made to volume in the weighing bottle (100 cc.), and 10 cc. is placed in the Devarda flask, reduced and the ammonia distilled into 100 cc. of the acid, exactly as the following method describes. The temperature of the acid is noted and its value in terms of H₂SO₄, KNO₃ and NaNO₂ stated on the container. The acid expands or contracts 0.029 cc. for every degree centigrade above or below the temperature of standardization, per 100 cc.

Standard Potassium Nitrate. The purest nitrate that can be obtained is recrystallized in small crystals, by stirring, during the cooling of the supersaturated concentrated solution, and dried first at 100° C. for several hours and then

¹ Paper by W. S. Allen, General Chemical Company, Eighth International Congress of Applied Chemistry.

at 210° C. to constant weight. Chlorides, sulphates, carbonates, lime, magnesia and sodium are tested for and if present are determined and allowance made.

Standard Sodium Hydroxide. This should be made of such strength that 1 cc. is equal to 1 cc. of the standard acid, 2 cc. methyl red being used as indicator. Ten cc. of the acid are diluted to 500 cc. and the alkali added until the color of the indicator changes from a red to a straw color.

Methyl Red Solution. 0.25 gram of methyl red is dissolved in 2000 cc. of 95% alcohol; 2 cc. of the indicator is used for each titration. As the indicator is sensitive to CO₂, all water used must first be boiled to expel carbonic acid. (Baker & Adamson, manufacturers of methyl red.)

Sodium Hydroxide—Sp.gr. 1.3. Pure sodium hydroxide is dissolved in distilled water and boiled in an uncovered casserole with about 1 gram of Devarda's alloy to remove ammonia. This is cooled and kept in a well-stoppered bottle.

Apparatus. This is shown in the accompanying illustration, Fig. 51. It consists of the Devarda flask connected to the scrubber K, filled with glass wool. This

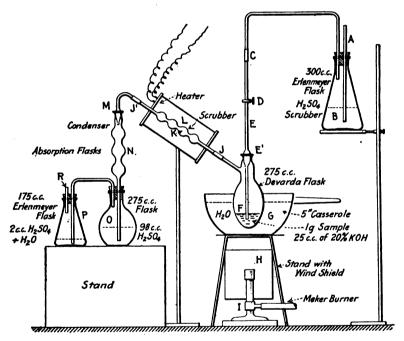


Fig. 51.—Devarda's Apparatus.

scrubber is heated by an electric coil or by steam passed into the surrounding jacket. The scrubber prevents caustic spray from being carried over into the receiving flask O. The form of the apparatus can best be ascertained from the sketch.

Weighing bottle with graduation at 100 cc. and a 10-cc. dropper with rubber bulb is used for weighing out the sample in solution. See Fig. 52.

Preparation of the Sample

Weight. It is advisable to take a large sample if possible, e.g., 100 grams of NaNO, 119 grams of KNO, or about 80 grams of strong HNO, (95%) or more




Fig. 52.

and Dropper.

if the acid is dilute. Solids are taken from a large sample, all lumps being broken down. After dissolving in water the sample is made up to 1 liter. (Scum is broken up by addition of a One hundred cc. of this solution is placed in little alcohol.) the weighing bottle, which has been previously weighed, being perfectly clean and dry. The difference is the weight of the 100-cc. sample. Manipulation. All parts of the apparatus are washed out

with CO₂-free water. All water used in this determination should be boiled to expel CO. Ninety-eight cc. of the standard acid is placed in flask O and washed down with 2 to 3 cc. of Two cc. of the standard acid is placed in flask P and washed down with 10 cc. of water and 13 to 14 drops of methyl red indicator added. Connections are made between the flasks Weighing Bottle and the scrubber. (The correction is made for the acid, the temperature being noted at the time of withdrawal.) serole, filled with cold water, is placed under F (see illustration).

The stem E is removed from the Devarda flask and 10 cc. (or more) of the nitrate added by means of the dropper in the weighing bottle, a funnel having been inserted in the flask. The bottle reweighed gives the weight of the sample removed, by difference. The nitrate is washed down with 10 cc. of water and 25 cc. of 20% caustic added (free from NH₃), the alkali washed down with 10 cc. more of water and then 3 grams of Devarda alloy placed in the flask by means of dry funnel. The stem E is quickly replaced, the stopcock being turned to close the tube. The reaction begins very soon. If it becomes violent, the reaction may be abated by stirring the water in the casserole, thus cooling the sample. After the energetic action has abated (five minutes), the casserole with the cold water is removed and the action allowed to continue for twenty minutes, meantime heat or steam is turned on in the scrubber. E is connected at C to the flask B containing caustic to act as a scrubber. It is advisable to have a second flask containing sulphuric acid attached to the caustic to prevent ammonia from the laboratory entering the system. A casserole with hot water is placed under F and the burner lighted and turned on full. A gentle suction is now applied at R, the stop-cock D being turned to admit pure air into the evolution flask; the rate should be about 5 to 6 bubbles per second. The suction is continued for thirty minutes, hot water being replaced in the casserole as the water evaporates. The heat is now turned off and the apparatus disconnected at M and J. The contents of this elbow and the condenser are washed into the flask O. The acid in O and P poured into an 800-cc. beaker and rinsed out several times. volume in the beaker is made up to 500 cc., 1 cc. of methyl red added, and the free acid titrated with the standard caustic. The end-point is a straw yellow.

Calculation. The cc. of the back titration with caustic being deducted, the volume of the acid remaining (e.g., combined with ammonia) is corrected to the standard condition. Expansion or contraction per 100 cc. is 0.029 cc. per each degree C. above or below the temperature at which the acid was standardized. If the acid is exactly 0.057 gram H₂SO₄ per cc., the result multiplied by 0.989 and divided by the weight of the sample taken gives per cent nitrate. (In terms of NaNOs.)

The Weight of the Sample. Ten times the difference of the weighings of the bottle W before and after removal of the 10 cc. and the product divided by the weight of the 100 cc. of the solution equals the weight of solid taken.

Example. Weight of the bottle + 100 cc. sample = 218 grams. Weight of the bottle

= 112 grams, therefore weight of 100 cc. NaNO₃ = 106 grams.

Weight of the bottle+100 cc. sample=218. Weight after removal of 10 cc=207.4

grams, therefore sample taken = 10.6 grams, including the added water. Now from above the weight of the actual sample taken = $10.6 \times 10 \div 106 = 1$ gram.

Temperature Correction. Temperature of standardization = 20° C. Temperature of the sulphuric acid when taken for the analysis = 31° C. Back titration of the caustic = 2° cc. The correct volume = $(100-2) - ((31-20)\times 0.029) = 97.681$ cc. H₂SO₄ combined with ammonia from the reduced nitrate. $97.681 \times 0.989 \div 1 = 96.62\%$ NaNOa.

Factors. $H_2SO_4 \times 2.06107 = KNO_3$ or $\times 1.7334 = NaNO_3$ or $\times 1.2850 = HNO_3$.

 $H_2SO_4 \times 0.9587 = HNO_2$ or $\times 0.3473 = NH_3$.

 $NH_{2} \times 3.6995 = HNO_{2}$ or $\times 4.9906 = NaNO_{2}$ or $\times 4.0513 = NaNO_{2}$.

 $NaNO_3 \times 1.1894 = KNO_3$ and $KNO_3 \times 0.8408 = NaNO_3$.

ANALYSIS OF NITRATE OF SODA

The following impurities may occur in nitrate of soda: KNO3, NaCl, Na2SO4, Na₂CO₂, NaClO₃, NaClO₄, Fe₂O₃, Al₂O₃, CaO, MgO, SiO₂, H₂O, etc. In the analysis of sodium nitrate for determination of NaNO, by difference, moisture, NaCl, Na₂SO₄ and insoluble matter are determined and their sum deducted from 100, the difference being taken as NaNO₃. Such a procedure is far from accurate, the only reliable method being a direct determination of niter by the Devarda method given in detail. The following analysis may be required in the valuation of the nitrate of soda.

Determination of Moisture

Twenty grams of sample are heated in a weighed platinum dish at 205 to 210° C. for fifteen minutes in an air bath or electric oven. The loss of weight multiplied by 5 = per cent moisture. (Save sample for further tests.)

Insoluble Matter

Ten grams are treated with 50 cc. of water and filtered through a tared Gooch. The increased weight dried residue (100° C.) multiplied by 10 = per cent insoluble matter. (Save filtrate.)

Sodium Sulphate

The moisture sample is dissolved in 20 cc. hot water and transferred to a porcelain crucible. It is evaporated several times with hydrochloric acid to dryness to expel nitric acid. (Until no odor of free chlorine is noticed when thus treated.) Fifty cc. of water and 5 cc. hydrochloric acid are now added and the sample filtered. Any residue remaining is principally silica. The filtrate is heated to boiling, 10 cc. of 10% barium chloride solution added, and the precipitated sulphate filtered off, ignited and weighed.

 $BaSO_4 \times 3.0445 = per cent Na_2SO_4$.

Iron, Alumina, Lime, and Magnesia

These impurities may be determined on a 20-gram dried sample, the material being dried and evaporated as in case of the sodium sulphate determination. The filtrate from silica is treated with ammonium hydroxide and Fe(OH)₁ and Al(OH)₂ filtered off. Lime is precipitated from the iron and alumina filtrate as oxalate and magnesia determined by precipitation as phosphate from the lime filtrate by the standard procedures.

Sodium Chloride

The filtrate from the insoluble residue is brought to boiling and magnesia, MgO (Cl free), is added until the solution is alkaline to litmus. 0.5 cc. of 1% potassium chromate (K₂CrO₄) solution is added as an indicator and then the solution is titrated with a standard solution of silver nitrate until a faint red tinge is seen, the procedure being similar to the determination of chlorides in water by silver nitrate titration. The cc. AgNO₂×factor for this reagent×10 = per cent NaCl.

Silver nitrate is standardized against a salt solution.

Carbonates

This determination is seldom made. CO₂ may be tested for by addition of dilute sulphuric acid to the salt. Effervescence indicates carbonates. Any evolved gas may be tested by lime water, which becomes cloudy if CO₂ is present. For details of the procedure reference is made to the chapter on Carbon.

DETERMINATION OF NITRIC NITROGEN IN SOIL EXTRACTS

Vamari-Mitscherlich-Devarda Method

Procedure. Forty cc. of water, a small pinch of magnesia and one of magnesium sulphate are added to flask D of the Mitscherlich apparatus (Fig. 53). Twenty-five cc. of standard acid and 60 cc. of neutral redistilled water are placed in flask F; 250 or 300 cc. of aqueous soil extract are placed in a 500-cc. Kjeldahl flask, 2 cc. of 50% sodium hydroxide added, the mouth of the flask closed with a small funnel to prevent spattering, and the contents of the flask boiled for thirty minutes. The water which has boiled off is replaced, and, after cooling, 1 gram of Devarda's alloy (60 mesh), and a small piece of paraffin are added and the flask connected with the apparatus; reduction and distillation are carried on for forty minutes. The receiver contents are then cooled, 4 drops of 0.02%

solution of methyl red added, the excess acid is nearly neutralized, the liquid boiled to expel CO₂, cooled to 10 to 15° and the titration completed.

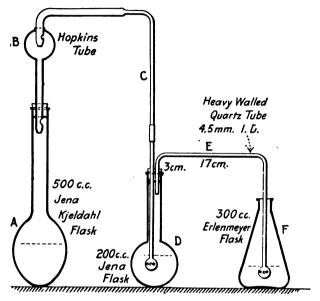


Fig. 53.—Mitscherlich's Apparatus for Nitrogen Determination.

B. S. Davisson¹ recommends an improved form of scrubber, shown in Fig. 53a to be used in place of the Hopkins bulb (Fig. 53). The bulb and adaptor are made of Pyrex glass. Steam condenses in the bulb and the condensate acts as a scrubber preventing alkali mist from being carried over with the ammonia. During the test ammonia is completely volatilized into the absorption The bulb of the adaptor, shown as II, prevents back suction into the distillation flask.

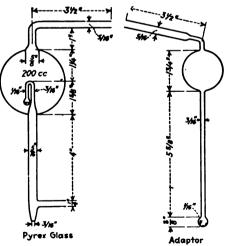


Fig. 53a.—Davisson's Scrubber.

¹ Reference B. S. Davisson, Ohio, Ag. Exp. Station, J. Ind. Eng. Chem., 11, 465 (May, 1919).

Determination of Hydroxylamine—Method of Raschig¹

Hydroxylamine in hot acid solutions reduces ferric salts to ferrous condition quantitatively according to the reaction:

$$2NH_2OH + 2Fe_2(SO_4)_3 = 4FeSO_4 = 2H_2SO_4 + N_2O + H_2O.$$

The amount of ferrous iron formed is a measure of the hydroxylamine originally present.

Approximately 0.1 gram of hydroxylamine salt is dissolved in Procedure. a little water in an Erlenmeyer flask and 30 cc. of cold saturated solution of ferric-ammonium alum added, followed by 10 cc. of dilute sulphuric acid (1:4). The solution is heated to boiling and kept at this temperature for five minutes, then diluted to 300 cc. and titrated immediately with standard permanganate solution.

1 cc. N/10 KMnO₄ = 0.001652 g. NH₂OH.

lodometric Determination of Nitrates—Method of Gooch and Gruener²

By this method the nitrate to be estimated is treated, in an atmosphere of carbon dioxide, with a saturated solution of manganous chloride (crystallized) in concentrated hydrochloric acid, the volatile products of the reaction (nitrogen dioxide, chlorine, etc.) are now distilled and caught in a solution of potassium iodide. The iodine set free is titrated by a standard solution of thiosulphate.

Procedure. The nitrate and the manganous mixture (saturated solution of crystallized manganous chloride and strong hydrochloric acid—20 cc. per 0.2 gram sample) following it are introduced into the pipette shown in Fig. 53a (marked III) suction being applied, if necessary, at the end of the absorption train (VI). The current of CO₂ is started immediately after putting in the When the air has been replaced by CO₂, heat is applied to the retort mixture. III and the distillation continued until nearly all the liquid has passed over into the receiver IV, which is cooled by water. (See illustration.) The contents of the receivers are united and the bulbs washed out by passing the wash water directly through III and IV. Introduction of manganous chloride into the distillate does not influence the accuracy of the titration. The liberated iodine is titrated with standard sodium thiosulphate as soon as possible after

Reaction: 2NH₂OH+Ti₂(SO₄)₃ = (NH₄)₂SO₄+4TiOSO₄+H₂SO₄.

For discussion of the two methods see paper by Wm. C. Bray, Miriam E. Simpson and Anna A. MacKenzie, Jour. Am. Chem. Soc., 41, 9, 1362, Sept., 1919.

² "Methods in Chemical Analysis," by F. A. Gooch. F. A. Gooch and H. W. Gruener, Am. Jour. Sci. (3), XLIV, 117.

¹ Hydroxylamine may also be determined by reduction with an excess of titanous salt in acid solution with exclusion of air, and the excess titrated with permanganate.

admitting air to the distillate, since traces of dissolved nitric oxide reoxidized by the air would react with the iodide liberating more iodine.

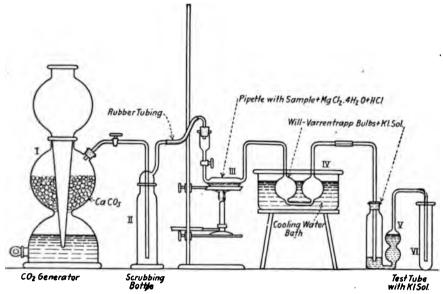


Fig. 53b. Gooch-Gruener Apparatus.

DETERMINATION OF NITROGEN OF NITRATES (AND NITRITES) BY MEANS OF THE NITROMETER

The nitrometer is an exceedingly useful instrument employed in the accurate measurement of gases liberated in a great many reactions and has therefore a number of practical applications. It may be used in the determination of carbon dioxide in carbonates; the available oxygen in hydrogen dioxide; in the valuation of nitrous ether and nitrites; in the valuation of nitrates and nitric acid in mixed acids.

The method for the determination of nitrogen in nitrates, with which we are concerned in this chapter, depends on the reaction between sulphuric acid and nitrates in presence of mercury:

$$2KNO_4 + 4H_2SO_4 + 3Hg = K_2SO_4 + 3HgSO_4 + 4H_2O + 2NO.$$

The simplest type of apparatus is shown in the illustration, Fig. 54. The graduated decomposition tube has a capacity of 100 cc. It is connected at the base by means of a heavy-walled rubber tubing with an ungraduated leveling tube (b). At the upper portion of (a) and separated from it by a glass stopcock (s) is a bulb (c) of about 5 cc. capacity; a second stop-cock enables completely enclosing the sample, as may be necessary in volatile compounds. The glass stop-cock (s), directly above the graduated chamber, is perforated so as

to establish connection with the tube (d) when desired and the graduated cylinder (a).

Procedure. The tube (b) is filled with mercury and the air in (a) now displaced by mercury, by turning the stop-cock to form an open passage between (a) and (d) and then raising (b). A sample of not over 0.35 gram potassium nitrate or a corresponding amount of other nitrates, is introduced into (c), the material being washed in with the least amount of water necessary (1 to 2 cc.). By lowering (b) and opening the stop-cock s the solution is drawn into the decomposition chamber, taking care that no air enters. This is followed by about 15 cc. of pure, strong sulphuric acid through s₁ and s, avoiding admitting air as before. NO gas is liberated by the heat of reaction between the sulphuric acid and the water solution. When the reaction subsides, the tube (a) is shaken to mix the mercury with the liquor and the NO completely liberated. The gas is allowed to cool to room temperature and then measured, after raising or lowering (b) so that the column of mercury is the calculated excess of height above that in (a) in order to have the gas under atmospheric pressure. The excess of height is obtained by dividing the length of the acid layer in (a), in millimeters, by 7 and elevating the level of the mercury in (b) above that in (a) by this quotient; i.e., if the acid layer = 21 mm. the mercury in (b) would be 3 mm. above that in (a). The volume of gas is reduced to standard conditions by using the formula

$$V' = \frac{V(P - w)}{760(1 + 0.00367t)}.$$

V' = volume under standard conditions; V = observed volume; P = observed barometric pressure in mm.; w = tension of aqueous vapor at the observed temperature, expressed in millimeters; t = observed temperature.

One cc. gas = 4.62 milligrams of KNO₃, or 3.8 milligrams NaNO₃ or 2.816 milligrams HNO₃.

Du Pont Nitrometer Method 1

The Du Pont nitrometer, Fig. 55, is the most accurate apparatus for the volumetric determination of nitrates. By use of this, direct readings in per cent may be obtained, without recourse to correction of the volume of gas to standard conditions and calculations such as are required with the ordinary nitrometers.


The apparatus consists of a generating bulb of 300 cc. capacity E with its reservoir F connected to it by a heavy-walled rubber tubing. E carries two glass stop-cocks as is shown in illustration. The upper is a two-way stop-cock connecting either the cup or an exit tube with the chamber. D is the chamber-reading burette, calibrated to read in percentages of nitrogen, and graduated from 10 to 14%, divided in 1/100%. Between 171.8 and 240.4 cc. of gas must be generated to obtain a reading. A is also a measuring burette, that may be used in place of D where a wider range of measurement is desired. "It is used for the measurement of small as well as large amounts of gas. It is most commonly graduated to hold 300.1 milligrams of NO at 20° C. and 760 mm. pressure and this volume is divided into 100 units (subdivided into tenths) each unit being equivalent to 3.001 milligrams of NO. When compensated, the gas from

¹ See paper by J. P. Pitman, Jour. Soc. Chem. Ind., p. 983, 1900.

ten times the molecular weight in milligrams of any nitrate of the formula RNO₁ (or five times molecular weight of R(NO₁)₂) should exactly fill the burette. This simplifies all calculations; for example the per cent nitric acid in a mixed acid would be

$$\frac{R63.02}{100W} = \text{per cent HNO}_3.$$

R = burette reading, W = grams acid taken." 1 C is the compensating burette very similar in form to the chamber burette D. B is the leveling bulb, by the



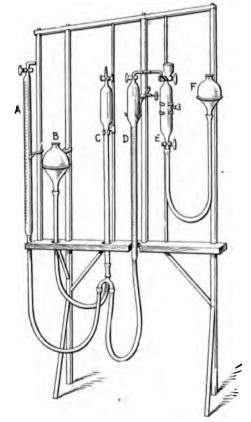


Fig. 54.—Nitrometer.

Fig. 55.—Du Pont's Nitrometer.

raising or lowering of which the standard pressure in the system may be obtained. The apparatus as shown in Fig. 55 is mounted on an iron stand. As in the more simple form of apparatus, previously described, mercury is used as the confining liquid. The parts are connected by heavy-walled rubber tubing, wired to the glass parts.

¹ A. W. Betts, Chemist, E. I. DuPont de Nemours Powder Co., in letter to author.

Standardizing the Apparatus. The apparatus having been arranged and the various parts filled with mercury, the instrument is standardized as follows: 20 to 30 cc. of sulphuric acid are drawn into the generating bulb through the cup at the top, and at the same time about 210 cc. of air; the cocks are then closed, and the bulb well shaken; this thoroughly desiccates the air, which is then run over into the compensating burette until the mercury is about on a level with the 12.30% mark on the other burette, the two being held in the same relative position, after which the compensating burette is sealed off at the top. A further quantity of air is desiccated in the same manner and run into the reading burette so as to fill up to about the same mark; the cocks are then closed, and a small piece of glass tubing bent in the form of a U, half filled with sulphuric acid (not water), is attached to the outlet of the reading burette: when the mercury columns are balanced and the enclosed air cooled down, the cock is again carefully opened, and when the sulphuric balances in the U-tube, and the mercury columns in both burettes are at the same level, then the air in each one is under the same conditions of temperature and pressure. A reading is now made from the burette, and the barometric pressure and temperature carefully noted, using the formula

$$V_t = \frac{V_o P_o(273+t)}{P_t 273},$$

the volume this enclosed air would occupy at 29.92 ins. pressure and 20° C. is found. The cock is again closed and the reservoir manipulated so as to bring the mercury in both burettes to the same level, and in the reading burette to the calculated value as well. A strip of paper is now pasted on the compensating burette at the level of the mercury, and the standardization is then complete.

Another rapid method of standardizing is to fill the compensating chamber with desiccated air as stated in the first procedure and then to introduce into the generating chamber 1 gram of pure potassium nitrate dissolved in 2 to 4 cc. of water, the cup is rinsed out with 20 cc. of 66° Béaume sulphuric acid, making three or four washings of it, each lot being drawn down separately into the bulb. The generated gas formed after vigorous shaking of the mixture, as stated under procedure, is run into the measuring burette. The columns in both burettes are balanced so that the reading burette is at 13.85 (=per cent N in KNO₃). A strip of paper is pasted on the compensating burette at the level of the mercury, and standardization is accomplished. By this method the temperature and pressure readings, and the calculations are avoided.

Procedure for Making the Test. Salts. One gram of sodium or potassium nitrate, or such an amount of the material as will generate between 172 to 240 cc. of gas, is dissolved in a little water and placed in the cup of the generating bulb.

Liquid Acids. The acid is weighed in a Lunge pipette and the desired amount run into the funnel of the generating bulb, the amount of acid that is taken being governed by its nitrogen content.

The sample is drawn into the bulb; the funnel is then rinsed out with three or four successive washings of 95% sulphuric acid, the total quantity being 20 cc.

To generate the gas, the bulb is shaken well until apparently all the gas is

¹ Standardization with "C. P. KNO₂ is the better, as it is less tedious and is not subject to the correction errors that cannot be escaped when standardizing with air. The KNO₃ must be of undoubted purity."—A. W. Betts.

formed, taking care that the lower stop-cock has been left open, this cock is then closed and the shaking repeated for two minutes. The reservoir is then lowered until about 60 cc. of mercury and 20 cc. of acid are left in the generating bulb. There will remain then sufficient space for 220 cc. of gas.

NOTE. If too much mercury is left in the bulb, the mixture will be so thick that it will be found difficult to complete the reaction, a long time will be required for the residue to settle and some of the gas is liable to be held in suspension by the mercury, so that inaccurate results follow.

The generated gas is now transferred to the reading burette, and after waiting a couple of minutes to allow for cooling, both burettes are balanced, so that in the compensating tube the mercury column is on a level with the paper mark as well as with the column in the reading burette; the reading is then taken.

If exactly one gram of the substance is taken the percentage of nitrogen may be read directly, but in case of other amounts being taken, as will invariably be the case in the analysis of acids, the readings are divided by the weight of the substance and multiplied by 4.5 to obtain the per cent of nitric acid monohydrate present.

The procedure may be used for determining nitrites as well as nitrates.

Determination of HNO₃ in Oleum by Du Pont Nitrometer Method ¹

About 10 cc. oleum are weighed in a 30-cc. weighing bottle, 10 cc. 95% reagent sulphuric acid added and mixed by shaking. This mixture is transferred to the nitrometer reaction tube and the weighing bottle and nitrometer cup rinsed with three 5-cc. portions of the reagent sulphuric acid which is drawn into the reaction tube. This is vigorously shaken for three minutes and the gas then passed to the measuring tube and allowed to stand for about five minutes, after which the mercury levels are adjusted and the reading taken.

It is obvious that this determination includes any nitrous acid in the oleum.

Combined Nitric Acid

The nitric acid in nitrates may be determined by titration with ferrous sulphate. The nitrate dissolved in a little water is run into strong sulphuric acid and titrated with standard ferrous sulphate according to the procedure described for determining free nitric acid in mixed acids (Vol. II, Acids).

Determination of Free Nitric Acid

Other acids being absent, free nitric acid may be determined by titration with standard alkali. Details for the analysis of nitric acid in presence of commonly occurring impurities are given in Volume II in the chapter on Acids.

1 cc. N/1 NaOH = 0.063018 g. HNO₃

¹ By courtesy of E. I. du Pont de Nemours Powder Co.

DETERMINATION OF NITRITES

Gravimetric Method of Buovold²

One and one fourth to 1.5 gram of AgBrO₃ is dissolved in 100 cc. of water and 110 cc. of 2 N. acetic acid, in an Erlnmeyer flask. 200 cc. of the nitrite solution (1 g. NaNO₂) are added from a burette, stirring the mixture during addition of the nitrite. A pale green precipitate is obtained. 30 cc. of H_2SO_4 (1:4) are added, the mixture warmed to 85°. When the yellow precipitate settles it is filtered on a Gooch and washed with hot water, then dried and weighed as AgBr+AgCl—chlorine is determined on a separate portion and AgCl deducted. $AgBr\times0.9070=NaNO_2$. The method is specially applicable to nitrites high in chlorine.

Volumetric Permanganate Method

Principle. Potassium permanganate reacts with nitrous acid or a nitrite as follows:

$$5N_2O_3+4KMnO_4+6H_2SO_4=5N_2O_6+2K_2SO_4+4MnSO_4+6H_2O_5$$

 $5HNO_2+2KMnO_4+3H_2SO_4=5HNO_2+K_2SO_4+2MnSO_4+3H_2O_5$

Since 2KMnO₄ in acid solution has five available oxygens for oxidation of substances (e.g.,2KMnO₄ = K₂O.2MnO+5O equivalent to 10H) the molecular weights of the constituents divided by 20 in the first equation and by 10 in the second would represent the normal weights per liter, e.g., 5N₂O₄ divided by 20 = 76 divided by 4 = 19 grams N₂O₃ per liter. 4KMnO₄ divided by 20 or 2KMnO₄ divided by 10 = 158.03 divided by 5 = 31.61 grams of KMnO₄ per liter for a normal solution. In the second equation if Na represents the univalent element we would have 5NaNO₂ divided by 10 or 69 divided by 2 = 34.5 grams per liter. Hence 1 cc. of a normal KMnO₄ solution would oxidize 0.019 gram N₂O₃ or 0.0345 gram NaNO₄ to form N₂O₅ and NaNO₂ respectively.

Organic matter is also oxidized by KMnO, hence will interfere if present.

Special Reagents.

N/5 Potassium Permanganate. The solution contains 6.322 grams KMnO₄ per liter.

N/5 Sodium Oxalate. Na₂C₂O₄ reacts with KMnO₄ as follows:

$$5Na_{2}C_{2}O_{4} + 2KMnO_{4} + 8H_{2}SO_{4} = K_{2}SO_{4} + 2MnSO_{4} + 5Na_{2}SO_{4} + 10CO_{2} + 8H_{2}O_{2}$$

Hence 5Na₂C₂O₄ divided by 10 or 134 divided by 2=67 grams per liter=a normal sodium oxalate solution. A N/5 solution requires 13.4 grams Na₂C₂O₄ per liter.

² Chem. Ztg. 38, 28, C. A. 8, 1250 (1914).

Preparation of the Sample.

Soluble Nitrites. Ten grams of the nitrite are dissolved in water and made to 1000 cc.; 10 cc. contain 0.1 gram of the sample.

Water-insoluble Nitrites. 0.5 to 1.0 gram of the nitrite according to the amount of nitrous acid present is taken for analysis. An excess of KMnO₄ solution is added, followed by dilute H₂SO₄ and the excess standard permanganate titrated with sodium oxalate according to directions given under Procedure.

Nitrous Acid in Nitric Acid and Mixed Acids. This is present generally in very small amounts so that a large sample is taken. The amount and details of the procedures are given under the special subject.

For routine work where a number of daily determinations are made, a 50-cc. burette is generally preferred.

Trial Run. If the approximate strength of the salt is not known the following test may be quickly made to ascertain whether more than 50 cc. of solution is necessary and the approximate amount of KMnO₄ required for oxidation.

Ten cc. of the solution together with 100 cc. of water are placed in a 4-in. casserole and about 10 cc. of dilute H₂SO₄, 1:1, added. Standard KMnO₄ from a 50-cc. burette is now run into the sample until a permanent pink color is obtained. The cc. of KMnO₄ multiplied by 5 = the approximate amount of permanganate solution required for oxidation of 50 cc. of sample. An excess of 5 to 10 cc. should be taken in the regular run.

Titration of Nitrite. Sufficient standard N/5 KMnO₄ to oxidize the sample to be titrated (as ascertained by the trial run) and 10 cc. excess are placed in a casserole. The solution is acidified with 10 cc. of dilute (1:4) H₂SO₄ and 50 cc. of the nitrite solution is added slowly with constant stirring. The sample is placed on a hot plate until the mixture reaches a temperature of 70° to 80° C. and 25 cc. more of the dilute H₂SO₄ added. The excess permanganate is now titrated with N/5 Na₂C₂O₄, the exalate being added slowly until the permanganate color is destroyed. Five cc. excess of the exalate are added and the exact excess determined by titrating the hot solution with N/5 KMnO₄ to a faint pink color. The total permanganate solution taken minus the exalate titration = cc. KMnO₄ required by the nitrite.

Standard ferrous sulphate, FeSO₄, may be used, in place of sodium oxalate. The titration then may be conducted in the cold.

One cc. N/5 $KMnO_4 = 0.0038$ g. N_2O_3 , or 0.0069 g. $NaNO_2$, or 0.0085 g. KNO_2 .

Detection of a Nitrate in a Nitrite Salt

Iridium salts are colored blue by HNO₂ but no color is produced by HNO₂. Use a 0.025% solution of IrO₂ or $(NH_4)_2IrCl_6$ per 100 cc. of 98-99% H_2SO_4 and heat to boiling. The solution should be kept in a stoppered bottle. Into the hot reagent in a test tube is dropped the solid substance tested. A blue color is produced by nitrates. If the nitrite is in solution, make alkaline with KOH, evaporate to dryness and test the residue. Chlorine interferes, but not FeCl₂.

Determination of Pyridine in Ammonium Nitrate¹

Dissolve 250 g. of sample in 300 cc. of distilled water, using a 1000 cc. Kjeldahl or Florence flask. Add a few drops of methyl orange and neutralize with 10% sodium hydroxide solution. Then add 15 cc. excess of 10% sodium hydroxide solution. Set up apparatus, note Fig. 55a, using 300 cc. hypobromite solution in the second flask and receiving the distillate in 25 cc. N/10

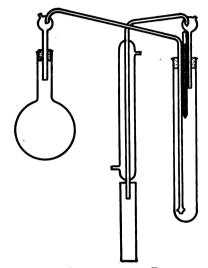


FIG. 55a.—APPARATUS FOR PYRIDINE.

The whole is set around a single ring stand. The hypobromite flask is 2 in. by 14 in. The hypobromite, 300 cc., occupies 7½ in. of the height at the start of the test.

sulfuric acid. Distil until 100 cc. of distillate have been collected. The heating should be very slow until all the ammonia, driven off, has been destroyed. This point will be indicated first by an acid reaction of the methyl orange in the first flast and second by the gradual reduction of the amount of nitrogen given off, in very small bubbles, in the hypobromite. At this point the hypobromite flask should not be warm enough to burn the hand (not above 70° to 75° C.). It is now safe to increase the heat so that boiling occurs in the hypobromite in 10 to 15 min. and 100 cc. of distillate comes over in 20 to 25 min. after active boiling starts.

Titrate the liquid in the receiver, using N/10 sodium hydroxide solution with methyl orange as the indicator.

¹ Ref. R. M. Ladd, Jour. Ind. Eng. Chem., Vol. 11, no. 6, page 552 (June, 1919). By courtesy of the author.

Record the end-point; add $\frac{1}{2}$ cc. of phenolphthalein (1:1000) solution and continue the titration until a red color which will persist for 30 sec. appears. Subtract the methyl orange end-point from that obtained with phenolphthalein, and multiply the difference by 0.0079. The result is the pyridine bases in grams. Methyl orange indicates pyridine plus ammonia. Phenolphthalein in licates ammonia. Difference is due to pyridine.

Notes. Because of the fact that the methyl orange and phenolphthalein endpoints are never quite the same and because an absorption of carbon dioxide by the sodium hydroxide solution may bring it about that they vary still more widely, it is necessary to standardize the solutions used to both end-points and to make a correction for their normal difference. This correction should be checked by a new standardization at least once a week. We found that with our solutions this difference was usually about 0.4 cc.

In case it is desired to use a sample of a different size, maintain the proportions indicated above, except that the total solution in the first flask should always be about

The hypobromite solution is made up as follows: 100 g. sodium hydroxide are dissolved in 800 cc. of water, 25 cc. of liquid bromine are added, and the mixture shaken until the bromine is entirely dissolved and made up to 1,000 cc. The solution should be made up a day in advance. It will maintain its strength for at least a week if kept in a stoppered, dark bottle. It will be brown in color. Should the brown color disappear during the distillation it would mean that an excess of ammonia is present. This should also be indicated and eliminated from the calculations by the double end-point called for, but in case this happens it is well to repeat the test, using more of the hypobromite solution.

The reactions involved and the calculations on which the proportions are based are indicated in the following equations:

$$NaOH + NH_4NO_3 \rightarrow NH_3 + H_2O + NaNO_3$$
40

15 cc. 10% sodium hydroxide solution contains 1.5 g. sodium hydroxide 1.5 g. sodium hydroxide will free 0.6375 g. ammonia

$$2NH_1 + 3NaBrO \rightarrow 3H_2O + N_2 + 3NaBr$$

0.638 g. ammonia is destroyed by 6.699 g. sodium hypobromite

$$2\text{NaOH} + \text{Br}_2 \rightarrow \text{NaBrO} + \text{NaBr} + \text{H}_2\text{O} \\ 80 \quad 160 \quad 119$$

25 cc. bromine = 79.5 g. bromine 300 cc. solution contains 17.7 g. hypobromite (approx.)

PHOSPHORUS

WILFRED W. SCOTT

P₄, at.wt.31.04; sp.gr. $\begin{cases}
yellow 1.831 \\
red 2.296
\end{cases}; m.p. \\
\begin{cases}
44^{\circ} \\
725^{\circ}
\end{cases}; b.p. \\
\begin{cases}
290^{\circ}C \\
.....
\end{cases}; oxides.$ P₁O₁, PO₁, P₂O₁; acids, H₁PO₁, H₂PO₁, H₂PO₂, H₃PO₄, HPO₃, H₄P₃O₇.

DETECTION

Element. Phosphorus is recognized by its glowing (phosphorescence) in the air. The element is quickly oxidized to P₂O₅; if the yellow modification is slightly warm (34° C.) the oxidation takes place with such energy that the substance bursts into flame. The red form is more stable. It ignites at 260° C.

Boiled with KOH or NaOH it forms phosphine, PH₂, which in presence of accompanying impurities is inflammable in the air.

Phosphorus oxidized to P₂O₅ may be detected with ammonium molybdate,

a yellow compound, (NH₄),PO₄·12MoO₃·3H₂O, being formed.

Acids. Hypophosphorous Acid, H₂PO₂, heated with copper sulphate to 55° C. gives a reddish-black compound, Cu₂H₂, which breaks down at 100° to H and Cu. Permanganates are reduced immediately by hypophosphorous acid. No precipitates are formed with barium, strontium or calcium solutions. Zinc in presence of sulphuric acid reduces hypophosphorous acid to phosphine, PH₂.

Phosphorous Acid, H.PO₁. Copper sulphate is reduced to metallic copper and hydrogen is evolved, no Cu₂H₂ being formed as in case of hypophosphorous acid. Permanganates are reduced slowly. Added to solutions of barium, strontium or calcium white phosphites of these elements are precipitated. Alkali phosphites are soluble in water, while hypophosphites are not readily soluble.

Orthophosphoric Acid, H₂PO₄. Ammonium phosphomolybdate precipitates yellow ammonium phosphomolybdate from slightly nitric acid solutions. The precipitate is soluble in ammonium hydroxide.

Metaphosphoric Acid, HPO₁. Converted by nitric acid in hot solutions to the ortho form. Metaphosphoric acid is not precipitated by ammonium molybdate.

Pyrophosphoric Acid, H₄P₁O₇. Converted to orthophosphoric acid in hot solutions by nitric acid. No precipitate is formed with ammonium molybdate.

COMPARISON OF ORTHO, META AND PYROPHOSPHORIC ACIDS

Reagent.	Orthophosphoric acid.	Metaphosphoric acid.	Pyrophosphoric scid.
Ammonium molybdate. Albumin Zinc sulphate, cold, in excess. Silver nitrate in neutral solution. Magnesium salts.	ŧ .	No ppt. Coagulated No ppt. White ppt., AgPO ₃ No ppt.	No ppt. Not coagulated White ppt. White ppt., Ag.P ₁ O ₇ No ppt.

Phosphorous acids are distinguished from phosphoric acids by the phosphine formed with the former when acted upon with zinc.

Acid phosphates are distinguished from normal phosphates as follows: Neutral silver nitrate added to an acid phosphate liberates free nitric acid (Litmus test), the following reaction taking place:

$$3AgNO_3+Na_2HPO_4=Ag_2PO_4+2NaNO_3+HNO_3$$
.

The solution resulting when silver nitrate is added to normal phosphate solution is neutral.

 $3AgNO_3 + Na_3PO_4 = Ag_3PO_4 + 3NaNO_3$.

ESTIMATION

The determination of the pentoxide of phosphorus is required in a large number of substances, since it is widely distributed in the form of phosphates—calcium phosphate, Ca₁(PO₄)₂; fluor apatite, 3Ca₁(PO₄)₂·CaF₂; chlor apatite, 3Ca₂(PO₄)₂·CaCl₂; vivianite, Fe₃(PO₄)₂·8H₂O; wavelite, 2Al₂(PO₄)₂·Al₂(OH)₄·9H₂O; pyromorphite, 3Pb₂(PO₄)₂·PbCl₂; phosphates of iron and calcium in phosphate ores, hence in slags of the blast furnace. It occurs in fertile soils, bones, plant and animal tissues.

The chemist is especially concerned in the determination of phosphoric acid (P₂O₅), in the evaluation of materials used for the manufacture of the acid—bone ash and phosphate rock (see table below). Generally, determinations of lime, iron and alumina are also desired and frequently a more complete analysis. In the analysis of phosphoric acid certain impurities occurring in the crude material used are determined, e.g., iron, lime, magnesia, sulphuric, hydrochloric and hydrofluoric acids, etc. Phosphoric acid is determined in the evaluation of phosphate fertilizers, phosphates used in medicine, phosphate baking powders, etc.

The element is determined in iron, steel, phosphor bronzes, and other alloys.

Typical Analyses * Charlestown Spanish Sombrero Redonda Canadian Substance. Bone Ash. Phosphate. Phosphorite. Phosphates. Phosphate. Phosphate. 39.55 27.17 33.38 35.12 35.47 37.68 Phosphoric oxide.... 3.30 Sulphur trioxide.... 0.574 43-4.96 7.40 Carbon dioxide..... 4.10 44.03 Lime.... 52.46 47.16 51.33 51.04 1.02 0.37 Magnesia..... trace +Fe Alumina..... 1.44 0.8920.17 $\mathbf{Fe_{s}O_{s}}$, $a \hookrightarrow c$ 0.43 2.38 Al2O3, 10, 0.17 2.59 1.02 8.85 Ferric oxide Fluorine, etc..... 4.01 F. etc. Alkaline salts..... 0.42=6.880.870.51 3.71 9.70 4.29 5.60 2.02Silica—sand, etc....

*Thorpe, "Dictionary of Applied Chemistry," Longmans, Green & Co.

Preliminary Remarks. Practically all procedures for the determination of phosphorus depend upon it; oxidation to ortho phosphoric acid and its precipitation by ammonium molybdate from a nitric acid solution as ammonium phospho-molybdate. It may now be determined either gravimetrically or volumetrically. Two procedures are of importance in the gravimetric deter-

mination of phosphorus; the first depends upon the direct weighing of the yellow phosphomolybdate, dried at 110° C.; the second, on the conversion of the yellow precipitate to the magnesium salt and its ignition to pyrophosphate. Two volumetric procedures, which are of special value in the determination of small amounts of phosphorus as in case of phosphorus in iron and steel, are to be recommended for their rapidity and accuracy. One of these is to dissolve the ammonium phosphomolybdate in a known amount of standard caustic, titrate the excess of alkali with standard acid, which indicates the alkali required to neutralize the molybdic acid in the yellow precipitate. From this the amount of phosphorus present may be calculated. A second procedure of equal accuracy and rapidity is to dissolve the molybdate in ammonia, add an excess of sulphuric acid, pass the warm solution through a column of zinc and titrate the reduced molybdic acid with standard potassium permanganate, the amount of permanganate required being a measure of the phosphorus present.

The impurities interfering in the procedures are silica and arsenic acid. The first may be eliminated by dehydration of the silicic acid in the solution and its removal as insoluble SiO₂ by filtration. Arsenic in small quantities does not interfere under certain conditions; in large quantities its removal is imperative.

Preparation and Solution of the Sample

Amount of the Sample Required. For accurate results it is advisable to take a fairly large sample, 5 to 10 grams, and when it has been dissolved, to dilute to a definite volume, 500 or 1000 cc. Aliquots of this solution are taken for analysis.

Iron Ores, Phosphate Rock and Minerals. Five to 10 grams of the pulverized material placed in a 3-in, porcelain dish are digested for an hour with 50 to 100 cc. of concentrated hydrochloric acid (sp.gr. 1.19), the dish being covered by a clock-glass and placed on a steam bath. The acid is now diluted with half its volume of water and the solution filtered into a porcelain dish of sufficient capacity to hold the filtrate and washings. The residue is washed with dilute hydrochloric acid (1:1) until free of visible iron discoloration. filtrate and washings are evaporated rapidly on a hot plate to small volume and then to dryness over the steam bath. Meanwhile the insoluble residue and filter are ignited in a 20-cc. platinum crucible over a Méker burner or in a muffle furnace and the residue fused with ten times its weight of sodium carbonate. The fusion is removed by inserting a platinum wire into the molten mass, allowing to cool and then gently heating until the mass loosens from the crucible, when it may be removed on the wire. The cooled mass on the wire and that remaining in the crucible are dissolved in dilute hydrochloric acid, and the filtered solution added to the main solution. The combined solutions are evaporated to dryness, and heated gently to dehydrate the silica. The residue is taken up with a few cc. of hydrochloric acid, the solution diluted, filtered and the SiO2 washed with dilute nitric acid solution. The combined filtrates are made up to 500 or 1000 cc. Aliquots of this solution are taken for analysis.

Iron and Steel. Five to 10 grams of the drillings or filings are dissolved in an Erlenmeyer flask with 50 to 100 cc. of dilute nitric acid, 1:1, more acid being added if necessary. When dissolved, a strong solution of KMnO₄ is added until a pink color appears; on boiling brown manganese dioxide forms in the solution if a sufficient amount of permanganate has been added. This is dis-

solved by adding 2% sodium thiosulphate solution in just sufficient quantity to dissolve the precipitate. The solution is diluted to a convenient volume for analysis. Where a number of determinations are to be made, it is advisable to weigh the amount of sample desired for the determination and to precipitate the ammonium phosphomolybdate in the flask in which the drillings have been dissolved.

Ores Containing Titanium. Titanium may be recognized by the red color produced by hydrogen peroxide, H_2O_2 , added to the sulphuric acid extract; also by the reduction test with zinc, which causes a play of colors, the solution becoming colorless by the reduction of iron, then, in presence of titanium, pink, purple and finally blue. (Vanadium gives similar tests.) Solutions containing titanium frequently appear milky when the solution is diluted before filtering off the insoluble residue. Since titanium forms an insoluble compound with phosphoric acid and iron oxide ¹ the final residue, obtained by the method of solution for ores, phosphate rock and minerals, should be moistened with sulphuric acid and the silica expelled with hydrofluoric acid. The solution is evaporated to dryness and to SO₂ fumes, the residue fused with sodium carbonate and taken up with boiling water. TiO₂ remains insoluble, while P₂O₅ passes into the filtrate.

Determination of Phosphorus in Organic Matter. Decompose the organic matter with nitric acid in a sealed tube according to the method of Cassius described on page 145, and determine the phosphoric acid formed.

Soluble Phosphates, Phosphate Baking Powder, etc. A water extract is generally sufficient to get the material in solution. In case iron, alumina, lime and magnesia salts are present, as may occur in baking powders, an extraction with dilute 3% nitric acid is necessary. It is advisable to dissolve a 5- to 10-gram sample and take an aliquot part of the solution made up to a definite volume. Before precipitating with ammonium phosphomolybdate, 5 grams of ammonium nitrate should be added for each gram of the sample taken for analysis and the solution boiled to oxidize compounds of phosphorus to the orthophosphate form.

Precipitation of Ammonium Phosphomolybdate

Precipitation of ammonium phosphomolybdate is common to all subsequent methods for determination of phosphorus, and, as in case of preparation and solution of the sample, details of this procedure will not be repeated.

Reaction.

 $H_2PO_4+12(NH_4)_2MoO_4+21HNO_3=(NH_4)_2PO_4\cdot12MoO_3+21NH_4NO_3+12H_2O.$

Special Reagents Required. Ammonium Molybdate. One hundred grams of pure molybdic acid are thoroughly mixed with 400 cc. of cold distilled water and 80 cc. of strong ammenia (sp.gr. 0.90) added. When the solution is complete it is poured slowly and with constant stirring into a mixture of 400 cc. of strong nitric acid (sp.gr. 1.42) and 600 cc. distilled water. This order of procedure should be followed, as the nitric acid poured into the ammonium molybdate solution will cause the precipitation of a difficultly soluble oxide of molybdenum and render the reagent practically worthless. Fifty milligrams (.050 gram) of microcosmic salt, dissolved in a little water are added, the precipitate agitated, then allowed to settle for twenty-four hours and the clear solu-

¹Blair "Chemical Analysis of Iron."

tion decanted through a filter into a large reagent bottle. Sixty cc. of the reagent should be used for every 0.1 gram of P_2O_4 present in the solution analyzed.

Potassium Permanganate. For oxidation purposes. Two per cent solution filtered free of dioxide through asbestos is required.

Amount of Sample Required for Analysis. If the material contains over 20% P₂O₅, 0.1 to 0.5-gram sample should be taken; if the product contains 5 to 20% P₂O₅, 1.0 to 0.5 gram should be taken; for a sample containing 0.5 to 5%, 2.5 to 1-gram sample is taken, and for P₂O₅ less than 0.5%, a 5-gram sample is taken.

Precipitation. The free acid of the solution is nearly neutralized by addition of ammonium hydroxide. In analysis of phosphate rock or materials comparatively low in iron, it is advisable to add ammonium hydroxide in quantity sufficient to cause a slight permanent precipitate followed by just sufficient HNO₃ to dissolve the precipitate. In iron and steel analysis ammonium hydroxide is added until the precipitated iron hydroxide dissolves with difficulty and the solution becomes a deep amber color or cherry red. In analysis of soluble phosphates, litmus paper dropped into the solution indicates the neutral point. Nitric acid is added to the neutral or slightly acid solution, 5 cc. of acid for every 100 cc. of solution. A volume of 150 to 200 cc. of solution is the proper dilution for samples taken in amounts above recommended. To the warm solution (not over 80° C.) ammonium molybdate is added, 60 cc. of the reagent being required for every 0.1 gram of P₂O₅ present. The solution is stirred, or shaken, if in a flask, until a cloudy precipitate of ammonium phosphomolybdate appears. It is then allowed to settle on the steam bath at a temperature of 40 to 60° C., for one hour, then again agitated and allowed to settle in the cold for an hour The filtrate should be tested with additional ammonium molybdate for phosphorus. The yellow precipitate is filtered and washed with 1% HNO₂ solution followed by a 1% solution of KNO3, or NH4NO3 or (NH4)2SO4 as the special case requires. Filtration through asbestos in a Gooch crucible is to be recommended. When a large number of determinations are to be made, as in case of iron and steel, filter paper is more convenient.

GRAVIMETRIC METHODS FOR DETERMINATION OF PHOSPHORUS

A. Direct Weighing of the Ammonium Phosphomolybdate

The sample being dissolved and the ammonium phosphomolybdate precipitated according to directions already given above, the supernatant solution is filtered through a weighed Gooch crucible and washed twice by decantation with dilute nitric acid (1%), the precipitate washed into the Gooch, followed by two washings with 1% KNO₃ or NH₄NO₃ (neutral solutions) and finally with water. The precipitate, free from contaminating impurities, is dried for two hours in an oven at 110° C., then cooled in a desiccator and weighed. Weight of precipitate×0.0165 = P, or ×0.03784 = P_2O_5 .

Note. If this procedure is to be followed it will be convenient to take 1.65 grams sample, if the phosphorus content will allow. Each 0.01 gram of precipitate will then equal 1% P.

B. Determination of Phosphorus as Magnesium Pyrophosphate

Magnesia Mixture. For precipitation of ammonium magnesium phosphate, 110 grams of magnesium chloride (MgCl₂·6H₂O) are dissolved in a small amount of water. To this are added 280 grams of ammonium chloride and 700 cc. of ammonia (sp.gr. 0.90); the solution is now diluted to 2000 cc. with distilled water. The solution is allowed to stand several hours and then filtered into a large bottle with glass stopper. Ten cc. of the solution should be used for every 0.1 gram P₂O₅ present in the sample analyzed. As the reagent becomes old it will be necessary to filter off the silica that it gradually accumulates from the reagent bottle.

Procedure. The ammonium phosphomolybdate, obtained as directed (page 365), is filtered onto a 12½ S. & S. No. 589 filter paper and washed four or five times with dilute 1% HNO3. The precipitate is now dissolved from the filter by a fine stream of hot ammonium hydroxide, 1:1, catching the solution in the beaker in which the precipitation was made. The solution and washings should be not over 100 to 150 cc. Hydrochloric acid is added to the cooled solution to neutralize the excess of ammonia, the vellow precipitate, that forms during the neutralization. dissolving with difficulty, when sufficient acid has been added. To the cooled solution cold magnesia mixture is added drop by drop (2 drops per second) with constant stirring. Ten cc. of the reagent will precipitate 0.1 gram P₂O₅. When the solution becomes cloudy the stirring is discontinued and the precipitate allowed Ammonium hydroxide is added until the solution conto settle ten minutes. tains about one-fourth its original volume of strong ammonia (e.g. 25 cc. NH₄OH, 90 to 100 cc. of solution). The solution is stirred during the addition and then allowed to settle for at least two hours. It is filtered preferably, through a Gooch crucible (or through an ashless filter paper), and the precipitate washed with dilute ammonium hydroxide, 1:4, then placed in a porcelain crucible, a few drops of saturated solution of ammonium nitrate added and the precipitate heated over a low flame till decomposed (or until the paper chars). The lumps of residue are broken up with a platinum rod and again ignited over a Scimatico or Méker burner, the heat being gradually increased. If the heating is properly conducted, the resultant ash will be white or light gray, otherwise it will be The addition of solid ammonium nitrate aids the oxidation in obstinate cases, but there is danger of slight mechanical loss. The crucible is cooled in a desiccator and the residue weighed as magnesium pyrophosphate.

 $Mg_2P_2O_7\times 0.2787 = P$ and $Mg_2P_2O_7\times 0.6379 = P_2O_6$.

Direct Precipitation of Magnesium Ammonium Phosphate

In the absence of heavy metals whose phosphates are insoluble in an ammoniacal solution, the magnesia mixture may be added directly to the neutral solution containing the phosphate, without previous precipitation of ammonium phosphomolybdate. The magnesium ammonium phosphate is washed and ignited according to directions given above, and weighed as magnesium pyrophosphate.

The use of the Gooch crucible for the ammonium phosphomolybdate and the ammonium magnesium phosphate precipitates is recommended in preference to filter paper, as the fibers of the latter invariably are occluded in the precipi-

tates, and produce dark-colored residues of magnesium pyrophosphate, which are, frequently, extremely difficult to burn white. The residue on the asbestos mat, on the other hand, is easily ignited white, and does not require repeated addition of an oxidizing agent, as is so often the case with precipitates filled with paper fiber.

VOLUMETRIC METHODS FOR THE DETERMINATION OF PHOSPHORUS

C. Alkalimetric Method

The method is based on the acid character of ammonium phosphomolybdate the following reaction taking place with an alkali hydroxide:

 $2(NH_4)_212MoO_2PO_4+46NaOH+H_2O$ = $2(NH_4)_2HPO_4+(NH_4)_2MoO_4+23Na_2MoO_4+23H_2O_4$

From the reaction 46 Ω polecules of sodium hydroxide are equivalent to one molecule of P_2O_5 , hence 1 Ω of a N/10 solution of sodium hydroxide neutralizes the yellow precipitate containing an equivalent of .000309 gram of P_2O_5 .

Special Reagents

Sodium Hydroxide—Tenth Normal Solution. For determination of phosphorus by the alkali volumetric method. To 100 grams of the pure NaOH sticks sufficient water is added to just dissolve the hydrate. This concentrated solution is poured into a tall cylinder, the vessel closed and the insoluble matter allowed to settle. The liquid will be practically free of carbonates. A portion of the clear liquor may now be drawn off and diluted to a definite volume so that the solution is slightly stronger than tenth normal, as determined by titration against a standard N/10 acid. It may now be diluted to the required amount as indicated by the acid titration. Freshly boiled distilled water should be used in the dilutions of the standard caustic solution. Phenolphthalein indicator is required in the titration. The exact value of the caustic solution in terms of phosphorus may be ascertained by standardizing the solution against a steel sample of known phosphorus content, the sample being dissolved in nitric acid, the phosphorus precipitated as ammonium phosphomolybdate, the washed precipitate dissolved by the caustic solution and the excess caustic titrated by standard nitric acid according to the procedure given later.

Wt. of P in sample
cc. of NaOH required to neutralize molybdate = amount of P per cc. of NaOH.

Nitric Acid—Tenth Normal Solution. The acid is standardized against the caustic solution and should be of such strength that 1 cc. of HNO₁ is equal to 1 cc. of NaOH. Phenolphthalein indicator is used. Approximately 6.7 cc. of 95% HNO₂ diluted to 1000 cc. = N/10 HNO₂ solution.

Nitric Acid for Washing Precipitates. One per cent solution, 14 cc. HNO₃ (sp.gr. 1.42) per liter of water.

Acid Ammonium Sulphate for Washing Precipitates. Fifteen cc. strong NH₄OH+25 conc. H₂SO₄ in 1000 cc. solution.

Potassium Nitrate for Washing Precipitates. Used in volumetric analysis only. Ten grams of KNO, per liter of solution. Test, to be sure the solution is neutral.

Procedure. The ammonium phosphomolybdate, obtained according to directions already given on page 365, is filtered into a Gooch crucible containing asbestos, and washed once or twice with water containing 1% nitric acid, and then several times with a 1% neutral solution of potassium nitrate until the washings are free of acid, as indicated by testing with litmus paper. The asbestos mat containing the precipitate is transferred to a No. 4 beaker, 100 cc. of CO₂ free water added, followed by about 20 cc. of N/10 NaOH measured from a burette. The crucible is rinsed out with 5 to 10 cc. of N/10 NaOH, the exact amount being noted and then with water, adding the rinsings to the main solution. Phenolphthalein indicator is added, and the excess of caustic titrated with N/10 HNO₃. The total NaOH added minus the acid titration equals the cc. of the caustic equired to react with the yellow precipitate.

One cc. N/10 NaOH = 0.000136 gram P and = 0.000309 gram P₂O₅.

The exact factor should be determined as directed under Reagents.

D. Zinc Reduction and Titration with Potassium Permanganate

This method is based on the assumption that ammonium phosphomolybdate, (NH₄)₂12MoO₂PO₄, is reduced, in acid solution, by zinc, the molybdic acid, MoO₃, forming the lower oxide Mo₂O₃, in which form it reacts with ferric iron in the receiving flask, reducing a corresponding equivalent of ferric salt to ferrous condition, being itself oxidized to MoO₂. When the ferric solution is not placed in the receiving flask a slight oxidation takes place, the oxide Mo₂₄O₂₇, apparently being formed.²

Reagents required: NH₄OH (sp.gr. 0.90); H₂SO₄ (sp.gr. 1.84); HNO₃ (sp.gr. 1.42); Na₂S₂O₃ solution, 2%; amalgamated zinc.

Special Apparatus Required

Jones' Reductor. Details of the reductor are given under the determination of iron by the permanganate method, also under the Volumetric Determination of Molvbdenum.

Potassium Permanganate Decinormal Solution. For volumetric determination of phosphorus, reduction method, 3.161 grams of the pure salt per liter is the theoretical amount required for a tenth-normal solution. It is necessary, however, to standardize the permanganate solution against a tenth-normal sodium oxalate solution. The exact value of the permanganate solution may be accurately and rapidly determined in terms of phosphorus by standardizing against a sample of standard steel containing a known amount of phosphorus, the ultimate standard being steel drillings furnished by the U. S. Bureau of Standards. The drillings are dissolved in nitric acid, oxidized with KMnO4, the excess of the reagent being destroyed by thiosulphate solution. Ammonia is added until the solution becomes a deep amber color. The phosphorus is precipitated as ammonium phosphomolybdate. The following procedure is the same as is

¹ D. L. Randall, Am. Jour. Sci. (4), 24, 315. ² Blair, "Chemical Analysis of Iron," 7th Ed., p. 96.

given in the volumetric method following: The permanganate titration of the reduced molybdic acid divided into the amount of phosphorus known to be present in the solution will give the value of the permanganate in terms of phosphorus.

Wt. of P in sample cc. KMnO₄ required = amount of P per cc. of KMnO₄.

Procedure. The ammonium phosphomolybdate, obtained by the procedure given on page 365, is filtered onto an asbestos mat in a Gooch crucible or onto filter paper, and washed with dilute HNO₃ followed by acid ammonium sulphate (15 cc. NH₄OH, sp.gr. 0.90+25 cc. conc. H₂SO₄, sp.gr. 1.84+1000 cc. H₂O), until 2 or 3 cc. of the wash water gives no reaction for molybdenum with a drop of ammonium sulphide solution. Five or six washings should suffice.

Reduction. The precipitate is dissolved by adding about 10 cc. ammonium hydroxide, sp.gr. 0.96, to the precipitate, catching the solution in the beaker or flask in which the precipitation was made. About 10 cc. of strong sulphuric acid is added to this solution after diluting to about 100 cc. The Jones reductor is prepared as described for determination of molybdenum by reduction, page 319. The receiving flask is charged with about 25 cc. of ferric alum (100 grams per liter) and 4 cc. syrupy phosphoric acid. In iron and steel analysis this mixture is omitted. One hundred cc. of hot water followed by 100 cc. of hot dilute sulphuric acid (2.50%) are passed through the column of zinc in the reductor (previously cleaned by passing hot dilute H₂SO₄ through it). The phosphomolybdic solution is now poured through the reductor, followed by 100 cc. 2% sulphuric acid and 100 cc. hot water. The solution as it is reduced becomes green, but upon coming in contact with the ferric solution produces a bright red color. In absence of ferric solution in the receiver the reduced solution appears green and should remain clear. The hot solution is titrated immediately with N/10 KMnO₄.

Titration. The reduced solution is poured into a No. 6 beaker and N/10 KMnO₄ added from a burette, until a faint permanent pink color is produced. During the titration, the solution changes in color to a brown, a pinkish yellow and finally to pink.

Titration of reduced ferric solution, 1 cc. N/10 KMnO₄=.0000862 P.

Titration in absence of ferric sulphate, 1 cc. N/10 KMnO₄ = .0000887 P.

Calculation. Case 1. Ferric sulphate in the receiver $(6\text{Mo}_2\text{O}_3 + 18\text{ O} = 12\text{MoO}_3)$ in the molecule containing 1 P); 18 O are equivalent to 36 H, hence N/10 P according to this reaction equals at.wt. P divided by $(36 \times 1000) = P$ for 1 cc. N/10 KMnO₄ = .0000862 g. P.

CASE 2. No ferric salt in receiver. $Mo_{24}O_{27}+35$ $O=24MoO_{2}+2P$. (35 O=7O H). Dividing by 2 we get at.wt. P divided by $(35\times1000)=P$ for 1 cc. N/10 KMnO₄=.0000887.

Report of the Committee on Research and Analytical Methods— Phosphate Rock ¹

The following tentative standard methods for sampling and determination of moisture, phosphoric acid and iron and alumina in phosphate rock are recommended to the Division.

Methods of Sampling and Determination of Moisture

I. Gross Sample. A. Car Shipments. One hundred pounds sample per car.

1. Sampling from the Car. In sampling car shipments in the car at least ten scoopshovelsful, aggregating 100 lbs., shall be taken from each car at approximately equal distances from each other so as to average the car. Care shall be taken to see that each scoopful shall cover the entire face of the pile from floor to top.

2. Sampling from the Cart or Barrow. A small hand scoopful of 1 to 2 lbs. shall be taken from each cart or barrow either as it is being loaded or as it leaves the car.

B. Cargo Shipments. One hundred pounds minimum sample per vessel.

1. Sampling in Hoisting Tub. In sampling cargoes generally running from 1000 tons upward a small hand scoopful shall be taken from approximately every tenth tub before it is hoisted from the hold.

2. Sampling from Conveyor. If unloading is being done with automatic bucket and conveyor, periodical sections of the entire discharge of the conveyor shall be taken of such intervals and quantity as to give a sample equivalent to approximately 1 lb.

per each 10 tons of cargo.

3. Sampling from Conveying Vehicle. Samples shall be taken with a hand scoop from various cars at such regular intervals and in such quantities as to give approx-

imately 1 lb. for each 10 tons of cargo.

II. Laboratory Sample. The resulting gross sample obtained by any one of the methods outlined shall be crushed to pass a four-mesh screen, thoroughly mixed on a clean, hard surface and quartered down to a 10-lb. average sample.

A. Crushing. This 10-lb. sample shall all be crushed to pass an eight-mesh

screen.

B. Mixing and Quartering. This eig and quartered down to two 2-lb. samples. This eight-mesh sample shall be carefully mixed

C. Grinding. 1. Moisture Sample. One of these 2-lb. samples shall be held in an air-tight container. This sample is to be used for the determination of moisture.

2. Analytical Sample. The other 2-lb. sample shall be further mixed and quartered

down to a 2- or 4-oz. sample which is then to be ground to pass a sixty-mesh screen or preferably a sixty-five mesh screen. This sample is to be used for the analytical determination.

NOTE. It is essential that the taking of the gross sample be done with small hand scoops and that the practice of taking the sample in the hand be absolutely prohibited, for it has been found that there is considerable selective action in the finer materials sifting through the fingers while a scoop retains the entire sample.

The dimensions of the screens referred to above are to be as follows:

No. of Mesh	Sise of Opening Inches	Diameter of Wire Inches
4	0.185	0.065
8	0.093	0.032
65	0.0082	0.0072

III. Determination of Moisture. Moisture is to be determined on both the moisture sample and analytical sample. Of the moisture sample not less than 100 grams are to be weighed out for each determination. Of the analytical sample approximately 2 grams are to be weighed out for each determination. Both are to be dried to constant weight at a temperature of 105° C. in a well-ventilated oven, preferably with a current of dry air passing through the oven. The containers in which moisture is determined should be provided with well-fitting covers so that the samples may be cooled and weighed in the well-covered container.

¹ Journ. Ind. and Eng. Chem.

IV. Calculation of Results. The percentages of phosphoric acid and iron and alumina as determined on the analytical sample are to be calculated to a moisturefree basis and subsequently to the basis of the original sample as shown by the moisture content of the moisture sample.

Determination of Phosphoric Acid

Reagents. To be prepared as in Official Methods, A. O. A. C. Bureau of Chemistry, Bulletin 107 (Rev.), 1910, p. 2. Preparation of reagents (c), (d), (e) and (f), except that the ammonium nitrate solution in (d) is changed to 5% instead of 10%.

Method of Solution. To 5 grams of the sample add 30 cc. of conc. hydrochloric acid (sp.gr. 1.20) and 10 cc. of conc. nitric acid (sp.gr. 1.42) and boil down to a syrupy consistency. The residue, which should be nearly solid after cooling, is taken up with 5 cc. of conc. nitric acid and 50 cc. of water. Heat to boiling, cool, filter and make up to 500 cc. through the filter. This procedure eliminates practically all of the silica and it is necessary to filter as quickly as possible after digestion so as to avoid redissolving the silica.

as to avoid redissolving the silica.

Determination. Draw off an aliquot portion of 50 cc., corresponding to 0.5 gram, neutralize with ammonia, then add nitric acid until the solution is just clear. Add 15 grams of ammonium nitrate (free from phosphates), heat the solution to 50° C. and add 150 cc. of molybdate solution. Digest at 50° C. for fifteen minutes with and and so the interest of the supernatant liquid and test the filtrate with molybdate solution to see if precipitation has been complete. (If not, add more molybdate to the filtrate and digest for fifteen minutes longer.) Wash with 5 per cent ammonium nitrate solution by decantation, retaining as much of the precipitate as possible in the beaker. Dissolve the precipitate in the beaker in the least possible quantity of ammonium hydroxide (sp.gr. 0.90) and dilute this solution with several times its volume of hot water. Dissolve the remainder of the precipitate on the filter with this solution, washing beaker and filter with hot water and keeping the volume of the filtrate between 75 and 100 cc. Neutralize with hydrochloric acid, cool to room temperatune and add 25 cc. of magnesia mixture from a burette, drop by drop, stirring vigorously with a rubber-tipped rod, then add 15 cc. of ammonium hydroxide (sp.gr. 0.90) and allow to stand for four hours or overnight at room temperature. The time of standing may be reduced to two hours if kept in a reformerator or still better in an ice-water bath. Filter through a platinum or porcelain Gooch crucible, fitted with a platinum or asbestos mat carefully made and ignited to constant weight. Wash with 2.5% ammonium hydroxide until practically free from chlorides; dry, ignite, cool and weigh as magnesium pyrophosphate. If desired, filtration may be made through an ashless filter paper, igniting in the usual manner. Calculate to P₂O₈ by multiplying by 0.6378 (log 80468).

Determination of Iron and Aluminum together as Phosphates

I. Solutions Required: 1. Hydrochloric acid (1:1); prepared by mixing 1 part by volume of concentrated HCl (sp.gr. 1.19) with 1 part of distilled water.

2. A saturated solution of ammonium chloride, which should be filtered before use.

3. A 25% solution of ammonium acetate, faintly acid to litmus paper.

4. A solution of ammonium phosphate (10%), prepared by dissolving 20 grams of (NH₄)₂HPO₄ in 180 cc. of distilled water and filtering. (This should be prepared frequently in small quantity, as it attacks glass containers on standing.)
5. A standard solution of ferrous ammonium sulphate, containing iron equivalent

to about 0.0100 gram of Fe₂O₃ in 10 cc. and 50 cc. conc. HCl per liter.

6. A solution of calcium and magnesium phosphates for blank determinations, prepared as follows: Dissolve 4 grams of Mg() and 35 grams of CaCO₂ (both free of iron and aluminum) in 100 cc. concentrated HCl, add an aqueous solution of 30 grams of (NH₄)₂HPO₄, make up to 2 liters and filter.

7. A solution of ammonium nitrate (5%) for washing precipitates. About 400 cc.

are required for each determination.

All reagents used should be as pure as practicable and all solutions should be free

of suspended matter.

II. Preparation of Rock Solution. Place 2.5 grams of pulverized rock with 50 ec. of 1:1 HCl in a graduated 250-cc. flask, the glass of which contains less than 1% of iron and aluminum oxides.¹ Boil gently with occasional shaking for one hour in such a manner as to avoid concentrating the solution to less than half of its original volume, dilute, cool to room temperature, make up to volume and mix; filter immediately through a dry filter into a dry flask, discarding the first few cc. of the filtered solution.

Pipette a 50-cc. aliquot, representing 0.5 gram of rock, into a platinum dish and evaporate nearly to dryness. Cool, take up with a few cc. of water and when the salts are loosened from the dish, add 5 cc. of 1:1 sulphuric acid and evaporate to fumes. Increase the temperature and evaporate nearly to dryness. Cool, dilute with about 50 cc. of distilled water, add 10 cc. of conc. HCl and heat, with occasional stirring, until sulphates are dissolved. Filter into a 600-cc. Jena glass beaker through a 9-cm. paper (S. & S. No. 597), washing the paper thoroughly with dilute HCl and hot water.

III. First Precipitation with Ammonium Acetate. To the solution in the beaker, add 25 cc. of the standard iron solution when the amount of combined iron aluminum oxides in the rock does not exceed 5% and 50 cc. of the standard iron solution when the combined oxides exceed 5%. Oxidize with about 3 cc. of bromine water and boil in covered beaker for about fifteen minutes to expel the excess of Rinse cover and sides of beaker with distilled water and cool to room tembromine.

perature.

(Run a blank determination containing 10 cc. of 1:1 HCl, 25 cc. of the calcium and magnesium phosphate solution, and the same quantity of standard iron solution

as is added to the rock solution.)

Add 100 cc. of saturated ammonium chloride solution, 6 3 cc. of 10% ammonium phosphate solution, 2 drops of methyl-orange indicator and conc. ammonium hydrate free of spangles and dissolved mineral matter) to alkaline reaction. Then add dilute HCl (about 1:20) drop by drop, with constant stirring, until the solution becomes faintly acid and the pink color of the methyl orange is just restored. Dilute to 450 cc. with distilled water, heat to boiling, and add 25 cc. of 25% ammonium acetate solution. Continue heating for about five minutes, after adding ammonium acetate, filter on a 12.5 cm. ashless filter paper (S. & 3. No. 589 "White Ribbon"

¹ Experiments have shown that the solution cannot be made in flasks made of glass resperiments have shown that the solution cannot be made in hasts made of glass containing a higher percentage of alumina, because the fluorine in the rock partially dissolves the glass and adds alumina to the solution. Neither "Nonsol," "Jena" nor "Weber's" resistant glass "R" is suitable. Flasks made of glass containing little alumina, such as "Kavalier," "F Z resistant glass" or other Bohemian glass of lower alumina content have proven satisfactory. See "Chemical Glassware," P. H. Walker, J. Am. Chem. Soc., 27, 865.

This may be accomplished by heating the flask over a low Bunsen flame or on a bet alter which is just bet enough to keep the solution boiling. A class tube chout

hot plate which is just hot enough to keep the solution boiling. A glass tube about 12 ins. long by ‡ in. in diameter with a bulb in the middle makes a very satisfactory condenser when placed in the neck of the flask.

denser when placed in the neck of the HCl as possible before adding sulphuric tis advisable to remove as much of the HCl as possible before adding sulphuric to as to minimize the chances of loss by effervescence or bumping. The evapoacid so as to minimize the chances of loss by effervescence or bumping. ration may be conducted in glass beakers of low alumina content. Kavalier glass has been used satisfactorily. In no case should the evaporation be conducted in por-

It is best to remove as much sulphuric acid as possible so that the calcium sulphate which might hold iron will dissolve readily in HCl.

It has been found that when iron oxide is present in considerable excess over aluminum oxide the precipitation of the phosphates is more complete, the combined phosphates are more readily ignited to constant weight, and the precipitate does not become red on ignition.

Ammonium chloride in large quantity increases the solubility of calcium and magnesium phosphates and decreases the solubility of iron and aluminum phosphates.

This method of adjusting acidity was suggested by F. B. Carpenter and was

found to give satisfactory results.

*All our work has confirmed Brown's statement (see Wiley's "Principles and Practice of Agricultural Analysis," 2d edition, 1908, Vol. II, p. 245) that the separation from calcium under the conditions of the method depends upon sufficient dilution.

is suitable), in a 3-in. rapid filtering funnel, keeping the contents of the beaker and funnel hot. Wash three times with hot 5% ammonium nitrate solution, each time cutting the precipitate loose from the filter and stirring it thoroughly with the stream from the wash bottle and filling to within about ½ in. of its upper edge. About 30 cc. are required for each washing. Return the precipitate to the precipitating beaker by washing it out of the filter with a stream of hot water. Dissolve the precipitate with dilute HCl (1:6), pouring about 50 cc. through the filter in successive washings and using about 25 cc. to wash down inside the beaker. Finish filter paper with distilled water.

IV. Second Precipitation with Ammonium Acetate. Cool the solution to room temperature, add 50 cc. saturated ammonium chloride solution, 4 cc. of 10% ammonium phosphate solution, 2 drops of methyl orange, and adjust acidity as before. Dilute to 300 cc. with distilled water. Heat to boiling, add 15 cc. of 25% ammonium acetate solution and continue heating for about five minutes. Filter on the same paper as used for the first filtration, scrubbing the inside of the beaker with a rubber-tipped stirring rod and rinsing with hot 5% ammonium nitrate solution. Wash the precipitate ten times with hot 5% ammonium nitrate solution, each time cutting the precipitate loose, stirring it thoroughly as before and breaking up all lumps that it may contain. About 300 cc. of wash solution are required.

As a precautionary measure, boil the filtrate and washings from both the first

and second precipitates, and recover any additional precipitate.

V. Ignition of Precipitate. Transfer filter with precipitate to a weighed deepform porcelain crucible (40 mm. in diameter is a good size) and heat gently over a low flame until the contents are dry, increase the temperature a little and continue heating until the paper is charred, increase the temperature again and continue heating until the paper is entirely burned. Ignite the uncovered porcelain crucible for one-hour periods over blast lamp No. 4 Mcker burner to constant weight, each time cooling to room temperature in desiccator before weighing. Deduct the weight of blank from each determination, and after subtracting the weight of FePO₄ equivalent to the amount of iron found in 0.5 gram of rock by titration, calculate the remainder to Al_2O_3 . $AlPO_4 \times 0.4184 = Al_2O_3$.

Determination of Iron

I. Solutions Required. 1. Standard Potassium Permanganate, N/40, containing 0.79015 gram of KMnO₄ per liter, and having a value of 0.001996 (or practically 0.002) gram of Fe₂O₄ per cc. Standardize with pure sodium oxalate (Bureau of Standards standard sample No. 40.)

2. Stannous Chloride. Dissolve 50 grams of the crystallized salt in 100 cc. of hot conc. HCl and make up to 1 liter with distilled water.

3. Mercuric Chloride. Prepare a cold saturated solution.
4. Manganese Solution. (Preventive solution): (a) Dissolve 200 grams of crystallized manganese sulphate in 1000 cc. of water. (b) Pour slowly, with constant stirring, 400 cc. of conc. sulphuric acid into 600 cc. of water and add 1000 cc. of phose-

- phoric acid of 1.3 sp.gr. Mix solutions (a) and (b).

 II. Analytical Procedure. Determine iron according to Jones' and Jeffrey's modification of the Zimmermann-Reinhardt method as follows: Place in a 250-cc. beaker an aliquot of the rock solution, containing not more than 5 cc. of conc. HCl, boil and reduce with the smallest possible excess of stannous chloride, added drop by drop while agitating the solution. Wash sides of beaker with distilled water and cool rapidly. Add 10 cc. of mercuric chloride solution and stir vigorously for about thirty seconds. Pour the mixture into a large porcelain casserole or dish containing 20 cc. of the manganese solution in about 500 cc. of water which has just been tinted with the permanganate solution.
- ¹ The contents of the funnel will remain hot if the solution in the beaker is kept hot over a low flame and filtration is fairly rapid.

² Heat over Bunsen to redness before placing over blast in order to prevent loss

of precipitate by blowing out of crucible.

Analyst, 34 (1909), 306.

4 Barneby has shown that only a short interval of time is necessary between the addition of mercuric chloride and manganese sulphate, if the solution is thoroughly agitated. J. Am. Chem. Soc., 36 (1914).

Titrate with N/40 permanganate solution, to original tint and correct result by the volume of KMnO₄ required for a blank containing the same quantity of HCl (diluted), adding 2 or 3 drops of stannous chloride to the hot solution, cooling, adding 10 cc. of mercuric chloride and titrating similarly.

When the rock solution contains carbonaceous matter it is necessary first to

oxidize this with a little potassium chlorate, evaporate to dryness to eliminate chlorine, and redissolve with 5 cc. conc. HCl and about 10 cc. of water.

Calculate the Fe₂O₄ found to FePO₄, using the factor 1.8898, and after deducting from the weight of combined phosphates found, calculate the difference (AlPO₄) to Al₂O₄.

Volumetric Determination of Free Phosphoric Acid

Phosphoric acid may be titrated directly by means of standard sodium or potassium hvdroxide. The choice of the indicator is important as may be seen by the following reactions:

reactions: H₂PO₄+NaOH = H₂O+NaH₂PO₄ (neutral to methyl orange, acid to phenolphthalein), H₂PO₄+2NaOH = 2H₂O+Na₂HPO₄ (neutral to phenol, and acid to methyl orange). The slight dissociation of Na₂HPO₄ causing an alkaline reaction to phenolphthalein prevents the endpoint being sharp. This dissociation may be repressed by titrating in a cold concentrated solution containing sodium chloride. The first reaction with methyl orange indicator is more satisfactory. By the electrometric method J. S. Coye has proven that the endpoint of phenolphthalein is the full color of the alkaline salt, not a faint pink.

Reference is made to the chapter on Acidimitry and Alkalimitry, Volume 2, for

titrating phosphoric acid in presence of its salts.

PLATINUM

R. E. HICKMAN 1

Pt, at.wt. 195.2; sp.gr. 21.48; m.p. 1755° C.; oxides PtO, PtO,

DETECTION

Platinum is a gray, lustrous, soft and malleable metal. It is not altered by ignition in the air, but fuses in the oxy-hydrogen flame. It does not dissolve in any of the single acids, but a fusion with acid potassium sulphate attacks the metal slightly. The action of chlorine in general, and nitro-hydrochloric acid (aqua regia), the main solvent, converts the metal to hydrochlorplatinic acid, H₂PtCl₅, which forms many double salts, or platinichlorides. If platinic chloride is gently heated it breaks up into platinous chloride, PtCl₂, and chlorine.

If, however, the platinum is alloyed with silver, it dissolves in nitric acid to a

yellow liquid, provided sufficient silver is present in the alloy.

The oxides can be formed by carefully igniting the corresponding hydroxides. These are very unstable, decomposing into metal and oxygen by gentle ignition.

The chlorides are the most important compounds of platinum. Two complex acids are formed with hydrochloric acid when the metal is dissolved in aqua regia.

PtCl₄+2HCl = H₂PtCl₄ (hydrochlorplatinic acid), orange-red crystals.

PtCl₂+2HCl = H₂PtCl₄ (hydrochlorplatinous acid), only known in solution.

An aqueous solution of the former is yellowish-orange, while an aqueous solution of the latter is dark brown, the former being by far the more important.

Potassium iodide precipitates platinum iodide, but it dissolves quite readily, giving a pink to a dark blood-red liquid, depending on the concentration of the solution. Nitric acid should be absent. Heat destroys this color, as well as hydrogen sulphide, sodium thiosulphate and sulphite, sulphurous acid, mercuric chloride and certain other reducing reagents.

Hydrogen sulphide precipitates black platinum disulphide, PtS₂, with the other elements of the hydrogen sulphide group. The solution should be warm, as precipitation takes place more quickly. It is difficulty soluble in ammonium sulphide. It will be found in the extract with the arsenic, antimony, tin, gold, molybdenum, etc., and is precipitated with these elements upon addition of hydrochloric acid. Platinum sulphide is soluble in aqua regia. Addition 75% MgCl₂ solution prevents formation of colloidal PtS₂.

Ammonium chloride added to a concentrated solution of platinum chloride precipitates yellow (NH₄)₂PtCl₆, which is slightly soluble in water, but insoluble in dilute ammonium chloride solution and alcohol.

Potassium chloride precipitates yellow K₂PtCl₆, which is difficulty soluble in water, but insoluble in 75% alcohol.

¹ Chief Chemist, J. Bishop & Co. Platinum Works.

Ferrous sulphate precipitates metallic platinum on boiling from a neutral solution. Neutralize with Na₂CO₃. Free mineral acids (except dilute H₂SO₄) prevent the precipitation (difference from gold).

Stannous chloride does not reduce platinum chloride to metal, but reduces hydrochlorplatinic acid to hydrochlorplatinous acid.

Oxalic acid does not precipitate platinum (difference from gold).

Sodium hydroxide with glycerine reduces hydrochlorplatinic acid on warming to black metallic powder.

Formic acid precipitates from neutral boiling solutions all the platinum as a black metallic powder.

Thallium protoxide precipitates from the platinum bichloride solution a pale yellow salt, thallium platinochloride. When the salt is heated to redness it leaves an alloy of thallium and platinum.

Rubidium, caesium and thallium chlorides yield similar insoluble salts with platinum chloride.

Sodium hydroxide added to platinic chloride and then supersaturating with acetic acid produces a reddish-brown precipitate of platinic hydroxide Pt(OH)₄. This dissolves in acids readily, except acetic acid.

Metallic zinc, magnesium, iron, aluminum and copper are the most important metals that precipitate metallic platinum.

$$H_2PtCl_4+3Zn=3ZnCl_2+H_2+Pt.$$

ESTIMATION

Platinum may be present under the following conditions:

1. Native grains usually accompanied by the other so-called platinum metals, iridium, palladium, ruthenium, rhodium, osmium, and gold and silver (alloyed with one or more of the allied metals).

Ore concentrates containing the native grains as above with the base metals, iron, copper, chromium, titanium, etc. The associated minerals high in specific gravity in the gravels may be expected to appear with the platinum nuggets, such as chromite, magnetite, garnet, zircon, rutile, small diamonds, topaz, quartz, cassiterite, pyrite, epidote, and serpentine; with gold in syenite; ores of lead and silver.

- 2. Scrap platinum containing, oftentimes, palladium, iridium, gold, silver and iron.
- 3. Small amounts of platinum in the presence of large amounts of iron, silica, carbon, magnesia: platinum residues, nickel and platinum contacts, photography paper, jewelers' filings and trimmings, dental and jewelers' sweeps and asbestos, etc.
 - 4. Platinum alloyed with silver, gold, tungsten, nickel, copper, lead, etc.
 - 5. Platinum solutions and salts.

Preparation and Solution of the Sample

The best solvent for platinum is aqua regia. The metal is also acted upon by fusion with the fixed alkalies—sodium or potassium hydroxide and sodium peroxide or potassium or sodium sitrate; also by chlorates in the presence of

HCl. Platinum, when highly heated, alloys with other metals, as lead, tin, bismuth, antimony, silver, gold, copper, etc. The element dissolves in nitric acid when alloyed with silver. This gives a method for the determination of gold in the presence of silver and platinum alloy.

All salts of platinum are soluble in water. The less soluble salts are the chloroplatinates of potassium, ammonium, rubidium, and caesium. Heat increases

the solubility while the presence of alcohol decreases the solubility.

Ores. When the free grains of platinum, gold and osmiridium are desired the following method is recommended: Five to 10 grams of the ore are taken from a well-mixed pulverized sample and placed in a large platinum dish that has been weighed. Twenty-five to 50 cc. of strong hydrofluoric acid together with 5 to 10 cc. of concentrated sulphuric acid is mixed with the ore in the dish and evaporated on the water bath, when SiF4 and the excess of HF are expelled. The material is gently heated until SO₃ fumes are given off. This is repeated with HF if necessary. The material is washed into a casserole with about 200 cc. of hot water and digested over a water bath for fifteen or twenty minutes, and is then washed by decantation, several times pouring the supernatant liquor through a filter to save any floating material that might be washed out. The filter is cautiously burned and the residue is added to the unattacked material. This is transferred from the dish to a beaker or a porcelain dish and treated with aqua regia. The platinum and a small amount of iridium that dissolves with the platinum on account of its being alloyed can be precipitated with ammonium chloride. The remaining residue in the dish will be a small amount of sand and The silica is driven off with HF as described above and the bright grains weighed as osmiridium, or the sand and osmiridium are run down in a scorifier with lead, and the lead dissolved in dilute nitric acid, leaving the osmiridium grains free from sand.

Platinum Scrap. One-half gram to a gram is dissolved in aqua regia and evaporated with HCl to get rid of the HNO₃.

If the platinum is alloyed with a large amount of copper, silver, lead and other impurities, a sample of 1 to 5 grams is dissolved in 15 to 25 cc. of HNO₃, whereby the copper, silver, lead and other impurities alloyed with the platinum as well as a large amount of platinum will dissolve. The residue after washing will be platinum and gold. These are dissolved in aqua regia as described above and the platinum precipitated with ammonium chloride. The platinum is recovered from the nitric acid solution and added to the aqua regia solution and the whole is evaporated to get rid of the HNO₃.

Small Amounts of Platinum in the Presence of Large Amounts of Iron; Iron Scale, Fe₂O₁; Sulphate of Iron, Magnesia, Sulphate of Magnesia, Silica, etc. The material is carefully weighed and the coarse scales are separated from the finer material containing the platinum by passing the fines through a 20-in. mesh or finer wire sieve. The coarse scale seldom contains platinum, but it is advisable to quarter this down to 1 kilogram or a fairly good-sized sample and test for platinum on a portion of the ground sample. This can be tested by a wet or a fire assay. The fines are quartered down to about 1 kilogram and ground to pass a 60- to 80-in. mesh sieve. One hundred to 500 grams of the material are taken for analysis. This is placed in one or more casseroles, depending on the amount taken. Each 100-gram portion is extracted by digestion on the steam bath with about 300 to 400 cc. of 10% H₂SO₄. The iron, magnesia, etc., soluble in H₂SO₄ will go into solution, leaving the platinum with the

insoluble residue. Filter (a Büchner funnel may be necessary) and wash the residue with water. Test the filtrate for platinum and if any is present precipitate with zinc as described below.

After the filter is ignited in a large platinum dish, the residue is moistened with H₂SO₄, and HF is added completely covering the material. The solution is evaporated on the water bath until SO₃ fumes are given off. If necessary, repeat the treatment with H₂SO₄ and HF until all the silica is driven off as SiF₄. The residue is transferred to a casserole and digested with aqua regia according to directions given under Ores and Platinum Scrap. It is sometimes very difficult to precipitate all of the platinum in the presence of a large amount of iron, magnesia, etc., not having the solution concentrated enough for the platinum. It is advisable to reduce the platinum by iron or zinc, filter, wash with water and redissolve the black metallic platinum in aqua regia. The HNO₃ is expelled by evaporation and adding concentrated HCl from time to time and finally the platinum is precipitated with ammonium chloride.

SEPARATIONS

A careful review of the paragraph on Detection will be very helpful oftentimes in making separations from other metals and substances.

Separation of Platinum from Gold. The platinum is precipitated first with ammonium chloride, as (NH₄)₂PtCl₆. After the precipitate has settled it is filtered and washed free from gold with 20% ammonium chloride solution and alcohol. The gold is precipitated with a concentrated solution of ferrous sulphate or iron protochloride as metallic gold.

Oxalic acid precipitates the gold, leaving the platinum in solution. The oxalic acid is added and the solution heated until the gold is entirely precipitated. Filter and wash the precipitate of metallic gold free from platinum. The filtrate is evaporated as far as possible without crystallizing, and the platinum is precipitated with ammonium chloride as (NH₄)₂PtCl₆, or it may be reduced with zinc and the black dissolved in aqua regia and treated as described above.

Separation of Platinum from Iridium. The platinum and the iridium are precipitated by iron or zinc and the black residue is washed free from impurities and the platinum is dissolved in dilute aqua regia with gentle heating, leaving the iridium as metallic iridium. The platinum solution is evaporated as described above and precipitated with NH₄Cl as (NH₄)₂PtCl₄.

If the platinum and iridium are precipitated together, the salt is filtered and washed with ammonium chloride solution and finally ignited. The sponge is redissolved and evaporated as above to expel the HNO₃. The platinum and the iridium are precipitated with NaOH, which brings down the platinum and iridium as Pt(OH)₄ and Ir(OH)₄. Boil this mixture with alcohol, which reduces the Ir(OH)₄ to Ir(OH)₃, but does not affect the Pt(OH)₄. Dissolve these hydroxides in HCl, forming PtCl₄ and IrCl₃ in solution, and the platinum is precipitated with NHCl free from iridium.

Separation of Platinum from Palladium. The platinum and the palladium are reduced with zinc and the black residue treated with HNO₃. The palladium goes into solution, leaving the platinum as a black metallic residue.

The black residue of platinum and palladium can be dissolved in aqua regia and the solution evaporated with additions of HCl to get rid of the nitric acid.

The platinum is precipitated with NH₄Cl and filtered. The filter is washed free from palladium.

Separation of Platinum from Ruthenium. From the chloride of platinum and ruthenium the metals are precipitated with ammonium or potassium chloride and filtered. The filter is washed with dilute ammonium chloride solution or dilute potassium chloride solution and alcohol until free from ruthenium. If a large quantity is handled it may be necessary to ignite to platinum sponge and dissolve in aqua regia, expel the HNO₁ as described above, and reprecipitate with NH₄Cl, filter and wash free from ruthenium.

Separation of Platinum from Rhodium. The rhodium salt, like the ruthenium salt, is soluble and can be washed from the platinum salt, (NH₄)₂PtCl₅, as

under Separation of Pt from Ru.

Separation of Platinum from Osmium. Both metals are reduced with zinc as a fine black powder. The metallic residue is washed and carefully ignited at a high temperature under a hood, as the fumes are poisonous and disagreeable like chlorine. The osmium will be converted into OsO₂ and OsO₄, which are very volatile. The residue is dissolved in aqua regia and the platinum is precipitated with NH₄Cl.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF PLATINUM

A. Weighing as Metallic Platinum

1. When the platinum contains only a small amount of impurities a sample of $\frac{1}{10}$ gram or more is taken and dissolved in aqua regia. The solution is gently heated until all is dissolved, adding another portion of aqua regia if necessary. The solution is evaporated, adding HCl from time to time in order to expel the HNO₂. Filter and evaporate again to concentrate the solution. Precipitate with ammonium chloride. After stirring, let stand until the precipitate, (NH₄)₂PtCl₄, settles, overnight if convenient. Filter, wash with alcohol or ammonium chloride solution and alcohol, and ignite to metal, which will be in the form of metallic sponge. Cool in a desiccator and weigh as metallic platinum.

 $\frac{\text{Wt. of Pt found}}{\text{Wt. of sample taken}} \times 100 = \text{per cent of Pt in the material.}$

2. When the platinum solution contains a large amount of impurities, as iron, nickel, magnesia, etc., it is advisable to reduce the platinum to black metallic platinum with zinc, iron or magnesium as follows: The solution is made acid (2 to 5% free HCl) by adding HCl. The Zn, Fe or Mg is added in small quantities at a time until the solution becomes colorless or until the platinum is completely precipitated. After action has ceased the platinum black metal is filtered onto an ashless filter paper and washed with warm dilute HCl to remove any excess Zn, Fe, or Mg that might be present. The filter and its contents are

¹ FeCl₂ in presence of HCl has a solvent action on platinum, hence the iron should be completely reduced.

carefully ignited and afterwards dissolved in aqua regia and treated as directed under A. 1.1

3. If none of the other Hydrogen Sulphide Group metals are present the platinum can be precipitated by hydrogen sulphide, filtered, washed with hot water and ignited to metal. If impurities are present in the sulphide, dissolve in aqua regia and proceed as under A, 1.

B. Weighing as a Salt

1. The procedure is the same as under A. The (NH4), PtCl6 precipitate is washed on a weighed Gooch crucible with alcohol. The crucible and contents are dried at a temperature below 100°. Cool in a desiccator and weigh as (NH4)2PtCl4.

2. After proceeding as described under A, the platinum is precipitated with potassium chloride as K2PtCl4. Transfer to a weighed Gooch crucible and wash well with alcohol. Dry below 100°, cool in a desiccator and weigh as K.PtCla.

C. Determination of Platinum by Electro-analysis

When platinum solutions are acidulated with sulphuric acid and acted upon by a feeble current they give up the metal as a bright deposit upon the electrode. If platinum is used as the electrode, first coat it with a layer of copper and deposit the platinum upon the copper. Wash with water and alcohol and after drying weigh.

Wt. of electrode+Cu+Pt-Wt. of electrode+Cu=Wt. of Pt.

$$\frac{\text{Wt. of Pt}}{\text{Wt. of sample taken}} \times 100 = \text{per cent of Pt in material.}$$

Dr. E. F. Smith, in his work on "Electro-Analysis" recommends that the K₂PtCl₄ be dissolved in water and slightly acidulated with H₂SO₄ (2 or 3% by vol.) and after heating to about 60 to 65° and electrolyzing with $N.D._{100} = .05$ ampere and 1.2 volts, the platinum will be completely precipitated in from four to five hours in a perfectly adherent form. A rotating anode will precipitate the platinum much quicker.

¹ If iron and lead are suspected, the platinum residue is washed with 10% solution of ammonium chloride and then with 10% solution of ammonium acetate and finally with 80% alcohol.

Factor (NH₄)₂PtCl₅ to Pt=0.4393.

Factor K₂PtCl₅ to Pt=0.4013.

RARER ELEMENTS OF THE ALLIED PLATINUM METALS

R. E. HICKMAN¹

IRIDIUM

Element, Iridium. Ir. at.wt. 193.1; sp.gr. 22.3; m.p. 23.50° C.? oxides, IrO2, Ir2O3.

DETECTION

Iridium is found associated with platinum. The element is insoluble in all acids, including aqua regia. Chlorine is the best reagent which forms the chlorides of iridium and yields compounds with other chlorides as K2IrCl6, which is insoluble. If the element is heated in a stream of chlorine in the presence of potassium chloride there forms a salt, K2IrCl6, which is sparingly soluble and is used in the separation of iridium.

The oxide, Ir₂O₃ is formed when K₂IrCl₆ is mixed with sodium carbonate and gently fused at a dull red heat.

 $2K_2IrCl_6+4Na_2CO_3=Ir_2O_8+8NaCl+4KCl+4CO_2+O.$

The fusion is dissolved in water containing ammonium chloride; filter the residue and after ignition, to expel the ammonium chloride, is treated with dilute acid in order to remove the small quantity of alkali. A bluish-black powder is thus obtained which begins to decompose when heated above 800 degrees, and at temperatures somewhat above 1000 degrees is completely broken up into oxygen and the metal.²

The dioxide, kO_2 , is a black powder obtained by heating the hydroxide in a current of carbon dioxide. It is insoluble in acids.2

Caustic Alkalies produce in a boiling solution a dark-blue precipitate of Ir(OH), insoluble in all acids except HCl.

Potassium chloride forms the double salt of K2IrCl6, which is black and is difficulty soluble in water.

Ammonium chloride precipitates black (NH₄)₂IrCl₆, which is difficulty soluble in water.

Hydrogen sulphide precipitates black Ir₂S₃, soluble in (NH₄)₂S.

Metallic zinc precipitates from an acid solution black metallic iridium.

Formic acid and sulphurous acid precipitate black metallic iridium from hot solutions.

Lead acetate gives a gray-brown precipitate.

Potassium and sodium carbonate give a black precipitate and the solution

being highly oxidized on cooling is a nice blue or violet blue.

When an iridium salt is heated with concentrated sulphuric acid and a small amount of silver nitrate is added, there forms a gorgeous blue color by which 1/1000 of a milligram of iridium may be detected. With the presence of HCl and an addition of NH₄Cl and NH₄NO₃, a rose-red color forms. The reaction is likewise very sharp.

¹ Chemist, J. Bishop & Co. Platinum Works.
² "Treatise on Chemistry," Roscoe and Schorlemmer.

ESTIMATION

Substances in which iridium is determined are: platinum scrap, jewelers' sweeps, contact points, ores. Iridium is weighed as the metal.

Preparation and Solution of the Sample

Platinum scrap and contact points, etc., containing iridium dissolve with difficulty in aqua regia, depending on the amount of iridium present. The alloy is dissolved more quickly if it is rolled or hammered to a very thin sheet or ribbon. The alloy of platinum and iridium with an iridium content up to 10% dissolves in aqua regia slowly; an alloy of iridium content of 15% dissolves in aqua regia very slowly and the aqua regia will likely have to be replenished from time to time. An alloy of 25% iridium is practically inscluble in aqua regia. The filings from sweeps, etc., can be dissolved by aqua regia the same as the scrap. After expelling the HNO₃ the platinum and the iridium are precipitated together with NH₄Cl as (NH₄)₂PtCl₅ and (NH₄)₂IrCl₅. When the precipitate is ignited to metal it forms an alloy of platinum and iridium. The iridium imparts a pinkish to a scarlet color to the salt.

If the iridium content is too high to be dissolved in aqua regia the metal can be mixed with NaCl, heated to a dull red heat in a porcelain or silica tube, and moist chlorine passed over the mixture. The iridium will be in the form of a chloride which dissolves in water. After filtering the solution and evaporating with HCl, the iridium as well as the platinum is precipitated with NH₄Cl or H₂S. This is a convenient way on a larger scale to dissolve osmiridium in ores. The writer has had good results with this operation.

When the iridium is contaminated with a large amount of impurities, it may be reduced from the solution with zinc, and the impurities dissolved by HNO₂ and dilute aqua regia; the residue is washed and dried as iridium.

Clean osmiridium grains are also brought into solution by a fusion of KNO₂, NaNO₂ or KClO₃ and NaOH or KOH, leaving the iridium as Ir₂O₃.

SEPARATIONS

Separation of Iridium from Platinum. See Separation of Pt from Ir.

If the platinum and iridium are alloyed with at least ten times their weight of silver and the alloy dissolved in HNO₃, the silver and the platinum dissolves, leaving the iridium insoluble. After washing the residue, treat with a small amount of dilute aqua regia to dissolve any platinum that may be present.

Separation from Osmium. Osmium this is removed by distillation.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF IRIDIUM

1. By Reduction with Zinc

The solution of iridium or iridium and platinum is treated with C.P. granulated zinc and 5% free HCl. The iridium and the platinum are precipitated as fine black metal. The black metal is washed free from impurities and the platinum

insoluble portion is dried, ignited, reduced with hydrogen and weighed as metallic iridium.

2. By Igniting the Salt (NH₄)₂IrCl₆

The percentage of iridium in the salt may be judged fairly well by the color, by comparing with standard iridio-platinum salts. The salt is filtered, washed with alcohol and carefully ignited and weighed as iridio-platinum sponge metal. The percentage of iridium in the sample can be calculated from the weight of the iridium obtained. The two metals are now digested at about 40 or 50° C. in aqua regia, diluted with about five times its weight of water—the aqua regia being renewed until it is not longer colored. The residue is pure iridium.

3. By Obtaining it as a Residue

The iridium and the platinum, etc., are alloyed with at least ten times its weight of silver and the alloy dissolved in HNO₂. The residue will be a small amount of platinum, gold, if any present, and iridium. Add a small amount of dilute aqua regia, which will dissolve the gold and the rest of the platinum, leaving the iridium as a black residue. This is filtered, washed and ignited and weighed as metallic iridium.

One part of the iridium material is alloyed with eight parts of lead. This is packed in a graphite capsule, and the whole embedded in charcoal in an ordinary assay crucible. Heat to a high temperature in a furnace for several hours. When the crucible and contents are cold, remove the lead and clean well. Treat the lead with dilute HNO₃, thus removing the lead and leaving the iridium as the residue. Wash thoroughly and treat the residue with dilute aqua regia, which leaves the residue as pure iridium. If other metals of the platinum group are present, see separations under those metals.

PALLADIUM

Element, Palladium. Pd. at.wt. 106.7; sp.gr. 11.9; m.p. 1549° C.; oxides, PdO, PdO₂.

DETECTION

This metal is also found associated with platinum and iridium as well as ruthenium, rhodium, and osmium. It occurs in the metallic state sometimes with gold and silver. It resembles platinum as to luster and color. Palladium sponge when heated slightly gives a rainbow effect due to the formation of oxides. Hydrogen passed over the sponge restores it to the original color. It dissolves in HNO₃ and boiling H₂SO₄. HCl has little action upon it. It is readily soluble in aqua regia, forming PdCl₂. PdCl₄ is unstable.

Palladium monoxide, PdO, is formed by a long-continued heating of the spongy metal in a current of oxygen at a temperature from 700 to 840° or by heating a mixture of a palladium salt with potassium carbonate. The pure hydrated oxide is best prepared by the hydrolysis of the nitrate.

It acts as a powerful oxidizing agent to organic substances, and is reduced to metal by hydrogen peroxide.¹

1 "Treatise on Chemistry," Rowse and Schorlemmer.

Palladium dioxide, PdO₂, is obtained in an impure hydrated form as a brown precipitate by the addition of caustic soda to potassium palladichloride. This is soluble in acids, but becomes less soluble when preserved. It can be obtained free from alkali and basic salts by the anodic oxidation of the nitrate, but it is not quite free from monoxide. The dioxide very readily decomposes into the monoxide and oxygen, and cannot be obtained in the anhydrous state. It acts as a vigorous oxidizing agent and decomposes hydrogen peroxide.

Alkalies precipitate in a concentrated solution a dark-brown precipitate soluble in an excess of the reagent. If boiled a brown palladous hydroxide is

precipitated. The anhydrous oxide is black.

Ammonia added to a concentrated solution gives a flesh-red precipitate. PdCl₂NH₂, soluble in excess of ammonia. If HCl is added to this solution the yellow compound of pallad-ammonium chloride, Pd(NH₂Cl)₂, is deposited.

Sulphur dioxide precipitates the metal from the nitrate or sulphate solution

but not from the chloride.

Cuprous chloride precipitates the metal from the sulphate, nitrate and chloride solution when they are not too strongly acid.

Mercuric cyanide precipitates a yellowish-white gelatinous precipitate, $Pd(CN)_2$, insoluble in dilute acids, but dissolving in ammonia and in potassium cyanide to $K_2Pd(CN)_4$.

Potassium iodide precipitates black palladous iodide, PdI₂, insoluble in water, alcohol, and ether, but soluble in an excess of reagent.

Hydrogen sulphide precipitates black palladous sulphide, PdS, soluble in HCl and aqua regia, but insoluble in (NH₄)₂S.

Potassium nitrite precipitates a yellow crystalline powder, K₂Pd(NO₂)₄.

Ferrous sulphate slowly produces a black precipitate of metallic palladium from the nitrate.

Ammonium chloride precipitates palladium as $(NH_4)_2PdCl_4$ from the nitrate.

Formic acid, zinc and iron reduce to metallic palladium.

Soluble carbonates precipitate brown palladous hydroxide, Pd(OH)₂, soluble in excess, and reprecipitated on boiling.

Phosphuretted hydrogen gas precipitates palladium phosphide. (Difference from Pt, Rh, and Ir.)

Alcohol precipitates, on boiling, metallic palladium.

Alkaline tartrates and citrates form yellow precipitates in a neutral solution from the nitrate.

Stannous chloride produces a brownish-black precipitate, soluble in hydrochloric acid to an intense green solution.

Potassium bisulphate attacks the metal readily.

An alcoholic solution of iodine dropped on the metal will turn black.

Acetylene gas passed through an acidfied solution containing Pd, a brown precipitate is obtained which, upon ignition, yields Pd. In this way Pd may be quantitatively separated from Cu.

ESTIMATION

Palladium is determined in alloys, ores, jeweler's sweeps, etc.

Preparation and Solution of the Sample

The solubility of palladium has been taken up under Detection. Palladium when alloyed with platinum, or an alloy of platinum, iridium and palladium, dissolves with the other metals in aqua regia as the chloride When palladium

is alloyed with silver the palladium and silver are dissolved in HNO₃, from which the silver can be separated.

Separations

Separation of Palladium from Platinum and Iridium. The chlorides of palladium, platinum and iridium in solution must be free from HNO₂. The platinum and the iridium are precipitated with NH₄Cl, leaving the palladium in solution. The precipitate is put on a filter and washed free from Pd with NH₄Cl solution and alcohol.

Separation of Palladium from Silver and Gold. At least three times the weight of the gold in silver should be present in the alloy in order to separate the silver and palladium from the gold. The silver and the palladium will dissolve in HNO₃, leaving the gold as the residue. This is filtered off and the silver may be precipitated with HCl. The silver chloride is filtered off and washed with hot water acidulated with HCl until free from palladium. Since AgCl tends to retain palladium it is advisable to redissolve the silver with HNO₃ after reduction of AgCl and reprecipitate the chloride to obtain a complete separation of palladium.

Separation of Palladium from Platinum. The chlorides of platinum and palladium being free from HNO₃ and having an excess of HCl is diluted with water. A 10% solution of potassium iodide is added until all of the palladium is precipitated. Avoid adding a large excess. The precipitate of PdI₂ is filtered off and washed free from platinum and alkali with water slightly acidulated with HCl. The filter is ignited to metallic sponge in a current of hydro-

gen.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF PALLADIUM

1. The palladium is precipitated from the solution by granulated sine, the solution having a small amount of free hydrochloric acid. The residue, after the zine is dissolved, is put on a filter and washed free from impurities. Ignite the filter and dissolve in a small amount of aqua regia and evaporate to a syrupy consistency. Dilute with a small amount of water and add a few drops of HNO₃; precipitate the palladium with NH₄Cl crystals. Heat for a few minutes and let cool. Filter, wash with alcohol, and ignite. Reduce in hydrogen or moisten with formic acid to reduce to metal any oxide that may have formed. Dry and weigh as metallic palladium.

2. With the solution containing about one-fifth the volume of free HCl, the palladium is precipitated with 10% KI solution. Heat to nearly boiling, filter, wash free from iron, etc., with 1:4 HCl. Ignite, cool, reduce in hydro-

gen or moisten with formic acid, dry and weigh as metallic Pd.

3. The filtrate from the platinum precipitation or the nearly neutral solution containing the Pd is made to about 150 cc., and the Pd is precipitated by adding a solution of dimethylglyoxime (1% solution in alcohol). Bring to boiling and let stand overnight if convenient. Filter on a weighed Gooch crucible and wash with hot water slightly acidified with HCl, then with alcohol Dry and weigh as $(C_8H_{14}N_4O_4)Pd$, which contains 31.67% Pd.

4. The nitric acid in the palladium solution is expelled by evaporating with HCl. Neutralize the chloride solution almost completely with sodium carbonate and mix the solution with a solution of mercuric cyanide, Hg(CN)₂, and heat gently for some time. Let stand until cool, overnight if convenient. A yellowish-white precipitate of Pd(CN)₂ is formed. Filter, wash with 1% Hg(CN)₂ solution, ignite and reduce in hydrogen to metal, or reduce with formic acid, dry, and weigh as metallic Pd.

RUTHENIUM

Element, Ruthenium. Ru. at.wt. 101.7; sp.gr. 12; m.p. 2450° C.? oxides, Ru₂O₂, RuO₄.

DETECTION

This element is found only in platinum ores. It is barely soluble in aqua regia, and insoluble in acid potassium sulphate. It dissolves when fused with KOH and KNO₃. The solution of the fusion when dissolved in water forms potassium ruthenate, K₂RuO₄, from which HNO₃ precipitates the hydroxide, which is soluble in HCl. The treatment with chlorine and KCl at a high temperature yields a salt of K₂RuCl₅. The salts that are most common are K₂RuCl₅ and K₂RuCl₆.

The oxide, Ru₂O₂, is formed when finely divided ruthenium is heated in the air, forming a blue powder which is insoluble in acids. It can also be obtained by heating the trihydroxide, Ru(OH)₃, in dry carbon dioxide which forms a black, scaly mass.¹

Ruthenium dioxide, RuO₂, is obtained by roating the disulphide or sulphate in contact with air. It is likewise formed when the metal is fused in an oxidizing atmosphere, when it burns with a sparkling smoky flame, and evolves an ozone-like smell.¹

Ruthenium tetroxide, RuO₄, is formed in small quantities when the metal is heated at 1000° in a current of oxygen, although when heated alone it decomposes about 106°. It is prepared by passing chlorine into a solution of potassium nitrosochlororuthenate, or of potassium ruthenate or sodium ruthenate prepared by fusing the metal with sodium peroxide; the liquid becomes heated and the tetroxide distills over and is deposited in the receiver. The moist oxide quickly decomposes. In the dry state it is fairly stable, but decomposes in sunlight with the formation of lower oxides. It dissolves slowly in water, and the solution when it contains free chlorine or HCl may be kept without alteration for some days if light be excluded, but when pure slowly deposits a black precipitat.

In addition to the above oxides, salts corresponding to the acidic oxides RuO₂ and Ru₂O₇ have been prepared.

Potassium hydroxide precipitates a black hydroxide easily soluble in HCl. Hydrogen sulphide slowly produces brown Ru₂S₃.

Ammonium sulphide precipitates brownish black sulphide.

Metallic zinc precipitates metallic ruthenium, the solution first turning blue. Potassium sulphocyanate gives on heating a dark brown solution.

Silver nitrate gives a rose red precipitate.

Mercurous nitrate produces a bright blue precipitate.

Zinc chloride produces a bright yellow precipitate which darkens on standing.

¹ "Treatise on Chemistry," Roscoe and Schorlemmer.

Potassium iodide after a time by heating precipitates the black sesquiiodide.

ESTIMATION

Ruthenium is generally estimated in alloys and ores or residues.

Preparation and Solution of the Sample

When ruthenium is alloyed with platinum or gold, aqua regia dissolves these metals, forming the chlorides of platinum, gold and ruthenium. The ruthenium in ores is in the form of an alloy with platinum or osmiridium. This is fused with KNO₃ and KOH in a silver crucible, the osmium and the ruthenium forming salts as described above, while the iridium remains as an oxide.

Separations

Separation of Ruthenium from Platinum. The two metals are precipitated with KCl and the potassium rutheniochloride is dissolved out with cold water containing a very small amount of KCl and alcohol. The ruthenium is then precipitated from an acid solution by additions of granulated zinc.

A separation may be made by alloying with silver and dissolving the platinum and silver by HNO₃, the ruthenium remaining as the residue.

From a concentrated solution of these metals precipitate the platinum with NH₄Cl. Evaporate the filtrate with potassium nitrate to dryness and boil the residue with alcohol when the residual platinum will remain behind and the ruthenium goes into solution.

Separation of Ruthenium from Iridium. The two metals are fused with KOH and KNO₃ as described above, the ruthenium forming a salt soluble in water and the iridium remaining as an oxide.

To the solution of the two metals, sodium nitrite is added in excess, with sufficient sodium carbonate to keep the liquid neutral or alkaline. The whole is boiled until an orange color appears. The ruthenium and the iridium are converted into soluble double nitrites. Sodium sulphide is then added, small quantities at a time until the precipitated ruthenium sulphide is dissolved in the excess of alkaline sulphide. At first the addition of the sulphide gives the characteristic crimson tint due to ruthenium, but this quickly disappears and gives a bright chocolate-colored precipitate. The solution is boiled for a few minutes, and allowed to become perfectly cold and then dilute HCl cautiously added until the dissolved ruthenium sulphide is precipitated and the solution is faintly acid. The solution is filtered and the precipitate washed with hot water. The filtrate will be free from ruthenium.

The fusion with KOH and KNO₃ as described above is dissolved in water in a flask or retort; chlorine is passed through this solution and thence into two or three flasks containing a solution of KOH and alcohol. The two or three flasks which form the condensing apparatus should be kept as cold as possible. The ruthenium is transformed into volatile RuO₄ which condenses in the flasks, while the iridium remains in the retort.

¹ "Select Methods in Chemical Analysis," Sir Wm. Crookes.

Separation of Ruthenium from Rhodium. The mixed solution of the two metals is treated with potassium nitrite as described above. The orange-yellow solution is evaporated to dryness upon the water bath and treated with absolute alcohol. The rhodium remains undissolved and can be filtered off and washed with alcohol. The rhodium salt can be ignited with NH₄Cl and after washing yields metallic rhodium. See Separation of Rhodium from Ruthenium.

Separation of Ruthenium from Osmium. See Separation of Osmium from Ruthenium.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF RUTHENIUM

Ruthenium is best weighed as the residue or metallic ruthenium after the other metals are eliminated. It may be precipitated from the solution with zinc and after filtering, washing and igniting the filter the impurities are dissolved in dilute aqua regia; reduce in hydrogen and the residue is ruthenium. The platinum metals may be alloyed with silver and after dissolving out the silver, platinum and palladium with HNO₁, the residue is treated with dilute aqua regia as above, leaving the residue as ruthenium. If iridium is present in the residue, weigh as iridium and ruthenium. Make a fusion with KOH and KNO₂ as described under iridium; dissolve the fusion and filter off the Ir₂O₂, and wash with sodium hypochlorite solution and then with water. Ignite and weigh as Ir₂O₃. Calculate the weight of Ir which is to be subtracted from the weight of the ruthenium and iridium. The difference is ruthenium. If rhodium is present fuse with KHSO₄ as described under rhodium.

The solution of Ru₂Cl₆ is evaporated to drive off the excess acid and then taken up with 50° to 60 cc. of water and a few pieces of magnesium added gradually. The solution is filtered and the residue washed with a 5% H₂SO₄ solution to get rid of any magnesium that may be present. Ignite at the lowest possible temperature, and heat in hydrogen to red heat, cool and weigh as metallic ruthenium.

RHODIUM

Element, Rhodium. Rh. at.wt. 102.9; sp.gr. 12.1; m.p. 1950° C.; oxides, RhO, Rh₂O₃, RhO₂.

DETECTION

Rhodium is found only in platinum ores. It is a white metal, difficultly fusible, and insoluble in acids. Rhodium, however, dissolves in aqua regia when alloyed with platinum, to a cherry red solution. It is also soluble in molten phosphoric acid and dissolves when fused with acid potassium sulphate with the formation of $K_3Rh(SO_4)_3$. If the metal is treated with chlorine in the presence of sodium chloride there forms a soluble salt, Na_3RhCl_6 .

Rhodium monoxide, RhO, is obtained by heating the hydroxide Rh(OH)₃, by cupellation of an alloy of rhodium and lead, or by igniting the finely-divided metal in a current of air. It is a grey powder with a metallic appearance, and

is not attacked by acids, and when heated in hydrogen is reduced with evolution of light.1

The oxide, Rh₂O₃, is obtained as a grey iridescent spongy mass by heating the nitrate. It is also formed as a crystalline mass when sodium rhodochloride is heated in oxygen. It is perfectly soluble in acids ¹

Rhodium dioxide, RhO₂, is obtained by repeated fusions of the metal with KOH and KNO₃. It is attacked neither by alkalies nor by acids and is reduced by hydrogen only at a high temperature.¹

Hydrogen sulphide precipitates from hot solution and incompletely a brown

rhodium sulphide, Rh₂S₃.

Potassium hydroxide precipitates at first a yellow hydroxide, Rh(OH)₁ + H₂O soluble in an excess of the reagent. If boiled, a gelatinous, dark-brown hydroxide, Rh(OH)₂, separates. A solution of Na₂RhCl₆ does not show this reaction immediately, but the precipitate appears in the course of time. An addition of alcohol causes a black precipitate immediately.

Ammonium hydroxide produces a yellow precipitate which is insoluble in HCl.

Potassium nitrite precipitates from hot solutions a bright yellow precipitate of double nitrite of potassium and rhodium.

Zinc, iron and formic acid precipitate rhodium as a black metal.

Hydrogen reduces rhodium salts.

To detect small amounts of rhodium in the presence of other metals, evaporate the solution and displace with a fresh solution of sodium hypochlorite; the yellow precipitate formed is soluble after an addition of acetic acid. After a long agitation the solution changes to an orange-yellow color and after a short time the color passes and finally a grey precipitate settles and the solution turns sky-blue.²

ESTIMATION

Rhodium is estimated mainly in ores, thermo couples and salts.

Preparation and Solution of the Sample

When rhodium is estimated in thermo couples or other alloys of platinum and rhodium the wire or sample is rolled to a thin ribbon and dissolved in aqua regia. Both metals will go into solution, forming the chlorides of rhodium and platinum. The aqua regia will have to be replaced from time to time, as the alloy dissolves slowly.

The rhodium from salts is precipitated with zinc and the black metallic rhodium cleaned with dilute aqua regia, filtered, washed, ignited and reduced with hydrogen.

Some alloys and ores are alloyed with silver and the silver and platinum are dissolved in HNO₃. The residue is cleaned with aqua regia, dried, and weighed as metallic rhodium. If the residue is ignited reduce with hydrogen.

The material or residue containing rhodium is fused with KHSO₄ for some time at a low red heat and the mass leached with hot water acidified with HCl. The rose-red solution contains the rhodium.

¹ "Treatise on Chemistry," Roscoe and Schorlemmer.

² Prescott and Johnson.

Separations

Separation of Rhodium from Platinum. Alloys and ores containing platinum and rhodium dissolve slowly in aqua regia as stated above. After expelling the HNO₃ add NH₄Cl. The precipitate is filtered and washed with dilute ammonium chloride solution, which dissolves the rhodium salt. A very small amount of rhodium will color the filtrate pink to a rose-red color, depending on the amount of rhodium present.

Separation of Rhodium from Iridium. See Separation of Rh from Pt.

A separation can be made by adding sodium nitrite in excess to the solution of the two metals, with a sufficient quantity of sodium carbonate to make the solution neutral or alkaline; this is boiled until the solution assumes a clear orange color. The rhodium and iridium are converted into soluble double nitrites. A solution of sodium sulphide is added in slight excess and the liquid made slightly acid. The rhodium is precipitated as dark-brown rhodium sulphide.

A solution of rhodium and iridium is evaporated with HCl and displaced with a large excess of acid sodium sulphite, NaHSO3, and allowed to stand sometime when a pale yellow double salt of rhodium and sodium sulphite slowly separates out while the solution becomes nearly colorless. the precipitate, and heat with hot concentrated H₂SO₄ till the sulphurous acid is driven off. Heat the material in a crucible until rid of all free sulphuric Then the iridium is dissolved out as a sulphate with a deep chromegreen color, while a double salt of sodium sulphate and rhodium oxide remains This is flesh color insoluble in water and acids. Boil with aqua regia, wash, dry, heat and it decomposes into rhodium and sodium sulphate.1

Rhodium can also be separated from iridium, when the latter is present as an iridic salt such as Ir(SO₄)₂, by precipitating the mixed salts with caustic potash, dissolving the hydroxides in dilute sulphuric acid and adding caesium sulphate. The sparingly soluble rhodium caesium-alum separates in the cold, and can readily be purified by recrystallization and then by electrolysis.²

Separation of Rhodium, Platinum and Palladium. Having the three in solution precipitate the platinum with NH₄Cl as described under Flatinum. After filtering off the (NH₄)₂PtCl₆ precipitate, and after neutralizing the filtrate with Na₂CO₂ add mercuric cyanide to separate the palladium as Pd(CN)₂ as described under palladium. The filtered solution is evaporated to dryness with an excess of HCl. On treating the residue with alcohol, the double chloride of rhodium and sodium is left undissolved as a red powder. By heating this in a tube through which hydrogen is passed the rhodium is reduced to the metallic state and the sodium chloride is washed out with water leaving a grey powder of metallic rhodium.

Separation of Rhodium from Ruthenium. The solution containing the two metals is treated with sodium nitrite as above and evaporated to dryness. The residue is powdered and treated in a flask with absolute alcohol. filtering and washing with alcohol the rhodium remains undissolved.

The substance or residue containing the rhodium and ruthenium may be fused with KHSO4 in a porcelain or platinum crucible causing the rhodium to The ruthenium remains insoluble. go into solution as already described.

¹ "Hand Book of Chemistry," Dammer.
² "Treatise on Chemistry," Roscoe and Schorlemmer.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF RHODIUM

The solution containing rhodium is treated with zinc and the residue is washed well with hot water acidulated with HCl. The residue is then cleaned with dilute aqua regia and the black metallic rhodium is filtered off, dried, and ignited in hydrogen. Cool and weigh as metallic rhodium.

The metals may be melted with lead or silver and the buttons dissolved in dilute HNO₃, leaving a residue which is treated with dilute aqua regia to dissolve any platinum that might be present. The residue is treated with salt and chlorine and the melt dissolved in water as described under Iridium. The iridium is precipitated with NH₄Cl and the rhodium with zinc. The rhodium black is cleaned with dilute aqua regia, filtered, washed and ignited. Reduce in hydrogen and weigh as metallic rhodium.

The solution containing the rhodium is made alkaline with KOH and then acid with formic acid, boil, and the rhodium will be precipitated as finely divided metallic rhodium. After filtering proceed in the usual manner.

OSMIUM

Element, Osmium. Os. at.wt. 190.9; sp.gr. 22.4; m.p. 2700° C.? oxides, OsO, Os₂O₂, OsO₂, OsO₄.

DETECTION

Osmium occurs with platinum ores as a natural alloy with iridium (Osmiridium), and remains undissolved in the form of hard, white metallic-looking grains when the ores are treated with aqua regia. The chlorides, OsCl₂ and OsCl₄, combine with the alkali chlorides. Through the action of HNO₃, aqua regia or heating in a stream of moist chlorine, osmic tetroxide is formed. Osmium is very volatile and the fumes are poisonous. It is detected readily by the odor when heated, as the fumes are highly corrosive and disagreeable like chlorine. Chlorine passed over hot osmium mixed with KCl gives K₂OsCl₆, which dissolves in cold water.

The oxy-hydrogen flame volatizes the metal but does not melt it. When strongly heated in contact with air, the finely divided osmium burns and is converted into OsO₄ commonly called osmic acid.

Osmium monoxide, OsO, is obtained when the corresponding sulphite mixed with sodium carbonate is ignited in a current of carbon dioxide. It is a greyish-black powder insoluble in acid.¹

The oxide, Os₂O₃, is a black insoluble powder obtained by heating its salts with sodium carbonate in a current of carbon dioxide.¹

Osmium dioxide, OsO₂, is obtained from its salts in a similar way to the foregoing oxides. It is likewise formed when its hydroxide is heated in a current of carbon dioxide.¹

¹ "Treatise on Chemistry, Roscoe and Schorlemmer.

Osmium tetroxide, OsO₄. Very finely-divided metallic osmium oxidizes slowly at the ordinary temperature, and at about 400° takes fire with formation of OsO4. The denser the metal the higher is the temperature needed for oxidation.1

Hydrogen sulphide precipitates dark brown osmium sulphide, OsS₂, but only in the presence of some strong mineral acid; from an aqueous solution of osmic acid there forms a dark brownish-black sulphide, OsS₄. These are insoluble in ammonium sulphide.

Potassium hydroxide precipitates reddish-brown osmium hydroxide. $Os(OH)_4$.

Ammonium hydroxide precipitates the osmium hydroxide.

Zinc and formic acid precipitate black metallic osmium.

Hydrogen reduces osmium compounds to the metal.

Potassium nitrite added to a solution of osmic acid reduces it to osmous acid which unites with an alkali forming a beautiful red salt.

Sodium sulphite yields a deep violet coloration and a dark blue osmium sulphite separates out gradually.

Phosphorus reduces osmium from an aqueous solution.²

Mercury precipitates osmium from an aqueous solution of osmic acid mixed with HCl.2

Stannous chloride produces a brown precipitate, soluble in HCl to a brown fluid.3

ESTIMATION

Osmium is estimated mainly in osmiridium and platinum residues.

Preparation and Solution of the Sample

After the platinum is extracted the residue or osmiridium is mixed with two or three times its weight of common table salt. The mixture is put in a porcelain or silica tube and heated to a dull red heat; moist chlorine is then passed through the tube and thence through receivers containing KOH and C₂H₅OH to catch the Os and Ru that pass over. The mass is cooled and dissolved with water. After several treatments the entire group of platinum metals will be in solution.

The osmium material may also be fused with KOH and KNO2 and the melt dissolved in water. The osmium will be in solution as potassium osmate, K₂OsO₄, while the iridium remains as residue.

Cold selenic acid has no appreciable action on osmium; at about 120°, however, the metal is dissolved to a colorless solution which contains selenious acid and OsO4, but no selenate.4

Separations

In most cases osmium is separated from the other metals present by distillation or volatilization. See next page.

² "Hand Book of Chemistry," Gmelin.
³ "The Sampling and Assay of the Precious Metals," E. A. Smith.
⁴ "Chemical Abstracts," April 10, 1918.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF OSMIUM

The osmium is very difficult to ascertain on account of the element being very volatile.

The potassium osmate, K₂OsO₄, solution is put in a small retort, and boiled with HNO₃, the OsO₄, is conducted into receivers containing NaOH solution and C2H3OH. After acidifying with a little HCl the osmium can be precipitated with Na₂S₂O₃ as a brown precipitate of OsO₄ which is filtered, washed, dried and weighed as the oxide, or reduce in hydrogen and weigh as the metal. The osmate solution from the receivers above is heated gently and strips of aluminum are plunged in; the osmium will be deposited in metallic form, while the aluminum dissolves in the soda. Care must be taken not to add too much aluminum, as an aluminate might be precipitated which is troublesome. the solution is discolored the dense precipitated osmium is washed by decantation with water to remove the sodium aluminate, and then with 5% H₂SO₄ solution to remove the excess aluminum. The osmium is dried in a belljar filled with hydrogen, then heated to a dull redness and cooled in a current of hydrogen. The osmium is weighed as the metal. As a check the osmium may be driven off in the form of OsO₄ by heating to redness with plenty of air, or better, in a current of oxygen and weighing again.1

The osmate solution from the condensing receivers or from the fusion of KOH and KNO₃ containing the ruthenium and osmium is placed in a retort and HCl is added. A slow current of air or oxygen is passed through the retort and thence through receivers containing KOH and alcohol similar to the ones mentioned above. These receivers are kept as cold as possible. The osmium is distilled over as OsO₄ while the ruthenium remains in the retort. Combine the solutions in the receivers and proceed to determine the osmium as described above.

The potassium or sodium osmate solution from the receivers above or where osmium tetroxide is dissolved in potassium hydroxide solution and alcohol is heated at 40 or 50° to form potassium osmate. A slight excess of dilute sulphuric acid is added and then 10 cc. more of alcohol in order to prevent reoxidation. After ten or twelve hours, a bluish-black deposit settles, while the supernatant liquid is colorless and free from osmium. The precipitate is filtered, washed with aqueous alcohol, and converted into metallic osmium by reduction in a current of hydrogen.²

¹ "Select Methods of Chemical Analysis," Sir Wm. Crookes.
² "Journal London Chemical Society Abstracts," 1907, by Carl Paal and Conrad

ASSAY METHODS OF PLATINUM ORES, ETC.

Take from 10 to 30 grams of the material and place in a $2\frac{1}{2}$ - or 3-in. scorifier with about 20 to 30 grams of test lead and cover with litharge Fuse in a muffle for a half hour. When cool clean the lead button thoroughly and dissolve the lead with dilute nitric acid (1:5). When the lead is dissolved, filter, and wash the residue with hot water till free from lead. Dry the filter and transfer the bulk of the residue to a small glass beaker. Burn the filter, and add the ash to the main residue. This is treated with dilute aqua regia to remove any gold, platinum, etc., that may be present. Filter and wash thoroughly with hot water and ignite at a low temperature for a short time only, as osmium will volatilize. Weigh as osmiridium. (See Ir and Os.)

Take another portion of 10 to 30 grams of the material and treat with aqua regia two or three times. This will bring the platinum and the alloys (except osmiridium) into solution. After filtering make up the volume to 500 to 1000 cc., depending on the amount of platinum present. Take two or three portions of 25 to 50 cc. of the solution and vaporate to nearly dryness with additions of HCl to get rid of the HNO₃. Take up with a small amount of water and add ammonium chloride. Digest on the water bath and let cool overnight if convenient. Filter onto an ashless filter and wash with dilute ammonium chloride solution and alcohol. Ignite cautiously and weigh as platinum and iridium sponge. For the determination of iridium see under Iridium.

The filtrate from the platinum precipitation is treated with ferrous sulphate to precipitate the gold. Digest and filter out the gold. Ignite and alloy with silver and part for gold.

In the filtrate from the gold precipitation the palladium and rhodium are treated with zinc and HCl until the solution is colorless. Filter, wash well with hot water and dilute HCl.

Ignite, reduce in hydrogen, cool and weigh as Pd and Rh. Treat with HNO₃. Filter, wash well, ignite and reduce in hydrogen, cool and weigh as metallic rhodium. The difference is palladium, or determine this as described under palladium.

DETERMINATION OF PLATINUM AND PALLADIUM¹

Special Methods

Dissolve a 100-gram sample in aqua regia, and expel the nitric acid by evaporation and the addition of small amounts of hydrochloric acid. Take up with a few cc. of dilute hydrochloric acid. If there should be present a large amount of reduced gold, add a few drops of nitric acid and heat the solution for a few minutes. Dilute to 800 cc. with water, and let it stand in a cool place until solution clears. Filter off silver chloride and wash it with cold water. Pass sulphur dioxide gas through the filtrate to reduce the gold (palladium, etc., is also reduced). Decant the clear solution on a tight filter paper, and wash several times with hot water by decantation. Then pour over the gold in the beaker, 50 cc. of nitric acid, and boil for a few minutes to dissolve the reduced palladium. Add 50 cc. of hot water and filter on the same filter paper and wash several times with hot water. Add 15 cc. of sulphuric acid to the filtrate, evaporate and heat to heavy fumes. to 200 cc. with water and boil for a few minutes, and filter off any gold and lead sulphate if present. Now pass hydrogen sulphide gas through the hot solution to precipitate the sulphides of platinum and palladium, etc. Filter and wash with hot water. Place the filter paper with the precipitate in a porcelain crucible, dry, burn and ignite. Now touch the residue with the reducing flame of a Bunsen burner to reduce to metal any oxide of palladium that may have formed. Dissolve the residue with a few cc. of aqua regia, and transfer the solution to a tall 300-cc. beaker, and evaporate carefully to dryness on a steam or sand bath. Then moisten the residue with hydrochloric acid and evaporate to dryness again. Moisten the dry residue once more with hydrochloric acid and evaporate to dryness.

Now take up with 16 cc. of hydrochloric acid and 4 cc. of water, cover beaker and boil gently for a moment. Filter on a small filter paper and wash with a small stream of hot water. Discard the residue. Dilute filtrate to 60 cc., cover beaker and heat to near boiling point. Then add 16 grams of ammonium chloride and heat gently to near boiling until all ammonium chloride is in solution. Remove beaker from the hot plate, and let it stand over night in a cool place. Filter rapidly (using suction) on a tight, double filter paper, and wash with ammonium chloride solution (200 grams per liter of water). As the ammonium chloroplatinate is somewhat soluble if exposed to air, the precipitate should be covered with the wash solution all the time during filtration. Then before the ammonium chloride solution is all sucked through, wash once or twice with 95% grain alcohol. Save filtrate for palladium determination. Place the filter paper with the precipitate in a porcelain crucible, so that the precipitate does not come in contact with the sides of the crucible; if it does, a platinum mirror will form, that cannot be removed. Dry gently and smoke off the filter paper (without burning it with a flame), and finally ignite at a bright red heat. Cool and weigh metallic platinum.

Add to the filtrate from the ammonium chloroplatinate precipitate, 16 cc. of nitric acid, stir, cover beaker, placing a glass triangle under the watch glass, and let it stand over night on steam plate. When the solution is super-saturated, as indicated when half of the solution is filled with ammonia salts,

¹ Contributed by F. Jaeger, Chemist, Nichols Copper Co.

remove the beaker from the steam plate and cool the solution. Filter off the ammonium chloropaladate just like the platinum salt and wash with ammonium nitrate solution (200 grams per liter of water). Finally wash with 97% grain alcohol. The solubility of ammonium chloropalladate is greater than of the platinum salt when exposed to air, therefore great care must be taken in filtering it. Place the precipitate with the filter paper in a porcelain crucible, dry, smoke off filter paper and finally ignite at a bright red heat. When cool, reduce any oxide that may have formed with the reducing flame of a Bunsen burner. Cool and weigh metallic palladium.

To confirm that all platinum and palladium is precipitated, neutralize the filtrate from the ammonium chloropalladate with a saturated solution of sodium carbonate, then add 30 cc. of formic acid, and boil for about one hour. Any platinum or palladium if still present will be precipitated as black powder.

Note. All evaporations should be made on a steam or sand bath, if not

incomplete precipitation of platinum will be obtained.

Weigh out 1,000 gram sample and dissolve it with dilute Refined Silver. nitric acid. Filter off the gold and any undissolved platinum, and then separate the gold from the platinum as described under "Gold Bar," and add the solution to the main filtrate. Dilute the filtrate from the gold residue, so that there will be 10 grams of silver per liter of solution, and then add a slight excess of hydrochloric acid to precipitate all the silver. Stir well and let it Decant the clear solution and wash the precipitate on a Buechner funnel with cold water. Evaporate the filtrate to a small volume. Now mix the silver chloride, with about ten times its weight, with soda ash (which contains a small amount of corn starch) and dry. Place the mass in 30 grams crucibles, and fuse for about 30 minutes. Pour in molds. When cool, hammer off excess of slag, and finally boil with hydrochloric acid to clean the silver buttons. Then dissolve with dilute nitric acid and precipitate silver as silver chloride as already described. Another silver chloride precipitation will be necessary to separate all platinum and palladium from the silver.

Combine all filtrates and evaporate to dryness on steam plate. Take up with a few cc. of hydrochloric acid and water, filter off the silver chloride and wash with cold water. This small amount of silver chloride carries down considerable of platinum and palladium. Therefore place the filter paper with the silver chloride in a 3-inch scorifier, dry, add 40 grams of test lead and a pinch of borax and scorify. Then cupel the lead button. Dissolve the silver buttons with dilute nitric acid and reprecipitate silver with hydrochloric acid. Finally when the pure white color of the silver chloride indicates that it is free from platinum and palladium, evaporate the filtrate to dryness on steam plate. Take up with 16 cc. of hydrochloric acid and 4 cc. of water. Boil for a minute, filter, and precipitate platinum and palladium as described under "Gold Bar."

Copper Anode Slimes. Take a 1,000-gram sample. Weigh out 3 gram portions into 3-inch scorifiers and mix each with 40 grams of test lead and a pinch of borax and litharge. Scorify and cupel. Dissolve silver buttons with dilute nitric acid, and proceed as described under "Refined Silver."

Determination of Platinum and Palladium in Refined Gold¹

The sample may be in the shape of drillings, but from a bar it is easier to roll the gold into a thin ribbon.

Fifty grams' of gold sample is sufficient for gold which has been parted

with sulphuric and nitric acids.

Dissolve sample in a 1,500 cc. beaker with 50 cc. of nitric acid (1.42) and 150 cc. of hydrochloric acid (1.19) using no water. Heating is not necessary. After complete solution of the sample, evaporate solution to a syrup of about 40 cc. volume, taking care not to evaporate too far, otherwise, some gold will become reduced and separate out; add 100 cc. of hydrochloric acid and re-evaporate the solution to syrup, repeating this operation four times in order to remove all nitric acid.

After the last evaporation, dilute with hot water, boil, add about 50 cc. hydrochloric acid (1.19) to clear up solution: volume of solution should be about 500 cc.

To the boiling solution³ gradually add a mixture of 50 grams ammonium oxalate and 50 grams oxalic acid, which should precipitate all the gold, but should there be any doubt add more of the mixture of the salts. Dilute the solution to about 1,000 cc. in volume and allow to settle in a warm place over night.

Filter off the gold, washing by decantation into a 1,500 cc. beaker. For extreme accuracy, this gold may be redissolved, re-evaporated and reprecipitated, this time with sulphur dioxide gas. This is more of a precautionary measure, for as a rule, no platinum or palladium will be found with the gold.

To the solution from the gold add 5 grams of 30 mesh C.P. zinc. This precipitates any gold left in the solution along with the silver, platinum,

palladium, tellurium, copper, etc.

Filter as soon as precipitation is complete and wash by decantation keeping as much of the precipitate in the beaker as possible. Ignite filter paper and transfer residue and precipitate to a 250 cc. beaker, dissolve in 10 cc. aqua regia and after complete solution, add 5 cc. sulphuric acid (1.84) evaporate to fume of SO₃ and fume well, 4 cool, dilute to 100 cc. bring solution to boiling and add 1 drop of hydrochloric acid to precipitate the silver, filter in a 400 cc. beaker, dilute filtrate to 200 cc. volume, add 5 cc. hydrochloric acid (1.19),

¹ Contributed by S. Skowronski, Chief Chemist, Raritan Copper Works, Perth Amboy, N. J.

² For gold which has been electrolytically refined by the Wohlwill process, 100 grams of gold should be taken as a sample, doubling the quantity of acid necessary for the colution

³ Sulphur dioxide gas is not recommended for the precipitation of gold as gold bullions contain a trace of tellurium, and in the presence of tellurium, palladium is precipitated as a telluride by sulphur dioxide gas. The gold precipitated with oxalic acid is free from palladium telluride and therefore may be reprecipitated with sulphur dioxide gas if a reprecipitation is thought necessary.

The platinum and palladium after solution in aqua regia, and addition of sulphuric acid, should be well fumed, in order to reduce any gold remaining in the solution to the metallic condition, it is very essential that all the gold is removed at this stage,

otherwise it is liable to contaminate the palladium di-methyl glyoxime.

and precipitate palladium with .5 grams of dimethyl glyoxime dissolved in 50 cc. of boiling water.⁵

Palladium dimethyl glyoxime, canary yellow in color, which possesses the same physical characteristics as the corresponding nickel salt, at once separates out. Allow to settle in a warm place for about five minutes. Filter in a Gooch crucible, wash with hot water, dry at 110° C. and weigh. Factor .3168.

To the filtrate from the palladium add 2 grams of 30-mesh C.P. zinc, which precipitates the platinum. Filter. Ignite, precipitate and dissolve in aqua regia. Remove nitric acid by three evaporations with hydrochloric acid (1.19), taking care not to evaporate solution to dryness. After the last evaporation, take up with not more than 10 cc. of water, and a few drops of hydrochloric acid. If necessary, filter, keeping volume of 10 cc. add 2 grams of ammonium chloride, stir well, add 10 cc. of alcohol, and let stand one hour with an occasional stirring.

Filter off ammonium chlor-platinate in small Gooch crucible and ignite to platinum in the usual manner.

 5 Palladium is best precipitated with di-methyl glyoxime in a 3-5% acid solution, gold if present will be reduced to the metallic condition and should be removed before hand. Alcohol is not recommended as the solvent for the dimethyl glyoxime, as it slows up the precipitation of the palladium. A hot water solution works quicker, and should be filtered to remove insoluble matter before addition to the palladium solution.

Any solutions containing platinum should never be evaporated to dryness, as platinum is easily reduced in baking to the "platinous" condition which is not precipitated with ammonium chloride.



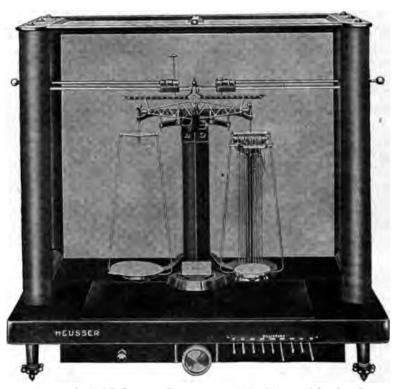


Fig. 55b.—Analytical Balance. (By courtesy of The Mine and Smelter Supply Company.)



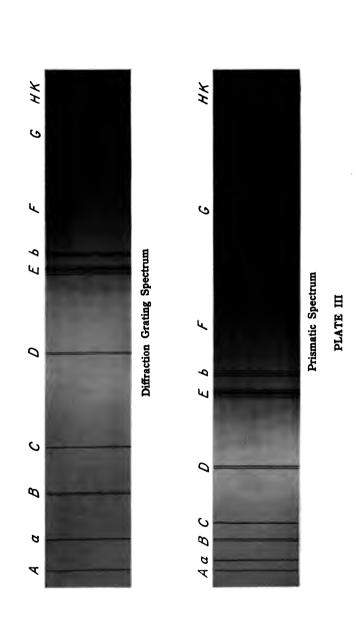

POTASSIUM, SODIUM AND OTHER

W. B. Bickel

Sedium, Na. at.wt. 23.00; sp.gr. 0.9735; m.p. 97.6 * Sec. Na.O. Na.O.

tithium, I.l, at.wt. 6.04; sp.gr. 0.534; m.p. 186; \$\(\frac{1}{2} \) \(\frac{1}{2}

Casium, Cs, at.wt. 132.81; sp.gr. 1.87; m.p. 26 \times Cs₂O, Cs₂O₂, Cs₂O₃, Cs₂O₄,

DETECTION

Detection of Sodium

Sodium is usually identified by the color which it but the mans of the spectroscope. The solution is prepared a contient and Solution of Sample, and is freed from all contients of magnesium and the alkalies according to the total separations. With exceedingly small amounts of socious, to remove the magnesium also. After acidifying with hydrocomorphisms of the solution is brought into the flame by means of a iconormal to the presence of sodium, the flame assumes an interacy of usually sufficient to identify the element. The results made a cambining the flame in the spectroscope, where the hardesteristic look will be prominent even in the presence of trace of sodium as match, the ever-presence of the sodium line is a language to the standard to the substantial and the substanti

Sodium may also be detected by precipitation as sodium $p(r, c) = U_1Na_2Sb_1O_7/H_2O_7$ from a sufficiently concentrated in strad or weak p(r, c) solution by means of a solution of acid potassium $p_1(rc, c)$ to according to the concentrate comes down in granular or crystalling form, and its bernation $b_1(c)$ to $b_2(c)$ to rubbing the sides of the vessel with a glass rod. In making this test, c > c as nesum must also be previously removed from the solution.

In waters and soluble salts, it is usually sufficient to test directly the consecutivated solution in the flame or spectroscope.

Detection of Potassium

For the detection of potassium in insoluble compounds, bring the saction, to solution by one of the methods given under Preparation and Solution of

⁴ Chemist, U. S. Geologi al Survey, Washington, D. C.

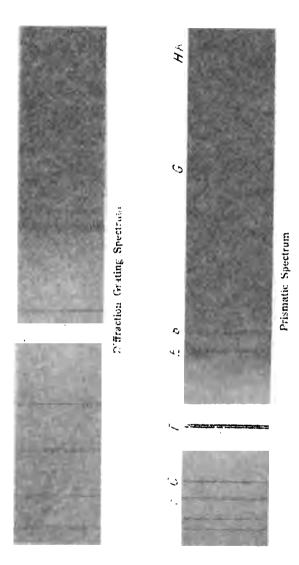


PLATE H

POTASSIUM, SODIUM AND OTHER ALKALIES

W. B. HICKS.1

Sodium, Na, at.wt. 23.00; sp.gr. 0.9735; m.p. 97.6°; b.p. 877.5° C.; oxides Na₂O, Na₂O₂.

Potassium, K, at.wt. 39.10; sp.gr. 0.875; m.p. 62.5°; b.p. 757.5° C.; oxides K₂O, K₂O₄.

Lithium, Li, at.wt. 6.94; sp.gr. 0.534; m.p. 186°; b.p. >1400° C.; oxide Li₁O.

Rubidium, Bb, at.wt. 85.45; sp.gr. 1.532; m.p. 38.5°; b.p. 696° C.; oxides Bb₂O, Bb₂O₃, Bb₂O₄, Bb₂O₄.

Caesium, Cs, at.wt. 132.81; sp.gr. 1.87; m.p. 26.37°; b.p. 670° C.; oxides Cs₂O, Cs₂O₃, Cs₂O₄, Cs₂O₄.

DETECTION

Detection of Sodium

Sodium is usually identified by the color which it imparts to the flame or by means of the spectroscope. The solution is prepared as directed under Preparation and Solution of Sample, and is freed from all constituents other than the chlorides of magnesium and the alkalies according to the methods given under Separations. With exceedingly small amounts of sodium, it may be necessary to remove the magnesium also. After acidifying with hydrochloric acid, a drop of the solution is brought into the flame by means of a loop of platinum wire. In the presence of sodium, the flame assumes an intense yellow color, which is usually sufficient to identify the element. The results may be confirmed by examining the flame in the spectroscope, when the characteristic yellow sodium line will be prominent even in the presence of traces of sodium. As a matter of fact, the ever-presence of the sodium line is a hindrance to the success of the method, but by observing the sudden change in the intensity of the line, little trouble will be experienced in detecting exceedingly small amounts of the metal.

Sodium may also be detected by precipitation as sodium pyroantimonate, $H_2Na_2Sb_2O_7 \cdot H_2O$, from a sufficiently concentrated neutral or weakly alkaline solution by means of a solution of acid potassium pyroantimonate. The precipitate comes down in granular or crystalline form, and its formation is hastened by rubbing the sides of the vessel with a glass rod. In making this test, magnesium must also be previously removed from the solution.

In waters and soluble salts, it is usually sufficient to test directly the concentrated solution in the flame or spectroscope.

Detection of Potassium

For the detection of potassium in insoluble compounds, bring the sample into solution by one of the methods given under Preparation and Solution of

¹ Chemist, U. S. Geological Survey, Washington, D. C.

In other cases, prepare a strong solution of the material to be tested. Where only very small amounts of potassium are present, remove all the constituents from the solution except the chlorides of magnesium and the alkalies as directed under Separations. In the presence of considerable amounts of potassium, small quantities of other constituents will not materially interfere with the flame and spectroscopic tests. After acidifying with hydrochloric acid, bring a drop of the solution to be tested into the non-luminous flame by means of a platinum wire and observe the color produced through a Merwin color screen. In the presence of potassium, a distinct reddish-violet coloration will be apparent. This must not be confused with the color caused by large amounts of sodium, which appear bluish-violet through the screen. Comparison with the coloration produced by pure salts is advisable. sary, confirm the results by examining the flame in the spectroscope. presence of a moderate amount of a volatile potassium compound, a bright red line will be readily seen in the red portion of the spectrum, and a less distinct violet line will be visible far out in the violet rays.

Potassium may be identified by precipitation as cobaltic nitrite. For this purpose place a small quantity of the solution to be examined in a test tube, acidify slightly with acetic acid, add about an equal quantity of the sodium nitrite solution, prepared by dissolving 125 grams of sodium nitrite (NaNO₂) in 250 cubic centimeters of distilled water, and about half as much of cobalt nitrate solution, prepared by dissolving 25 grams of cobalt nitrate (Co(NO₂)₂·6H₂O) in 100 cubic centimeters of distilled water and adding 50 cubic centimeters of concentrated (glacial) acetic acid. Mix and allow the mixture to stand until effervescence ceases and the cherry-red solution is transparent. If an appreciable amount of potash is present a yellow precipitate will have settled to the bottom of the test tube. By comparing the volume of the precipitate with that produced when a known quantity of potassium chloride is used, an idea of the amount of potash present can be obtained. Ammonium salts produce a similar precipitate.

Potassium chloroplatinate, perchlorate, acid tartrate, picrate, silico-fluoride, and phospho-tungstate are all sparingly soluble in water while the corresponding sodium salts are readily soluble. Precipitation of these compounds from solution may be used in the identification of potassium.

Silicate rocks and minerals may be tested for potash by mixing the finely powdered material with an equal quantity of pure calcium carbonate, moistening with hydrochloric acid, and examining a small amount of the wet mixture on a platinum loop in the flame.

Detection of Lithium

Bring the sample into solution as directed under Preparation and Solution of Sample, and separate the alkali chlorides from other constituents according to the methods under Separations. Digest the dry chlorides with amyl alcohol or with a mixture of absolute alcohol and ether, filter, and evaporate the filtrate to dryness. Moisten the residue with dilute hydrochloric acid and examine it in the spectroscope. A bright red band and a faint orange line make up the flame spectrum of lithium. These lie between the sodium line and the red potas-

¹ The Merwin color screens are manufactured and sold by G. M. Flint, 84 Wendell Street, Cambridge, Mass., at 25 cents apiece, and are far superior to the ordinary cobalt glass.

sium line and are easily recognized.

Lithium salts impart a carmine-red color to the flame, which is obscured by sodium, and by large amounts of potassium. But by the proper use of a color screen, the lithium flame may be recognized in the presence of large amounts of sodium.

Confirmation of the presence of lithium may be had by the formation of the sparingly soluble lithium phosphate or lithium fluoride.

Detection of Rubidium and Caesium

In the usual course of analysis, these rare elements are separated along with sodium, potassium, and lithium from all other bases. In order to detect rubidium and caesium, extract the dry chlorides of the alkali metals with a few drops of hydrochloric acid and 90% alcohol. This will dissolve most of the rare alkalies along with some sodium and potassium. Evaporate the solution to dryness, dissolve in a very small amount of water, and add chloroplatinic acid solution. Rubidium, caesium, and potassium chloroplatinates will be precipitated. Filter and wash the residue repeatedly with hot water to remove the potassium salt, which is much more soluble than rubidium and caesium chloroplatinates. During this treatment, examine the residue from time to time in the spectroscope. As the rubidium and caesium salts are concentrated through washing, their spectra will gradually become visible.

The flame spectrum of rubidium consists of two red lines at the extreme left end of the spectrum, 3 orange lines rather close together just to the left of the sodium line, and a narrow and a broad line between the violet and indigo portion of the spectrum.

Caesium has one narrow orange line, one broad yellow line just left of the sodium line, one green line, and two broad blue lines close together.

ESTIMATION

The estimation of sodium and potassium is required in the analysis of rocks, clays, soils, ashes of plants, waters, brines, saline deposits, salts of the alkalies, many technical products, and in other cases. The determination of potassium is of special importance in the analysis of fertilizers. The estimation of lithium is desired in the analysis of lithium minerals, frequently in mineral waters, occasionally in rocks, and in certain other special cases. The estimation of rubidium and caesium is seldom required.

Preparation and Solution of Sample

Procedure for Rocks and Other Insoluble Mineral Products. For silicate rocks and other silicious material, bring the alkalies into solution, according to the J. Lawrence Smith or the hydrofluoric acid method, as directed on pages 355 and 356. In the case of alunite prepare the solution as directed on page 356. For products which are dissolved by hydrochloric acid, effect the solution by acid digestion, expel the excess of acid by evaporation, and remove other constituents as directed under Separations.

Procedure for Soils.¹ Digest 10 grams of moisture-free soil with 100 cc. of hydrochloric acid of a constant boiling-point (sp.gr. 1.115) in a 300-cc. Erlenmeyer flask fitted with a ground-glass or rubber stopper and a reflux condenser. Digest continuously for ten hours on the steam bath, shaking the flask every hour. After settling, decant the solution into a porcelain dish. Wash the insoluble residue onto a filter with hot water, and continue the washing until free from chlorides, adding the washings to the original solution for evaporation. Oxidize the organic matter present in the solution with a few drops of nitric acid and evaporate to dryness on a water bath. Moisten with hydrochloric acid and dissolve in hot water and evaporate a second time to complete dryness and until the excess of hydrochloric acid is completely removed. Moisten the cooled residue with strong hydrochloric acid and dissolve in hot water. Filter into a 250-cc. graduated flask, wash free from chlorides, and dilute to the mark. Use an aliquot of 100 cc. for the determination of the alkalies.

Procedure for Fertilizers.² Potash salts. Boil 10 grams of the sample with 300 cc. of water for thirty minutes, wash into a 500-cc. graduated flask, cool, dilute to the mark, mix and pass through a dry filter. Determine the potassium in a 25-cc. aliquot representing 0.5 gram of the original substance, according to either the modified chloroplatinate or the Lindo-Gladding method.

Mixed fertilizers. Boil 10 grams of the sample with 300 cc. of water for thirty minutes, and wash into a 500-cc. graduated flask. Add to the hot solution a slight excess of ammonia and sufficient ammonium oxalate to precipitate all the lime, cool, dilute to the mark, mix, and pass through a dry filter. Evaporate

U. S. Dept. Agr., Bu. of Chem., Bull. 107 (revised), 14, 1907.
 U. S. Dept. Agri., Bu. Chem. Bull. 107 (revised), 11, 1907.

50 cc. of the filtrate to dryness and ignite gently to remove ammonium salts. Dissolve in water, filter, and determine the potassium according to the modified chlorplatinate ¹ or the Lindo-Gladding method.

Organic compounds. When it is desired to determine the total potash in organic substances such as cottonseed meal, tobacco stems, etc., saturate 10 grams with strong sulphuric acid, and ignite in a muffle at low red heat to destroy organic matter. Add a little strong hydrochloric acid, warm slightly to loosen the mass from the dish, dissolve in water, filter, and determine the potassium according to the modified chloroplatinate or the Lindo-Gladding method.

If for any reason it is desired to use either the chloroplatinate or the perchlorate method in the determination of potassium, interfering substances, including sulphates, must first be removed from the solution.

Procedure for Ashes of Plants. Boil 20 grams of the sample with 300 cc. of water for thirty minutes, filter into a 500-cc. flask, and wash the residue thoroughly with hot water. Cool, dilute to the mark and mix. Take aliquots for the determination of the alkalies. The solution may also be prepared by digestion with hydrochloric acid.² This treatment is preferable when all the constituents of the ash are to be determined.

Procedure for Saline Residues, Soluble Salts, Brines, etc. In the case of water-soluble products, the convenience of the analyst usually determines the manner of preparing the solution. Usually it is preferable to weigh out a convenient portion, to make up the solution to definite volume, and to take an aliquot for each determination. As a general rule, a sample should be taken sufficient to give about a half gram of solids. Strong brines should be weighed and not measured.

SEPARATIONS

Separation of the Alkali Metals from other Constituents

Separation from the Hydrogen Sulphide and Ammonium Sulphide Groups of Metals

The alkali metals are usually weighed as chlorides or sulphates, and in general before undertaking their determination, all other bases and acids must first be separated from them. The hydrogen sulphide and the ammonium sulphide groups of metals are seldom to be found in solutions in which the determination of the alkalies is desired. If these are present, however, they may be readily precipitated by means of hydrogen sulphide and ammonium sulphide as detailed on pages 168 and 292.

Separation from Silica

Acidify the solution with hydrochloric acid and evaporate it in a platinum or porcelain dish on the water bath until the odor of hydrochloric acid in the dry residue can no longer be detected. Break up the dry mass with a platinum or glass rod, cool, moisten with a minimum amount of concentrated hydrochloric

¹ If this method is used, it will not be absolutely necessary to remove the calcium by addition of ammonia and amonium oxalate.

² Lunge, "Technical Methods of Analysis," 2, 456, 1911. D. Van Nostrand Co., New York.

acid, dissolve in a small quantity of water, filter and wash the residue free from chlorides. In the presence of much silica, repeat the operation.

Separation from Iron, Aluminum, Chromium, Titanium, Uranium, Phosphoric Acid, etc.

If phosphoric acid is present in amounts insufficient to combine with all the iron, alumina, etc., or is absent altogether, heat the solution to boiling, add a few drops of nitric acid to oxidize the iron, add gradually an excess of ammonia, boil for a minute or so, allow the precipitate to settle, and filter. Wash the precipitate free from chlorides with hot water.

If phosphoric acid is present in the solution in excess of that required to combine with the iron, alumina, etc., heat the solution to boiling, oxidize with nitric acid, add a slight excess of ferric chloride solution, and precipitate with ammonia as described above.

When the precipitate is considerable, it should be dissolved in hydrochloric acid, and the precipitation repeated.

If chromates are present, these must first be reduced to the chromic salt. For this purpose, add 10 to 15 cc. of hydrochloric acid and a small amount of alcohol to the solution and heat on the water bath or hot plate for a few minutes. Heat to boiling and precipitate with ammonia as directed above. The reduction may also be done by boiling with sulphurous acid.

Separation from Sulphates

Precipitate the sulphate radical as BaSO₄ by the addition of a slight excess of barium chloride to the hot solution as directed on page 395 for the determination of SO₄. Remove the excess of barium chloride by addition of ammonia and ammonium carbonate.

The two operations may be combined as follows: Add a slight excess of barium chloride to the hot solution and boil for a few minutes. Then, without filtering off the BaSO₄, add an excess of ammonia and ammonium carbonate, allow the precipitate to settle, filter, and wash free from chlorides.¹

Separation from Barium, Calcium and Strontium

To the not too concentrated solution, add a slight excess of ammonia and ammonium carbonate, heat to boiling, allow the precipitate to settle, filter and wash the residue a few times with hot water. Dissolve the precipitate, which is likely to contain small amounts of the alkalies, in a little dilute hydrochloric acid, and repeat the precipitation with ammonia and ammonium carbonate. Filter and wash the residue. Evaporate the combined filtrates to dryness in a platinum or porcelain dish and ignite cautiously at a very faint red heat to remove ammonium salts. Dissolve the residue in a little water, add a few drops of ammonia, ammonium carbonate, and ammonium oxalate, and allow to stand for several hours in order to precipitate the last traces of the alkaline earths. Filter and wash the residue free from chlorides.

¹ This procedure does not give faultless results as some of the potassium is carried down with the precipitate and lost.

407

Separation from Iron, Aluminum, Chrominum, Barium, Calcium, Strontium, Phosphates, Sulphates, etc., in One Operation

To the hot solution add a slight excess of barium chloride and boil for a few minutes. Then, without filtering off the BaSO₄, add an excess of ammonia and ammonium carbonate, heat to boiling, and allow the precipitate to settle. Filter and wash free from chlorides with hot water. After evaporating the filtrate to dryness, removing the ammonium salts by ignition, and dissolving the residue in a little water, precipitate the last traces of barium and calcium by addition of a few drops of ammonia, ammonium carbonate, and ammonium oxalate. By this procedure a small portion of the alkalies is retained by the precipitate and lost.

Separation from Boric Acid

Acidify the solution strongly with hydrochloric acid and evaporate to dryness. Stir up the residue with 15 to 20 cc. of pure methyl alcohol and cautiously evaporate on a water bath at not too high a temperature. Moisten the residue with a drop or two of concentrated hydrochloric acid, add 15 cc. of methyl alcohol, and again take to dryness. Repeat the evaporation with methyl alcohol a third time. This should be ample for the complete removal of half a gram of B₂O₃.

Separation from Magnesium

Mercuric Oxide Method. After removing other bases and acids, evaporate the solution of the chlorides to dryness, expel ammonium chloride by gentle ignition, and dissolve the residue—except for the small amount of magnesium oxide present—by warming with a little water. Add an excess of mercuric oxide in the form of a thin paste prepared by shaking up freshly precipitated mercuric oxide in water. Evaporate the mixture to complete dryness on the water bath with frequent stirring, dry thoroughly and ignite gently at first and then more strongly until all the mercuric chloride present has been volatilized. (Be careful not to inhale the fumes.) The whole of the unchanged mercuric oxide need not be expelled by ignition. Digest the residue, composed of the excess of mercuric oxide, the precipitated magnesium oxide, and the alkali chlorides, with a small amount of hot water, filter rapidly, and wash with successive portions of hot water, first by decantation and then on the filter, but do not prolong the operation unnecessarily. If desired, determine the magnesium in the residue by expelling the mercuric oxide by ignition and weighing the magnesium oxide. Acidify the filtrate, which contains the alkalies, with hydrochloric acid, evaporate to dryness, gently ignite, cool and weigh. If the residue contains a small amount of magnesium, as it usually does, determine the magnesium in an aliquot and apply the necessary correction. The mercuric oxide should be tested for alkalies by volatilizing a portion and testing the residue.

The Barium Hydroxide Method. Evaporate the solution, which may contain chlorides, sulphates or nitrates, to dryness and gently ignite to remove ammonium salts. Warm the residue with a small amount of water and treat the hot neutral solution so obtained with baryta water until no more precipitate is formed and barium hydroxide remains in slight excess. Boil, filter and wash

¹ Fresenius, "Quantitative Chemical Analysis," 1, 610, 1908, John Wiley & Sons, New York.

408 POTASSIUM, SODIUM AND OTHER ALKALIES

the precipitate with hot water. If desired, determine the magnesium in the residue. Treat the filtrate, which contains the alkalies, barium and a trace of magnesium, with an excess of ammonia and ammonium carbonate to remove the barium. Acidify the filtrate with hydrochloric acid and evaporate to dryness, ignite and weigh. This residue will contain a small amount of magnesium which may be determined in an aliquot and a correction applied.

Remark. The barium hydroxide method is applicable in the presence of lithium.

The Ammonium Phosphate Method.¹ To the hot solution, add an excess of ammonia and ammonium chloride, and precipitate the magnesium by adding a slight excess of ammonium phosphate. Allow the mixture to stand an hour or so, filter and wash the residue with 2% ammonia solution. Expel most of the free ammonia from the filtrate by evaporation, acidify very slightly with hydrochloric acid, and add an excess of ferric chloride solution, which should color the solution slightly yellow. Neutralize the solution with ammonium carbonate, heat to boiling, and filter off the basic ferric phosphate, washing the residue with hot water. Evaporate the filtrate to dryness, ignite to expel ammonium salts, and determine the alkalies in the residue. Magnesium may also be separated by precipitation as magnesium ammonium arsenate 2 or magnesium ammonium carbonate.¹

Separation of the Alkali Metals from One Another

Separation of Sodium from Potassium

After weighing the sodium and potassium together as chlorides, dissolve the residue in water and precipitate the potassium as chloroplatinate or perchlorate according to one of the methods detailed under Determination of Potassium.

Separation of Lithium from Sodium and Potassium

Extract the dry chlorides with amyl alcohol as prescribed under the Gooch method, or with alcohol saturated with hydrochloric acid gas as detailed under the Rammelsberg method.

Separation of Lithium and Sodium from Potassium, Rubidium, and Caesium

Precipitate the potassium, rubidium, and caesium as chloroplatinates as described under the chloroplatinate method for the estimation of potassium. Evaporate the filtrate to dryness and ignite gently with a little oxalic acid to reduce the platinum, or else dissolve the residue in water and pass a current of hydrogen through the hot solution to reduce the platinum. In any case, filter off the reduced platinum and determine lithium and sodium in the filtrate.

¹ Fresenius, op. cit.

² Browning and Drushel, Am. J. Sci. (4), 23, 293, 1907.

METHODS FOR DETERMINATION OF SODIUM Determination as Sodium Chloride

Sodium is commonly weighed as NaCl when it is already present as such or after conversion of other forms into the chloride. In the case of salts of volatile acids, such as nitrates for instance, the transformation is made by evaporating the solution to dryness with hydrochloric acid repeatedly or until only the chloride remains. When the sodium is present as a salt of a non-volatile acid, the latter is removed and the transformation effected according to the methods under Separations.

Usually the solution in which sodium chloride is to be determined will contain ammonium salts from some previous operation. In such cases, proceed as follows: Evaporate the sodium chloride solution, which must contain no other non-volatile substance, in a platinum dish to complete dryness on the water bath. Cover the dish with a watch-glass, and cautiously dry the residue in an air bath at 110 to 130° C. Make sure that no loss of sodium chloride is sustained by decrepitation during drying and subsequent ignition. Heat the dish and contents over a free flame held in the hand and moved back and forth under the dish in order to remove ammonium salts: But to avoid loss of sodium chloride by volatilization, take care not to heat the dish to more than a faint redness in any one spot and not to raise the temperature of the salt above incipient fusion. Cool the residue, dissolve it in a little water, and filter from the carbonaceous matter into a weighed platinum dish. Acidify the filtrate with hydrochloric acid and evaporate it to dryness on the water bath. Dry the residue at 100 to 130° C. in an air bath, ignite cautiously over a free flame, taking the precautions mentioned above to prevent loss of sodium chloride, cool in a desiccator, and weigh.

Determination as Sodium Sulphate

Sodium is often determined by weighing as Na₂SO₄ when it is present as such or after conversion of other forms into the sulphate. In the case of salts of volatile acids, the change into the sulphate is made by simply evaporating the solution with a slight excess of sulphuric acid. With salts of non-volatile acids, the transformation is effected according to the methods under Separations. When the sodium is present as an organic salt, the substance is moistened with concentrated sulphuric acid and carefully heated over a free flame until fumes cease to come off. The residue is dissolved in water and filtered from the carbonaceous matter.

As a rule the solution in which sodium sulphate is to be determined will contain an excess of sulphuric acid. In such cases, evaporate the solution to dryness in a weighed platinum dish, and cautiously ignite the dry residue until fumes cease to come off. Cool, add a lump of ammonium carbonate to the contents of the dish, and ignite a second time at dull red heat until no more fumes are given off. Cool in a desiccator and weigh as Na₂SO₄. Repeat the ignition with the addition of ammonium carbonate until a constant weight is obtained.

In case an excess of sulphuric acid is not present, evaporate the solution to dryness in a weighed platinum dish, ignite, cool in a desiccator and weigh as Na₂SO₄.

Determination by Difference

Ordinarily sodium and potassium are weighed together as chlorides or sulphates as detailed above for sodium. Potassium is then determined by one of the methods given below, and the value for sodium obtained by difference.

METHODS FOR DETERMINATION OF POTASSIUM Determination as Potassium Chloride or Potassium Sulphate

Potassium may be weighed as chloride or sulphate. The procedure is the same as that described for sodium. Observe, however, that the potassium salts are a little more volatile than the corresponding sodium salts, so that greater care must be taken not to lose potassium by volatilization.

The Chloroplatinate Method

Application. This method is applicable in the presence of the chlorides of sodium, lithium, magnesium, calcium, and strontium.

Principle. Potassium chloroplatinate is practically insoluble in strong alcohol while the other chloroplatinates are readily soluble.

Procedure. Treat the aqueous solution of the alkali chlorides contained in a small porcelain dish with slightly more than enough chloroplatinic acid to convert all the chlorides present into the corresponding chloroplatinates. The chloroplatinic acid solution should contain the equivalent of 1 gram of platinum in each 10 cc. Evaporate the solution on the steam bath to a syrupy consistency, i.e., until solidification occurs on cooling. Flood the cooled residue with a small quantity of alcohol of at least 80% strength, grind thoroughly with a pestle made by enlarging the end of a glass rod, and allow to stand one-half hour. Pour the liquid through a previously weighed Gooch crucible containing an asbestos mat, and before adding more alcohol, rub up the residue again with the glass pestle. Now continue the washing by decantation with small portions of alcohol until the wash liquid becomes colorless. Transfer the precipitate to the crucible and wash two or three times with alcohol. Dry at 130° C., cool in a desiccator, and weigh. Repeat the drying until a constant weight is obtained. Multiply the weight of K₂PtCle by 0.161 to obtain the weight of K; by 0.194 to obtain K₂O; and by 0.307 to obtain KCl.

Remarks. This method is considered to be the most accurate known for the estimation of potassium. Care should be taken not to conduct the evaporation at too high a temperature nor let it go too far, as this may cause the formation of anhydrous sodium chloroplatinate, which dissolves slowly in alcohol. Too large a volume of alcohol for washing should be avoided, as K₂PtCl₀ is slightly soluble in alcohol, especially that of 80%. For this reason 95% alcohol is preferable for the washing.

Instead of using a Gooch crucible, the precipitate may be filtered on paper, dried, washed through the filter with hot water into a weighed platinum dish; evaporated to dryness, and heated at 130° C. to constant weight.

¹ For methods of preparing chloroplatinic acid from scrap platinum and from platinum residues, see Precht, Z. Anal. Chem., 18, 509, 1879; Vogel and Haefcke, Landw. Vers. Sta., 47, 134, 1896.

The Modified Chloroplatinate Method 1

Application. The method is applicable in the presence of chlorides, sulhates, phosphates, nitrates, carbonates, borates and silicates, salts of sodium, arium, calcium, strontium, magnesium, iron and alumina, and is especially lited for the estimation of potassium in salines, potassium salts, and fertilizers which only the potassium is desired.

Principle. On evaporating a solution containing potassium with a slight scess of chloroplatinic acid, the potassium is completely transformed into otassium chloroplatinate which is insoluble in strong alcohol, while any of the ther chloroplatinates which may be formed are either dissolved or decomposed by leohol, so that the excess of chloroplatinic acid may be readily removed. After issolving the K₂PtCl₆ along with any other soluble salts contained in the residue 1 hot water, the platinum is precipitated from the solution by magnesium, and rom the weight of platinum so obtained, the amount of potassium present is alculated.

Procedure. To the solution slightly acidified with hydrochloric acid, add hloroplatinic acid solution slightly in excess of that necessary for the complete recipitation of the potassium present and evaporate the solution on the steam ath to a syrupy consistency, i.e., until solidification occurs on cooling. Flood he cooled residue with a small quantity of alcohol of at least 80% strength, grind horoughly with a pestle made by enlarging the end of a glass rod, and allow to tand one-half hour. The alcoholic solution should be colored if an excess of hloroplatinic acid has been used. Pour the liquid through a small filter, using action if desired, and before adding more alcohol, rub up the residue again with the estle. Now continue the washing by decantation with small portions of alcohol ntil the wash liquid becomes colorless. Three or four washings usually suffice. 'ransfer the precipitate to the filter and wash two or three times with alcohol.

Dissolve the precipitate of K₂PtCl₂ along with any other soluble salts present 1 hot water, washing it through the filter into a beaker of convenient size. To he hot solution add about 4 cc. of concentrated HCl and approximately 0.5 ram magnesium ribbon pressed into the form of a ball for every 0.2 gram potasium present, stirring the solution and holding the magnesium at the bottom of he beaker by means of a glass rod. A lump of stick magnesium weighing about 4 gram is preferable to the ribbon. When the action has practically ceased, dd a few cc. of hydrochloric acid and allow the fluocculent platinum to settle, referably by allowing the beaker to set for an hour on the hot plate. The upernatant liquid should be perfectly clear and limpid like water if reduction is omplete. To make sure, add more magnesium, in which case the solution will arken if reduction be incomplete. To the completely reduced solution, add oncentrated hydrochloric acid, and boil to dissolve any basic salts, filter on aper or a Gooch, wash thoroughly with hot water, ignite in platinum or porce-in and weigh. Pt×.4006 = K or ×.4826 = K₂O.

Remarks. If the solution contains very large amounts of iron, alumina, r silica, it is perferable to remove the greater part of these before proceeding to he determination of potassium. Care should be taken to insure the complete emoval of the soluble chloroplatinates from the residue without the use of an

¹ Hicks, J. Ind. Eng. Chem., 5, 650, 1913.

excessive amount of alcohol, and also that the subsequent reduction of the potassium chloroplatinate with magnesium be complete.

Lindo-Gladding Method 1

Application. This method is applicable in the presence of chlorides, sulphates, and phosphates of the alkalies and magnesium.

Principle. The potassium is precipitated as K₂PtCl₆, and the soluble chloroplatinates removed by washing with 80% alcohol. The impurities in the precipitate are then washed out by a strong solution of ammonium chloride saturated with K₂PtCl₆, and the wash solution is removed by again washing with alcohol. The purified K₂PtCl₆ is finally dried and weighed.

Procedure. To the solution, slightly acidified with hydrochloric acid, add an excess of chloroplatinic acid solution, and evaporate on the water bath to a thick paste. Treat the residue with 80% alcohol, avoiding the absorption of ammonia. Wash the precipitate thoroughly with 80% alcohol both by decantation and on the filter, continuing the washing after the filtrate is colorless. Wash finally with 10 cc. of ammonium chloride solution prepared as follows: Dissolve 100 grams of pure ammonium chloride in 500 cc. of water, add from 5 to 10 grams of potassium chloroplatinate, and shake at intervals of six to eight hours. Allow the mixture to settle over night and filter. Repeat the washing with successive portions of the ammonium chloride solution five or six times in order to remove the impurities from the precipitate. Wash again thoroughly with 80% alcohol, dry for thirty minutes at 100° C. and weigh as K₂PtCl₄. The precipitate should be perfectly soluble in water. Multiply the weight of K₂PtCl₆ by 0.161 to obtain the weight of K; by 0.194 to obtain K₂O; and by 0.307 to obtain KCl.

The Perchlorate Method²

Application. This method is applicable in the presence of chlorides and nitrates of barium, calcium, magnesium and the alkali metals, and also in the presence of phosphates. Sulphates should not be present.

Principle. The separation depends on the insolubility of potassium perchlorate, and the solubility of sodium and other perchlorates in 97% aclohol.

To the neutral or slightly acidified solution, add twice as much perchloric acid as is required to convert all the bases present into perchlorates and evaporate on the water bath with stirring to a syrupy consistency. Add a little hot water and continue the evaporation with constant stirring until all the hydrochloric acid is expelled and heavy fumes of perchloric acid are given off. Avoid excessive loss of perchloric acid. Stir up the cooled mass thoroughly with 20 cc. of 97% alcohol to which 0.2% perchloric acid has been added, but avoid breaking up the potassium perchlorate crystals too finely or else they may pass through the filter. Allow the mixture to settle, and decant the alcohol off through a Gooch crucible. Repeat the washing once by decantation and then warm to remove the alcohol. Dissolve the residue in hot water, add about a half gram of perchloric acid and evaporate again until fumes of perchloric acid are given off. Wash the residue once by decantation and then several times on the filter. Remove the adhering wash-liquid by washing with pure 97% alcohol, dry at 130° C., and weigh. Multiply the weight of KClO₄ by 0.2825 to obtain the weight of K; by 0.3402 to obtain K₂O.

U. S. Dept. Agri., Bu. Chem. Bull. 107 (revised), 11, 1907.
 Wense, Zeit. Angew. Chem., 691, 1891; 233, 1892. Caspari, Zeit. Angew, Chem., 68, 1893.

Other Methods

Among the more important of other methods which have been proposed and used for the determination of potassium, may be mentioned the cobaltinitrite method,1 which has been studied by the Association of Official Agricultural Chemists and considered to be unreliable; 2 the bitartrate method; 3 the colorimetric method: 4 and the spectroscopic method.

Determination of Sodium and Potassium by Indirect Method

After removing all other constituents, weigh the sodium and potassium as chlor-Dissolve the weighed residue in water and determine the chlorine gravimetrically by precipitation as AgCl or volumetrically by titration with standard silver nitrate (potassium chromate indicator). From the weight of the combined salts and the weight of the chlorine, calculate the amount of sodium and potassium as follows:

Let x = weight of NaCl + KCly =weight of Cl. Then Na = 3.004y - 1.428x; K = 2.428x - 4.004y.

The method is satisfactory when sodium and potassium are present in about equal quantities.

Determination of Magnesium, Sodium and Potassium in the Presence of One Another

In the usual course of analysis, magnesium, sodium and potassium are separated as chlorides from all other constituents. Instead of going through the tedious process of separating the magnesium from the alkalies, the magnesium, sodium, and potassium may be accurately determined in the presence of each other as follows:

Treat the solution containing these constituents with slightly more than enough sulphuric acid to convert all three bases into sulphates, evaporate it to dryness on the water bath, and ignite gently at first and then at dull red heat to break up bisulphates and expel the excess of sulphuric acid. To hasten the decomposition of the bisulphates, cool, add a lump of ammonium carbonate, and heat a second time. Cool in a desiccator and weigh. Repeat the heating with the addition of ammonium carbonate until a constant weight is obtained. Dissolve the residue in water and dilute to definite volume. Determine the potassium in one portion according to one of the methods described above, and the magnesium in a second portion as described on page 293. Deduct the weight of magnesium and potassium sulphates from the weight of the combined sulphates to obtain the amount of sodium sulphate.

¹ Addie and Wood, J. Chem. Soc., 77, 1076, 1900; Drushel, Am. J. Sci. (4), 24, 433, 1907; 26, 329, 555, 1908; Bowser, J. Am. Chem. Soc., 33, 1752, 1911.

² U. S. Dept. Agri. Bu., Chem., Bull. 132, 137, 152, 159.

³ Bayer, Chem. Zeit., 17, 686, 1893.

4 Compression and Faither J. Am. Chem. Soc., 25, 1062, 1062, 1711, L. Am. Chem. Soc., 26, 1062, 1062, 1062, 1711, L. Am. Chem. Soc., 26, 1062, 1711, L. Am. C

⁴Cameron and Failyer, J. Am. Chem. Soc., 25, 1063, 1903; Hill, J. Am. Chem. Soc., **25**, 990, 1903.

Gooch and Hart, Am. J. Sci. (3), 24, 448, 1891.

414 POTASSIUM, SODIUM AND OTHER ALKALIES

METHODS FOR DETERMINATION OF LITHIUM

Determination as Lithium Chloride.

Lithium may be weighed as LiCl. The procedure is practically the same as that described for sodium, but since lithium chloride is very hygroscopic, this salt must be weighed out of contact with the air. For this purpose the lithium chloride is ignited in a platinum crucible, cooled in desiccator, and the crucible and contents weighed in a glass-stoppered weighing bottle.

Determination as Lithium Sulphate

Lithium is weighed preferably as Li₂SO₄. The procedure is the same as that described for sodium, but since lithium bisulphate is easily broken up on heating, it is not necessary to ignite with ammonium carbonate.

The Gooch Method 1

Principle. Lithium chloride is readily soluble in amyl alcohol, while sodium and potassium chlorides are not.

Procedure. Concentrate the solution as far as possible by evaporation. transfer it to a 50-cc. Erlenmeyer flask, add a small amount of amyl alcohol and heat cautiously on an asbestos plate until the water has been expelled and the boiling-point of the solution rises to about that of pure amyl alcohol (132° C.). To prevent bumping during this treatment, pass a current of dry air through the solution. When all the water has been removed, the sodium and potassium chlorides, together with some LiOH will separate from the solution. Decant the solution through a filter and wash the residue several times with hot amyl alcohol. Moisten the residue with dilute hydrochloric acid, dissolve in a little water and repeat the extraction with amyl alcohol. If much lithium chloride is present, it will be necessary to repeat the extraction with amyl alcohol three or four times. Evaporate the combined filtrates and washings to dryness and dissolve in a little dilute sulphuric acid. Filter from the carbonaceous matter into a weighed platinum dish, evaporate to dryness, and remove the excess of sulphuric acid by gentle heating. Ignite the residue at dull redness, cool in a desiccator. and weigh as Li₂SO₄.

Remarks. For very accurate work, account must be taken of the fact that the lithium sulphate obtained according to the procedure just described always contains small amounts of potassium and sodium sulphates, if these metals were originally present. To correct for this, deduct 0.00041 gram for every 10 cc. of the filtrate exclusive of the washings in case only sodium chloride was present, or 0.00051 if only potassium chloride was present, and 0.00092 if both sodium and potassium chlorides were present.

¹ Proc. Am. Acad. Arts. Sci., 22 (N. S. 14), 177, 1886.

The Rammelsberg Method 1

Principle. Anhydrous lithium chloride is soluble in equal parts of alcohol and ether which have been saturated with hydrochloric acid gas, while the chlorides of sodium and potassium are practically insoluble in this mixture.

Procedure. Evaporate the solution of the chlorides to dryness in a small flask provided with a two-hole stopper. During the evaporation, pass a current of dry air through the flask. Place the flask containing the dry residue in an oil or air bath and heat for half an hour at 140 to 150° C., during which time pass dry hydrochloric acid gas through the flask. Cool in a current of hydrochloric acid gas, treat the residue with a few cc. of absolute alcohol which has been saturated with hydrochloric acid gas, and add an equal volume of absolute ether. Close the flask tightly and allow it to stand with frequent shaking for twelve hours. Pour the solution through a filter, wet with the alcohol-ether mixture and wash the residue three times by decantation with the alcohol-ether mixture. Add a few more cc. of the alcohol-ether saturated with hydrochloric acid gas to the contents of the flask and allow to stand again for twelve hours. Pour the liquid through a filter, and wash the residue by decantation with the alcoholether mixture until the residue tested in the spectroscope shows the complete absence of lithium. Carefully evaporate the combined alcohol-ether extract to dryness on a lukewarm water bath. Dissolve the residue in sufficient dilute sulphuric acid to convert all the lithium into the sulphate, transfer the solution to a weighed platinum dish, evaporate to dryness on the water bath, and finally ignite gently. Cool the residue in a desiccator and weigh as lithium sulphate.

Note. Lithium may also be precipitated and weighed as Li₂PO₆² or it may be precipitated as LiF² and then changed into the sulphate and weighed.

Spectroscopic Method 4

Dissolve the lithium salt containing small amounts of sodium and potassium resulting from the separation by the Gooch or Rammelsberg methods in 5 or 10 cc. of water, depending on the amount of lithium present. Gradually add measured amounts of this solution to a known volume of water—testing the solution from time to time in the spectroscope—until the lithium line appears. When only traces of lithium are present, it is better to dissolve the lithium salt in a little water and dilute to the vanishing point of the lithium line. Make the spectroscopic examination as follows: Prepare a loop by winding a platinum wire four times around a No. 10 wire. Plunge the loop into the solution, and remove with the axis parallel to the surface of the water. Evaporate the drop to dryness carefully, ignite in the Bunsen flame, and observe through a good spectroscope.

Before undertaking the determination, standardize the instrument and platinum loop by carrying out the determination with known amounts of lithium.

The method gives satisfactory results when only an approximation is desired. For weighable amounts of lithium, the Gooch method is preferable.

¹ Treadwell, "Analytical Chemistry," 2, 55, 1911. John Wiley & Sons, N. Y. ² Mayer, Ann. Chem. Pharm., 98, 193, 1856. Merling, 3 Anal. Chem., 18, 563,

1879.

³ Carnot, 3 Anal. Chem., 29, 332, 1890. ⁴ Skinner and Collins, U. S. Dept. Agri. Bu. Chem., Bull. 153. A good bibliography is included in this bulletin.

Determination of Sodium, Potassium, and Lithium in the Presence of One Another

Weigh the combined bases as sulphates, observing the precautions detailed under Determination of Sodium, dissolve in water and dilute to definite volume. In one portion determine the potassium and in a second portion determine the lithium by the Gooch or Rammelsberg method. Obtain the value for the sodium by difference.


Determination of the Alkalies in Silicates

J. Lawrence Smith method 1

Principle. By heating the substance with 1 part ammonium chloride and 8 parts calcium carbonate, and leaching the sintered mass with water, the alkalies are obtained in solution in the form of chlorides along with some calcium, while the remaining metals are for the most part left behind as insoluble oxides, and the silica is changed to calcium silicate.

Procedure. Triturate 0.5 gram of the finely powdered mineral with an equal quantity of pure ammonium chloride in an agate mortar, add 3 grams of precipitated calcium carbonate 2 and mix intimately with the former. Transfer the

mixture to a platinum crucible (preferably the J. Lawrence Smith alkali crucible), rinse the mortar with 1 gram of calcium carbonate and add to the contents of the crucible. Place the covered crucible in a slightly inclined position with the top protected from the heat of the flame This can be done by setting the crucible in a hole in a cylinder. of fire clay, as shown in Fig. 56. Gradually heat the crucible over a small flame until no more ammonia is evolved, but avoid heating sufficiently to cause the evolution of ammonium chloride. This should require about fifteen minutes. Then raise the temperature until finally the lower three-fourths (and no more) of the crucible is brought to a red heat, and maintain this tem-

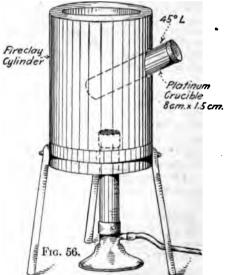

perature for one hour. Allow the crucible to cool and remove the sintered cake by gently tapping the inverted crucible. Should this not be possible, digest the mass a few minutes with water to soften the cake, and then wash it into a large porcelain or platinum dish. Heat the covered dish with 50 to 75 cc. of water for half an hour, reduce the large particles to a fine powder by rubbing

¹ Am. J. Sci. (3), 1, 269, 1871; Hillebrand, U. S. Geol. Survey Bull. 422, 171, 1910.

² Blank determinations should be run on the calcium carbonate, and corrections made for its alkali content.

with a pestle in the dish, and decant the clear solution through a filter. Wash the residue four times by decantation, transfer it to a filter, and wash with hot water until a few cc. of the washings give only a slight turbidity with silver nitrate. To make sure the decomposition of the mineral has been complete, treat the residue with hydrochloric acid. No trace of undecomposed mineral should remain undissolved.

The aqueous extract obtained in the above operation contains the chlorides of calcium and the alkalies. To remove the calcium, treat the solution with ammonia and ammonium carbonate, heat to boiling, filter and wash the residue. As this precipitate invariably retains some alkali salts, it should be dissolved in hydrochloric acid and the precipitation repeated. Evaporate the filtrate to dryness in a platinum or porcelain dish, and expel the ammonium salts by gentle ignition over a moving flame. After cooling, dissolve the residue in a little water, and add a few drops of ammonia and ammonium oxalate to remove the last trace of calcium. After standing several hours, filter off the calcium oxalate, receive the filtrate in a weighed platinum dish, evaporate to dryness and ignite gently to remove ammonium salts. Moisten the cooled mass with hydrochloric acid to transform any carbonate into chloride, and again evaporate to dryness and ignite. Cool in a desiccator and weigh the combined chlorides. Dissolve in water, and if an insoluble residue remains, filter off, weigh and deduct from the weight of the chlorides. Determine the potassium by one of the methods already described, and obtain the value for sodium by difference.

The Hydrofluoric Acid Method

Weigh out a half-gram sample of the finely powdered mineral, Procedure. place in a small platinum dish or a large platinum crucible, moisten with a few drops of water, and add about 10 cubic centimeters of hydrofluoric acid and about 2 cubic centimeters of dilute sulphuric acid. Hold the dish with the tongs and heat it and its contents cautiously over the free flame for a few Evaporate the solution on the steam bath to complete dryness, and during this evaporation agitate the solution occasionally by giving the dish a gyratory motion with the tongs. This treatment is nearly always sufficient to decompose the mineral, but if decomposition seems incomplete add more hydrofluoric acid and evaporate a second time, agitating the mixture frequently. With refractory silicates it may be desirable to digest the mineral with the acid mixture in a covered crucible for an hour or so. Heat the dish and its contents on a radiator to expell the excess of hydrofluoric and sulphuric acids. Cover the residue with dilute hydrochloric acid and digest on a steam bath until solution is complete, adding more water and acid if necessary. of organic matter which remain undissolved may be neglected. Remove the iron, alumina, calcium, etc., by the methods described under "Separations." Finally weigh the magnesium, sodium, and potassium as sulphates as described on page 413 and determine the potassium according to the modified chloroplatinate or Lindo-Gladding method. An alternative procedure is to remove sulphates and magnesium also as described under "Separates," weigh the alkalies as chlorides, and determine the potash by any of the methods already It should be noted however that potash is carried down with barium sulphate, and the loss thus occasioned may be appreciable.

¹ Hillebrand, W. F., U. S. Geol. Survey Bull. 422, p. 31, 1910 (reprinted, 1916). A large porcelain crucible serves well as a radiator for this purpose.

418 POTASSIUM, SODIUM AND OTHER ALKALIES

Test for Hydroxide. A small amount of the material dissolved in CO₂ free water is treated with an excess of BaCl₂ solution and filtered. Phenolphthalein added to the filtrate will produce the characteristic red color if an alkali hydroxide is present in the sample.

Sodium Chloride, Table Salt

U. S. Standard Specifications. Table salt must contain not over

Barium chloride	.0.05%
Calcium and magnesium chlorides	.0.5%
Calcium sulphate	.1.4%
Water insoluble matter	.0.1%

In addition to these impurities, salt frequently contains combined Fe_2O_3 , K_2O_3

Outline of Method for Examination

Moisture. A 10 gram sample is dried to constant weight at 100° C. and the loss of weight noted.

Insolubles in Water. A fifty gram sample is dissolved in 200 cc. of water and filtered on a weighed, dry filter paper. The residue is washed five times with small portions of water and then dried at 100° C. for an hour. The increased weight = water insolubles. It is advisable to run side by side a second filter, which is washed and also dried in the same way, the paper being used as a tare weight.

The filtrate from the insoluble matter is diluted to exactly 500 cc. in a volumetric flask and used for the following tests.

Sulphur Trioxide. 100 cc. of the above solution equivalent to 10 grams of sample is examined for SO₃ by addition of BaCl₂ sol. and the BaSO₄ filtered off and weighed.

Barium. If SO_3 is present above, Ba will not be found in the solution. If SO_3 is absent, test for Ba by addition of H_2SO_4 to 100 cc. of the solution, by the standard procedure. $BaSO_4 \times 0.8923 = BaCl_2$.

Lime. After removal of Fe₂O₃ and Al₂O₃ by addition of NH₄OH (100 cc. solution) CaO is determined by precipitation as oxalate by regular method.

Magnesia. MgO is determined in the filtrate from CaO by concentrating this and precipitating phosphate salt as usual.

 P_2O_5 . This is determined by precipitation as ammonium phosphomolybdate according to the standard procedure. $(NH_4)_2HPO_4.12MoO_2 \times .038 = P_2O_5$.

Fe₂O₃ and Al₂O₃. Determined on a 10-gram sample. See page 69. If Fe₂O₃ alone is desired determine colorimetrically. (See page 258.)

Alkalies in Alunite. The ore is mixed with pure silica and is run by the J. L. Smith method.

Alkalies Volumetric Determination. See chapter in Vol. 2.

RADIUM

L. D. ROBERTS¹

Ra, at.wt. 226; m.p. about 700 degrees C.; half period 1580 yr.; chloride RaCl₂.

In 1895 Roentgen discovered X-rays. In the following year Becquerel, while studying the phosphorescent properties of some potassium uranium salt which he had prepared about fifteen years before, noticed that it was capable of producing an effect on a photographic plate without exposure to The plate was wrapped in several thicknesses of black paper, being perfectly opaque to ordinary light, and then placed with the uranium salt in a dark chamber. Pictures of coins and other articles were made in this way. These effects were found to be due to radiations from the disintegration products of ordinary uranium. Uranium decomposes in succession into the following products: Uranium X₁, Uranium X₂, Uranium II, Ionium, Radium, Emanation, Radium A, Radium B, Radium C, Radium D, Radium E, Radium F (polonium), Radium G (lead). There are about thirty-five members in the three radioactive families—uranium, thorium, and actinium. Uranium and thorium are the only ordinary elements that are strongly radioactive. Potassium and rubidium give off some beta radiation. The actinium series seems to be a side chain of the uranium family.

The Curies discovered radium in 1898. It is the most important of the radioactive elements.

Kinds of Radiation. Three kinds of radiation are emitted by the various radioactive substances: alpha (α) particles, beta (β) particles, and gamma (γ) rays. Rutherford showed that the alpha particles are doubly positively charged helium atoms. They have an initial velocity of from 1/20 to 1/15 that of light. The beta praticles are singly charged atoms of negative electricity, commonly known as electrons. They have an initial velocity from some substances approaching that of light. The gamma rays are very short waves in ether, and therefore have the general properties of light. They resemble X-rays but are much shorter than any X-rays that have yet been produced. They also have a much higher penetrating power. On account of the very high electrical effects of these radiations and also on account of the extremely small quantities of some of the radioactive substances it is necessary to depend for their detection and determination on the electroscope. The rays ionize the air and this discharges the electroscope.

The Lind instruments, made by the Sachs-Lawlor Company of Denver, Colorado, and distributed by the Denver Fire Clay Company of Denver, are very satisfactory for radium determinations. These instruments may be obtained from any laboratory supply house. Methods for the determination of radium are found in the second volume.

¹ Associate Professor of Chemistry, Colorado School of Mines.

SELENIUM AND TELLURIUM

WILFRED W. SCOTT AND H. D. GREENWOOD*

Se₃, at.wt. 79.2; sp.gr. { amorphous 4.26; m.p. 217°; } b.p. 690° C.; oxide SeO₂; acids, H₂SeO₃, H₄SeO₄.

Te, at. wt. 127.5; sp.gr. 6.27; m.p. 452°; b.p. 1390°C.; oxides TeO, TeO,, TeO; acids, H.TeO,, H.TeO.

DETECTION

Selenium and tellurium appear with the hydrogen sulphide subgroup elements in the ordinary course of qualitative analysis. The acid solution of the material is treated cold with H₂S, as the lemon-yellow SeS, formed in a cold solution is more readily soluble in alkaline sulphide solutions than the orange-yellow SeS₂ precipitated from hot solutions. Although only a partial separation takes place the extract will contain sufficient selenium, if present in the sample, to give a qualitative test. By precipitation from an acid solution by H₂S, selenium and tellurium are separated from members of subsequent groups. The sulphides precipitated are extracted with sodium or ammonium sulphide and the extract examined for sclenium and tellurium.

Detection of Selenium

The sodium or ammonium extract is acidified with hydrochloric acid, whereby selenium together with the other members of the group are precipitated. The washed dried precipitate is mixed with twice its weight of a flux containing equal parts of sodium carbonate and nitrate, and the mixture added to an equal amount of the flux which has been previously fused. The fluid mass is poured on to a slab of porcelain and the cooled melt placed in a beaker and extracted with water, whereby selenic, telluric, molybdic and arsenic acids dissolve, stannic oxide, sodium antimonate, gold and the platinum group remaining insoluble. The extract is treated with an excess of hydrochloric acid and boiled to reduce sodium selenate, Na₂SeO₄, to selenious acid, H₂SeO₃. A reducing agent such as sulphurous acid, ammonium sulphite, hydrazine sulphate or hydroxylamine is added and the solution boiled. Selenium, if present, is precipitated in its red or brown colored metallic form. The red color darkens on boiling.

Selenium is an odorless and tasteless solid. *Its vapor* has a putrid horseradish odor. The element burns with a reddish-blue colored flame.

Dissolved in *concentrated sulphuric acid* a fine green-colored solution is obtained, from which solution selenium may be precipitated by dilution with water, the suspended substance giving a reddish tint to the acid.

^{*} Chief Chemist, U. S. Metals Refining Co., Chrome, N. J.

¹ Circular 35 (2d Ed.), U. S. Bureau of Standards.

Hydrochloric acid decomposes selenates with evolution of chlorine gas on boiling.

Barium chloride precipitates white BaSeO₄, soluble in dilute HCl, when added to selenites, and white BaSeO₄, insoluble in dilute HCl, when added to selenates.

Hydrogen sulphide produces no precipitate with a selenate. This reduced, however, by heating with HCl, a lemon-yellow to orange-yellow precipitate of SeS₂ is obtained.

The gas passed into a solution of selenite gives an immediate precipitation of the sulphide. SeS₁.

Detection of Tellurium

Tellurium dissolved in *concentrated sulphuric acid* colors the acid purple or carmine. The color disappears on dilution. The mineral may be treated directly with hot concentrated sulphuric acid and the color obtained in presence of tellurium.

Heated in a test-tube tellurium compounds sublime and fuse to colorless, transparent drops of TeO₂.

Hydrogen sulphide precipitates metallic tellurium mixed with sulphur when passed into acid solutions containing the element. The precipitate resembles SnS in appearance. It is readily soluble in $(NH_4)_2S$.

Tellurium burns with a greenish flame.

Reducing agents added to acid solutions of tellurium precipitate black metallic tellurium.

Tellurium compounds are not as readily reduced as are those of selenium. In solutions having an acidity of over 80 per cent, SO₂ gas causes the precipitation of metallic selenium alone. Upon dilution with an equal volume of water tellurium is precipitated. A separation may be effected in this way.

Tellurates boiled with HCl evolve chlorine gas and are reduced to H₂TeO₁. Dilution of the solution will cause the precipitation of TeO₂ (distinction from Se).

Potassium iodide added to a tellurite in dilute sulphuric acid solution (1:4) precipitates black TeI, soluble in excess of KI.

ESTIMATION

Selenium and tellurium closely resemble sulphur in chemical properties. They have crystalline and amorphous forms. The elements occur in nature frequently associated with sulphur. Selenium is frequently present in iron pyrites, hence is found in the flue dust of lead chambers of the sulphuric acid plant, and as an impurity in sulphuric acid, prepared from pyrites containing selenium.

Ores—Selenium. In copper and iron pyrites; meteoric iron. In the rare minerals clausthalite, PbSe; lehrbachite, PbSe HgSe; onofrith, HgSe 4HgS; eucairite, CuSe Ag Se; crookesite, (CuTlAg)Se.¹

Tellurium. Occurs in tellurides and arsenical iron pyrites. Frequently associated with gold, silver, lead, bismuth and iron. In the minerals—altaite, PbTe; calaverite, AuTe₂; coloradolite, HgTe; nagyagite, (AuPb)₂(TeSSb)₂; petzite, Ag₂AuTe₂; sylvanite, AuAgTe₄; telluride, TeO₂ (tellurium ochre); tetradymite, Bi₂Te₃.¹

¹ Thorpe, "Dictionary of Applied Chemistry."

Preparation and Solution of the Sample

The following facts regarding solubilities of these elements and their compounds may be useful in the analysis of these substances.

Selenium. Amorphous selenium is soluble in carbon disulphide; the crystalline hexagonal form is insoluble in this reagent. The metal is soluble in hydrochloric acid in the presence of nitric acid. It is soluble in cold concentrated sulphuric acid, giving a green-colored liquid, which diluted with water deposits selenium. The dioxide, SeO₂, is readily soluble in hot water.

Tellurium. The element dissolves in hot concentrated hydrochloric acid. On dilution of the solution a precipitation of H₂TeO₂·TeO₂ occurs. Treated with concentrated nitric acid or aqua regia H₂TeO₄ forms. With sulphuic acid the compound H₂TeO₂ forms and SO₂ is evolved. The element dissolves in concentrated potassium cyanide, from which solution hydrochloric acid precipitates all of the tellurium. Tellurium is insoluble in carbon disulphide. The oxides TeO and TeO₂ are soluble in acids, TeO₃ being not readily soluble. All the oxides dissolve in hot potassium hydroxide solutions.

Care must be exercised to avoid overheating acid extracts in the preparation of the sample, since loss by volatilization is apt to occur; this is especially true of the halogen compounds of selenium and tellurium, the former being more volatile than the latter. (B.p. $SeCl_2=145^\circ$; $Se_2Br_2=225^\circ-230^\circ$; $SeOCl_2=179.5^\circ$; $TeCl_2=327^\circ$; $TeCl_4=414^\circ$; $TeBr_2=339^\circ$; $TeBr_4=420^\circ$ C.)¹

Fusion Method. The finely powdered substance is intimately mixed with about five times its weight of a flux of sodium carbonate and nitrate (4:1) and heated gently in a nickel crucible, gradually increasing the heat, until the charge has fused. When the molten mass appears homogeneous, it is cooled and extracted with water. Sodium selenate and tellurate pass into solution and are separated from most of the heavy metals. The water extract is acidified with hydrochloric acid and boiled until no more free chlorine is evolved. (Test with starch iodide paper. Cl=blue color.) 2 Metallic selenium and tellurium may be precipitated by passing sulphur dioxide into the hydrochloric acid solution.

Keller has shown that tellurium is not precipitated by SO_2 in strong hydrochloric acid solutions (sp.gr. 1.175), whereas selenium is precipitated. Diluted with an equal volume of water (acidity 30 to 50% of above) both tellurium and selenium are precipitated by SO_2 .

SEPARATIONS

One or more of the following procedures may be required according to the material that is being analyzed.

Separation of Selenium and Tellurium from the Iron and Zinc Groups, from the Alkaline Earths and the Alkalies. If sulphur dioxide is passed into a solution containing 30 to 50% of hydrochloric acid (sp.gr. 1.175), selenium and tellurium will be precipitated, the other elements remaining in solution. If the acidity is over 80% of the above strength of hydrochloric acid, only selenium is precipitated.

¹ Van Nostrand's Chem. Annual.

² According to B. Rathke, Zeit. anal. Chem., 9, 484, 1870, no appreciable loss of sclenium occurs in the presence of sodium or potassium chlorides. Rose claims that an appreciable loss occurs when solutions of sclenium are heated above 100° C.

The presence of nitric and of sulphuric acid prevents the copmlete precipitation of tellurium.

Separation of Selenium and Tellurium from Cadmium, Copper and Bismuth. Sulphur dioxide passed into an acid solution containing 30 to 50% hydrochloric acid (sp.gr. 1.175) precipitates selenium and tellurium free from cadmium, and the greater part of bismuth, copper, antimony, etc. Complete separation of selenium and tellurium may be effected by the distillation process described under Separation of Selenium and Tellurium, see below.

Separation from Silver. Silver is precipitated as the chloride, AgCl, se-

lenium and tellurium remaining in solution.

Separation from Gold. The slightly acid solution, free from nitric acid, is diluted with water, ammonium oxalate or oxalic acid added and the precipitated gold allowed to settle several hours (preferably twenty-four hours or more). The gold is filtered off and the selenium and tellurium precipitated in the filtrate with sulphur dioxide.

In the absence of selenium, gold may be separated from tellurium by precipitation with ferrous sulphate added to the solution strongly acidified with hydrochloric acid. Tellurium remains in solution. (Selenium is also precipitated

with ferrous sulphate.)

Separation of Selenium from Tellurium in Strong Hydrochloric Acid by Direct Precipitation with Sulphur Dioxide—Keller's Method. The procedure has already been mentioned. Advantage is taken of the fact that tellurium is not precipitated by SO₂ in strong hydrochloric acid solutions, whereas selenium is precipitated.

Procedure. The two elements are precipitated by sulphur dioxide from an acid solution containing 30 to 40% of strong hydrochloric acid. The precipitate is dissolved in nitric acid and the solution evaporated to dryness on the steam plate. The residue is treated with 200 cc. of hydrochloric acid (sp.gr. 1.175) and boiled to free the solution of nitric acid, since the presence of this acid prevents complete precipitation of tellurium. A little sodium chloride is previously added to minimize the loss through volatilization during the heating. solution is saturated with sulphur dioxide, whereupon selenium is quantitatively precipitated and may be filtered off, washed with a 90% solution of strong hydrochloric acid (sp.gr. 1.175, i.e., 9 parts HCl to 1 part by volume H₂O), followed by dilute acid, then by water until free of acid, and finally by alcohol. Weigh as metallic selenium after drying at 105° C. The tellurium is precipitated from the filtrate by diluting this with an equal volume of water, heating to boiling and again saturating with sulphur dioxide. The precipitate is washed with dilute hydrochloric acid (1:1), followed by water and alcohol, then dried and weighed as tellurium.

Separation of Selenium and Tellurium. Distillation Method

The following method is excellent for determining selenium and tellurium in alloys.

Procedure. The apparatus having been set up as is shown in the cut, Fig. 57, 0.5 gram of the alloy containing selenium and tellurium is placed in the distilling flask D and 30 cc. of H₂SO₄ (sp.gr. 1.84) added. All connections are made tight.

A current of dry HCl gas is allowed to flow into the distilling flask and the contents of the flask heated to 300° C. (The H₂SO₄ should not fume and the temperature should be kept below the boiling point of this acid, otherwise the ¹ Jour. Am. Chem. Soc., 19, 771.

acid distilling into the reservoir R would interfere with the precipitation of selenium by SO_2 .) Selenium distills as selenium chloride into R, while tellurium remains in the distillation flask. During the distillation, SO_2 gas is passed into R, to reduce the selenic salt in solution and precipitate metallic selenium.

The distillation is continued for two or three hours, keeping the temperature of the distillation flask at about 300° C. (i.e., below the boiling-point of H_2SO_4). The contents of the receiver R is transferred to a 400-cc. beaker, and the distillation continued into fresh HCl to assure complete volatilization of selenium from the flask D. The contents of the receiver and any of the metal adhering to the glass wool, or the glass of the vessel, are combined. (The adhering selenium is dissolved off with a little Bromine-Potassium Bromide solution.)

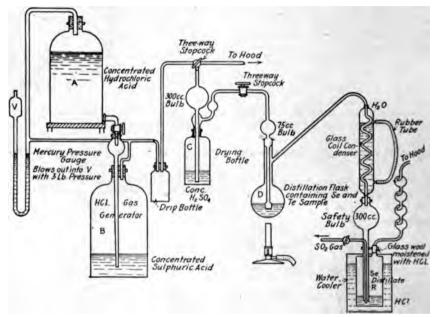


Fig. 57.-- Apparatus for Determining Selenium and Tellurium.

Fig. 57 shows a convenient apparatus for routine determinations of selenium and tellurium in alloys. Hydrochloric acid gas is generated by allowing strong hydrochloric acid to flow into concentrated sulphuric acid (see A and B in drawing Fig. 57). The gas is dried by passing it through strong sulphuric acid (C in figure). A mercury pressure gauge, arranged to allow gas to blow out at a pressure of 3 or 4 pounds, prevents accident occurring due to stoppage in the system.

Determination of Selenium. The solution in the beaker is saturated with SO₁, then heated to boiling and the precipitated selenium allowed to settle several hours, or overnight. The precipitate is filtered into a weighed Gooch crucible, then washed with hot water and finally with alcohol. The residue is dried for an hour at 100° C. and weighed.

$$\frac{\text{Weight of Se} \times 100}{0.5} = \% \text{ Se.}$$

Determination of Tellurium. The residue in the distilling flask is transferred to a 600-cc, beaker containing 150 cc. of cold water. Ten cc. of 3% Fe(NO₃)₂ solution is added, and made ammoniacal, and then heated to boiling; the precipitate filtered off on a large filter and washed with hot water. The precipitate is dissolved in hot dilute HCl and the solution nearly neutralized with NH₄OH. The slightly acid solution is saturated with H₂S, the precipitated tellurium filtered off on an S. and S. No. 589, 12½ cm. filter, and washed with H₂S water.

The precipitate is dissolved off the paper into a small beaker with a mixture of equal parts of HCl and bromine-potassium bromide solution.¹ The paper is washed with water keeping the volume of the solution as small as possible. The filtrate should contain 20% HCl.

Tellurium is precipitated by saturating the solution with SO₂. The precipitate, after heating to boiling, is allowed to settle for several hours and filtered onto a weighed Gooch. It is washed with hot water and then with alcohol and dried for an hour at 100° C., cooled in a desiccator and weighed.

$$\frac{\text{Weight of Te} \times 100}{0.5} = \% \text{Te}.$$

GRAVIMETRIC METHODS FOR DETERMINING SELENIUM AND TELLURIUM

The sections on Preparation and Solution of the Sample and Separations should be carefully studied, as details for the precipitation of selenium and tellurium are given.

SELENIUM

Precipitation of Selenium by Sulphur Dioxide

The procedure for isolation of selenium by precipitation with sulphur dioxide gas, passed into the hydrochloric acid solution, has been given already in detail. For matter of convenience the procedure is briefly outlined here.

Procedure. The sample obtained in solution according to the procedure outlined under Preparation and Solution of the Sample and freed from nitric acid, is saturated with sulphur dioxide, whereupon selenium is precipitated in its elemental condition. If the solution is strongly acid with hydrochloric acid (HCl=sp.gr. 1.175), tellurium remains in solution, if present. It is advisable to wash the precipitated selenium with moderately strong hydrochloric acid, followed by the dilute acid, then with water until free of acid, and finally with alcohol. The residue is dried at 105° C. and weighed as metallic selenium.

The filtrate should be tested for selenium by saturating again with SO₂. Tellurium precipitates quantitatively from hydrochloric acid solution of half the above strength, hence will be evident in the filtrate, if present.

¹The potassium bromide solution is made by adding 200 cc. of liquid bromine to 320 grams of potassium bromide salt dissolved in just sufficient water to form a saturated solution.

Reduction to Metallic Selenium Potassium Iodide Method

The method worked out by Peirce ¹ is useful in determining selenium in samples containing less than 0.1 gram selenium. Larger amounts are apt to occlude iodine, giving high results.

Procedure. The sample containing selenious acid or a selenite is diluted to 400 cc. and acidified with hydrochloric acid. Potassium iodide is added in excess, about 3 grams more than is required to effect reduction, and the solution boiled about twenty minutes. The precipitate is filtered and washed as usual, then dried and weighed as metallic selenium.

TELLURIUM

Precipitation of Tellurium by Sulphur Dioxide

The procedure has been given under the section on Separations. The following method is useful for determining tellurium in samples in which selenium estimations are not desired.

Procedure. A sample of 1 to 5 gramsis taken for analysis and placed in a No. 5 porcelain crucible. Ten cc. of conc. HNO₂ are added very cautiously and, when the apparent action has ceased, the sample is placed on the steam bath until all NO₂ fumes have been expelled. Four to 5 drops of conc. H₂SO₄ are now added and the solution evaporated to dryness on the steam bath. About 15 cc. of conc. HCl are added and the solution again evaporated to dryness. By this latter procedure any selenium that may be present is converted to the easily volatile chloride. The crucible is placed on a triangle on a wire gauze over a low flame and heated cautiously ² until all white fumes have disappeared and then at dull red heat until all signs of crystallized selenious chloride have disappeared. The residue in the crucible is tellurious dioxide and ferric oxide.

The crucible is cooled and the residue dissolved in conc. HCl in a No. 4 beaker and the solution diluted to 250 cc. with distilled water. H₂S is passed into the solution until tellurium is completely precipitated. The precipitate is filtered onto a 12½ cm. filter, S. & S. 589 quality, and washed with H₂S water.

The precipitate is dissolved in a 250-cc. beaker by adding a mixture of bromine-potassium bromide (200 cc. of liquid bromine added to 320 grams of KBr salt that has been dissolved in just sufficient water to form a saturated solution), 1 part and conc. HCl, 1 part, using the least amount of the mixture necessary to dissolve the precipitate and wash with a little water. The filtrate should contain 20% HCl.

The solution is thoroughly saturated with SO₂ gas, and then heated to boiling. The precipitated tellurium is allowed to settle for several hours, preferably over night, and filtered into a weighed Gooch crucible, then washed with hot water and finally with alcohol. After drying for an hour at 100° C., the tellurium is cooled and weighed.

Weight of the residue multiplied by 100 divided by weight taken gives per cent telurium.

¹ A. W. Peirce, Am. Jour. Sci. (4), 1416. Gooch, "Methods of Chemical Analysis," 376

² Cautious heating is necessary to prevent mechanical loss of tellurium during the volatilization of selenium.

Determination as Tellurium Dioxide

The following procedure worked out by Browning and Flint 1 provides for the direct estimation of tellurium in the form of its dioxide, TeO₂, in presence of selenium. The oxide is not affected by the air, it is anhydrous, non-hydroscopic and may be obtained in pure form. Selenium and tellurium are precipitated by sulphur dioxide from a hydrochloric acid solution according to the procedures given. The elements are filtered off, dissolved in hydrochloric acid containing sufficient nitric acid to cause solution and carefully taken to dryness on the water bath. The mixture is then treated as follows:

Procedure. The material is dissolved in hydrochloric acid, or in a 10% solution of potassium hydroxide, using about 2 cc. per 0.2 gram of dioxide. The solution, if alkaline, is slightly acidified with hydrochloric acid and then diluted to 200 cc. with boiling water. Dilute ammonium hydroxide is now added in faint excess, followed by the faintest possible excess of acetic acid, whereby the finely crystalline tellurium dioxide is precipitated. The precipitate is transferred to the perforated crucible containing an asbestos mat, and washed rapidly with cold water, then dried to constant weight at 105° C. and weighed as TeO₂.

Notes. The addition of a few drops of acetic acid, as recommended, causes the precipitation to become quantitative when the solution has cooled.

Hot water is used for the dilution, since cold water induces a flocky precipitation with inclusion of selenious acid.

VOLUMETRIC DETERMINATION OF SELENIUM AND TELLURIUM

Iodometric Determination of Selenic, or Telluric Acid—Reduction with Hydrochloric Acid and Distillation

The method depends upon the reduction of selenic or telluric acid to selenious or tellurious acid by heating with hydrochloric acid, the evolved chlorine being a measure of the acids in question. The chlorine absorbed in potassium iodide solution liberates its equivalent of iodine, which may readily be determined by titration with standard thiosulphate. The following reactions illustrate the change that takes place:

$$K_2SeO_4+4HCl = 2KCl+H_2SeO_2+H_2O+Cl_2$$
,
 $K_2TeO_4+4HCl = 2KCl+H_2TeO_2+H_2O+Cl_2$,

1 Cl. =1 I =
$$\frac{\text{Se}}{2}$$
 or $\frac{\text{Te}}{2}$ = 63.75 grams Te or 39.6 grams Se per liter normal solution.

According to Gooch and Evans² over 30% of strong hydrochloric acid (sp.gr. 1.20) should be present. Dilute hydrochloric acid having a strength of 10% of HCl, sp.gr. 1.2, does not react with liberation of chlorine. Care must be taken not to prolong the boiling after the solution reaches a concentration of half strength, since over reduction may take place and the metals be liberated.

Philip E. Browning and Wm. R. Flint, Am. Jour. Sci. (4), 28, 112.
 F. A. Gooch, Methods in Chemical Analysis," John Wiley & Sons, Pub.
 F. A. Gooch and P. S. Evans, Jr., Am. Jour. Sci., (3), 1, 400.

Procedure. The sample containing the selenate or tellurate is treated with 75 cc. of hydrochloric acid. containing 25 cc. of strong HCL sper. 1290 per 62 gram of the exides, in a distillation flask connected with a Drezel wash bottle receiver, water cooled, and charged with potassium iodide solution. A current of CO₂ is passed into the flack to sweep the liberated chlorine into the isdide solution. The sample is boiled until nearly one-third its volume has distilled into the receiver. The liberated isdine is titrated with standard this sulphate. One cc. N/10 Na₂S₂O₁ = 0.00396 gram Se or 0.006375 gram Te.

COMMERCIAL SELENIUM

Selenium

Weigh out four one-half gram (.5000 g.) portions of the finely ground sample (100 mesh) into a 150 cc. beaker. Add 10 cc. H₂O, then add slowly 15 cc. conc. HNO₄ and cover with a watch glass.

Evaporate to dryness on the water bath, take up with 10 cc. HCl (1-1) and 20 cc. II₂O in the cold. Filter off the insoluble into a 400 cc. beaker; to the filtrate add sufficient conc. HCl to make a solution of 70% conc. HCl by volume.

Precipitate the selenium at room temperature by a slow current of SO: gas at the rate of two small bubbles a second, stirring frequently to granulate the selenium. Care must be taken to keep the solution at room temperature, 60 70" F., by placing the beaker in a vessel of running tap water.2

When all the selenium has been precipitated and the solution smells strongly

of SO₂, remove and allow to settle for one-half hour.

Decant the supernatant liquor through a tared Gooch crucible and wash the precipitated selenium in the beaker three times with conc. HCl and once with cold water, decanting each time through the crucible. ..

Add to the precipitate still in the beaker 25 cc. cold water and from a wash bottle an ordinary stream of hot water with vigorous stirring, until the selenium turns black and granular.3 The sclenium is then readily filtered off, washed with hot water finally with alcohol and dried at 105° C. to constant weight. Weigh as metallic selenium.

In order to quickly obtain a constant weight, it is sometimes necessary to break up the precipitate of the selenium in the crucible with a platinum rod to facilitate the driving off of the moisture.

After the final weight is obtained, the crucible is gently heated, to expel the selenium. This is a check on the weight and the purity of the precipitated sclenium.

· Evaporating to dryness on a hot stove in place of the water bath, causes a loss of softment by volatilization.

The archer claims there is an appreciable loss of selenium when heated above 105° C. and I of when the form of chloride when heated above 100° C., even in the presence

and of sometiment the form of chloride when heaten above 100 Cq even as a solution and perassium chlorides.

If the tenterature of the solution when precipitating sclenium is above 70° F., the solution hals upon lading impurities which can never be washed out; if below 10° I among the periodical solution occurs, and the solution occurs which is not made granular as above, it cakes in drying and thus most are solved at 10° C. If the water is too hot the sclenium partially melts: although a solution of the solution of the solution of 70° C, is about right. A time supersity will also impose the correct results.

The resolute has connected solid a and gold.

*The results may remote if sili a and gold.

Tellurium

Add three (3) grams of powdered tartaric acid to the filtrate from the selenium precipitate, dilute to four times its bulk with hot water, then add 25 cc. NH₄OH. Saturate the liquid with SO₂ gas (takes about two minutes) and bring to a boil. Allow to stand for two hours, or longer, on a hot plate. The granular precipitate is filtered on a tared Gooch crucible washed with hot water; dried at 115° C. to constant weight and weighed as metallic tellurium.

The above method when strictly followed gives accurate results, but the

beginner is apt to deviate from the method as follows:

Not testing wash waters and filtrates, and finally in not having beakers and precipitating tubes entirely free from grease, the latter in this laboratory are always flame burned before using.

Lead —Copper —Iron

Weigh out 10-25 grams of sample into a No. 4 casserole, dissolve in 50-75 cc. conc. HNO₂ and evaporate to dryness. Expel the selenious acid by heating the casserole with just enough heat to volatilize the selenious acid, care being taken not to heat too rapidly, or too hot, so as not to cause a mechanical loss of the non-volatile matter. Take up the residue with 10 cc. HNO₂ (1.42)+5 cc. HCl (1.19), evaporate to 5 cc. add 5 cc. H₂SO₄ (1.84) and evaporate to fumes, cool, take up in 75 cc. H₂O and allow to stand over night. Filter off lead sulphate, wash in the usual manner with very dil. sulphuric acid and alcohol, dissolve in ammonium acetate and determine the lead in the usual way as the chromate.

Pass H₂S into the filtrate, filter off the sulphides and ignite the precipitate (As, Se and Te being burned off), dissolve residue in conc. HNO₃, add NH₄OH, and determine copper volumetrically.

Boil H₂S out of filtrate, oxidize with a few small crystals of chlorate and precipitate the iron with NH₄OH. With such a small quantity of iron it is best to filter the ferric hydrate and either burn and weigh as the oxide, or determine the iron by volumetric methods.

Insoluble in Commercial Selenium

Weigh out 10-25 grams in No. 4 porcelain casserole. Dissolve in concentrated HNO₃ and evaporate to dryness. Add HCl (1.19) and dehydrate. Take up insoluble matter with HCl and water, filter, wash, ignite and weigh in the usual manner.

Selenium and Tellurium in Refined Copper

The success and accuracy of determining small amounts of impurities, is to collect these impurities from a large sample, and to do the necessary chemical work in a small volume of solution.

Ferric hydroxide when precipitated from a copper solution has the peculiar property of forming insoluble compounds with As, Sb, Se and Te.

For complete precipitation, the iron contents must be at least thirty times the combined As, Sb, Se and Te and must be entirely precipitated from the solution.

The iron is best added by means of the ferrous salt (FeSO₄+7H₂O) dissolved in water and oxidized to the ferric salt with HNO₃. Roughly the iron content of FeSO₄+7H₂O is 20%, or one-fifth of the weight of ferrous sulphate.

Weigh 100 grams of drillings into a 1300 cc. beaker, cover with water and add gradually 350 cc. HNO₃ (1.42). When the copper is in solution, boil out all red fumes, dilute to 700 cc. with warm water and neutralize with NH₄OH until just enough copper hydroxide has been formed to cover the bottom of the beaker; then add the required amount of oxidized ferrous sulphate in solution. Stir well, dilute to 900 cc. and boil for at least one hour, settling on the warm plate over night. Filter on a 15 cm. filter.

Treat the filtrate with ammonia until a precipitate of copper hydroxide has formed to cover the bottom of the beaker and half the quantity of oxidized FeSO₄+7H₂O added previously, is again added and the solution boiled for one hour, allowing to settle over night on the warm plate. Filter on a 15 cm. filter. It is absolutely necessary that no iron salts be left in this filtrate, either in solution, or as hydrate, therefore, this filtrate had best be tested with ammonia and refiltered on a 15 cm. filter. The three precipitates on the 15 cm. papers are treated as one, dissolved in the least quantity of warm H₂SO₄ (1-1), the papers washed well with hot dil. H₂SO₄ (1-20) and filtered into a 600 cc. beaker. Make strongly ammoniacal, boil well and filter, washing the precipitate well and free from the folds into the apex of the filter. Refilter the filtrate to catch any iron that has washed through. The papers are spread open and the precipitates dissolved in 25 cc. warm HCl (1-1) in a 250 cc. beaker, using as little hot water as possible to remove the yellow stains.

Filter the solution into a 400 cc. beaker, washing with as little hot water as possible. To the filtrate add four times its volume of conc. HCl and cool.

Pass SO₂ gas through this liquid at the rate of one bubble per second, keeping the solution cool.

Filter off the precipitated Se on a tared Gooch crucible wash with cold water and alcohol, dry at 60° C. for two hours, then at 105° C. to constant weight.

Weigh as metallic Se.

Expel the Se from the crucible and reweigh as a check on the weight and the purity of the precipitate.

Tellurium

To the filtrate from the precipitated Se, add 2 grams of tartaric acid in order to keep the Sb in solution, dilute to 600 cc. with hot water, add 50 cc. conc. NH₄OH, and saturate the solution with SO₂ gas. Boil for two minutes and allow to settle 4-6 hours.

Filter the Te on a tared Gooch crucible, wash with hot water and finally with alcohol, dry at 115° C. to constant weight.

Weigh as metallic Te.

¹ Te is best precipitated by SO₂ gas in a 20-30% HCl solution and the strong (80%) HCl solution from the Se precipitation is best neutralized to 25-30%, by the use of ammonia.


SILICON

WILFRED W. SCOTT

Si, at. wt. 28.3; sp.gr. amor. 2.00.; crys. 2.49; m.p. 1420° C.; oxides SiO, 1 SiO,

DETECTION

The finely ground sample together with a small quantity of powdered calcium fluoride is placed in a small lead cup 1 cm. in diameter and depth (see Fig. 58), and a few drops of concentrated sulphuric acid added. A lead cover, with a small aperture, is placed on the cup, and the opening covered with a piece of moistened black filter paper. Upon this paper is placed a moistened pad of ordinary filter paper. The cup is now gently heated on the steam bath. At the end of about ten minutes a white deposit will be found on the under side of the black paper, at the opening in the cover, if an appreciable amount of silica is present in the material tested.2



A silicate, fused with sodium carbonate or bicarbonate in a platinum dish and the carbonate decomposed by addition of hydrochloric acid with subsequent evaporation to dryness, will liberate silicon as silicic anhydride, SiO₂. The silica placed in a platinum dish is volatilized by addition of hydrofluoric acid, the gaseous silicon fluoride being formed. A drop of water placed in a platinum loop, held in the fumes of SiF4, will become cloudy owing to the formation of gelatinous silicic acid and fluosilicic acid.

$3SiF_4+3H_2O=H_2SiO_2+2H_2SiF_6$.

If a silicate is fused in a platinum loop with microcosmic salt, the silica floats around in the bead, producing an opaque bead with weblike structure upon cooling.

ESTIMATION

The gravimetric procedure is the only satisfactory method for the estimation of silica. The substance in which the element is combined as an oxide or as a silicate is decomposed by acid treatment or by fusion with an alkali carbonate or bicarbonate, the material taken to dryness with addition of hydrochloric acid, whereby the compound silica is liberated. If other elements are present the silica is volatilized by addition of hydrofluoric acid and estimated by the loss of weight of the residue.

The element silicon has no important application. Its use for electrical resistance has been suggested. A rod 10 cm. long with cross section of 40 sq.mm. has a resistance of 200 ohms against a carbon rod of the same dimensions of 0.15

¹ Dictionary of Applied Chemistry. Thorpe, page 671. ² Philip E. Browning, Am. Jour. Sci. (4), 32, 249.

ohm. Impure silica finds use in fluxes in manufacture of glass; pure silica for the manufacture of silica ware. With caustic it forms an adherent sodium silicate. Silicon carbide, carborundum, is used for refractory purposes, fire brick, zinc muffles, coke ovens. Crystolon, the crystalline form, is used as an abrasive, in making grinding wheels, sharpening stones, etc.

Combined as SiO₂ and in silicates the element is very widely distributed in nature and is a required constituent in practically every complete analysis of ores, minerals, soils, etc. It is present in certain alloys, ferro-silicon, silicon

carbide, etc.

The element is scarcely attacked by single acids, but is acted upon by nitric-hydrofluoric acid mixture. It dissolves in strong alkali solutions. Silica is decomposed by hydrofluoric acid and by fusion with the fixed alkali carbonates or hydroxides.

Preparation and Solution of the Sample

General Considerations. The natural and artificially prepared silicates may be grouped under two classes: 1. Those which are decomposed by acids. 2. Silicates not decomposed by acids. The minerals datolite, natrolite, olivine and many basic slags are representative of the first class, and feldspar, orthoclase, pumice and serpentine are representative of silicates not decomposed by acids. (See more complete list under List of More Important Silicates, page 433.) The first division simply require an acid treatment to isolate the silica, the latter class require fusion with a suitable flux.

In technical analysis, in cases where great accuracy is not required, the residue remaining, after certain conventional treatments with acids, is classed as silica. This may consist of fairly pure silica or a mixture of silica, undecomposed silicates, barium sulphate and certain acid insoluble compounds. For accurate analyses this insoluble residue is not accepted as pure silica, unless impurities, which are apt to be found with the silica residue, are known to be absent from the material under examination.

Although the procedure for isolation of silica is comparatively simple, errors may arise from the following causes:

1. Imperfect decomposition of the silicate.

- 2. Loss of the silica by spurting when acid is added to the carbonate fusion.
- 3. Slight solubility of silica, even after dehydration, especially in presence of sodium chloride and magnesia.

4. Loss due to imperfect transfer of the residue to the filter paper.

- 5. Mechanical loss during ignition of the filter and during the blasting, due to the draft whirling out the fine, light silica powder from the crucible.
- 6. Error due to additional silica from contaminated reagents or from the porcelain dishes or glassware in which the solution was evaporated. A blank of 0.01% on the sodium carbonate will make an error of 0.1% per gram sample in an ordinary fusion where 10 grams of the flux are required.

7. Error due to loss of weight of the platinum crucible during the blasting.

8. Incomplete removal of water, which is held tenaciously by the silica. Furthermore, weighing of the residue should be done quickly, as the finely divided silica tends to absorb moisture.

Two general procedures will be given for treatment of the acid decomposable and undecomposable silicates. It is frequently advisable to use these two procedures in conjunction, extracting the material first with acid, and then fusing

SILICON 433

the insoluble residue with sodium carbonate; this procedure is used when a gritty residue remains after the acid extraction. Following the general procedures for decomposition of silicates, certain special methods will be given.

List of Most Important Silicates. Silicates decomposed by acids. Allanite; allophane; analoite; botryolite; brewsterite; calamine; chabasite; croustedtitite; datolite (hydrated silicate and borate of Ca with Al and Mg); dioptase; eulytite; gadolinite; gahlenite; helvite; ilvaite (silicate ferrous and ferric iron with Al₂O₃, CaO and MgO); laumonite; melinite; natrolite (hydrated silicate of Al and Na with Fe and

MgO); laumonite; melinite; natrolite (hydrated silicate of Al and Na with Fe and CaO); okenite; olivine (silicate of Fe and Mg); peetolite; prehenite (hydrated Al and Ca silicate with Fe, Mn, K, Na, etc.); teproite; wernerite; woolastonite; zaolite. Silicates undecomposed by acids. Albite; audalusite; augite; axinite; beryl; carpholite; cyanite; diallage, epidote (silicate of Fe, Al and Ca with FeO, Mn, Mg, K, Na); euclase; feldpsar (silicate of K, Na, Al, Fe, Ca and Mg); garnet; iolite; labradorite; (micas of K and Mg); orthoclase; petalite; pinite, prochlorite; pumice; serpentine; sillimanite, talc, topaz, tourmaline (Fe₂O₃, FeO, Mn, Al, Ca, Mg, K, Na, Li, SiO₂, B₂O₃, P₂O₅, F); vesuvianite.

Preparation of the Substance for Decomposition

If the material is an ore or mineral it is placed on a steel plate within a steel ring and broken down by means of a hardened hammer to small lumps and finally to a coarse powder. A quartered portion of this is air dried and ground as fine as possible in an agate mortar and preserved in a glass-stoppered bottle for analysis.

Analyses are based on this air-dried sample. If moisture is desired it may be determined on a large sample of the original material. Hygroscopic moisture is determined on the ground, air-dried sample, by heating for an hour at 105 to 107° C.

Decomposition of the Material, General Procedures Silicates Decomposed by Acids

Acid extraction of the silicates. 0.5 to 1 gram of the finely pulverized material placed in a beaker or casserole is treated with 10 to 15 cc. of water and stirred thoroughly to wet the powder. It is now treated with 50 to 100 cc. cf strong hydrochloric acid and digested on the water bath for fifteen or twenty minutes with the beaker or casserole covered by a watch-glass. If there is evidence of sulphides (pyrites), etc., 10 to 15 cc. of concentrated nitric acid are now added and the containing vessel again covered. After the reaction has subsided, the glass cover is raised by means of riders and the mixture evaporated to dryness on the water bath. (This evaporation may be hastened by using a sand bath, boiling down to small bulk at comparatively high temperature, then to dryness on the water bath. Decomposition is complete if no gritty particles remain. A flocculent residue will often separate out during the digestion, due to partially dehydrated silicic acid, hydrated silicic acid, Si(OH), is held in solution.) The silicic acid is converted to silica, SiO2, the residue taken up with dilute hydrochloric acid, silica filtered off, washed with water acidified with hydrochloric acid, and estimated according to the procedure given later.

¹Water is added to the sample and then acid, as strong acid added directly would cause partial separation of gelatinous silicic acid, which would form a covering on the undecomposed particles, protecting them from the action of the acid.

Silicates Not Decomposed by Acids

Fusion with Sodium Carbonate or Sodium Bicarbonate. 0.5 to 1 gram of the air-dried, pulverized sample is placed in a large platinum crucible or dish in which has been placed about 5 grams of anhydrous sodium carbonate. sample is thoroughly mixed with the carbonate by stirring with a dry glass rod, from which the adhering particles are brushed into the crucible. A little carbonate is sprinkled on the top of the mixture and the receptacle covered. It is heated to dull redness for five minutes and then gradually heated up to the full capacity of a Méker burner. When the mix has melted to a quite clear liquid, which generally is accomplished with twenty minutes of strong heating, a platinum wire with a coil on the immersed end is inserted in the molten mass, and this allowed to cool. The fusion is removed by gently heating the crucible until the outside of the mass has melted, when the charge is lifted out on the wire, and after cooling disintegrated by placing it in a beaker containing about 75 cc. dilute HCl (1 part HCl to 2 parts H₂O), covering the beaker to prevent loss by spattering. The crucible and lid are cleaned with dilute hydrochloric acid, adding this acid to the main solution. When the disintegration is complete, the solution is evaporated to dryness and silica is estimated according to directions given later.

If decomposition is incomplete, gritty material will be found in the beaker upon treatment of the fusion with dilute acid. If this is the case, it should be filtered off and fused with a second portion of sodium carbonate, and the fusion

treated as directed above.

Notes. Fusions with soluble carbonates are generally best effected with the sodium salt, except in fusions of niobates, tantalates, tungstates, where the potassium salt is preferred on account of the greater solubility of the potassium compounds. Sodium alone has an advantage over the mixed carbonates, Na₂CO₂+K₂CO₃, as silicals has a high melting-point and a flux, which fuses at 810° C., is more apt to cause disintegration of the silicate than the mixture, which melts at 690° C.

Prolonged blasting is undesirable, as it renders the fusion less soluble. Aluminum and iron are also rendered difficultly soluble, when their oxides are heated to a high

temperature for some time.

If the melt is green, it is best to dissolve out the adhering melt from the crucible with dilute nitric acid, as a manganate (indicated by the color), if present, will evolve free chlorine by its action on HCl and this would attack the platinum.

Fluorides.¹ In presence of fluorides the melt is extracted with water (an acid extraction would volatilize some of the silica), and the extract filtered off from the insoluble carbonates. To the filtrate is added about 5 grams of solid ammonium carbonate, and the mix warmed to 40° C. and allowed to stand for several hours. The greater part of the silica is precipitated. This is filtered off and washed with water containing ammonium carbonate. Preserve this with the insoluble carbonate for later treatment. The filtrate, containing small amounts of silicic acid, is treated with 1 to 2 cc. of ammoniacal zinc oxide solution (made by dissolving C.P. moist zinc oxide in ammonia water). The mixture is boiled to expel ammonia and the precipitate of zinc silicate filtered off. The precipitate is washed into a beaker through a hole made in the filter, and the adhering material dissolved off with dilute HCl, enough being added to dissolve the remaining residue. This is evaporated to dryness and silica separated as usual. Meantime the insoluble carbonate is dissolved with HCl, evaporated to

¹ Sodium bicarbonate may be used in place of the carbonate with excellent results.

SILICON 435

dryness and any silica it contains recovered. Finally all three portions of silica are combined, ignited and silica estimated as usual.

Special Procedures for Decomposing the Sample

Treatment of Iron and Steel for Silica. One gram of pig-iron castings, or 5 grams of steel are taken for analysis, both the fine and coarse drillings being taken in about equal proportion. (Fine particles contain more silicon than the coarse chips.) Twenty to 50 cc. of dilute nitric acid (sp.gr. 1.135) are added to the sample in a 250-cc. beaker or small casserole, and this covered. If the action is violent, cooling, by placing the beaker in cold water until the violent action has subsided, is advisable. Twenty cc. of 50% sulphuric acid are added and the solution evaporated on the hot plate to SO₂ fumes. After cooling, 150 cc. of water are added and 2 to 5 cc. dilute sulphuric acid. The mixture is heated until the iron completely dissolves and the silica is filtered off onto an ashless filter, washed with hot dilute hydrochloric acid (sp.gr. 1.1), and with hot water until free from iron. The residue is ignited and the silica estimated according to the procedure given later.

Pig iron and cast iron may be decomposed by digestion with a mixture of 8 parts by volume of HNO₃ (sp.gr. 1.42), 5 parts of H₂SO₄ (sp.gr. 1.84), and 17 parts of water.

Steel and wrought iron may be disintegrated by a mixture of 8 parts by volume of HNO₃ (sp.gr. 1.42), 4 parts H₂SO₄ (1.84), and 15 volumes of water.

Ferro Silicons. Dilute hydrochloric acid, 1 volume of acid (sp.gr. 1.19), with 2 volumes of water is a better solvent than the strong acid.

Steels Containing Tungsten, Chromium, Vanadium and Molybdenum. Fusion with potassium acid sulphate, KHSO₄, in a platinum dish, or sodium peroxide in a nickel crucible will generally decompose the material. Sodium peroxide is of special value in decomposing chromium alloys.

Silicon Carbide, Carborundum. This is best brought into solution by fusion with potassium hydroxide in a nickel crucible. Sulphuric, hydrochloric, nitric acids, or aqua regia have no effect upon this refractory material.

Sulphides, Iron Pyrites, etc. These require oxidation with strong nitric acid or a mixture of bromine and carbon tetrachloride, followed by nitric, exactly according to the procedure given for solution of pyrites in the determination of sulphur. The sample is taken to dryness and then hydrochloric acid added and the solution again evaporated. The residue is dehydrated and silica determined as usual.

Slags and Roasted Ores. Digestion with hydrochloric acid according to the first general procedure is best. The addition of nitric acid to decompose sulphides may be necessary.

Decomposition of silicates by fusion with lead oxide (method of Jannasch), and calcium carbonate and ammonium chloride (method of Hillebrand), are of value when sodium is desired on the same sample. The procedures are given under chapters on Sodium and Potassium.

NOTE. K₂CO₂ is preferred to Na₂CO₂ for fusion of tungstates, niobates and tantalates on account of the greater solubility of the potassium salts. For corundum and alumina silicates Na₂CO₂ is preferred as double salt of potassium and aluminum are less soluble than the sodium salt.¹

Fluorides of silicon are fused with boric acid, BF, is volatilized, SiF, is not formed. P. Jannasch.²

¹J. L. Smith, Am. Jour. Sci. (2), **40**, 248, 1865. C. N., **12**, 220, 1865. ³Ber., **28**, 2822, 1896.

436 SILICON

PROCEDURE FOR THE DETERMINATION OF SILICON AND SILICA

As has been stated, the gravimetric method for determination of silica is the only satisfactory procedure for estimation of this substance. The oxidation of the element and its isolation have been dealt with in the section Preparation and Solution of the Sample. The following directions are for purification and final weighing of the element in the form of its oxide, silica, SiO₂.

Extraction of the Residue—First Evaporation. The residue, obtained by evaporation of the material after decomposition of the silicate, by acids or by fusion, as the case required, is treated with 15-25 cc. of hydrochloric acid (sp.gr. 1.1) covered and heated on the water bath 10 minutes. After diluting with an equal volume of water, filtration is proceeded with immediately, and the silica is washed with a hot solution consisting of 5 cc. hydrochloric acid (sp.gr. 1.2) to 95 cc. of water and finally with water. This filtration may be performed with suction. The filtrate and washings are evaporated to small volume on a sand bath and then to dryness. This contains the silica that dissolved in the

first extraction.

Second Evaporation. The residue obtained from evaporation of the filtrate is dehydrated for 2 hours at 105-110° C.1 and extracted with 10 cc. of hydrochloric acid (sp.gr. 1.1) covered and heated on the water bath for ten minutes diluted to 50 cc. with cold water and filtered immediately, without suction. The residue is washed with cold water containing 1 cc. concentrated hydrochloric acid to 99 cc. water, the washed residue containing practically all? the silica, that went into solution in the first extraction, is combined with the main silica residue. heated in a platinum crucible until the filters are thoroughly charred, and then ignited more strongly to destroy the filter carbon and finally blasted over a Méker burner for at least thirty minutes, or to constant weight, the crucible being covered. After cooling the silica is weighed. For many practical purposes this residue is accepted as silica, unless it is highly colored. For more accurate work, especially where contamination is suspected (silica should be white), this residue is treated further.

Estimation of True Silica. Silica may be contaminated with BaSO₄, TiO₂, Al₂O₃, Fe₂O₃, P₂O₅ combined (traces of certain rare elements may be present). The weighed residue is treated with 3 cc. of water, followed by several drops of concentrated sulphuric acid and 5 cc. of hydrofluoric acid, HF (hood). After evaporation to dryness, the crucible is heated to redness and again cooled and weighed. The loss of weight represents silica, SiO₂.3

¹ Dehydration of silica is aided by the presence of lime and retarded by magnesia. In presence of the latter a soluble magnesium silicate will form if the dehydration is conducted at a temperature much above 110° C., hence it is better to avoid this by taking more time and heating to 100 or 105° as recommended.

Sodium chloride has a solvent action on silica, the reaction of HCl on sodium silicate being reversible; 2HCl+Na₂SiO₃ \(\sigma 2NaCl+H₂SiO₃. An evaporation of the filtrate to dryness will recover the greater part of the silica thus dissolved.

2 Not more than 0.1% of the original SiO₂ may still be in solution.

*Silicic acid cannot be completely dehydrated by a single evaporation and heating, nor by several such treatments, unless an intermediate filtration of silica is made. If, however, silica is removed and the filtrate again evaporated to dryness and the residue heated, the amount of silica remaining in the acid extract is negligible. (See Article by Dr. W. F. Hillebrand, Jour. Am. Soc., 24.) SILICON 437

Nores. Lenher and Truog make the following observations for determining silica: In the sodium carbonate fusion method with silicates, there is always a non-volatile residue when the silica is volatilized with hydrofluoric and sulphuric acids.

2. The non-volatile residue contains the various bases, and should be fused with sodium carbonate and added to the filtrate from the silica when the bases are to be determined.

3. In the dehydration of the silica from the hydrochloric acid treatment of the

fusion, the temperature should never be allowed to go above 110°.

4. Dehydrated silica is appreciably soluble in hydrochloric acid of all strengths. With the dilute acid used, this error is almost negligible.

5. Dehydrated silica is slightly soluble in solutions of the alkaline chlorides. sodium chloride is always present from the sodium carbonate fusion, an inherent error

is obviously thus introduced.

6. The dehydrated silica along with the mass of anhydrous chlorides must not be treated first with water, since hydrolysis causes the formation of insoluble basic chlorides of iron and aluminum, which do not dissolve completely in hydrochloric acid.

- 7. Hydrochloric acid (sp.gr. 1.1) in minimum amount should be used first to wet the dehydrated chlorides and should be followed by water to bring the volume to about 50 cc., after which the silica should be filtered off as quickly as possible.
- 8. Pure silica comes quickly to constant weight on ignition. Slightly impure silica frequently requires long heating with the blast flame in order to attain constant weight, and is then commonly hydroscopic.

9. Evaporations of the acidulated fusion in porcelain give practically as good results

as when platinum is used.

- 10. Filtration of the main bulk of the silica after one evaporation is desirable, inasmuch as the silica is removed at once from the solutions which act as solvents.
- 11. Dehydration of the silica under reduced pressure has no advantages over the common evaporation at ordinary atmospheric pressure.

12. Excessive time of dehydration, viz., four hours, possesses no advantages.

13. Excessive amounts of sodium carbonate should be avoided, since the sodium chloride subsequently formed exerts a solvent action on the silica. The best proportion of the silical characteristics of the solution of the silical characteristics. tions are 4-5 sodium carbonate to 1 of silicate. Less than 4 parts of sodium carbonate

is frequently insufficient completely to decompose many silicates.

14. The non-volatile residue has been found to be invariably free from sodium. Pure silica, on fusion with sodium carbonate, subsequently gives no non-volatile residue.

ANALYSIS OF SILICATE OF SODA

Determination of Na₂O

Five grams of the sample are dissolved in about 150 cc. of water and heated; 1 cc. of phenolphthalein is added and then an excess of standard sulphuric acid from a burette. The excess acid is titrated with standard sodium hydroxide to a permanent pink.

 $H_2SO_4 \times 0.6321 = Na_2O$.

Ten grams of the sample are acidified with hydrochloric acid and evaporated to dryness on the steam bath. The treatment is repeated with additional hydrochloric acid and then the residue taken up with 5 cc. of the acid and 200 cc. of water. The residue is digested to dissolve the soluble salts, filtered, washed and ignited. Silica is determined by loss of weight by volatilization of the silica with hydrofluoric and sulphuric acids. The filtrate is made to 1 liter.

Iron and Alumina. Five hundred cc. (5 grams) of the filtrate from the silica determination are oxidized with HNO₃ and the iron and alumina precipitated with ammonia, washed, ignited and weighed as Al₂O₃ and Fe₂O₃. The residue is dissolved by digestion with hydrochloric acid or by fusion with sodium acid

¹ Victor Lenher and Emil Truog, Jour. Am. Chem. Soc., 38, 1050, May, 1916.

sulphate, and subsequent solution in hydrochloric acid. Iron is determined by titration in a hot hydrochloric acid solution with standard stannous chloride, SnCl₂, solution as usual. If only a small amount of precipitate of iron and alumina is present, as is generally the case, solution by hydrochloric acid is preferable to the fusion with the acid sulphate. The latter is used with larger amounts of the oxides.

Lime, CaO. This is determined in the filtrate from iron and alumina by precipitation as the oxalate and ignition to CaO.

Magnesia, MgO. This is determined in the filtrate from lime by precipitation with sodium ammonium phosphate. The precipitate is ignited and weighed as $Mg_2P_2O_7$ and calculated to MgO. Precipitate $\times 0.3621 = MgO$.

Combined Sulphuric Acid. One hundred cc. of the filtrate from the silica determination (=1 gram) is treated with BaCl₂ solution and sulphuric acid precipitated as BaSO₄.

$$BaSO_4 \times 0.4202 = H_2SO_4$$
 or $\times 0.3430 = SO_3$.

Sodium Chloride. Ten grams of the silicate of soda are dissolved in 100 cc. of water and made acid with HNO₁ in slight excess and then alkaline with MgO. Cl is titrated with standard AgNO₂ solution.

Water. This is determined either by difference or by taking 10 grams to dryness and then heating over a flame and blasting to constant weight.

Note. For detailed procedures for each of the above see special subject.

ANALYSIS OF SAND, COMMERCIAL VALUATION

Silica. Two grams of the finely ground material are fused in a platinum crucible with 10 grams of fusion mixture (K₂CO₃+Na₂CO₃) by heating first over a low flame and gradually increasing the heat to the full blast of a Méker blast lamp. When the fusion has become clear it is cooled by pouring on a large platinum cover. The fused mass on the cover and that remaining in the platinum crucible are digested in a covered beaker with hot hydrochloric acid on the steam bath. The solution is now evaporated to dryness, taken up with a little water and 25 cc. of concentrated HCl and again taken to dryness. Silica is now determined by the procedure outlined under the general method on page 436.

Ferric Oxide and Alumina. The filtrate is oxidized with crystals of solid potassium chlorate, KClO₃, and iron and aluminum hydroxides precipitated with ammonia. The precipitate is filtered, washed, ignited and weighed as Al₂O₂+Fe₂O₃.

Calcium Oxide. To the ammoniacal filtrate 10 cc. of ammonium oxalate sólution are added, the solution heated to boiling and the precipitate allowed to settle until cold. The solution should not be over 200 cc. The calcium oxalate is filtered off, washed and ignited. The residue is weighed as CaO.

Magnesium Oxide. The filtrate from the lime is made strongly ammoniacal and 10 cc. of sodium ammonium phosphate added. The solution during the addition is allowed to stand cold for some time, three to four hours. The precipitate is filtered and washed with dilute ammonia (1 of reagent to 3 parts of water), then ignited and weighed as $Mg_2P_2O_7$. This weight multiplied by 0.3621 = MgO.

For more detailed directions see the individual subjects under the chapters devoted to the element.

W. G. DERBY

Ag, at.wt. 107.88; sp. gr. 10.50-10.57; m.p. 960.5° C.; b.p. about 1950° C.; oxides, Ag₂O, Ag₄O, Ag₂O₁

DETECTION

A trace of silver in most substances is detected with greatest certainty by furnace assay methods.

The wet method of detection of silver most commonly practiced, depends upon observation of the properties of the precipitate formed by the addition of a not excessive amount of alkaline chloride to a cold nitric or sulphuric acid solution of the substance undergoing examination. One-tenth milligram of silver precipitated as silver chloride in a cold 200-cc. acid solution gives a very perceptible opalescence to the liquid.

Silver chloride is white when freshly precipitated, tinted pink when palladium is present; in colorless liquids on exposure to light turns brown, violet, blue or black. By agitation, heating or long standing the precipitate becomes coagulated or granular and in such a state is retained by an ordinary filter. The presence of some forms of organic matter prevents coagulation.

Silver chloride is dissolved by concentrated hydrochloric acid; raising the temperature of the acid assists the action. It is dissolved by sodium thiosulphate, alkali cyanides, mercuric nitrate, and alkaline chlorides.

From mercurous chloride, silver chloride, except when constituting a small proportion of the precipitate, is distinguished by its solubility without decomposition in ammonia. Precipitation from its ammoniacal solution is accomplished by acidifying. Lead chloride, precipitable also by hydrochloric acid, is not flocculent, does not coagulate, but dissolves quite freely by heating. Addition of hydrochloric acid to a solution of silicon, tellurium, thallium, tungsten or molybdenum may produce a precipitate, in each case, easily distinguishable from that of silver chloride, but may mask traces of the salt.

Silver, in a cold solution containing free nitric acid, only a small amount of colored salts and no mercury, may be detected through the formation of a white precipitate, similar in appearance to silver chloride, by addition of a slight excess of an alkaline thiocyanate.

When a solution of silver salt 1 is added to a mixture of 20 cc. ammonium salicylate (20 gr.ms. salicylic acid neutralized with ammonia, a slight excess added and the whole made up to 1000 cc.) and 20 cc. of a 5% solution of ammonium persulphate added, an intense brown color is produced, which will detect the presence of a 0.01 milligram of silver. Lead does not affect the test.

When it appears that the chloride or thiocyanate test for silver is not positive on account of the presence of other precipitable elements, the precipitate, after it

¹ A. W. Gregory, Chem. Soc. Proc., 24, 125, 1908.

settles, is filtered through the finest quality of paper, and the mixture of the ash of the incinerated filter with dry potassium carbonate heated on charcoal with a If silver is present and not associated with a large amount of mouth blowpipe. palladium, there will be found on the charcoal pellicles of the color characteristic of silver, which have no white or vellow sublimate when melted in the oxidizing flame of the blowpipe. The pink palladium salts of silver precipitated by a chloride or thiocyanate before the blowpipe produces metal which is dull in appearance and not readily melted.

Notes. Silver may be recognized in a solution of concentration 1 to 240,000 by the reduction of its salts with alkaline formaldehyde. Whitby's method of detection and estimation of small amounts of silver depends upon the formation of a yellow color through addition of sucrose and sodium hydrate. Ammonium hydrate interferes, but bismuth, cadmium, copper, mercury of either valence, lead or sinc, in amounts equal to that of the silver, do not. Maletesta and DeNola add to the solution to be tested a few drops of a solution of nitrate of chromium and then potassium hydrate to alkalinity. A brownish turbidity or black precipitate of silver oxide forms. The limit of sensitiveness is 0.5 milligram in 100 cc.

ESTIMATION

Silver is determined in copper, lead, silver, sulphur or other ores, in copper and lead furnace by-products, and in lead by furnace assay methods, in which a preliminary acid treatment of the sample is rarely employed; in native copper ore, in copper, copper alloys, gold, gold alloys and in the slime from the electrolytic refining of copper or lead by furnace methods, in which a preliminary acid treatment of the sample is employed, in silver alloys by volumetric or gravimetric methods; in mercury by a gravimetric method; in cyanide mill solution or solutions containing much organic matter by furnace process on the residue obtained by evaporation or precipitation; in silver plating electrolyte by electrolysis.

Solubility. Nitric acid, dilute or concentrated, attacks silver rapidly when hot. The presence of a soluble chloride, iodide or bromide in the solvent or substance will retard and may prevent solution. Unless oxidizing agents are present, dilute sulphuric acid has practically no action on massive silver, but hot, strong acid commences to be an active solvent at a concentration of 75% H₂SO₄. chloric acid attacks silver superficially. The action of alkaline hydrates or carbonates in solution is inappreciable; in a state of fusion, slight.

Furnace Assay Methods. These will be described in the chapter devoted to that subject.

GRAVIMETRIC METHODS

Determination as Silver Chloride

The method is not of extreme accuracy in the presence of much antimony, mercury or lead. By precipitating silver chloride in a well-diluted solution by a weak solution of the precipitant, the error, on account of its property of tenaciously retaining salts, may be made very small. Because of its tendency to decompose, the precipitate of silver chloride should not be exposed to direct sunlight or allowed to stand for many hours.

- ¹ Armani and Barboni, Zeit. Chem. Ind. Kolloide, 6, 290.
- ² Zeit. Anorg. Chem., 67, 62; C.A., 4, 1444. ³ Bull. Chim. Farm., 52, 533.

To the hot nitric or sulphuric acid solution of silver, diluted to about 500 cc., is added, with constant stirring, a few cc. at a time, and to only slight excess, a solution of hydrochloric acid containing $\frac{1}{10}$ the per cent HCl.

The precipitate of silver chloride is coagulated by heating, or brisk stirring, the liquid cooled to room temperature and filtered through a tared Gooch crucible, which has been thickly bottomed with fiber asbestos. The precipitate is washed with water containing a little nitric acid. The dried crucible is heated over a flame until the edges of the precipitate begin to fuse.

$$AgCl \times 0.7526 = Ag$$
.

Alefeld adds 5 cc. ether to the halide solution, before precipitation, to The method is not satisfactory for silver bullion. hasten coagulation.

Determination as Silver Cyanide

In the analysis of mercury, the nitric acid solution of the metal is nearly neutralized with a solution of sodium carbonate. Potassium cyanide solution is then added until the precipitate, which first forms, is dissolved. Then under a hood with strong draft, dilute nitric acid is added in slight excess of the quantity required to combine with the base in the amount of potassium cyanide present. The precipitate of silver cyanide, practically insoluble in dilute nitric or hydrocyanic acid, is coagulated by stirring or long standing and filtered from the cold solution of mercuric nitrate by use of a tared paper-bottomed Gooch crucible. The precipitate is washed with cold dilute nitric acid (1-10) until a test of the washings with hydrogen sulphide shows the absence of mercury. The crucible is dried at 100° to constant weight.

$$AgCN \times 0.8057 = Ag$$
.

Notes. Determination of silver as metal through precipitation with hypophosphorous acid as silver sulphide or as silver chromate, are methods of doubtful technical application.

Electrolytic Method 4

According to the strength of the silver bath 10 or 20 cc. are filtered into a tared 200-cc. platinum dish and according to the greater or smaller excess of cyanide present, ½ to 1 gram of potassium cyanide in solution is added. The electrolyte diluted to about a half inch from the edge of the dish is kept, by a flame underneath, at a temperature of 60°-65° C. during the period of electrolysis at $N.D._{100} = 0.08$ amp.

Complete precipitation, which requires three to three and a half hours, is recognized by test with ammonium sulphide. Without interruption of the current, by use of a siphon, displacement of the electrolyte with water is accomplished. The dish is rinsed with alcohol and ether, dried at 100°, weighed and silver obtained calculated to grams per liter or cubic foot.

Benner and Ross 5 deposit 0.15 gram in twenty minutes with a current of 3 amperes from 50 cc. of electrolyte containing 8 grams potassium cyanide and 2 grams potassium hydrate on a 9-gram platinum gauze cathode.

- Z. anal. Chem., 48, 79. L. E. Salas in communication with the author.
 Mawrow and Mollow, Zeit anorg. Chem., 61, 96.
 Gooch and Bosworth, Am. J. Sci., 27, 241.
 Langbein, "Electro-Deposition of Metals," 6th Ed.

- ⁵ J. A. C. S., July, 1911, 1106.

Exner 1 using a platinum dish as the cathode and a 2-in. diameter bowl-shaper spiral anode revolving 700 R.P.M., deposited 0.4900 gram from about 125 cc. of a hot electrolyte containing 2 grams potassium cyanide in ten minutes at N.D. 2

amps.

The above methods presume the absence of other metals precipitable under the con-

ditions mentioned.

VOLUMETRIC METHODS

Volhard's Thiocyanate Method. This method is especially adapted to determination of moderate quantities of silver in cold dilute nitric acid solutions which contain no mercury, nitrous acid, or a greater amount of yellow. red or brown-colored salts than will give an appreciable tint to the solution, and not so large amount of blue salts as will mask the end-point.

The presence of palladium and silver chloride interfere with the accuracy of

the determination. Bromide or iodide of silver 2 may be present.

The method is based on the greater affinity of silver than ferric for thiocyanate When silver thiocyanate has been completely precipitated, the excess of alkali thiocyanate, in the presence of free nitric acid, reacts with a ferric salt with formation of a reddish-brown solution of ferric thiocyanate.

The ferric indicator may be made from ferric ammonium sulphate, ferric nitrate or from ferrous sulphate by adding a large excess of nitric acid to its concentrated solution and boiling to decompose nitrous acid. Whatever salt is used for indicator it should be free of chlorine, its solution made of constant ferric strength and used in quantities graduated according to the volume of the liquid titrated. A saturated solution of ferric ammonium sulphate (1 cc. to each 20 cc. of the liquid to be titrated), is a convenient form of indicator. The standard solution commonly employed for the determination of silver in silver plate, for the trial assay of Doré metal and for the assay of silver bullion by the Gay-Lussac pipette method has a silver value of 10 milligrams per cc. Since both the commonly employed thiocyanate salts are deliquescent, it is unnecessary to weigh out the exact quantity. Ammonium is less likely to contain chlorine than potassium thiocyanate. In the decimal solution (silver value 1 milligram per cc.), the liter content is 0.7-0.8 gram of ammonium or 0.9-1.0 gram of potassium thiocyanate. Solution is made with chlorine-free water.

For standardizing the decimal solution, 1 gram of standard silver is dissolved in a funnel-closed liter flask by 20 cc. of equal volumes of nitric acid and water. After boiling to decompose nitrous acid the solution is made up to mark with

water at room temperature.

When using the standard thiocyanate solution with the object of obtaining very accurate results, it is good practice, instead of using a standard solution of silver, to obtain the standard by titrating, simultaneously with the assays, solutions of known quantities of standard silver approximately equal in amount and dissolved in the same manner as the assays.

In the operation of titration, after addition of the prescribed proportion of ferric indicator, standard thiocyanate solution is added from a burette to the cold silver solution in 500-cc. Erlenmeyer flask, until the rate of bleaching of the reddishbrown color slackens; then cautiously, with vigorous agitation after each addition,

¹ J. A. C. S., Sept., 1903, 900. ² Rosanoff and Hill, J. A. C. S., March, 1907, 273.

until the liquid shows a tendency to become clear above the settled precipitate and a reddish tint persists. The end-point tint obtained in standardizing the thiocyanate should be matched in titrating the assay solutions. In case the end-point is overrun, standard silver solution may be added until the correct tint is obtained, allowance being made for silver so added.

Since the shade of color at the end-point is dependent upon the concentration of ferric salt and inasmuch as volume, temperature, amount of free nitric acid and amount of silver present are conditions which have more or less influence upon the determination, such conditions as prevailed during the standardization of the thiocyanate solution should be maintained in the operation of the assay.

Notes. Separation from colored salts may be brought about by precipitating the silver with a very slight excess of thiocyanate, allowing the precipitate to settle until the residual liquor is clear, washing by decantation through an alundum filter cone or asbestos-bottomed Gooch crucible, placing the filter and contents in the flask in which precipitation took place, adding strong nitric acid and heating until all silver thiocyanate is decomposed. Titration is made on the cold dilute solution.

Palladium, in quantity sufficient to color the solution, can be eliminated by removal of free acid through evaporation just to dryness, immediately taking up with water and adding a drop or two of a saturated solution of sodium acetate, (free of chlorine). Pure carbon monoxide is passed until the hot liquid is decolorized. The filtrate from the palladium after addition of an excess of nitric acid is titrated when cold.

When part of the silver is present as silver chloride, as an unavoidable product of the analysis, it should be removed by filtration and reduced on the filter with zinc dust after removal of the filtrate. The reduced silver is washed free of chloride, dissolved with hot 20% nitric acid, the solution washed from the filter, concentrated by boiling and added to the filtrate from the silver chloride. Titration may then be made on the silver solution.

In the application of the Volhard method to the assay of a cyanide mill solution, a measured volume of the solution is run through a \(\frac{1}{6}\)-in. layer of zinc dust in a Gooch crucible with care to keep the zinc always covered with the solution. The zinc washed into beaker, is cautiously dissolved with nitric acid, the solution boiled, diluted and, when cold, titrated with a thiocyanate solution which has been standardized by a silver solution which contains an amount of zinc the same as used in the process of reduction.

Gay-Lussac Method²

This very accurate method is especially adapted to the valuation of silver bullion, but may be applied in principle to the determination of silver in a nitric acid solution which contains as little as 100 milligrams of the metal, providing the volume of the solution is not so large or color so deep as to make a precipitate of silver chloride equivalent to 0.1 milligr.ms of silver indistinguishable. Metals whose presence interfere are mercury and tin.

The method is founded upon the almost absolute insolubility of silver chloride or bromide in cold dilute nitric acid and the property of the precipitate becoming so completely coagulated through agitation that it settles speedily, leaving a

¹ Clevenger, Eng. and Min. J., 95, 892, 1913.

² For thorough discussion of this method, consult Jour. Ind. and Eng. Chem., March, 1913, pp. 209-214. Article by F. P. Dewey, Assayer, Bureau of Mines.

liquid sufficiently clear to permit of observance of any precipitate produced by further addition of precipitant.

The presence of free sulphuric acid is prejudicial to a very close determination, because of the volume of liquid required to keep silver sulphate in solution, and also because the result of agitation after addition of precipitant, is apt to be a fine precipitate which does not readily settle.

The use of a bromide is preferable to a chloride salt as a reagent, because its silver salt is less affected by light, coagulates and settles more readily, will suffer more agitation before formation of a fine, slowly settling precipitate, but chiefly because on account of the greater insolubility of silver bromide, the end-point of the operation of titration is more sharply defined.

The reagents required consist of chlorine-free nitric acid, as standard solution of an alkali bromide or chloride of approximately decinormal strength, a decimal solution of the same salt having a silver-precipitating value of 1 milligram per cc., and a decimal silver solution containing 1 milligram of silver per cc. in the form of silver nitrate.

In the assay of silver bullion, the standard solution may contain 5.42 grams of sodium chloride or 11.03 grams of potassium bromide or 9.54 grams of dry sodium bromide per liter, and should have a silver precipitating value, as indicated by the method, of about 1 gram per 100 cc.

The factor of volume change per degree change of temperature from 15 to 21° C. is approximately 0.00012; from 20 to 26°, 0.00019; from 25 to 31° C., 0.00024.

Although the approximate precipitating value should be known by previous test, it is the better practice to determine the exact value by running two or more checks of pure silver simultaneously with each batch of assays than to apply the temperature correction factor.

The decimal salt solution is best made from C.P. salts, either 0.5149 gram sodium chloride or 1.1033 grams potassium bromide per liter.

The decimal silver solution is made by dissolving 1 gram of pure silver with a few cc. of nitric acid and making up to 1 liter with distilled water. (See Method for Preparation of Pure Silver, page 448.)

The apparatus required consists of a pipette which will deliver approximately 100 cc. with an accuracy of not over 5 milligrams variation in weight of the standard solution at constant temperature between successive deliveries, 10-cc. burettes with glass stopcocks; and 8-oz. narrow mouth, round, flint-glass bottles with high, tightly fitting stoppers; the assay bottles should be of a quality which will endure heating in a steam bath or in a hot plate.

The Stas or Ricketts overflow pipette, listed by all laboratory supply firms, is the type most commonly used. This pipette is filled by gravity flow through a rubber tube from the standard solution reservoir connected to the discharge-end. When the liquid overflows, the top is closed by finger, the pinchcock closed, the supply tube removed and the hanging drop wiped off.

Care to avoid introduction of air bubbles into the pipette, uniform habit in respect to pressure of the finger on the top, and method of wiping off the hanging drop, must be practiced to obtain good results.

The automatic dividing pipette with three-way stopcock shown in the illustration, will give remarkably accurate deliveries when properly constructed and manipulated. This type of pipette of the form ordinarily furnished by supply houses, will rarely deliver with sufficient accuracy for bullion assays.

Since the end-point by the Gay-Lussac method depends upon the observance

of cessation of precipitation, it is evident, in order to avoid undue tediousness in its operation, that the silver content of the amount of sample taken for assay should be known within a few milligrams.

This may be ascertained by assay of 1 gram of the sample by the Volhard method, using a thiocyanate solution of decinormal strength, or by cupellation with application of a correction for cupel absorption.

The approximate silver value having been determined, such an amount of the sample is weighed out and placed in an assay bottle, as will contain silver in slight excess of the silver equivalent of the pipette full of standard salt solution. Ten to 15 cc. of nitric (1.26 sp.gr.) acid are added and the bottle kept in a steam bath or on a moderately hot plate until solution of silver is complete.

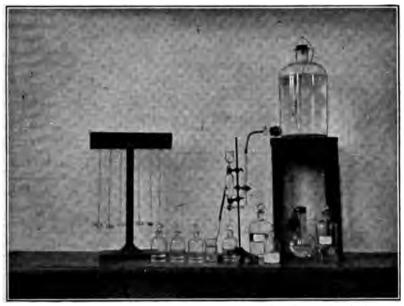


Fig. 59.—Apparatus for Determining Silver. Gay-Lussac Method.

To the cold solution of the sample is added a pipette full of the standard salt solution and the tightly stoppered bottle agitated until the precipitate will settle with sufficient completeness to permit of observance of any turbidity produced by addition of either of the decimal solutions.

More agitation than is absolutely necessary should be avoided, because of the increasing tendency of the precipitate toward the fine granular form, which settles slowly.

On account of alteration of the character of the precipitate by sunlight, the titration should be carried out in a shaded place and as expeditiously as possible.

One-tenth cc. of the decimal salt solution is dropped into the bottle, and holding the bottle against a dark background, the appearance of the cloud of precipitate is noted.

From the character of the precipitate, after some practice, it is possible to judge whether a single cc. or more may be added at once, or whether the titration must be continued by one-tenth cc. additions.

Until the non-appearance of cloudiness indicates the end-point, the bottle

should be agitated after each addition of decimal salt solution.

If the pipette full of standard solution is more than sufficient to precipitate the silver, or in case the end-point has been run over, decimal silver solution is added in 1 cc. portions until precipitation ceases. Decimal salt solution is then added cautiously until the end-point is reached. Completion of the titration should always be with the decimal salt solution. Some confusion in judgment of the endpoint may arise, on account of the fact that an excess of sodium chloride produces turbidity. The appearance of the cloud so produced is characteristic, and can be distinguished after some practice from that exhibited when silver is still in excess. If bromide standard and decimal solutions are used, excess of the reagent produces a turbid film only after long standing.

The silver value in milligrams of the standard solution, plus the number of cc. of decimal salt solution which produced a precipitate, minus the number of cc. of decimal silver solution added, gives the amount of silver in the quantity of sample weighed out.

The result calculated to milligrams silver per gram of sample is customarily

reported in the case of silver bullion as points fineness.

The accuracy of the method is limited by the quality of pipette and the skill of the operator. With a pipette which delivers accurately an experienced operator can speedily make analyses in which the error is only of the order of plus or minus 0.1 milligram of silver. In the comparison of purity of samples of pure silver. it is customary to carry out determinations to the limit of the known accuracy of the pipette delivery.

Notes. If the amount of mercury present is very small, addition of 20 cc. of a saturated solution of sodium acetate and several cc. of acetic acid before introduction of the standard salt solution will prevent precipitation of chloride of mercury. When the quantity of mercury is so large that this method fails, the quantity of silver weighed out is heated several hours at a red heat in a small covered crucible surrounded by

coarsely powdered charcoal within a covered crucible of larger size.

When tin is known to be present in the bullion to the extent of less than 5%, 2 grams tartaric are added to the assay bottle and dissolved with 3 or 4 cc. hot water. When the liquid is cool, 10 cc. nitric acid (1.26 sp.gr.) are added and solution of the bullion effected by the action of acid without the aid of heat. Unless prevented from forming by addition of tartaric acid, metastannic acid stays in suspension and obscures the end-point. If more than 5% of tin is present, such an amount of the sample should be weighed out which will make the tin content of the assay less than 50 milligrams. A weighed amount of pure silver is added sufficient to make the total silver present in the assay slightly more than the silver value of the standard salt solution and the method of solution carried out as described.

No pipette is of use in the practice of the Gay-Lussac method which shows any tendency to spatter at the beginning or ending, or yields a quickly following or clinging drop at the completion of discharge. The film of liquid adherent to the inner surface of the body of a good pipette will drain without sign of rivulet effect and be retained by the capillary of the discharge tube for at least a minute.

Determinations can be made without the use of the pipette by introducing the precipitant in the form of a weighed amount of the standard solution or of finely powdered pure dry salt, after dilution of the silver solution to about 125 cc. The

¹ L. E. Salas, Bull. A. I. M. E., 63, 267.*

^{*}I am informed by the author that this method is used at the Royal Mint, London, for silver bul-containing tin.—Note by Editor. _on containing tin.-

silver value of the salt should be determined by carrying out the operations of the method on pure silver.

Combination Methods

Combination of the operations of the Gay-Lussac and Volhard methods have been devised to avoid the tediousness incident to the performance of the Gay-Lussac method by the unexperienced. By the modified methods the amount of sample to be weighed out is determined by preliminary assay, and is dissolved in the same manner as in the practice of the Gay-Lussac method, but with the added precaution to decompose nitrous acid in the silver solution by gentle boiling when completion of the titration is to be accomplished by the Volhard method.

The operation of the combination methods consists briefly of precipitation of all but a few milligrams of silver by a standard solution of alkali thiocyanate, chloride or bromide added from the Stas pipette and estimation of the excess of silver with a decimal solution of thiocyanate or by a colorimetric or nephelometric method.

The procedure favored by the writer is to use a standard solution of potassium bromide as the pipette precipitant. After the liquid is cleared by shaking, it is decanted as completely as possible into a 500-cc. Erlenmeyer flask. The precipitate is washed by five 30-cc. portions of water containing a little nitrous-free nitric acid, each portion being shaken before decanting. Using the same amount of ferric indicator as in the check assays, decimal thiocyanate solution is added until not a very deep tint remains permanent after vigorous agitation. Decinormal silver solution is then added until the tint is discharged. When the assay is sufficiently free of copper or other colored salts to permit accurate matching of tints, the decanted liquid, which may contain a raticles of silver bromide without interference, is titrated with decimal thiocyanate to the appearance of a tint which will match that of the check assays. Except when colored salts are present in such quantity as to make recognition of the point of bleaching of the ferric thiocyanate coloration uncertain, the extreme range of error is 0.3 part per 1000.

For colorimetric method, see Smith, I.M.M Bull. No. 28. Determination of the residual silver in the filtrate from the thoroughly washed silver bromide precipitate is practicable by use of a suitable nephelometric apparatus.¹

Denige's Cyanide Method:

Silver which has been precipitated as chloride may be determined volumetrically by dissolving the precipitate with a measured quantity of a standard solution of potassium cyanide of about decinormal strength.

$$AgCl+2KCN = KAg(CN)_2+KCl.$$

Potassium iodide is then added and the excess of standard potassium cyanide solution determined by addition of potassium iodide and titration to the first appearance of a permanent precipitate with decimormal silver nitrate.

$$AgNO3+KI = AgI+KNO_3$$
; $AgI+2KCN = KAg(CN)_2+KI$.

Notes. If the last portion of the precipitate of silver chloride dissolves with difficulty in the potassium cyanide, the liquid may be decanted into another beaker and solution completed with ammonia. The solutions are combined.

Richards and Wells, Am. Chem. J., 235, 1903; Richards, ibid., 510, 1906; Richards, Com. 8th Int. Cong. Ap. Chem., Sec. 1, 423.
 Clennell, "The Cyanide Handbook," 433.

Extreme sensitiveness is claimed for the method if centinormal solutions be used and the opalescence indicating the end-point be detected by a beam of light across the liquid.

Miscellaneous Volumetric Methods

Silver may be determined by addition from a burette of a portion of a known volume of its neutral or slightly acid solution to a standard solution of sodium chloride which contains a little potassium chromate or bichromate and sufficient chlorine-free magnesium oxide emulsion to neutralize free acid. The end-point is indicated by the formation of a reddish or brown precipitate.

By Pisani's Method 1 a standard solution of iodide of starch is added to a very dilute neutral solution of nitrate of silver until the fluid becomes permanently blue.

By Vogel's Modification of Pisani's Method,³ the silver solution, which may contain free acid, is titrated with standard starch iodide solution after addition of nitric acid containing nitrous acid.

By Andrews' Modification, the standard solution of starch iodide is added to a solution of silver nitrate which contains so much ferrous nitrate or sulphate that iron will be in excess of the silver present.

$$2AgNO_3+2Fe(NO_3)_2+I_3=2AgI+2Fe(NO_3)_3$$

By Gooch and Bosworth's Method,4 silver is determined by precipitating with an excess of potassium chromate, dissolving the precipitate in ammonia, reprecipitating by boiling to low volume and determining iodometrically either the chromate ion combined with the silver, or that remaining after precipitating the silver with a known amount of standard potassium chromate.

Nephelometric Method

This method is practicable for the determination of a small concentration of silver in a clear and colorless liquid. Less than 2 milligram; of silver can be estimated with considerable accuracy by matching the opalescence produced by a drop of hydrochloric acid with that from a known quantity in a liquid of the same volume, depth and temperature. Intensity of opalescence attains the maximum in about five minutes after precipitation. Standard silver solution is made by dissolving 500 millig ams standard silver (see Preparation at close of chapter) with several cc. of dilute nitric in a liter flask and making the solution up to the mark. For most technical determinations the apparatus may consist of clear glass cylinders (color tubes) of suitable size. More accuracy can be arrived at by use of a nephelometer of refined construction, for example the combination of a projection lantern and a Duboscq colorimeter.

Preparation of Pure Silver. The volumetric methods used for the determination of high percentages of silver, employ solutions which should be standardized by metal of the highest purity. For the preparation of this metal, the electrolytic method as described below is preferred by laboratories which are suitably equipped.

- ¹ Robière, Bull. Soc. Chim., 17, 306, 1915; J. S. C. I., Oct. 30, 1915, 1073.

 ² Fresenius, "Quantitative Analysis."

³ Zeit. für Anorg. Chem., 26, 175.

⁴ Am. J. Sci., 27, 302.

⁵ Am. Chem. Soc. Chem. Abs., Aug. 10, 1909, 1735. ⁶ Wells, Am. Chem. J., **35**, 99, 508; Richards, Am. Chem. J., **35**, 510; Dienert, Compt. rend., 159, 1117.

For the manufacture of a large quantity—several pounds—a basket-like support for the anode is made of several glass rods bent so that they will hang from the rim of

a tall 1000-cc. or larger beaker or battery jar and dip into the receptacle about an inch.

Smaller anodes may be supported by the positive wire or by a cloth bag fixed in place by a string under the flare of the rim of the beaker. In any arrangement for the support of the anode, allowance of room should be made for the introduction and free movement of an L-shaped stirring rod.

The cathode may consist of sheet silver or of platinum foil, and lies flat on the bottom of the beaker. The immersed length of the silver or platinum wire leading from

the cathode should be covered with rubber tubing.

Commercial silver, usually about 999 fine, may be used for the anode, but by retreatment of the deposit, very impure silver may be used, providing that the quantity of tellurium present is very low. The presence of tellurium will exhibit itself in the

impossibility of obtaining the desired coarsely crystalline deposit.

Tellurium in moderate quantities may be removed by melting the silver in a crucible or scorifier, adding niter, permitting the silver to nearly freeze, raising the temperature and pouring into a hot crucible or scorifier in which the operation is repeated, preferably in a muffle furnace, until the surface of the silver is without streaks or spots when cooled to near freezing. An oxidizing atmosphere about the molten metal should be maintained. On the basis of 172 grams silver per cubic inch an anode mould for any convenient amount of silver may be shaped from 4-in. pieces of 1-in. square rod on a smooth Just before the anode bar sets in the mould, a silver terminal strip or wire iron plate. is plunged into it.

After coating the contact wire or strip and the surface of the anode about it with sealing wax, the anode is wrapped with filter paper, held firmly in place by string or rubber bands. If the anode weighs half a pound or more, the anode is also wrapped with cotton flannel which has been washed with water until free of chloride. A porous

dish, cylinder or filter cone can be used instead of filter paper and cloth.

The electrolyte contains about 4% of C.P. silver nitrate and half a per cent of chlorine-free nitric acid in distilled water, and fills the beaker or jar so it wets only the lower surface of the anode.

The current, of about 0.1 ampere per square inch of cathode surface at the start, is raised after deposition has proceeded for a few minutes to the limit at which a coarsely

crystalline deposit can be maintained.

Inasmuch as the electrolysis proceeds at a rate of 4 grams per ampere hour, some attention is required to break up short circuits and to pack down the rather bulky deposit. The deposit, if coarse, can be washed very-easily free of electrolyte, and after

heating to near redness is in the form preferred for use by many assayers.

Other methods which may be employed consist of dissolving the crude silver with nitric acid about 1.20 sp.gr. or with hot concentrated sulphuric acid, if platinum is present, separating the gold and platinum by filtration, precipitating AgCl with not too large an excess of HCl, stirring the precipitate until it coagulates, washing repeatedly with hot water until a washing is obtained which shows no precipitate with H₂S, reducing the silver chloride by contact with pure zinc, wrought iron or the silver terminal of a carbon-silver couple aluminum foil, and washing with hot dilute HCl until a test of the decanted liquid indicates absence of the precipitating element. The dried silver, mixed with about 1% of dry sodium carbonate, is packed into a clay crucible, the inside of which has been glazed with borax glass and covered with a layer of crushed charcoal.

The sodium carbonate is omitted in case it is desired to melt silver refined by

electrolysis.

The silver melted in the tightly covered crucible is poured into an iron mould which

has been chalked or black leaded.

By Knorr's method, a solution of silver nitrate from which excess of nitric acid has been removed by evaporation is freed of metallic impurities by adding enough sodium carbonate to precipitate one-tenth of the silver, boiling and filtering. The silver in the carbonate to precipitate one-tenth of the silver, boiling and filtering. filtrate is precipitated by sodium carbonate and the precipitate decomposed without addition of reducing reagent, by melting in a crucible. Excess sodium carbonate carried down with the precipitate of silver carbonate will cover the fusion and such as adheres tightly to the metal is readily removed by hydrochloric acid. The metal should be smelted under charcoal.

If the cover of the charcoal is omitted or burned away during the fusion, the molten metal is capable of absorbing oxygen from the atmosphere to the extent of about 0.25% of its weight. This gas is expelled during the passage of the metal into the solid state and produces a casting which cannot be rolled into smooth sheets

The most convenient size and shape of castings for rolling is but little larger than a

lead pencil. Before rolling, the casting is cleaned of particles of the mould wash After rolling to about cardboard thickness, the sheets may be cut up into strips of convenient size and length, then digested with dilute hydrochloric acid (1 to 5 of water) washed with ammonia and finally with pure water.

The silver then should be dried and annealed by heating to redness. It is best preserved in a glass-stoppered, salt-mouth bottle and should be exposed to laboratory

atmosphere as little as possible.

The purity of each batch of silver made should be compared by use of the Gay-Lussac method with standard silver, the purity of which has been determined by analysis of a 50- or 100-gm. portion for Se and Te, As, Sb, Pb, Cu, Au, and the element employed in reducing silver chloride, if the reduction method was followed in the manufacture of the metal.

FURNACE METHODS OF ASSAYING FOR GOLD AND SILVER

WALLACE G. DERBY 1

THE SAMPLE

The unit of weight in assaying all classes of material except gold and silver bullion is the assay ton, 29166.7 milligrams; the same number of milligrams as there are ounces Troy in the short ton of 2000 avoirdupois pounds. Each milligram therefore represents an ounce per ton. The English or long ton of 2,240 lbs. contains 32,666.7 ounces Troy, so 32.667 grams constitutes the English A.T. Whichever unit is used, results are calculated to and reported in terms of parts per thousand. Synonymous with parts per thousand are the terms "fine." "fineness."

The sample received by the assayer should not only be representative of the material undergoing valuation or investigation, but should be in such a state that the operator can, without extraordinary manipulation or precaution, weigh out portions which are exactly like the sample. As a general rule no sample of pulverized material should have a fineness of less than 80 mesh. With increase of value or decrease of proportion of the constituent of the material which carries the values, the fineness should be increased to 100, 120 or even 200 mesh, unless the attempt to obtain such homogeneity is accompanied by introduction of so much matter worn from the grinding mill or plate, or by change of weight due to oxidation of some constituent, as to decrease rather than increase the representative character of the assay portions. The sample of material which is composed of particles very unlike in value and so dissimilar in such physical properties as size. weight, magnetism, hardness, etc., which make separation practicable, should be presented to the assayer in fractions representative of the components. A convenient rule (an algebraical contraction of the arithmetical operation), for calculating the assay of the whole from the assays of the components which for convenience will be called coarse and fine, may be stated as follows: Multiply the difference of the assays of the coarse and fine by the decimal fraction representing the percentage of fine in the material and, if the assay of the fine is greater than that of the coarse, add the product to the assay of the coarse; but if the assay of the fine is less than that of the coarse, subtract the product from the assay of the coarse. To a known weight of some sorts of material, during the process of sampling, reagents are added to neutralize and dry acid substances or water is added to prevent dusting of light and fine substances. To calculate the assay to original basis; multiply by 1 plus the decimal fraction representing the per cent increase of weight. Occasionally organic matter is removed by combustion, barren matter by magnetism or other methods, and very commonly moisture by drying. To calculate to original basis; multiply the assay by 1 minus the decimal representing

¹ Research Chemist, Nichols Copper Company, New York.

the per cent decrease in weight of the sample. Samples of material which have the property of changing weight with atmospheric conditions, should be kept in tightly stoppered bottles. The assay of such material is best made on the portion of the sample used in the determination of moisture. The distribution of values in solid copper or lead bullion is never uniform. Unhomogeneity tends to increase with quantity of impurity and with decrease in the rate of cooling from the molten state. The sample of copper bullion should be composed of drill shavings from every part of the piece which is practicable to attack with a ½ or ½-in. twist drill in such a manner that the particles from each part shall have the same proportionate weight in the sample as the part is of the whole piece. This principle is applied to the sampling of the multiplicity of pieces composing a lot of copper. In lot sampling a single hole is drilled through the top or bottom of each piece of a definite fraction of the total pieces in a lot. The position of the drill is changed with successive pieces so that it will attack in turn the center of all the equal-sized squares composing a pattern or "templet" which will exactly cover one-quarter, one-half or the whole of the top of the average piece. The squares should be as small as is practicable to drill, about 1 in. It is considered the best practice to drill one-half of the holes in blister copper top to bottom, the remainder bottom to top, also when drilling according to a quarter or half templet, to change hand side with every other round of the templet. All the shavings are ground to pass a 20-mesh screen by a drug mill with hard steel grinding plates. The sample of lead bullion, like that of copper, should be composed of the due proportion of particles from every part of the single piece. The end is attained by using for sample the sawdust from complete cuts with a circular saw at equal and definite intervals along the length of the piece. In lot sampling a single cut is made in a definite fraction of the total number of pieces in the lot. The position of the cut is changed with successive pieces, so that it will pass through the longer axis of each of the equalsized rectangles composing the pattern or templet which will exactly cover onehalf or the whole of the top of the average piece of the lot. To make accurate sampling possible, it is evident that the pieces composing a lot of either copper or lead bullion should be symmetrical in form and alike in size, shape and grade. At regular intervals during the process of pouring lead bullion into moulds, samples may be taken in the form of shot, but most satisfactorily in the form of slugs or bullets, each weighing close to the amount customarily taken for assay (1 or 1 A.T.) and composed of the entire contents of the ladle used for dipping. All classes of gold or silver bullion and Doré metal are most accurately sampled by taking just after thorough stirring and immediately before pouring several dip samples of about 3 grams each with graphite ladles. The metal is allowed to cool in the ladle or may be granulated by pouring into warm water. When the lot of bullion is large, samples are taken at definite and regular intervals throughout the ladling period. Except in the case of bullion of a high degree of fineness, sampling by drilling or by cutting chips from the corners of bars is not as satisfactory as the methods described.

References on Sampling

Ore-Sampling Conditions in the West. T. R. Woodbridge. Technical Paper 86, Bureau of Mines.

The Principles and Practice of Sampling Metallic Metallurgical Materials. Edward Kellar. Bulletin 122, Bureau of Mines.

Assay and Valuation of Gold Bullion. F. P. Dewey. Trans. Am. Inst. Min. Eng., 1909, 40, 780-797.

FURNACE OPERATIONS

The several furnace operations employed in assaying have for their object:
(1) To eliminate in part or entirely from the material undergoing assay, organic matter and such elements as sulphur, arsenic, antimony or sclenium when present in sufficient quantity to cause excessive reducing effect in the crucible fusion, interference with decomposition, mechanical or other loss by either method of fusion. When the operation does not cause greater loss of values than its avoidance by skillful fluxing,

elimination by combustion or roasting is practiced.

(2) To produce such conditions that the greatest quantity of gold or silver in the material subjected to assay can through their affinity be concentrated in molten lead.

This is brought about by two methods...

a. By the crucible method, the material is mixed with no larger quantity of reagents called fluxes than will form, with all its basic or acid constituents at a moderate temperature, compounds of the greatest degree of fluidity. Simultaneously with the progress of the fusion, lead, generated from lead oxide by an added reducing agent or by the property of the material itself, percolating the fluid, collects the precious metals and also some portion of such other constituents which combine or alloy with lead under

the conditions of the fusion.

b. By the scorification method, the material, in contact with a relatively large mass of lead in shallow dishes called scorifiers, is decomposed and fluxed chiefly by lead oxide, the greater part of which is formed by the action of atmosphere on the molten lead. When the proportion of volume of material or flux is not too great, the fluid slag collects about the sides of the scorifier leaving the surface of the lead exposed to oxidation, which may be allowed to progress until the increasing proportion of slag covers the lead. The precious metals and a portion of other allowable metals in the charge are collected by contact with the molten lead. During scorification, elements forming readily volatile oxides such as sulphur, arsenic, and selenium are in process of elimination in the form of vapor, while the elements—iron, manganese, antimony, zinc, cobalt, tin, nickel, cadmium, copper, bismuth, selenium and tellurium—when taken up in one form or another by lead during the fusion period of the operation, are carried into the slag at rates which depend in part upon the property to oxidize characteristic of the element, in part upon the concentration of the element in the lead, and in part on the properties of the associated elements.

(3) To procure with the least loss of gold and silver their alloy with lead in the

form of a lead button which can be cleaned of adherent slag and is of suitable size (10 to 20 grams) and sufficiently free of base elements to make possible by the operation of cupellation, the production without greater loss than if the base elements were absent, of a silver-gold bead of normal purity. Size of button is controlled in scorification by observation, in crucible fusion by incorporation in the charge of the proper amount (which is determined by trial or experience with similar material), of oxidizing reagents when the material has an excessive reducing property; of reducing reagent when the material has an oxidizing, neutral or deficient reducing property. Purity of button is obtained by the scorification method by repetition of the operation, with addition each time of lead until the shade of color of the glazed portion of the scorifier

Sampling Gold Bullion. F. P. Dewey. Trans. Am. Inst. Min. Eng., 1912, 44, 853-879. Determination of Silver and Base Metals in Precious Metal Bullion. F. P. Dewey. J. Ind. Eng. Chem., 1914, 6, 650-658, 728-736.

Copper Bu!lion:

Wraith, Trans. Am. Inst. Ming. Eng., Bull. 39, 209. Keller, Eng. and Min. J., April 6, 1912. Smoot, Eng. and Min. J., June 22, 1912. Liddell, Eng. and Min. J., Nov. 12, 1910; Dec. 16, 1911.

Lead Bullion:

Roberts, Trans. Am. Inst. Min. Eng., 28, 413.

Gold or Silver Bullion:

Rose, "Metallurgy of Gold."

or appearance or properties of the lead button indicate to the experienced operator the presence of impurity in less quantity than will prevent faultless cupellation. By each method the amount of metallic impurity in the button can be diminished by increasing the proportion of litharge in the charge. With increase of quantity of base element its restraint from the button becomes impracticable by the crucible method; purification of the button by process of scorification is therefore resorted to in all cases except when bismuth or copper associated with selenium or tellurium are present. These elements are best eliminated by a wet method.

(4) To separate from lead which may contain a small amount of other metals an alloy of the precious metals in weighable form and in a definite state of purity, 996-998

Separation by cupellation is effected by taking advantage of the non-susceptibility of gold or silver to oxidation, the heat of formation of lead and other metallic oxides, the fluid character of lead oxide at the temperature of its formation, the solubility of a limited amount of metallic oxides, and the sparing solubility of gold and silver in fluid lead oxide, the perviousness to fluid lead oxide of bone ash of about the same temperature and the imperviousness of the same material to molten gold, silver or lead.

Consequent to the furnace operations, except when it is known that gold is absent, is the wet process of separating in weighable form and in a very definite state of purity

(997 to 998 fine) gold from silver in the bead obtained by cupellation.

The process of parting depends upon the fact that when the proportion of gold in the alloy is not too great, silver can be dissolved almost completely by hot dilute nitric acid with but small corrosive effect upon the gold.

Preliminary to furnace operations, it is advantageous in the assay of some classes of material to subject the sample to treatment by nitric or sulphuric acid with the object of eliminating all or a greater part of the base elements and of concentrating the precious metals into a mass of small volume. The procedure is practicable when the character of the material is such that the residue resulting from the treatment does not interfere with filtration and when gold is not dissolved or liberated in so fine a state that it cannot be retained by a filter. Dissolved silver is precipitated as chloride, bromide, sulphide or metal. Procedures which introduce the feature of preliminary acid treatment are called combination methods.

Silver and gold are retained in the slag from both the crucible and scorification method of fusion. When the product of assay of slag is added to the result of the primary operation, the assay is said to be carried out with slag correction.

Silver and gold are carried into the cupel to a greater extent per unit of lead oxidized than into slag by scorification of lead containing the same concentration of precious elements. When the silver or gold so retained is determined, either by subjecting the cupel to assay processes or by check cupellation of a known and similar quantity of the precious metals under the same conditions, and the result obtained added to the product of the primary operation, the assay is said to be carried out with correction for cupellation loss.

Corrected assay is the term applied to the result which includes a correction for silver and gold lost into the slag and cupel. It is not customary to take account of the fineness of the silver or gold mass, or of gold dissolved in the operation of parting.

Determination of gold, even when silver is known to be absent, is much more accurately made by weighing the product of the operation of parting its alloy with a suitable proportion of silver than the gold bead resulting from cupellation. Loss of gold in cupellation tends to decrease with increase of the ratio of silver present.


The precautions taken in furnace operations to prevent abnormal silver loss should

be observed as a rule in the assay for gold only.

Determination of silver is performed by weighing the bead resulting from cupellation and subtracting from this weight the amount of gold obtained from the operation

parting.

Influence of quantity of sample taken for a single determination can be derived relatively from Chart Fig. 138, which shows that the per cent of loss in the operation of assaying blister copper by the sulphuric acid combination method decreases as the proportion of precious metals in the charge increases. Cupellation has a larger influence ordinarily in this direction than the operation of fusion. The fact is of consequence in the assay of material for purchase and sale, for it is evident that unless the valuation be made on the basis of corrected assay, or a complete understanding by all parties interested exists as to the details of the methods of assaying employed, controversy may arise because of the consistently higher value which will be put on the material by the assayer who uses the larger assay portion in his practice. For instance, in the valuation of blister copper containing 50 ozs. silver per ton, should assayer A representing one party be in the habit of using 2 A.T. assay portions, his

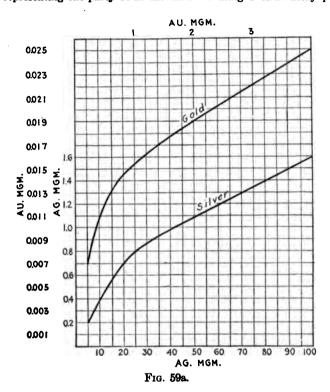

valuation of the lot will be on the basis of $\frac{98.4}{2}$ or 49.2 ozs. per ton, while B, who uses the same method as A but customarily carries out his operations on 1 A.T. portions, will report 48.82 ozs. per ton, or a result about 0.8% lower than A.

ROASTING INCINERATION

In laboratories performing many assays by combination methods, incineration of filters is accomplished by placing the scorifiers on trays which fit the shelves of an oven like that of a gas stove. The furnace muffle is, however, commonly employed for the purpose. Loss of particles of the charge is prevented by covering the folded paper with granulated or sheet lead and burning slowly at a low temperature. Sprinkling the inside of filters with litharge hastens combustion. Carbonaceous matter in material like reverberatory or blast-furnace flue-dust is removed by combustion in a muffle. The same matter in zinc retort residue cannot be removed by incineration without considerable loss of silver. Roasting of pyritic material is carried out on the portions weighed out for assay in scorifiers if the sulphur has little other metallic base than iron; in large roast-

ing dishes when the sulphide is that of copper, lead, antimony or zinc. In the latter case, unless there is considerable earthy base or silica in the sample, stirring is required to prevent sintering, which obstructs complete oxidation. In both cases, at the beginning, the temperature should be no higher than is sufficient to start and maintain oxidation. When evolution of sulphur dioxide has practically ceased, the temperature may be raised to about 700° C. to decompose the sulphates which have formed at lower temperature. Decomposition of refractory sulphates—lead, zinc, silver, nickel, may be achieved by mixing the roast with onethird of its weight of ammonium carbonate and heating at about 400° C. and antimony oxidize in part to volatile trioxides, but a portion, large if the temperature is high or draft strong, becomes changed to higher oxides which form with metallic bases salts stable at higher temperatures. These salts tend to increase the slag loss of silver in the fusion stage of the assay. By mixture with an equal volume of powdered charcoal and roasting again at 550° to 600° C. in a muffle with reduced draft, the quantity of arsenic or antimony is diminished. Several repetitions of the reducing and oxidizing process may be required to bring



Fig. 59b.

about complete elimination of the objectionable elements except in the case of copper arsenate, on which charcoal has little reducing action.

Because roasting takes up muffle space, requires considerable attention in the case of ores containing much other base for sulphur than iron, and is usually attended by some loss, especially of silver, its practice is limited to the assay of pyrites or pyrrhotite ores which contain very low gold and silver values.

CRUCIBLE METHOD OF FUSION

This operation may be performed in a wind or crucible furnace, but best in a muffle. If the furnace is to be used for crucible fusion alone, the muffle need have a single draft hole only in the top. Although the operation is less subject to irregularities when carried out in a muffle tight to the products of combustion, satisfactory fusions are made in gas or liquid fuel furnaces from which the muffles have been removed. The most convenient shape and size of crucible to muffle fusions are the 5, 10, 20 or 30 grams, Colorado form. The 10 and sometimes the 5-gram crucible is used for fusion of filter paper residues from combination methods. The 20-gram is used for ½ A.T., the 30-gram crucible for 1 A.T. ore portions. The cinder from roasted fine pyrite mixed with water makes a good paint for marking crucibles or scorifiers.

Litharge melting at 888° C., is a basic flux, an oxidizing and therefore desulphurizing agent. It is the source of metallic lead for collecting the precious metals. borax it forms a very fluid glass. Its functions are expressed by the following reactions:

 $2PbO + SiO_2 = 2PbO \cdot SiO_2$

 $PbO + Na_2CO_2 + SO_2 = Na_2SO_4 + Pb + CO_2$

 $ZnS+3PbO=ZnO+3Pb+SO_2$

 $Ag_2S + 2PbO = 2PbAg + SO_2$

 $PbS+2PbO=3Pb+SO_2$

 $C+2PbO=2Pb+CO_2$

 $Sb_2S_3 + 9PbO = 9Pb + Sb_2O_3 + 3SO_2$

 $Sb_2S_2 + 6PbO = Pb_6Sb_2 + 3SO_2$

 $2Cu_2S + 7PbO = 2CuO + Cu_2O + 7Pb + 2SO_2$

 $Sb_2+3PbO=Sb_2O_2+3Pb$

Lead oxide dissolves metallic oxides. of this property.

The following table 1 shows the extent

Per one part of	Cu ₂ O 1.5	CuO 1.8	-ZnO	Fe ₃ O ₄	Fe ₂ O ₃	MnO.	SnO ₂ 13
Per one part of	SbO ₂ 5	As ₂ O ₃ 0.8	As ₂ O ₅				

Sb₂O₃ is very soluble in litharge.

Five hundred grams of lead oxide should contain no gold, less than 0.0005 gram silver, and no bismuth. According to the amount of litharge used, such silver as it contains should be deducted from the weight of the bead in the assay of material in which the normal range of assay error is measured in hundredths rather than tenths of

An ounce.

Floated silica, analyzing over 95% SiO₂, and so fine that 90% will pass a 200-mesh screen is an excellent and easily obtainable form of the reagent. Silica in the form of powdered glass, averaging 70% to 75% SiO₂, is an acid flux. Its addition to a basic charge should be limited to the formation of a slag which is less than a bisilicate.

Borax glass. Na₂O·2B₂O₂, melting at 878° C., may be considered an acid or basic flux. As an acid flux, it combines with the metallic oxides to form a very fluid slag. As a basic flux it may be employed in the assay of acid ores, with a value nearly equal in weight to that of litharge.

Sodulm carbonate applydrous melting at 840° C. sodium bisabanda acid in the state of the state of

Soduim carbonate, anhydrous, melting at 849° C., sodium bicarbonate which commences to decompose at 270° C., and potassium carbonate, anhydrous, melting at 909° C. are basic fluxes. Sodium bicarbonate in its decomposition and reaction with silica liberates three times as much gas per unit of base as the normal carbonate.

¹ Hofman, "Metallurgy of Lead."

. By some assayers this property is considered a virtue on account of the stirring-up action on the charge. In the use of bicarbonate the danger of spoiled assays due to boiling over and mechanical loss through dusting is great. Potassium carbonate in the form of refined pearl ash, is of value on account of the fluidity of the potash silicates. It is deliquescent and when dried and in form for use as a flux must be kept out of contact with moist atmosphere. Sodium carbonate is used in the form of refined soda ash. A mixture of equal weights of soda and pearl ash is a good form of flux. Besides its function as a base for silica in the charge, the alkali flux operates to increase the amount of lead reduced from lead oxide by a sulphide.

$$4Na_2CO_3+15PbO+2FeS_2=Fe_2O_3+4CO_2+15Pb+4Na_2SO_4$$

By the addition of 3.1 parts of Na_2CO_3 , 23 parts of lead are reduced by 1 part of sulphur. In the absence of the alkali, the reaction would be $FeS_2+5PbO=FeO+2SO_2+5Pb$, according to which only 16 parts of lead are reduced by 1 part of sulphur. The reaction of the alkali flux with lead sulphide is like the following:

$$7PbS+4Na_2CO_3=4Pb+Na_2SO_4+3(PbS\cdot Na_2S)+4CO_2$$
.

Reducing Agents. In case the charge is not of a reducing nature, one of the reagents in the table is added in quantity which experience with the same type of material, knowledge of its composition or preliminary trial indicates is sufficient to reduce a suitable amount of lead to collect the precious metals.

The following table shows the approximate reducing power of the reagents in com-

mon use:

Grams lead reduced	by 1 gram of reagent.
22 -30	Charcoal
6 –11	Argol (crude tartar)
4.5-6.5	Cream of tartar
10 -15	Wheat flour
11.5-14.5	Sugar
22 -25	Coal or coke
11 . 5-13	Corn or laundry starch
11 -12	Pyrite (FeS ₂)

To assist distribution or contact with the largest number of particles of litharge it is of advantage to use an agent which is in a very fine state of division and of low reducing power per unit of volume. Argol is a popular reagent. The writer uses starch. A carbonaceous reducing agent reacts with silicate of lead with a sluggishness which increases with the silicate degree above the monosilicate, but the presence of other bases, especially the alkaline, operates to make the reaction more complete.

$$2PbO \cdot SiO_2 + 2Na_2O + C = 2Na_2O \cdot SiO_2 + CO_2 + 2Pb$$
.

Iron in the form of twenty-penny nails or \(\frac{1}{4}\)-in. iron wire can be used as a reducing agent and desulphurizing agent in the assay of material which contains little or no base impurities, such as copper, tin, antimony. Its functions are expressed by the following reactions:

$$Fe+PbS=FeS+Pb$$

$$Fe+FeS_2=2FeS$$

$$PbO+Fe=FeO+Pb$$

$$2PbO\cdot SiO_2+2Fe=2FeO\cdot SiO_2+2Pb$$

$$PbS\cdot Na_2S+Fe=FeS+Na_2S+Pb$$

Potassium nitrate, saltpeter, melting when pure at 337° C., or sodium nitrate, nitre, melting when pure at 316° C., are oxidizing and therefore desulphurizing agents. Sodium nitrate is deliquescent. Either salt should be dried, very finely pulverized and kept in a stoppered bottle.

The nitrates decompose on heating,

 $2KNO_2 = 2KNO_2 + O_2;$

and at a higher temperature,

$$2KNO_2 = K_2O + 2NO + O.$$

Their behavior in fusions is illustrated by the following reactions:

$$4\text{FeS}_2 + 10\text{KNO}_3 = 4\text{FeO} + 5\text{K}_2\text{SO}_4 + 3\text{SO}_2 + 5\text{N}_2;$$

 $4\text{ZnS} + 6\text{KNO}_3 = 4\text{ZnO} + 3\text{K}_2\text{SO}_4 + \text{SO}_2 + 3\text{N}_2.$

When an alkaline base is present the reaction is

$$2\text{FeS}_2 + 6\text{KNO}_3 + \text{Na}_2\text{CO}_3 = \text{Fe}_2\text{O}_3 + 3\text{K}_2\text{SO}_4 + \text{Na}_2\text{SO}_4 + \text{CO}_2 + 3\text{N}_3$$
.

Nitrates act on metallic lead

$$7Pb + 6KNO_3 = 7PbO + 3K_2O + 3N_2 + 4O_2$$

Salt, melting at 804° C., is used in a thin layer as a cover over the top of the charge in the crucible. It is very fluid when melted and having a low gravity, floats on the fusion. Its function is to prevent the charge from boiling over or spattering. When moist it decrepitates and on that account may cause loss of particles of the charge. It should be dried before use.

Fluxing. All substances from which precious metals are to be effectively collected by crucible fusion must necessarily be in a fine state of division, and mainly composed of compounds which may be classified as acid or basic. Acid is the characteristic applied to material which contains silica, free or combined with too little base to form a readily fusible substance. Basic is the term applied to metallic or earthy oxides, or compounds which may be brought to the state of oxide in the process of fusion. In this form they are capable of forming salts with silica. These salts are defined by the ratio to each other of oxygen in the acid and base. By the metallurgical classification their names are as follows:

Formula.	Name.	Oxygen Ratio Base to Acid.	Example.
4RO·SiO ₂ . 2RO·SiO ₂ . RO·SiO ₂ . 4RO·3SiO ₂ . 2RO·3SiO ₂ .	Monosilicate Bisilicate Sesquisilicate	2 to 1 1 to 1 1 to 2 2 to 3 1 to 3	4PbO·SiO ₂ 2Al ₂ O ₃ ·3SiO ₂ CaO·SiO ₂ 4MgO·3SiO ₂ 2PbO·3SiO ₂

The silicates of Na₂O, K₂O and PbO are readily, MnO, FeO, and Cu₂O, less; and MgO, CaO, and Al₂O₂ difficultly fusible. To make the refractory silicates fusible and fluid at moderate temperatures, the proportion of their bases should be less in the fusion than the bases of the readily fusible silicates. Advantage is also taken of the fact that the multibasic silicates are more fusible generally than the single of the same degree.

A rule governing the fluxing of a crucible charge is very definitely stated by Fulton,¹ "The most desirable constitution for an assay slag, in general, is that of a monosilicate or sesquisilicate, sometimes, but more rarely, a bisilicate. If the ore is basic, a bisilicate slag may be approached, if acid, a monosilicate or even a subsilicate."

^{1 &}quot;Fire Assaying," 2d ed., 69.

Per unit of base, silica required Per unit of silica, base required	Na ₂ O 0.486 2.06	K ₂ O 0.320 3.12	PbO 0.135 7.40	MnO 0.425 2.35	FeO 0.419 2.37
	Al ₂ O ₃	CuO	ZnO	CaO	MgO
Per unit of base, silica required Per unit of silica, base required	0.886 1.13	0.379 2.64	0.371 2.70	0.359 2.64	0.748 1.34

TO FORM A MONOSILICATE THE REQUIREMENT

A crucible fusion should not be fluxed by borax or litharge alone. No more borax should be used than is required to combine with bases and silica in the proportion illustrated by the equations:

$$2(Na_2O, 2B_2O_3) + SiO_2 = 2Na_2O \cdot SiO_2 + 4B_2O_3,$$

 $B_2O_3 + 3FeO = 3FeO \cdot B_2O_3.$

As a flux for silica, 6.7 parts borax will take the place and can be substituted for 7.4 parts litharge, 3.5 parts Na₂CO₂, 5.4 parts NaHCO₂ or 4.6 parts K₂CO₃. As a flux for bases, assumption of 3RO, B₂O₃ works out well in practice.

	FeO	CaO	MgO	ZnO	. БРО
Required of borax per unit of base	0.937	1.20	1.67	0.807	0.302

"In the fusion of a mixture containing silica, various bases and borax glass, that silicate borate having the lowest formation point will form and then as the temperature rises, absorbs either silica, base or both, as these are in excess of the ratio required to form the lowest formation point compound. If the temperature does not rise high enough to cause this absorption, the excess of silica or base or both will remain in suspension in the formed silicate borate, practically in an unaltered condition." ¹

Materials intended for crucible assay are characterized according to their behavior toward lead or lead oxide as oxidizing, reducing or neutral. The oxidizing constituents of an ore are practically limited to Fe₂O₄, Fe₃O₄, MnO₂ and CuO. Substances containing unoxidized sulphur, antimony, arsenic or carbon, on fusion with litharge produce metallic lead. When an arsenide is present with iron, nickel or cobalt a brittle fusible substance called speiss will be found in the crucible above the lead. Also when iron is present and the quantity of litharge has not been sufficient to oxidize all the sulphur, a sulphide compound of iron and lead called matte will be found above the layer of speiss. When the silver content of the ore is small, the ore can be roasted in the manner already described. The roasted ore then as a rule becomes oxidizing in its behavior. To obtain a lead button of suitable size, knowledge of the oxidizing power

² Fulton, "Fire Assaying," 2d ed., 64.

of the ore is obtained from experience or by trial assay. Having once determined the reducing power of the reducing reagent, for instance starch, by fusion of its intimate mixture with the charge without the ore, \frac{1}{2} A.T. of the ore is roasted and then fused with 50 grams litharge, 2 grams starch, accurately weighed out, 10 grams soda ash and 8 grams silica. A thin layer of borax or salt covers the charge in the crucible. If the reducing power of the 2 grams of starch is known to be 22 grams and only 15 grams of lead are produced by fusion of the ore, the oxidizing

power of the ore is equivalent to $\frac{2(22-15)}{22} = 0.636$ gram starch per half A.T.

2.636 grams of starch therefore should be used to obtain a 22-gram button.

Since roasting causes inappreciable loss as a rule only in the case of material of low silver value, oxidation by addition of nitre to the fusion is the more generally practiced. Theoretically the oxidizing value of 1 gram of KNO₃ is 2.39 grams of lead according to the reaction

$$7Pb + 6KNO_{1} = 7PbO + 3K_{2}O + 6N + 8O.$$

The reducing power of $\frac{1}{10}$ A.T. of the ore is determined by trial fusion with 60 grams of litharge, 5 grams silica, 7 grams Na₂CO₃ and borax cover. Assume the product is a button weighing 16 grams. A fusion may then be made with the same charge but with 1 gram of nitre added. Assuming the product of the nitre fusion to be 12 grams, then the oxidizing power per gram of nitre is 16-12 or 4 grams under the conditions of the fusion. If the assay is to be made on a A.T. portion and a 25-gram button is desired, then $(16 \times 5) - 25 = 55$, and ½ = 13.75 grams nitre to be added. When sulphur is oxidized by nitre, care should be taken that sufficient Na₂CO₂ is in the charge to carry out the reaction:

$$6KNO_3 + Na_2CO_3 + 2FeS_2 = Fe_2O_3 + 3K_2SO_4 + Na_2SO_4 + 6N + CO_2$$

Theoretically the quantity of Na₂CO₃ required is 0.84 of the sulphur present or 0.175 of the nitre used.

The oxidizing power per gram of nitre, when sufficient Na₂CO₃ is present, ranges from the equivalent of 4.7 to 5.6 grams lead in a litharge soda charge and 4.0 to 4.2 grams in a charge containing so much silica that little of the alkaline base is left to form a sulphate.

In practice, the requirement of quick results does not always permit of trial assays for determination of oxidizing or reducing power. Estimation of the reducing value of sulphide ores can be made by experience gained by observation of the proportion of heavier sulphide to gangue on vanning a definite weight of a sample in a shovel or porcelain spot plate.

Instead of weighing out each of the fluxes at the time of dressing a crucible, it is the practice to make up for each type of ore a stock mixture of all or part of the reagents adapted to its assay, and to measure out the flux with a graduate.

Oxidizing and reducing reagents, when not incorporated in a stock flux, are weighed out carefully.

The following are examples, the first from Fulton 1 "Reducing flux designed to give a 22-gram button with a neutral charge:

^{1 &}quot;Fire Assaying," 150; Hawley, Eng. and Min. Jo., 89, 1122; 90, 647.

									Gram	s per	A.T.
PbO,	15	part	в	 	 	 	 	 		. 60	
Na ₂ CO ₃ ,	4	"		 	 	 	 	 		. 16	
Borax,	2	"		 	 	 	 	 		. 8	
Flour,											75

"A scoopful of flux weighing 84 grams is used per ½ A.T.

[&]quot;Non-reducing flux to be used in connection with nitre for sulphide ores which will give a button larger than 22 grams.

			Grams p	er 🕯 A.T.
PbO,	15	parts	6	0
		- 46		
		"		
		• • • • • • • • • • • • • • • • • • • •		
Nitre			A	s required

"When sulphide ores are assayed which do not contain sufficient sulphides for a 22-gram button, the reducing and non-reducing fluxes are mixed in such proportion as to obtain the desired result. Ore 3.64 grams; non-reducing flux 50 grams. This is run in a 10-gram crucible. This charge will give a lead button weighing as much as the nitre necessary to oxidize all the sulphides in a 0.5 A.T. portion of the ore. Place the lead button obtained in one scale pan of the pulp scale and from the hook above the other suspend by fine wire a weight so that the wire amounts to 6 grams. Then add nitre to the pan having the 6-gram weight until the scale is in balance. The amount of nitre is the proper quantity necessary to reduce a 22-gram button with the ore and the non-reducing flux is 0.5 A.T. be taken for assay."

The following stock fluxes are used by a well-known New York firm of assayers. No. 1 flux for free acid ores without much sulphides or reducing agents.

	Lbs.	%	Grams per A.T.
Soda ash Pearl ash. Silica Borax glass Litharge. Argol	21 21 4	22.8 8.8 8.8 14.0 44.0	31.9 12.3 12.3 19.6 61.6 2.4

Use 140 grams per A.T. of pulp. Argol may be increased as the individual charge requires.

No. 2 flux for basic ores without much sulphate or other reducing agents.

	Lbs.	%	Grams per A.T.
Soda ash Pearl ash. Silica Borax glass Litharge. Argol	21 41 4 121	17.2 18.6 15.5 13.8 43.1 1.0	24.1 12.0 21.7 19.3 60.3 2.4

Use 140 grams per A.T. of material. Argol may be increased in the individual charge.

No.	3 flux fo	r heavy	copper si	ılphides	containing	but	little	silicious	matter.
110.	U Hun IU	1 1104 7 7	COPPOL DO	PHILACO	COTTOCCUTATION	~ ~ ~	110010	Dilloud	IIII COUCE.

	Lbs.	%	Per j.A.T.
LithargeSoda ashSilica	3½	84.2 7.4 8.4.	252.6 22.2 25.2

Use 200 to 300 grams flux per ½ A.T. of pulp, less for lighter, more for heavier sulphides. Reduce the very large lead button weighing 90 to 100 gms. by scorification. Varying mixtures of No. 1 and No. 3 are employed for sulphides ores carrying considerable silica. High grade litharge free of bismuth is essential. Soda ash is the ordinary high test commercial variety. All ingredients should be finely powdered and thoroughly mixed by repeatedly passing the flux through a coarse screen or by turning a mixing cylinder.

The iron nail is a convenient method of assaying low-grade sulphide ores which do not contain much copper or other impurity alloyable with lead, because neither experience nor a preliminary assay is required to secure a button of definite weight. On account of their solubility in sodium sulphide, a product of the fusion, gold and especially silver is retained in the slag from high-grade ores to a greater extent than when nitre is suitably used as the desulphurizing agent.

Since one of the functions of iron, as expressed by the reactions on page 458, is to precipitate lead, the litharge added to the charge is limited to the amount whose lead content combined with that in the assay portion totals the weight of button desired. Addition of organic reducing agent is practiced by some assayers for the purpose of diminishing oxidation of the nails during the melting period. The slag should be below the monosilicate. The charge should be high enough in soda to make certain the completion of the reaction 7PbO+FeS₂+2Na₂CO₃=7Pb+2Na₂-SO₄+FeO+2CO₂, else matte will form and collect a portion of the precious metals which should go into the button. When arsenic is present, the temperature of the fusion should not be above 1050° C. to prevent the formation of speiss. The following charges are recommended (L. S. Austin in discussion of Assay of Gold and Silver by the Iron Nail Method, Drury and Hall. Bull. Am. Inst. Min. Eng., 83, p. 2691);

	Silicious Ore.	Basic Ore.	Ore High in Pyrite.	Ore High in Galena.	Basic Blendy Ore.
Ore	0.5 A.T.	0.5 A.T.	0.5 A.T.	0.5 A.T.	0.5 A.T.
	20 gms.	20 gms.	20 gms.	10 gms.	20 gms.
	25 "	25 "	25 "	25 "	25 "
Borax	5 " 3 "	15 " 4 "	10 "	5 " 3 "	15 "
Silica	0 "	0 "	10 "	0 "	0 "
Nails	1 "	1 "		2 "	3 "

The nails are introduced in such a form and manner that just before pouring, the portion above the charge can be seized firmly by suitable tongs, freed of adherent lead by knocking against the side of the crucible and then withdrawn.

Ores containing a great deal of silica and little of metallic oxides may be fused with a charge similar to the following:

Ore	
PbO	30 grams
Na ₂ CO ₃	30 ''

Reducing agent sufficient to produce a 20-gram button.

In the assay of ores containing selenium or tellurium, these metals must be practically eliminated from the lead before cupellation. Both have a great affinity for lead and copper and unless the fluxes are well proportioned and the fusion skillfully carried out, the product will be a brittle button which cannot be detached Tellurium reacts with litharge at moderate temperature, 700 to from the slag. 900° C... before silicates of lead are formed according to the reaction 2PbO+Te = Pb₂O + TeO. Partial reversion of the reaction takes place during the formation of silicates. When litharge has reacted sufficiently to form silicates there is no longer any oxidizing effect on tellurium.2 In the assay of gold telluride ores it is the best practice to make a crucible fusion with a large quantity of litharge and to cupel directly or after scorification. The passage of tellurium into the slag is more complete in the case of a basic than an acid slag. The following are type charges:3

	Hillebrand and	Silicious Ore with	Cripple Creek Ore
	Allen's charge for	Slight Reducing	Containing 15-25%
	Cripple Creek Ore.	Power.	Al ₂ () ₃ .
Ore Litharge Na ₂ CO ₂ K ₂ CO ₂ Borax Charcoal Flour NaHCO ₂	10 grams when required when required	0.5 A.T. 100 grams 30 " 6 " 1.1 "	0.5 A.T. 45.5 grams 9 "" 10.5 "" 8.5 "

Litharge cover. Salt should not be used.

The fusion of 1 and 2 should be carried out at a low temperature 950-10:0° C.. for 45 minutes, and finished by quickly raising the temperature, for a short period. Fusion of 3, which is not an excess litharge charge, is conducted at a temperature above the melting-point of gold, 1063° C., for the same length of time.

Silicious furnace by-products from the smelting of electrolytic slime from a copper refinery may contain selenium and tellurium in much larger percentage than is usual in ores. Especially when associated with copper, uniform results are most certainly obtained by a crucible fusion with a large excess of litharge of the largest assay portion which will produce a button which can be detached from the slag. Copper, selenium and tellurium are removed by wet treatment described on page 772.

In the assay of zinc-bearing material, loss of the precious metals through entrainment may be great if in any part of the process fume of zinc oxide is evolved.

³ Fulton, Fire Assaying, 131-136.

¹ Smith, Trans. Inst. Min. and Met., 17, 473. ² E. A. Smith, "Assay of the Precious Metals," 227.

On that account, whenever it is practicable material containing metallic zinc should be subjected to acid treatment preliminary to the furnace operation. Loss into the slag may occur, through incomplete decomposition on account of the refractoriness of zinc silicate or because of the low solubility of zinc oxide in litharge.

The following is a type charge for ½ A.T. of ore containing a high percentage of zinc sulphide.

Litharge	Grams. 100–200
Soda	10- 15
Silica	5- 10
Borax	5

Nitre sufficient to produce a 20 to 25-gram button. Borax glass cover.

The final temperature of the fusion should be about 1100° C.

When antimony in quantity is present, the crucible charge should contain a larger proportion of either litharge or soda. The following are type charges for A.T. of an ore containing a high percentage of sulphide of antimony.

	No. 1.* Grams.	No. 2.† Grams
Litharge. Soda.	150 10	50 35
BoraxSilica	6 10	10

^{*}Fulton, Manual of Fire Assaying, 146. †E. A. Smith, Assaying of Precious Metals, 222.

Nitre sufficient to produce a 25-gram button.

Salt used as cover.

As a rule a little antimony will contaminate the button and should be removed by a five or ten-minute scorification with about 10 grams of litharge.

In the assay of tin ores or concentrates, consideration must be given to the low solubility of tin oxide in litharge. The following are type charges:

	No. 1.	No. 2.*
Ore.	1 A.T.	1 A.T.
Litharge.	150 grams	35 grams
Soda.	10 ''	25 ''
Borax.	5 ''	5 ''

^{*} Bannister, Trans. Inst. Min. and Met., 15, 513.

Reducing agent sufficient to produce a 20-gram button.

By method No. 2 it has been found necessary to clean the slag when the ore contains over 1 oz. of gold. The slag is therefore pulverized and fused with a mixture of 20 grams litharge, 6 grams soda and sufficient reducing agent to produce a 20-gram button.

Nickel and cobalt silver ores always contain arsenic, usually antimony and sometimes as much as 10% of silver, of which a portion may be in the form of large particles of very pure metal. Handy describes the following: The charge

¹ Eighth Int. Cong. Appl. Chem., 1912, Sect. IIIA.

for the crucible, 0.2 oz. pulp, 12 grams K₂CO₂, 12 grams Na₂CO₂, 6 grams borax, 60 grams litharge and 1 gram of flour. "These are mixed by rolling in a rubber cloth, transferred to a crucible, covered with borax glass and heated to a medium red heat for twenty minutes. The door of the gas-fired muffle is then shut and the crucible heated to a bright yellow for thirty minutes."

The following are efficient charges employed in the process of corrected assay. Because calcium phosphate is not decomposed by the fusion, it is necessary in the assay of the cupel that it should be very finely powdered—no coarser than 120 mesh.

	Slag.	Saturated Portion of Cupel.
Material	100 parts 25 " 10 · " 5 "	100 parts 100 '' 40 '' 75 ''

Reducing agent, sufficient to produce a 20-gram button, is added and thoroughly mixed with each material while it is being pulverized. Salt is used for cover. The fusion of the cupel powder should be finished at a high temperature. The button from slag containing copper, antimony, tin, nickel or cobalt may require scorification with addition of lead before it becomes suitable for cupellation. Purification of the lead button may also be accomplished by melting it in a crucible or scorifier with litharge sufficient to cover it and a pinch of silica or borax. When the slag is fluid, the crucible is given a rotary motion, either within or without the furnace. This treatment is continued at intervals for five to ten minutes before pouring.

In the conduct of the crucible method, it is of extreme consequence when the material is neutral or oxidizing in its action that there should be very intimate mixture of the assay portion with the reducing agent and with litharge. When reducing in action, the finely pulverized nitre should be thoroughly mixed with the assay portion.

The operation of mixing is conveniently accomplished by use of a 10- or 12-in. porcelain mortar with glazed inner surface, or by rolling on a 30-in. square piece of smooth rubber cloth. Soda should be well mixed with the charge but not necessarily so intimately as to lose its identity. Silica and borax may be roughly mixed. The use of a cover of salt or borax is of advantage in all fusions in which much gas, CO₂, CO, SO₂ or H₂O is liberated.

Salt is not recommended as a cover of charges high in silver or gold.

Fusion. As a rule it is good practice to place crucible into a muffle which is at about 850 to 900° C. The introduction of the crucibles cool the furnace to about 550 to 600° C. Without altering the rate of introduction of heat to the furnace, the flow of heat to the crucible charge continues until at the end of twenty-five to thirty minutes evolution of gas ceases. The fire is then urged for ten to fifteen minutes until a temperature of about 1100° is reached, when the crucibles are withdrawn from the muffle and poured into a dry, clean, shallow-bottomed or conical mould. The slag should be very fluid and free of any evidence of undecomposed ore. If the slag is pasty, the necessity of modifying the flux is indicated. If the nature of the flux is such that the crucible is very much corroded, it is good practice to pour off most of the slag and permit the lead, covered with slag, to solidify in the crucible. If the crucible is heated too slowly, the greater part of the lead

may be reduced and run to the bottom of the crucible before complete decomposition of that constituent of the ore which carries the precious metal has taken place. When heated too speedily, that compound of base and borax with the silica of the ore which has the lowest formation point will sink to the bottom of the charge, leaving a pasty, unbalanced charge above. Moreover, evolution of the gases may not only cause mechanical loss, but on account of their expulsion before the material undergoing assay is entirely decomposed, the effect of their stirring action is lost.

SCORIFICATION

Scorification is most efficiently carried out in a muffle sealed from the products of combustion and having a rectangular opening in the back nearly the



Fig. 59c.

full width of the muffle and about on the level with the top of the scorifiers. The opening should be connected with a flue pipe fitted close to the furnace with an easily controlled damper. The draft head from a chimney 10 ft. in height is effective. The life of a muffle is prolonged by a layer of bone ash or silica sand over its floor and by adequate support of the entire bottom. Mixture of 1 part fire-clay with 3-4 parts silica sand serves well to lute the muffle to the furnace. Alundum cement is better for filling cracks in the muffle.

The best form of scorifier is the Bartlett shape. The nearly flat bottom of this type gives room for a larger accumulation of slag about the molten lead than a rounder bottomed scorifier of the same diameter. The sizes of scorifier

commonly employed are the 2, $2\frac{1}{2}$, and 3 inch. For the fusion of ore or other material, when it is of advantage to use as large as possible charge of either assay portion or of lead, the 3-in. size is employed. For the fusion of filter paper residue. from which a moderate quantity of impurity such as copper, silica or iron, is to be removed, the 2½-in. size is adapted. The 2-in. size is used for filter paper residue of small volume, which contains so little impurity objectionable in the process of cupellation that only short scorification is required.

Moisture and especially salts absorbed by a scorifier will cause spurting of the lead during scorification. For this reason, scorifiers should be kept dry, and those intended for reception of moist substances should be first glazed with lead borate

or silicate, or lined with a single sheet of lead foil.

The reagents used are limited to granulated test lead, sheet lead, borax glass,

silica and litharge.

Granulated lead is commonly of such degree of fineness that 50% or more will pass a 60-mesh screen. The sheet lead most generally used weighs 1.5 to 1.75 grams per square inch. The amount of gold in 500 grams of lead should be and generally is unweighable. While the lead should contain no bismuth or silver, it too frequently carries as much as 0.005% of bismuth, and 0.0002% of silver. The silver content should be known and correction on account of it should be applied to results from material, the assay error of which is measured in hundredths rather than tenths of a milligram.

Borax glass alone is always used as a flux for silicious material. Silica alone is used in all rescorifications. A mixture of equal parts of borax and silica is used to flux

basic charges.

Litharge mixed with the assay portion of any refractory material increases the rate

of its decomposition.

The scorification method is especially applicable to the fusion of filter paper residue in combination methods of assaying, to gold or silver ores and to copper or lead refinery by-products which are so rich that 0.1 or 0.05 A.T. constitutes the test portion, and to the assay for gold in material in which gold is less and silver more accurately determined by combination methods, such as some high copper ores, furnace and refinery products. Scorification is employed to purify lead, either as sample or the product of the crucible fusion, of impurities which are objectionable in the process of cupellation. The scorification method of fusion can be applied to low-grade silver-and gold-bearing silicious material, but usually gives the lower result and requires more furnace space and attention of the operator than the crucible method. Of such material, it is the practice to make fusions of portions of 0.1 to 0.25 A.T. each, and on the single button or on combinations of the buttons, with or without addition of more lead, second, third or even fourth scorifications are made until a button of suitable purity and size is obtained which represents 0.5 or 1 A.T.

The size of charge and detail of method of manipulation to produce the button for cupellation in the assay of any single type of material depends upon the size and shape of muffle and scorifiers, and the quality of draft. For instance, with a muffle of 6 ins. or more of inside height, having a draft hole and flue area 10-12% of the area of cross-section of the inside of the muffle, it is possible to scorify at the back of the muffle without pouring off the slag 60 grams of lead in a 3-in. Bartlett-shaped scorifier of American manufacture, to a 15- to 20-gram button. While a 30- to 50-gram button will be the product of the scorification in a muffle of such low form that it is difficult to keep the surface of the slag cool. or in one unequipped to maintain a rapid rate of oxidation, or in a scorifier of smaller size, or of the same diameter but of a shape which does not provide amply for accumulation of slag before the lead becomes covered.

The ratio of weight of assay portion to that of lead is limited by the specific volume of the material and by the characteristic solubility of the actual and potential bases and of silica by lead oxide.

The volume of the assay portion, except in the case of material which is wholly metallic, when mixed intimately with one-half of the charge of granulated lead, should be no greater than can be covered by the remainder of the charge, else a part of the assay portion may adhere to the side of the scorifier out of contact with the slag. The assay portion should be no greater than will be completely dissolved by flux and lead oxide during the first few minutes of the scorification with formation of much less volume of slag than will cover the molten lead, else particles of the assay portion may float to the side of the scorifier and will remain undecomposed because out of reach of the portion of the slag which is in active circulation. In the dry or "all-fire" assay of metals alloyable with lead, the proportion of the assay portion and the concentration of metals during the first or succeeding scorifications should be no greater than will allow of the ready solution of the oxides by lead oxide at the rate of its formation, else a solid scum of oxide may form over the lead, preventing further scorification; or the oxides may aggregate in pasty lumps which tend to retain values in Oxidation of the metals progresses in approximately the following the slag. order: iron, zinc, tin, arsenic, antimony, lead, cobalt, nickel, copper, bismuth, selenium and tellurium. It is sometimes impracticable to eliminate completely the last three elements from lead by process of scorification. Because of their effect on the bead obtained by cupellation, whenever consistent assays for silver are sought, they are best removed from the lead button by the method described on The presence of selenium unassociated with other colored oxides is indicated by a ruby-colored slag. Tellurium gives a dark stain over the bottom of the scorifier. Antimony is indicated by orange-yellow patches on the scorifier. Iron gives a reddish brown, cobalt a brilliant blue and nickel a light-brown color to the scorifier glaze. Copper is oxidized comparatively slowly by scorification and the progress of its elimination by repeated scorification is indicated by the shade of the green glaze on the scorifier. When the concentration of copper in the lead has been reduced to such an extent that the lighter shades of green are obtained, the experienced operator is able to judge by observation of the size of button and the depth of color of the scorifier how much lead is required in the charge for final scorification, and when the button is sufficiently free of copper to permit of cupellation. A 10-gram button suitable for cupellation should be from a scorifier which is no darker than a very light apple green; a 20-gram button may be from a somewhat deeply shaded scorifier. If too little flux, silica or borax is supplied to a scorification, the scorifier is apt to be so deeply corroded or pitted that lead will be retained, while if too much borax is added the slag will be so viscous as to prevent aggregation of the particles of lead.

Silica, if unmixed with the assay portion, may be added in moderate excess, but may give some trouble in pouring. It is not uncommon practice to make a poor batch of scorifiers usable for assay of basic material by tamping a layer of fine silica over the bottom of each dish. In the assay of basic or acid ores or furnace products, as quick fusion as possible should be made. The scorifiers are put into a muffle having a temperature between 1050° and 1100° C. and the door and damper are closed tightly until (within ten minutes) the

scorifiers are of the same temperature as the muffle. The door and damper are then opened and by regulation of the means of supplying heat, the scorification is conducted at as low temperature as is practicable, until experience indicates that the buttons are of the size desired. The temperature of the muffle is then raised by closing the door and urging the fire for several minutes, when the contents of the scorifiers are poured into shallow iron moulds. Pouring with certainty of not shotting the slag is made easy of accomplishment by use of a mould no deeper than will just hold the contents of the scorifier, tongs with a very short prong on the pouring side and a motion which introduces the greater part of the slag a distinct interval before the lead is allowed to flow without much drop into the middle of the mould. When the scorifier remains in the furnace for some time after the lead is submerged, the slag becomes pasty and tends to cause more or less loss of lead in pouring. Thickening of the slag through entrance of the constituents of the scorifier is also brought about even before the lead is closed over, when the scorification is carried out at too a high a temperature or under any condition which causes corrosion of the scorifier at a greater rate than the production of the quantity of lead oxide requisite to keep the slag fluid.

Rescorifications to purify or concentrate the buttons are made at as low temperature as possible. Scorification of filter paper residues containing little else than gold and a silver precipitate may be commenced at a low temperature, but such as contain sulphur in any form should be started at a high temperature, else a portion of the sulphur oxidizing to SO₄ forms with the base of the borax flux, sodium sulphate, which may cover the lead and prevent oxidation of the sulphur which has combined to form lead sulphide.

Placing powdered charcoal on the surface of the slag before raising the temperature to pour, is not an effective method of cleaning the slag or of making an assay with slag correction. Because it introduces a factor likely to be personal and not wholly under control, the practice is not good in the appraising assay of commercial material.

Type Schemes. The following are illustrative of the details of manipulation of the scorification method of fusion, purification and preparation of the button for cupellation.

Cobalt, Nickel Silver Ore. For each test of an ore containing over 2000 to 4000 oz. per ton, a button representing \(\frac{1}{2} \) A.T. is cupelled. For each test of an ore containing 1000 to 2000 oz. per ton, a button representing \(\frac{1}{2} \) A.T. is cupelled. For each test of an ore containing less than 1000 oz. a button representing \(\frac{1}{2} \) A.T. is cupelled. For each test of the metallic scale, which is quite pure silver, a button representing \(\frac{1}{2} \) A.T. is cupelled. Of the 2000 oz. ore, \(\frac{1}{2} \) A.T. is weighed out and mixed on smooth paper or rubber cloth with 90 grams of finely granulated lead and 9 grams powdered borax glass. The charge is distributed between three 3-in. scorifiers and each portion is covered with 30 grams of lead. Scorification, commencing at a high temperature, is continued at a low temperature until 15- to 20-gram buttons are produced. The buttons are combined in a single 3-in. scorifier, and rescorified to production of a 15- to 20-gram button which represents \(\frac{1}{2} \) A.T. Of the 1000 to 2000 oz. ore, \(\frac{1}{2} \) A.T. is weighed out, mixed with 150 grams of lead and 15 grams powdered borax, and distributed among five 3-in. scorifiers. The content of each scorifier is covered with 20 grams of lead. After scorification to production of 10- to 15-gram buttons, all the buttons are combined in a single 3-in. scorifier and scorified to production of a 15- to 20-gram button. The 1000 oz. or less ore is treated in exactly the same manner as the 1000- to 2000-oz. grade with the exception that two lots of \(\frac{1}{2} \) A.T. each are weighed out and distributed among two groups of five scorifiers each. The two buttons resulting from the second scorification are combined in a 2\(\frac{1}{2} \)-in. scorifier and by a third scorification a single button

representing 1 A.T. is produced. Of the metallic scale $\frac{1}{10}$ A.T. is weighed out, placed in a 2½-in. scorifier with 30 grams of lead and scorified to production of a 15- to 20gram button. It is customary in the case of nickel silver ore to report results on the basis of assay with both slag and cupel correction, therefore all the slag in the production of each bead for cupellation should be collected, ground finely and the whole, or a convenient aliquot, assayed by the method described on page 466

Assay of Blister Copper for Gold. For each test of \(\frac{1}{2} \) A. T., five lots of the sample of

10 A.T. each are placed in three scorifiers and covered with 60 grams lead and 2 to 3 grams of the borax silica flux. Scorification is continued to production of 20- to 25-gram buttons. Sufficient lead is added to each button to make the total charge 60 grams and each & A.T. portion is rescorified until about 20 grams of lead remain in each scorifier. From each scorifier the slag is decanted on the shelf in front of the muffle. Without removal from the furnace, all the buttons are combined by pouring into a single hot, fresh scorifier. Scorification is continued until about 25 grams of lead remains, the temperature is then raised, the slag decanted and the metal poured into a fresh scorifier holding 40 grams of molten lead. Scorification is continued to production of a 15- to 20-gram button. From the shade of the scorifier and size of the button, the operator judges how much lead is required to be added to procure from the fourth scorification a button suitable for cupellation. Throughout the operation the copper should not be allowed to become so concentrated or the temperature so low that lead will liquate from the copper.

Whenever muffle space is more valuable than time saved by combining portions of the assay by pouring from one scorifier into another in the furnace, it is the bet-

of the assay by pouring from one scorifier into another in the furnace, it is the better practice to pour the portions into moulds and combine the slag-free buttons.

*Copper Matte for Gold.** For each test of \(\frac{1}{2} \) A.T., three lots of \(\frac{1}{2} \) A.T. each are placed on a layer of 30 grams of lead in three 3-in. scorifiers. The charge in each scorifier is covered with 30 grams of lead and 5 grams of borax-silica flux. The scorifiers are placed in a very hot muffle which is opened only after the scorifiers are of the same temperature. The scorification is continued at as low temperature as possible, until 15 to 20 grams of lead remains in each scorifier. The heat is then raised for three to five minutes before requiring. before pouring.

If the matte is very low in copper the buttons may be combined and rescorified to suitable size for cupellation. If the matte contains 10% to 20% copper, the product of the second scorification is rescorified with sufficient lead to make the total charge,

according to the judgment of the operator, 30 to 60 grams.

If the matte contains 20% to 40% copper, each button of the first scorification is put into a fresh 3-in. scorifier and sufficient lead added to make the charge up to 30 to 60 grams. The product of the 15- to 20-gram buttons of the second rescorification

are combined and reduced to cupellation size.

If the matte contains 40% to 60% copper, the product of the third scorification is scorified a fourth time with addition of sufficient lead to make the total charge

30 to 60 grams.

If the matte contains more than 60% of copper, each lot of \(\frac{1}{4}\) A.T. is rescorified twice with addition each time of sufficient lead to make the total charge in each scorification. fier 40 to 60 grams. The resulting buttons are combined into a single charge for a fourth and final scorification to a 15- to 20-gram button. The details of the scheme are the same for the assay for silver or gold in ore of similar copper content, except that

several grams of borax are mixed with the charge to flux the initial fusion.

Tin Concentrates for Gold and Silver. For each test, 1 A.T. mixed with 200grams test lead, 100 grams litharge and 30 grams borax on smooth paper, rubber or oil
cloth, is distributed among ten 3-in. scorifiers and each charge covered with 30 grams lead. Scorification, commenced at a high temperature, is continued low until the lead is covered over. The resulting buttons are pounded free of adherent slag, distributed among 2 or 3 scorifiers and rescorified. When the lead has been reduced in each to 15 to 20 grams, the charges may be poured and the resulting buttons combined and scorified to a final button; or the slag may be poured off and all the lead poured into a single scorifier. This method is also adapted to the assay of highly silicious material.

The methods described may be modified in the following details: For purpose of accounting, factory, mine or mill control, or by agreement between buyer and seller, the button to be cupelled may represent a smaller portion; because it is difficult to nick from the cupel and clean very small silver beads, cupellation of a portion representing two or more A.T. may be undertaken. When scorifiers are of uncertain quality, it is the better practice to weigh out the portion designed for each scorifier and mix the flux and lead with spatula with the charge.

CUPELLATION

Cupels are best made by a cupel machine from perfectly dry cupel bone ash. Cupels so made can be used immediately after manufacture. If water is employed to make the bone ash coherent, cracking is liable to occur on exposure to muffle temperature unless the cupels are dried out very slowly by allowing them to stand in a warm, dry spot, days or weeks according to the amount of water used. When a brand of bone ash makes a dry pressed cupel which is inclined to crack or split, this tendency is overcome by admixture of the unsaturated portion of old cupels or of bone ash which has been heated in a muffle to about 1000° C. which evidently has not been completely decarbonized should not be used, because complete oxidation of its content of organic matter requires that the cupels be kept hot for a long period before commencing cupellation, else spurting of molten lead will take place during the operation. When the form of the saturated portion. of the cupel show, that lead oxide is not absorbed freely, an unsatisfactory quality of bone ash is indicated. The bottom of the saturated portion of a well-made cupe! of bone ash of first class quality is concave in shape, free of knobs or projections, and can be cleanly separated by hand, with exercise of little effort, from the unsaturated portion. The proportion of the different sizes of particles of bone ash is a matter of consequence. Cupels made wholly of very fine particles are apt to be too dense, unless moulded with so little pressure that they are so fragile, that their manipulation must be conducted with great care. Those made entirely of coarse particles (through 40 and left on 60 mesh) have such a rough cup surface that the cupellation loss is excessive and not uniform.

A very satisfactory cupel is made from bone ash which contains approximately 75% of particles which will pass a 100-mesh screen and the remaining 25% finer than 40 mesh.

The following shows the range of screen analyses of samples taken from 28 barrels of the same brand:

	rer Cent.
Left on 40 mesh	0-8.7
Through 40 left on 60 mesh	
Through 60 left on 70 mesh	3.7 - 9.6
Through 80 left on 100 mesh	12.5-20.3
Through 100 mesh	59.1-83.2

Samples from seven of the barrels wet-screened through a 200-mesh sieve gave quantities of fine product ranging from 42% to 58%.

Patent and ready-made cupels, in which magnesium or calcium oxides, plaster of Paris, Portland cement or organic matter may enter as constituents, because they will survive shipment, are of use in situations where the manufacture of the laboratory-moulded cupel is impracticable. When silver beads of 997-998 fineness are obtained from such cupels, the cupellation loss is usually greater than is common from bone ash cupels of normal quality.

The patent cupels require the higher temperature generally throughout, always at the finish of the operation, else freezing will take place, or beads will be obtained which may retain quite as much lead as will balance the normal loss of silver.

The brands of patent cupels which preserve a smooth, hard surface after cupellation will retain a trace of silver (0.10 milligram or less) in easily discoverable form. This amount is difficult to find in a bone ash cupel unless made entirely or cup finished with a grade of very fine quality.

While a bone ash cupel absorbs practically its own weight of lead in the form of lead oxide, it is well to make the size such that the saturated portion will not reach quite to the bottom. A cupel $\frac{3}{4}$ in. in height, 1 in. in diameter is suitable for a 12-gram button; 1 in. in height, $\frac{1}{6}$ ins. diameter for a 20-gram button; 1 in. in height $\frac{1}{4}$ in diameter for a 25-gram button.

The cup of the cupel should be perfectly smooth and free of any particles of loose bone ash. Such particles as may adhere may be removed by blowing on them. Loosening the particles by the finger may roughen the surface and increase the cupellation loss.

The lead button is prepared for cupellation by freeing it all of adherent particles of slag. Presence of slag corrodes the cupel. It is pounded on a smooth anvil with a flat-faced hammer and then shaped into a cube or disk which will fit the cupel and be firmly held by the tongs. It is good practice to round the corners of the button. A soft, brittle button may result, through the presence of lead oxide in its composition, from completion of scorification at too low a temperature. A button containing more than 25% of silver or gold is brilliantly smooth, hard and brittle. Selenium or tellurium in considerable quantity makes the button rough, brittle and difficult to separate from the slag. A small quantity of sulphur will make the surface of the button scale. Arsenic and antimony have a similar effect.

Operation. In a small or low-formed muffle, cupellation of only a single or possibly two rows of cupels placed near the front can be carried out successfully. When cupellation is carried out in a single row near the front, the position and shape of the row is determined by experience. Besides regulation of fuel supply, temperature of the cupel is controlled by placing scorifiers or old cupels in front and back of the row and by manipulation of the muffle door and damper. Large and small buttons can be cupelled simultaneously by this method. Because the action tends to increase silver loss into the cupel, a cupel should not, while cupellation is in progress, be moved in a manner which will cause change of position of the metal in the cup. In a muffle high enough to allow view of metal inside of a cupel placed near the back wall and of size large enough to be unaffected quickly by small heat changes, cupellation is conducted in a series of rows of cupels extending from close to the back wall to within 4 or 5 ins. of the To hold the heat in the front and back rows, it is common practice to bank against the cupels in these rows bone ash, old cupels, scorifiers or pieces of thin brick. Some operators make it possible to do very artistic feathering by building a dam of bone ash several inches high near the door of the muffle to break and heat the current of air over the cupels. Cupellation by this method should be of buttons of nearly uniform size.

Entrance of the products of combustion to the muffle retards cupellation. By nice adjustment of temperature previous to commencement of the operation in a large muffle carrying many cupels, little regulation of the fuel supply is required. Heat effects are produced by manipulation of the muffle door and of in. thick cooling irons with 3-ft. handles. The irons are shovel shaped to cool the entire top of the muffle and of rectangular form to cool a single lateral or longitudinal row. During the early part of the operation heat is supplied and tempera-

ture raised by oxidation of the lead in the cupels. Toward the end of the operation, the rise of temperature produced by moderate reduction of the rate of flow of air through the muffle, together with the heat retained by the closely packed cupels is usually sufficient to produce silver beads of standard purity, when the cupels are of good quality.

Previous to commencement of the operation, to expel moisture, burn organic matter, decompose CaCO, in the cupels, to give them time to gain a temperature uniform with the atmosphere of the closed muffle and to permit the furnace as a whole to acquire a condition of temperature and equilibrium of flow of heat which will allow control of muffle temperature without application of extreme methods of heating or cooling, the cupels in the tight muffle should be brought to and allowed to remain for at least ten minutes at a temperature only very little above that which will cause scum of oxide on the surface of molten lead to melt and be absorbed by the cupel material.

"The temperature of cupellation of pure lead buttons should be 850° C. to uncover the button; this may be lowered to 770° C. during the major part of the cupellation, but must be raised to about 830° C. near the end to finish the operation." ¹

The muffle damper being closed, the lead buttons are placed in the cupels in the order of the numbers on the scorifiers in a tray. The muffle door is closed until the lead in all the cupels will "uncover" or "drive." Immediately the damper is opened somewhat.

The temperature of the top of the cupel is then cooled by the methods mentioned until the appearance of the margin of the molten metal within the cupel and the color of the saturated portion of the cupel indicates to the experienced operator that a fringe of crystalline or "feather" litharge is forming just above the lead. If the cooling is carried too far, the cupel becomes too cold to absorb the litharge and "freezing" is the result. Approach to this condition is manifested by the tendency of the line of juncture of metal and cupel to appear indefinite. in an attempt to raise the temperature of a charge of cupels, the flow of air through the furnace is stopped, cupellation will cease because a coating of solid oxide will form on the surface of the lead which will require a considerable rise of temperature to melt. The operation of alternately cooling and allowing the temperature to rise is continued until little lead remains. As the quantity of lead and the heat imparted to the cupel through its oxidation diminishes, the temperature of the cupel must be increased until at the moment when the silver-gold bead is practically free of lead, the temperature should be close to that at which cupellation was started. If the temperature is too high at this moment the silver bead will not at once solidify and while molten will asborb oxygen. When the bead solidifies, the oxygen is expelled with the projection of rough points on the bead and sometimes of particles entirely separate from the bead. The tendency to "sprout" or "spurt" increases with the size of the beads. When a cupel is kept in a muffle at a high temperature for a considerable period previous to commencement of cupellation, the silver bead exhibits a tendency to remain liquid at a temperature far below the normal freezing-point of silver. The same inclination is also quite characteristic of cupellation in a dense cupel of fine bone ash. When such a bead solidifies the expulsion of oxygen has been known to be so violent as to break the beads apart. When a bead is induced to become solid by taking the cupel out of the muffle and giving it a series of shocks, if sprouting does not take place.

¹ Fulton, "Fire Assaying," 2d ed., 41.

the bead is often found to be hollow. Silver loss tends to increase with length of time that the bead remains in a state of suffusion. Rootlets extending into the cupel are peculiar to beads which have been in this state. A silver bead having once solidified in its cupel does not require immediate removal from the furnace, but may remain for any reasonable period without loss or gain of weight, providing the temperature of the cupel is not raised so high that its fringe of feather litharge is melted. If the temperature is too low during the oxidation of the last portion of the lead, "freezing" with accumulation of unabsorbed litharge is likely to occur. Solidification of a lead silver alloy which forms a flat dull-colored bead with smooth under surface and is non-adherent to the cupel, may sometimes occur. This alloy may contain as much as 10% of lead. Because the heat of oxidation of copper is greater than that of lead, freezing is less likely to occur in the cupellation of buttons containing no greater quantity of copper than is suited to the process.

Except when the bead contains more than 20% of gold, it should be silvery white, globular and, when hot, adherent to the cupel. As the ratio of gold increases, unless the cupellation is finished at a high temperature, the bead is apt to be dull on account of retained lead, or copper when that metal is present in the button.

An indented bead if silvery white is not an indication of impurity, but if the luster is dull the presence of bismuth, copper, selenium or tellurium may be suspected. Bismuth in moderate quantity (a few tenths per cent of the lead alloy) is taken up by large beads to such an extent that the bismuth content may more than balance the excessive cupellation loss on account of its presence. Through the inclination to leave particles of the precious metal on the sides of the cupel, the excessive loss may exhibit itself in the case of small beads. Copper being absent, bismuth produces a brownish stain under the silver bead and dark green rings about it. When a large quantity of bismuth, selenium or tellurium is present the surface tension of the silver bead is diminished to such an extent that it may spread over the surface and into the bottom of the cupel. These impurities in lesser quantity modify the appearance of the silver bead according to the amount of silver and the finishing temperature of the cupellation. In the assay for gold, the result obtained from parting the product of cupellation of a tellurium-bearing bead is usually higher than that obtained by removal of tellurium by wet methods. Recupellation is of necessity occasionally resorted to in order to obtain a silver bead sufficiently pure to favor the production of a gold mass which can be collected in the process of parting.

The presence of a large proportion of silver decreases the gold loss especially in the cupellation of buttons containing selenium or tellurium. In the assay for silver and for silver and gold in bismuth-bearing material, selenium, tellurium and bismuth should be separated by the combination method described on page 484.

Copper eliminated before the last of the lead causes no abnormal cupellation loss. When its proportion in the lead button is large enough to extend the dark stain on the cupel to the seat of the bead, but insufficient to prevent cupellation with "feathers," the cupellation loss is somewhat more than normal when the final temperature is hot enough to bring about a bead of standard purity. But if the ratio of gold to silver is low in the bead or the final temperature is not high, copper may be retained in the bead in quantity sufficient to offset a part or more than the whole of the abnormal amount of silver absorbed. No attempt should be made to cupel a lead button containing a greater proportion of copper than will allow cupellation with "feathers." Antimony to the extent of 2% may be present

in the lead button.¹ A large quantity produces scoria and causes cracking of the cupel. The presence of antimony and any of the base metals whose oxides are not very soluble in lead oxide causes large and not uniform loss of the precious metals into the cupel because of the high heat required to start and sometimes to continue cupellation, and through retention of particles in the scoria of oxide about the sides of the cupel.

The presence of platinum or palladium raises the temperature of the meltingpoint of the silver-gold alloy and increases the tendency to retain lead by the product of cupellation. The presence of but a very small proportion of either gives a steely hue to the silver bead. With increase of proportion of the platinum

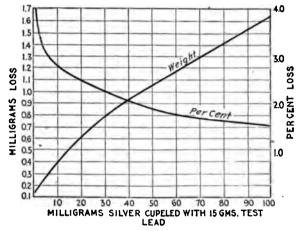


Fig. 59d.

metals and influenced by the final temperature of cupellation, the bead becomes flat, its 'surface dull, crystalline, rough or irregular and its color gray or almost black. The effect of either metal alone is similar but not exactly alike. Palladium shows a tendency to produce beads of less luster, darker in color and of more irregular surface.

Since the freezing-point of the silver gold alloy increases rapidly with the percentage of gold, care is required when the ratio of silver to gold is less than 6 to 1, that the final temperature of cupellation be higher than is required to obtain a gold-free silver bead of standard purity.

Loss of both gold and silver into the cupel increases with the quantity of lead used. Custom and convenience have made it the very common practice to carry out cupellation on buttons of 15 to 25 grams, resulting from crucible fusion, and on those between 10 and 20 grams which are the product of scorification. Amount of lead remaining constant, cupellation loss of silver decreases in percentage with increase of quantity. Chart Fig. 141 is the product of several hundred cupellations, chiefly of pure silver, made in the course of trials of different brands and graded mixtures of bone ash and other experiments. The lead used was reduced from litharge made from the best grade of test lead; 200 grams gave an unweighable amount of silver and bismuth. The beads assayed 996.5–998 fineness.

¹ E. A. Smith, "Sampling and Assaying of Precious Metals," 168.

Temperature higher than is required to produce "feather" litharge increases the loss of silver and gold. The effect, however, of temperature of cupellation on small quantities of gold alloyed with silver is so little that ordinarily when the assay is for gold alone care is only taken that the bead does not " spurt."

Weighing the Beads. Error may be introduced in the assay for silver through lack of care in cleaning particles of bone ash from the bead. The bottom of the bead held firmly by pliers is scoured with a bristle assay brush before weighing. Weighing of the silver bead is made to the tenth or twentieth milligram and on a button or assay balance sensitive to one or two hundredths of a milligram. In the assay of low-grade material, appraised in large parcels, and when the accuracy of the method warrants such action, weighings are made to the hundredth milligram on a gold assay balance.

To check balance and mathematical errors it is common practice to weigh and record separately each bead and then the combination of all the beads from

the same sample.

Direct cupellation is applied to the assay for silver in lead, and preliminary assay of base and Doré bullion, when no sulphur- or scoria-forming metals and but a few hundredths per cent of selenium and tellurium enter into their composition. When such impurities are present in lead bullion, 10 grams each of lead and litharge and 2 or 3 grams borax-silica flux are added and the test portion subjected to long enough scorification to produce a 15-gram button whether 1 or \frac{1}{2} A.T. be taken for the assay portion.

Lead bullion which contains no impurity interfering with cupellation is cupelled in portions of \(\frac{1}{2} \) A.T. each. Each portion is wrapped in a 2-in. square of assayer's sheet lead which weighs about 7 grams. Cupellation is carried out under conditions which favor the production of feather litharge. Correction for slag and cupel loss is applied in the assay of lead bullion usually by direct assay of cupel and slag, but sometimes from the loss sustained by a similar and known quantity of silver cupelled or scorified at the same time and under exactly the same conditions.

Cupellation of have or Port bullion is most commonly practiced to prepare the

Cupellation of base or Dorê bullion is most commonly practiced to prepare the assay portion for the parting process, and as a convenient method of making the trial assay preliminary to performance of some form of the Gay-Lussac method of determination of silver. Settlement assays for silver are, however, sometimes made on the

purer grades of bullion by the cupellation method.

purer grades of bullion by the cupellation method. A preliminary assay of 500 milligrams of the sample is made by wrapping that quantity with 15 or 25 grams of assayers' sheet lead and cupelling with feathers if possible. The experienced operator judges from the quantity of silver and gold present, from the stain on the cupel and from the appearance of the bead, how much copper is present and how much lead to add. To prevent "spurting" some prefer to add a definite amount (less than 10%) of copper to bullion which contains none. The suitable amount of lead to employ in the cupellation may be calculated by multiplying the copper present in grams by 100 and adding 2 when the copper is less than 20% of the bullion; multiplying by 40 and adding 8 when the copper content is between 20 and 60%; multiplying by 20 and adding 14 when the per cent of copper is over 60. As an illustration, a 500-milligram assay portion containing no copper is cupelled with As an illustration, a 500-milligram assay portion containing no copper is cupelled with 2 grams lead, while such containing 50, 200 or 450 milligrams of copper would be cupelled with 7, 16 and 23 grams of lead respectively. One or two check portions are made containing the same amounts of silver, gold and copper as were determined by the preliminary assay. In making up the checks, the silver weighed up in the preliminary assay is corrected for cupellation loss by adding in the case of base bullion 1.25% to its weight. Gold under 1% of the silver is not ordinarily included in the check assays when silver only is to be taken account of.

The check and two or more assay portions are cupelled each with the same amount of lead at the same time and under as precisely the same conditions as it is possible to obtain. In calculating fineness the average of the silver and the gold found in the

assay portion is corrected by the actual loss or gain sustained by each precious metal

in the check portions.

In making the cupellation, conditions of temperature and draft which will affect all the cupels uniformly are sought rather than the production of feather litharge. The temperature, however, should not be so high that the beads are likely to sprout. Less confidence is placed in results from check portions which show a gain than in those which show a loss, when it is apparent that the loss is not mechanical.

PARTING

To the process of separating gold from silver in such form that it can be collected and weighed with certainty and facility, the action of suitably diluted nitric acid is better adapted than that of sulphuric acid. On account of the solubility of platinum in its silver gold alloy by nitric acid, parting with hot sulphuric acid is used only when the assay is intended to include that metal. Except by employment of methods of manipulation and treatment practiced in the assay of gold bullion, silver does not dissolve with sufficient completion from beads in which the ratio of silver to gold is less than 4 or 5 to 1. When this ratio is natural to the material undergoing assay, the bead, after weighing, may be cupelled with several grams of lead after addition of about 10 parts silver. It is the better and more commonly followed procedure when low ratios prevail, because a high proportion of silver in the bead tends to prevent gold loss into the cupel, to make a separate assay for gold, and add about ten times as much silver as gold present to the assay portion at some period previous to cupellation.

Nitric acid and water used in parting should be free of any form of chlorine or other halogen, and of the presence of another acid. The gold mass in the operation is somewhat more conveniently handled if the silver bead be flattened somewhat. But flattened buttons containing large amounts of gold (over 50 milligrams) appear to require annealing to obtain an uniform parting loss. The gold mass is less liable to break up if the bead is dropped into hot than into cold acid. It is more apt to be coherent when the silver is dissolved in a high than in a low column of acid. On account of the solvent action on gold in spongy form by hot nitric acid of a strength approaching 1.42 sp.gr., parting solutions should never be allowed to become so highly concentrated.

The following methods are employed in a laboratory which has investigated the solvent effect of the acids and the purity of the gold masses produced. All the heating operations are conducted on a 2-in. copper plate covered with strips of asbestos paper and heated by lateral rows of perforated pipe burners. The gas supply to each burner is separately controlled. The silver bead containing less than 2 milligrams of gold is dropped into 25 cc. of hot acid of 1.07 sp.gr. (1 part 1.42 sp.gr. acid and 6 parts water) in a 1 oz. casserole and the liquid is kept a little below the boiling-point for forty minutes. The gold mass is washed with water by decantation three times, dried and annealed by placing the casserole over a Bunsen flame until change of color of the mass. A silver bead containing more than 2 milligrams and less than 10 is dropped into 25 cc. of hot acid of 1.04 sp.gr. (1 part strong acid and 9 parts water) in a 1-oz. casserole. When visible action has ceased, the silver solution is decanted, the casserole filled up with acid of 1.16 sp.gr. and the gold mass digested for fifteen to twenty minutes at a temperature a little below the boiling-point. When the quantity of gold is more than 10 milligrams, the two-strength acid treatment is carried out in a 2-oz. parting flask. During the final treatment the acid is kept boiling gently for twenty minutes. After decantation of the acid liquid, the flask is filled up to the brim with water, the brim closed with the cup of a 1-oz. casserole, the flask quickly inverted and tapped to dislodge particles of gold from the side. The flask is raised until the brim is near the surface and removed with a quick motion to the side. The gold mass is then washed, dried and annealed.

When platinum and palladium are present the gold mass is apt to break up into dark-colored particles, coarse or very fine, according to the proportion of the platinum metals. Selenium or tellurium in the bead will also produce a similar effect. When gold only is to be determined, the single 1 to 6 acid treatment in a casserole is pursued; but if platinum is to be determined the parting with 1 to 6 acid takes place in a flask or covered beaker. The residue is transferred to a filter, about 20 parts of silver added, the filter, covered with 25 grams of lead in a small scorifier, is

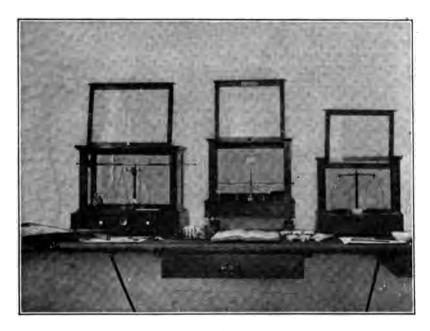


Fig. 59e.

incinerated, scorified, cupelled and parting repeated. These operations may require repetition several times before the coherency and color of the gold mass indicates absence of platinum. The presence of even 0.05 milligram of palladium gives a yellow hue to 20 cc. of parting liquor.

Gold is usually weighed to hundredths milligram. When the demand, the sensitiveness of the balance and the accuracy of the method of assay warrant such procedure, weighings to thousandths milligram are made. The low-column type of gold balance is in every way superior to the high. The weights and riders employed should be frequently checked by a set which has been verified

¹ For methods of treatment of the parting liquor for determination of platinum refer to chapter on Platinum, also see article by A. M. Smoot, Eng. and Min. Jour., April 17, 1915.

by the Bureau of Standards. To lessen balance and other errors, it is common practice to obtain the weight of each in turn and finally all of the gold masses from the same sample without removal of any from the balance pan.

Gold Bullion. A preliminary assay of 500 milligrams is made to determine very closely the gold and silver content. The weighed quantity of standard silver to be added to make the ratio of silver to gold in the trial assay between 2.5 and 2 to 1, can usually be judged from the color of the gold. When the gold contains no copper, 50 milligrams should be added and the same quantity used in the final assay. The function of the copper is to toughen the gold silver alloy and make possible its reduction by jewelers rolls to sheet form without cracking. The cupellation of the trial assay is with 10 grams of lead and at a temperature slightly above that which will obtain feather litharge. The button is thoroughly cleaned with a button brush, weighed and rolled into a fillet about 2 ins. long. During rolling, softening or annealing by heating to dull redness may occasionally be required to prevent cracking. The fillet is finally annealed, rolled into a "cornet" and parted in a parting flask by digestion for thirty minutes with 25 to 30 cc. of 1.16 sp.gr. acid at just under the boiling-point. The solution of silver is decanted and washed once by decantation, 25 to 30 cc. more of 1 to 2 acid are added and digestion continued for thirty minutes longer. The gold is transferred to a porcelain casserole in the manner already described, washed by decantation several times, dried and annealed. If the attempt is made to dry the gold mass on a too hot plate, particles are liable to be scattered. The weight of the gold found and that of the added silver subtracted from the weight of the bead is closely the silver content of the bullion. The silver plus the gold content subtracted from the amount of bullion taken for the trial assay gives approximately the quantity of base metal present. When copper is present in a bullion or alloy containing much base, it should be determined by separate analysis.

To two or more assay portions of 500 milligrams each are added just the amount of proof silver determined by the trial assay to make the ratio of silver to gold 2 to 1. If the base does not consist of copper such is added sufficient to make the total 10% of the gold present. One or more check portions are made containing the same amount of gold, silver and copper as are in the assay portions. Each of the check and assay portions are wrapped with exactly 10 grams of lead and cupelled under precisely the same conditions at a temperature somewhat higher than will produce feather litharge If the bullion contains copper, the same quantity is added to the check portions. The quantity of lead to be used in cupellation depends upon, but as in the assay of silver copper alloys is not in direct ratio to the quantity of copper present. The object is not to remove all the copper by cupellation, but to leave just so much as will toughen the silver gold alloy. Temperature and draft are factors which affect the elimination

of copper.

Subject to modification on account of the quantity and character of other impurity, the following table will in a general way serve as a guide to the quantity of lead to use when 500 milligrams of gold bullion are weighed out.

Lead to Use in Grams.
10 16
22
24 26
28 30

The thoroughly cleaned buttons are rolled to the same thickness and length. When cupelled with just the proper amount of copper and lead the edges will not crack. If annealed at too high a temperature the surface will blister and particles are likely

¹ See Circular No. 3, U. S. Bureau of Standards.

to fall off in parting. If the annealing is not uniform or complete, the results will not agree and the value of the check assays is vitiated. The cornets at this point may be stamped by a small die with figures or dots indicating the note-book record of the assay and check portions. Each cornet is then coiled into a roll with index mark outward and placed in a platinum capsule with perforated bottom which will fit the cornets not too loosely or tightly. The capsules set in a platinum tray which has an upright handle and rests on a platinum stand about $1\frac{1}{2}$ ins. above the bottom of a beaker.

With some experience in soldering platinum with gold and without requirement of much skill, boiling apparatus with capacity for nine tests can be laboratory made from 17 ins. of 0.06-in. wire, nine strips 13 by 31 mm. each of unperforated 0.005-in. sheets, nine circular pieces 10 mm. in diameter and one circular sheet 2 ins. in diameter of 0.005 sheet platinum perforated with 0.062-in. holes, 144 to the square inch. Each capsule is a cylinder 10 mm. in diameter, 13 mm. long, closed at the bottom with perforated metal. To the center of the bottom is soldered a \(\frac{1}{2}\)-in. length of 0.06-in. wire. This wire through a perforation holds the capsule upright as it rests on the circular sheet which is soldered to a 2-in. diameter loop in the wire; the wire should extend beyond the loop \(\frac{1}{2}\) ins. on one side and 6 ins. or more on the other. The sheet in the loop is bent at right angle to the wire and two pieces of wire each \(\frac{1}{2}\) ins. long are soldered to the loops to form a tripod. The wire extending above the frame is bent to form a handle over the side of a beaker and out of direct range of acid fumes.

Two strengths of acids are used, the first of equal parts of 1.42 sp.gr. nitric acid and water the second of 2 parts of acid to 1 of water. The 600-cc. beaker, half filled with No. 1 acid, is brought to boiling, the frame with capsules is slowly introduced to avoid boiling over, and allowed to remain ten to fifteen minutes. The frame is taken out, drained of the acid, dipped in a large beaker of hot water, and then introduced into a beaker half filled with boiling No. 2 acid. After fifteen minutes' boiling the frame is removed, dipped successively into two beakers of hot water, boiled for five to ten minutes in a third, dipped in the fourth, drained and dried by placing in an oven or on a hot plate. The contents of each capsule are removed to an annealing cup or porcelain casserole, annealed and weighed to hundredths milligrams. The actual loss or gain sustained by the check portion is added to or subtracted from the assay portions. The corrected results are calculated to parts per thousand and reported as fineness. More confidence is placed in check assays which show a loss when such loss is known to be not mechanical.

COMBINATION METHODS

The sulphuric acid method when skillfully carried out gives Copper Bullion. results for gold in blister and refined copper equal to those by the "all fire," and for silver the same as the nitric acid combination method. For each test 1 A.T. is placed in a 1000-cc. beaker of resistance glass and shaken with 5 cc. of a solution of mercuric nitrate (mercuric nitrate solution is made by dissolving 10 grams of mercury with the least quantity—about 25 cc.—of hot nitric acid, making the solution up to 1000 cc. Just sufficient nitric acid is added to keep the solution clear). 80 cc. of 1.84 sp.gr. sulphuric acid are added. Some brands of blister, especially such as contain arsenic, dissolve best when 20 or more cc. of water are also added and the quantity of mercury solution is increased. The beaker covered with a clock-glass is placed on a very hot plate, and boiled vigorously for ten minutes. The temperature is then decreased so low that the accumulation of sulphur on the sides of the beaker will remain, but not so low as to stop quite copious furning of the acid. The beaker is taken off just before the liquid becomes grayish in color. This point is determined by expert observation of the appearance of the hot solution. The temperature of the hot plate, size of the particles of copper, the quantity and character of impurities in the copper, as well as amount of sulphuric acid used are factors which influence the time required for solution. The time will vary from thirty to ninety minutes. Since the gold is in a very finely divided condition and

a little copper sulphide acts efficiently as an entangling agent, no attempt should be made to continue the treatment with sulphuric acid until the clear liquid, which will result from low silver-bearing copper, indicates complete solution of copper sulphide. Silver sulphide is also effective in preventing gold from passing through the filter, and in the assay of very high gold-bearing copper containing little silver, it is of advantage to add the silver required to carry the gold with minimum loss through cupellation to the beaker before solution rather than to the scorifier or cupel. After the beaker has become cold through standing on an asbestos mat, a little standard salt solution is added to precipitate the trace or more of silver which may be in solution. Although only a trace of silver may be dissolved it is safe to assume that 2% of that present is in solution. At least 600 cc. of boiling hot water are added a little at a time while the lumps of anhydrous salt are being broken up by a stirring rod. The liquid is filtered hot through three or four 15cm. No. 1 F Swedish filter paper folded together in a funnel (2½ to 2½ ins. in diameter) whose brim is about $\frac{1}{4}$ in. below the edge of the paper. During filtration copper sulphate must not be allowed to stretch the pores of the paper by crystallizing. Solution, therefore, should be maintained by addition of hot water to the contents of the funnel as required. The beaker is wiped very thoroughly with a piece of common filter paper. The inside of the filter is sprinkled with 15 grams test lead. The filter is folded, placed in a 2½-in. scorifier and covered with 15 grams The filter is incinerated in an oven or muffle. After adding a pinch (about 2 grams) of borax or borax silica flux, scorification is continued to production of 10- to 15-gram button.

The nitric acid method of solution of blister or other copper is resorted to when the sample is in such coarse form that the sulphuric-acid method is impracticable. The results for gold tend to be lower than those from the sulphuric-acid method, partly because of the solvent action of nitric acid, which is especially noticeable when the copper contains sclenium and partly on account of the very fine state of the liberated particles. The solvent action is hindered by alloying the copper with a considerable quantity of mercury and by dissolving with weak acid. In the assay of copper in coarse form some heat must be applied or stronger acid used to complete the solution, but when the sample is fine the heat of the reaction is sufficient.

One A.T. in a covered 1000-cc. beaker is shaken with 5 cc. of a solution of nitrate of mercury which contains 1 gram of mercury, 400 cc. (or a larger amount if the sample is fine) of water and 100 cc. of nitric acid, sp.gr. 1.42 are added. is allowed to stand overnight, and in the morning solution is completed if necessary by heating gently on a hot plate. An emulsion of lead sulphate is poured in with constant stirring until a permanent precipitate forms. Ten cc. of thick paper pulp is then stirred in and the beaker allowed to stand for an hour on a plate sufficiently hot to promote circulation of the liquid. Filtration is through two 15-cm. papers of S. & S. No. 590 quality. The beaker is wiped thoroughly after taking care to transfer to the filter every trace of the mercury flour which The inside of the paper is sprinkled with 7½ grams test lead. sometimes forms. The paper is folded and placed in a $2\frac{1}{2}$ -in. scorifier, the cup of which has been glazed with lead silicate or borate; $7\frac{1}{2}$ grams of lead are placed on the paper, which is then incinerated. To the filtrate with constant stirring is added saturated salt solution—a few drops at a time—until a permanent precipitate remains. The beaker is heated nearly to boiling and more salt solution added in the same way if the precipitate first formed dissolves. When the silver has become granular,

digestion on the hot plate is stopped and the liquid cooled to room temperature before filtering through a single 15-cm. paper close texture. When the quantity of silver is high (150 milligrams or over), the copper solution is filtered without disturbing the precipitate. The precipitate is washed quite free of copper by decantation. $7\frac{1}{2}$ grams of lead are stirred into the precipitate and allowed to remain until the appearance indicates that all the silver chloride is reduced. The contents of the beaker are then transferred to the filter. The beaker and stirring rod are thoroughly wiped with filter paper. When the quantity of silver is less than 150 mg., the inside of the paper is sprinkled with $7\frac{1}{2}$ grams of lead. The paper is folded, placed on the residue of the paper containing the product of the previous filtration, covered with $7\frac{1}{2}$ grams of lead and incinerated. Scorification when lead sulphate is present should commence at rather high temperature.

Copper Matte. The following combination method of assaying iron-copper matte gives results for gold equal to that from any of the all-fire methods. One A.T. in an 1000-cc. beaker is gently boiled with 350 cc. of a mixture of 1 part concentrated sulphuric acid and 10 parts water. Boiling is continued until but little gas is given off. The solution is then filtered through a single 15-cm. paper and the residue washed with hot water twice. The filtrate is discarded. The filter paper and its contents are placed in the beaker. Twenty cc. of a solution of mercuric nitrate containing 200 milligrams of mercury are poured over the residue and the beaker immediately shaken until all its particles are wet by the mercury. 150 cc. of water and 100 cc. of nitric acid are added and the beaker allowed to stand for at least half an hour. The liquid is then boiled until no fumes are given off. The solution is then filtered through two 15-cm. filters of No. 589 quality folded The beaker is wiped thoroughly with filter paper. The bulky precipitate, sprinkled with 20 grams lead, is placed in a 3-in. Bartlett-shaped scorifier which has been glazed with lead silicate. The folded paper is covered with 20 grams lead, incinerated, fluxed with 2 grams of borax and scorified to a 10-gram button which is reserved for addition to the scorifier containing the silver residue. Scorification should commence at a high temperature. Silver is precipitated as chloride and manipulated in the same manner as has been described in the nitric acid method for blister and refined copper. The total charge of lead in the 2½-in. scorifier containing the silver residue after addition of the button containing the gold, is 25 to 30 grams.

On account of slow filtration, slag in matte interferes with the operation of this method.

The following method of treatment of matte tends to give higher silver but lower gold results. To 1 A.T. in a 1000-cc. beaker are added cautiously at first 100 cc. strong nitric and then 50 cc. conc. sulphuric acid with beaker covered, the liquid is boiled until the sample is completely decomposed and the precipitated sulphur is yellow. When the liquid is cold, the salts are dissolved with 400 cc. hot water and the solution is filtered hot. The procedure from this point is the same as described in the nitric acid treatment of blister copper.

Silver Slime for Gold and Silver. Each assay portion of 0.1 or 0.05 A.T. is wet in a 1000-cc. resistance-glass beaker with 10 cc. of a solution of nitrate of mercury which contains 10 milligrams of mercury. Fifty cc. of 1.84 sp.gr. sulphuric acid are added and boiled for about thirty minutes. When cold, 400 cc. of hot water are added and after all salts are in solution, a solution of sodium chloride of approximately known silver precipitating strength is dropped in with constant stirring until it is evident that a slight excess has been added. The liquid is stirred

until silver chloride is coagulated. When cold, the clear liquid is decanted through a 15- cm. No. 589 paper without disturbing the precipitate. The precipitate is washed free of copper by decantation. Ten grams of 40-mesh test lead are sprinkled over the inside of the filter. Twenty grams of test lead and a few drops of a solution of sodium sulphide are mixed with the precipitate of silver chloride with a stirring rod. When it is apparent that reduction of silver is quite complete the residue is washed into the filter and the beaker thoroughly wiped with filter paper. After draining the filter is folded, placed in a 3-in. scorifier, covered with 10 grams of lead, dried and incinerated. Fluxed with a pinch (2 to 3 grams) of borax glass, scorification is continued to production of a 15- to 20-gram button. Corrected assay is made of the slag and cupel.

Removal of Interfering Metals. Inasmuch as bismuth, selenium or tellurium are not readily removed from a lead button by dry oxidation, with the object of avoiding repeated scorifications, it is expedient to remove these elements by dissolving the well-cleaned lead button with twelve times as many cc. as its weight in grams of a mixture of 1 part of strong nitric acid with 5 parts water. is filtered, the silver precipitated, reduced when high, filtered and the filters containing each of the precious metals manipulated as has been described. In the treatment of a bismuth-bearing button, the filter should be washed with acidulated water. When platinum is present in the material undergoing assay in quantity sufficient to interfere with the purity of the silver bead produced by cupellation at the usual temperature, the solution of the lead button by nitric acid is filtered through a small filter. The content of the thoroughly washed filter is treated for determination of platinum and gold by methods described in chapter on Platinum. Silver in the filtrate is precipitated as chloride and determined by the described procedures of filtration, scorification and cupellation. By this method may be conducted the assay for silver in material containing gold in excess of silver.

When the precipitate of silver chloride is colored a deep pink, indicating the presence of considerable palladium, the button resulting from its scorification is dissolved, silver again precipitated, filtered, scorified and, if the silver chloride is

not too highly colored, cupelled.1

Assay of Cobalt—Silver Ore.² ¼ or ½ A.T. portions are taken, the former when the sample carries over 2000 oz. silver per ton. Nitric acid is added a little at a time to the pulp in a covered beaker, about 75 cc. for a ½-A.T. or 100 cc. for a ½ A.T. portion. After heating on a steam bath until action has ceased, 200 cc. water are added and the solution allowed to stand (best over night) until cold before filtration. From some ores containing much arsenic, a white crystalline coating containing a little silver forms, and unless allowed to form in the original nitric acid solution will cause trouble later. If the coating cannot be detached by filter paper it is treated in the beaker with a hot solution of sodium hydrate. The alkaline liquid is acidulated with nitric acid and washed into the filter with the insoluble residue. If the insoluble residue is large in volume, it is dried, burned in a crucible and fused with litharge, borax, sodium carbonate and a reducing agent. If the residue is small, it is scorified. In either case the lead button from the residue is reserved.

Standard sodium chloride solution is added to the filtrate from the insoluble residue in quantity sufficient to precipitate all the silver, but carefully avoiding

² Smoot, Eng. and Min. J., 28, 1100, 1914.

¹ See article by A. M. Smoot, End. and Min. Jour., April 17, 1915, p. 701.

any considerable excess. The precipitate is stirred briskly until it coagulates and then is allowed to stand for an hour until the supernatant liquid becomes The precipitate is transferred to a double filter and washed slightly with Traces of silver chloride in the beaker are wiped off with filter paper and placed in the filter. The filter is transferred to a scorifier which has been glazed with molten litharge. As a further precaution against absorbing moisture, a small disk of lead is placed under the paper. The paper in the scorifier is dried and burned in a closed oven at 250 to 300° C. Fine test lead is sprinkled over the residue and the button resulting from the crucible or scorifier fusion of the insoluble residue is added. Scorification at a low temperature is conducted to production of a 15-gram button which is cupelled with care to avoid "sprouting." The influence of bismuth which cobalt ores sometimes contain is eliminated by the combination method.

CYANIDE SOLUTIONS

Inasmuch as cyanide solutions have but little greater gravity than water, 29.2 cc. is regarded as the volume equivalent of 1 A.T. The quantity taken for assay depends upon the gold or silver content; 1 A.T. of a rich solution, 50 to 100 A.T. when traces of the metals are sought; 5, 10 or 10 A.T. are the test portions most commonly employed. When gold only is to be determined, there should be in the lead button prepared for cupellation sufficient silver to permit parting of the bead resulting from the operation. Silver may be added to the button or solution in the form of metal or to the solution in the form of a standard solution of silver nitrate if the electrolytic or evaporation method is employed.

The methods of preparation of the solution for fire assay may be grouped as follows:

- (a) Evaporation.1
- (b) Metallic Reagent.2 Aluminum foil,3 cement copper,3 zinc dust, zinc lead couple formed by the addition of lead acetate to the cyanide solution and precipita-tion of spongy lead by zinc shavings, by zinc dust, by stick zinc, aluminum-lead couple.7
 - (c) Electrolutic.8
- (d) Liquid reagent, potassium ferrocyanide and cuprous chloride, copper sulphate and sodium sulphite, ferrous sulphate, oxalic acid.
 - (3) Gaseous reagent, hydrogen sulphide. 11

The evaporation method is the standard with which all other methods are compared, and on account of the requirement of little manipulation, is practiced

- All Manuals or Text Books of Assaying.
 Seamon, West. Chem. and Met., Aug., 1909, 291.
 Arents, Trans. A.I.M.E., 34, 184.
 Chiddy, Eng. and Min. J., Mar. 28, 1903, 473.
 Magenau, Min. and Sci. Press, Apr. 14, 1906, 259; Stines, Min. and Sci. Press, Apr. 28, 1906, 278; Durant, Proc. Chem. Met. and Min. Soc. of S.A., 1902-3, 105; Clark, Fulton's "Manual of Fire Assaying," 2d ed. 156.
 Bahney, Trans, A.I.M.E., 51, 131.
 Holt, Min. and Sci. Press, June 11, 1910, 863.
 Miller, J. Chem. Met. and Min. Soc. of S. A., Feb. 15, 1905, 216; Crichton, J.

 - Miller, J. Chem. Met. and Min. Soc. of S. A., Feb. 15, 1905, 216; Crichton, J.
- Chem. Met. and Min. Soc. of S. A., 1911-12, 90.

 White, J. Chem. Met. and Min. Soc. of S. A., Oct., 1909, 136.

 Whitby, Proc. Chem. Met. and Min. Soc. of S. A., 1902-3, 15.

 - ¹¹ Watson, Eng. and Min. J., Mar. 28, 1911, 443.

with considerable variety of detail in laboratories which make a large number of assays. From a 6- by 4-in. strip of assayers' sheet lead, a flat-bottom dish 4 by 2 by 1 in. deep can be made, which will weigh 30 to 40 grams and hold 3 A.T. A test portion of this or a larger amount of cyanide solution introduced from time to time is evaporated to dryness. To avoid spattering the heat of the hot plate is reduced toward the last of the operation. The dish is folded carefully and scorified to a 15- to 20-gram button in a 3-in. scorifier. A 10 or 20 A.T. test portion may be evaporated to small volume in an evaporating dish or casserole, and then to dryness in a lead dish. When it is the practice to complete the evaporation in porcelain or earthen ware, 50 to 60 grams of litharge are added with the object of facilitating removal of the residue. The residue, which should not be heated so strongly as to make a hard cake, is removed with a spatula and intimately mixed with a charge 1 consisting of 25 grams litharge, 15 grams sodium carbonate. 2 grams fine silica, 5 grams borax glass and 2 grams argol. Fusion is made in a 20-gram crucible. When the scorification method of fusion is preferred, 10 grams of granulated lead are added to the solution instead of litharge, the residue transferred to a 2-in. scorifier, covered with 15 grams test lead and a pinch of borax glass and scorified to a 15- to 20-gram button. Whether litharge or lead is used. the dish should be wiped thoroughly with moist filter paper which is placed in the bottom of the crucible or retained in place in the scorifier by the 15 grams of test lead.

Of the metallic reagent methods, the zinc-lead couple is most commonly practiced. The details of manipulation vary with different operators. The following method combines the features of Clark's ² and Bahney's.² To the test portion of cyanide solution in a beaker of capacity several hundred cc. in excess of its liquid content, are added 25 cc. of a 20% solution of lead acetate. From a bottle having a ½-in. glass tube through the stopper and holding silver-free zinc dust and water in the proportion of 1 gram in 3 cc., the equivalent of 4 grams of dust is shaken out into a suitable graduate and added to the cyanide liquor. When moderately heated, but before boiling, a volume of 1.18 to 1.19 S.G. C.P. hydrochloric acid equal to 10% of the cyanide solution is added. The mixture is then boiled not too vigorously until the spongy lead aggregates (five to ten minutes).

Since some zinc may remain undissolved in the mass above the surface of the liquid, after removal of the beaker from the hot plate, the precipitate is collected and confined below the surface by an overturned funnel which has a diameter 1 in. less than the diameter of the beaker and whose constricted throat is sealed with a small ball of barren lead sponge. After standing hot for five to ten minutes the funnel is removed and washed free of adherent particles. The beaker is then filled up with cold water. From a circular piece of assayers' sheet lead 3 ins. in diameter and weighing 7 to 9 grams a filter cone is made by pricking a dozen fine holes through and about the apex. This cone is fitted to a 2-in. funnel in a filter flask which is connected to aspirating apparatus. A layer of 5 grams of test lead, finer than 60 mesh, is shaped over the perforated portion of the cone. The clear liquid is decanted as completely as is practicable without loss of precipitate. The beaker is again filled with cold water and decanted. A portion of the sponge is drawn with the flattened end of a glass rod onto the filter cone and tamped into

³ Trans. A.I.M.E., 51, 129.

¹ Fulton, "Manual of Fire Assaying," 2d ed., 157. ² Fulton's "Manual of Fire Assaying," 2d ed., 156.

place. After complete removal of the precipitate to the cone, it is washed several times and then dewatered by tamping with the rod. The edges of the filter cone are folded tightly over the precipitate to form a cone-shaped button which will fit a 1½-in. cupel. The button is placed in a hot cupel which is brought to the front of the muffle and allowed to remain there no longer than is sufficient to expel moisture. A piece of glowing charcoal placed in front of the cupel will help to clear the lead shortly after the muffle door is closed, if the muffle has been kept at the temperature which prevails in the usual practice of starting cupellation.

If suspended matter insoluble in hydrochloric acid or considerable copper is present in the solution, cupellation without previous scorification is impracticable, the other details of the method, however, may be carried out as described. In such cases the lead button is placed in a 2-in. scorifier, 10 grams of test lead and borax flux are added and scorification continued to production of a 10- to 15-gram button. In case much copper is present, it may be necessary to rescorify with addition of more lead.

By the electrolytic method,¹ gold is deposited on a cylinder of assay lead foil which fits closely the inside and rests on the bottom of the beaker. The lower edge of the foil is serrated to promote circulation. The anode is a ¼-in. carbon rod. The current is adjusted to the KCN strength of the solution; 0.1 amp. for a 0.3% to 0.04 amp. for a 0.02% solution. To avoid plating out on the anode, care is taken to have the current on all the time it is in contact with the solution. A little cyanide added to a weak solution facilitates the deposition of gold; and ammonium hydrate is added when the solution is impure. When deposition is complete (four hours), the lead foil is washed, dried, folded into a button and cupelled.

Christy's liquid reagent method, as modified by Whitby and described by Clennell, is based on the fact that when a copper salt together with a reducing agent is added to an acidulated cyanide solution, a precipitate of cuprous cyanide is formed which precipitates silver and all but a trace of gold. To 10 A.T. are stirred in successively 20 cc. 10% solution of blue vitriol, 20 cc. 15% solution of sodium sulphite and 10 cc. 10% sulphuric acid. Addition of a little ferrocyanide of potassium hastens settling. The mixture is stirred thoroughly, allowed to settle for fifteen minutes, filtered and the filtrate refiltered until clear. When drained the precipitate is covered with a mixture of 30 grams litharge, 30 grams borax glass and 1 gram charcoal. The paper and contents are placed in a hot E or F crucible and the operations of fusion and cupellation carried out.

¹ Crichton, J. Chem. Met. and Min. Soc. of S. A., 1911-12, 90. ² Cyanide Hand Book, 443.

Summary. General Outline.

An assay ton (A.T.) or multiple is taken, of the 80-200-mesh ore or 20-mesh shavings of metals and is heated with a flux of lead oxide, a suitable slag forming material and a reducing or oxidizing reagent as the case requires, (see preliminary assay below), in order to obtain by reduction about 18 g. of lead from the lead oxide. The molten lead alloys with the silver and gold (and copper) and sinks to the bottom of the melt. The charge is cooled and the slag hammered off the lead and the button or cube of lead is heated on a bone ash cupel in presence of air. The bone ash absorbs the oxides of lead (and copper) leaving the precious metals in the form of a bead. As the last trace of lead is removed a play of colors is seen with a final flash of light as the alloy of silver and gold appears ("blick"). The combined gold and silver button is weighed, the silver now dissolved (parting) from the gold and the residual gold weighed. The difference between the first and second weight is due to silver.

Preliminary Assay. This is to ascertain the nature of the material as neutral, oxidizing or reducing products require different treatment. Usually one-sixth of the charge of ore is taken with the regular charge of flux, without a reducing or oxidizing agent. A typical example of a charge is one-sixth A.T. of ore, 100 g. litharge, 20 g. sodium bicarbonate and 5 g. borax. Using this charge the following cases will illustrate the method of interpretation.

A. Reducing Ores. Suppose a 2 g. Pb button is obtained. This is equivalent to $2 \times 6 = 12$ g. on a customary charge of 1 A.T. of ore. Additional reducing agent is necessary to get the 18 g. Pb desired. 1 g. charcoal reduces about 30 g. Pb, hence $(18 - 12) \div 30 = 0.2$ g. charcoal required.

On the other hand suppose a 4 g. Pb button results, equivalent to 24 g. with full charge of ore. It is necessary to add an oxidizing agent to counteract the reducing action of the ore to the extent of 24 - 16 = 6 g. Pb excess. 1 g. NaNO₃ oxidizes 4 g. Pb. Therefore $6 \div 4 = 1.5$ g. NaNO₃ is required.

B. Neutral and Oxidizing Ores. In this case no lead is reduced. A second run must be made with say 1 gram of charcoal (30 g. Pb equivalent). If 30 g. Pb results the ore is neutral and $18 \div 30 = 0.6$ g. charcoal is required.

On the other hand suppose 28 g. Pb results, then the ore is an oxidizer and 1 A.T. of the ore will oxidize $2 \times 6 = 12$ g. Pb. To counteract this 12 + 30 = 0.4 g. charcoal is necessary and $18 \div 30 = 0.6$ g. charcoal to reduce 18 g. Pb, making a total of 0.4 + 0.6 = 1 g. charcoal required.

Precaution. All reagents used should be tested by regular assay.

A 20-25 gram button of lead is generally required in the assay of ores high in silver.

Solution Assay. Place 10 assay tons of the solution in a 1000 cc. beaker. Add about 30 cc. of a 20% lead acetate solution (the amount being governed by the strength of the solution). Dilute to about twice the volume and heat. Add about 5 grams of zinc shavings, heat until solution clears. Add 30-40 cc. HCl. When clear, decant off solution, wash the lead and squeeze into a button. Assay the button.

STRONTIUM

WILFRED W. SCOTT

Sr", at.wt. 87.63; sp.gr. 2.54; m.p. 900°C; oxides SrO and SrO₂.

DETECTION

Strontium is precipitated with barium and calcium, in the filtrate, from the ammonium sulphide group, by addition of ammonium carbonate to the ammoniacal solution. The precipitate is dissolved in acetic acid and treated with potastassium dichromate, and the barium filtered off as BaCrO₄. Strontium and calcium in the filtrate are separated from the excess of potassium chromate by reprecipitation as carbonates by the addition of ammonium carbonate, the precipitate again dissolved in acetic acid and the excess of free acid neutralized with ammonia. Strontium may now be precipitated from the concentrated solution by boiling with an equal volume of a saturated solution of calcium sulphate.

Sodium Sulphate Test. A saturated solution of the salt added to a solution containing strontium chloride, made strongly acid with acetic acid, and the mixture boiled, will produce a distinct precipitate if strontium exceeds 0.0015 normal. Calcium does not precipitate until 1.3 normality is reached.¹

Flame Test. Strontium, preferably in the form of the chloride in a hydrochloric acid solution, placed on a platinum loop and held in a colorless flame, colors the flame crimson. (Lithium gives a red color, calcium a yellowish-red.) The test is best confirmed by means of the spectroscope.

The Spectra of Strontium. Eight bright bands; 6 are red, 1 orange, 1 blue. Two of these, known as strontium β and γ , are red, the orange is strontium α and the blue strontium δ . The delicacy of the test is 0.6 milligram Sr per cc. The test is very much more delicate with the arc spectra, e.g., 0.03 milligram Sr per cc. See chapter on barium. Preliminary Tests under Separations.

ESTIMATION

Strontium never occurs free in nature. It is found principally in the ores celestine, SrSO₄, and strontianite, SrCO₂. It generally accompanies calcium in the various forms of calcite and aragonite. It occurs with barium in bary-tocelestine, and is found in barytes. It also occurs associated with barium as a silicate in brewsterite, Al₂O₂·H₄(BaSr)O₂·(SiO₂)₆·3H₂O. It is found in traces in certain mineral waters and in sea-water.

The compounds of strontium are used for medicinal purposes; for red fire in pyrotechnics; for the manufacture of iridescent glass; the dioxide for bleaching purposes; the sulphide for luminous paint; the hydroxide for refining of beet-root sugar, being preferable to lime, as the saccharate of strontia is more granular.

Preparation and Solution of the Sample

The following facts regarding solubility may be of value in the determination of strontium. 100 cc. of water dissolves 1.74 grams Sr(OH)₂·H₂O at 20° C. The hydroxide is less soluble than that of barium. The peroxide dissolves to the extent of only 0.008 gram per 100 cc. 20° C. One hundred cc. of water dissolves 0.0011 gram ¹ SrCO₂ (18°); 0.0114 gram SrSO₄ at 18° and 0.0104 at 100°; the presence of sulphuric acid decreases this solubility, i.e., 0.00083 gram SrSO₄; 0.0051 gram SrC₂O₄·H₂O at 18° and 5 grams at 100° C.; the presence of oxalic acid decreases this solubility. The sulphate dissolves in concentrated sulphuric acid, and is appreciably soluble in HCl, HNO₃, HC₂H₃O₂, NH₄Cl, NH₄NO₃, NaCl, MgCl₂. The carbonate and oxalate are soluble in mineral acids.

The procedure for the treatment of ores and strontium products is the same as those described for barium and calcium. We refer to the chapters on these elements for the preparation of the strontium solution.

SEPARATIONS

Separation of Strontium from Magnesium and the Alkalies. The procedure is the same as the one given in detail under barium for the separation of the alkaline earths from magnesium and the alkalies. Either the oxalic acid method or precipitation of strontium as a sulphate in presence of alcohol will accomplish this separation. If a sulphate precipitation is made it will be necessary to fuse the sulphate with sodium carbonate to get it into solution or to effect further separation from members of the ammonium carbonate group, should these be present.

Separation of Strontium from Calcium.² Strontium and calcium are converted into the nitrates and taken to dryness and all water expelled by heating to 140° C. for an hour or more. The nitrates are now extracted with equal parts of absolute alcohol and anhydrous ether or by boiling with amyl alcohol at 130° C. (hood). Strontium remains insoluble and calcium goes into solution as the nitrate. Strontium nitrate may require further solution in water, evaporation to dryness, heating and extraction to remove calcium completely, should this be present in large excess. The nitrate of strontium is dissolved in water and strontium determined by one of the procedures given later. See detailed procedure for separation under Barium.

Separation of Strontium from Barium. The procedure is given in detail under chapter on Barium. In brief one of the following methods may be used: Strontium and barium in a mixture of the nitrates are separated from calcium by treatment with ether-alcohol mixture, in which Ba(NO₃)₂ and Sr(NO₃)₂ are insoluble. The nitrates dissolved in water are separated by precipitating barium as BaCrO₄ from a faintly acetic acid solution, strontium remaining in solution.

If preferred, barium may be first removed as a chromate, strontium and calcium precipitated from an ammoniacal solution by $(NH_4)_2CO_2$ as carbonates, the carbonates converted to nitrates and $Sr(NO_3)_2$ separated from Ca(NO₃) in an ether-alcohol solution or by amyl alcohol. Details of the separations are given under Barium.

¹Treadwell claims solubility = 0.00055, i.e., 1 part SrCO₂ in 18,045 parts of water.

² Advantage may be taken of the insolubility of strontium sulphate in ammonium sulphate in separating it from the soluble calcium salt.

1

STRONTIUM

WILFRED W. SCOTT

Sr", at.wt. 87.63; sp.gr. 2.54; m.p. 900° C; oxides SrO and SrO₂.

DETECTION

Strontium is precipitated with barium and calcium, in the filtrate, from the ammonium sulphide group, by addition of ammonium carbonate to the ammoniacal solution. The precipitate is dissolved in acetic acid and treated with potastassium dichromate, and the barium filtered off as BaCrO₄. Strontium and calcium in the filtrate are separated from the excess of potassium chromate by reprecipitation as carbonates by the addition of ammonium carbonate, the precipitate again dissolved in acetic acid and the excess of free acid neutralized with ammonia. Strontium may now be precipitated from the concentrated solution by boiling with an equal volume of a saturated solution of calcium sulphate.

Sodium Sulphate Test. A saturated solution of the salt added to a solution containing strontium chloride, made strongly acid with acetic acid, and the mixture boiled, will produce a distinct precipitate if strontium exceeds 0.0015 normal. Calcium does not precipitate until 1.3 normality is reached.¹

Flame Test. Strontium, preferably in the form of the chloride in a hydrochloric acid solution, placed on a platinum loop and held in a colorless flame, colors the flame crimson. (Lithium gives a red color, calcium a yellowish-red.) The test is best confirmed by means of the spectroscope.

The Spectra of Strontium. Eight bright bands; 6 are red, 1 orange, 1 blue. Two of these, known as strontium β and γ , are red, the orange is strontium α and the blue strontium δ . The delicacy of the test is 0.6 milligram Sr per cc. The test is very much more delicate with the arc spectra, e.g., 0.03 milligram Sr per cc. See chapter on barium, Preliminary Tests under Separations.

ESTIMATION

Strontium never occurs free in nature. It is found principally in the ores celestine, SrSO₄, and strontianite, SrCO₃. It generally accompanies calcium in the various forms of calcite and aragonite. It occurs with barium in bary-tocelestine, and is found in barytes. It also occurs associated with barium as a silicate in brewsterite, Al₂O₃·H₄(BaSr)O₂·(SiO₂)₆·3H₂O. It is found in traces in certain mineral waters and in sea-water.

The compounds of strontium are used for medicinal purposes; for red fire in pyrotechnics; for the manufacture of iridescent glass; the dioxide for bleaching purposes; the sulphide for luminous paint; the hydroxide for refining of beetrecot sugar, being preferable to lime, as the saccharate of strontia is more granular.

Titration of the Chloride with Silver Nitrate

Strontium chloride, free from other chlorides, may be determined indirectly by titration of its combined chlorine with silver nitrate by Mohr's method, using potassium chromate indicator. One cc. N. AgNO₃=0.04381 gram Sr.

potassium chromate indicator. One cc. N. AgNO₃ = 0.04381 gram Sr.

The oxide or carbonate is slightly supersaturated with hydrochloric, then taken to dryness and heated at 120° C. in the air bath to expel the excess of acid. Chlorine is determined on an aliquot portion.

SULPHUR

WILFRED W. SCOTT

S, at.wt. 32.07; sp.gr. 2.035; m.p. 111°; b.p. 444.53°; oxides S₂O₁, SO₂, SO₃, S₂O₇; principal acids H₂S₂O₄, H₂SO₃, H₂SO₄, H₂S₂O₄, and H₃S₂O'4.

DETECTION

The following tests include the detection of free sulphur and its more important combined forms.

Element. Sulphur is a polymorphous, yellow, brittle, odorless and tasteless solid; existing in the rhombic, monoclinic and triclinic crystalline forms, and also in an amorphous state. At 111° it melts to a pale yellow liquid; at 180° it thickens to a dark gum-like material, containing a large percentage of amorphous sulphur; at 260° it becomes a liquid again, and at 444.53° it boils, giving off a brownish-red vapor.

Heated in the air sulphur burns with a blue flame, and is oxidized to SO₂, a gas with a characteristic pungent odor. This gas passed into a solution of potassium permanganate will decolorize it, if SO₂ is in excess of the amount that will react with the KMnO₄ in the solution.

If sulphur is dissolved in a hot alkali solution and a drop of this then placed on a silver coin, a stain of black Ag₂S will be evident, due to the action of the sulphur.

Sulphides. Hydrogen sulphide, H_2S , is liberated when a sulphide is treated with a mineral acid. This gas blackens moist lead acetate paper. H_2S has a very disagreeable odor, which is characteristic.

Sulphates. A white compound, BaSO,, is precipitated in presence of free hydrochloric acid when a solution of barium chloride is added to a solution of a sulphate.

Insoluble sulphates are decomposed by boiling or fusion with alkali carbonates, forming water-soluble alkali sulphates.

Sulphites. Sulphur dioxide, SO₂, is evolved when a sulphite is treated with hydrochloric acid. The odor of the gas is characteristic.

Sulphur dioxide decolorizes a solution of potassium permanganate. (Use very dilute solution.)

Sulphites are distinguished from sulphates by their failure to form a white precipitate, when barium chloride is added to the solution acidified with hydrochloric acid; also by the fact that H₂S is formed when zinc is added to a solution of a sulphite, acidified by hydrochloric acid.

Thiosulphates. Sulphur dioxide is evolved and free sulphur precipitated when a thiosulphate is acidified with dilute mineral acids. In presence of oxidizing agents sulphides will also liberate free sulphur.

Thiosulphates are strong reducing agents.

 1 U. S. Bureau of Standards gives the following melting-points: $S_1=112.8^\circ$, $S_2=119.2$, $S_3=106.8$. Circular 35 (2d Ed.).

493

ESTIMATION

The determination of sulphur may be required in a great variety of substances, minerals, rocks, sulphur ores, acids, salts, water, gas, coal and other organic matter.

The substance occurs in nature principally in the following forms:

Element. Found free, generally mixed with earthy matter. The commercial product is exceedingly pure and may contain over 99.5% S.

Sulphur Dioxide. The gas, together with free sulphur, is found in volcanic regions.

Hydrogen Sulphide. Occurs in mineral waters and in the air, from decaying organic matter.

Sulphide Ores. Iron pyrite, FeS₂ (30 to 50% S); ferro ferric sulphide, Fe₂O₃·5FeS; pyrrhotite, Fe₇S₃; copper pyrites, CuFeS₂; realgar, As₂S₃; orpiment, As₂S₃; galena, PbS; cinnabar, HgS; zinc blende, ZnS.

Sulphate Ores. Gypsum, CaSO₄·2H₂O, very abundant; barytes, or heavy spar, BaSO₄; celestite, SrSO₄; kieserite, MgSO₄·H₂O; bitter spar or Epsom salts, MgSO₄·7H₂O; Glauber salt, Na₂SO₄·10H₂O; sulphates of alkalies in animal and plant fluids.

The gravimetric determination of sulphur, by procedures of technical importance, depends upon its precipitation as barium sulphate, BaSO₄, after converting it into sulphuric acid, or a soluble sulphate, if not already in this form. Oxidation of free sulphur, sulphides, sulphites, metabisulphites, thiosulphates may be accomplished by either dry or by wet methods, details of which are given under subsequent procedures. When present as a sulphide, or having been converted to this form, the substance may be evolved as hydrogen sulphide, the gas absorbed by a suitable agent, and after oxidation it may be determined by precipitation as BaSO₄ and thus weighed.

The volumetric methods of determining sulphur depend upon titration with oxidizing agents, or by acids, or by alkalies, according to the form of the sulphur compound, or by means of a substance forming an insoluble compound with sulphuric acid. For example sulphides are treated with a strong mineral acid (HCl), the evolved H₂S absorbed in a suitable reagent, and the sulphide formed is titrated with standard iodine. Sulphites may be determined either by oxidation with iodine or by titration with an acid in presence of methyl orange. Acid sulphites or metabisulphites may be determined by the iodine titration or by titration with an alkali in presence of phenolphthalein. Thiosulphates are titrated with iodine. Soluble sulphates may be titrated with standard barium chloride or chromate, added in slight excess, and the excess estimated by titration.

Standard procedures are given, covering the more important forms which commonly concern the analyst.

Preparation and Solution of the Sample

In the preparation of the sample the following facts regarding solubility of sulphur and its combination should be kept in mind.

Element. The crystalline forms are soluble in CS₂, the monoclinic form is soluble also in alcohol, chloroform and benzol. Yellow amorphous and plastic sulphur are insoluble in CS₂. Sulphur precipitated by the action of HCl

upon $(NH_4)_*S_x$ is soluble in benzol. The element is soluble in hot hydrates of sodium, potassium, barium and calcium, forming polysulphides and thiosulphates.

Sulphide. Sulphides of Na, K, Cs, Rb, Ca, Sr, Ba, Mg, Mn, Fe are soluble in dilute mineral acids. The sulphides of Ag, Hg, Pb, Cu, Bi, Cd, Co, Ni require strong acids for decomposition. These are also insoluble in sodium hydroxide and potassium hydroxide solutions. As, Sb and Sn sulphides are insoluble in dilute acids, but soluble in alkalies.

Sulphate. With exception of BaSO₄, CaSO₄, SrSO₄ and PbSO₄, sulphates are soluble in water.

Thiosulphate. Nearly all are soluble in water.

Sulphite. With exception of the sulphites of the alkalies, sulphites of the metals are difficultly soluble in water, but readily decomposed by acids.

Decomposition of Sulphur Ores

The wet procedure for oxidation and decomposition of sulphur ores is given in detail under the Gravimetric Methods, page 498. This process is used for the valuation of the ore, and is applicable to a wide range of substances.

Fusion Method. One gram of the finely ground ore (80 mesh) is intimately mixed with 6 grams of zinc oxide-sodium carbonate mixture (2 parts ZnO+1 part Na₂CO₂), placing 2 grams more of the mixture over the charge. The material is fused and sulphur extracted according to the procedure described for coal—Eschka's method.

Sulphur in Coal, Eschka's Method

One gram of coal is intimately mixed with 3 grams of Eschka's compound, consisting of 2 parts of porous, calcined magnesia and 1 part of anhydrous sodium carbonate. The mixture, placed in a platinum crucible, is covered with about 2 grams more of Eschka's compound. The charge is placed in an open platinum crucible, which is protected from the flame by a shield, as shown in Fig. 65. If possible, a sulphur-free flame should be used to avoid contaminating the material. With proper precautions, the shield will prevent this. Heating in a crucible electric furnace completely avoids sulphur contamination. The mixture is heated very gradually, to drive off the volatile matter, the charge being stirred frequently with a platinum wire to allow free access of air. The heat is increased, after half an hour, to a dull redness. When the carbon has burned out, the gray color having changed to a yellow or light brown, the heat is removed and the crucible cooled.

The powdered fusion is digested with 100 cc. of hot water for half an hour, and the clear liquor decanted through a filter into a beaker. The residue is washed twice more with hot water, by decantation, and finally on the filter, until the volume of the total filtrate amounts to about 200 cc. About 5 cc. of bromine and a little hydrochloric acid are added, and the solution boiled. Sulphuric acid is now precipitated as BaSO₄ by addition of barium chloride to the hot solution, and sulphur determined by the first of the gravimetric procedures.

Sulphur in Rocks, Silicates, and Insoluble Sulphates

The material in finely powdered form is fused in a large platinum crucible with about six times its weight of sodium carbonate (sulphur free) mixed with about 0.5 gram of potassium nitrate. The charge is protected from the flame

by an asbestos board or silica plate with an opening to accommodate the crucible snugly, as shown in Fig. 65. The fusion is extracted with water, the filtrate evaporated to dryness and silica dehydrated. The residue is moistened with strong hydrochloric acid, then taken up with a little water, boiled free of CO₂, and silica filtered off. The filtrate contains the sulphate, which is now precipitated as barium sulphate according to one of the standard procedures.

Barium Sulphate. This is transposed by fusion with sodium carbonate, as stated above. Barium carbonate remains in the water-insoluble residue. It is advisable to wash the residue in this case with hot sodium carbonate solution, to insure complete removal of the sodium sulphate. The filtrate is acidified with HCl, boiled free of CO₂ and BaSO₄, then precipitated.

Lead Sulphate. This may be transposed by digesting the compound with a strong solution of sodium carbonate saturated with CO₂, keeping the solution at boiling temperature for half an hour or more. The sulphate will be in solution and the lead is precipitated as the water-insoluble carbonate.

Strontium or calcium sulphates may be transposed by the procedure described for lead.

SEPARATIONS

Substances Containing Iron

In precipitating barium sulphate, in presence of ferric salts, from hot solutions by the gravimetric procedure commonly followed, considerable iron is carried down by the precipitate. Since Fe₂(SO₄), loses SO₃ upon ignition, and since Fe₂O₃ weighs much less than BaSO₄, low results will be obtained. Hence the removal of iron is necessary, or a method should be followed in which iron does not interfere. It is found that barium sulphate precipitated from a large volume of cold solution, in which the iron has been reduced to ferrous condition, is free from iron. Details of this procedure are given in the second of the gravimetric methods, page 498.

If sulphur is to be precipitated from hot solution of comparatively small volume (200 to 400 cc.), it is necessary to remove iron. This is accomplished by precipitating this as Fe(OH)₁ by addition of ammonium hydroxide in decided excess (5 to 10 cc. excess of strong NH₄OH, sp.gr. 0.90). If the solution is barely neutralized with ammonia, the iron hydroxide carries down considerable of the sulphate. Even with the precaution recommended some of the combined sulphuric acid is occluded by the precipitate, so that it is necessary to recover this by dissolving the precipitate with hydrochloric acid and reprecipitating the ferric hydroxide with an excess of ammonia. The combined filtrates are now treated with barium chloride, upon acidification with hydrochloric acid, according to the procedure first given, page 497, and the sulphate determined.

Separation of Sulphur from Metals Forming an Insoluble Sulphate

This is accomplished by fusion of the compound with sodium carbonate and extraction of the mass with water. The metal remains with the residue and the sulphate of the alkali passes into solution. For details see subject under Preparation and Solution of the Sample, page 494.

Nitrates and Chlorates. These are carried down with the precipitate as barium salts if they are present in appreciable amount. They may be removed from the solution by evaporation to dryness with hydrochloric acid.

Silica. Silica will be carried down with the barium sulphate precipitate if present in appreciable amounts. It is removed by evaporation of the solution with hydrochloric acid, dehydrating the silicic acid, taking up with HCl and water and filtering.

Ammonium and Alkali Salts. These have a negligible effect on the precipitate of BaSO₄ if this is precipitated from a large volume, according to the second gravimetric procedure.

GRAVIMETRIC DETERMINATION OF SULPHUR Precipitation as Barium Sulphate

Preliminary Remarks. The procedure depends upon the insolubility of barium sulphate, BaSO4, in neutral or slightly acid solutions. It was formerly the general practice to precipitate the sulphur by adding a 10% barium chloride solution to the hot sulphate solution, which had been diluted from 200 to 400 cc., according to the amount of sulphur that was present (not over 0.2 gram sulphur per 100 cc.), containing 1 to 3 cc. of free concentrated hydrochloric acid per 100 cc. of solution. Special precautions were given to have the solution boiling hot, and to avoid having a volume of over 400 cc., a smaller sample being taken in high sulphur ores, rather than increase the volume. Extended experiments have shown that it is preferable to precipitate the sulphate from a large volume of cold solution. The product obtained is less apt to occlude impurities, the crystals are larger than those obtained in hot concentrated solutions, and do not pass through the filter. Precipitation may be made in presence of large amounts of iron, copper and other impurities. The procedure requires large beakers of 2- to 2½-liter capacity. special precipitating cups, and a suction apparatus, as shown in Figs. 60, 61, 62 and 63. This apparatus may not always be available, and occasionally it is advantageous to precipitate the sulphur in a small volume, specially when the sulphur content of the material is low, hence, although the second procedure is generally recommended, the older method is also included.

I. Precipitation of Barium Sulphate from Hot_Solutions

Procedure. The sulphur should be present in solution either as free sulphuric acid or as a sulphate salt. The solution is made acid by addition of hydrochloric acid (phenolphthalein indicator), and then 4 cc. added in excess (HCl, sp.gr. 1.2). After diluting to a volume of 400 cc. with hot water, the mixture is heated to boiling, and a 10% solution of barium chloride added in a fine stream, through a funnel with a capillary stem, or from a burette, at the rate of 10 cc. in two to ten minutes. The reagent is added in slight excess of that required to react with the sulphuric acid or sulphate. (Ten cc. of 10% BaCl₂.2H₂O solution will precipitate about 0.13 g. of sulphur.) The beaker is placed on a steam bath and the pre-

¹ E. Hints and H. Weber recommend adding 100 cc. of N/10 BaCl₂ solution, boiling hot, to the hot sulphate solution all at once in place of slowly, as recommended in general practice. (See Treadwell and Hall, "Analytical Chemistry," 2, 3d Edition, p. 469.)

cipitate allowed to settle for about two hours. The solution is filtered through a fine grade of filter paper (B. & A. grade A, or S. & S. grade No. 90), or through a tared Gooch crucible. Since the precipitate frequently passes through the filter it is advisable always to pass the solution through the same filter a second time. The precipitate is washed ten times with hot water, then dried, and ignited gently over a Bunsen burner, or in a muffle, for half an hour. (Blasting is not necessary, nor desirable.) The white BaSO₄ is cooled in a desiccator, and then weighed. If a filter paper has been used in place of a Gooch crucible, the ignition is best made in a porcelain crucible, with free access of air, the ignited sulphate, upon cooling, is brushed out of the crucible and so weighed.

Factors. BaSO₄×0.1373 = S, or $\times 0.4202 = H_2SO_4$, or $\times 0.3766 = FeS$, or $\times 0.2744 = SO_2$, or $0.3430 = SO_3$, or $\times 0.4115 = SO_4$.

Note. If much iron or alumina is present it is advisable to precipitate the sulphate from a large volume, by the second method, rather than attempt to remove these substances. If BaSO₄ is present in the original material its weight should be included with that of the precipitate.

II. Precipitation of Barium Sulphate from Cold Solutions— Large Volume

Introduction. The method worked out by Allen and Bishop, General Chemical Company, is especially adapted to the determination of sulphur in iron pyrites and materials high in sulphur, 30 to 50% sulphur, but by varying the amount of material used the range may be extended from smaller to greater amounts. The finely ground sample is oxidized by means of a mixture of bromine and potassium bromide, followed by nitric acid. The nitric acid is expelled by evaporation to dryness, followed by a second evaporation with hydrochloric acid, which dehydrates the silica. Iron is now reduced to the ferrous condition and the silica and residue, undissolved by addition of hot water and HCl, is filtered off. The sulphur is precipitated in a large volume of cold solution, by barium chloride solution, as BaSO₄ and so weighed.

Reagents. Bromine—Potassium Bromide Solution. 320 grams of potassium bromide are dissolved in just sufficient water to cause solution and mixed with 200 cc. of bromine, the bromine being poured into the saturated bromide solution. After mixing well the solution is diluted to 2000 cc.

Bromine—Carbon Tetrachloride Solution. Carbon tetrachloride saturated with bromine.

Barium Chloride, anhydrous, 5% solution; or crystals, 6% solution.

Procedure. Preparation of Sample. The sample ground to pass 80-mesh sieve is carefully mixed and quartered down to 10 grams. This is dried for one hour at 100° C. and then placed in a weighing tube.


A factor weight, 1.373 grams of the sample, is placed in a deep beaker, 300 cc. capacity, $2\frac{1}{2}$ by $4\frac{1}{2}$ ins.

Oxidation of Sulphur. Ten cc. of the bromine-potassium bromide mixture for pyrrhotite ore, or bromine—earbon tetrachloride reagent for pyrites ores, are added and the beaker covered with a dry watch-glass cover. After standing

¹ Paper before Eighth International Congress of Applied Chemistry: "An Exact Method for the Determination of Sulphur in Pyrites Ores," W. S. Allen and H. B. Bishop.

fifteen minutes in the cold bath (a casserole of water will do), with occasional shaking of the beaker, 15 cc. of strong nitric acid are added and the mixture


allowed to stand fifteen minutes longer, at room temperature, and then warmed on an asbestos board on the steam bath until the reaction has apparently ceased and the bromine has been volatilized. The beaker is now placed within the ring of the steam bath so that the lower portion is exposed to steam heat. The solution is evaporated to dryness, the cover of the beaker being raised above the rim by means of riders (U-shaped glass rods), Fig. 60, 10 cc. of strong hydro-

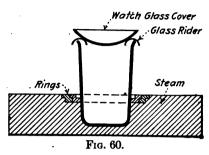

chloric acid are now added and the solution again evaporated to dryness to expel the nitric acid. The silica is dehydrated by heating in the air oven at 100° C. for one hour, or overnight if preferred.

Reduction of Iron. Four cc. of hydrochloric acid (sp.gr. 1.20), followed five minutes later by 100 cc. of hot water, are added, the sides of the beaker and the cover being rinsed into the solution. The riders being removed, the sample is gently boiled for five minutes to insure the solution of the sulphate. After cooling for about five minutes, approximately 0.2 gram powdered aluminum is stirred into the solution, keeping covered during the intervals between stirring. When the iron has been reduced, the solution becoming colorless, the sample is filtered into a 2500-cc. beaker, through a 12½ cm. filter paper (S. & S. No. 590 or B. & A. No. A). The beaker should be copped out and the residue on the filter washed nine times with hot water, filling the filter funnel and draining each time.

Precipitation of the Sulphur. The solution in the large beaker is diluted to 1600 cc. with cold water and 6 cc. HCl (sp.gr. 1.20) added, and mixed by

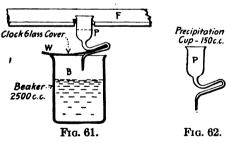

Apparatus for Precipitating Sulphur.

stirring. The barium chloride solution is now added by means of a special delivering cup (Figs. 61 and 62), which should drain at the rate of 5 cc. per minute. 125 cc. of barium chloride solution are added for ores containing 30 to 50% sulphur, the factor weight being taken. The solution is not stirred while the barium chloride is being added, but when the cup has drained, the solution is mixed by stirring. The BaSO₄ is allowed to settle, two or

three hours being advisable, overnight being preferred.

Filtration. The clear solution is filtered through a weighed Gooch crucible (35 cc.), using suction. This is best done by the automatic arrangement shown in Fig. 63. The beaker containing the solution is placed on a shelf; a siphon dipping to within half an inch of the precipitate at the bottom of the beaker is connected to the Gooch crucible by means of a tightly fitting stopper. The Gooch and thistle tube are best connected by heavy rubber tubing. The

suction flask, or bottle, should have a capacity of about 3 liters. A Geissler stop-cock passes through the rubber stopper in the suction flask to relieve the

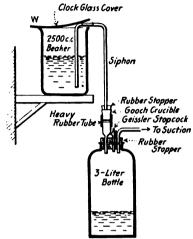


Fig. 63.—Apparatus for Filtering Barium Sulphate.

pressure when the Gooch is to be removed. The precipitate is washed onto the aspestos mat in the crucible and washed with cold water six times, the beaker being copped out as usual.

Ignition. The precipitate is dried by placing the crucible on an asbestos board over a flame for twenty-five minutes and then heated over a direct flame for thirty minutes.

Calculation. $BaSO_4 \times 10 = per cent S$. (If factor weight is taken.)

 $BaSO_4 \times 0.1373 = gram S.$ Factor.

Notes and Precautions

Although barium sulphate is only slightly soluble in water, it is appreciably soluble in the salts of the alkalies (Na, K and NH4), and in a large excess of hydrochloric acid.

Barium sulphate occludes salts, especially nitrates and chlorides. Ferric chloride is carried down with this precipitate, though ferrous chlo-

ride is not; hence the reduction of iron is necessary. Occlusion of iron causes low ride is not; hence the reduction of from is incorrectly. Consider that with heating of $Fe_2(SO_4)_1$, SO_2 is volatilized, the salt decomposing to $Fe_2O_2 + SO_3$. With the iron reduced the precipitate burns perfectly white, whereas with ferric iron present the precipitate is invariably red or yellow. Aluminum powder used by W. H. Seamon, for reduction of iron in determination. nation of sulphur, suggested its value in the method above given.

Potassium bromide is added to the bromine mix as a diluent to prevent too vigor-

ous a reaction. Cooling the solution is for the same purpose as a loss of sulphur will result if the reaction is violent. This is especially the case in pyrrhotite ore.

Otto Folin 2 shows that precipitation of BaSO4 in a large volume of cold solution produces large crystals.

Mechanical loss and reduction of BaSO4 is avoided by the Gooch crucible.

The method has been thoroughly tested in the laboratories of the Gen. Chem. Co. and has become a standard method for sulphur.

Evolution Method for Determining Sulphur in Iron, Steel, Ores, Cinders, Sulphides and Metallurgical Products

Introduction. The method depends upon the fact that hydrogen sulphide is evolved when a sulphide is acted upon by a strong acid such as hydrochloric acid. This gas, absorbed by a suitable reagent, may be determined gravimetrically by weighing directly the precipitated sulphide, or by oxidation of either the hydrogen sulphide evolved or the sulphide formed in the absorbing reagent,

¹ Chemical Engineer, September, 1908. ² Journal of Biological Chem., 1, 131-159.

³ Gravimetrically. (a) Evolution of H₂S into solutions of ZnCl₈, KOH, KMnO₄, AgNO₃, Hg(CN)₂, H₂O₃, Br+HCl and subsequent oxidation to sulphate when necessary, and precipitation as BaSO₄. (b) Absorption of H₂S by neutral or alkaline solutions of lead, oxidation of PbS to PbSO₄ and weighing as such. (c) Absorption of H₂S in solutions of AgNO₃, CdCl₂, and weighing the precipitated sulphide.

and precipitating sulphur as BaSO₄. It may be determined volumetrically 1 by titrating the precipitated sulphide with iodine or by titrating the acid, formed by the reaction, with standard caustic. The iodine and caustic titrations may be made on the same run, or the sulphide may be weighed and the filtrate containing the free acid titrated, thus double checking results. The following reaction takes place when the gas is evolved and absorbed by neutral cadmium sulphate:

H₂S+CdSO₄ = CdS precipitate+H₂SO₄ free acid.

The method is especially adapted to the determination of sulphur in iron and steel or in metallurgical products containing small amounts of sulphide.

may be applied to products containing larger amounts of sulphur as sulphides or sulphates, the latter condition requiring a special preliminary treatment.

The method is not applicable for determining free sulphur or sulphur in


iron pyrites.

Reagents. Iodine Solution. strengths of this reagent should be at hand for general work:

For iron and steel and low sulphur briquettes, etc. = .01 to 0.5% S..... N/30 I For sulphur products containing over 0.5% S..... N/10 I

Starch Solution. Made from a good grade of soluble starch, 1 gram per 200 cc. of water. Fresh solutions are desirable, as the deteriorated material produces a greenish-brown color in place of the delicate blue desired. Flocks of insoluble starch will cause the same difficulty.

Cadmium Chloride or Cadmium Sulphate Solutions. Ammoniacal Solution. Fifty-five grams of CdCl₂·2H₂O or 70 grams of the sulphate are dissolved in 500 cc. of distilled water. To this are added 1200 cc. NH₄OH (sp.gr. 0.90) Fig. 64.—Scott's Apparatus for Determinand the solution diluted to 2500 cc. The solution is of such strength that

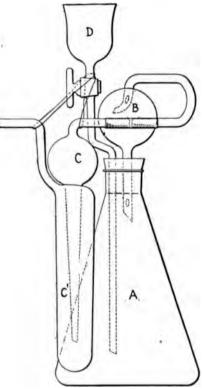

ing Sulphur in Iron and Steel.2

50 cc. will precipitate approximately 0.175 gram sulphur evolved as H₂S. This is equivalent to about 3.5% sulphur on a 5-gram sample.

¹ Volumetrically. (a) Absorption in a solution of KOH, CdCl₂ or CdSO₄, ZnCl₂ or ZnSO₄, Na₂HAsO₂ and titration with iodine solution. (b) Absorption in iodized KI and titration of the excess of iodine with Na₂S₂O₂ solution. (c) Absorption in a neutral solution of a metallic salt and titration of the liberated acid. (d) Absorption in caustic alkali and addition to an acid solution of a reducible salt, e.g., Fe₂O₃ and titration of the lower oxide, Fe()

² Apparatus designed by W. W. Scott.

Neutral Solution. To be used where titration with caustic is desired. Seventy grams of CdSO₄ are dissolved in water and made up to 2500 cc. The solution should be neutral to methyl orange, otherwise add the requisite amount of H₂SO₄ or NaOH necessary, determined by titration of an aliquot portion.

Hydrochloric Acid. One part concentrated acid to an equal volume of distilled water.

Sulphuric Acid. One volume of concentrated acid to four volumes of distilled water.

Reducing Mixture for Reduction of Sulphates. Five parts of NaHCO₁, 2 parts of C.P. aluminum powder and 1 part of pure carbon, best made by charring starch. A blank should be determined on this material and allowance made accordingly.

Stannous Chloride. Ten-per cent solution.

Fine Granular Aluminum or Zinc Metal. Sulphur free, 20 mesh.

Apparatus. The apparatus shown in the illustration, Fig. 64, is the author's 1 modification of the form used at Baldwin Locomotive Works. This consists of an Erlenmeyer flask A of about 500-cc. capacity with large base. With material in which violent foaming occurs, during the evolution of hydrogen sulphide, it is advisable to use a wash bottle with large base, in preference to an Erlenmeyer flask. Through a rubber stopper is inserted a thistle tube with glass stop-cock D, by which the acid is introduced into the flask. The hydrogen sulphide passes through a potash connecting bulb with trap as shown. A hole blown in the side of the tube prevents liquid being swept through. Connected to the potash bulb is the absorption bulb C, which is suspended by a wire attached to the thistle tube. The apparatus is compact, so that on a large hot plate, 30 by 20 ins., a dozen outfits may readily be accommodated. With the use of this apparatus the writer has been able to make over seventy-five determinations of sulphur in steel in an ordinary day's run.

Preparation and Amount of Sample

The amount of material to be taken for the determination depends upon the sulphur content as shown by the following table:

Approximate % of Sulphur Present.	Amount to take for Analysis.
0.01 to 1	5 grams
1.0 to 10	1
10.00 to 30	0.5
Above 30	0.25

The class of material will govern the method of procedure.


Iron and Steel. A 5-gram sample of drillings or finely divided material is treated directly in the evolution flask with hydrochloric acid, 1:1, and the hydrogen sulphide absorbed in ammoniacal cadmium chloride. The sulphide formed is titrated with iodine.

Iron Ore Briquettes and Materials Containing Sulphates. Low Sulphur. Preliminary Reduction. A 5-gram sample is intimately mixed with an equal weight of reducing mixture (NaHCO₃+Al+C) and wrapped in a 9-cm. ashless filter. The charge is placed in a 50-cc. nickel crucible with cover. The crucible

is inserted half way into an asbestos board or perforated silica plate (see Fig. 65) and after covering, placed over a low flame of a Méker blast burner. The

flame of the blast is gradually increased during the first five minutes and the charge blasted for about twenty The crucible will appear a bright red and carbon monoxide gas escaping from under the crucible lid will burn. The loss of sulphur, however, is not appreciable. The crucible is cooled without removing the cover. When cold the fused mass is quickly pulverized and placed in the dry evolution flask containing a mat of aluminum granules or C.P. zinc dust or granulated tin. Hydrogen sulphide is best evolved with hydrochloric acid to which 4 or 5 cc. of 10% stannous chloride has been added to reduce ferric iron. The gas is absorbed in ammonical cadmium chloride and the cadmium sulphide formed titrated with iodine.

Iron Sulphide for Available H2S. Since this product runs over 20% available hydrogen sulphide not over 0.5 gram sample should be taken. The H₂S is evolved by addition of dilute sulphuric acid, 1:4, in place of hydrochloric acid, and is absorbed by neutral cadmium sulphate. The acid formed by the reaction is titrated by standard N/10 NaOH.



Sodium Sulphide or Water-soluble Sulphides for Available H₂S. Ten grams dissolved in water and diluted to 1000 cc.; 50 cc. = (0.5 gram) taken for analysis.

Details of Procedure

Evolution of Hydrogen Sulphide. One-half to 1 gram of aluminum or zinc granules, 20 mesh, is placed over the bottom of the evolution flask and the sample placed above this mat of metal. The stopper with the thistle tube and condenser is inserted snugly into the neck of the flask. An absorption bulb containing about 20 cc. of distilled water is attached to the condenser. This bulb serves as a trap for the HCl that is driven out of the flask during the boil-To this bulb is attached a second bulb containing 50 cc. of ammoniacal cadmium chloride. A third bulb may be attached if the sulphur content of the material examined is high; this, however, is seldom necessary when ammoniacal cadmium chloride is used. The rubber stopper and all rubber connections being air tight, 100 cc. of warm HCl, 1:1, is poured into the flask through the thistle tube, the stem of which should now dip well below the acid. The stopcock is closed during the violent action of the acid on the sample and opened when this has subsided. The acid trap prevents loss of H₂S through the thistle tube. The apparatus is now placed on the hot plate and the sample boiled vigorously for about twenty minutes. The flask is taken off the hot plate and the contents allowed to cool. At this stage it may be advisable to draw a current of air through the apparatus to sweep out any residual H2S that may remain in the flask. Hydrogen gas is preferable to air.

(a) The contents of the bulbs are poured into a 600-cc. beaker containing about 400 cc. of distilled water. The bulbs are washed out first with water and then with dilute acid. The excess of ammonia is neutralized with concentrated HCl, 5 cc. of starch solution added and the sulphide immediately titrated with standard iodine, additional hydrochloric acid being added from time to time during the titration to insure complete decomposition of the sulphide. The liquid appears yellowish red, orange, purplish red and finally a deep blue. Since the sulphide, when present in appreciable quantity, decomposes slowly, the solution should be strongly acid at the completion of the titration, and five minutes should be allowed for a permanent end-point.

Knowing the amount of iodine necessary, a check run may be made by adding to the neutral solution an excess of iodine followed by 5 cc. of starch solution and a large excess of concentrated hydrochloric acid. The excess of iodine is titrated with N/10 thiosulphate, Na₂S₂O₃, solution. (Arsenous acid will not do.) This procedure will prevent the loss of H₂S, which is apt to occur in samples high in sulphide.

(b) An alternate method is frequently advisable in high sulphurs. The precipitate is separated from the solution containing ammonia by filtration. The cadmium sulphide is now placed in the 600-cc. beaker with water and an excess of iodine run in. Starch is added, followed by hydrochloric acid. The excess of iodine is titrated with sodium thiosulphate, Na₂S₂O₃. By this method the heat action during the neutralization of ammonia is avoided and only the precipitate is titrated.

When the iodine titration exceeds 50 cc. of N/10 iodine, a smaller amount of the sample should be taken for analysis; the iodine titration for amounts of sulphur exceeding 0.1 gram is not satisfactory, owing to a fading end-point. The method for determining available hydrogen sulphide in high sulphide products, dealing with the titration of the free acid formed during the reaction, permits of larger samples being taken. Details of this method are given on page 509.

One cc. N/10 iodine = 0.001604 gram S.

Tenth Normal Equivalents

```
One cc. of N/10 iodine = 0.001704 gram H<sub>2</sub>S
                           =0.004396 gram FeS
        "
                 "
                           =0.003904 \text{ gram Na}_{2}S
        "
                 "
                           =0.003607 \text{ gram CaS}
        "
                 "
                           =0.008471 gram BaS
                 "
                           =0.00561 gram Sb_2S_3
        . .
                 . .
                           =0.011959 \text{ gram PbS}
        "
                 "
                           =0.011634 gram HgS
        "
                 "
                           =0.004782 gram CuS
        . .
                           =0.007224 \text{ gram CdS}
        "
                 "
                           =0.004872 \text{ gram ZnS}
                           =0.003269 gram Zn
```

Combustion Method for Evaluation of Sulphide Ores. When a sulphide ore (pyrrhotite) is heated to redness in presence of oxygen both sulphur dioxide and trioxide are evolved. The first may be absorbed in suitable reagents and estimated volumetrically or gravimetrically. The trioxide mist is best retained by asbestos and weighed. The combustion furnace with silica tube used for determinations of carbon is adapted for sulphide ores. The finely powdered

dry sample, spread in a thin layer in a 3-inch porcelain boat, is placed in the red hot tube and burned in a current of oxygen, which has been purified by passing through sodium hydroxide, strong sulphuric acid and phosphorus pentoxide. The trioxide mist is removed by passing the evolved gases through an asbestos filter (P.O. bulb with asbestos in one arm adjacent to the combustion tube and P₂O₅ in the other). The SO₂ is absorbed in a mixture of bromine and nitric acid, and the sulphuric acid formed is titrated after removing the reagent by evaporation; or it is absorbed in an excess of standard iodine, the excess titrated with sodium arsenite or thiosulphate, and sulphur calculated. The iodine method is preferable to the bromine, as it is more rapid and the reagent less disagreeable to handle. The gravimetric method is the most reliable. The dioxide is absorbed in chromic acid (caustic will not give correct results owing to its affinity for carbon dioxide, a product of combustion of the free and combined carbon, that are generally present in sulphide ores. Pyrrhotite frequently contains as much as 1% carbon) and weighed. The combustion method cannot be recommended for extreme accuracy. The procedure may be used for the estimation of available sulphur, but does not give the total sulphur of the ore, since .2 to .5% remains in the cinder. Error may result from the following causes: (1) Incomplete combustion of the sulphur—due to sublimation of the sulphur to cooler zones of the combustion tube, and to a fine mist of sulphur passing unburned into the asbestos, where it is retained with SO₂ and weighed as such. (2) Error due to combined water of the ore. The results are apt to be .05 to 0.5% lower than those obtained by the barium sulphate procedures, the sulphur of the cinder being included with the available sulphur.

VOLUMETRIC METHODS FOR DETERMINING SOLUBLE SULPHATES

Combined sulphuric acid in soluble sulphates is best determined gravimetrically; occasionally, however, a volumetric procedure is of technical value. A number of volumetric methods are based on the insolubility of barium sulphate. Two general procedures deserve mention: addition of barium chloride in known amount in slight excess of that required by the sulphate, and titrating the excess either with a soluble carbonate or a chromate; or addition of barium chromate and titrating the alkali chromate formed by the reaction. The sulphate is also determined by precipitation with a weak organic base benzidine, added in form of the hydrochloride salt; the benzidine sulphate, filtered off, is titrated with caustic. The typical procedures given below will meet general requirements for the volumetric determination of sulphates.

Determination of Sulphur by Titration with Barium Chloride and Potassium Chromate—Wildenstein's Method Modified ¹

Reaction.

 $Na_{1}SO_{4}+BaCl_{2}=BaSO_{4}+2NaCl$ and excess $BaCl_{2}+K_{2}CrO_{4}=BaCrO_{4}+2KCl$.

Procedure. The substance containing the sulphate in solution is diluted to 50 cc. in a small flask, acidified with hydrochloric acid, if necessary heated to

. ¹ See "Volumetric Analysis," Sutton, 10th Ed., p. 350.

boiling, and precipitated with a slight excess of N/4 barium chloride added from a burette (1 cc. BaCl₂=0.01 gram SO₃). The precipitate settles rapidly, so that a large excess of the reagent may readily be avoided. The mixture is cautiously neutralized with ammonia, free from carbonate (CO₂ may be precipitated with CaCl₂ solution), the solution heated to boiling, and N/4 potassium chromate added from a burette in .5 cc. portions, each time removing the flask from the heat, allowing the precipitate to settle and examining the elear solution. A faint yellow color will appear as soon as the excess of barium has been precipitated and a few drops of the chromate in excess are present in the solution. The value of the chromate being equivalent to the barium chloride cc. per cc., the difference between the two titrations is due to the barium chloride required by the sulphate.

One cc. N/4 BaCl₂ = 0.01 gram SO₃.

Notes. Salts of the alkalies, alkaline earths (Sr and Ca) and zinc and cadmium do not interfere. Nickel, cobalt and copper, however, give colored solutions which prevent the yellow chromate being seen. Should the latter be present, the end-point may be recognized by using ammoniacal lead acetate as an outside indicator (1 vol. NH₄OH +4 vols. PbC₂H₄O₁·3H₄O, 5% sol.), the indicator and titrated solution being mixed drop per drop on a white tile. A yellowish red color indicates the presence of chromate.

Precipitation of the Sulphate with Barium Chromate and Titration of Equivalent, Liberated Chromate with Iodine and Thiosulphate, Hinman's Method.¹

The sulphate, precipitated by barium chromate, liberates an equivalent amount of chromic acid, which is determined by treating with potassium iodide and titrating the liberated iodine with thiosulphate.

Reactions. $Na_2SO_4+BaCrO_4=BaSO_4+Na_2CrO_4$, $Na_2CrO_4+3KI+8HCl=2NaCl+3KCl+CrCl_2+4H_2O+3I$, $2Na_2S_2O_3+I_2=2NaI+Na_2S_2O_4$.

Procedure.² The solution of the sulphate, containing not over 2 per cent of SO₂, if acid, is almost neutralized with potassium hydroxide, then heated to boiling, and an excess of barium chromate solution added.² After boiling for one to five minutes, the hot solution is neutralized by adding calcium carbonate a until no further effervescence occurs. The precipitate is filtered off and washed with hot water. The combined filtrates containing the chromate liberated by the sulphate through double decomposition, is acidified with 5 cc. strong

- ¹ Treadwell and Hall, "Analytical Chemistry," 2, 4th Ed., p. 716. Am. Jour. Sci. and Arts, 114, 478.

 ² See p. 716.
- The barium chromate used should be free from soluble chromate, barium carbonate or soluble barium salt. The compound may be prepared by precipitating with potassium chromate added to a boiling solution of barium chloride. The precipitate is washed with boiling water containing a little acetic acid, and finally with pure water, and then dried. Four grams of the dry salt are dissolved in a liter of normal hydrochloric acid.

In presence of iron, zinc and nickel, the solution is neutralized with ammonium hydroxide and an excess added; after boiling, the solution is filtered. By using calcium carbonate insoluble basic chromates of these elements would be formed, and low results for SO₃ would follow. This is avoided by the use of ammonia.

hydrochloric acid per each 100 cc. of filtrate and an excess of potassium iodide added. Iodine equivalent to the chromic acid is liberated. This is titrated with N/10 sodium thiosulphate.

One cc. of N/10 thiosulphate = 0.003269 gram H₂SO₄.¹

Benzidine Hydrochloride Method—Raschig

Benzidine sulphate, C₁₂H₈(NH₂)₂·H₂SO₄, is scarcely soluble in water containing hydrochloric acid. The weak base benzidine is neutral to phenolphthalein and the acid in its sulphate may be titrated with an alkali.2 The method gives reliable results in the analysis of all sulphates, provided no substances are present which attack benzidine, and provided the amount of other acids and salts present is not too great.3

 $Na_2SO_4+C_{12}H_8(NH_2)_2\cdot 2HCl = 2NaCl+C_{12}H_8(NH_2)_2\cdot H_2SO_4$ and Reaction. $C_{12}H_8(NH_2)_2 \cdot H_2SO_4 + 2NaOH = C_{12}H_8(NH_2)_2 \cdot 2H_2O + Na_2SO_4$

Reagent. Benzidine hydrochloride is prepared by taking 6.7 grams of the free base, or the corresponding amount of the hydrochloride and mixing into a paste with 20 cc. of water in a mortar. Twenty cc. of hydrochloric acid (sp.gr. 1.12) are added and the mixture diluted to exactly 1000 cc. One cc. of this solution corresponds to 0.00357 gram H₂SO₄. The solution has a brown color. Brown flakes are likely to separate out on standing, but these do no harm.

Procedure. The sulphate solution is diluted with water so that there is at least a 50-cc. volume for each 0.1 gram sulphuric acid present. An equal volume of the reagent is vigorously stirred in, and the precipitate allowed to settle for ten minutes. The solution is filtered onto a double filter, placed on a porcelain, perforated plate in a funnel (a Büchner is O.K.), gentle suction being applied. The last portions of the precipitate are transferred to the filter by means of small portions of the clear filtrate, and the compound then washed with 20 cc. of cold water added in small portions and sucked dry with each addition. The precipitate and filter are placed in an Erlenmeyer flask, 50 cc. of water added, and the mixture shaken until homogeneous. Phenolphthalein indicator is now added, the mixture heated to about 50° C. and titrated with N/10 sodium hydroxide. When the end-point is nearly reached, the liquid is boiled for five minutes, and the titration then completed.

One cc. N/10 = 0.004904 gram H_2SO_4 .

Determination of Free Sulphuric Acid

Other free acids being absent, sulphuric acid may be accurately determined by titration with standard alkali. The method for determining sulphuric acid in presence of commonly occurring acids, and in mixed acids are given in Volume II, in the chapter on Acids, Vol. II.

1 cc.
$$N/1$$
 NaOH = 0.04904 g. H₂SO₄.

¹ N/10 Na₂S₂O₃= $\frac{\text{H}_2\text{SO}_4}{30}$ =98.08 ÷30=3.269.

 Method suggested by Raschig, Z. a. Chem., 617 and 818, 1903.
 Friedheim and Nydegger (Z. a. Chem., 9, 1907) have found that there should not be more than 10 mol. HCl, 15 mol. HNO₃, 20 mol. HC₂H₃O₂, 5 mol. alkali salt, or 2 mol. ferric iron present to 1 mol. H₂SO₄. See Treadwell and Hall, "Analytical Chemistry," pp. 714–716.

DETERMINATION OF PERSULPHATES

Ferrous Sulphate Method-

Ferrous salts in cold solutions are oxidized to ferric form by persulphates. Advantage is taken of this action in the quantitative determination of persulphates. Reaction. $2\text{FeSO}_4 + \text{H}_2\text{S}_2\text{O}_8 = \text{Fe}_2(\text{SO}_4)_3 + \text{H}_2\text{SO}_4$.

Reaction. $2\text{FeSO}_4 + \text{H}_2\text{S}_2\text{O}_3 = \text{Fe}_2(\text{SO}_4)_3 + \text{H}_2\text{SO}_4$.

Procedure.¹ About 2.5 grams of the persulphate are dissolved in water and diluted to 100 cc. Ten cc. of this solution, equivalent to one-tenth of the sample, weighed out, are placed in a flask and a considerable excess of standard ferrous sulphate solution ² added, say 100 cc. measured out from a burette. The solution is diluted with an equal volume o hot, distilled water (70 to 80° C.), and the excess ferrous sulphate titrated with N/10 potassium permanganate. This titration is deducted from the permanganate equivalent of 100 cc. of the ferrous solution taken (if this amount was used). The difference is due to persulphate oxidation.

One cc. N/10 KMnO₄=0.009708 gram $H_2S_2O_8$; or =0.0114 gram (NH₄)₂S₂O₈; or =0.01352 gram $K_2S_2O_8$.

Oxalic Acid Method

Oxalic acid, in presence of silver sulphate, reduces persulphates in accordance with the reaction, $H_2C_2O_4 + H_2S_2O_8 = 2H_2SO_4 + 2CO_2$.

$$H_2C_2O_4+H_2S_2O_8=2H_2SO_4+2CO_2$$
.

Procedure. About 0.5 gram of the persulphate is placed in an Erlenmeyer flask, 50 cc. of N/10 oxalic acid added, together with 0.2 gram silver sulphate in 20 cc. of 10% sulphuric acid solution. The mixture is heated on the water bath for about half an hour to expel carbon dioxide. When the evolution ceases the liquid is diluted to 100 cc. with warm water and titrated warm (about 40° C.) with N/10 potassium permanganate. The excess of oxalic acid is titrated, the difference is due to oxidation by the persulphate.

For calculation see factors in previous method.

Alkali Titration of the Boiled Solution

The aqueous solutions of potassium, sodium, and barium persulphates are decomposed by boiling as follows (M = metal Na, K, or Ba):

 $2M_2S_2O_8+2H_2O=2M_2SO_4+O_2+2H_2SO_4$.

Procedure. About 0.2 g. of the persulphate salt is dissolved in 200 cc. of water and the solution boiled about 15 minutes, then cooled and titrated with N/10 NaOH, using methyl orange indicator.

1 cc. $N/10 \text{ NaOH} = 0.02008 \text{ g. } BaS_2O_84H_2O, \text{ or } 0.01191 \text{ g. } Na_2S_2O_8 \text{ or }$

Ammonium persulphate cannot be determined by the above method but may be determined by the ferrous sulphate method—which see above.

¹ Method suggested by Le Blanc and Eckardt, C. N., 81, 38.

² About 30 grams of ferrous sulphate or ferrous ammonium sulphate crystals are dissolved in 900 cc. of water and the volume made to 1000 cc. with concentrated sulphuric acid. The reagent is standardized against N/10 potassium permanganate and the value per cc. in terms of the standard permanganate noted, the cc. permanganate solution required divided by the cc. of ferrous sulphate solution taken for titration, gives value of the reagent in terms of the permanganate.

The solutions are best verified upon a persulphate of known purity.

DETERMINATION OF SULPHUR IN COMBINATION AS SUL-PHIDES, SULPHITES, BISULPHITES, METABISULPHITES, THIOSULPHATES, SULPHATES. AND HYDROSULPHITES

Available Hydrogen Sulphide in Materials High in Sulphide Sulphur. Iron Sulphide, Sodium Sulphide, etc.

Evolution Method. Since it is desired to obtain the H₂S that ordinarily would be obtained when the sulphide is treated with a strong acid, the mat of metallic aluminum or zinc and the addition of stannous chloride solution used in the procedure given on page 503 is omitted here.

Procedure. 0.5 to 1 gram of the sulphide is placed in the dry evolution flask. All connections are now made as directed in the general procedure. Three absorption bulbs containing neutral solution of cadmium sulphate are connected to the condenser, and supported by wires attached to the thistle tube and the arm of the condenser. All connections being tight, 100 cc. of dilute sulphuric acid, 1:4 are added through the thistle tube and H₂S evolved. The procedure is now the same as described on page 503.

Titration. When the evolution of the H_2S is complete, the bulbs containing the precipitate are emptied into a beaker and carefully washed out. The precipitate is now filtered and washed five or six times until free of acid. Methyl orange is added to the filtrate and the free acid titrated with N/10 NaOH.

The precipitate may be titrated with iodine according to (b) under general method of procedure, using an excess of iodine, followed by starch and acid and then titrating back with sodium thiosulphate solution. A double check may thus be obtained. See page 504.

If it is desired to weigh the CdS precipitate, it is best to evolve the H₂S into a neutral solution of cadmium salt. The precipitate formed in a neutral or slightly acid solution is crystalline and easily filtered, whereas that formed in an ammoniacal solution is gelatinous.

When a neutral CdSO₄ or CdCl₂ solution is used, H₂S should be evolved by sulphuric acid and not by hydrochloric acid, as the latter is volatile, and will pass through the condensing bulb recommended in the general procedure.

```
One cc. N/10 NaOH = .001704 gram H<sub>2</sub>S
" = .004396 gram FeS
= .003904 gram Na<sub>2</sub>S.
```

Hydrogen Sulphide and Soluble Sulphides

Direct titration of hydrogen sulphide water, and soluble sulphides in solution may be made in absence of other substances acted upon by iodine. The solution containing the sulphide is added to an excess of N/10 iodine solution, made acid with hydrochloric acid, and the excess iodine titrated with N/10 sodium thiosulphate. The following reaction takes place:

• $H_2S+I_2=2HI+S$. The cc. $Na_2S_2O_3$ are subtracted from cc. I=I reacting with H_2S . One cc. N/10 iodine =0.00174 gram H_2S .

NOTE. The soluble sulphide may be determined gravimetrically by oxidizing with bromine, the reagent being added until the solution is colored brownish red, the excess of the halogen removed by boiling and the sulphate precipitated as BaSO₄.

Determination of a Sulphide and a Sulphydrate in Presence of Each Other

When a mixture of sulphide and sulphydrate is treated with iodine the following reactions take place:

$$H_2S+I_2=2HI+S$$
 and $NaHS+2I_2=NaI+HI+S$.

It will be noticed that the acidity produced by the first reaction is twice that caused by the iodine action on the sulphydrate, and that the acidity in the latter titration remains unaffected. The reactions with the alkali salts is effected by addition of a standard iodine solution containing a known amount of hydrochloric acid. The reactions in this case are as follows:

 $Na_2S+2HCl=2NaCl+H_2S$ and $NaSH+IICl=NaCl+H_2S$. The iodine reacts with the H_2S as follows: $H_2S+I_2=2HI+S$.

From the second set of reactions it is evident that the quantity of hydriodic acid formed by the action of iodine on the sulphide is equivalent to the hydrochloric acid required to decompose the sulphide, so that the acidity remains unchanged. On the other hand with sulphydrate, NaSH, the hydriodic acid formed by the iodine oxidation, is twice the equivalent of hydrochloric acid required to decompose the acid salt. Hence it is evident that the acidity is a measure of the quantity of sulphydrate present in the mixture. From the second set of reactions the following procedure is devised.

Procedure. To a measured amount of N/10 iodine solution containing a measured amount of N/10 hydrochloric acid (the mixture diluted to 400 cc.) is added the solution containing the sulphide and sulphydrate from a burette, until the stirred solution becomes a pale yellow color. (The cc. of solution added is noted and its equivalent of the sample calculated.) Starch is now added and the excess of the iodine titrated with N/10 sodium thiosulphate. The cc. of thiosulphate in terms of N/10 solution subtracted from the cc. N/10 iodine solution taken give cc. iodine required by the sample added. The acidity of the solution is now determined by titration with N/10 sodium hydroxide. The cc. NaOH required by the HI give total NaOH minus cc. N/10 HCl present in the iodine solution.

Calculation. A. Cc. N/10 iodine required by the sample minus twice the cc. of N/10 NaOH required by HI formed by the reaction multiplied by 0.003903 give weight of Na₂S, (i.e., cc. I -2 cc. NaOH) \times 0.003904 = gram Na₂S.

B. Cc. N/10 NaOH required by the HI multiplied by 0.00560 gives gram weight of NaHS. Or in brief: cc. NaOH ×0.005608 = gram NaHS.

The above weights multiplied by 100 and divided by the weight of sample used in the iodine titration give per cent of constituents in the sample.

The method is of value in the analysis of alkali sulphides in absence of other compounds, which are decomposed by hydrochloric acid and which react with iodine.

Determination of Thiosulphate in Presence of Sulphide and Sulphydrate

The sulphide and sulphydrate sulphur is removed from the solution by adding an excess of freshly precipitated cadmium carbonate. The solution is filtered and diluted to a definite volume and the thiosulphate determined on an aliquot portion by running it into an excess of N/10 iodine solution and titrating the excess of iodine with N/10 thiosulphate solution.

One cc. N/10 iodine = 0.024822 gram Na₂S₂O₂·5H₂O.

Determination of Sulphates and Sulphides in Presence of One Another

In one portion of the sample the sulphide is decomposed and the hydrogen sulphide expelled by boiling the solution (in presence of CO₂ replacing air in the flask) after acidifying with hydrochloric acid. The sulphate sulphur may now be precipitated as BaSO₄ by the usual methods.

In a second portion total sulphur is determined after oxidizing the sulphide with an excess of bromine and boiling out the excess of halogen. Total sulphur minus sulphate sulphur = sulphide sulphur.

The sulphide may be oxidized with fuming nitric acid by boiling the solution in a flask with reflux condenser. The nitric acid is expelled by evaporating the solution down to a moist residue. The sulphate is now precipitated by taking up the residue with water, adding HCl and then sufficient BaCl₂ to cause complete precipitation.

Determining the Sulphur in Thiocyanic (Sulphocyanic) Acid and its Salts

Oxidation of the sulphur may be accomplished as described for sulphides in the preceding method either by means of bromine or by fuming nitric acid. The sulphur is then precipitated as BaSO₄ as usual.

Determination of Sulphurous Acid (SO₁ in Solution) Free, or Combined in Sulphites, Acid Sulphites, Metabisulphites and Thiosulphates

Gravimetric Method, Oxidation to Sulphate and Precipitation as BaSO₄. Sulphur dioxide, free or combined in a soluble salt, may be oxidized to SO₃ or sulphate by means of an oxidizing agent such as chlorine, or bromine, or hydrogen peroxide (alkaline solution). The sulphuric acid or sulphate may be then precipitated and determined as BaSO₄ in the usual way.

Procedure. The halogen (bromine preferred) is added (in a water-saturated solution) in large excess to the sample, the free halogen then boiled out, and sulphuric acid precipitated, from a solution made slightly acid with hydrochloric acid, by addition of a solution of barium chloride, according to the standard procedure.

If hydrogen peroxide is used, the solution should be made alkaline with ammonia and the peroxide added, the excess boiled out, and the solution then made acid as directed above.

 $BaSO_4 \times 0.3517 = H_2SO_3$, or $\times 0.5401 = Na_2SO_3$, or $\times 0.4458 = NaHSO_3$, or $\times 0.3387 = Na_2S_2O_3$, or $\times 0.2745 = SO_3$.

Note. If hydrogen peroxide is used, it should be tested for H₂SO₄ and allowance made accordingly.

Volumetric Methods

Titration with Iodine. Sulphurous Acid, Sulphites, Metabisulphites, Thiosulphates. Sulphurous acid, combined or free, may be titrated with iodine solution, the following reaction taking place:

$$SO_2 + 2I + 2H_2O = H_2SO_4 + 2HI$$
.

The titration is accomplished by adding the solution of sulphurous acid, sulphite, or thiosulphate to the iodine, not in the reverse order, since in the latter order low results are obtained, unless the solution is very dilute (less than 0.04% SO₁).

Procedure. Five grams of the sample (sulphurous acid solution titrated directly) are dissolved in a little water and transferred to a 500-cc. graduated flask, then made to volume. Each cc. of this solution contains 0.01 gram of the sample; 100 cc. of N/10 iodine, or their equivalent if the solution is stronger or weaker, are placed in a beaker together with a few drops of hydrochloric acid. A portion of the sample in a 100-cc. burette is now run into the iodine, with constant stirring, until the color of the free iodine has almost faded out; a little starch solution is now added and the titration continued to the complete fading of the blue color.

Since each cc. of the sample contains 0.01 gram of the material, it follows that the 100-cc. iodine equivalent in terms of the material titrated expressed to the fourth decimal place as a whole number, if divided by the cc. of the sample required, will give the per cent of the substance sought, provided other titratable substances are absent.

Example. Suppose sodium sulphite is being titrated, then since 100 cc. of N/10 iodine are equivalent to 0.6304 gram Na₂SO₃, 6304 divided by the cc. Na₂SO₃ solution required gives per cent Na₂SO₃. If 63 cc. were required the salt would be 100% pure.

Note. When the iodine equivalent is over unity, it is necessary to take a larger sample per 500-cc. volume to avoid having a titration of over 100 cc. For example in the analysis of sodium thiosulphate, a 20-gram sample is diluted to 500 cc. and a portion of this added to 100 cc. of N/10 iodine solution. In this case it must be kept in mind that each cc. of the sample contains 0.04 gram of thiosulphate and the percentage calculated accordingly upon completing the titration.

If the titration of the iodine is made in a casserole, the end-point may readily be recognized without the addition of starch.

Equivalents. 100 cc. N/10 iodine solution will oxidize:

Sodium sulphite (anhydrous), Na₂SO₃ = 0.6304 gram, or 0.3203 gram SO₃.

Sodium sulphite, Na₂SO₂.7H₂O = 1.2606 grams.

Acid sodium sulphite, NaHSO₁=0.5204 gram.

Sodium metabisulphite, Na₂S₂O₅ (anhydride of NaHSO₃) = 0.47535 gram.

Sodium thiosulphate, $Na_2S_2O_3 \cdot 5H_2O = 2.4822$ grams.

Note. Hydrogen sulphide or sodium sulphide are also titrated with iodine. Equivalents for 100 cc. N/10 iodine=0.1704 gram H₂S, or 0.3904 gram Na₂S.

¹ A secondary reaction takes place, the hydriodic acid formed reducing the SO₂ to S, e.g., SO₂+4HI=2H₂O+2I₂+S. (J. Volhard, Ann. d. Chem. u. Pharm., 242, 94.) The solution, if not too dilute, will show a distinct separation of sulphur. (Treadwell and Hall, "Analytical Chemistry," 2, 3d Ed.) Raschig believes that a loss of SO₂ occurs, due to evaporation. (Z. Angew. Chem., 580, 1904.) See Sutton, "Volumetric Analysis," 10th Ed., pp. 128, 129. Gooch, "Methods in Chemical Analysis," 1st Ed., pp. 364-368.

Determination of Sodium Thiosulphate. The iodine titration is described on page 512. See also the chapter on iodine.

Acidimetric and Alkalimetric Methods

Titration of Sulphites, Acid Sulphites (Metabisulphite) or Sulphurous Acid. The choice of indicator is important as the titration with one may be different from that obtained in presence of another. For example the titration of sulphurous acid by an alkali in presence of phenolphthalein is twice the titration necessary to obtain an alkaline reaction with methyl orange. The reason for this is evident by the fact that Na₂SO₃ is neutral to phenolphthalein and alkaline to methyl orange, whereas NaHSO₃ is neutral to methyl orange but is acid to phenolphthalein. Advantage is taken of this in the analysis of salts containing a mixture of the normal and acid salts.

Reaction. With phenolphthalein $H_2SO_2+2NaOH=Na_2SO_2+2H_2O$. With methyl orange $H_2SO_2+NaOH=NaHSO_2+H_2O$.

On the other hand if a salt is being titrated, methyl orange cannot be used for the titration of metabisulphite or acid sulphite, since these salts are neutral to this indicator, here phenolphthalein is required and an alkali titration made.

Reaction. $NaHSO_2 + NaOH = Na_2SO_2$. $(Na_2S_2O_5 + H_2O = 2NaHSO_2)$.

Again if sodium sulphite, Na₂SO₃, is to be titrated, phenolphthalein would not do as an indicator, since Na₂SO₃ is neutral to this indicator. Here an acid titration is required with methyl orange indicator present:

 $2Na_2SO_3 + H_2SO_4 = 2NaHSO_3 + Na_2SO_4$.

A. Sulphurous Acid

For the alkali titration of this acid it is advisable to use methyl orange as indicator, since this is not affected by carbon dioxide, which is very frequently present.

Reaction. $H_2SO_1 + NaOH = NaHSO_1$.

One cc. N/1 NaOH = 0.06407 gram SO₂, or = 0.08209 gram H₂SO₃.

B. Sodium Metabisulphite

Sodium acid sulphite does not exist in dry form, since the salt loses water and the anhydride Na₂S₂O₄ results. This is analogous to sulphurous acid, which exists only in water solution. It has been found that the acid sulphite solution evaporated to crystallization yields a product, which though dried with extreme care, forms the anhydride salt, Na₂S₂O₄. For correct report, therefore, the solid should be reported as metabisulphite, and the solution of the salt as acid sulphite.

Since metabisulphite in solution, or acid sulphite, is neutral to methyl orange, phenolphthalein indicator must be used and an alkali titration made. Carbon dioxide-free water and reagents should be used.

Reaction. Na₂S₂O₅+H₂O = 2NaHSO₂ and NaHSO₂+NaOH = Na₂SO₂+H₂O. **Procedure.** 9.507 grams of the finely ground powder are dissolved in about 50 cc. of cold saturated salt solution, to which has been added from a burette 50 cc. of normal sodium hydroxide. The salt solution should be made neutral to

phenolphthalein. One cc. of 0.1% solution of the indicator is added and the excess acid sodium sulphite titrated with normal sodium hydroxide until a permanent faint pink color is obtained.

Since the normal equivalent of the salt has been taken for analysis the cc. alkali titration, including the 50 cc. originally present, will give the percentage directly in terms of Na₂S₂O₄.

Note. The NaCl serves to give a sharp and more permanent end-point. It may be necessary to add more of the indicator towards the end of the titration.

C. Sodium Sulphite, Na₂SO₃

Sodium sulphite, Na₂SO₃, is neutral to phenolphthalein and alkaline to methyl orange. The titration of this salt is accomplished by addition of standard acid in presence of methyl orange.

Reaction. $2Na_2SO_1 + H_2SO_4 = Na_2SO_4 + 2NaHSO_3$.

Procedure. The normal factor weight (12.6 grams) of the salt is dissolved in about 250 cc. of distilled water, 1 cc. of methyl orange added, followed by normal sulphuric acid, added from a burette until a faint orange end-point is obtained. As in the case of the metabisulphite, each cc. of normal sulphuric acid equals 1% Na₂SO₃. Hence the percentage is obtained directly from the burette reading.

Notes. Organic coloring matter may be removed from the solution by filtering

through charcoal.

If sodium carbonate is present, it will also be titrated. A correction must be applied for this. In the presence of sodium carbonate the solution will be alkaline to phenolphthalein. An approximate estimation of this may be obtained by titration with normal acid in presence of this indicator, remembering that sodium bicarbonate, NaHCO₃, is neutral to phenolphthalein, hence twice this titration must be deducted from the total methyl orange titration, i.e., Na₂CO₃+H₂SO₄ (M.O.) = Na₂SO₄+H₂CO₃ and 2Na₂SO₃+H₂SO₄ (P.) = 2NaHSO₄+2NaHCO₃. (Alkaline hydroxides will also be titrated.) CO₂ may also be obtained by the standard procedure under carbon, the SO₂ being oxidized by addition of chromic acid. Na₂CO₂×1.5 = equivalent Na₂SO₃.

Sodium carbonate may be detected in a sulphite or metabisulphite by adding cold, dilute acetic acid (25%) to the dry powdered salt. An effervescence is due to the presence of carbonate, since a sulphite or metabisulphite does not effervesce under similar conditions.

Determination of Sulphites, Metabisulphites, Thiosulphates, Sulphates, Chlorides and Carbonates in Presence of One Another

1. Sodium Sulphite, Na₂SO₃

This is determined by titration with standard acid in the presence of methyl orange indicator according to the standard procedure previously described. If a carbonate is present, allowance must be made for this as stated

One cc. N/1 $H_2SO_4 = 0.126$ gram Na_2SO_3 . Calculate to per cent. $Na_2CO_3 \times 1.5 = \text{equivalent } Na_2SO_3$.

2. Sodium Metabisulphite, Na₂S₂O₅

This is determined by titration with a standard alkali in the presence of phenolphthalein indicator according to the procedure previously described.

One cc. N/1 NaOH = 0.09507 gram Na₂S₂O₅. Calculate to per cent.

3. Sodium Thiosulphate, Na₂S₂O₃

One gram of the mixed salts is placed in 100 cc. of N/10 iodine solution, and the excess of iodine titrated with N/10 sodium thiosulphate according to the standard procedure.

Calculation.
$$\{(cc. N/10 I - cc. N/10 Na2S2O3) - [(\% Na2S2O5 × 2.104) + (\% Na2SO3 × 1.5864)] × 1.5814 = \% Na2S2O3.$$

4. Sodium Sulphate

The sample is dissolved in a little water, hydrochloric acid added, and the solution boiled to expel all of the SO₂. Barium sulphate is now precipitated and determined according to the standard procedure.

$$BaSO_4 \times 0.6086 = Na_2SO_4$$

Note. The amount of the sample required is governed by the per cent Na₂SO₄ present.

5. Sodium Chloride

The sample is dissolved in water, nitric acid added and the solution boiled until all the SO₂ has either been volatilized or oxidized. The chlorine of the chloride is now precipitated with silver nitrate from a hot solution by the usual procedure.

$$AgCl \times 0.4078 = NaCl.$$

Note. The amount of the sample taken is governed by the per cent of NaCl present.

6. Sodium Carbonate, Na₂CO₃

Carbon dioxide is evolved from the mixture by means of chromic and sulphuric acids, the former being used to oxidize the SO₂ of the sample. The evolved gas is bubbled through a mixture of strong sulphuric and chromic acids to remove any SO₂ that may have escaped oxidation. Fig. 20. The CO₂ is absorbed either in caustic and weighed or is passed into a standard solution of barium hydroxide and titrated according to the standard procedures given under carbon.

Note. The amount of the sample taken is governed by the per cent of Na₂CO₃ present.

phenolphthalein. One cc. of 0.1% solution of the indicator is added and the excess acid sodium sulphite titrated with normal sodium hydroxide until a permanent faint pink color is obtained.

Since the normal equivalent of the salt has been taken for analysis the cc. alkali titration, including the 50 cc. originally present, will give the percentage directly in terms of Na₂S₂O₄.

Note. The NaCl serves to give a sharp and more permanent end-point. It may be necessary to add more of the indicator towards the end of the titration.

C. Sodium Sulphite, Na₂SO₃

Sodium sulphite, Na₂SO₂, is neutral to phenolphthalein and alkaline to methyl orange. The titration of this salt is accomplished by addition of standard acid in presence of methyl orange.

Reaction. $2Na_2SO_4 + H_2SO_4 = Na_2SO_4 + 2NaHSO_3$.

Procedure. The normal factor weight (12.6 grams) of the salt is dissolved in about 250 cc. of distilled water, 1 cc. of methyl orange added, followed by normal sulphuric acid, added from a burette until a faint orange end-point is obtained. As in the case of the metabisulphite, each cc. of normal sulphuric acid equals 1% Na₂SO₂. Hence the percentage is obtained directly from the burette reading.

Notes. Organic coloring matter may be removed from the solution by filtering

through charcoal.

If sodium carbonate is present, it will also be titrated. A correction must be applied for this. In the presence of sodium carbonate the solution will be alkaline to phenolphthalein. An approximate estimation of this may be obtained by titration with normal acid in presence of this indicator, remembering that sodium bicarbonate, NaHCO₃, is neutral to phenolphthalein, hence twice this titration must be deducted from the total methyl orange titration, i.e., Na₂CO₃+H₂SO₄ (M.O.) = Na₂SO₄+H₂CO₃ and 2Na₂SO₃+H₃SO₄ (P.) = 2NaHSO₄+2NaHCO₃. (Alkaline hydrox; ides will also be titrated.) CO₂ may also be obtained by the standard procedure under carbon, the SO₂ being oxidized by addition of chromic acid. Na₂CO₃×1.5 = equivalent Na₂SO₃.

Sodium carbonate may be detected in a sulphite or metabisulphite by adding cold, dilute acetic acid (25%) to the dry powdered salt. An effervescence is due to the presence of carbonate, since a sulphite or metabisulphite does not effervesce under similar conditions.

Determination of Sulphites, Metabisulphites, Thiosulphates, Sulphates, Chlorides and Carbonates in Presence of One Another

1. Sodium Sulphite, Na₂SO₃

This is determined by titration with standard acid in the presence of methyl orange indicator according to the standard procedure previously described. If a carbonate is present, allowance must be made for this as stated

One cc. N/1 $H_2SO_4 = 0.126$ gram Na_2SO_3 . Calculate to per cent. $Na_2SO_3 \times 1.5 =$ equivalent Na_2SO_3 .

ł

2. Sodium Metabisulphite, Na₂S₂O₅

This is determined by titration with a standard alkali in the presence of phenolphthalein indicator according to the procedure previously described.

One cc. N/1 NaOH = 0.09507 gram Na₂S₂O₅. Calculate to per cent.

3. Sodium Thiosulphate, Na₂S₂O₃

One gram of the mixed salts is placed in 100 cc. of N/10 iodine solution, and the excess of iodine titrated with N/10 sodium thiosulphate according to the standard procedure.

4. Sodium Sulphate

The sample is dissolved in a little water, hydrochloric acid added, and the solution boiled to expel all of the SO₂. Barium sulphate is now precipitated and determined according to the standard procedure.

$$BaSO_4 \times 0.6086 = Na_2SO_4$$

Note. The amount of the sample required is governed by the per cent Na₂SO₄ present.

5. Sodium Chloride

The sample is dissolved in water, nitric acid added and the solution boiled until all the SO₂ has either been volatilized or oxidized. The chlorine of the chloride is now precipitated with silver nitrate from a hot solution by the usual procedure.

$$AgCl \times 0.4078 = NaCl.$$

NOTE. The amount of the sample taken is governed by the per cent of NaCl present.


6. Sodium Carbonate, Na₂CO₃

Carbon dioxide is evolved from the mixture by means of chromic and sulphuric acids, the former being used to oxidize the SO₂ of the sample. The evolved gas is bubbled through a mixture of strong sulphuric and chromic acids to remove any SO₂ that may have escaped oxidation. Fig. 20. The CO₂ is absorbed either in caustic and weighed or is passed into a standard solution of barium hydroxide and titrated according to the standard procedures given under carbon.

NOTE. The amount of the sample taken is governed by the per cent of Na₂CO₃ present.

ESTIMATION OF SODIUM HYDROSULPHITE


Standard Indigo Solution. To about 150 cc. concentrated sulphuric acid in a casserole, are added 4.2 grams of indigo, slowly with stirring. The solution is kept at 80° C. for an hour in an oven, stirring once or twice during this time. After cooling the solution it is made up to four liters with distilled water. This reagent is now standardized against N/50 KMnO₄ solution. To do this 25 cc. of the indigo



1 cc. N/50 KMnO₄ is equivalent to 0.0015 g. indigotin.

1.505: 1 = gram indigotine : x, where $x = \text{gram Na}_2S_2O_4$ in 25 cc. Indigo solution.

 $\frac{2\times10,000}{\text{cc. titration}} = \% \text{ Na}_2\text{S}_2\text{O}_{\frac{1}{4}}(2.5 \text{ grams of solid}) \text{ or grams per liter } (25 \text{ cc. sample made up to } 500 \text{ cc.}).$

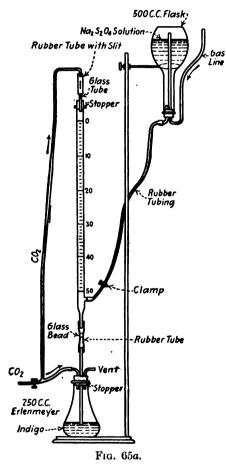

Procedure

Titration of Sodium Hydrosulphite Against Standard Indigo Solution. Fifty cc. of standard indigo solution are pipetted into a 300 cc. Erlenmeyer flask. The titrating apparatus as well as the 500 cc. volumetric flask are filled with CO2 gas (C2H2 may be used in place of CO2). Two and a half grams of the solid are now taken, or 25 cc. of the solution (if the material is already dissolved as a 10% solution) and placed in the 500 cc. flask and made to mark with distilled water. The flask is stoppered and connections made with the burette, etc., as shown in The burette is filled with Fig. 65a. the sample and the flask containing the indigo solution is placed under the burette as shown in the figure. The air s displaced from the apparatus by CO₂, the flow of this gas being continued

during the titration. The hydrosulphite solution is now added to the indigo solution until it changes from the blue to a yellow or brown color.


Factor for Indigo =% Na₂S₂O₄ in solids, or grams per liter in liquids.

Notes. The hydrosulphite solution should be made alkaline with NaOH, then made up rapidly to volume and titrated in an atmosphere of CO₂ to prevent oxidation. The size of the sample may be varied, but the titration should be over 10 cc.

The tip of the burette should dip below the surface of the indigo until near the endpoint, then withdrawn and the titration completed with the tip above the surface. The above method was outlined by J. H. Brackett.

DETERMINATION OF FREE SULPHUR IN A MIXTURE

From 1 to 10 grams of the material, depending upon the amount of sulphur esent, is extracted in a Soxhlet extractor (see modified form Fig. 66) with carbon

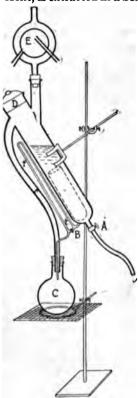

G. 66.—Sanders' Extraction Apparatus.

tetrachloride, or carbon bisulphide (freshly distilled) for twelve hours. The extract is evaporated to dryness, adding 10 cc. of bromine-carbon tetrachloride mixture together with 15 cc. of nitric acid. The residue is taken up with 10 cc. of hydrochloric acid, diluted with 150 cc. of distilled water, heated to boiling and the sulphuric acid precipitated with 10% barium chloride solution, washed, dried, ignited and weighed according to the procedure for sulphur.

 $BaSO_4 \times 0.58851 = Ba$.

 $\frac{\text{BaSO}_4 \times 100 \times 0.13738}{\text{Weight of sample}} = \text{per cent free sulphur.}$

Sanders' extraction apparatus has several advantages that make this apparatus desirable for laboratory use, where a number of daily extractions are required. As may be seen from Fig. 66, by simply removing the glass stopper D the cylinder may be charged without disconnecting the apparatus, as is necessary with the Soxhlet type of apparatus. The extraction is carried on with the traps A and B closed, the siphon t-t' acting automatically as in case of the Soxhlet. With A closed and B open the apparatus may be used as a reflux condenser. The solvent liquid may be drawn off by opening A. With B closed and A open the apparatus may be used as a condenser and the ether, chloroform, carbon disulphide, etc., distilled from C. The globe-shaped Soxhlet condenser may be replaced by Allihn's or Liebig's condenser, if

sired. The ball form, however, is more compact.

¹ J. McC. Sanders, Proc. Chem. Soc., 26, 227-228, 1910. The Analyst, \$5, 556, 10.

EVALUATION OF SPENT OXIDE FOR AVAILABLE SULPHUR

Spent oxide is the by-product of gas works, and refers to the spent Fe_2O_2 used in the scrubber for the removal of hydrogen sulphide from the gas. The FeS, as in case of pyrites, is used in the manufacture of sulphuric acid, and is evalued by its available sulphur content.

Total Sulphur. The oxide is sampled, brought into solution and the sulphur determined exactly as is given under the standard method for determination of

sulphur in pyrites ore.

Residual Sulphur. Two grams of the material are ignited to expel volatile sulphur, a porcelain crucible being used. The residue is treated with strong hydrochloric acid and after digestion on the steam or water bath is diluted with water and filtered. (If SiO₂ is present evaporation to dryness is necessary.) Sulphur is determined in the filtrate as usual.

Available Sulphur. The per cent of residual sulphur is subtracted from the

per cent total sulphur, the difference being available sulphur.

Iron. This may be determined on an ignited sample according to a standard procedure for iron. See chapter on Iron.

ANALYSIS OF BRIMSTONE

The impurities in brimstone are seldom more than a few tenths per cent. In the usual analysis, moisture, available sulphur, ash, arsenic, and chlorine are required.

Moisture. The powdered sample, weighing 50 grams, is spread out on a watch-glass and dried for an hour at 100° C., then cooled in a desiccator and weighed.

Loss of weight in grams multiplied by 2 = per cent moisture.

Available Sulphur. Ten grams of the sulphur taken from the dried material are heated in a silica or porcelain dish until the sulphur ignites. The heating is discontinued during the burning of the substance, but renewed for a minute or so after the sulphur has burned away. Loss of weight of the cooled residue is due to the available sulphur.

NOTE. Organic matter in brimstone is not appreciable.

Ash. This is the residue that remains in the dish. The increase of weight of the tared dish is due to the ash.

Arsenic. Ten grams of the material are treated with 30 cc. of carbon tetrachloride mixture (3 parts CCl₄+2 parts Br) and after standing for ten minutes 25 cc. strong nitric acid are added in small portions (a watch-glass covering the beaker during the intervals of addition). HNO₂ and Br are expelled by evaporation on the steam bath. Water is added and the evaporation repeated. Arsenic is now determined on the residue by the Gutzeit Method for arsenic.

Note. Arsenic-free reagents should be employed.

Chlorine. One hundred grams of the brimstone are extracted with hot water, the filtered extracts oxidized with 10 to 15 cc. of nitric acid and a few crystals of ammonium persulphate by boiling and treated with 5 cc. of 10% solution of silver nitrate. The solution, brought to boiling, is placed in a dark place and the silver chloride allowed to settle. This is now filtered off in a weighed Gooch crucible and chlorine calculated from the AgCl.

$$AgCl \times 0.2474 = Cl \text{ or } = 0.4078 = NaCl.$$

Total Sulphur. This is best determined by oxidation of the free sulphur to sulphuric by treating with bromine, followed by nitric acid. Sulphuric acid is now determined gravimetrically by precipitation as BaSO₄.

QUANTITATIVE ESTIMATION OF SMALL QUANTITIES OF SULPHIDE SULPHUR; METHOD OF W. A. DRUSHEL AND C. M. ELSTON¹

The method is a colorimetric method and consists essentially of the comparison of the depth of color of lead sulphide stains obtained from the sulphide sulphur of a given weight of a sample to be analyzed with a standard series of stains prepared from sulphide solutions of known sulphur content. A set of stains varying in depth of color from a faint yellowish brown to black representing from 0.0002% to 0.004% of sulphide sulphur may be prepared and used indefinitely for comparison. With a set of standard stains at hand the method has the advantage that within the range given the sulphide sulphur of a sample may be determined with a fair degree of accuracy in less than ten minutes.

Preparation of Standard Set of Sulphide Stains. The apparatus used for preparing standard stains and for making analyses is very simple. The inner tube of a Liebig condenser with its larger end about 18 mm. in internal diameter is cut off 15 cm. in length. The smaller end is drawn down somewhat, rounded and fitted to a sound cork stopper which in turn is fitted to a 100 cc. round-bottom flask. The condenser tube then serves as a sort of reflux condenser. To the upper and larger end of this tube a filter paper moistened with a dilute solution of lead acetate is smoothly fitted and tied, so that the steam passing up through the tube and carrying hydrogen sulphide is required to pass out through the lead acetate paper. A similar tube with the internal diameter of its larger end about 36 mm. is also prepared and used for sulphide sulphur samples containing 0.001% or more of sulphur.

A solution of sodium sulphide is made up with pure distilled water and carefully standardized. The solution is then diluted to contain exactly 0.01% of sulphide sulphur. This solution is used for making up standard solutions containing 0.0002, 0.0004, 0.0006, 0.0008, 0.001, 0.002, 0.003 and 0.004% of sulphide sulphur respectively, taking care to use distilled water free from traces of nitrites in making the dilutions. It is found that the more dilute sulphide solutions when made up with ordinary distilled water lose their sulphide content either wholly or in part on standing for several hours in stoppered bottles. This difficulty is obviated by using nitrite free distilled water in making up the solutions.

Carefully measured portions of 1 cc. to 5 cc. of the standard solutions are pipetted into the 100 cc. flask and 25 cc. of hydrochloric acid of about 0.5% strength is added. The flask is immediately attached to the condenser tube fitted with moistened lead acetate paper as previously described. The mixture is then gently boiled for a few minutes at such a rate that the steam issued not too rapidly from the upper end of the condenser tube. In this way the sulphide sulphur is quantitatively liberated as hydrogen sulphide and evenly deposited as lead sulphide on the moistened lead acetate paper. The undecomposed lead acetate is then washed out, the paper dried and labeled with the amount of sulphide sulphur present as one of the set of standard stains. In the same way complete sets in duplicate are prepared ranging in sulphide sulphur from 0.0002% to 0.004%.

¹ Am. Jour. Sci., Fourth Series, Vol. XLII, No. 248, August, 1916.

In making these estimations the larger condenser tube is used where a preliminary trial indicates that the amount of sulphide sulphur is equal to or greater than 0.001%. In all other cases the smaller tube is used. The maximum error, depending upon the amount of sulphur present, with the larger tube was 0.001% and with the smaller tube 0.0003%. These errors may be reduced by repeating the determination and taking the mean of several values found. In this way in the practical applications of the method the errors may be kept within reasonable limits.

Practical Applications. (1) In gas analysis. Twenty-five liters of air are slowly drawn through a Geissler bulb of the most modern type containing dilute potassium hydroxide solution. This solution is then washed into a measuring flash and made up to the mark with nitrite free distilled water and aliquot portions of this solution are used for determining the sulphide sulphur as previously described.

- (2) In coke analysis. The simplest method of estimating sulphur in coke given by Fresenius is to boil 5 grams to 10 grams of powdered coke in dilute hydrochloric acid, and to absorb the hydrogen sulphide evolved in dilute potassium hydroxide solution. The sulphur is then oxidized to the sulphate condition by chlorine water or bromine water and weighed as barium sulphate. This method is used as a control to check up the results obtained by the colorimetric method. In this method the hydrogen sulphide is liberated and absorbed as suggested by Fresenius and aliquot portions of the sulphide containing potassium hydroxide solution are transferred to the distillation flask and the previously described procedure is followed.
- (3) In paper analysis. In order that tissue paper may be used for wrapping polished metal without producing a tarnish the paper must be relatively free from sulphide sulphur. A weighed amount of paper, 1 gram to 2 grams, is cut into small pieces and transferred to the distilling flask and digested with gently boiling 0.5% hydrochloric acid, collecting the hydrogen sulphide as lead sulphide on lead acetate paper as previously described.

THORIUM

R. STUART OWENS 1

Th, at.wt. 232.4; sp.gr. 7.7; 11.00; m.p. 1700°; oxides ThO2.

DETECTION

- (1) By means of the spectroscope. Thorium shows lines of greatest intensity in the arc spectrum at 4863.3, and 4919.9. In the spark spectrum lines of greatest intensity at 3221.4, 3300.6, 4382.1, 4391.1.
- (2) By the addition of H₂O₂ to a neutral solution of the nitrates containing ammonium nitrate. See page 524.
- (3) By radio activity. Thorium compounds possess the power of continually emitting Becquerel rays and radio active emanations.

ESTIMATION

The estimation of thorium is required chiefly in the fabrication of incandescent gas mantles. Raw materials such as monazite PO₄(Ca,La,Di,Th)) and thorite (ThSiO₄) are generally used. The former usually contains from 2 to 4% of thorium while the latter runs as high as 81.5%. Thorium nitrate in a rather impure state is the chief intermediate product. The finished mantles generally contain 99% ThO2 and 1% CeO2.

Preparation and Solution of the Sample

"A" Silicates (as thorite, etc.) are decomposed by treatment with ten times their weight of fuming hydrochloric acid. This treatment usually suffices, but in cases where an insoluble residue still remains it is fused with ten times its weight of sodium carbonate in a large platinum crucible. The fusion is dissolved in hydrochloric acid and added to the solution obtained from the first extraction. After the silica and the metals of the first group are removed in the usual way the solution is freed from H2S by boiling. The thorium together with the other rare earths, calcium, magnesium, etc., are then present as chlorides and the neces-

sary separations made as detailed under gravimetric determination.

"B" Phosphates (as Monazite, etc.) (1) By Fusion with Potassium Acid Sulphate. 0.5 gram of the finely pulverized material is mixed with 10 grams of potassium acid sulphate in a large platinum crucible, covered and heated until gentle fusion takes place and no further gas is given off. Then ignite over free flame for a few minutes, cool and treat with a little water and hydrochloric acid, until complete decomposition takes place. Boil for a few minutes, allow to cool and settle and decant off the clear liquid. The residue is treated with concen-

Research Chemist, New York City.
 Lunge, "Technical Methods of Analysis."
 Benz, "Zeit. für angew. Chem., p. 297, 1902.

trated hydrochloric acid. Dilute and filter from the residue of silicic and tantalic acids. The filtrate then contains the thorium, etc., as chlorides. Determinations are made as detailed under gravimetric methods following.

- (2) By Sulphuric Acid Extraction. The finely pulverized sample is mixed with sufficient H₂SO₄ to form a paste and the mass heated gently at first, then gradually increasing the heat to low redness. After cooling the rare earths are dissolved from the mass with cold water. The thorium is then present in the solution as sulphate. After removal of the base metals in the usual way determinations are carried out as detailed below.
- "C" Oxides (as gas mantles, etc.). In the case of gas mantles the organic matter is first burned off and the resulting oxides heated with three times their weight of strong H₂SO₄ in a porcelain casserole. The mixture is heated on the sand bath at a temperature slightly below that required to drive off fumes of SO₂ for a few minutes. After cooling the contents are diluted with a small quantity of water and allowed to stand for several hours. The sulphates completely dissolve and the sample is ready for the gravimetric estimation as detailed.

SEPARATIONS

- (1) The hydroxide is insoluble in an excess of the precipitant.
- (2) The sulphate forms double salts with K₂SO₄, which are insoluble in an excess of the reagent.
- (3) Thorium oxalate readily forms a double oxalate with ammonium oxalate in an excess of the reagent.
 - (4) Thorium is precipitated together with the rare earths by oxalic acid.
- (5) Thorium and cerium may be separated from all of the other earthy metals if the hydroxides recently precipitated are suspended in water containing 4 to 5 times their weight of caustic soda and a current of chlorine gas passed through the solution. All of the other metals dissolve. The insoluble residue left under these conditions is gelatinous like aluminum hydroxide.
- (6) Thorium may be completely separated from cerium by precipitation with H_2O_2 from a neutral solution containing 10% of ammonium nitrate. The thorium being precipitated as the peroxide which on ignition readily changes to the oxide ThO₂.

GRAVIMETRIC METHOD FOR DETERMINING THORIUM

The solution of the chlorides or sulphates after being freed from the base metals, silica, etc., is made nearly neutral with ammonium hydroxide and the rare earths precipitated by the addition of oxalic acid in solution. In the case of monazite sands where 0.5 gram sample was used 1 gram of oxalic acid is generally sufficient, but in any case the precipitate should be allowed to settle and the clear solution tested by the further addition of oxalic acid. Allow to stand at least twenty-four hours, then filter and wash thoroughly with water. The precipitate is then washed into a casserole and treated with strong nitric acid, adding a little at a time until complete decomposition has taken place. Then evaporate to dryness on the steam bath to remove the excess acid. A second evaporation with water should follow in cases where the precipitate is appreciable. Take up

with 10% ammonium nitrate in sufficient quantity to cause a dilution of one part of thorium nitrate in 100 parts of water. Heat to 60°-80° C. and precipitate the thorium with 20 cc. of pure 3% H₂O₂ solution for each 100 cc. solution. The precipitate which is usually colored yellow by traces of cerium peroxide is filtered at once, washed with hot water containing ammonium nitrate. By reprecipitation after solution in nitric acid and neutralizing the excess acid with ammonia pure thorium peroxide may be obtained. The precipitate is ignited in a platinum crucible and weighed as ThO₂.

Thorium nitrate is assayed by precipitating the thorium as peroxide accord-

ing to the details given above.

DETERMINATION OF MINUTE AMOUNTS OF THORIUM JOLLY'S METHOD¹

Solids after pulverizing are fused with an alkali carbonate at 1000° C. and the fusion extracted with water. The residue is dissolved in dilute hydrochloric acid and set aside for some days in order to allow thorium disintegration products to develop. The thorium is then determined by boiling off the emanations in a constant stream of air which is passed through an electroscope. The rate of discharge of the electroscope is compared with that produced when a known amount of thorianite was tested. It is necessary to boil the solutions before testing to expel any radium emanation that may be present.

¹ J. S. C. I., 8, Vol. **84, 422.**

WM. S. SELLERS1 AND B. S. CLARK2

Sn, at.wt. 118.7; sp.gr. 6.56; m.p. 232°; b.p. 2275°; oxides SnO, and SnO.

DETECTION

Tin is separated, together with arsenic, antimony, gold and platinum, from the hydrogen sulphide precipitate of the metals of the second group, by the action of vellow ammonium sulphide. (Normal ammonium sulphide does not readily dissolve the sulphides of tin.) If the ammonium sulphide solution is acidulated with hydrochloric acid and the acid solution reduced with iron, antimony, arsenic, platinum and gold are precipitated in the metallic form. The presence of tin, which is present as stannous chloride, is indicated by the reducing action of the solution on mercuric chloride, a white precipitate of HgCl or a gray precipitate of Hg being thrown down.

Reduce the hydrochloric acid solution of the sample by means of a small piece Treat with an excess of cold potassium hydroxide. Filter if the solution is not clear. Add an ammoniacal solution of silver nitrate. (One part AgNO₃: 16 parts NH₄OH.) A brown precipitate of metallic silver indicates the presence of tin. Antimony, arsenic, platinum and gold are precipitated by the iron, while all of the heavy metals remaining, except lead, tin, aluminum, chromium, and zinc, are removed by the treatment with potassium hydrate.

Welch and Weber's recommend the following method for detection of tin: Add 10 cc. concentrated hydrochloric acid to the superficially dried precipitated sulphides from the ammonium sulphide separation. Filter off arsenic which does not decompose. Dilute filtrate to 70 cc. volume. Saturate with H₂S. Heat to expel excess H.S. Add 5 cc. of hydrogen peroxide and heat until precipitate is redissolved. Add 5 to 10 grams of oxalic acid and pass H₂S into the hot solution. Antimony separates as a red sulphide. Filter. Filtrate contains the tin. Reduce with test lead and add mercuric chloride. White or grayish precipitate indicates presence of tin.

ESTIMATION

The estimation of tin is required in connection with the analysis of tin ores, dross, ashes, dust, tin plate, alloys such as solder, canned foods, and general analysis.

Opening Up Tin Ores

As the oxides of tin are not readily soluble in acids the tin can be most easily removed by assay. Ores, slags, dross, and ashes are first subjected to the assay process. The button obtained is then analyzed either volumetrically or gravi-

Chief Chemist, American Can Company.
 First Assistant Chemist, American Can Company.
 Jour. Am. Chem. Soc., \$8, 5, 1011, 1916.

metrically by one of the methods given below. Having the weight of the button and the per cent of tin in it, the per cent of tin in the sample as received can be calculated.

There are two general processes of assaying, namely, the Cyanide Process and the Carbonate of Soda Process.

The Cyanide Process

The theory of this method is that the oxides are reduced to the metal by the action of potassium cyanide, the reaction being represented as follows:

$$SnO_2 + 2KCN = Sn + 2KCNO$$
.

Potassium cyanide reduces other metals also so that the button obtained is not pure.

Procedure. Take 100 grams of the sample which has been dried and finely powdered. (For complete analysis the moisture should be determined in the usual way.) Mix thoroughly with four times its weight of powdered potassium cyanide. Place about 1 in. of potassium cyanide in the bottom of a number H (height 5½ ins., diameter 3½ ins.) Battersea clay crucible. Place the mixture of sample and cyanide on top of the cyanide in the crucible and cover with enough more cyanide to fill the crucible to within 1 in. of the top.

Place the crucible in the assay furnace and heat slowly until it has been thoroughly warmed and the cyanide begins to melt. Then increase the heat gradually to a pure white, taking care that the cyanide does not boil over. Grasp the crucible with the tongs and tap it gently on the hearth to assist in settling the metal. Continue the heating until all of the organic matter has disappeared, adding more cyanide from time to time if necessary. Near the end of the process the molten mass becomes clear and transparent and finally pasty and translucent. When this last condition appears, remove the crucible from the furnace and allow it to cool slowly at the temperature of the room.

When cool, break the crucible and slag away from the button. The appearance of the button and the slag immediately surrounding it indicates whether or not the process has been properly manipulated. The button itself should be firm and compact and the slag around it should be white or greenish in color. If the button is spongy or if the slag has a dirty black color, the assay should be discarded and a new determination made, using a fresh sample.²

Weight of Button = per cent Metal in Sample.

$$\frac{\text{Weight of Metal} \times \text{per cent Sn}}{100} = \text{per cent Sn in the Sample.}$$

Note. This process should be carried on under a hood in a segregated room, and every precaution should be taken to avoid breathing the poisonous fumes of potassium cyanide.

¹Lunge advises that the cyanide should not be allowed to boil. He uses a small sample (10 grams). "Technical Methods of Chemical Analysis" 1, Part 1, p. 256. It is our experience that satisfactory results are not obtained unless the extreme heat of the furnace is used.

² See also Mellor, "A Treatise on Chemical Analysis," p. 270, 1913.

The Sodium Carbonate Method

The sample is fused with equal parts of sodium carbonate and sulphur. The fusion is then dissolved in water. The tin goes into solution as a thiostannate of sodium. Iron and copper are then separated by the addition of sodium sulphite, leaving arsenic, antimony and tin in solution.2

Other Methods of Opening Tin Ores

Fusion with Sodium Hydrate. The sample of ore is fused with ten times its weight of sodium hydrate. The process is carried out in an iron crucible and then transferred to nickel. The fused mass is dissolved in water and the tin determined in the usual way.3

Reduction by Means of Hydrogen. The ore may be reduced by strongly igniting in a porcelain tube in a current of hydrogen. The reduced metal is then dissolved in hydrochloric acid and the tin estimated by a standard method.

Fusion with Sodium Peroxide. J. Darroch and C. Meiklejohn opened ores, slags, etc., by fusing with sodium peroxide in a nickel crucible. They dissolve the fused mass in hot water and acidify with hydrochloric acid. The sample is then ready for the necessary separations.

SEPARATIONS

Tin is separated from iron, aluminum, chromium, etc., by the insolubility of its sulphide in dilute hydrochloric acid. Tin, together with antimony, arsenic, platinum and gold, is separated from lead, mercury, copper, cadmium and bismuth, by the solubility of its sulphide in yellow ammonium sulphide. Antimony, arsenic, platinum and gold are precipitated as metals from a hydrochloric acid solution by the action of metallic iron, leaving tin in solution.

A few special separations are of interest.

Tin and Lead. For the analysis of an alloy of lead and tin, it is usually preferable to make the estimations on different samples. In this case, lead is estimated by Thompson's method and the tin by Baker's modification of the iodine method. Lead can also be separated from tin by the method given below for the separation of tin and copper.

Tin and Copper. This alloy can be dissolved in concentrated hydrochloric acid by the addition of potassium chlorate. A large excess of ammonium tartrate is added and the solution made alkaline with ammonia. Copper is then precipitated as sulphide by the addition of hydrogen sulphide water until no more precipitate is formed.

- ¹Very finely divided carbon is sometimes preferred. Air must not be allowed to enter the crucible. Else decomposition is not complete. Mellor, "A Treatise on Chemical Analysis," 1913, p 270. If carbon is used instead of sulphur the process becomes one of reduction to the metal and is carried out in the assay furnace. The details of operation are similar to the cyanide process. The metal separates as a button in the bottom of the crucible. The button contains other metals with the tin and must be analyzed further for exact percentages.
 - Mellor objects to the method as being tedious and dirty.
 Low, "Technical Methods of Ore Analysis," 3d Ed., pp. 208-213, 1908.
 Engineering and Mining Journal, 81, 1177, 1906.

Tin and Antimony. Antimony is separated, in the metallic form, from the hydrochloric acid solution of the alloy, by the action of metallic iron placed in the solution. The tin may be determined by the iodine method without the removal of the antimony. If the antimony is desired, it may be filtered off and determined in the usual way.

As in the case of lead, it is usually quicker and more accurate to make these determinations on separate samples. The tin can be determined by the iodine method. The antimony can be determined volumetrically by various methods, preferably the bromate. (See chapter on Antimony.)

Tin and Phosphorus. One-half gram of the alloy is dissolved in 15 cc. of concentrated hydrochloric acid containing potassium chlorate. This is diluted to 200 cc. with water and warmed. It is then treated for a long time with hydrogen sulphide gas. The tin is all precipitated as sulphide while the phosphorus remains in solution.

Tin and Iron and Aluminum. Tin is separated from iron and aluminum by precipitation, as sulphide, from the hydrochloric acid solution.

Iron may also be separated from tin with copper, and lead by precipitation as sulphide from the alkaline ammonium tartrate solution.

Tin and Tungstic Acid. Donath and Mullner 1 separate tin oxide from tungstic acid by mixing the sample with zinc dust and strongly igniting in a covered crucible for fifteen minutes—boiling with dilute hydrochloric acid; oxidizing with potassium chlorate to change the blue tungstic oxide to tungstic acid and diluting with water. It is then allowed to stand overnight and filtered. The tin is in solution.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF TIN

Determination of Tin or the Oxides of Tin by Hydrolysis

This method depends upon the precipitation of meta-stannic acid in the presence of ammonium nitrate when the stannic chloride is diluted to considerable volume and heated to boiling. It is especially applicable to the determination of tin oxide in tin paste, but may be extended to all chloride solutions of the higher oxides. The reaction involved proceeds as follows:

$$SnCl_4+4NH_4NO_3+3H_2O$$

= $H_2SnO_3+4NH_4Cl+4HNO_3.^2$

Stannous tin may be determined by oxidizing the chloride solution to the stannic form. The method gives concordant results and is rapid.

Procedure. For the analysis of tin paste take a catch weight of about 10 grams for a sample. Dissolve this sample by heating it in a No. 6 beaker with 300 cc. of concentrated hydrochloric acid. Transfer the acid solution to a 500-cc. volumetric flask and make up to the mark with dilute (1:1) hydrochloric acid.

¹ J. Chem. Soc. Absts., 54, 531, 1888. ² Fresenius, "Quantitative Chemical Analysis," 1, 406, 1903. Sodium sulphate may be used instead of ammonium nitrate. In that case the reaction is

$$SnCl_4 + 4Na_2SO_4 + 3H_2O = H_2SnO_3 + 4NaCl + 4NaHSO_4$$

Take 50 cc. (approximately 1 gram) for a working sample. (If the determination is to be made on tin paste, the sample may be obtained directly by one of the methods described under Opening Tin Ores.) Dilute to 100 cc. with cold water. Nearly neutralize with strong ammonia and finish by adding drop by drop from a burette, dilute ammonia until a slight permanent precipitate is formed. A large amount of ammonia will tend to precipitate iron, if present, as a hydrate and to re-dissolve the meta-stannic acid. Add 50 cc. of a saturated solution of ammonium nitrate. Dilute to 400 cc. with boiling water, stirring constantly. Bring the solution to an incipient boil, remove from the flame and allow the beaker to stand on the steam bath unvil the precipitate has settled.2 The solution above the precipitate should be clear. Decant the supernatant liquor through a 12½ cm. S. & S. 590 filter paper and wash the precipitate by decantation six times, using 200 cc. of boiling water and allowing the precipitate to settle thoroughly at each washing. Transfer the precipitate to the filter, "cop" out the beaker and wash down with hot water in the usual way. After the precipitate has been allowed to drain, transfer to a porcelain or a silica crucible and dry carefully on an asbestos board over a Bunsen flame. When dry, ignite at a low temperature until the filter paper has been consumed. Increase the heat and finally blast to constant weight.

 $\frac{\text{Weight SnO}_2 \times 100 \times .7877}{\text{Weight of sample}} = \text{per cent Sn.}$

Determination of Tin as Sulphide

The determination of tin as a sulphide involves many difficulties and should be avoided if possible. Better results can be obtained by the volumetric methods and in most cases without the necessity of preliminary separations of interfering metals. If tin must be separated as a sulphide, better results would be obtained if the precipitate were dissolved and the tin content determined by the iodine method.

Having the hydrochloric acid solution of tin after the interfering metals have been separated, to precipitate tin sulphide, neutralize with ammonia and then acidify with acetic acid. Pass hydrogen sulphide until the solution is saturated. Allow the precipitate to settle overnight. Pour the supernatant liquor off through a Gooch crucible and wash the precipitate six times by decantation, using a solution of ammonium nitrate * for wash water. Finally transfer to the crucible and wash free from chlorides. Dry the crucible in an oven at 100° C. Heat slowly in a Bunsen flame until * all the sulphur has been expelled. Care should be taken at this point to avoid forming fumes of stannic sulphide by heating too rapidly.

¹ Some practice is required to judge accurately the exact point when the necessary amount of ammonia has been added. The precipitate should appear white.

² If the boiling continues more than a few seconds the precipitate will not settle properly. Time will be saved in this case if the sample is discarded and a new determination commenced.

If meta-stannic acid is washed over onto the filter at this point, clogging will result and a great deal of time will be lost.

4 Spattering is likely to occur here, causing loss.

⁶ Sulphide of tin separates as a slimy mass which tenaciously retains alkaline salts, especially in the absence of ammonium salts. Mellor, "Treatise on Chemical Analysis," p. 308, 1913.

Bichloride of tin, Acker process, page 425.

Remove the lid of the crucible, which should be kept in place during the first part of the heating, and raise the temperature gradually, finally finishing with the blast. As sulphuric acid is usually present in some quantity, the crucible should be cooled and a small piece of ammonium carbonate should be placed in it. Repeat the ignition to drive out the acid. Cool and weigh as SnO₂.¹

BICHLORIDE OF TIN

Bichloride of tin is of great importance in some of the industries, especially the textile. It is necessary to have exact analytical control of the processes in which this compound is used in order to insure uniform results and to certify the efficiency and economy of the process. Several methods have been developed for this purpose. The ones given below have had practical application and have proven to be satisfactory.

Stannic Acid Method.—Hot-water Precipitation. In the textile industry where bichloride of tin is used, the efficiency of the process depends directly on the neutrality of the tin liquor. If there is more than enough chlorine present in the bichloride solution to exactly oxidize all the tin to the stannic form, this excess is called "free HCl." If there is not enough chlorine present to do this, the deficiency is spoken of as "basic HCl." The difficulty of determining the "free" or "basic" HCl is apparent when it is known that SnCl4 readily decomposes in water, liberating free acid. The following method has been developed especially for this purpose and has given good results.

The important point in this analysis is to determine whether the liquor has "free" HCl present or whether it is "basic" in nature. It has been found that hot water precipitates tin from the SnCl₄ solution as stannic hydroxide and at the same time liberates the chlorine as free HCl.

$$SnCl_4+4H_2O = Sn(OH)_4+4HCl.^2$$

The Sn(OH)₄ separates in a colloidal precipitate which may be filtered off and the tin estimated as SnO₂. The liberated acid may be determined in the filtrate, and from this data the "free" or "basic" HCl can be calculated.

Procedure. For accurate work about 20 grams of the liquor should be weighed out in a tared weighing bottle, but for works control, where time is an important factor, it is sufficiently accurate to get the specific gravity of the liquor by means of a hydrometer and take a measured quantity for a sample, calculating the weight from these data.

Transfer the sample to a 100-cc. volumetric flask. Make up to volume with cold distilled water. Draw out of this solution 10 cc. (approximately 2 grams) and place in a 150-cc. tall beaker. Fill the beaker nearly full with boiling hot water, stirring continuously while the water is being poured in. Place the beaker on top of the steam bath and allow the precipitate to settle. Decant the liquor

¹ This method is generally used only when minute traces of tin are present, and then it is considered best to dissolve the sulphide in hydrochloric acid and make the final determination by the iodine method. (See analysis of Canned Foods for "Salts of Tin," page 536.)

² Holleman and Cooper, "Text Book of Inorganic Chemistry," 4th Ed., 1912.

³ If the solution is not stirred at this point, the precipitate will not settle and trouble will be experienced during the filtering process.

through an 11 cm. 590 S. & S. filter ¹ and wash the precipitate six times by decantation, using hot water. Now transfer the precipitate to the filter and continue the washing until 1 drop of the filtrate gives no test for chlorine. After most of the water has drained out of the filter, place the paper and precipitate in a tared silica crucible. If there is plenty of time, dry the contents of the crucible on an asbestos board over a low Bunsen flame. In case the analysis must be made in a hurry, cover the crucible ² and heat it very carefully over a low flame until all the water has been driven out and the paper has been charred. Then remove the cover and increase the heat to the full Bunsen flame and finally blast to constant weight. Weigh as SnO₂. Titrate the filtrate with N/1 NaOH, using methyl orange as the indicator.

Calculation:

 $SnO_1 \times .7877 = Sn$ $Sn \times 2.1945 = SnCl_4$ $SnCl_4 - Sn = Cl$ equiv. to Sn $Cl \times 1.0282 = HCl$ equiv. to Sn $\frac{HCl}{Weight \text{ of sample}} = per \text{ cent } HCl \text{ equiv. to } Sn$ $\frac{cc. N/1 \text{ NaOH} \times .03646}{Weight \text{ of sample}} = per \text{ cent } HCl \text{ (actual)}.$

The difference between these last two figures equals "free" or "basic" HCl. The Acker Process Method. The theory of this method is practically the same as that of the hot-water method, except that in this case the liberated acid is neutralized with ammonia before the stannic hydroxide has been filtered off, the advantage being that any solution of the stannic hydroxide, by either acid or alkali, is prevented. The method is not applicable for the determination of "free" or "basic" HCl.

Procedure. Weigh out 25 cc. of the bichloride of tin solution. Transfer to a 500-cc. flask (volumetric) and make up to volume with cold water. With a standardized pipette, transfer 25 cc. of this solution to a No. 4 beaker. Dilute with hot water to precipitate most of the tin as stannic hydrate. Add 10 drops of phenolacetolin (1 gram of phenolacetolin dissolved in 200 cc. of water). Titrate very carefully with dilute ammonia until the appearance of a rose-red color. Boil a few minutes on the hot plate. Allow the tin precipitate to settle. Decant through an 11-cm. filter paper (S. & S. 589, black ribbon brand). Wash rapidly with hot water without allowing the precipitate to cake down in the filter until the washings are free from chlorine. Dry the precipitate in an oven at 100° C. When dry, invert the filter into a tared porcelain crucible and heat on a gauze until the paper has disappeared. Remove the gauze and heat with the full

² This precaution must be taken, else there will be a loss by decrepitation.

³ Kindness of W. F. Dorflinger, chief chemist of Perry-Austin Manufacturing

*Luteol may be used as indicator, giving a yellow color at the end-point. It is slightly more delicate but much more expensive.

¹ Time may be saved by using a platinum cone with the filter and applying a gentle vacuum. This can be done with very little danger of breaking the paper.

Bunsen flame for a few minutes. Finally blast to constant weight.¹ Weigh as SnO.

Take the filtrate and washings and dilute them to a volume of 1000 cc. Warm 500 cc. of this solution and saturate it with hydrogen sulphide. If any tin separates, filter and ignite in a tared porcelain crucible. Moisten with a little nitric acid and heat very slowly to drive out the acid. Ignite to constant weight. Weigh as SnO₂. Add this result to the SnO₂ obtained above when calculating the final result.

Determination of Tin in Bichloride of Tin as Sulphide

This method is given as an alternative for the Acker Process Method and may be used as a check on that process. Uniform and concordant results have been obtained by the use of the two methods.²

Procedure. Weigh out 25 cc. of bichloride and dilute to 500-cc. volume with cold distilled water. Take 25-cc. portions of this solution for analysis. Dilute the sample to 250 cc. Saturate with hydrogen sulphide. Warm the mixture on a hot plate at a temperature of about 65° C. until the precipitate is coagulated. Test the clear supernatant liquor for unprecipitated tin by adding a little hydrogen sulphide water. Filter on an ashless filter and wash free from chlorides. Make the filtrate and washings up to 1000 cc. volume for further determinations. Dry the tin sulphide precipitate on the filter in an oven at 100° C. Remove the precipitate from the paper as completely as possible. Ignite the paper in a weighed porcelain crucible. Cool and add a few drops of nitric acid. Repeat the ignition, heating very carefully at first until the acid has nearly all been driven out. Now place the main tin precipitate in the crucible. Cover, heat gently for a few minutes, moisten with fuming nitric acid, ignite very carefully for one-half hour and then blast for fifteen minutes. Weigh as SnO₂.²

VOLUMETRIC DETERMINATION OF TIN

Volumetric methods for the determination of tin are based upon the reducing power of stannous compounds. They vary according to the oxidizing agent used and the details of manipulation.

Lenssen's Iodine Method as Modified by Baker.⁴ This method is a modification of Lenssen's Iodine Method for the determination of tin in alkaline solutions. It is especially applicable to the determination of "salts of tin" in canned foods and to the estimation of tin coating on tin plate, but is accurate, rapid and very satisfactory for alloys and general analysis.

The method is based on the action of iodine in the presence of stannous chloride in hydrochloric acid solution. The reaction involved is:

$SnCl_2+I_2+2HCl=SnCl_4+2HI$.

¹ If there has been any reduction, a few drops of nitric acid may be added and the ignition repeated, heating slowly at first to prevent loss by decrepitation.

² W. F. Dorflinger, Perry-Austin Manufacturing Company.

³ Pure ammonium carbonate may be added at the end to drive off the sulphuric acid more rapidly.

⁴ The details of this method as given were developed by Mr. H. A. Baker at this laboratory and have been modified in accordance with the findings of several years of experience.

Iron, lead and antimony do not interfere with the reaction. Copper in small quantities does not interfere with the determination, but if it is present in large quantities as a salt, it is likely to produce low results. Determinations made by the writer show that results are accurate when less than 10% of copper, as copper chloride, is present. Larger amounts gave consistently low results. The reason for this fact centers around the difficulty of reducing all the copper to the cuprous form. If any CuCl₂ is left in the solution, it reacts with the potassium iodide of the iodine solution, causing the precipitation of CuI and the liberation of free iodine.

$$CuCl_2+2KI=CuI+2KCl+I$$
.

Copper present as the metal is not easily soluble or goes into solution in the reduced form and is not likely to disturb the determination.2

Solutions—Standard Tin Solution. Dissolve 5,79 grams of Kahlbaum's C. P. tin in C. P. hydrochloric acid. The solution of the tin is effected by placing about 150 cc. HCl in an Erlenmeyer flask, together with the tin, and boiling. After the tin has all been dissolved, transfer to a volumetric liter flask and make up to the mark with dilute hydrochloric acid.

1 cc. = .00579 gram Sn.

Standard Iodine Solution. Dissolve 12.7 grams of C. P. iodine in a water solution of 20 grams of potassium iodide. Make up to one liter and standardize against the standard tin solution. For tin plate analysis, it is convenient to adjust the iodine solution so that 1 cc. equals exactly .00579 gram of tin. Then, if a sample of the plate having a total surface of 8 sq.ins. is taken, 1 cc. of the iodine solution is the equivalent of one-tenth of a pound per base box.

Indicator. Dissolve 5 grams of pure soluble starch in 1 liter of water.

Air-free Water. Dissolve 12 grams of bicarbonate of soda in 1 liter of water. Add 20 cc. HCl and allow the resulting gas to escape. Keep in a stoppered bottle.

Procedure. For practical purposes, take a sample, such that the tin content will be between .2 gram and .5 gram. A larger sample should be taken for extreme accuracy in order to decrease the possible technical error. Place the sample in flask A of the Sellars apparatus, Fig. 68, together with 100 cc. of conc. C. P. HCl. Stopper the flask and connect tubes B and D, as shown in the illustration. Boil until the metal is all dissolved. This point is indicated by the cessation of the hydrogen evolution and the appearance of large welldeveloped bubbles. If a sufficient amount of metallic iron is present in the sample, complete reduction is assured. If no iron was present in the sample, or if there was not enough to reduce all of the tin, make sure that the tin is all converted to the stannous form by adding aluminum foil (about 1 gram). Replace the stopper and connect as originally. Boil until normal bubbles reappear. Open cock C to allow CO_2^4 gas to enter. Place the flask in cooling bath F without disconnecting the apparatus. After the solution has become thoroughly

² Sulphates must not be present. They tend to have an oxidizing effect and spoil the results.

There should always be an excess of bicarbonate of soda present in order that carbon dioxide will be generated during the washing process, thus preventing air from entering the flask at any time during the analysis.

4 Carbon dioxide generated in a Kipp apparatus is likely to contain oxygen. It is much better to use liquid CO₂ such as can be purchased in the open market.

¹ Mr. B. S. Clark.

cool, disconnect tubes B^1 and D^1 from the splash bulbs. Wash the bulbs with " air free" water, allowing the washings to drain into the bulk of the sample. Remove the stopper and wash down the sides of the flask. About 50 cc. of water should be used in the washing so that the final sample contains about 25% HCl. Add 5 cc. starch solution and titrate with the standard iodine solution.

$$\frac{\text{cc. iodine} \times .00579 \times 100}{\text{Weight of Sample}} = \text{per cent Sn,}$$

or

$$\frac{\text{cc. iodine}}{10} = \text{pounds per "base box."}^2$$

The Sellars Apparatus. This apparatus is a device designed by Mr. W. S. Sellars of this laboratory for the purpose of facilitating the solution of tin samples out of contact with air. Added to this advantage, it is equipped with a water

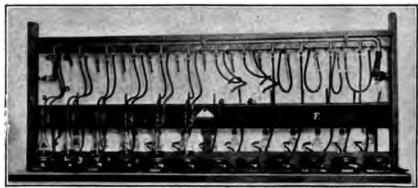


Fig. 67.—Sellars' Apparatus.

cooler. It is also constructed so that the tubes and scrubbing bottles can be cleaned by flushing with water. The use of this apparatus practically eliminates the usual sources of error in connection with the iodine method, and at the same time greatly increases the speed of the determination. Fig. 67 shows the apparatus in operation.

- A. 1 300-cc. Erlenmeyer flask.
- B.1 Connection with reduced pressure line from liquid carbon dioxide cylinder.
- C.1 Glass manifold.
- D.1 Exit connection to trap.
- E.1 Water trap to prevent escape of HCl fumes and to prevent air from backing into the flask.
- F.1 Cooling tank.
- G.1 Low-pressure water wash-out manifold.
- H.1 Perforated feed pipe to water cooler.
- K.1 Outlet for cooler.
- L.1 Electric hot plate.
- M.1 Lead drain pipe.

¹ See Fig. 68, page 535. ² "Basebox"—112 sheets of tin, 14×20 ins.

Ferric Chloride Method.¹ This method depends upon the reduction of ferric hloride by stannous chloride in hot solution.

 $SnCl_2+2FeCl_3=SnCl_4+2FeCl_2$.

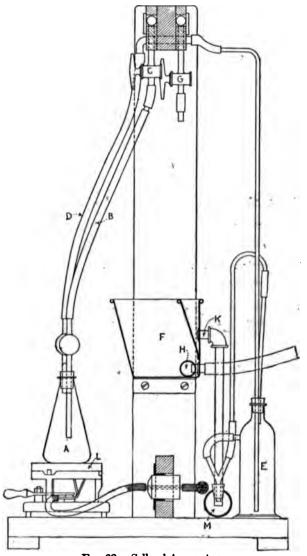


Fig. 68.—Sellars' Apparatus.

¹C. Mene, Dinglers Journal, 117, 230, 1850. K. Pallet and A. Allart, Bul. Soc. Chim. (2) 27, 43, 438, 1877. H. J. B. Rawlins, Chem. News, 107, 53, 1913. H. Nelsmann, Zeit. Anal. Chem., 16, 50, 1877.

Antimony, copper, arsenic, bismuth, mercuric chloride, tungsten and titanium must be absent.1

The Standard Solution of Ferric Chloride is made by dissolving pure iron wire in hydrochloric acid. To standardize this solution, dissolve 1 gram of pure tin in 200 cc. of C. P. HC!, preventing air from coming in contact with the solution by means of a trap, or by passing carbon dioxide over it.2 Titrate this standard sample with the ferric chloride solution. The end-point is indicated by the yellow color, due to a slight excess of the iron solution.

Procedure. Tin is first separated from the interfering metals in the usual way. If lead, copper, arsenic, antimony or bismuth are present, the sample is first reduced, in the hydrochloric solution, with iron wire. The solution is then filtered. Lead and tin remain in the filtrate. Neutralize by adding strips of zinc until the action ceases. Tin and lead are precipitated. The clear liquid should show no trace of tin with hydrogen sulphide. Allow the precipitate to settle and wash by decantation, keeping the precipitated metals in the flask. Add 150 cc. of concentrated hydrochloric acid, keeping the contents of the flask protected from the air, and bring to a boil. When everything is dissolved, titrate to a yellow color with the ferric chloride solution.3 This part of the analysis should be done very quickly to prevent oxidation by the oxygen of the air.

ELECTROLYTIC DETERMINATION OF TIN

Henz and Classen's Method. Results with this method at this laboratory have not been satisfactory.

Procedure. The tin is obtained as sulphide, dissolved in sodium sulphide solution and acidified with dilute acetic acid. It is then heated to boiling, and a boiling solution of equal parts of ammonium oxalate and oxalic acid added. The amount of this solution added should be such that the final mixture will contain thirty-five parts of oxalate and oxalic acid to one part tin. Use a current of .2 to .3 amp. having a voltage of two to three volts. After six hours add 'more oxalic acid and continue the electrolysis for another twenty-four hours.

ESTIMATION OF TIN IN CANNED FOOD PRODUCTS 4

The tin in the canned food products is obtained as a sulphide precipitate from wet combustion, with nitric and sulphuric acids, of 100 grams food product.

The clear sulphuric acid residue is diluted, neutralized with ammonia and then rendered about 2% acid with hydrochloric acid, after which it is thoroughly saturated with hydrogen sulphide gas. This precipitate is then filtered on a Gooch crucible with a false bottom. The precipitate may contain foreign substances, such as lime, phosphorus, and silica, some lead, or even small amounts of

Lunge, "Technical Methods of Chemical Analysis," 2, Part I, p. 267.
 The Sellars apparatus can be used with advantage for this purpose.
 The end-point can be easily identified by looking at a blue Bunsen flame through the solution. When a small quantity of ferric chloride is present, the flame appears green. Mellor, "A Treatise on Chemical Analysis," p. 310, 1913.

4 H. A. Baker, Eighth International Congress of Applied Chemistry.

iron, but none of these will cause any trouble subsequently in the titration, so that the labor of separating the tin completely from the precipitate is obviated.

After washing the precipitate three or four times in a Gooch crucible, it is transferred to a small porcelain dish by simply forcing out the false bottom of the Gooch crucible and its asbestos pad and rinsing off the crucible.

The precipitate, mixed with asbestos, is now transferred to a 300-cc. Erlenmeyer flask and boiled with strong hydrochloric acid, potassium chlorate being added from time to time to insure the complete breaking up and solution of the tin sulphide, as well as the elimination of the sulphur. This is accomplished in a very few minutes. A few strips of pure aluminum foil, free from tin, are then added to the flask until all of the chlorine is eliminated. The flask is then attached to the Sellars apparatus and the determination completed, according to the details given under the Iodine Method, using N/100 iodine solution.

Gravimetric Method. The sample is first digested to a colorless or pale

yellow solution as described under Baker's method.

Add 200 cc. water to the digested solution and pour into a 600-cc. beaker. Rinse out the Kjeldahl flask with three portions of boiling water so that the total volume of the solution is about 400 cc. Allow to cool and add 100 cc. concentrated ammonia. This amount of ammonia should render the solution nearly neutral, unless more than 50 cc. sulphuric acid have been used for digestion. The solution should be tested to see that it is still somewhat acid. In case of a large excess acid, add ammonia until just alkaline and then make about 2% acid with hydrochloric or sulphuric acid. Pass in a s'ow stream of hydrogen sulphide for an hour, having the covered beakers on an electric hot plate at about 95° temperature. Allow to digest on the hot plate for an hour or two.

Filter the tin sulphide on an 11-cm. filter. Wash with three portions of wash solution alternated with three portions of hot water. The wash solution is made up of 100 cc. saturated ammonium acetate, 50 cc. g'acial acetic acid, and 850 cc. water. The filter papers used in this method are C. S. & S. No. 590, white ribbon.

Place the filter and precipitate in a 50-cc. beaker and digest with three successive portions of ammonium polysulphide, bringing to a boil each time and filtering through a 9-cm. filter. Wash with hot water. Acidify with acetic acid, digest on the hot plate for an hour and filter through a double 11-cm. filter. Wash with two portions of wash solution alternated with hot water and dry thoroughly in a weighed porcelain crucible. Thorough drying is essential to the success of the determination. Ignite very gently at first and later at full heat of Bunsen flame. Finally heat strongly with large burner, or Méker burner, having the crucible partly covered. Stannic sulphide must be gently roasted to the oxide, but the oxide may be heated strongly without loss, due to volatilization.

Weigh the stannic acid and convert to metallic tin by the factor .7877.

¹ E. L. P. Treuthardt, Association of Official Agricultural Chemists, August 15, 1915.

TITANIUM

WILFRED W. SCOTT and L. E. BARTON 1

Ti, at.wt. 48.1; sp.gr. 4.5 2; m.p. 1795° C. $(\pm 15^{\circ})^3$; oxides TiO, Ti₂O₃, TiO2, TiO3.

DETECTION

The powdered ore is fused with potassium bisulphate, KHSO4, until effervescence ceases. The cooled mass is dissolved in dilute sulphuric acid by boiling. Hydrogen peroxide, H₂O₂, added to this titanium solution, produces a yellow to orange color, according to the amount of titanium present. Hydrofluoric acid, or fluorides, destroys the color. Vanadium also produces this color with hydrogen peroxide, but the color is not destroyed by HF. The yellow color, according to Weller 4 is due to TiO₃ formed.

Morphine produces a crimson color with solutions of titanium in sulphuric acid.

Zinc added to hydrochloric acid solutions of titanium produces a blue color,5 tin a fine violet solution.6

If sulphur dioxide, SO₂, is passed into the solution of titanium to reduce the iron, and the slightly acid solution then boiled, yellowish white metatitanic acid, TiO(OH)2, is precipitated.

Bead Test on Charcoal. A small portion of the powdered mineral heated on charcoal with microscosmic salt and tin produces a violet-colored bead if titanium is present.

ESTIMATION

The element is widely distributed in minerals, soils, clays and titaniferous iron, FeTiO₁. It is found in granite, gneiss, mica, slate, syenitic rocks, granular limestone, dolomite, quartz, feldspars and a large number of other minerals. The principal commercial minerals are:

Ilmenite, FeTiO₃, containing about 52.7% TiO₂. Rutile, TiO₂, containing 90 to 100% TiO₂. Titanite, CaTiSiO₅, containing 34 to 42% TiO₂. Perovskite, CaTiO₂, containing about 60% TiO₂ and 5 to 6% Yt₂O₃. Titaniferous ores of variable titanic oxide content.

By far the most important application of titanium at the present time is the use of ferrotitanium in the iron and steel industry. The function of the titanium

- ¹Chief Chemist Titanium Alloy Manufacturing Co.
- ² Hunter, Eighth Int. Congress Applied Chem., 2, 125.
- Burgess and Waltenburg, U. S. Bureau of Standards.

- J. S. C. I., 1882, 506-508.
 Deville, C. N., 4, 241.
 Cahen and Wootton, "The Mineralogy of the Rarer Metals."

is to deoxidize the steel and consequently to yield a product free from blow-holes and segregation of impurities. In a steel thus purified the natural strength and resistant properties of the material are developed in the highest degree.

Next in importance is the application of titanium compounds to the textile industry. For use as a mordant in dyeing, the alkali titanium salts of organic acids, especially potassium titanium oxalate, have found extensive application. The use of titanous chloride and titanous sulphate for bleaching or discharging colors is increasing. Such bleaching agents are particularly applicable for silk and wool, which are injured by the action of those bleaching agents in which chlorine is the active element. Titanium compounds have also attained considerable importance in the dyeing of leather.

Titanium compounds are also used for electric light filaments, are carbons, ceramics, fine brown glazes, paint for iron and steel, etc.

Preparation and Solution of the Sample

A knowledge of the solubility of the element and its oxides is of value in the solution of the sample.

Element. This is feebly soluble in cold dilute hydrochloric, or sulphuric acids; more readily so when the acids are heated. It is soluble in cold, concentrated hydrochloric acid; readily soluble in hot, concentrated hydrochloric, or sulphuric acids. It is scarcely acted upon by nitric acid, but readily dissolves in hydrofluoric acid. It is soluble by fusion with the alkalies.

Oxides. Ti₂O₂ is soluble in concentrated hydrochloric or sulphuric acids; forming, in the latter case, a violet-colored solution. The oxide is insoluble in water and in ammonium hydroxide.

TiO₂ is difficultly soluble in concentrated sulphuric acid, less soluble if rongly ignited. The metatitanic acid, TiO(OH)₂, requires strong hydrochloric or sulphuric acid to effect solution, the orthotitanic acid, Ti(OH)₄, however, is readily soluble in hot or cold, dilute and concentrated acids. From titanic solutions orthotitanic acid is precipitated by ammonia, the precipitation being assisted by warming. Boiling a slightly acid solution precipitates the metatitanic acid, TiO(OH)₂. TiO₂ is soluble upon fusing with alkalies. TiO₂ is soluble in hydrofluoric acid, forming TiF₄, which is volatile, unless an excess of sulphuric acid is present (distinction from silica). The ignited oxide is best dissolved by fusion with KHSO₄ and heating the fused mass with dilute sulphuric acid solution. Titanous oxides have a black or blue color.

Salts. Many titanic salts are decomposed in the presence of water, precipitating titanic acid, the extent of the decomposition depending on the quantity of water used. Titanic sulphate is readily soluble in water and the solution is remarkably stable unless largely diluted with water. Some of the double salts are readily soluble and their solutions stable, i.e., potassium titanium oxalate.

General Considerations

Solution of Steel. The sample may be dissolved in hydrochloric acid (1:2). If a residue remains it is treated with a mixture of equal parts of hydrofluoric and sulphuric acids and a few drops of nitric acid, in a platinum

¹ Ebelmen, A. Ch., (3), 20, 392, 1847.

dish, and the mixture evaporated to sulphuric anhydride fumes and to complete expulsion of hydrofluoric acid. The colorimetric procedure is now used for estimating titanium. For determination of titanium in hydrochloric acid solution see page 545.

Note. Titanium in steel treated with ferro carbon-titanium exists in two conditions: (1) Titanium soluble in hydrochloric acid. (2) Titanium insoluble in hydrochloric acid. Of the very small amount of titanium in treated steel the greater part will usually be found in the second form. When the amount of titanium in the steel is exceedingly small, the soluble titanium frequently exceeds the insoluble, and it is then occasionally desirable to determine also that existing in the second form.

Alloys. These are dissolved in concentrated nitric acid, aqua regia or a mixture of the dilute acids. Should nitric acid be used, the excess is expelled by evaporation to dryness with hydrochloric acid. The metals of the hydrogen sulphide group are removed in an acid solution by precipitation with H₂S, and titanium determined colorimetrically in the filtrate.

Ores. One to 5 grams of the ore are treated with 10 to 50 cc. of a mixture of sulphuric and hydrofluoric acids (1 to 5), a few drops HNO₃ added, and the solution evaporated to fumes to expel HF. If a residue remains upon taking up with water containing a little sulphuric acid, it is filtered off and fused with KHSO₄ as directed under the fusion method.

Fusion Method for Ores. The finely powdered sample is fused with four to five times its weight of potassium bisulphate, KHSO4, and the cooled fusion dissolved with dilute sulphuric or hydrochloric acid. In the presence of silica potassium fluoride is added to assist in the decomposition of the material.

(See Analysis of Titaniferous Ores, page 551.)

Titaniferous Slags. One-half gram of the finely ground sample is decomposed in a platinum dish by a mixture of 5 cc. water, 5 cc. concentrated sulphuric acid, 2 cc. nitric acid, and 10 cc. of hydrofluoric acid, the reagents being added in the order named. The solution is evaporated rapidly to SO₂ fumes to expel fluorides and the excess sulphuric acid until residue is left nearly dry. After cooling it is taken up with 40 cc. of dilute hydrochloric acid (1:3), which will give a clear solution containing all the constituents of the slag except silica, which has been volatilized as SiF₄. The solution is diluted to 200 cc. with cold water. Iron and titanium are precipitated by ammonia in slight excess and filtered at once without boiling. The precipitate is dissolved in cold dilute hydrochloric acid and reprecipitated with ammonia. Titanium is now separated from iron by reducing iron with SO₂ and precipitating titanium from a boiling acid solution as described on page 542.

SEPARATIONS

Details of the isolation of titanium are given in the methods for its estimation.

Separation of Titanium from the Alkaline Earths, etc. The hydroxide is precipitated when a titanium solution containing ammonium chloride is treated with ammonium sulphide, whereas barium, strontium, calcium and magnesium remain in solution. Titanium hydroxide may be precipitated by making the solution containing titanium slightly ammoniacal with HN₄OH.

Separation from Copper, Zinc, Aluminum Iron, etc. Titanium is pre-

cipitated from a slightly acid solution 1 by boiling, passing sulphur dioxide through the solution to keep the iron reduced and prevent its precipitation.

Separation from the Bivalent Metals, Manganese, Nickel, Cobalt, Zinc. Titanium is precipitated along with aluminum and iron by hydrolysis of its acetate in a hot, dilute solution, whereas manganese, nickel, cobalt and zinc remain in solution. Details of the basic acctate method are given on page 298.

Separation of Titanium from Aluminum. Small amounts of titanium from large amounts of aluminum. (One part Ti to 50 parts Al.) Cupferron. C₆H₆(NO)N·ONH₄ added to a decidedly acid solution containing titanium and aluminum precipitates titanium, but not aluminum. The precipitate is washed by decantation and then on the filter with very dilute hydrochloric acid to remove traces of aluminum. The procedure affords a separation of titanium from chromium, nickel, cobalt, manganese, etc. Copper and iron, however, precipitate with the titanium, if present in the solution. The yellow titanium salt has the composition (C₆H₆(NO)NO)₄Ti.²

Separation of Titanium from Iron. See Gravimetric Method for Determination of Titanium, Modified Gooch Method, below.

GRAVIMETRIC METHODS

Gravimetric Determination of Titanium. Modified Gooch Method 8

This method is applicable to minerals and metallurgical products that are comparatively high in titanium. The method provides for the separation of titanium from iron and from aluminum and phosphoric acid with which it commonly occurs. The procedure as proposed by F. A. Gooch and modified for non-aluminous rocks by Wm. M. Thornton has been found by the author 4 to give reliable results. The details of the method with a few slight changes found to be advantageous are given below. Iron is separated from titanium by precipitation as a sulphide in presence of tartaric acid, the organic acid is destroyed by oxidation and titanium precipitated from a boiling acetic acid solution. In the presence of alumina and phosphoric acid the impure precipitate is fused with Na₂CO₂ and the impurities leached out with boiling water. In presence of zirconium, titanic acid is incompletely precipitated. Hillebrand's modification for the removal of zirconium is given in the notes.

Procedure. Preparation of the Sample. Ores High in Silica. These may be decomposed by taking to SO, fumes with a mixture of 10 to 15 cc. of 50% hydrofluoric acid, HF, and 3 to 4 cc. of concentrated sulphuric acid per gram of sample.

Oxides. Decomposed by fusion with sodium or potassium bisulphate. fusion is dissolved in 10% sulphuric acid, keeping the volume as small as possible. The sample should contain not over 0.2 gram titanium.

Precipitation of Iron. To the solution containing titanium, tartaric acid, equal to three times the weight of the oxides to be held in solution, is added. This should

¹Acidity exactly 0.5% is best according to Levy, C.N., **56**, 209.

²Analyst, **36**, 520, 1912, method of J. Bellucci and L. Grassi.

³F. A. Gooch, Proc. Am. Acad. Arts and Sci., New Series, **12**, 435. Wm. M. Thornton, C. N., **107**, 2781, 123, 1913.

⁴W. W. Scott.

not exceed 1 gram of the organic acid, as the subsequent removal of larger amounts would be troublesome. H₂S is passed into the solution to reduce the iron and NH₄OH added to slight alkalinity followed by a further treatment with H₂S to completely precipitate FeS. The solution should be faintly alkaline (litmus) otherwise more ammonia should be added. After filtration and washing of the ferrous sulphide with very dilute and colorless ammonium sulphide, the titanium is entirely in the iron-free filtrate.

Oxidation of Tartaric Acid. Since titanium cannot be precipitated by any reagent in the presence of tartaric acid, the organic acid is oxidized by addition of 15 to 20 cc. of concentrated sulphuric acid to the sample placed in a 500-cc. Kjeldahl flask. The solution is evaporated to incipient charring of the tartaric acid. After cooling slightly, about 10 cc. of fuming nitric acid are added cautiously, a few drops at a time, and when the violent reaction has subsided the flask is heated gradually (hood), a vigorous reaction taking place accompanied by much effervescence and foaming with evolution of copious brown fumes. The organic matter gradually disappears, the effervescence becomes steady and finally ceases and white fumes of SO₁ are given off. The solution is cooled and the pale yellow syrup poured into 100 cc. of cold water, the flask washed out, adding the rinsing to the main solution. If cloudy, the solution is filtered.

Precipitation. Ammonia is added until the solution is nearly neutral, a point where the solution is slightly turbid, the precipitate dissolving upon vigorous stirring. If a trace of iron is suspected about 1 cc. of 10% ammonium bisulphate is added. Five cc. of glacial acetic acid followed by 15 grams of ammonium acetate or its equivalent in solution is added and the volume of the solution made up to about 350 cc. The solution is brought rapidly to boiling and maintained in ebullition for about three minutes. The titanium will precipitate in white flocculent and readily filterable condition. The precipitate is washed first with water containing acetic acid and finally with pure water. The filter and the precipitate are ignited cautiously over a low flame and finally blasted over a Méker blast for twenty minutes. The residue is weighed as TiO₂.

In the presence of large amounts of alumina and phosphoric acid, the residue above obtained is fused with sodium carbonate in a platinum dish and the fusion leached by boiling with pure water. Alumina and phosphoric acid go into solution as soluble sodium salts and titanium oxide remains insoluble in the residue.

Ignited insoluble residue = TiO₂.

Norm. Titanium may be separated from aluminum by fusing the residue with potassium acid sulphate, KHSO₄, and precipitation of titanium in an acid solution by cupferron. Al₂O₃ is in solution.

Determination of Titanium in Ferro Carbon Titanium. Gravimetric Method ¹

Into a 6-in. porcelain evaporating dish, weigh 0.6 gram (factor weight) of alloy.

Dissolve in a mixture of 15 cc. of dilute sulphuric acid (one acid to one water), 5 cc. of nitric acid, and 10 cc. of hydrochloric acid. Evaporate to fumes of sulphuric anhydride.

Cupferron precipitates titanium in presence of tartaric acid.
 Methods of analysis used in the laboratories of the Titanium Alloy Manufacturing Company.

Cool and take up by boiling with 50 to 60 cc. of water and 5 to 10 cc. hydrochloric acid. Filter into a 500-cc. beaker and wash the residue with hot water and dilute hydrochloric acid.

In the filtrate precipitate iron and titanium by ammonia in slight excess. Filter without boiling and wash precipitate twice on filter with hot water.

Reject filtrate. Dissolve the precipitate in a very little dilute hydrochloric acid, washing the filter with hot water and collecting the solution and washings in the original beaker.

Nearly neutralize the solution with ammonia or ammonium carbonate; dilute to 300 cc.; saturate with sulphur dioxide gas, and boil until titanic acid is precipitated and the solution smells faintly of sulphur dioxide.

Filter and wash with hot water and dilute sulphurous acid.

Dry, ignite, and weigh as titanic oxide.

Since the factor weight of sample has been used, one milligram of titanic oxide is equal to 0.1% metallic titanium.

VOLUMETRIC METHODS

The Determination of Titanium by Reduction, Addition of Ferric Salt and Titration of Reduced Iron with Potassium Permanganate 1

Principle. Titanic acid is reduced by means of zinc, an excess of ferric sulphate is added and the ferrous salt, formed by reduction by titanous salt, is titrated with standard permanganate. The method is more accurate than direct titration of the titanous salt with permanganate.

Reaction. $\text{Ti}_2(SO_4)_3 + \text{Fe}_2(SO_4)_3 = 2\text{Ti}(SO_4)_2 + 2\text{Fe}SO_4,$ or $\text{Ti}Cl_3 + \text{Fe}Cl_3 = \text{Ti}Cl_4 + \text{Fe}Cl_2.^2$

Preparation of the Sample

Procedure. One to 2 grams of the ore is decomposed by hydrofluoric and sulphuric acids or by fusion with potassium bisulphate or a combination of the two according to the methods already described. Members of the H₂S group, if present, may be removed by H₂S. If iron is present it may be determined by boiling off the H₂S in the filtrate containing Fe, Ti, etc., and allowance made in the titration for titanium. If other interfering elements are present in this filtrate, titanic acid may be precipitated by boiling the slightly acid solution (sulphurous acid) according to directions given in the gravimetric method. The washed oxide is dissolved in strong H₂SO₄ and diluted as directed below.

Reduction. The solution is washed into a 100-cc. flask and diluted with water so that it will contain 10% of sulphuric acid. This acid holds titanic acid in solution and at the same time is insufficient to oxidize the reduced titanium oxide. Sufficient zinc to cause complete reduction is added and a rubber stopper carrying a Bunsen valve tube and a thistle tube with glass stop-cock is inserted

¹ H. D. Newton, A. J. Sc. (4), 25, 130. A. F. Gooch, "Methods in Chemical Analysis."
² T. R. Ball and G. McP. Smith, Jour. Am. Chem. Soc., 36, 1838, 1914.

in the neck of the flask. The evolved hydrogen expels the air and reduces the titanic oxide to the titanous form. Iron if present is also reduced. Gentle heat is applied until the excess of zinc dissolves. The solution is cooled and an excess of ferric sulphate added through the thistle tube, followed immediately by cold distilled water until the flask is filled to the neck. The contents of the flask is poured into a No. 6 beaker containing 150 to 200 cc. of cold distilled water and the ferrous iron, formed by the reducing action of titanous salt, is titrated with N/10 KMnO₄ solution.

One cc. N/10 KMnO₄ = 0.00481 gram Ti, or 0.00801 gram TiO₂.

Volumetric Method by Reduction of Titanium and Titration with a Ferric Salt

The following volumetric method recommended by the Titanium Alloy Mfg. Co., is essentially that described by P. W. & E. B. Shimer, Proceedings of Eighth International Congress of Applied Chemistry, the method hereafter described differing principally in the form of reductor and also in a few details of operation.

Reagents. Standard ferric ammonium sulphate solution.

Dissolve 30 grams of ferric ammonium sulphate in 300 cc. water acidified with 10 cc. of sulphuric acid; add potassium permanganate drop by drop as long as the pink color disappears, to oxidize any ferrous to ferric iron; finally dilute the solution to 1 liter.

Standardize this solution in terms of iron. The iron value multiplied by 1.4329 gives the value in titanic oxide (TiO₂); and the iron value multiplied by 0.86046 gives the value of the solution in terms of metallic titanium.

Indicator. Saturated solution of potassium thiocyanate.

Reductor. As a reductor a 500-cc. dispensing burette is used. The internal dimensions of the burette are $1\frac{\pi}{2}$ by 22 ins.

The reductor is charged with 1200 grams of 20-mesh amalgamated zinc, making a column about 12 ins. high and having an interstice volume of about 135 cc. This form of reductor is connveient, and when used as hereafter described is adapted to maintaining hot solutions, which is essential for complete reduction of the titanium.

The reductor is connected to a liter flask for receiving the reduced titanium solution, through a three-hole rubber stopper which carries also an inlet tube for carbon dioxide supply, and outlet tube for connecting with the suction pump.

Procedure. Determination of Titanium in Ferro-Carbon Titanium. One-half gram of sample is dissolved in a 6-in. porcelain evaporating dish in a mixture of 10 cc. water, 10 cc. sulphuric acid, 5 cc. of hydrochloric acid, 5 cc. of nitric acid.

The solution is evaporated to fumes of sulphuric anhydride; taken up by boiling with 50 cc. water and 10 cc. of hydrochloric acid; filtered and washed with hot water and hydrochloric acid.

The filtrate and washings should be about 100 cc. in volume.

The reductor is prepared for use by first passing through it a little hot dilute sulphuric acid followed by hot water, finally leaving sufficient hot water in the reductor to fill to the upper level of the zinc.

The hot titanic solution prepared as described above is now introduced,

about 100 cc. of water being drawn from the reductor into the original beaker to bring the solution to about the upper level of the zinc. The water thus removed will not contain any titanium if the operation has been conducted as described; but it serves as a safeguard and is also convenient to acidify this water with 10 cc. of sulphuric and reserve it on the hot plate to be used as an acid wash after the reduction of the sample solution.

The titanium solution is allowed to remain in the reductor for ten minutes. · While the solution is being reduced the receiving flask is connected to the reductor and the air completely displaced by carbon dioxide, conveniently drawn from a cylinder of the liquefied gas.

When the reduction is complete the receiving flask is connected with the suction pump, and while still continuing the flow of carbon dioxide the reduced solution is drawn out, followed by the reserved acid wash and then three or four 100-cc. washes with hot water. The displacement of the sample solution and washing of the zinc is so regulated by means of the stop-cock that the reductor is always filled with solution or water to the upper level of the zinc.

When the washing is complete, gradually release the suction to prevent air being drawn back into the receiving flask.

Disconnect the flask, add 5 cc. of potassium thiocyanate solution as indicator and titrate immediately with standard ferric ammonium sulphate solution, adding the solution rapidly until a brownish color is produced which will remain for at least one minute.

The method is also well adapted for determining titanium in other titanium products, suitable means being employed for bringing the titanium into sulphuric acid solution.

Colorimetric Determination of Titanium with Hydrogen Peroxide

Preliminary Considerations. Hydrogen peroxide added to acid solutions of titanium produces a yellow to orange color, the depth of the color depending upon the amount of titanium present. Upon this fact the method is based. It is of especial value in determining small amounts of titanium, as it is possible to detect less than one part of the metal per hundred thousand parts of solution. Color comparisons can best be made on samples containing 0.05 to 5 milligrams of the element; larger amounts produce too deep a color for accurate comparison.

The following interferences should be made note of, e.g., molybdenum, vanadium and chromium also produce a color that would lead to error. Iron if present to the extent of 4\% or over produces a color that must be allowed for: e.g., 0.1 gram Fe₂O₂ in 100 cc. of solution is equivalent to about 0.2 gm. of TiO₂ oxidized by H₂O₂ in 100 cc. of solution. Fluorides destroy the color, hence must be absent.1 Phosphoric acid and alkali sulphates have a slight fading action,2 hence must be allowed for by adding equivalent amounts to the standard if they are present in the sample. The addition of an excess of sulphuric acid partly counteracts the action of phosphates or alkali sulphates.* The color intensity is increased by increase of temperature, hence the standard and the sample

W. F. Hillebrand, J. A. C. S., 17, 718, 1895.
 P. Faber, Zeit. an. Chemie, 46, 277, 1907.
 H. E. Merwin, A. J. S. (4), 28, 119, 1909.

examined should have the same temperature. Since metatitanic acid produces no color with hydrogen peroxide, its formation must be prevented; the presence of 5% of free H₂SO₄ accomplishes this.

The procedure is very satisfactory for magnetic or other iron ores. It is fully as accurate as the best gravimetric method and very much more rapid.

Solutions Required. Standard Titanium Solution. This may be prepared by precipitations of TiO₂ from K₂TiF₆ according to the gravimetric procedure and purification by solution and reprecipitation, the fluorine being first removed by taking the compound to fumes with H₂SO₄ and then hydrolyzing titanium with NH₄OH. The washed precipitate is ignited over a Méker flame

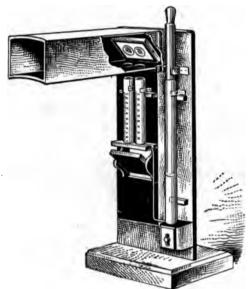


Fig. 69.—Colorimeter.

for fifteen minutes, cooled in a desiccator and placed in tightly stoppered bottle, since TiO₂ is slightly hydroscopic.

0.5 gram of TiO2 is fused with about twenty times its weight of KHSO₄ in a platinum dish, keeping at fusion heat until the oxide has dissolved. A high tempera-The fusion ture is not advisable. is dissolved in 5% sulphuric acid by gently heating. The solution washed into a 500-cc. graduated flask is made up to volume with 5% H₂SO₄. One cc. contains 0.001 gram TiO2, or 0.0006 gram Ti.

Hydrogen Peroxide. Thirty per cent solution. If this is not available sodium peroxide dissolved in dilute sulphuric acid will do.

Apparatus. Colorimeter—Fig. 69. Also see Fig. 43, page 283.

Preparation of the Sample. The solution of the sample having been obtained by one of the procedures given under Preparation and Solution of the Sample, the element may be determined according to the procedure given below. If interfering substances are present, e.g., comparatively large amounts of iron, or if tungsten, vanadium or chromium are present it will be necessary to precipitate titanic acid by adding ammonium hydroxide to the boiling solution as directed under the gravimetric determination of the element. The washed precipitate is dissolved in sulphuric acid.

Procedure. The sulphuric acid solution of titanium should contain 5% of free sulphuric acid. It is poured from the beaker in which solution was effected into a 100-cc. Nessler tube, 2 cc. of hydrogen peroxide, 30% solution are added and the volume made up to 100 cc. with 5% sulphuric acid. The standard is prepared by pouring 40 or 50 cc. of 5% sulphuric acid into a second 100-cc. Nessler tube, adding 2 cc. of 30% hydrogen peroxide, H_2O_2 , followed by sufficient

¹ Hillebrand.

² Dunnington, C. N., 64, 302; J. A. C. S., 12, 210, 1891.

standard titanium solution to exactly match the sample and the solution made up to 100 cc. with 5% sulphuric acid. The titanium solution is added from a burette, noting the exact volume required. From this the percentage of titanium in the sample can readily be calculated. If iron is present in the sample, an equivalent amount should be added to the standard. If a colorimeter is used, a standard should be prepared which is deeper in color than the sample examined. The standard is poured into the comparison cylinder and the two tubes compared. By raising or lowering the plunger (see illustration) the standard solution is forced in or drawn out of the comparison tube. When the colors match, the cc. in the comparison tube will indicate the amount of TiO₂ present in the sample. The solution may be mixed by stirring with a platinum spiral.

Example. One-gram sample required 20 cc. of titanium standard solution, 1 cc. of which contained 0.001 gram TiO₂. Then the sample contains

$$\frac{0.001\times20\times100}{1} = 2\% \text{ TiO}_{3}.$$

If the colorimeter has been used and 150 cc. of standard made by adding 30 cc. of standard titanium solution and it is found that the column of liquor in the standard comparison tube stands at 85 cc., the calculation would be as 150 cc. contains 30×0.001 gram TiO₂, therefore 85 cc. are equivalent

to
$$\frac{85\times0.03}{150}$$
 = 0.017 gram TiO₂ per gram or 1.7%.

For the practical application of the colorimetric method in determining titanium in steel the following procedure is given.

Note. Separation of Titanium from Iron. J. H. Walton, Jr. 1 separates titanium from iron by fusing the finely powdered substance with three or four times as much sodium peroxide, and extracts the fusion with water. The filtrate contains the sodium pertitanate whereas the iron oxide remains on the filter paper. The filtrate is acidified with H_2SO_4 until 5% of free acid is obtained and the color of this solution compared with a standard obtained by fusing a known weight of TiO_2 with Na_2O_2 and extracting and treating with H₂SO₄ as in case of the sample.

Colorimetric Determination of Titanium in Steel Treated with Ferro-carbon Titanium²

The titanium in steel treated with ferro-carbon titanium exists in two conditions:

- (1) Titanium insoluble in hydrochloric acid.
- (2) Titanium soluble in hydrochloric acid.

Of the very small amount of titanium in treated steel the greater part will usually be found in the first form, and ordinarily the determination of titanium in this form answers every purpose of identifying and judging the quality of titanium-treated steel.

When the amount of titanium in the steel is exceedingly small, the soluble titanium frequently exceeds the insoluble and it then is sometimes desirable to determine also that existing in the second form.

¹ J. Am. Chem. Soc., 29, 481, 1907. ² By L. E. Barton. Method of analysis recommended by the Titanium Alloy Manufacturing Company.

Reagents. Peroxide Solution. Dissolve 4 grams of sodium peroxide in 125 cc. dilute sulphuric acid (1 of acid to 3 of water), and dilute to 500 cc.

Concentrated Standard Titanium Solution. Stock Solution. One-fourth gram of a standard 20% carbonless ferro-titanium is dissolved in 30 cc. dilute sulphuric acid (1 acid to 3 water). When solution is complete it is oxidized by the least possible quantity of concentrated nitric acid, boiled for a few minutes, cooled and diluted to such a volume that 1 cc. will contain 0.0005 gram of titanium.

When using a 5-gram sample 1 cc. is therefore equal to 0.01% titanium.

Dilute Standard Titanium Solution. This solution is made, just before making the determination, by diluting one volume of the concentrated standard titanium solution to ten volumes.

One cc. of this solution contains 0.00005 gram of titanium and is equal to 0.001% of titanium when using a 5-gram sample.






Fig. 70.

Apparatus. Pipettes and Burettes. The pipettes for measuring the concentrated standard solution and burette for delivering the dilute standard solution should be carefully calibrated.

Nessler Jars. These should be graduated with 50-cc. mark. It is convenient to have a set of four.

Colorimeter. The colorimeter or comparator consists of a rectangular block 2½ by 4 by 7 ins. high—the height being about ½ in. less than the height of Nessler jars—through which two chambers 1½ ins. diameter and 1½ ins. between centers are bored lengthwise—the chambers being of such diameter as to just receive the jars.

To one end of the block is fastened the base, which is in. thick and through which two i-in. holes are bored concentric with the chambers, thus forming a shoulder which supports the jars and also exclude light from the sides of the tubes. To prevent shadows and give better lighting the holes in the base are beveled outward at an

angle of 45°. The construction will be apparent by reference to Fig. 70. The interior of the chamber is painted dead black.

(a) For Determination of Titanium Insoluble in Hydrochloric Acid

Procedure. Dissolve 5 grams of steel in 100 cc. of dilute hydrochloric acid (one of concentrated acid to two of water) by boiling gently. Wash off the cover and wash down the sides of the beaker with water and filter out the slight insoluble residue, washing with hot water and dilute hydrochloric acid until free from iron. For filtration it is advisable to use either a close-grained paper or double rapid-filtering papers such as S. & S. No. 589 white ribbon.

Ignite the residue gently in a platinum crucible to burn off carbonaceous matter. Treat the residue in the crucible with a mixture of 3 cc. dilute sulphuric acid (1:1), 2 or 3 cc. hydrofluoric acid, and a few drops of nitric acid.

¹ Ferro-titanium suitable for the preparation of standard titanium solutions is made and supplied by the Titanium Alloy Manufacturing Company, Niagara Falls, N. Y.

Heat and evaporate to fumes of sulphuric anhydride to complete expulsion of hydrofluoric acid.

Cool, add a few cc. of water and heat until the solution is perfectly clear. The ignited residue may also be rapidly and completely brought into solution by fusion with about 3 grams of potassium bisulphate and dissolving the fusion in water and sulphuric acid.

In either case wash the contents of the crucible into one of a pair of Nessler jars and dilute with cold water nearly to the 50-cc. mark, and in the other jar place an equal volume of distilled water.

Place the jars in the colorimeter and observe if the sample solution is colorless. If the sample solution is colored slightly yellow by iron, the water in the standard tube should be brought to the same color by addition of a few drops of a ferric solution. For this purpose a solution of ferric ammonium sulphate, 30 grams per liter, is very convenient.

If the work up to this point has been carefully performed, the addition of ferric solution will usually be unnecessary; and if more than a few drops of ferric solution are required the analysis should be rejected and a new sample started. After adjusting the color—if necessary—bring the volume of solution in both jars to the 50-cc. mark.

The volumes now being equal and the solutions practically colorless, add 2 cc. of the peroxide solution to each. If the sample contains titanium even in minute quantity it will be indicated by the immediate development of a yellow color.

Match the colors by running into the standard jar freshly prepared dilute standard titanium solution, keeping the volumes equal by adding an equal quantity of water to the sample, placing the jars in the colorimeter for comparison of colors.

As before stated, each cc. of the dilute standard solution is equal to 0.001% titanium when using a 5-gram sample.

The determination may be made in less than an hour and requires little attention.

(b) For Determination of Titanium Soluble in Hydrochloric Acid

For the determination of soluble titanium the filtrate from the insoluble titanium residue obtained as before described may conveniently be used.

Dilute the solution in which the iron is already in the ferrous state to 180 cc. Add 10 cc. of alum-solution made by dissolving 40 grams of crystallized alum in a liter of water.

The aluminum here added is subsequently precipitated as alumina with the titanium and serves to collect quickly the exceedingly small precipitate of titanium hydroxide and facilitate its separation from the solution by filtration.

Heat the solution to about 90° C. and add ammonia or ammonium carbonate solution, stirring constantly until a slight permanent precipitate is produced. Add dilute hydrochloric acid (1 to 1) drop by drop from the wash bottle until the precipitate is just redissolved and the solution perfectly clear; then add 1 cc. more of the dilute hydrochloric acid.

Add 3 cc. of phenylhydrazine dissolved in 10 cc. hot water, which will precipitate the titanium and aluminum. Stir thoroughly and filter immediately

on a 7-cm. filter paper in a Büchner funnel, using suction. Wash thoroughly with hot water.

Calcine the precipitate *gently* in a platinum crucible to destroy organic matter and dissolve the residue exactly as described under (a), except that 6 cc. of dilute sulphuric acid is used instead of 3 cc.

The solution, which has a very light yellow, or greenish-yellow color, is transferred to one of a pair of Nessler jars and diluted to the 50-cc. mark. About 40 cc. of water are placed in the other jar and the color of the sample solution exactly matched by addition of ferric ammonium sulphate and copper sulphate solutions, which are conveniently delivered from burettes.

For matching the original color of the solution nearly saturated solutions of ferric ammonium sulphate and copper sulphate are suitable.

Only a few drops of such solutions are required, but it is frequently necessary to use both blue and yellow to match the greenish-yellow tone of the sample solution.

The standard is finally diluted to the 50-cc. mark. The volumes now being equal and identical in color, add to each 2 cc. peroxide solution to develop the titanium color and finish the determination as before described under (a).

(c) For Determination of Total Titanium

The total titanium is given by the sum of the insoluble and soluble titanium determined as under (a) and (b); but if desired may be determined in one operation.

To determine total titanium, dissolve as before in hydrochloric acid and without filtering proceed as directed under (b) for determination of soluble titanium.

Determination of Titanium when Interfering Elements are Present

If chromium, vanadium or molybdenum is present in the steel, fuse the residue insoluble in hydrochloric acid or the calcined phenylhydrazine precipitate containing the interfering element with a mixture of sodium carbonate and a little sodium nitrate.

Dissolve the fusion in water and filter. The residue on the filter will contain the titanium, free from interfering element. Bring the residue into sulphuric acid solution by methods before described and determine the titanium as usual.

Colorimetric Determination of Titanium with Thymol ¹

Principal and Preliminary Considerations. Titanium dioxide dissolved in sulphuric acid is colored red by addition of thymol, the depth of color being directly proportional to the amount of titanium present. The intensity of the color is claimed by Lenher and Crawford to be twenty-five times that produced by hydrogen peroxide with the same amount of titanium.

As in case of hydrogen peroxide, fluorides destroy the color, hence must be absent. Dilution with water has no effect until the concentration of sulphuric acid falls below 79.4 (e.g., sp.gr. 1.725). The color then fades in direct propor-

¹ Victor Lenher and W. G. Crawford, C. N., 107, 152, March 28th, 1913.

tion to dilution. Warm solutions are lighter in color than cold solutions with the same amount of titanium, hence the standard and the sample compared must have the same temperature. The color fades on heating but returns on cooling. The temperature should be kept below 100° C. Chlorides, phosphates and tin seem to have no effect. Tungsten, WoO₂, interferes, as it intensifies the color of the solution in direct proportion to the amount present; hence it must be removed or allowance made by adding an equivalent amount to the standard or subtracting the equivalent blank.

Special Reagents. Thymol Solution 1%. The thymol is dissolved in a little glacial acetic acid containing 10% ethyl alcohol, and this solution added to concentrated sulphuric acid. Addition of the thymol directly to the acid would produce a colored solution. The reagent should be kept protected from strong light, otherwise it will become colored.

Apparatus. See Colorimetric Determination of Titanium with Hydrogen Peroxide, Figs. 69, 70, also Fig. 43.

Procedure. About 0.3 gram of the material is fused with potassium acid sulphate, KHSO₄, and the melt dissolved in concentrated sulphuric acid. Enough thymol reagent is added so that there is present at least 0.006 gram thymol for every 0.0001 gram TiO₂. Concentrated sulphuric acid is added to bring up the volume to 50 or 100 cc. in a Nessler tube exactly as in the case of the colorimetric determination of titanium with H₂O₂. The depth of color is compared with a standard solution of titanium dissolved in a concentrated sulphuric acid added to 5 cc. of thymol solution made up to a convenient volume with concentrated sulphuric acid. The procedure is the same as described in the H₂O₂ method.

THE ANALYSIS OF TITANIFEROUS ORES 1

Determination of Titanium

Decompose the ore by fusion with potassium bisulphate, dissolving the fusion in water, hydrochloric and sulphuric acids. If an insoluble residue remains, filter it out. Calcine the residue, add a few drops of sulphuric acid and sufficient hydrofluoric acid to dissolve silica, evaporate to fumes of sulphuric anhydride and then heat to redness.

If a residue now remains, bring it into solution directly in acids or fuse with a little potassium bisulphate, etc., finally adding the solution to the main solution obtained as before described.

If desired, the sample of ore can first be partially dissolved in hydrochloric and sulphuric acids, and the insoluble residue then fused with potassium bisulphate or treated with sulphuric and hydrofluoric acids.

Some ores may be completely decomposed by a mixture of nitric, hydrofluoric and sulphuric acids, evaporating to fumes of sulphuric anhydride in a platinum dish to free the solution from nitric and hydrofluoric acids.

The complete decomposition of the sample having been accomplished, the titanium in the solution is determined by either the gravimetric or volumetric methods for Determination of Titanium in Ferro-Carbon Titanium. Pages 542 and 547.

¹Method of Analysis used in the laboratories of The Titanium Alloy Manufacturing Company.

Determination of Iron in Presence of Titanium

The sample is decomposed as directed under the Determination of Titanium. The sulphuric acid solution, which should have a volume of 150 to 200 cc., is saturated with hydrogen sulphide gas to reduce the iron, and filtered to separate any precipitated sulphides and free sulphur. The filtrate is collected in a flask fitted with a rubber stopper through which pass two glass tubes, one reaching nearly to the bottom for conducting gas into the solution, the other a short exit tube. Unless the solution after filtration is still highly charged with hydrogen sulphide, more gas should be passed into the solution to reduce any iron that may have been oxidized by the atmosphere during filtration. The excess hydrogen sulphide is now expelled by boiling the solution while passing a current of carbon dioxide.

When the exit gases cease to darken a piece of filter paper moistened with lead acetate solution, the flask is cooled while still passing the carbon dioxide. When the flask has partially cooled the carbon dioxide is shut off and the flask quickly cooled in running water and immediately titrated with standard permanganate solution.

Determination of Silica

This determination is conveniently combined with the determination of iron, the ore being preferably decomposed by fusion with potassium bisulphate. The fusion is dissolved and evaporated with excess sulphuric acid to fumes of sulphuric anhydride and the silica determination finished as usual—weighing, volatilizing with hydrofluoric acid, etc. If the ore contains quartz or a silicate undecomposable by treatment with potassium bisulphate and hydrofluoric acid, the residue filtered from the sulphuric acid solution should be fused with sodium carbonate and the silica then determined as usual.

Determination of Alumina

After making determination or separation of titanium by *gravimetric* method use the filtrate for determination of alumina.

Phenylhydrazine Method for Determination of Aluminum in Presence of Iron

The iron and aluminum should be in hydrochloric or sulphuric acid solution. Nearly neutralize the solution with ammonium carbonate. Pass sulphurous acid gas to complete reduction of the iron. Boil until the excess sulphurous acid is driven off and if titanic acid separates filter it out.

After filtering out titanic acid again nearly neutralize with ammonium carbonate, pass a little sulphurous acid gas and heat for a few minutes to reduce any iron that might have been oxidized during filtration. If titanium has not been detected the second treatment with sulphurous acid may be omitted. In either case the solution still containing a little free sulphurous acid is nearly neutralized with ammonium carbonate, diluted to 300 cc. and 3 cc. of phenol-hydrazine added. Stir thoroughly, let settle and filter out the alumina. If the precipitate is discolored by iron, dissolve in hydrochloric acid, and repeat the reduction, neutralization and precipitation by phenylhydrazine. Ignite and

weigh $Al_2O_4+P_2O_6$. Since the alumina precipitate may be contaminated by phosphoric anhydride (P_2O_6) , determine it by analysis and correct the alumina determination accordingly.

Determination of Phosphorus

Phosphoric acid may be separated from titanic acid by repeatedly fusing the ore with alkali carbonate and extraction of alkali phosphate with water.

The determinations of other constituents of the ore are conducted by the usual methods of ore analysis.

ANALYSIS OF TITANIUM PIGMENTS1

Titanium pigment products consisting of titanic oxide and barium sulphate can be analyzed by the following method:

Weigh ½ gram sample into 250 cc. Pyrex glass beaker; add 25 cc. concentrated sulphuric acid and 4 grams sodium sulphate. Mix well and heat on hot plate until fumes of sulphuric anhydride are evolved and then heat directly over flame to boiling for five minutes or until solution is complete. Traces of silica, if any, remain as an insoluble residue.

Cool, take up in 150 cc. of water, boil and filter off barium sulphate and silica, washing with 5% sulphuric acid to free residue from titanium, calcine and weigh barium sulphate.

Evaporate filtrate to 100 cc. and determine the titanium as directed under volumetric method for the determination of titanium, page 544.

¹ Method of analysis used in the laboratories of The Titanium Alloy Manufacturing Company.

TUNGSTEN, TANTALUM AND COLUMBIUM 1

TUNGSTEN

WILFRED W. SCOTT, A. M. SMOOT² AND J. A. HOLLADAY³

W., at.wt. 184.0; sp.gr. 18.77; m.p. 3000° C.; oxides, WO₂ (brown); WO₃ (yellow); acids, H₂WO₄, ortho tungstic; H₂W₄O₁₃, meta tungstic

DETECTION

The finely powdered material is decomposed by treating with mixed acids according to the procedure given on page 560. Tungsten is precipitated with cinchonine, the precipitate filtered off and dissolved in ammonium hydroxide, then acidified with hydrochloric acid and reprecipitated with cinchonine as described.

Tungsten oxide may be confirmed as follows:

1

- 1. The residue is suspended in dilute hydrochloric acid and a piece of zinc, aluminum, or tin placed in the solution. In the presence of tungsten a bluecolored solution or precipitate is seen, the color disappearing upon dilution with water.
- 2. A portion of the precipitate is warmed with ammonium hydroxide and the extracts absorbed with strips of filter paper.
- (a) A strip of this treated paper is moistened with dilute hydrochloric acid and warmed. In the presence of tungstic acid a yellow coloration is produced.
- (b) A second strip of paper is moistened with a solution of stannous chloride. A blue color is produced in the presence of tungsten.
- (c) A third strip dipped into cold ammonium sulphide remains unchanged until warmed, when the paper turns green or blue if tungsten is present.

Iron, Steel and Alloys. These decomposed with strong hydrochloric acid followed by nitric acid as directed under Solution of the Sample leave a yellow residue in the presence of tungsten. If this residue is digested with warm ammonium hydroxide and the extract evaporated to dryness a yellow compound, WO3, will remain if tungsten is present. This oxide may be reduced in the reducing flame to the blue-colored oxide.

¹ Columbium is also known as Niobium.

² Technical Director, Ledoux and Co. ³ Chemist, Electro Metallurgical Co.

ESTIMATION

Tungsten occurs principally as wolfram, a tungstate of iron and manganese (FeWO₄·MnO₄), as scheelite, a tungstate of calcium (CaWO₄), as ferberite, FeOWO₃ and hubernite, MnO·WO₃. The best concentrate of hand-picked material contains 70 to 74% tungsten in terms of its oxide, WO₃.

The element is met with in alloys—ferro-tungsten, is ilico-tungsten, tungsten steels containing as much as 10 to 20% of the metal, used for making high-speed, self-hardening cutting tools; tungsten powder; alkali tungstates for mordanting purposes; tungstic oxide, WO₁; tungsten electric light filaments, etc.

Solution of the Sample

For solution of the sample the following facts should be kept in mind regarding solubilities.

The metal is practically insoluble in HCl and in H₂SO₄. It is slowly attacked by HNO₃, aqua regia and by alkalies. It is readily soluble in a mixture of HNO₃ and HF (=WF₄ or WOF₄).

Oxides. WO₂ is soluble in hot HCl and in hot H₂SO₄ (=red sol.), also in KOH (red sol.). The oxide WO₂ is scarcely soluble in acids, but is readily soluble in KOH, K₂CO₃, NH₄OH, (NH₄)₂CO₃, (NH₄)₂S₂. Both the acid and the alkali solutions deposit the blue oxide on standing.

Acids. Ortho tungstates. A few are soluble in water and in acids. The alkali salts only slightly soluble. The meta tungstates are easily soluble in water. Tungstates are precipitated from alkali salts by dilute H₂SO₄, HCl, HNO₂, H₂PO₄ (aqua) as yellow WO₁·H₂O or white WO₁·2H₂O. Meta tungstates are not precipitated by cold acids, but are precipitated by boiling and by long standing.

Solution of Minerals. The material is best decomposed by acid treatment as described on page 560. Use of a fusion as a means of decomposition of tungsten ores preliminary to either the qualitative detection or the quantitative determination of tungsten cannot be recommended. The precipitation of tungsten by boiling with acids in presence of considerable amounts of alkali salis (such as result from acidification of a fusion) is absolutely worthless inasmuch as large amounts of tungsten always remain in solution. Repeated evaporations do not improve matters. In fact, when the amount of tungsten present is small, and especially if the ore contains much phosphorus, there is small likelihood that any of the tungsten will be precipitated. The use of cinchonine is necessary in order completely to precipitate tungsten under these conditions.

¹TYPICAL ANALYSES

Tungsten Powder	Ferro Tungsten
	%
W, 97 to 98.7	71 to 85.5
Fe, .5 to .6+	14 to 24.5
C, .1 to .3+ Si, .3 to .7+	.4 to 2.6
Mn, 0 to .2 P, — — S, — —	.1 to .4
	.08 to .9+
	.008 to .02 .01 to .02
Cú, — —	0 to .008
$M\sigma$ 0 to 3+	

SEPARATIONS

Separation of Tungsten from Silica. The oxide of tungsten, as ordinarily obtained, is frequently contaminated with silica. The removal of silica is accomplished by heating the mixture in a platinum dish with sulphuric and hydrofluoric acids and volatilizing the silica. After taking to dryness and igniting gently, the last traces of sulphuric acid are expelled by adding ammonium carbonate and again igniting.

In presence of small amounts of silica (0.1 to 0.2%) and large amounts of tungsten (75 to 85%) J. A. Holladay recommends evaporation with sulphuric and phosphoric acids, filtration to remove the bulk of the tungsten, and subsequent ignition and voltailization with sulphuric and hydrofluoric acids.

Separation from Tin. The weighed residue is mixed with six to eight times its weight of ammonium chloride (free from non-volatile residue) in a platinum crucible, placed in a larger crucible, both vessels being covered. Heat is applied until no more vapors of ammonium chloride are evolved. Additional ammonium chloride is added and the treatment is repeated three times. The fourth treatment is followed by weighing of the residue and the treatment repeated once more. If no further loss of weight takes place it is assumed that all the stannic oxide has been driven off. The inner crucible is now placed directly over the flame and heated to dull redness for a few minutes and the oxide, WO₂, weighed.

Separation of Tungsten from Tin and Antimony. Talbot's Process.¹ The mixed oxides are fused with twelve times their weight of potassium cyanide in a porcelain crucible. Tin and antimony are thrown out as metals and the soluble alkali tungstate formed. This is leached out with water and the aqueous extract boiled (hood) with an excess of nitric acid to drive off the cyanogen compounds. The tungstate is then precipitated by the usual methods. If phosphorus is present in the sample it will be found in the solution with tungsten and its removal will be necessary.

Separation of Tungsten from Arsenic and Phosphorus. Both arsenic and phosphorus may be precipitated by cold magnesia mixture in an ammoniacal solution, tungsten remaining in solution. The separation of arsenic is difficult, as it is tenaciously retained by tungsten as a complex salt. The following process is outlined by Kehrmann.²

One to 2 grams of the sample are fused with twice as much sodium hydroxide as is required to combine with the arsenic oxide, the resulting cake is dissolved in a little water and boiled in an Erlenmeyer flask for half an hour. After cooling, three times as much ammonium chloride as is needed to form chlorides with the alkalies present is added, and then ammonium hydroxide equal to one-fourth the volume of the solution under investigation, followed by sufficient magnesia mixture, added cold, drop by drop with constant stirring. After settling several hours, the solution is filtered and the residue washed with a weak solution of ammonia and ammonium nitrate. It is advisable to dissolve the residue in dilute acid and repeat the precipitation several times. The filtrates containing the tungsten are combined and concentrated by evaporation if necessary.

¹ J. A. Talbot, J. Sci. (2), **50**, 244, 1870. ² F. Kehrmann, Ber., **20**, 1813, 1887.

Separation of Tungsten from Molybdenum, Hommel's Process. The moist oxides of tungsten and molybdenum are digested with concentrated sulphuric acid and a few drops of dilute nitric acid, in a porcelain dish over a free flame for about half an hour. About three times its volume of water is added to the cooled solution, the residue, WO3, filtered off and washed with dilute sulphuric acid (1:20) followed by three washings with alcohol. The residue is ignited separately from the paper and weighed with the ash of paper as WO₃.

Molybdenum is in the filtrate and may be precipitated in a pressure flask with H.S.

Volatilization of Molybdenum with Dry Hydrochloric Acid Gas. Pechard's Process.1 The procedure depends upon the fact that molybdenum oxide heated in a current of dry hydrochloric acid gas at 250 to 270° C. is sublimed, whereas tungsten is not affected.

The oxides of the two elements, or their sodium salts, are placed in a porcelain boat and heated in a hard glass tube, one end of which is bent vertically downward and connected with a Péligot tube containing a little water. A current of dry hydrochloric acid gas is conducted over the material, heated to 250 to 270° C. From time to time the sublimate of molybdenum (MoO₃·2HCl) is driven towards the Péligot tube by careful heating with a free flame. This enables the analyst to observe whether any more sublimate is driven out of the sample and to ascertain when the tungsten is freed of molybdenum. From one and a half to two hours are generally sufficient to accomplish the separation. If sodium salt is present it is leached out of the residue, and this is then ignited to WO₂. Molybdenum may be determined in the sublimate.

Separation from Vanadium. Tungstic and vanadic acids are precipitated with HgNO, and HgO, the moist precipitate dissolved in HCl and the solution largely diluted; WO₂ is precipitated free from vanadium.

Separation from Titanium. The material is heated with K₂CO₃ and KNO₃, tungsten is dissolved out with water and precipitated as mercurous tungstate.

Separation of Tungsten from Iron. The procedure is given under Solution of the Sample, of Steel and Alloys. The impure oxide WO, is fused with Na₂CO₃ and the melt extracted with water. Fe(OH)₃ remains on the filter. The filtrate is evaporated to dryness with HNO₃ and the residue extracted with water. The insoluble WO₂ is washed with dilute NH₄NO₂ solution, then dissolved in NH₄OH and tungsten determined in the solution.

Separation of Tungsten from Uranium. The sample is evaporated with nitric acid to near dryness, 5 cc. HNO₃ is added and the uranium is dissolved out by extraction with ether.

¹ E. Pechard, Comp. Rend., 114, 173, 1891. ² Friedheim, C. N., 61, 220. ³ Defacqz, C. N., 74, 293.

⁴ C. A. Pierlé, Jour. Ind. Eng. Chem., 12, 61-63, 1920.

GRAVIMETRIC PROCEDURES FOR DETERMINING TUNGSTEN

Since there is no highly commendable volumetric procedure for determining tungsten, the gravimetric methods are preferred.

The element is determined as tungstic oxide, WO₃. It may be isolated preferably by precipitation with cinchonine, or in the form of tungstic acid, ammonium tungstate, or as mercurous tungstate, in the usual course of analysis, all of which forms may be readily changed by ignition to the relatively non-volatile oxide, WO₃.

Gravimetric Determination of Tungsten in Steel and Alloys

Tungsten alloys may be decomposed by hydrochloric (or sulphuric) and nitric acids. Tungsten precipitates, carrying down chromium and a little iron. The bulk of the iron is filtered off and tungsten determined in the residue, by direct or difference methods.

Special Reagent. Cinchonine Solution. 100 grams of the alkalcid dissolved in dilute (1:3) HCl and made to 1000 cc. with the dilute acid. Wash Solution. 30 cc. of the above solution, with 30 cc. strong HCl diluted to 1000 cc.

Procedure

- 1. Decomposition of the Sample. Two grams of high tungsten alloys or 5 grams of alloys low in tungsten are dissolved in a 350-cc. beaker by addition of 20 cc. strong HCl, the beaker being placed over an asbestos mat on a hot plate or steam bath. (The temperature should be below the boiling point of HCl, since the acid should remain strong to effect decomposition.) Since the reaction is energetic the beaker is covered by a watch glass. Ten cc. of strong nitric acid are added, pouring small portions at a time through the lip of the beaker. The sample is digested until all the black particles have dissolved and only the fine greenish yellow tungstic oxide is evident. Agitation of the liquor to prevent caking assists the reaction.
- 2. When the sample is decomposed, the beaker is uncovered and the solution evaporated rapidly to about 20 cc. and then cautiously at low heat to about 5-10 cc. 5 cc. of HCl are added to the moist residue and the solution diluted to about 50 cc. and heated to boiling 2-3 cc. of cinchonine reagent are added. Avoid taking to dryness and baking as this will make the tungsten difficult to dissolve in NH₄OH. See step 4.
- 3. The mixture is filtered and the ferric chloride washed out from the tungstic residue with dilute HCl (1:10), i.e., until the wash solution passes through the filter colorless. The filtrate is tested for tungsten by addition of more cinchonine. (See step 7.) As small amounts of tungsten come down slowly at least an hour should be given for the test.
- 4. A clean beaker is placed under the filter and tungsten dissolved out from the impure residue by treating this with warm ammonia water (1:5), the filter being half filled with each washing and thoroughly drained. It is advisable to rinse out the beaker in which the decomposition was made, with warm ammonia solution and pour this on the filter. After five washings the filter is cautiously removed and spread out on a watch glass. The residue is washed into a beaker with a stream of ammonia water and digested with about 20-30 cc. of ammonia for about 5 minutes warming to near boiling. The solution is poured through a

fresh filter into the main extract, the filter is drained and then washed twice more with warm ammonia solution (1:5). All the tungsten should now be in the filtrate. If much residue remains as in case of high silica samples, tungsten is apt to be present. This is recovered by acid sulphate fusion. See Notes.

- 5. The filtrate is boiled to expel the ammonia. When the odor has become faint, HCl is added until the solution is just acid and about 3 cc. excess is added. The total volume will be 75-100 cc., after boiling. Acidification may cause some tungsten to precipitate, but this does no harm. The ammonia is generally expelled by boiling the filtrate down to half its original volume.
- 6. 10 cc. of cinchonine reagent are added to the hot solution and the mixture stirred and allowed to settle until cold. If the supernatant solution is cloudy stirring up the precipitate and allowing it to settle will clear the solution. It is well to test the clear liquor with a few drops more of the reagent to ascertain whether all of the tungsten has precipitated.
- 7. The solution is filtered and the tungsten residue washed three or four times with dilute cinchonine reagent (washing down from the rim of the filter), and once with 5-10 cc. of water.

Note. The filtrate from step 3 may contain some tungsten. If the filtrate treated with cinchonine has become cloudy on standing it must be filtered, the residue washed with cinchonine reagent as in the procedure above and the filter and residue added to that containing the bulk of the tungsten.

8. The filter (or filters) is ignited in a weighed crucible to destroy the carbon, then cooled and weighed as WO₃.

$$WO_3 \times 0.7931 = W$$

Note. The oxide WO₃ fused with KHSO₄ and the cooled melt extracted with ammonium carbonate reagent should give a clear solution. If the solution is cloudy SiO₂ is indicated. This should be filtered off, ignited and its weight subtracted from the WO₃ obtained above. See optional method below. The KHSO₄ fusion may be made in a porcelain or platinum crucible.

Optional Method

The impure residue obtained in step 3 of the first procedure is ignited and weighed. The residue is now fused with acid potassium sulphate, KHSO₄ (5-6 grams of salt). The heating is continued until effervescence ceases and the mass changes to a clear solution. The fusion is cooled by rotating the crucible so that the mass is spread in a layer over the sides. It is now dissolved by placing in about 100 cc. of ammonium carbonate solution (10% sol.) and heating to boiling. Iron, chromium and silica will remain insoluble, tungsten will be in solution. The liquor is filtered and washed 4 or 5 times with water containing a little (NH₄)₂CO₃. The residue is ignited, cooled and weighed. The difference of this weight and that of the impure residue is due to the WO₃.

NOTE. If the carbonate extract is boiled, acidified and cinchonine reagent added tungsten will precipitate as the cinchonine compound. See Notes.

Notes

The use of sulphuric acid in place of hydrochloric acid in the decomposition of the sample offers no advantages as to speed of decomposition. On the

other hand with sulphuric acid treatment tungsten is invariably found in the filtrate (step 3) while with the HCl method it is seldom found in appreciable amounts.

Hydrofluoric acid assists in the decomposition of alloys high in silicon. A large excess must be avoided as this would attack the glass of the beaker with liberation of silicic acid, and fluosilicic acid. With large amount of HF a platinum dish should be used.

WO₃ does not dissolve readily in ammonia after it has been ignited. The moist residue of tungsten precipitated by acids is easily soluble in ammonia. If an appreciable amount of residue remains from the ammonia extraction, it is fused with KHSO₄, extracted with a 10% solution of (NH₄)₂CO₂, the CO₂ expelled by boiling and the ammoniacal solution filtered from silica, vanadium, iron, etc., and the tungsten precipitated and determined according to the procedure outlined in steps 5 to 8 inclusive.

SiO₂ is but slightly soluble in dilute ammonia solution. The silica dissolved by 100 cc., 1:1 NH₄OH in a 30 hour treatment on a 47% SiO₂ ore amounted to less than 0.005 g. on a gram sample. With a 30 minute treatment the amount was inappreciable. In case of doubt treat the WO₂ with HF in a platinum crucible and again ignite after expelling the acid by evaporation.

. THE ANALYSIS OF TUNGSTEN ORES, CONCENTRATES AND METALLIC PRODUCTS¹

General Considerations

Commercial tungsten minerals are marketed usually in the form of concentrates derived from treatment of lean ores by water concentration, or, sometimes, as specially selected high grade ore which has not been subjected to dressing operations other than hand sorting.

The important commercial minerals are Wolframite—iron-manganese tungstate; Hubnerite—manganese tungstate; Ferberite—iron tungstate; Scheelite—calcium tungstate. The first three grade into each other imperceptibly; commercially, they are all classed as Wolframite although the predominant mineral may, in some cases, be either manganese tungstate or iron tungstate. The determinations usually required are tungstic oxide, manganese, tin, phosphorus, sulphur, copper and arsenic sometimes molybdenum, which occurs more or less frequently in Scheelite, and occasionally bismuth and lead.

The principal minerals associated with tungsten concentrates are pyrite, arsenopyrites, cassiterite, magnetite, columbite, and always more or less quartz and silicates. Scheelite sometimes is associated with baryte.

The following analytical methods have been in practical use for a long time; they have been modified from time to time as experience showed necessary. Many suggestions from Works' chemists and others have been adopted. The descriptions are given in detail where this has been thought to be necessary because much depends upon minor points and upon the experience gained in making many hundreds of determinations.

Methods for the analysis of tungsten powders and ferro-tungsten are also given, since these are the raw materials of manufacturers of special steels.

Gravimetric Determination of Tungsten in Ores and Concentrates

Special Reagents

Cinchonine Solution. Cinchonine solution is made by dissolving 100 grams of the alkaloid in dilute HCl (1 part acid to 3 of water) and diluting to 1000 cc. with HCl of the same strength.

Cinchonine Wash Solution. 30 cc. Cinchonine solution, 30 cc. strong HCl to 1000 cc. of water.

Preparation of the Sample

Ores should be ground in agate to pass a 200-mesh screen; double screening is recommended to insure perfect fineness.

Weigh one gram into a 350 cc. beaker, add 5 cc. of water and shake to spread the ore evenly over the bottom of the beaker. Add 100 cc. of strong HCl, cover the beaker and set it to warm gently for an hour. The temperature should not exceed 60° C.—higher heating expels HCl gas. The ore is slowly decomposed and most of the tungsten is held in solution by the excess of HCl, leaving the undecomposed ore exposed to further attack by the HCl.

Stir the solution with a glass rod once or twice during this digestion to prevent

¹ By A. M. Smoot.

the formation of crusts or cakes on the bottom. The glass rod may be left in the beaker.

After an hour increase the heat and boil until the solution is evaporated one-half or thereabouts. The cover may be removed after boiling begins, or better, it may be supported over the beaker on three glass hooks. After the liquid is reduced in volume to 50 or 55 cc., scrape the bottom of the beaker thoroughly with a glass rod to detach all caked ore and residue—this is very important, otherwise complete decomposition by the acid treatment is difficult if not impossible to accomplish. Add 40 cc. more strong HCl and 15 cc. HNO₃, replace the cover and boil until all danger of spattering (owing to the rapid expulsion of chlorine) is past, remove the cover and evaporate to a volume of 50 cc., then add 5 cc., more HNO₃, replace cover and continue boiling, finally remove cover and evaporate to a volume of 15 cc. or less. All this boiling and evaporation requires about an hour. Occasional stirring to break up crusts, especially when fresh additions of acid are made, is recommended.

Add 200 cc. of hot water to the concentrated solution, stir well and simmer gently just at the boiling point for half an hour. Nearly all the tungstic acid is separated after the addition of nitric acid, and during the subsequent simmering and boiling after dilution, but a little may remain in solution. Add 6 cc. of cinchonine solution, stir well and let stand for half an hour, or longer if convenient, thus precipitating all tungsten.

This method of attack is preferable to that formerly employed wherein less acid was used and HNO₃ was added earlier in the digestion. Most ores are completely decomposed, so far as tungsten minerals are concerned, but it is unsafe to assume that this is the case unless the residue is pure white silica.

After the tungstic acid residue has settled well and has stood for half an hour, filter the solution through a 9 cm. paper, using a little paper pulp in the filter. Wash the residue well, first by decantation in the beaker and afterward on the paper with a dilute solution of cinchonine and HCl.

It is unnecessary to detach the tungstic acid which adheres to the sides of the beaker, but washing should be thorough to remove all iron, manganese, lime, etc., from the residue and filter paper. Finally wash both beaker and filter once with cold water to displace most of the dilute cinchonine washing solution.

Procedure for Isolation of Tungsten

Wash the tungstic acid and residue back from the filter into the original beaker with a fine jet of water from a wash bottle—the residue washes out easily because of the paper pulp which prevents adherence—about 25 cc. of water should be used. Add 6 cc. of strong NH₄OH, cover the beaker and warm it gently for about ten minutes. Tungstic acid dissolves readily, stir well and wash down the sides of the beaker with dilute ammonia, make sure that all the yellow tungstic acid has dissolved, then filter the warm solution through the same filter paper that was used at first, thus dissolving the small amount of tungstic acid that adhered thereto. Collect the filtrate in a 400 cc. beaker, wash the original beaker and the filter paper thoroughly with dilute ammonia (1 part strong NH₄OH—9 parts H₂O). The filtrate should be clear, or at most only slightly cloudy. The addition of about one gram of NH₄Cl to the solution before filtering and the use of a little of the same salt in the wash solution will insure a perfectly clear filtrate; but the use of this salt is not recommended unless the silicious residue tends to pass the filter in large

amount. The residue insoluble in ammonia will usually be free from tungsten; it may consist of tin oxide (cassiterite) silica and undecomposed silicates, titanium minerals or columbite; to make sure, it must be fused as described below.

Cover the 400 cc. beaker and boil it until free ammonia is expelled. of boiling off the free ammonia is to minimize ammonium salts since the cinchonine tungsten compound to be precipitated comes down more quickly and completely in solutions free from ammonium salts. Dilute the solution to 200 cc. with hot distilled water, acidulate with 3 cc. HCl and add 6 to 8 cc. of cinchonine solution. Stir very briskly for half a minute, which will cause the flocculent precipitate to agglomerate. It will then settle rapidly, leaving a clear supernatant liquid. Let it stand until cold, filter on an 11 cm. weightless ash filter (B. & A.—A grade) which has been treated to a rather copious dose of paper pulp. If ammonium chloride is used in the prior operation, the solution should be allowed to stand for several hours, best over night, after adding cinchonine. Wash well with dilute cinchonine solution (wash solution described above) policing the beaker with a rubber tipped Follow the cinchonine wash by one washing with cold water, transfer the filter to a small weighed platinum dish or large crucible, dry by heating on the hot plate, then burn the filter slowly over a burner or in a muffle followed by strong ignition until all carbon is consumed.

The use of paper pulp in the filter promotes ignition, leaving the ignited precipitate as a *porous*, friable mass, whereas if paper pulp is not used, the ignited precipitate is dense and it is sometimes difficult to burn the carbon completely.

After the carbon is practically all consumed break down the residue with a glass od flattened at one end, wipe off the end of the rod with a small piece of moistened ilter paper, adding it to the dish. Any remaining carbon and the small piece of ilter paper are quickly burned, leaving a pure yellow residue.

Moisten the residue with three drops of strong H_2SO_4 , add 5 cc. of HF and evaporate slowly on the hot plate until the HF is expelled. It is best to continue neating on the hot plate until the H_2SO_4 is expelled also; there is then no danger of spitting. Ignite the dish cautiously at first, finally at full red heat for ten ninutes, cool in a desiccator and weigh as WO_4 .

The residue left after the ammonia treatment may in some cases contain WO₃, although with Scheelite and most pure ores and concentrates it does not. It is sest in all cases to examine it. In the case of impure ores containing much insoluble esidue, the residues from duplicate determinations should be examined separately. When the residue is small and light-colored, it suffices to unite the duplicates for this determination.

Ignite the filter containing the residue in a small porcelain crucible. This is necessary because tin may be present, which would be reduced by the filter paper and ruin platinum. Mix the ignited residue with five or six times its weight (in any case at least one gram) of sodium carbonate plus a very little KNO₃. Transfer the mixture to a platinum crucible and fuse for five or ten minutes. Leach the usion with 50 cc. of hot water in a small beaker, filter, acidulate slightly with HCl and boil to expel CO₂. Add 5 cc. cinchonine solution. Let the beaker stand for everal hours, best over night; long standing is essential because small amounts of ungsten are slowly precipitated by cinchonine in the presence of alkaline chlorides.

If any tungsten precipitate appears, filter it off on a 7 cm. paper and wash it vith dilute cinchonine solution, followed by one wash with cold water, dissolve on he filter in warm dilute ammonia, collecting the filtrate in a small beaker, boil ut the excess of ammonia, make slightly acid with HCl and reprecipitate the

tungsten with cinchonine: This reprecipitation is done in a very small volume of liquid practically free from salts so the tungsten comes down quickly, let it stand for an hour, filter on a small weightless ash filter containing a little pulp, wash with dilute cinchonine solution followed by one wash with water, ignite, cool, treat with a drop of H₂SO₄ and 1 cc. of HF, evaporate, ignite and weigh. Add the percentage of WO₃ thus found to the principal amount.

Factors: $WO_3 \times 0.7931 = W$, $W \times 2.4739 = PbWO_4$.

Aqua Regia Method of Watts1

One gram of medium grade, or 0.5 gram of high grade, very finely pulverized ore, is treated in a 4-oz. flask with 40-50 cc. aqua regia and kept at moderate heat, below boiling, on a hot plate, until the solution has evaporated to about 15 cc. The solution is shaken frequently to prevent a solid cake forming at the bottom of the flask, which would prevent complete action of the acid on the ore.

The solution, removed from the hot plate, is diluted to about 50 cc. with hot distilled water and set aside to settle for half an hour. The clear liquor is decanted through a paper filter and the residue washed in the flask twice by decantation with 25 cc. portions of water slightly acidulated with HCl.

The WO₃ in the flask is dissolved with 20 cc. of 1:5 NH₄OH containing 2-3 drops of HCl. The solution is decanted through the filter and any remaining residue washed by decantation twice with the ammonia reagent.

If the residue is white it is transferred to the filter. If any black particles of undecomposed ore are evident, the residue is again digested with 10-15 cc. of aqua regia and treated as in the first case, only with relatively smaller portions of solutions. The ammonia extract is added to the filter. And the filter washed down in the customary way to remove all tungsten solution, allowing it to flow into the main extract.

The filtrate containing the tungsten is evaporated to dryness in a platinum dish over a water bath. The ammonia salts expelled by heat. The residue cooled is treated with 1-2 drops of $\rm H_2SO_4$ and about 2 cc. HF. The silica is expelled (in Hood), together with the acids by gently heating. The residue is now heated to dull redness for 5-10 minutes, then cooled in a desiccator and weighed as $\rm WO_3$.

Volumetric Method²

Tungsten is isolated as the oxide WO₃, and an excess of N. NaOH added. The excess is titrated with N. HCl.

One cc. N. NaOH = 0.116 gram WO₃, or = 0.092 gram W.

¹ H. F. Watts.

² Horting, Z. angew. Chem., 14, 165, 1901.

DETERMINATION OF COMMONLY OCCURRING SUB-STANCES IN TUNGSTEN ORES AND CONCENTRATES

Determination of Phosphorus

Treat two grams of ore exactly as in the tungsten determination and evaporate the HCl and HNO₃ solution until only about 10 cc. of liquid remains. Add 5 cc. of strong H₂SO₄ and evaporate to fumes. Cool, take up with 25 cc. H₂O, add about two grams of tartaric acid and heat to boiling. Add 20 cc. of strong NH4OH thus dissolving the separated WO₁. Filter into a "shaking bottle" (a glass stoppered 250 cc. bottle) and wash the residue with dilute NH₄OH. Reserve the liquid. Ignite the residue and expel SiO2 with HF and H2SO4. In the case of Scheelite this residue may be rather large owing to the insolubility of CaSO₄. Add sufficient Na₂CO₂ to make eight or ten times the weight of the residue and fuse thoroughly. Leach the fusion with hot water and filter, washing the residue with dilute Na₂CO₃ solution. Acidulate the filtrate with HCl and boil to eliminate CO₂—evaporate the solution if necessary to a volume of 75 cc. and make it slightly alkaline with NH₄OH. A precipitate of Al₂(OH)₆ may appear at this point; if it does, make the liquid slightly acid until the precipitate dissolves, and add it to the main ammoniacal solution in the shaking bottle. The presence of tartaric acid in this solution will prevent the separation of alumina. Add 10 cc. magnesia mixture to the bottle (the whole volume of solution should not exceed 160 cc.) and cool to 5° C. or less. Add five or six glass beads to the bottle and shake in a shaking machine for five or ten minutes. The object of the glass beads and the shaking, is to start the formation of magnesium-ammonium phosphate. After shaking, add 25 cc. of strong NH₄OH and let the bottle stand in a refrigerator over night. Filter off the solution and wash the precipitate in the bottle and on the paper with dilute NH₄OH but do not attempt to remove the precipitate adhering to the sides of the bottle. The precipitate consists of magnesium ammonium phosphate and arsenate together with silica and other impurities. Tin, tungsten, molybdenum, vanadium and titanium are eliminated by precipitation with magnesia mixture in the presence of tartaric acid. Dissolve the magnesia precipitate in hot dilute HCl and evaporate to small volume, say 7 or 8 cc. Add 10 cc. of strong HCl and 0.5 gram NaBr and evaporate to dryness. Take up with 5 cc. HNO₂ and evaporate to dryness again. The NaBr serves to reduce As' to As". The addition of strong HCl and boiling followed by evaporation to dryness eliminates As and SiO₂. Dissolve residue in 60 cc. HNO₃, S. G. 1.135, add 40 cc. of NH₄OH Sp. Gr. 0.96, cool to 35° C., add 30 cc. molybdate solution (Blair) and finish the determination by the alkalimetric method (Handy) described on page 368.

Determination of Sulphur in Ferberite, Wolframite and Scheelite

Fusion Method. Fuse two grams of pulp mixed intimately with nine grams of Na₂CO₃ and one gram KNO₃. Leach the fusion with water and wash the residue thoroughly with a dilute solution of Na₂CO₃. Acidulate the liquid with HCl and evaporate to dryness. Take up with a little HCl and 150 cc. of water, add 5 cc. of strong cinchonine solution and heat until all soluble salts are dissolved, finally boil for about five minutes. Let the solution stand over night, filter and wash with dilute cinchonine solution, using paper pulp in the filter. Neutralize the filtrate with Na₂CO₃, make slightly acid with HCl (0.5 cc. for each 100 cc. of liquid) heat to boiling and precipitate BaSO₄ by the slow addition of 10% BaCl₂

solution. Let stand over night; filter, wash and weigh. The cinchonine solutions are the same as those used in the tungsten determinations. Note that the use of cinchonine is essential in this determination because in the presence of a large excess of alkaline chlorides the complete separation of tungsten is only effected by cinchonine. If it is omitted the BaSO₄ precipitate will inevitable contain BaWO₄. Blank determinations on the reagents run parallel with the sample are essential.

Wet Method. In Ferberite and Wolframite only where sulphur is present as associated sulphides. The method is not applicable to Scheelite which may contain BaSO₄.

Treat two grams of the 200-mesh pulp with 20 cc. of a mixture of three parts HNO₃ and one part HCl in a 250 cc. beaker, add 0.5 cc. Br and let stand at room temperature for half an hour. Digest on a steam bath, for half an hour, remove cover and evaporate to dryness on the steam bath. Add 5 cc. strong HCl and again evaporate to dryness. Take up with 3 cc. HCl and 10 cc. H₂O, and digest until all soluble salts are dissolved. Add 250 cc. hot water and 2 cc. cinchonine solution and boil. Let the solution stand until it is cold, filter and wash the residue with water containing a few drops of HCl. Heat the liquid to boiling and precipitate S by adding 10 cc. of a 10% solution of BaCl₂·2H₂O. Let stand over night, filter and wash with hot water. Ignite and weigh as BaSO₄. In this method, the tungsten mineral is only partly decomposed, but all sulphides of iron, copper, etc., are oxidized to sulphates. This method is useful for the analysis of impure concentrates containing much associated sulphides. It is not to be relied upon for the accurate determination of small amounts of sulphur.

Determination of Arsenic in Tungsten Ores and Concentrates

Wet Method. The method is based on the assumption that arsenic in tungsten ores and concentrates is wholly present as associated minerals which may be decomposed by acid treatment and not as complex arsenic-tungsten compounds unaffected by acids, since the treatment used does not wholly decompose the tungsten mineral or associated tin, titanium and niobium minerals.

Treat two grams of the 200-mesh pulp in a round bottom 300 cc. flask with 10 cc. strong HNO₃. Digest for half an hour over a small flame, add 7 cc. of strong H₂SO₄ and evaporate to fumes by shaking the flask over a naked flame and at the same time blowing a mild air current into it to remove HNO₃. Cool the flask, add 10 cc. of water and again evaporate to fumes of H₂SO₄; this is done to expel HNO₃ completely which is important. Cool the flask and add 3 cc. of water, not more, then add two grams of dry FeSO₄ and connect the flask to an Allihn condenser, set up vertically, by means of a rubber stopper carrying a stoppered funnel tube and a wide exit tube. The exit end of the condenser is sealed by allowing it to dip slightly below the surface of 300 cc. of cold water contained in a large beaker.

Add 75 cc. of strong HCl through the funnel tube and boil until the volume in the flask is reduced to 25 or 30 cc., then add 25 cc. more strong HCl and repeat the distillation. Usually two distillations serve to volatilize all arsenic which is collected in the beaker. To make sure, substitute another beaker containing water, add 25 cc. more HCl to the flask and distil again. The second distillate is tested by itself; it seldom shows any arsenic. Pass a rapid current of H₂S into the acid distillate, thus precipitating arsenic as As₂S₃. Let the precipitate settle at a temperature of 60° to 70° for an hour or two, filter through a Gooch crucible fitted with a well washed asbestos pad and wash the precipitate thoroughly with hot water, followed by alcohol, ether and finally CS₂. Dry the precipitate at 105° C.

for an hour and weigh, dissolve the As₂S₂ from the filter by passing warm NH₄OH through it, wash again with water followed by alcohol only, dry at 105° C. for an hour and weigh again. Take the weight of As₂S₃ by difference between first and second weighing. This method is preferable to weighing the Gooch crucible before filtering.

The distillation method depends on the reduction of As' to As'' by ferrous sulphate and on volatilization as AsCl₂. This can only be done if the HCl employed is *strong*. Dilution of the HCl below a gravity of 1.10 will prevent the formation of AsCl₂, since in that case we have a solution of As₂O₃ in HCl rather than AsCl₂.

See also the procedure given on pages 37-39 of this volume.

Preliminary Fusion. In case the ore or concentrates contains insoluble arsenic compounds not broken up by the simple acid treatment described, it is necessary to fuse two grams of pulp with 15–20 grams of potassium pyrosulphate in a porcelain or fused silica crucible. After the melt is cold, remove it from the crucible which can usually be done easily by inverting and tapping, and break it into small pieces in a porcelain mortar. Transfer the ground melt to the 300 cc. flask, add two grams FeSO₄ and proceed with the distillation as above. The latter modification is unnecessary on most ores, since arsenic is rarely present except as associated arsenical minerals decomposed by acids.

Some trouble may be experienced in distilling owing to the "bumping" caused by separated WO₃ or undecomposed ore. This may be overcome by introducing a few glass beads into the flask.

Tin in Tungsten Ores and Concentrates

Fuse two grams of the finely pulverized ore in a spun iron crucible with ten grams of a mixture of equal parts of finely granulated sodium hydrate and sodium peroxide. The ore should be intimately mixed with the flux, fusion should be continued for one or two minutes after the mass is completely liquid, and a rotary motion should be given to the crucible during this period by holding it in the tongs and turning it in the flame; turning should be continued during cooling to spread the fusion.

Dissolve the fusion in 75 to 100 cc. of hot water. This is best done by placing the crucible in water in a large nickel dish since the strongly alkaline solution attacks glass or porcelain. When the mass is thoroughly disintegrated, remove the crucible and wash it; then pour the liquid into a 300 cc. beaker containing 15 grams of tartaric acid dissolved in 50 cc. of water; forthwith add 40 cc. of strong HCl. The solution will, of course, be quite hot. It should become clear on standing a few minutes except for a small amount of iron scale from the crucible, but it may require further heating to dissolve all iron hydrate. There should be no perceptible residue of undecomposed ore but it does not matter if there is a little, because it will be decomposed by the subsequent treatment. Pass a brisk current of H2S into the warm solution until ferric iron is reduced and tin is precipitated as Filter the solution and wash the precipitate thoroughly with stannic sulphide. warm water containing H₂S. If there is a tendency for the tin sulphide to run through add a little ammonium nitrate to the wash water. It is important to remove chlorides since their presence might entail a loss of tin in the subsequent ignition.

The presence of sufficient tartaric acid prevents the precipitation of tungstic acid when the fusion is acidulated with HCl, but with large amounts of tin or with

the considerable separation of sulphur caused by reduction of ferric iron in the solution some tungsten is likely to be entrained with the precipitate which no reasonable amount of washing will remove; a second fusion is therefore necessary. Ignite the sulphide precipitate in a porcelain crucible and transfer the residue carefully to a small spun iron crucible. The reason for this step is the presence of free sulphur and sulphides which unite with the iron of the crucible, forming iron sulphide when ignition is made in the iron crucible. The film of iron sulphide is vigorously acted upon by peroxide, causing spattering. Mix the ignited residue with about two grams of sodium peroxide and fuse as before. Dissolve the fusion, in the crucible, in 25 cc. of water, transfer to a 250 cc. beaker and boil to decompose peroxide: then add two grams of tartaric acid and 60 cc. of strong HCl. gives a solution containing 2 vols. of strong HCl to 1 vol. of water. Iron scale from the crucible and iron hydrate dissolve immediately in acid of this strength, leaving a perfectly clear solution, but the object in adding the large excess of HCl is to obtain a solution of such acid strength that arsenic may be precipitated with H₂S while tin sulphide is not formed.

If the foregoing proportions are maintained the separation of arsenic and tin may be accomplished by passing H₂S into the solution, whereby arsenic is separated as sulphide. Pass H₂S into the hot solution for about ten minutes or until practically all ferric iron is reduced. Filter off the arsenic sulphides through a small filter and wash thoroughly with HCl (1.19 sp.gr.) diluted with one half its volume of water. Good quality filter paper will withstand HCl solutions of this strength although an asbestos filter (Gooch) may be used if preferred.

Dilute the acid filtrate with twice its volume of water, add 25 cc. of strong NH₄OH to neutralize part of the free acid, and pass a little more H₂S thus precipitating tin, antimony, copper, etc. as sulphides. Let the sulphides stand until they have settled well, then filter and wash the precipitate with H₂S water slightly acidulated with HCl. Filter the solution through a 9 cm. filter, or better through a Gooch filter, using very moderate suction. Transfer the filter to a small beaker and heat it with 10 cc. of a 10% solution of sodium monosulphide. The tin sulphide and free sulphur dissolve readily leaving, usually, a very small amount of copper sulphide. Filter the solution through a 7 cm. paper and wash the filter several times with a 1% solution of sodium sulphide. Since copper sulphide is usually exceeding small, a single treatment with sodium sulphide suffices to dissolve all the tin sulphide, but if much copper should be present a second treatment is advisable.

The alkaline filtrate and washings contained in a 450 cc. Erlinmeyer flask should measure approximately 60 cc.; add 70 cc. of strong HCl, or a little more than the volume of the liquid. The sulpho-stannate is decomposed, most of the tin sulphide will dissolve, and there will be a separation of free sulphur. If the liquid is fairly cool at the time of adding the acid, there will be no great rise in temperature; if the temperature does not exceed 50-55° C. the liberated sulphur will not agglomerate and subsequent oxidation is easily accomplished by adding about two grams of KClO₃ a little at a time to the cool solution, shaking after each addition. After the solution begins to clear, heat it to boiling to remove chlorine. A perfectly clear solution without agglomerations of sulphur should result. Continue boiling for about ten minutes to insure complete expulsion of chlorine. Add 70 cc. of water to the flask, making the volume approximately 200 cc. containing between one-quarter and one-third of its volume of free HCl; this proportion of free acid is important. Introduce a coil of nickel foil, $1\frac{1}{2}$ " x 7", rolled around a

glass rod until it will just slip into the neck of the flask, heat the solution to boiling and boil gently for about 20 minutes; connect the flask by means of a double perforated rubber stopper with a current of CO2 gas and continue boiling for a few minutes. Remove from heat and while a brisk stream of CO2 is continued immerse the flask in cold water. When the solution is cooled to room temperature disconnect from the source of CO₂ and immediately titrate the tin with N/20 iodine solution using a few drops of starch solution as indicator. It is unnecessary to remove the nickel before titration. A "blank" should be made on the titration by boiling a solution of hydrochloric acid with a foil of nickel under the same conditions as the determination. The correction may amount to 0.2 cc. The iodine solution should be standardized against pure tin dissolved in HCl and KClO₃ and reduced with nickel under the same conditions as the determination.

Notes. Antimony does not interfere; it is precipitated as metal by the nickel and remains as a black precipitate in the bottom of the flask.

Arsenic in minute proportions does not interfere. Where it is known to be present only in small amounts the steps for its elimination may be omitted. Some tungsten ores, however, contain relatively large proportions of arsenic, usually present as arsenopyrite. When a large amount of arsenic is present it should be eliminated as described, otherwise serious errors may be made.

In place of the cumbersome CO₂ apparatus mentioned for use at the end of the reduction with nickel and during cooling, the "tin reduction" apparatus devised by A. Craig and described in The Engineering and Mining Journal, Vol. 106, p. 25, may be

used to great advantage.

Copper in Tungsten Ores and Concentrates

Applicable to All Ores Whether Scheelite, Wolframite or Hubnerite

Treat five grams of the fine pulp with 20 cc. of HCl in a 400 cc. beaker and digest with frequent shaking at a low temperature for an hour. Add 5 cc. of HNO₃ and boil down to a volume of, say, 10 cc., cool and add 10 cc. of H₂SO₄ and evaporate to fumes. Cool, add 150 cc. of water and boil. Filter off the separated tungstic acid. All copper is in the acid filtrate, but it is well to test the residue also to be perfectly sure.

In the case of Scheelite it is necessary to add a few cc. of HCl to the acid solution before filtering off the WO₃, since the large amount of CaSO₄ which separates in sulphuric acid solution alone is troublesome to wash and renders the examination of the insoluble residue difficult unless it is removed.

Neutralize the sulphuric acid solution from the WO₃ with NH₄OH, make it just acid with HCl, avoiding any greater excess than is sufficient to dissolve the iron and manganese hydrates. Add 50 cc. of a solution of sodium bisulphite (150 grams per liter) and let stand in a warm place for half an hour with frequent stirring -iron is reduced to the ferrous condition. Add 5 cc. of sodium sulphocyanate (150 grams per liter) and let stand for another hour stirring from time to time. Copper is precipitated as cuprous sulphocyanate free from molybdenum (which frequently occurs in Scheelite), arsenic or other interfering elements. Filter the cuprous sulphocyanate through a double filter, returning the first part of the filtrate to the filter since the precipitate is very fine and is apt to "run through" at first. To prevent this, add a little paper pulp to the filter.

Wash the precipitate with warm water and transfer the wet filter to a porcelain crucible, dry in an oven heated to 150° to 175°. This will char the paper gradually without danger of loss of precipitate. When the paper is thoroughly charred, heat the crucible in a muffle or over an open burner until all carbon is consumed. solve the mixture of copper sulphide and oxide remaining in the crucible in a few cc. of strong HNO₃ and finish the determination by the electrolytic or iodide methods. Very small amounts of copper are best estimated colorimetrically by comparing the blue color of the ammoniacal solution with a standard in short color tubes. the exact determination of copper is sometimes very important, it is advisable always to take a large initial weight of sample (5 grams) unless copper is present in large amount—say two per cent. This is sometimes the case in scheelites containing cupro-scheelite. In examining the residue left by the acid treatment; dissolve the WO₃ in NH₄OH and wash the filter with dilute NH₄OH. Ignite the filter containing the insoluble matter and undecomposed ore and fuse it with KHSO₄ in a porcelain crucible. Dissolve the fusion in water and make the solution strongly alkaline with NH₄OH. Filter off any iron hydrate and insoluble residue and observe whether or not the filtrate shows a blue color. As little as 0.5 mg. can easily be detected in a volume of 50 cc. If there is no blue color, further examination may be omitted. If the qualitative test indicates copper, dissolve any iron hydrate which may have separated in dilute H2SO4. Add this solution to the main liquid and slightly acidulate with HCl. Then add sodium bisulphite and sulpho-cyanate, proceeding as in the main determination.

Manganese in Tungsten Ores and Concentrates

Treat one gram of the pulp exactly as in the tungsten determination omitting the use of cinchonine, but letting the solution stand until it is cold after decomposition has been effected. Filter off the insoluble residue and tungstic acid and wash it thoroughly with dilute HCl (25 cc. per liter). It is quite difficult to remove every trace of iron and manganese from the heavy WO₃ residue which invariably retains a little unless the precipitate and residue is washed back from the filter and agitated with the wash liquid. The filtrate contains all Mn.

Neutralize the solution by means of Na₂CO₃ until there is a slight permanent precipitate. Dissolve this by adding dilute H₂SO₄ (1-5) leaving the solution very slightly acid. Add two or three grams of ZnO, ground to a cream with water, heat to boiling and titrate Mn with standard permanganate by Volhard's method. See page 304.

METALLIC TUNGSTEN AND TUNGSTEN ALLOYS

Tungsten in Tungsten Metal and Ferro-Tungsten

Treat one gram of the finely ground sample in a large (60 cc.) platinum crucible fitted with a cover with 5 cc. HF.; add HNO₃, drop by drop, until the metal dissolves. Add 3-4 cc. H₂SO₄ and evaporate on a steam bath until HNO₃+HF is expelled. Shake gently over a small Bunsen flame until H₂SO₄ fumes strongly. Cool, transfer to a 250 cc. beaker with water, finally wiping the crucible with a little filter paper. A little WO3 sticks to the crucible; it cannot be removed by Reserve the crucible. Dilute the contents of the beaker to about 150 cc. with water, add 3 cc. HCl and boil. Remove from the stove and to the hot solution add 5 cc. cinchonine solution and let stand over night (or at least four or five hours). Filter on "ashless paper" and wash with dilute cinchonine solution. Gently ignite the precipitate in the crucible in which it was originally treated. Heat for five minutes with full Bunsen burner flame, cool and weigh. Add about 5 grams Na₂CO₃ and fuse, running the fusion around the side of the crucible to remove all WO3. Dissolve the fusion in hot water; filter and wash five or six times with hot water. Place the filter in the crucible and ignite, add a little Na₂CO₃ and fuse again. Dissolve the fusion in water, filter and wash very thoroughly with hot water to remove last traces of Na₂CO₃, ignite in the same dish as at first, cool and weigh. The difference between weight of dish plus residue and weight of dish plus tungstic oxide is WO₃.

Dilute Cinchonine Solution. 30 cc. strong cinchonine solution and 30 cc. HCl to one liter.

Strong Cinchonine Solution. 100 grams cinchonine dissolved in dilute HCl (1 part acid, 3 parts water) and diluted to one liter with acid of the same strength.

Method for Phosphorus in Ferro-Tungsten and Tungsten Metal

Treat one gram of the finely powdered sample in a platinum dish, fitted with a gold cover, with 15 cc. HNO₃ (1.42 sp.gr.), add 3 cc. HF and warm gently. When action subsides, add 3 cc. more HF. After action subsides, boil, remove cover and if decomposition is not complete, add more HF and boil again. When solution is complete, wash off the cover and evaporate at a low heat to a volume of about 10 cc. then add 3-4 drops of concentrated permanganate solution and continue evaporation until crusts of WO₃ begin to form at the edges; that is, to a volume of, Add 5 cc. H₂SO₄ and evaporate on the stove at a low heat until HF and HNO₂ are expelled and H₂SO₄ fumes are given off. (Strong heat causes spattering and also cause hard, over-baked crusts to form on the bottom of the dish which resist subsequent treatment.) Cool, add 25 cc. H₂O and boil (by agitating over bunsen flame) until all soluble salts are dissolved. Destroy pink color due to excess of permanganate by adding sulphurous acid drop by drop. The pink color may not be very evident but the SO₂ is added anyway to reduce higher oxides of Mn. Boil for a minute or two after adding the SO₂. Add 1.21 grams of pure tartaric acid and when this is dissolved and the solution is cooled to a temperature of about 50° C., add 20 cc. of NH₄OH, (0.90 sp.gr.) diluted with an equal volume of water. The precipitated tungstic acid should dissolve completely, giving a clear solution. The solution is hot from the reaction between H₂SO₄ and NH₄OH. While it is

still hot add 10 cc. magnesia mixture and transfer it from the Pt dish to a six-ounce glass stoppered bottle. Set the bottle in ice water and when it is thoroughly cooled, add four or five glass beads, say 6 mm. diameter. Stopper it tightly and shake in an efficient shaking machine for at least ten minutes. The agitation should be The beads aid in starting the formation of the magnesium precipitate; after agitation add 15 cc. of strong NH4OH and return the bottle to ice water tank or put it in a refrigerator to stand over night. Phosphorus separates as magnesium ammonium phosphate free from tungsten but containing possibly basic magnesium compounds. After standing over night, filter the solution through a 9 cm. paper containing a little paper pulp and wash the bottle and paper thoroughly by small additions of ammonia wash water (1 part NH₄OH, 3 parts H₂O). Do not attempt to remove all the precipitate from the bottle but remove the beads to the filter. Place the bottle under the filter and pour through the filter 60 cc. of HNO₃ of 1.135 sp.gr. (1 part HNO₃, 1.42; 3 parts H₂O) in five successive portions of 12 cc. each letting the acid fall on the upper edges of the filter paper. This dissolves any ammonium magnesium phosphate and washes it into the bottle where any that remained adhering to the glass is also dissolved. Add 12 cc. of NH₄OH (sp.gr. 0.90) to the liquid, cool to 35° C., add 35 cc. molybdate mixture and proceed according to either of the methods described on pages 368-370 of this volume.

Notes. The usual proportions of HNO₂ and HF are reversed in order to provide a constant excess of HNO₂ to oxidize P. The procedure given takes a little longer than when the sample is treated with HF first and HNO₃ is added a little at a time, but solution is finally complete. It is necessary to keep the platinum dish covered after action begins, as the reaction is somewhat violent.

The platinum dishes recommended are:

8 cm. in diameter at top. 7.8 cm. in diameter at bottom. 4 cm. high.

They have flat bottoms and are wire rimmed at top to give additional stiffness. They weigh 58 to 60 grams each and hold about 175 cc. The covers are made of pure gold (for economy) "dished" like a crucible cover to fit the top of the dishes closely. The dishes have small lips to aid pouring. The "tongue" of the cover overlaps the lip. Ordinary round bottomed dishes may be used but the manipulation is much more difficult; there is greater tendency to spattering and danger of local baking or overheating in evaporating to fumes of H₂SO₄. If the separated WO₃ is overheated locally, it does not dissolve readily in NH₄OH. In a flat bottomed dish, the WO₃ is spread in a thin layer and heat is applied evenly all even the bettern

in a thin layer and heat is applied evenly all over the bottom.

A good shaking machine should be used. The magnesia precipitate may be started by shaking the bottles by hand, but it is a tiresome job. The solution must be cold—

say 8° or 10° when shaking begins.

Permanganate solution is added to insure complete oxidation of phosphorus, as in steel analysis. The color of the permanganate gradually fades in the hydrofluoric nitric solution, but after evaporating to fumes and adding water, the solution is usually

slightly pink.

The amount of tartaric acid is limited to 1.20 grams since ammonium tartrate retards the formation of the magnesia precipitate. Complete precipitation can only be obtained by brisk agitation and by keeping the solution very cold followed by long standing in a cold place. By this method, determinations started at 3 p.m. may be completed by noon the next day.

Determination of Sulphur and Silicon in Ferro-Tungsten and Tungsten Metal

Fuse two grams of the finely powdered metal, intimately mixed with 8 grams of dry Na₂CO₂ and 2 grams of powdered KNO₃, in a large platinum crucible (40 cc.). The fusion is best made in an electric muffle to avoid contamination with sulphur contained in illuminating gas. Leach the fusion with 100 cc. of distilled water in a 250 cc. beaker. Filter into a 12 cm. porcelain casserole and wash the residue several times with hot distilled water. The solution contains practically all of the sulphur and most of the tungsten and silica. The residue contains some of each, but not more than traces of sulphur.

Solution. Render the liquid acid with 20 cc. HCl and evaporate to dryness on a steam bath, thus precipitating tungstic acid. After the residue is dry, heat it to 110°-120° C. in an oven to dehydrate silica, take up with 5 cc. HCl and 50 cc. water. add 3 cc. strong cinchonine solution (see tungsten determination) and boil, or heat just short of the boiling point, for half an hour. Let the solution stand until it is cold. By means of the cinchonine all WO₃ is rendered insoluble. Filter through an 11 cm. filter paper (free from ash) which has been liberally treated with an emulsion of filter paper pulp, and wash the residue with dilute cinchonine solution (see tungsten determination). Reserve the residue. The filtrate contains all the sulphur, heat it to boiling and add 10 cc. of barium chloride solution (100 grams BaCl₂ 2H₂O to 1000 cc.) boil for ten minutes, allow it to stand over night, filter on a 9 cm. filter paper (free from ash) wash repeatedly with hot water, ignite in platinum and weigh as BaSO4. If the work is properly carried out every trace of WO₃ is removed from the solution and there is no danger of including BaWO₄ with the BaSO₄. If one suspects that the BaSO₄ is not quite pure, t should be fused with a little Na₂CO₂, leached with water and filtered, the filtrate should be acidulated with HCl, a few drops of cinchonine solution added and the solution evaporated to dryness on a steam bath. The dry residue should be dissolved in a little water, a few drops of HCl added, and any residue filtered off. In the clear filtrate BaSO₁ should be again precipitated as before. The weight of BaSO₁×0.1373=S.

A "blank" on all reagents must be made parallel with the determination; this is important since all sodium carbonate obtainable contains sulphur and there is sometimes more or less of it in the cinchonine. All evaporations should be made over steam and the operations conducted in a place free from sulphur gases.

Silicon. The residue of tungstic oxide from which the solution for the determination of sulphur was filtered contains most of the silica. The residue from leaching the original fusion contains the rest.

Wash the residue from the Na₂CO₂ fusion from the filter paper with a fine jet of water into a small casserole, add an excess of HCl and evaporate to dryness on a steam bath, heat the dry residue at 110°-120° C. to dehydrate silica and filter on a small filter paper (free from ash). Wash thoroughly with hot dilute HCl (1-10°) and finally with hot water. Reserve the filter.

Wash the residue of tungstic oxide, silica and filter paper pulp from the filter into a small casserole, add 5 cc. of HCl and heat for a few minutes, then filter again through the same paper and wash it thoroughly with hot water. This second washing is necessary to remove sodium salts completely. (The original washing sufficed to remove all of the small amount of sulphur present.) Transfer the well-washed filter and residue to a platinum crucible, add the small filter containing

the little silica recovered from the Na₂CO₂ fusion residue and ignite both to constant weight in a platinum crucible. On account of the presence of filter paper pulp, the ignited residue is porous and friable; if paper pulp had not been used, the WO₂ would be dense and not easily susceptible to the subsequent treatment. Cool the ignited residue of WO₂ and SiO₂ and weigh it. Add two or three drops of H₂SO₄ and 5 or 6 cc. of pure HF. Digest at a gentle heat for some time, and then slowly evaporate off the HF. When H₂SO₄ fumes are evolved, cool and again add HF, digest as before, evaporate off the HF, ignite gently to expel H₂SO₄ and then strongly for ten or fifteen minutes. Cool and weigh. The loss in weight after expulsion is SiO₂ which multiplied by 0.4693 equals silicon.

Determination of Manganese in Tungsten and Ferro-Tungsten

The filtrate from the tungstic acid obtained by digesting the residue after evaporation to fumes of H₂SO₄ and digestion with dilute HCl (see tungsten determination) contains all the manganese. Separate iron from this solution by means of a basic acetate precipitation and wash the precipitate thoroughly with a hot dilute solution of sodium acetate, reject the precipitate, and to the filtrate, which contains all the manganese, add 5 cc. of strong NH4OH, add about two grams of (NH₄)₂S₂O₆. Digest on a steam bath for 45 to 60 minutes, manganese separates as hydrated peroxide. Filter and wash with hot water. Dissolve the precipitate through the filter with ten or fifteen cubic centimeters of H₂SO₃ containing a few drops of H₂SO₄ and wash the filter paper several times with hot dilute H₂SO₄ (10%). Again filter through the same paper into a 500 cc. flask and wash with hot water. Dilute the liquid to a volume of about 200 cc. and boil it for fifteen or twenty minutes until all SO₂ is expelled. Nearly neutralize the solution with a solution of NaOH but still leave it slightly acid, complete the neutralization by adding 5 grams of zinc oxide emulsified by grinding with water, heat again to boiling and titrate manganese in the hot solution with a N/10 solution of KMnO₄ (Volhard's Method).

Acknowledgement is made to Mr. J. A. Holladay, Electrometallurgical Co., for cooperation in the preparation of these methods.

TANTALUM AND COLUMBIUM

Cb, at.wt. 93.5; sp.gr. 7.06; m.p. 1950°; oxides CbO, CbO₂, Cb₂O₄. Ta, at.wt. 181.5; sp.gr.14.49; m.p. 2900°; oxides TaO₂, Ta₂O₄, Ta₂O₄.

DETECTION

The finely powdered mineral is digested with strong hydrochloric acid, followed by concentrated nitric acid and the mixture taken to dryness. The residue is treated with hydrochloric acid, diluted with water, boiled and filtered. The residue is digested with warm ammonium hydroxide to remove tungsten and the solution filtered from the insoluble material, in which tantalum and columbium will be found, if present in the sample.

Decomposition of the material may be effected according to the procedure

described for the detection of tungsten, page 554.

The residue obtained is digested, in a platinum crucible, with hydrofluoric acid and a saturated solution of potassium fluoride added. The mixture is evaporated to small volume and allowed to cool slowly. Tantalum will separate in acicular rhombic crystals (solubility—1 part of the salt in 200 parts of water) as potassium fluotantalate $2KF \cdot TaF_5$; columbium separates in plates as the double fluoride, $2KF \cdot CbF_5$, if HF is in excess, or as a double oxy-fluoride $2KF \cdot CbOF_5$, if HF is not in excess; the columbium salt being much more soluble (1 part of the salt in 12 parts of water) crystallizes after the crystals of tantalum have formed.

The crystals may be examined under a lens and then treated as follows: The needle-like crystals are heated in a shallow platinum dish or crucible cover with strong sulphuric acid to fumes, the cooled mixture is transferred to a test-tube with water and boiled to precipitate the tantalic acid. An opalescent solution is obtained when this precipitate is treated with an excess of hydrochloric acid. Metallic zinc added to this solution produces no color. A light-brown precipitate is obtained with tannic acid in the presence of tantalum. If the crystals of columbium salt are treated in the same way, metallic zinc added to the acid solution will give a blue coloration, and tannic acid an orange-red coloration. Tantalic acid fused with sodium meta-phosphate gives a colorless bead (distinction from silica). The bead moistened with FeSO₄ and heated in the inner flame is not colored red. Columbic acid fused in the same way gives a blue bead in the reducing flame, and a red bead by addition of FeSO₄, and heating in the flame.

ESTIMATION

Tantalum and columbium occur commonly with tungsten in nature. In the following minerals, however, tantalum and columbium form the more important constituents:

Columbite, $(Ta \cdot Cb)_2(Fe \cdot Mn)O_6$; pyrochlore, $RCb_2O_6R(Ti \cdot Th)_2$; hatchettolite, $2R(Cb \cdot Ta)_2O_6$ or $R_2(Cb \cdot Ta)_2O_7$; fergusonite, $R(Cb \cdot Ta)O_4$; yttrotantalite, $RR(Cb \cdot Ta)_4O_{16} \cdot 4H_2O$; samarskite, $R_2R_2(Cb \cdot Ta)_6O_{21}$.

Tantalum is used in electric light filaments; it is also used for hardening steel for drills, files, cutting edges, watch springs, and pen points. It is used in rectifiers for alternating currents.

Solution of the Sample

The statements made for solution of the sample in determinations of tungsten apply here also. It is well to keep the following facts in mind: Tantalum is insoluble in the common mineral ácids—hydrochloric, nitric and sulphuric acids, but dissolves in hydrofluoric acid. Columbium is insoluble in hydrochloric, nitric and in nitro-hydrochloric acid, but dissolves in hot concentrated sulphuric acid. The oxides Ta₂O₅ and Cb₂O₅ fused with KOH form soluble salts. Cb₂O₅ (not strongly ignited) is soluble in acids, from which (NH₄)₂S and NH₄OH precipitate columbic acid (containing ammonia). Freshly precipitated tantalic acid is soluble in acids, and reprecipitated by NH₄OH. The acid dissolves readily in HF.

Tantaliferous Minerals. Although decomposition may be effected by fusion with potassium acid sulphate, fusion with potassium hydroxide is recommended as being the best flux for opening the minerals. Simpson's process is as follows:

Three grams of pure potassium hydroxide are fused in a nickel or silver crucible and the finely powdered mineral (0.5 gram) added, the contents mixed by gently rotating the crucible and fusion kept at a dull red heat for ten minutes longer. The crucible placed in a hole in an asbestos board, Fig. 65, is heated over a free flame for half an hour, the sample being covered. The lid is removed and allowed to cool reversed, if any material clings to this. The cooled crucible, placed in a beaker, is two-thirds filled with distilled water, and a clockglass immediately placed over the beaker. After the violent reaction has subsided the contents of the crucible are poured into about 10 cc. of dilute hydrochloric acid (sp.gr. 1.08) in a 300-cc. beaker, and the crucible, basin and the lid washed with water, followed by about 20 cc. of the dilute acid, and again with water, adding the washings to the remaining solution. The total volume of the solution should occupy from 80 to 100 cc. A drop or two of alcohol are added to destroy any potassium manganate formed.

Separations

Isolation of Columbium and Tantalum Oxides. Separation from iron, manganese, copper, cobalt, nickel, calcium, magnesium, titanium, and tin. The solution obtained above is boiled with 5 to 10 cc. of hydrochloric acid (sp.gr. 1.16) (less acid may be used if titanium is absent). Columbium and tantalum hydroxides are precipitated. The solution is now diluted to 200 cc. and boiled for fifteen minutes longer to make sure that the precipitation is complete. After settling, the clear solution is decanted through a close-grained filter and the residue, having been transferred to the filter, is washed with dilute hydrochloric acid (sp.gr. 1.08) until the washings give no indication of iron. The residue may contain tantalum, columbium, tungsten, silica, antimony and tin. The greater part of the tin, titanium, and all of the iron, manganese, cobalt, nickel, copper, calcium and magnesium are removed in the filtrate.

Notes. If the filtrate becomes turbid, it is advisable to dilute the solution and repeat the boiling to recover the columbium and tantalum that may still be in solution.

In the presence of appreciable amounts of titanium a soluble double chloride of columbium and titanium is formed, so that the precipitation of columbium

¹ E. S. Simpson, Chem. News, 99, 243, 1909.

is not complete. (See L. Weiss and Landecker, Chem. News, 101, 2, 13, 26, 1910.) The formation of this compound is hindered by the addition of an oxidizing agent—sodium nitrate—to the alkali.

Removal of Tin, Antimony, Tungsten and Silica. *Tungsten* is removed by digesting the moist precipitate with ammonium hydroxide or sulphide, tungsten being soluble in these reagents. Antimony and Tin are also removed.

Silica is volatilized by heating the residue with sulphuric and hydrofluoric acids according to the standard procedure.

Tin. The oxide may be reduced with hydrogen passed over the heated residue within a boat placed in a combustion tube. The tin may now be dissolved out with hydrochloric acid.

Determination of Columbium and Tantalum

The insoluble residue obtained, freed from other elements by the procedures outlined, is ignited at a red heat for fifteen or twenty minutes and the residue weighed as $Cb_2O_5+Ta_2O_5$.

Separation of Columbium and Tantalum, Selenium Oxychloride Method.¹

The method depends on the solubility of columbium oxide and the comparative insolubility of tantalum oxide in a mixture of sulphuric acid and selenium oxychloride as found by Victor Lenher.²

The method worked out by H. B. Merrill is as follows:-

The oxides are separated together with titanium dioxide from the other elements by the usual methods and the total percentage of titanium and columbium pentoxides (with titanium) is determined.

A weighed sample (0.2-0.3 g.) of the ignited oxides is boiled with 50 cc. of a 1:1 mixture of selenium oxychloride and strong sulphuric acid (sp. gr. 1.84) in an Erlenmeyer flask, on a sand bath for half an hour, avoiding heating to voluminous fumes. After cooling the solution is carefully decanted from the residue, with suction, through asbestos in a Gooch crucible that has been weighed. The filtrate is poured into a large volume of water and the solution boiled. A white precipitate indicates the presence of columbium. The residue in the flask is again extracted with 20 cc. of the reagent for fifteen minutes, the extract being poured through the asbestos filter and the filtrate tested as before for columbium. The process is repeated until the filtrate upon hydrolysis gives only a faint precipitate, due to traces of dissolved tantalum pentoxide. Three or four extractions are usually sufficient.

The undissolved tantalum pentoxide is transferred to the crucible with a jet of water from a wash bottle, washing unnecessary. The crucible is ignited and weighed, the gain in weight representing tantalum pentoxide.

Columbium (with titanium) is determined by difference. If titanium is present it is determined colorimetrically in a separate sample and its amount deducted from columbium.

- ¹ Henry Baldwin Merrill, Jour. Am. Chem. Soc. 43, 2378 (Nov. 1921).
- ² Victor Lenher, Jour. Am. Chem. Soc. 43, 21 (1921).

URANIUM

WILFRED W. SCOTT ALBERT H. LOW *

U, at.wt. 238.5; sp.gr. 18.7; m.p. $<1850^{\circ}$ C.; oxides UO₂, UO₃, (oxide U₂O₃, formed by ignition = UO₂+2UO₃)

DETECTION

The mineral is warmed with a slight excess of nitric acid (1:1) until decomposition is complete. The solution is diluted with water and then an excess of sodium carbonate added and the mixture boiled and filtered. Sufficient nitric acid is added to neutralize the carbonate, and after expelling the CO₂ by boiling, sodium hydroxide is added to the filtrate. A yellow precipitate is formed in presence of uranium. The precipitate is insoluble in an excess of the reagent, but dissolves in ammonium carbonate.

Uranous salts are green or blue and form green or bluish-green solutions, from which alkalies precipitate uranous hydroxide, reddish brown, insoluble in excess, but readily dissolved by ammonium carbonate. Uranous salts are strong reducing agents.

Uranyl salts (UO₂·R₂) are yellow. Alkali carbonates give a yellow precipitate, soluble in excess. UO₂ is regarded as a basic radical, known as "uranyl." The radical migrates to the cathode, upon electrolysis of a uranyl solution. Uranyl salts are more stable than uranous and are better known.

Potassium ferrocyanide, K₄Fe(CN)₆, added to uranous or uranyl solutions gives a reddish brown precipitate (or a red color in dilute solutions). The precipitate dissolves in a large excess of HCl. If sufficient ferrocyanide is present the color changes to green on boiling. Addition of sodium hydroxide to the ferrocyanide precipitate of uranium changes the color to yellow. (Distinction from cupric ferrocyanide. Ferrocyanide gives a green precipitate with vanadium, the color deepens on addition of nitric acid. A blue color is produced with ferric iron. No color change with chromates. Distinction from vanadium, chromium and iron.)

Barium carbonate precipitates the uranic ion completely (distinction from the ions of nickel, cobalt, manganese, zinc).

Disodium hydrogen phosphate added to uranyl solutions, in presence of alkali acetates or free acetic acid gives a yellowish white precipitate, $UO_2HPO_4 \cdot x H_2O_7$, soluble in mineral acids. Warming promotes precipitation.

Tartaric acid, certain organic compounds, hydroxylamine hydrochloride, ammonium carbonate, prevent precipitation of uranium by alkalies and ammonia.

Oxides UO₂, brown or black; UO₃, brick red; UO₂(OH)₂, yellow. All oxides are converted to U₃O₈ on ignition with free access of air.

* Professor of Chemistry, Colorado School of Mines. Author of Technical Methods of Ore Analysis.

ESTIMATION

The element occurs in the following minerals: 2

Pitchblende, or uraninite, containing 40 to 90% U₃O₄.

Autunite, Ca(UO₂)₂P₂O₅·8H₂O, contains 55 to 62% UO₃.

Torbernite, Cu(UO₂)₂·P₂O₅·8H₂O, contains 57 to 62% UO₃.

Carnotite, a vanadate of potassium and uranium, V₂O₅·U₂O₁·K₂O·3H₂O.

Samarskite, a urano-tantalate of iron and yttrium, etc., 10 to 13% UO₂.

Fergusonite, a columbate of cerium, uranium, yttrium, calcium and iron.

Nearly all the silicates, phosphates and zirconates of the rare earths contain uranium.

The element is used in the ceramic industry for producing yellow, brown, gray, and velvety-black tints. It produces canary-yellow glass. It is used as a mordant in dyeing of silk and wool. It also finds use in photography. The metal is used in cigarette-lighters and self-lighting burners.

Preparation and Solution of the Sample

The element dissolves in hydrochloric and in sulphuric acids; less readily in nitric acid. It is insoluble in alkaline solutions.

The oxide, UO2, dissolves in nitric acid and in concentrated sulphuric acid.

 U_2O_8 is readily soluble in nitric acid, but dissolves with difficulty in hydrochloric acid. V_2O_5 dissolves with difficulty in nitric acid but easily in hydrochloric (red colored solution); U_3O_8 is readily soluble in a mixture of glacial acetic-nitric acids (100:5), V_2O_5 and Fe_2O_3 (ignited) are practically insoluble in this reagent.

The salls, UF₄ and UO₂(HPO₄)₂·4H₂O, are insoluble in water, but dissolve in strong mineral acids.

Solution of Ores. One gram or more of the ore is dissolved with 15 to 20 cc. of aqua regia, by placing the mixture first on the steam bath for ten to fifteen minutes and then gently boiling over a low flame or on the hot plate. The solution is taken to dryness, silica dehydrated as usual, the residue treated with 10 cc. of hot dilute hydrochloric acid and diluted to about 50 cc. with hot water and the silica filtered off. Uranium passes into the filtrate. The solution is now treated as directed under Separations. If much silica or acid-insoluble matter is present, this should be treated in a platinum dish with strong hydrofluoric acid, and evaporated twice on the steam bath with hydrochloric acid to expel HF. The residue, dissolved with hydrochloric acid and water, is added to the first portion of solution obtained.

Carnotite. Solution of the ore is readily effected by boiling with nitric acid to which a little hydrofluoric acid is added. One gram of ore with 20 cc. nitric acid and 5 cc. hydrofluoric acid at boiling temperature will be completely decomposed in five minutes. Some authorities recommend addition of sulphuric acid with ores containing barium to break up the combination of barium and uranium. If the lead acetate separation of vanadium is used, the sulphuric acid should be expelled previously to this separation. Consult the gravimetric procedures following the section on "Separations."

SEPARATIONS

Separation of Uranium from Copper, Lead, Bismuth, Arsenic, Antimony and the Other Members of the Hydrogen Sulphide Group. The solution containing uranium, etc., having an acidity of about 5 cc. strong HCl per 100 cc. of solution, is saturated with hydrogen sulphide and allowed to settle and again saturated with H₂S. The sulphides are filtered off and washed. The filtrate and washings contain the uranium that was present in the sample.

Separation of Uranium from Iron and from Elements Having Water-insoluble Carbonates. The filtrate from the hydrogen sulphide group is concentrated to about 150 cc., and 15 cc. of hydrogen peroxide added. The solution is now neutralized with sodium carbonate and about 3 grams added in excess. After boiling for about twenty minutes, renewing the water evaporated, the hydroxide of iron, insoluble carbonates, etc., are filtered off, washed with hot water and the filtrate set aside for the determination of uranium. To recover any occluded uranium the precipitate is dissolved in just sufficient nitric acid to effect solution, and iron again precipitated by addition of hydrogen peroxide and sodium carbonate and boiling as directed above. The combined filtrates from this precipitate are concentrated to about 250 cc.

Separation of Uranium from Vanadium. Procedure 1. To be Used in the Gravimetric Determination of Uranium. The solution obtained as directed, under the previous separation, is acidified with nitric acid, adding a slight excess, and CO_2 expelled by boiling. The acid is now neutralized with ammonia in slight excess, then re-acidified with nitric acid in slight excess, finally adding about 4 cc. of the strong acid additional. Vanadium is now precipitated as lead vanadate by adding 10 cc. of a 10% solution of lead acetate, followed by sufficient strong ammonium acetate solution (1 vol. strong $NH_4OH + 1$ vol. $H_2O +$ sufficient glacial acetic acid to neutralize the NH_4OH) to neutralize the free nitric acid (about 20 cc.). The precipitated lead vanadate is allowed to settle for a couple of hours on the steam bath, and is then filtered off (returning the first portions if not perfectly clear) and washed well with hot water. The uranium passes into the filtrate.

The excess of lead remaining in the filtrate is next removed. A marked excess of ammonia is added to the hot filtrate, which is then boiled for about a minute and filtered. No washing required. The precipitate contains all the uranium as ammonium uranate, perhaps some ferric and aluminum hydroxides and a portion of the lead. Most of the lead passes into the filtrate, which is discarded. The precipitate is now treated on the filter with a strong hot solution of ammonium carbonate containing a little free ammonia until all the uranium is dissolved and then washed with the same solution diluted. Most of the admixed lead and other impurities remain on the filter, the lead as carbonate. Sufficient strong hydrogen sulphide water is now added to the filtrate, or the gas is passed to precipitate all the lead remaining. The mixture is heated to boiling and then allowed to stand until clear. Any iron present is precipitated with the lead. Finally, the uranium solution is filtered off and the precipitate washed with hydrogen sulphide water containing a little ammonium carbonate. The filtrate is boiled to expel the hydrogen sulphide and ammonium carbonate and concentrated to 200-250 cc. Uranium is now precipitated and determined by the gravimetric procedure given on page 581a.

Procedure 2. To be Used in the Volumetric Determination of Uranium. The separation of vanadium from uranium may be effected by precipitation of the latter as a phosphate according to the following procedure. The solution is heated and allowed to run in a small stream through a funnel with constricted stem, into a boiling solution of 15 grams of ammonium acetate, 5 grams of microcosmic salt dissolved in 100 cc. of water containing about 5 cc. of glacial acetic acid. A rod, with a cup-shaped tip, placed in the solution prevents bumping. The mixture is allowed to boil for a few minutes, the beaker is then removed from the heat and the precipitate allowed to settle. This is now transferred to a filter after first decanting off the clear solution. It is washed once with hot water. then washed back into the beaker and dissolved in a small amount of hot dilute nitric acid, the precipitate clinging to the filter being dissolved off by the acid. which is allowed to run through the filter into the beaker. This nitric acid solution containing the vanadium is diluted to about 75 cc. and the uranium (together with aluminum if present) again precipitated as the phosphate according to the procedure described. The precipitate is again transferred to the filter previously used, and washed off with hot water four or five times. Vanadium passes into the filtrate. The phosphate is now dissolved off the filter with 15 cc. of hot dilute sulphuric acid (1:3), and uranium determined by titration with permanganate according to the directions given under the volumetric method described later.

Glacial Acetic Method for Separating Uranium from Vanadium.* Uranium nitrate or oxide dissolves readily in a mixture of glacial acetic acid and nitric acid, 20 parts of the former to 1 part of the latter. The nitrate and oxide of vanadium are insoluble in the reagent. Addition of water causes vanadium to dissolve. See method for determining uranium in Carnotite under the "Gravimetric" methods.

Separation of Uranium from Molybdenum, Tungsten and Vanadium.* The residue obtained by evaporating a mixture of uranyl nitrate and nitric acid with ammonium molybdate, or sodium tungstate, or sodium vanadate to dryness, is slightly moistened with nitric acid (5 cc. HNO₃-1.42) and extracted with ether; uranium dissolves completely while molybdenum, tungsten and vanadium remain insoluble. The evaporation is conveniently conducted in a glass boat of a size that may be placed in the paper thimble of a Soxhlet extraction apparatus, commonly used with volatile solvents. The extraction is generally complete after the ether has siphoned over five or six times.

* Peligot, Ann. Chem. Phys., (3) 5 (1842). C. A. Pierlé, Jour. Ind. Eng. Chem. 21, 60 (1920).

GRAVIMETRIC DETERMINATION OF URANIUM AS THE OXIDE, U₃O₈

Procedure. The filtrate containing the uranium, as obtained according to the method given, under "Separations," is made slightly acid with nitric acid and boiled for a short time to ensure the absence of CO₂, then ammonia is added in marked excess, the mixture boiled for about a minute more and filtered. No washing necessary. Either paper or a weighed Gooch crucible may be used for the filtration. The precipitate is dried and ignited to the oxide U₃O₈, in which form it is weighed.

 $U_3O_8 \times 0.8482 = U.$

Notes. The purity of the oxide may be ascertained by dissolving in HNO₃ and testing for vanadium with H_2O_2 and for Al_2O_3 by adding $(NH_4)_2CO_3$.

Treadwell recommends that the oxide be reduced by hydrogen passed over the red-hot residue, the brown UO₂ being formed. The oxide is cooled in a current of hydrogen.

GRAVIMETRIC METHOD FOR URANIUM IN ORES*

Take 0.5 gram of the finely ground ore, or more, according to richness. Treat by heating gently in an 8-oz. "copper flask" with nitric or hydrochloric acid, or both, together with about 1-2 cc. of hydrofluoric acid, to effect complete solution of the uranium. Sometimes galena is present, in which case it is best to start with 10 cc. or more of hydrochloric acid and heat until the galena is decomposed. Whenever hydrochloric acid is used, boil almost to dryness to expel most of it before continuing. To this residue, or to the original ore, if hydrochloric acid appeared unnecessary, add 10 cc. of nitric acid and 1-2 cc. of hydrofluoric acid. Boil very gently to effect complete decomposition, and finally to approximate dryness. Allow to cool, add 3 cc. of nitric acid and 50 cc. of hot water, and see that everything soluble is dissolved.

Now make slightly alkaline with ammonia, then just acid with nitric acid, and again alkaline with a little solid ammonium carbonate, followed by about 5 cc. of strong ammonia and 3-4 grams more of ammonium carbonate.

Boil for about a minute and then filter, having a wetted wad of absorbent cotton in the apex of the filter. Wash twice with hot water. Boil and concentrate the filtrate in a covered beaker during the next step.

Dissolve the precipitate on the filter with a little hot dilute nitric acid, receiving the filtrate in the original flask. Again neutralize and precipitate as before, washing this second precipitate well with hot water. Add the filtrate to the first one and continue the concentration to 150-200 cc. Now acidify with nitric acid, and then, in case of doubt, add about 1 cc. of hydrogen peroxide. A reddish brown color indicates vanadium.

A. Vanadium Present.—Boil to expel any remaining CO₂, make just alkaline with ammonia, then just acid with nitric acid, finally adding about 4 cc. of the latter in excess. The appearance of the liquid is usually a sufficient indication of the neutralization points. Now add 1 gram of lead acetate crystals and then sufficient ammonium acetate solution (about 20 cc.) to neutralize the nitric acid and precipitate the lead vanadate. Boil for about 10 minutes and then filter through a double filter, returning the first portions if not perfectly

^{*} By Albert H. Low.

Wash with hot water. Receive the filtrate in a large beaker. bulky, boil down to perhaps 200-250 cc. Now add ammonia in marked excess and boil for a minute to expel any CO₂. Filter hot, 1 paying no attention to a turbid filtrate unless it is yellowish (in which case wash the precipitate once with hot water, re-acidify the filtrate with nitric acid, heat to boiling and again precipitate with ammonia, filtering through the previous precipitate). No washing required. Place the last beaker under the funnel and fill the latter with a strong hot solution of ammonium carbonate, to which some free ammonia has been added. Usually one filling is sufficient to dissolve all the uranium and leave a white residue of lead carbonate, perhaps slightly discolored by a trace of iron. Wash with hot water, using a little more of the ammonium carbonate solution, if apparently necessary. Add to the filtrate sufficient strong hydrogen sulphide water to precipitate all the remaining lead (ordinarily 25 cc. of strong hydrogen sulphide water), or pass the gas for a short time. This also removes traces of iron. Heat to boiling, then allow to stand and settle. Filter, washing with hydrogen sulphide water containing some ammonium carbonate. Boil to expel the sulphide, then acidify with nitric

acid and boil off all CO₂. Continue according to C.

B. Vanadium Absent.—Boil the nitric acid solution sufficiently to expel all CO₂, then add ammonia in marked excess and boil a little longer to expel any CO₂ in the ammonia. Filter the hot mixture, returning the first portions if not perfectly clear. No washing required. Dissolve the uranium on the filter with hot ammonium carbonate solution, as described in the last paragraph, and continue from this point as in the same situation above. Do not omit the hydrogen sulphide treatment, for, even in the absence of lead, there will usually be traces of iron to be removed. Continue according to C.

C. Add ammonia in marked excess, boil well for one minute and then filter through an ashless filter, returning the first portions if not clear. No washing required. Ignite filter and precipitate thoroughly in a porcelain crucible and weigh, after cooling, as U_3O_8 . Impurities are usually present.

Dissolve the residue in the crucible by warming with a little nitric acid. Dilute and test for vanadium with hydrogen peroxide. A faint brownish tinge may be neglected. Rinse the solution into a small beaker, add solid ammonium carbonate in excess, boil a minute or two and then filter through a small filter, washing with hot water. The residue on the filter may consist of alumina and other insoluble matter. Ignite filter and residue in the original crucible, weigh and deduct the weight from that of the impure U₃O₈ previously found.

Ammonium Acetate Solution.—Eighty cc. of strong ammonia, 100 cc. of water and 70 cc. of 90 per cent. glacial acetic acid.

Note.—A yellow filtrate from the ammonium uranate indicates incomplete precipitation. This may be due to a deficiency in ammonium nitrate, as ammonium uranate is perceptibly soluble in pure water. Add a gram or so of ammonium nitrate to the filtrate, boil and refilter. Or, better, dissolve the precipitate on the filter with dilute nitric acid, so that the mixed filtrates will be markedly acid, and repeat the precipitation with ammonia. The filtrate should be colorless.

GLACIAL ACETIC ACID METHOD FOR DETERMINING URANIUM IN CARNOTITE*

The following method depends upon the fact that uranium nitrate or oxide is soluble in a mixture of glacial acetic and nitric acids in the proportion of 20 parts by volume of the former to 1 part of the latter, while vanadic nitrate and oxide (V_2O_5) are not.¹

Procedure

Half a gram or more of carnotite ore according to its richness (ground to pass 100-mesh sieve) is taken for analysis and digested at boiling temperature with 25 cc. dilute HNO₃ (1:1) and 1-2 cc. HF. (An amount that will fill a small crucible lid.) The solution is rapidly evaporated to dryness and baked

gently to expel water, but not ignited.

Fifteen to 20 cc. of glacial acetic-nitric reagent (20:1) are added, rinsing down the sides of the beaker to remove any adhering material, using a policeman if necessary. (The reagent may be conveniently handled in a small wash bottle, the transferring of precipitates and washing with the reagent being necessary, no water being used at this stage.) The residue transferred to a filter is washed with the reagent five or six times, using small portions of the mixture.

The filtrate and glacial washings are rapidly evaporated to dryness and the residue again extracted with glacial-nitric acids.² This extract, free from vanadium,³ is evaporated to dryness, and gently heated over a free flame until the residue turns dark.⁴ Ten cc. of nitric acid and 40 cc. of water are added and the mixture heated to dissolve the uranium.

The greater part of the free nitric acid is neutralized by addition of ammonia (no permanent precipitate should form). Solid ammonium carbonate is added (covering the beaker during the intervals between additions of the carbonate as loss will occur through effervescence in an uncovered beaker) until a precipitate forms that remains undissolved on stirring. 2-3 grams additional ammonium carbonate and 5 cc. of ammonium hydroxide are now added and the solution warmed to coagulate the hydroxides of iron and aluminum. Uranium passes into solution.

The precipitate is filtered off and washed with hot water. The filtrate and washings (concentrated by boiling to about 150 cc.-200 cc. if the volume is large) is acidified with nitric acid (uranium precipitates andre dissolves). Carbon dioxide is expelled by boiling and a decided excess of ammonium hydroxide added. The boiling is now continued until uranium precipitates completely. If the supernatant solution is yellow, it is again acidified with nitric acid, followed by an excess of ammonium hydroxide and the boiling repeated. This generally effects complete precipitation.

The precipitated uranium is filtered off, washing being unnecessary. The filter and precipitate are placed in a crucible, the greater part of the water expelled by drying and the material then ignited. The greenish black residue

is weighed as U₂O₂.

This residue should be soluble when boiled with nitric acid. If it is not, contamination by iron and aluminum is indicated. Any residue remaining should be filtered off, then washed free of uranium with hot water, and ignited. Its weight is subtracted from the uranium oxide to obtain the true value of U_3O_8 .

Notes. 1. C. A. Pierlé, Jour. Ind. Eng. Chem. 12, 61, 1920.

^{*} Method by Wilfred W. Scott.

- 2. Uranium dissolves completely in the glacial-acetic mixture. A small amount of the vanadium may dissolve, hence the extract is evaporated and the residue again extracted. A smaller quantity of the reagent may be used in this second extraction. 25 cc. of the reagent will dissolve, at boiling temperature, about 4.5 grams of U_2O_8 in five minutes and about 0.003 gram of V_2O_8 . The proportion of glacial acetic acid to nitric acid should not fall below 10:1, otherwise vanadium will dissolve in appreciable amount. The author uses a round bottom flask filled with cold water, placing this over the beaker to act as a condenser to prevent loss of acetic acid.
- 3. The acetic acid extract filters rapidly. The red colored residue contains the vanadium and practically all of the silica, iron and alumina.
- 4. The residue is ignited to destroy organic matter which would prevent precipitation of uranium by ammonia.
- 5. Uranium carbonate precipitates and then dissolves in the acid when present in excess. CO₂ must be expelled as this prevents precipitation of uranium by ammonium hydroxide.
- 6. A colored solution indicates the presence of uranium. The nitrate formed by acidification with HNO₂ and making alkaline with ammonia with additional boiling insures complete precipitation of uranium.
- 7. Nitric acid dissolves uranium oxide very easily. The oxide of iron is practically insoluble. Vanadic oxide difficultly soluble.
- 8. Hydrogen peroxide added to the nitric extract will produce a reddish brown color if vanadium is present.

Wash water used in transferring the uranium precipitate should contain ammonium nitrate to prevent solution of uranium.

DETERMINATION OF URANIUM IN CARNOTITE

The following method, worked out by C. E. Scholl, is adapted for eliminating the difficulties in an accurate determination of uranium, caused by the presence of iron, alumina and vanadium, which commonly occur in carnotite.

Procedure. To the sample of material containing about 0.2 gram uranium oxide, are added 25 to 50 cc. 1:1 nitric acid and heat applied until all the uranium is in solution. If necessary, allow to stand on the water bath to keep warm overnight. After diluting with warm water to 250 cc. the solution is filtered. Ferric chloride, equivalent to about three times the weight of vanadium present, is added. To the cold or slightly warm solution solid sodium carbonate is now added in small portions until all the acid is neutralized and then an excess of 1 gram added, the beaker being kept covered during the intervals between the additions. The sample is placed on a hot plate and heated to about 90° C., but not to boiling. keeping hot for 15 minutes, the solution is filtered and washed. The residue contains all the iron and vanadium and the greater part of the aluminum. The filtrate is neutralized cautiously with nitric acid until uranium begins to precipitate. The greater part of the CO₂ is removed by boiling. Sodium hydroxide is now added in excess and after boiling 15 minutes the solution is filtered. The filtrate contains the remainder of the aluminum and the vanadium not previously precipitated. The precipitate containing the uranium is dissolved in dilute nitric acid and heated to 90° C. and an excess of NH₄OH added and the solution boiled. The precipitate is filtered off, ignited and weighed as uranium oxide, U₃O₄.

The oxide is tested for its purity with nitric acid as in the previous method.

'Jour. Ind. Eng. Chem., Vol. 11, No. 9, p. 842, Sept., 1919.

VOLUMETRIC DETERMINATION OF URANIUM BY REDUCTION AND OXIDATION

Introduction. The determination of uranium by oxidation of the lower oxide UO₂ to UO₃ may be accomplished by means of potassium permanganate in precisely the same manner as in the determination of iron, the Jones reductor being used for the reduction of the uranic salt to the uranous form. The metal must be in solution either as a sulphate, a chloride or an acetate, but not as a nitrate. If present as a chloride the usual preventative solution of phosphoric acid and manganous sulphate solution must be present as in case of the titration of a chloride of iron, hence a sulphate solution is to be preferred. Although the degree of reduction varies with conditions, it is found that with brief contact with the oxygen of the air the oxide UO₂ is formed.¹

Procedure. Solution. The method for preparation of the sample, isolation of the uranium, has been given under Preparation and Solution of the Sample and Separations. The solution from the ammonium carbonate precipitate is acidified with sulphuric acid and boiled to expel the CO₂.

Reduction. The uranium sulphate solution, diluted to a volume of 100 to 150 cc., containing one-sixth of its volume of sulphuric acid, is heated nearly to boiling and the organic matter that may be present oxidized by addition of just sufficient potassium permanganate solution to produce a faint pink color. Fifteen to 20 cc. of dilute sulphuric acid are passed through the 18-in. column of zinc in the Jones reductor, followed by the hot uranium sulphate solution, flowing very slowly, fifteen to twenty-five minutes being required for 0.2 gram uranic oxide, thirty to forty minutes for 0.3 gram of the oxide, care being taken that the liquid in the reductor always covers the zinc.² The uranic solution is followed by 10 to 15 cc. of dilute 1: 6 solution of sulphuric acid.

Titration. The olive-green solution is poured into a beaker or casserole. The lower oxides are immediately oxidized to UO₂ by the air, as seen by the slight change of color to sea green. The hot solution is now titrated with tenth normal permanganate. The solution during titration gradually becomes more and more yellowish green, as the highest oxidation is approached, until a faint pink color is obtained. With large amounts of uranium the color appears a yellowish pink.

One cc. N/10 KMnO₄ = 0.11925 gram U.

Note. 55.85 grams Fe is equivalent to 119.25 grams U.—Sutton.

C. A. Pierlé² claims that high results are obtained by this method.

¹Oxidation of lower oxides by air to UO₂". O. S. Pulman, Jr. Am. Jour. Sc. (4), 16, 229.

² Hydrogen dioxide formed by nascent hydrogen in contact with air would vitiate results.—Gooch.

VANADIUM

WILFRED W. SCOTT

V, at.wt. 51.0; sp.gr. 6.025; m.p. 1720° C.; oxides V_2O_1 , V_2O_2 , V_2O_3 , V_2O_4 , V_2O_4 ; vanadates—meta NaVO₃, ortho Na₂VO₄, pyro Na₄V₂O₇, tetra Na₂HV₄O₁₇, hexa Na₂H₁V₆O₁₇.

DETECTION

Ammonium Sulphide or Hydrogen Sulphide passed into an ammoniacal solution of vanadium precipitates brown $V_{z}S_{z}$, soluble in an excess of alkali sulphide and in alkalies, forming the brownish-red thio-solution, from which the sulphide may be reprecipitated by acids.

Reducing Agents. Metallic zinc, sulphites (SO₂), oxalic acid, tartaric acid, sugar, alcohol, hydrogen sulphide, hydrochloric acid, hydrobromic and hydriodic acids (KI) reduce the acid solutions of vanadates with formation of a blue-colored liquid. (See Volumetric Methods.) Reduction is hastened by heating.

Hydrogen Peroxide added to a cold acid solution of vanadium produces a

brown color, changing to blue upon application of heat.

Solid Ammonium Chloride added to a neutral or slightly alkaline solution of a vanadate precipitates the colorless, crystalline salt, NH₄VO₁, insoluble in ammonium chloride. The ammonium metavanadate ignited is decomposed, ammonia volatilizing and the red pentoxide of vanadium remaining as a residue.

The colorless ammonium vanadate solution becomes yellow when slightly

acidified. Acids produce a red color when added to the solid salt.

The oxide, V_2O_5 , is distinguished from Fe_2O_3 by the fact that it fuses very readily with the heat of Bunsen burner, whereas the oxide of iron, Fe_2O_5 , is infusible in the heat of a blast lamp. M.p. $V_2O_5 = 658^{\circ}$ C.; m.p. $Fe_2O_3 = 1548^{\circ}$ C.

Comparison of Vanadium and Chromium Salts. Vanadium, like Chromium, forms a soluble salt upon fusion with sodium carbonate and potassium nitrate or with sodium peroxide. The solution of vanadates and of chromates are yellow or orange; the color of the chromate becomes more intense when strongly acidified, whereas that of the vanadate is reduced. The yellow color of the vanadate solution is destroyed by boiling with an excess of alkali, but may be restored by neutralizing the alkali with acid. The chromate color is not destroyed. (Yellow with alkalies, orange in acid solution.) Silver nitrate produces a dark-maroon precipitate with a soluble chromate and an orange-colored precipitate with a vanadate; mercurous nitrate produces a red-colored precipitate with chromates and a yellow with vanadates. Vanadates are also distinguished from chromates by the reduction test; reducing agents such as a soluble sulphite, or sulphurous acid added to acid solutions, form a blue-colored liquid with vanadates and a green color with chromates. Ammonium hydroxide added in excess to the cold reduced solutions

¹ Reduction with zinc is rapid with vanadates, much less vigorous with chromates. V_2O_5 reduced to V_2O_7 , color changes to blue, green, lavender and finally violet. SO_2 or H_2S reduces V_2O_5 to V_2O_4 . V_2O_2 forms vanadyl salts.

gives a brown color, or a brown to dirty green precipitate with *vanadium*, and violet or lavender color or a light green-colored precipitate with *chromium*, depending upon the concentration of the solutions. Hydrogen peroxide added to the reduced cold acid solutions changes the vanadium blue to reddish brown; the chromium green remains unchanged.

Detection of Vanadium in Steel. Five grams of the sample are dissolved in dilute nitric acid, the nitrous fumes boiled off, the solution cooled, and an excess of sodium bismuthate added. After filtering through an asbestos filter an excess of concentrated ferrous sulphate solution is added, and the solution divided into two equal parts in test-tubes. To one portion 10 cc. of hydrogen peroxide are added and to the other 10 cc. of water. If vanadium is present the peroxide solution will show a deeper color than the untreated solution. A deep red color is produced with high vanadium steels and a brownish-red with low. Since titanium also causes this color, it would interfere, if it were not for the fact that the color produced with titanium is destroyed by hydrofluoric acid and fluorides, whereas that of vanadium is not. In presence of titanium, 5 cc. of hydrofluoric acid are added to the treated sample.

The brown color produced by hydrogen peroxide, with vanadium solutions, will remain in the water portion when shaken with ether. The ether layer is colored a transient blue in presence of chromium.

ESTIMATION

The materials in which the estimation of vanadium is desired may be surmised from the following facts: Industrial application. Vanadium is used in special iron and steel alloys. It increases the strength of steel as well as the compression power, without loss of hardness, and increases the resistance to abrasion; hence vanadium steels are used in locomotive and automobile cylinders, pistons, bushings and in all parts of machines subject to jar. It is used in high-speed tools, vanadium bronzes for gears, trolley wheels, etc. It is used in indelible inks, and in the form of alkali vanadates and hypovanadates it serves as a mordant for aniline black on silk, for calico printing and like uses. Vanadium salts are used in ceramics where a golden glaze is desired.

The element occurs widely distributed in minute quantities. It is found in iron ores, hence occurs in blast-furnace slags as the oxide, V_2O_6 . The principal ores are:

Patronite, a sulphide of vanadium containing 28 to 34% V₂O₄, associated with pyrites and carbonaceous matter; the principal source of vanadium.

Vanadinite, (PbCl)Pb4(VO4)3, containing 8 to 21% V2O5.

Carnotite, K₂O·2UO₂·V₂O₅·3H₂O, contains 19 to 20% V₂O₅.

Descloizite, (PbZn)2NVOs, contains 20 to 22% V2Os.

Roscoelite, a vanadium mica with variable composition.

Eusynchite, contains 17 to 24% V2Os.

Cuprodescloizite, (PbZnCu)2(OH)VO4, contains 17 to 22% V2O4.

Calciovolborthile, (CuCa)2(OH)VO4, contains 37 to 39% V2O4.

Vanadium occurs in ores of copper and lead, it is present in certain clays and basalts, in soda ash, phosphate soda, and in some hard coals.

Preparation and Solution of the Sample

In decomposition of the material for analysis the following facts regarding the solubility of the metal, its oxides and principal salts, will be helpful:

Element. The metal is not attacked by aqueous alkalies, but is soluble by fusion with potassium or sodium hydroxide, and sodium carbonate containing potassium nitrate. It is insoluble in dilute hydrochloric and sulphuric acids. It dissolves in concentrated sulphuric acid and in dilute and concentrated nitric acid forming blue solutions.

Oxides. V_2O_2 is easily soluble in dilute acids, giving a lavender-colored solution.

V₂O₄ is insoluble in hydrochloric and sulphuric acids, and in alkali solutions. It dissolves in hydrofluoric acid, and in nitric acid.

V₂O₄ is easily soluble in acids, forming blue-colored solutions. It dissolves in alkali solutions.

V₂O₅ is soluble in acids, alkali hydroxide and carbonate solutions. Insoluble in alcohol and acetic acid.

Salts. Ammonium meta vanadate, NH₄VO₅, is slightly soluble in cold water, readily soluble in hot water. The presence of ammonium chloride renders the salt less soluble. The vanadates of lead, mercury and silver are difficultly soluble in water. These are dissolved, or are transposed by mineral acids, the vanadium going into solution; i.e., lead vanadate treated with sulphuric acid precipitates lead sulphate and vanadic acid passes into solution.

General Procedure for Decomposition of Ores. One gram (or more) of the finely divided material is placed in a large platinum crucible together with five times its weight of a mixture of sodium carbonate and potassium nitrate (Na₂CO₃=10, KNO₃=1). The product is heated to fusion over a blast lamp and, when molten, about 0.5 to 1 gram more of the nitrate added in small portions. (Caution—platinum is attacked by KNO₃. A large excess of Na₂CO₃ tends to prevent this.) The material should be kept in quiet fusion for ten to fifteen minutes, when most of the ores will be completely decomposed. The cooled fusion is extracted with boiling water, whereby the vanadium goes into solution. Arsenic, antimony, phosphorus, molybdenum, tungsten and chromium pass into solution with the vanadium. These must be removed in the gravimetric determination of this element. (Iron remains insoluble in the water extract.)

Should there be any undecomposed ore, the residue from the water extract will be gritty. If this is the case, a second fusion with the above fusion mixture should be made.

Small amounts of occluded vanadium may be recovered from the water-insoluble residue by dissolving this in nitric acid and pouring the solution into a boiling solution of sodium hydroxide. Vanadium remains in solution.

Vanadium may be determined volumetrically after removal of the hydrogen sulphide group, by titration with potassium permanganate according to the procedure given later. The isolation and determination of vanadium by the gravimetric procedures are given in detail later.

Ores and Material High in Silica. The sample is treated in a platinum dish with about ten times its weight of hydrofluoric acid (10 to 50 cc.) and 2 to 5 cc. of strong sulphuric acid. The silica is expelled as SiF₄ and the hydrofluoric acid driven off by taking the solution to SO₄ fumes. The residue is extracted with hot water containing a little sulphuric acid. Any undissolved residue may be brought

into solution by fusion with potassium acid sulphate, KHSO₄, and extraction with hot water containing a little sulphuric acid. By this treatment the iron passes into solution with vanadium.

Products Low in Silica. Decomposition may be effected by fusion in a nickel crucible with sodium peroxide and extraction with water. The water should be added cautiously, as the reaction is vigorous. One gram of the finely divided ore is intimately mixed with 3 to 4 grams of Na₂O₂ and 1 gram of the peroxide placed on the charge. The material is then fused as stated.¹

Iron and Steel. The solution of the sample, isolation of vanadium and its volumetric determination are given at the close of the chapter.

Alloys. These may be decomposed with nitric acid, or aqua regia. The isolation of vanadium with mercurous nitrate or lead acetate are given under the gravimetric methods.

SEPARATIONS

Fusion with sodium carbonate and potassium nitrate and extraction of the melt with water effect a separation of vanadium from most of the metals, which remain insoluble as carbonates or oxides. Arsenic, molybdenum, tungsten, chromium and phosphorus, however, pass into the filtrate with vanadium.

Removal of Arsenic. This element generally occurs in vanadium ores. It may be removed when desired, by acidifying the water extract of the fusion with sulphuric acid, and after reducing arsenic with SO₂, precipitating the sulphide, As₂S₂ with H₂S gas. Vanadium passes into the filtrate.

Removal of Molybdenum. The procedure is similar to that used for arsenic, with the exception that the sulphide of molybdenum is best precipitated under pressure. The solution in a pressure flask is treated with H₂S. The flask is stoppered and heated in the steam bath. It is advisable to resaturate the solution with H₂S before filtering off the sulphide.

Separation from Phosphoric Acid. In the gravimetric procedure phosphorus and vanadium are precipitated together as mercuric vanadate and phosphate. The mercury is expelled by heat and the oxides V_2O_5 and P_2O_5 weighed. (V_2O_5 in presence of P_2O_5 does not melt as it does in pure form, but only sinters.) The oxides are fused with an equal weight of sodium carbonate, the melt dissolved in water, then acidified with sulphuric acid and vanadium reduced to the vanadyl condition by SO_2 gas. The excess of SO_2 is expelled by boiling and passing in CO_2 . Phosphoric acid is now precipitated with ammonium molybdate (50 cc. of a solution containing 75 grams ammonium molybdate dissolved in 500 cc. of water and poured into 500 cc. nitric acid—sp. gr. 1.2) in presence of a large amount of ammonium nitrate and a little free nitric acid. It is advisable to dissolve the precipitate in ammonia and reprecipitate in presence of additional ammonium molybdate and nitrate by acidifying with nitric acid. The equivalent P_2O_5 is deducted from the weight of the combined oxides, the difference being due to V_2O_5 .

Note. Vanadium must be completely reduced to the vanadyl form, as vanadic acid will precipitate with phosphoric acid.

¹Direct reduction and titration of vanadium in presence of a large accumulation of salts leads to erroneous results. The vanadium should be separated by precipitation with lead acetate.

Separation of Vanadium and Chromium. A volumetric procedure for determining vanadium and chromium in the presence of one another is given. If a separation is desired the following procedures may be used:

A. The solution is acidified with nitric acid. If hydrochloric acid is present it is expelled by taking to near dryness twice with nitric acid, the residue is taken up with water and SO₂ gas passed in to completely reduce the vanadium. This solution is poured into a boiling solution of 10% sodium hydroxide. After boiling a few minutes, the solution is filtered and the residue washed. The filtrate contains vanadium, the residue chromium. It is advisable to pour the filtrate into additional caustic to remove the small amount of chromium that passes into the solution.

B. One hundred cc. of the neutral solution is made acid with about 15 cc. of glacial acetic acid and hydrogen peroxide added. The solution is boiled for a few minutes. Chromium is thereby reduced to Cr_2O_3 , whereas vanadium appears as V_2O_4 . Lead acetate will now precipitate lead vanadate, the reduced chromium remaining in solution. The lead vanadate now treated with strong sulphuric acid is decomposed upon heating. Addition of water precipitates PbSO₄, the vanadium remaining in solution.

GRAVIMETRIC METHODS

The following procedures presuppose that vanadium is present in the solution as an alkali vanadate, the form in which it occurs in the water extract from a fusion with sodium carbonate and potassium nitrate, as is described in the method of solution of ores containing vanadium. Chromium, arsenic, phosphorus, molybdenum and tungsten, if present in the ore will be found in this solution.

Mercurous Nitrate Method for Determination of Vanadium— Gravimetric ¹

Principle. A nearly neutral solution of mercurous nitrate precipitates vanadium completely from its solution. The dried precipitate ignited forms the oxide, V_2O_4 , mercury being volatilized.

Procedure. To the alkaline solution or an aliquot portion of the water extract from the sodium carbonate potassium nitrate fusion nearly neutralized with nitric acid ² (the solution should remain slightly alkaline) is added drop by drop, a nearly neutral solution of mercurous nitrate in slight excess of that necessary to precipitate completely the vanadium present, as may be determined by allowing the precipitate to settle and adding a few drops more of the reagent. The mixture is heated to boiling and then placed on the water bath or steam plate and the gray-colored precipitate allowed to settle. The precipitate is washed several times

¹ Method of Rose. J. W. Mellor, "A Treatise on Quantitative Inorganic Analysis." ² Should the alkaline solution of the vanadate be made acid, nitrous acid, from the nitrate fusion, will be liberated and cause reduction of the vanadate to the vanadyl salt, in which form it is not precipitated by mercurous nitrate; hence great care should be used in neutralizing the alkaline solution to avoid making it acid. It is a good practice to measure the acid added, having determined on an aliquot portion the amount necessary to add to neutralize the solution. This is readily accomplished when a comparatively large sample has been prepared for analysis and an aliquot portion taken for analysis, several determinations being made on the same fusion.

with water containing a few drops of mercurous nitrate, washing once or twice by decantation and finally on the filter paper. The precipitate is dried, then ignited in a porcelain crucible in a hood over a Bunsen burner to a red heat. The fused red residue is V_2O_5 .

 $V_2O_5 \times 0.5604 = V$.

Gravimetric Method of Determining Vanadium by Precipitation with Lead Acetate ¹

Principle. From a weakly acetic acid solution, vanadium is quantitatively precipitated by lead acetate. The precipitate is dissolved in nitric acid, lead removed as a sulphate, and vanadium determined in the filtrate by taking to dryness and igniting to the oxide, V₂O₅.

Procedure. To the alkaline solution or an aliquot portion obtained by extraction of the carbonate fusion of the ore with water, just sufficient amount of nitric acid is added to nearly neutralize the alkali present, as in the case of the method described for precipitation of vanadium by mercurous nitrate, and then a 10% solution of lead acetate is added in slight excess with continuous The precipitate is allowed to settle on the steam bath. The vanadate, first appearing orange colored, will fade to white upon standing. The lead vanadate is filtered and washed free of the excess of lead acetate with water containing The precipitate is washed into a porcelain dish with a little dilute nitric acid, and brought into solution by warming the lead salt with nitric acid. To this, the ash of the incinerated filter is added. Sufficient sulphuric acid is added to precipitate completely the lead, and the solution taken to small volume on the water bath and then to SO₃ fumes, but not to dryness. About 100 cc. of water are added and the mixture filtered; lead sulphate will remain upon the filter and the vanadium will be in solution. The lead sulphate is washed free of vanadium (i.e., until the washings no longer give a brown color with hydrogen peroxide).

The filtrate containing all the vanadium is evaporated to small volume in the porcelain dish, then transferred to a weighed platinum crucible and evaporated to dryness on the water bath and finally the residue (V₂O₅) heated to a dull redness over a Bunsen flame.

$$V_2O_6 \times 0.5604 = V$$
.

Notes. Lead may be separated from the vanadium by passing H_2S through the nitric acid solution, the excess of H_2S volatilized by boiling and the liberated sulphur filtered off. The filtrate is evaporated to dryness and the vanadium ignited with a few drops of nitric acid to the oxide V_2O_5 .

Lead may also be separated as lead chloride in the presence of alcohol, the solution taken to dryness and vanadium oxidized by addition of nitric acid and ignited to V_2O_{δ} .

¹ Method by Roscoe, Ann. Chem. Pharm., Supplement 8, 102, 1872. Treadwell and Hall, "Analytical Chemistry," p. 305.

VOLUMETRIC PROCEDURES FOR THE DETERMINATION OF VANADIUM

Reduction of the Vanadate, V₂O₅, to Vanadyl Condition, V₂O₄, and Reoxidation with Potassium Permanganate

Principle. Vanadium in solution as a vanadate is reduced to the vanadyl salt by H₂S or SO₂, the excess of the reducing agent expelled and the solution titrated with standard KMnO₄, vanadium being oxidized to its highest form, V₂O₅.

Reactions. a. $V_2O_5 + SO_2 = V_2O_4 + SO_3$. b. $V_2O_4 + O = V_2O_5$. Hence

$$N/10$$
 sol. = $\frac{At. wt. V}{10}$ grams to the liter.

Procedure. An aliquot portion of the solution containing vanadium, as obtained by one of the procedures given for the solution of the sample, is taken for analysis; dilute sulphuric acid (1:1) is added to acid reaction and 5 cc. of acid per 100 cc. of solution added in excess. The vanadium content should be not over 0.5 gram V when a tenth normal permanganate is used for the titration. If arsenic or molybdenum is present these may be removed from the solution by passing in H₂S. The insoluble sulphides are filtered off and washed with H₂S water. The filtrate is boiled down to two-thirds of its volume and the sulphur filtered off. In the absence of members of the H₂S group, this portion of the procedure is omitted.

Oxidation with KMnO₄. The solution containing the vanadium is oxidized by adding, from a burette, tenth normal potassium permanganate to a faint permanent pink. If the solution has been treated with H₂S, the vanadium is in the vanadyl condition, and the amount of permanganate required to oxidize the solution completely will give a close approximate value for the vanadium present, each cc. of N/10 KMnO₄ being equivalent to 0.0051 gram vanadium.

Reduction. The vanadite is now reduced to vanadyl salt by passing through the acid solution, containing approximately 5% free sulphuric acid, a steady stream of SO₂ gas. Reduction may also be accomplished by adding sodium metabisulphite, or sodium sulphite, to the acid solution. The excess SO₂ is now removed by boiling (a current of CO₂ passed into the hot solution will assist in the complete expulsion of the SO₂).

NOTE. KMnO4 is reduced by SO2.

Test for Iron. A drop test with potassium ferricyanide, $K_1Fe(CN)_6$, on a white tile will give a blue color in the presence of ferrous iron. Since ferrous iron will titrate with potassium permanganate, its oxidation is necessary. This is accomplished by adding tenth normal potassium dichromate solution cautiously to the cold liquid until no blue color is produced by the spot test with $K_1Fe(CN)_6$ outside indicator. If the sample is sufficiently dilute, the blue color of the vanadyl solution will not interfere in getting the point where the iron is completely oxidized. Care must be taken not to pass this end-point, otherwise Va_2O_4 will also be oxidized and the results will be low.

NOTE. The action of the dichromate is selective to the extent that iron is first oxidized and then V₂O₄. If the amount of iron present is large a separation must be effected. In case a sodium carbonate potassium nitrate fusion has been made and

with water containing a few drops of mercurous nitrate, washing once or twice by decantation and finally on the filter paper. The precipitate is dried, then ignited in a porcelain crucible in a hood over a Bunsen burner to a red heat. The fused red residue is V_2O_4 .

 $V_2O_4 \times 0.5604 = V$.

Gravimetric Method of Determining Vanadium by Precipitation with Lead Acetate ¹

Principle. From a weakly acetic acid solution, vanadium is quantitatively precipitated by lead acetate. The precipitate is dissolved in nitric acid, lead removed as a sulphate, and vanadium determined in the filtrate by taking to dryness and igniting to the oxide, V_2O_5 .

Procedure. To the alkaline solution or an aliquot portion obtained by extraction of the carbonate fusion of the ore with water, just sufficient amount of nitric acid is added to nearly neutralize the alkali present, as in the case of the method described for precipitation of vanadium by mercurous nitrate, and then a 10% solution of lead acetate is added in slight excess with continuous The precipitate is allowed to settle on the steam bath. The vanadate, first appearing orange colored, will fade to white upon standing. The lead vanadate is filtered and washed free of the excess of lead acetate with water containing acetic acid. The precipitate is washed into a porcelain dish with a little dilute nitric acid, and brought into solution by warming the lead salt with nitric acid. To this, the ash of the incinerated filter is added. Sufficient sulphuric acid is added to precipitate completely the lead, and the solution taken to small volume on the water bath and then to SO₃ fumes, but not to dryness. About 100 cc. of water are added and the mixture filtered; lead sulphate will remain upon the filter and the vanadium will be in solution. The lead sulphate is washed free of vanadium (i.e., until the washings no longer give a brown color with hydrogen peroxide).

The filtrate containing all the vanadium is evaporated to small volume in the porcelain dish, then transferred to a weighed platinum crucible and evaporated to dryness on the water bath and finally the residue (V₂O₅) heated to a dull redness over a Bunsen flame.

 $V_2O_4 \times 0.5604 = V$.

Notes. Lead may be separated from the vanadium by passing H_2S through the nitric acid solution, the excess of H_2S volatilized by boiling and the liberated sulphur filtered off. The filtrate is evaporated to dryness and the vanadium ignited with a few drops of nitric acid to the oxide V_2O_4 .

Lead may also be separated as lead chloride in the presence of alcohol, the solution taken to dryness and vanadium oxidized by addition of nitric acid and ignited to V₂O₈.

¹ Method by Roscoe, Ann. Chem. Pharm., Supplement 8, 102, 1872. Treadwell and Hall, "Analytical Chemistry," p. 305.

VOLUMETRIC PROCEDURES FOR THE DETERMINATION OF VANADIUM

Reduction of the Vanadate, V₂O₅, to Vanadyl Condition, V₂O₄, and Reoxidation with Potassium Permanganate

Principle. Vanadium in solution as a vanadate is reduced to the vanadyl salt by H₂S or SO₂, the excess of the reducing agent expelled and the solution titrated with standard KMnO₄, vanadium being oxidized to its highest form, V₂O₅.

Reactions. a. $V_2O_5 + SO_2 = V_2O_4 + SO_3$. b. $V_2O_4 + O = V_2O_5$. Hence

$$N/10$$
 sol. = $\frac{At. wt. V}{10}$ grams to the liter.

Procedure. An aliquot portion of the solution containing vanadium, as obtained by one of the procedures given for the solution of the sample, is taken for analysis; dilute sulphuric acid (1:1) is added to acid reaction and 5 cc. of acid per 100 cc. of solution added in excess. The vanadium content should be not over 0.5 gram V when a tenth normal permanganate is used for the titration. If arsenic or molybdenum is present these may be removed from the solution by passing in H₂S. The insoluble sulphides are filtered off and washed with H₂S water. The filtrate is boiled down to two-thirds of its volume and the sulphur filtered off. In the absence of members of the H₂S group, this portion of the procedure is omitted.

Oxidation with KMnO₄. The solution containing the vanadium is oxidized by adding, from a burette, tenth normal potassium permanganate to a faint permanent pink. If the solution has been treated with H₂S, the vanadium is in the vanadyl condition, and the amount of permanganate required to oxidize the solution completely will give a close approximate value for the vanadium present, each cc. of N/10 KMnO₄ being equivalent to 0.0051 gram vanadium.

Reduction. The vanadite is now reduced to vanadyl salt by passing through the acid solution, containing approximately 5% free sulphuric acid, a steady stream of SO₂ gas. Reduction may also be accomplished by adding sodium metabisulphite, or sodium sulphite, to the acid solution. The excess SO₂ is now removed by boiling (a current of CO₂ passed into the hot solution will assist in the complete expulsion of the SO₂).

NOTE. KMnO4 is reduced by SO2.

Test for Iron. A drop test with potassium ferricyanide, $K_tFe(CN)_t$, on a white tile will give a blue color in the presence of ferrous iron. Since ferrous iron will titrate with potassium permanganate, its oxidation is necessary. This is accomplished by adding tenth normal potassium dichromate solution cautiously to the cold liquid until no blue color is produced by the spot test with $K_tFe(CN)_t$ outside indicator. If the sample is sufficiently dilute, the blue color of the vanadyl solution will not interfere in getting the point where the iron is completely oxidized. Care must be taken not to pass this end-point, otherwise Va_tO_t will also be oxidized and the results will be low.

Note. The action of the dichromate is selective to the extent that iron is first oxidized and then V_2O_4 . If the amount of iron present is large a separation must be effected. In case a sodium carbonate potassium nitrate fusion has been made and

with water containing a few drops of mercurous nitrate, washing once or twice by decantation and finally on the filter paper. The precipitate is dried, then ignited in a porcelain crucible in a hood over a Bunsen burner to a red heat. The fused red residue is V_2O_4 .

 $V_2O_4 \times 0.5604 = V$.

Gravimetric Method of Determining Vanadium by Precipitation with Lead Acetate ¹

Principle. From a weakly acetic acid solution, vanadium is quantitatively precipitated by lead acetate. The precipitate is dissolved in nitric acid, lead removed as a sulphate, and vanadium determined in the filtrate by taking to dryness and igniting to the oxide, V_2O_5 .

Procedure. To the alkaline solution or an aliquot portion obtained by extraction of the carbonate fusion of the ore with water, just sufficient amount of nitric acid is added to nearly neutralize the alkali present, as in the case of the method described for precipitation of vanadium by mercurous nitrate, and then a 10% solution of lead acetate is added in slight excess with continuous The precipitate is allowed to settle on the steam bath. The vanadate, first appearing orange colored, will fade to white upon standing. The lead vanadate is filtered and washed free of the excess of lead acetate with water containing acetic acid. The precipitate is washed into a porcelain dish with a little dilute nitric acid, and brought into solution by warming the lead salt with nitric acid. To this, the ash of the incinerated filter is added. Sufficient sulphuric acid is added to precipitate completely the lead, and the solution taken to small volume on the water bath and then to SO₃ fumes, but not to dryness. About 100 cc. of water are added and the mixture filtered; lead sulphate will remain upon the filter and the vanadium will be in solution. The lead sulphate is washed free of vanadium (i.e., until the washings no longer give a brown color with hydrogen peroxide).

The filtrate containing all the vanadium is evaporated to small volume in the porcelain dish, then transferred to a weighed platinum crucible and evaporated to dryness on the water bath and finally the residue (V₂O₅) heated to a dull redness over a Bunsen flame.

 $V_2O_5 \times 0.5604 = V$.

Notes. Lead may be separated from the vanadium by passing H_2S through the nitric acid solution, the excess of H_2S volatilized by boiling and the liberated sulphur filtered off. The filtrate is evaporated to dryness and the vanadium ignited with a few drops of nitric acid to the oxide V_2O_5 .

Lead may also be separated as lead chloride in the presence of alcohol, the solution taken to dryness and vanadium oxidized by addition of nitric acid and ignited to V_2O_5 .

¹ Method by Roscoe, Ann. Chem. Pharm., Supplement 8, 102, 1872. Treadwell and Hall, "Analytical Chemistry," p. 305.

VOLUMETRIC PROCEDURES FOR THE DETERMINATION OF VANADIUM

Reduction of the Vanadate, V₂O₅, to Vanadyl Condition, V₂O₄, and Reoxidation with Potassium Permanganate

Principle. Vanadium in solution as a vanadate is reduced to the vanadyl salt by H_2S or SO_2 , the excess of the reducing agent expelled and the solution titrated with standard KMnO₄, vanadium being oxidized to its highest form, V_2O_4 .

Reactions. a. $V_2O_5 + SO_2 = V_2O_4 + SO_3$. b. $V_2O_4 + O = V_2O_5$. Hence

$$N/10$$
 sol. = $\frac{At. wt. V}{10}$ grams to the liter.

Procedure. An aliquot portion of the solution containing vanadium, as obtained by one of the procedures given for the solution of the sample, is taken for analysis; dilute sulphuric acid (1:1) is added to acid reaction and 5 cc. of acid per 100 cc. of solution added in excess. The vanadium content should be not over 0.5 gram V when a tenth normal permanganate is used for the titration. If arsenic or molybdenum is present these may be removed from the solution by passing in H₂S. The insoluble sulphides are filtered off and washed with H₂S water. The filtrate is boiled down to two-thirds of its volume and the sulphur filtered off. In the absence of members of the H₂S group, this portion of the procedure is omitted.

Oxidation with KMnO₄. The solution containing the vanadium is oxidized by adding, from a burette, tenth normal potassium permanganate to a faint permanent pink. If the solution has been treated with H₂S, the vanadium is in the vanadyl condition, and the amount of permanganate required to oxidize the solution completely will give a close approximate value for the vanadium present, each cc. of N/10 KMnO₄ being equivalent to 0.0051 gram vanadium.

Reduction. The vanadite is now reduced to vanadyl salt by passing through the acid solution, containing approximately 5% free sulphuric acid, a steady stream of SO₂ gas. Reduction may also be accomplished by adding sodium metabisulphite, or sodium sulphite, to the acid solution. The excess SO₂ is now removed by boiling (a current of CO₂ passed into the hot solution will assist in the complete expulsion of the SO₂).

NOTE. KMnO4 is reduced by SO2.

Test for Iron. A drop test with potassium ferricyanide, $K_*Fe(CN)_*$, on a white tile will give a blue color in the presence of ferrous iron. Since ferrous iron will titrate with potassium permanganate, its oxidation is necessary. This is accomplished by adding tenth normal potassium dichromate solution cautiously to the cold liquid until no blue color is produced by the spot test with $K_*Fe(CN)_*$ outside indicator. If the sample is sufficiently dilute, the blue color of the vanadyl solution will not interfere in getting the point where the iron is completely oxidized. Care must be taken not to pass this end-point, otherwise Va_*O_* will also be oxidized and the results will be low.

Note. The action of the dichromate is selective to the extent that iron is first oxidized and then V_2O_4 . If the amount of iron present is large a separation must be effected. In case a sodium carbonate potassium nitrate fusion has been made and

with water containing a few drops of mercurous nitrate, washing once or twice by decantation and finally on the filter paper. The precipitate is dried, then ignited in a porcelain crucible in a hood over a Bunsen burner to a red heat. The fused red residue is V₂O₅.

 $V_2O_4 \times 0.5604 = V$.

Gravimetric Method of Determining Vanadium by Precipitation with Lead Acetate ¹

Principle. From a weakly acetic acid solution, vanadium is quantitatively precipitated by lead acetate. The precipitate is dissolved in nitric acid, lead removed as a sulphate, and vanadium determined in the filtrate by taking to dryness and igniting to the oxide, V_2O_5 .

Procedure. To the alkaline solution or an aliquot portion obtained by extraction of the carbonate fusion of the ore with water, just sufficient amount of nitric acid is added to nearly neutralize the alkali present, as in the case of the method described for precipitation of vanadium by mercurous nitrate, and then a 10% solution of lead acetate is added in slight excess with continuous The precipitate is allowed to settle on the steam bath. The vanadate, first appearing orange colored, will fade to white upon standing. The lead vanadate is filtered and washed free of the excess of lead acetate with water containing acetic acid. The precipitate is washed into a porcelain dish with a little dilute nitric acid, and brought into solution by warming the lead salt with nitric acid. To this, the ash of the incinerated filter is added. Sufficient sulphuric acid is added to precipitate completely the lead, and the solution taken to small volume on the water bath and then to SO₃ fumes, but not to dryness. About 100 cc. of water are added and the mixture filtered; lead sulphate will remain upon the filter and the vanadium will be in solution. The lead sulphate is washed free of vanadium (i.e., until the washings no longer give a brown color with hydrogen peroxide).

The filtrate containing all the vanadium is evaporated to small volume in the porcelain dish, then transferred to a weighed platinum crucible and evaporated to dryness on the water bath and finally the residue (V₂O₅) heated to a dull redness over a Bunsen flame.

 $V_2O_5 \times 0.5604 = V$.

Notes. Lead may be separated from the vanadium by passing H_2S through the nitric acid solution, the excess of H_2S volatilized by boiling and the liberated sulphur filtered off. The filtrate is evaporated to dryness and the vanadium ignited with a few drops of nitric acid to the oxide V_2O_5 .

Lead may also be separated as lead chloride in the presence of alcohol, the solution taken to dryness and vanadium oxidized by addition of nitric acid and ignited to V₂O₅.

¹ Method by Roscoe, Ann. Chem. Pharm., Supplement 8, 102, 1872. Treadwell and Hall, "Analytical Chemistry," p. 305.

VOLUMETRIC PROCEDURES FOR THE DETERMINATION OF VANADIUM

Reduction of the Vanadate, V₂O₅, to Vanadyl Condition, V₂O₄, and Reoxidation with Potassium Permanganate

Principle. Vanadium in solution as a vanadate is reduced to the vanadyl salt by H_2S or SO_2 , the excess of the reducing agent expelled and the solution titrated with standard KMnO₄, vanadium being oxidized to its highest form, V_2O_4 .

Reactions. a. $V_2O_4 + SO_2 = V_2O_4 + SO_3$. b. $V_2O_4 + O = V_2O_5$. Hence

$$N/10$$
 sol. = $\frac{At. wt. V}{10}$ grams to the liter.

Procedure. An aliquot portion of the solution containing vanadium, as obtained by one of the procedures given for the solution of the sample, is taken for analysis; dilute sulphuric acid (1:1) is added to acid reaction and 5 cc. of acid per 100 cc. of solution added in excess. The vanadium content should be not over 0.5 gram V when a tenth normal permanganate is used for the titration. If arsenic or molybdenum is present these may be removed from the solution by passing in H₂S. The insoluble sulphides are filtered off and washed with H₂S water. The filtrate is boiled down to two-thirds of its volume and the sulphur filtered off. In the absence of members of the H₂S group, this portion of the procedure is omitted.

Oxidation with KMnO₄. The solution containing the vanadium is oxidized by adding, from a burette, tenth normal potassium permanganate to a faint permanent pink. If the solution has been treated with H₂S, the vanadium is in the vanadyl condition, and the amount of permanganate required to oxidize the solution completely will give a close approximate value for the vanadium present, each cc. of N/10 KMnO₄ being equivalent to 0.0051 gram vanadium.

Reduction. The vanadite is now reduced to vanadyl salt by passing through the acid solution, containing approximately 5% free sulphuric acid, a steady stream of SO₂ gas. Reduction may also be accomplished by adding sodium metabisulphite, or sodium sulphite, to the acid solution. The excess SO₂ is now removed by boiling (a current of CO₂ passed into the hot solution will assist in the complete expulsion of the SO₂).

NOTE. KMnO4 is reduced by SO2.

Test for Iron. A drop test with potassium ferricyanide, $K_*Fe(CN)_*$, on a white tile will give a blue color in the presence of ferrous iron. Since ferrous iron will titrate with potassium permanganate, its oxidation is necessary. This is accomplished by adding tenth normal potassium dichromate solution cautiously to the cold liquid until no blue color is produced by the spot test with $K_*Fe(CN)_*$ outside indicator. If the sample is sufficiently dilute, the blue color of the vanadyl solution will not interfere in getting the point where the iron is completely oxidized. Care must be taken not to pass this end-point, otherwise Va_*O_* will also be oxidized and the results will be low.

Note. The action of the dichromate is selective to the extent that iron is first oxidized and then V_2O_4 . If the amount of iron present is large a separation must be effected. In case a sodium carbonate potassium nitrate fusion has been made and

vanadium has been extracted by water, iron will not be present. A special procedure for determination of vanadium in steel is given.

Potassium Permanganate Titration. N/10 KMnO₄ is now cautiously added until a pink color, persisting for one minute, is obtained. During the titration the solution changes from a blue color to a green, then a yellow and finally a faint pink. The reaction towards the end is apt to be slow if made in a cold solution.

Notes. In absence of chromium, it is better to make the titration in a hot solution, 60 to 80° C., the end-point being improved by heat. In case an excess of permanganate has been added, the excess may be determined by a back titration with tenth normal thiosulphate. The solution may be rerun, if desired, by repeating the reduction with SO_2 and the titration with $K_2Cr_2O_7$ and $KMnO_4$.

One cc. N/10 KMnO₄=0.0051 gram V, or =0.00912 gram V_2O_5 .

For solutions containing less than 0.5% vanadium a weaker permanganate reagent should be used. A fiftieth normal permanganate solution will be found to be useful

for materials low in vanadium.

The author obtained excellent results by the above procedure on materials containing small amounts of iron and chromium; with amounts equal to that of vanadium present in the solution no interference was experienced. The titration with potassium permanganate is made in cold solutions if chromium is present, as the permanganate will oxidize chromium in hot solutions. Potassium permanganate added to samples containing chromic salts, and the mixture boiled, will oxidize these quantitatively to chromates. This reaction does not take place in cold solutions to any appreciable extent during a titration and only slowly in warm solutions.

. Volumetric Determination of Vanadium by Reduction with Zinc to V_2O_2

The procedure proposed by Gooch and Edgar is to reduce vanadic acid, in presence of sulphuric acid, by zinc to the oxide, V_2O_2 ; oxidation of the unstable V_2O_2 by the air is anticipated by means of ferric chloride or sulphate, in the receiver of the Jones reductor, the highest degree of reduction being registered by the ferrous salt formed by the reaction of the reduced vanadate on the ferric salt, i.e., $V_2O_2+3Fe_2O_3=6FeO+V_2O_5$. Compounds reduced by zinc and oxidized by KMnO₄ must be absent or allowed for.

Procedure. The Jones reductor is set up as directed in the procedure for the determination of iron by zinc reduction. The receiver attached to the tube containing the column of zinc is charged with a solution of ferric alum in considerable excess of that required for the oxidation of the reduced vanadium. (The amalgamated zinc is cleaned by passing through the column, a dilute solution of warm sulphuric acid. The final acid washings should show no further reducing action on permanganate when the reductor is clean.) Gentle suction is applied, and through the column of clean amalgamated zinc are passed in succession—100 cc. of hot water, 100 cc. of 2.5% sulphuric acid, and then the solution of vanadic acid diluted to 25 cc. in a 2.5% sulphuric acid solution, and finally 100 cc. of hot

¹ Corrections should be made for the action of zinc upon the reagents without the vanadic acids, as it is almost impossible to get a condition where no blank is obtained with permanganate. The reductor is cleaned first by passing about 500 cc. of dilute 2.5% sulphuric acid through the column of zinc. A blank is now obtained with the same quantity of reagents as is used in the regular determination, only omitting the vanadium, and this is deducted from the titration obtained for each sample reduced.

water. To the receiver is added a volume of 4 cc. of syrupy phosphoric acid to decolorize the solution. The reduced iron salt is now titrated with N/10 KMnO.

One cc. N/10 KMnO₄ = 0.0017 gram V, or = 0.00304 gram V_zO_4 .

Determination of Vanadium in Steel

The following method is used in analyzing the Bureau's vanadium and chrome-vanadium steels. The procedure was worked out by J. R. Cain and L. F. Witmer of the U. S. Bureau of Standards.

Five to 10 grams of drillings are dissolved in hydrochloric acid (1:1), a few drops of hydrofluoric are added, and the solution is boiled for a few minutes. The insoluble matter is filtered off, ignited, fused with a little sodium carbonate, the fusion dissolved in water and added to the main filtrate. This is then oxidized with the minimum amount of nitric acid needed, and boiled till free from fumes. The iron is extracted with ether and the excess of ether removed from the aqueous layer by evaporation on the steam bath. After concentration on the bath, strong nitric acid is added to the solution and it is evaporated to dryness. The residue is dissolved in strong nitric acid, the solution is diluted with water and nearly neutralized with strong sodium hydroxide solution. It is then poured slowly into 150 to 200 cc. of a 10% sodium hydroxide solution, stirring vigorously. The solution is filtered, and the series of operations are repeated with the precipitate until it is free from vanadium, as shown by dissolving it in nitric acid and testing with hydrogen peroxide. In the latter treatments the amount of sodium hydroxide solution used may be smaller. From the combined filtrates the vanadium is precipitated with mercurous nitrate solution, after making nearly but not quite neutral with dilute nitric acid. After settling, the precipitate is collected on paper and washed with dilute mercurous nitrate solution. The filter is burned off in a platinum crucible and the precipitate ignited till all the mercury is expelled. The impure vanadium pentoxide left is fused with a little sodium carbonate, the fusion is dissolved in water and filtered (on asbestos) from insoluble matter. second precipitation with mercurous nitrate is then made. Sometimes a further fusion and precipitation may be necessary in order to get a product sufficiently pure for the next step, which is a final fusion with sodium carbonate. The fusion is dissolved in dilute sulphuric acid and the vanadium is reduced by sulphur dioxide gas and titrated against N/50 permanganate after complete expulsion of the excess of reducing agent.

Volumetric Determination of Molybdenum and Vanadium in Presence of One Another

Sulphur dioxide reduces V_2O_5 to V_2O_4 , but does not reduce molybdic acid provided the sample contains 1 cc. of free sulphuric acid per 50 cc. of solution and not more than 0.2 gram of molybdic acid. By means of amalgamated zinc V_2O_5 is reduced to V_2O_4 and MoO_2 to Mo_2O_4 . Upon these two reactions the determination is based according to the procedure worked out by Edgar. Details of the method are given in the chapter on Molybdenum, page 321.

¹ Graham, Edgar, Am. Jour. Sci. (4), 25, 332. Gooch, "Methods in Chemical Analysis," John Wiley & Sons.

Volumetric Determination of Vanadium, Arsenic or Antimony in Presence of One Another. Edgar's Method ¹

Tartaric or oxalic acid reduces V₂O₄ to V₂O₄, but does not act upon arsenic or antimony. On the other hand SO₂ causes the reduction of all three. Therefore if aliquot portions of the solution are taken, one portion being treated with tartaric acid and vanadium determined by titration with iodine, and another portion reduced with SO₂ and again titrated with iodine, the difference between the two titrations is due to the cc. of reagent required for the oxidation of the reduced arsenic or antimony.²

Reactions.
$$V_2O_4+I_2+H_2O=V_2O_5+2HI$$
.
 $As_2O_3+V_2O_4+3I_2+3H_2O=As_2O_5+V_2O_5+6HI$.
 $Sb_2O_2+V_2O_4+3I_2+3H_2O=Sb_2O_5+V_2O_5+6HI$.

Vanadium. One portion is boiled with about 2 grams of tartaric or oxalic acid, until the solution turns the characteristic blue of vanadium tetroxide. After cooling, the solution is nearly neutralized with potassium bicarbonate, and an excess of standard iodine solution added. Neutralization is now completed, an excess of bicarbonate added, and after fifteen to thirty minutes the excess iodine titrated with standard arsenious acid, starch being used as an indicator. This titration measures the vanadium present.

Arsenic or Antimony. A second portion of the solution is placed in a pressure flask and acidified with sulphuric acid. A strong solution of sulphurous acid is added, the flask closed and heated for an hour on the steam bath. After cooling, the flask is opened and the solution transferred to an Erlenmeyer flask and the excess of SO₂ removed by boiling, a current of CO₂ being passed through the liquid. The cooled solution is treated with bicarbonate, iodine added and the titration conducted exactly as described for determination of vanadium in the first portion. The difference between the first titration and the second is a measure of the cc. required for oxidation of arsenic or antimony.

Determination of Vanadium and Iron in Presence of Each Other

The solution slightly acidified with sulphuric acid is treated with sulphurous acid, the excess expelled and the reduced vanadium and iron titrated with standard potassium permanganate.

$$10\text{FeO} + 5\text{V}_2\text{O}_4 + 6\text{H}_2\text{SO}_4 + 4\text{KM}_1\text{O}_4 = 5\text{Fe}_2\text{O}_3 + 5\text{V}_2\text{O}_5 + 2\text{K}_2\text{SO}_4 + 4\text{M}_1\text{SO}_4 + 6\text{H}_2\text{O}_5$$

The solution is now reduced with zinc in the Jones reductor and again titrated with permanganate.² V_2O_5 is reduced by zinc to V_2O_2 , the sample being caught

¹ G. Edgar, Am. Jour. Sci. (4), 27, 299.

² Gooch, "Methods of Chemical Analysis."

³ Craham Edgar Am. Jour. Sci. (4), 28, 76

³ Graham, Edgar, Am. Jour. Sci., (4), 26, 79.
See Am. Jour. Sci., (4), 27, 174, also Gooch, "Methods in Chemical Analysis," p. 510, for procedure determining iron, chromium and vanadium, in presence of one another.

⁴ When the color has changed from a bluish-green to greenish-yellow the solution is heated to 70 to 80° C., and the permanganate titration completed in a hot solution

in ferric alum solution (details for determining of vanadium by reduction with zinc are given under the volumetric methods for this element).

 $10\text{FeO} + 5\text{V}_2\text{O}_2 + 12\text{H}_2\text{SO}_4 + 8\text{KMnO}_4 = 5\text{Fe}_2\text{O}_3 + 5\text{V}_2\text{O}_4 + 4\text{K}_2\text{SO}_4 + 8\text{MnSO}_4 + 12\text{H}_2\text{O}_2$

The difference between the two titrations multiplied by 0.00456 = vanadic acid (V₂O_b) originally present.


Iodometric Method for Estimation of Chromic and Vanadic Acids in Presence of One Another

The following procedure developed by Edgar. is given by Gooch ("Methods of Chemical Analysis").

In carrying out the operation, the alkali salts of the chromic and vanadic acid are put into the Voit flask of the distillation apparatus shown in the cut, Fig. 71.

the absorption apparatus containing a solution of potassium iodide made alkaline with sodium carbonate or sodium hydroxide, and the whole apparatus is filled with hydrogen gas. Fifteen to 20 cc. of concentrated hydrochloric acid are added through the separatory funnel and the solution is boiled for ten minutes, an interval of time found to be enough for the completion of the reduction. slow current of hydrogen is maintained to avoid back suction of the liquid from the Drexel bottle. The apparatus is disconnected,

the Voit flask placed in a beaker containing cold water, and the

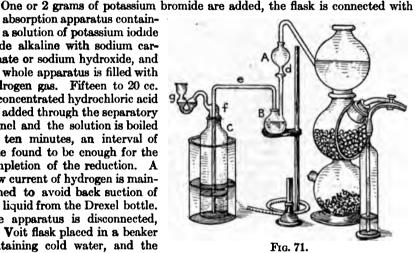

alkaline solution in the absorption apparatus cooled by running water. The contents of the trap are washed into the Drexel bottle and the solution therein is made slightly acid with hydrochloric acid. The liberated iodine is titrated with approximately N/10 sodium thiosulphate and the color is brought back by a drop or two of N/10 iodine solution, after the addition of starch.

Alkaline potassium iodide is again placed in the absorption apparatus and the latter connected with the Voit flask. The current of hydrogen is turned on and, after the air has been expelled, the apparatus is disconnected momentarily, 1 or 2 grams of potassium iodide are added to the solution in the Voit flask, and connections made again. Through the separatory funnel 10 cc. to 15 cc. of concentrated hydrochloric acid and 3 cc. of syrupy phosphoric acid are added and the solution in the reduction flask is boiled to a volume of 10 cc. to 12 cc. The absorption apparatus is removed and cooled, hydrochloric acid is added and the liberated iodine titrated with approximately N/10 sodium thiosulphate.

¹ Graham Edgar, Am. Jour. Sci. (4), 26, 333.

The iodine determined in the first titration corresponds to a reduction of the chromic and vanadic acids according to the equation

$$V_2O_5+2CrO_3+8HBr = V_2O_4+Cr_2O_3+4Br_2+4H_2O_7$$

while in the second case the iodine corresponds to a reduction of the vanadium tetroxide to trioxide as indicated in the equation

$$V_2O_4+2HI=V_2O_2+I_2+H_2O_2$$

The second titration, therefore, determines the vanadic acid present. and the difference between the first and second furnishes the necessary data for the calculation of the chromium.

DETERMINATION OF VANADIUM IN FERRO=VANADIUM

Standard Methods of the American Vanadium Company¹

Dissolve 0.510 gram of the alloy (100 mesh) in a 250-cc. beaker with 50 cc. dilute sulphuric acid (1:2) and 10 cc. (concentrated) nitric acid. If the alloy does not decompose, when heated, add a few cc. of hydrofluoric acid. Take down to copious white fumes. Cool, add 50 cc. dilute sulphuric acid (1:2) and water. Heat until all salts are in solution and transfer to a white casserole containing 100 cc. dilute sulphuric acid (1:2). Dilute the solution to 400 cc. with H₂O and heat to 60° C. The solution is ready to titrate.

Add potassium permanganate until a deep red is obtained. Just discharge the

red color with ferrous ammonium sulphate.

Get the neutral point by alternating the permanganate and ferrous ammonium sulphate until one drop of the ferrous sulphate just discharges the pink color.

Now add N/10 ferrous ammonium sulphate from a burette until the vanadium

is reduced and then 3 cc. in excess.

Titrate the excess of ferrous ammonium sulphate with N/10 potassium bichromate, using potassium ferricyanide as an indicator.

From the cc. of ferrous ammonium sulphate used, subtract the cc. of bichromate used. The number of cc. used gives the per cent of vanadium in the alloy.

The relation between ferrous ammonium sulphate and bichromate is established by adding 150 cc. sulphuric acid (1:2) to a casserole, diluting to 400 cc.

Find the neutral point and then add 25 cc. ferrous ammonium sulphate and titrate with bichromate until the blue spot is just discharged. TOX A MADE TO

Blank.	EXAMPLE	
Ferrous ammonium	sulphate used	25 cc.
Potassium bichroma	te used	24 6 "
	25.00	
	24.60	
	$.40 \div 25 = -0.016$ factor.	
Alloy.		
	sulphate used	40.00
Potassium bichroma	te used	2.40
40.00 - 0.64		
Correction on ferrous a	mmonium sulphate:	
$39.36 - 2.4 \dots$	· · · · · · · · · · · · · · · · · · ·	= 36.96% V
Solutions used:		, ,
N/10 potassium bicl	hromate.	
N/10 ferrous ammo	nium sulphate.	
Potassium ferricvanide,	a crystal the size of a pea in 50 cc	e. of water.
Potassium permangana	te, 5 grams per liter.	
-	• • •	

¹ Methods developed in the Bridgeville Laboratory. By courtesy of the American Vanadium Company.

Determination of Vanadium in Vanadium Ores

Weigh 0.51 gram of the finely powdered ore in a 1½-in. diameter iron crucible filled three-fourths full of sodium peroxide. Fuse. Dissolve the fusion in water and add 100 cc. H₂SO₄ (1:2) in excess and evaporate until white fumes come off. Cool and dilute and filter. Gas the filtrate, which should be about 400 cc., until all H₂S metals are precipitated. Boil and filter. Boil the filtrate until all H₂S is off. Transfer to a 500-cc. casserole and add 50 cc. H₂SO₄ (1:2) and heat to above 60° C. Titrate as in the determination of vanadium in ferro-vanadium.

Determination of Vanadium in Steel

Dissolve 5.1 grams of steel in a covered 400-cc. beaker with 60 cc. of HCl (concontrated). After total solution add concentrated HNO₃ sufficient for complete oxidation. Evaporate to a syrupy consistency, add 40 cc. HCl (concentrated) and evaporate to about 20 cc. Cool and transfer contents to a separatory funnel, washing beaker with dilute HCl (2HCl: 1 H₂O).

Add 100 cc. ether, cork and shake for some time, cooling funnel under tap water while shaking. Remove cork, place funnel in stand and allow it to stand for at least five minutes. Run out the lower layer of the separation into the original 400-cc. beaker.

Evaporate the ether off. Cool and oxidize with a few crystals of sodium chlorate. Boil off the chlorine. Add 50 cc. of 1:2 HrSO4 and evaporate to copious white Boll on the chlorine. Add 50 cc. of 1:2 H₂-O₄ and evaporate to copious white fumes. Cool, oxidize completely with KMnO₄ (5 grams to the liter), add 40 cc. of HCl (concentrated) and evaporate to dense white fumes. Cool, add 40 cc. of water, and again take down for the last time to white fumes. Cool, add 150 cc. of water, cool, and titrate with N/50 potassium permanganate. Each cc. of permanganate used is equal to 0.00102 gram of vanadium, or in this case, having used a 10-factor weight, each cc. represents 0.02% vanadium.

Determination of Vanadium in Steel (When Chromium is present)

Dissolve 5.1 grams of steel in a covered 400-cc. beaker with 60 cc. of HCl (concentrated). After total solution, add concentrated HNO₂ sufficient for complete oxidation. Evaporate to a syrupy consistency, add 40 cc. HCl (concentrated) and evaporate to about 20 cc. Cool and transfer contents to a separatory funnel, washing with dilute HCl (2 HCl: 1 H₂O). Add 100 cc. ether, cork and shake for some time, cooling funnel under tap water while shaking. Remove cork, place funnel in stand and allow it to stand for at least five minutes. Run out the lower layer of the separation into the original 400-cc. beaker.

Evaporate the ether off. Add 5 cc. HNO₁ (concentrated) and just bring to a boil, Stir out all nitrous fumes, make alkaline with NaOH (saturated solution). Make just acid with HNO₁ (concentrated) cool solution.

Add above solution to a solution containing 300 cc. cold water and 5 cc. of NaOH (saturated solution). Boil and filter, washing with hot water thoroughly. Make filtrate just acid with HNO₃ (concentrated). Add 40 cc. of a saturated solution of lead acetate. (If lead precipitate forms just clear solution by adding HNO, drop by drop and bring to a boil.) Add 60 cc. of ammonium acetate. Boil for twenty minutes. The vanadium is precipitated as lead vanadate.

Filter the lead vanadate onto a Munktell paper, washing with hot water. Put filter containing lead vanadate in a small porcelain dish and burn off paper at a low heat. Add a little HNO₁ and evaporate on the hot plate, then put the dish in the cold end of a muffle to drive off the remaining HNO₂. Avoid baking. Dissolve in HCl (concentrated) and transfer the solution to a 400-cc. beaker. Add 60 cc. dilute H₂SO₄ (1:2). Oxidize thoroughly with KMnO₁ (5 grams to a liter.) Add 40 cc. HCl (concentrated) and evaporate to dense white fumes. Cool, add 40 cc. of water and again take to white fumes. Cool add 150 cc. of water cool and titrate of water and again take to white fumes. Cool, add 150 cc. of water, cool, and titrate with N/50 KMnO. Each cc. of permanganate used is equal to 0.00102 gram of vanadium, or in this case, having used a ten-factor weight, each cc. represents 0.02% vanadium.

Determination of Vanadium in Cupro-vanadium, Brasses and Bronzes

Dissolve 1.020 grams of cupro-vanadium in aqua regia. Evaporate to small bulk and add excess of peroxide of hydrogen. Dilute to 600 cc. and add ammonia until all copper goes into solution. Heat to boiling and add sufficient barium chloride solution to precipitate all the vanadium. Boil and filter. Wash all copper out of filter with hot ammonia water. Transfer the filter to a beaker, add 100 cc. 1:2 sulphuric acid, boil and filter on close filter paper. Titrate the filtrate with N/10 ferrous ammonium sulphate and N/10 potassium bichromate the same as in the case of the ferro alloy, except that this being a two-factor weight, the result must be divided by 2.

Vanadium copper, brasses and bronzes are treated in the same manner except that a ten-factor weight is used and the titration carried out with N/50 solution instead

of N/10.

Determination of Vanadium in Ores, Mine and Crude Mill Samples¹

Reagents Indicator. K₂Fe(CN)₆. Make up just before using in a drop bottle which has been washed out with NaOH and then with water. Place a small crystal of the salt in the bottle and wash several times to remove the oxidized coat, pouring out the washings, then add about 30 cc. of distilled water and dissolve for use.

Ferrous ammonium sulphate, FeSO₄(NH₄)₂SO_{.6}H₂O. 135 grams of the salt are dissolved in a mixture of 333 sulphuric acid and 3000 cc. of water.

Standardize the solution as follows: Take 25 cc. of the solution and add 25 cc.

H₂SO₄. Dilute to 400 cc. and titrate with standard K₂Cr₂O₇ reagent using K₃Fe(CN)₆ indicator according to the procedure used in the determination of iron.

Potassium permanganate,—KMnO₄. 3.162 grams per liter.
Potassium dichromate, K₂Cr₂O₇. 4.903 grams per liter. Standardize with 1/2 gram of iron wire. (1 cc. = .056 g. Fe.)

PROCEDURE. Solution of the Sample.

Take 2.04 grams of the ore, ground to pass through a 60-mcsh screen. Fuse with (about 20 times its volume), sodium peroxide in a 25 cc. iron crucible. (If the mixture can be thoroughly cintered, it is better than a complete fusion.) Take up the mass with

can be informally cintered, it is better than a complete fusion.) Take up the mass with water in a 600 cc. beaker. Add a solution of 50 cc. strong sulphuric acid diluted with 100 cc. of water. Then dilute to 400 cc. with water.

Titration. Heat to about 80° F. and add just sufficient offthe permanganate reagent to make the solution pink. Titrate back with a few drops of ferrous ammonium sulphate reagent until the color of the permanganate just disappears. The solution will now appear a green or blue color. Now add the "ferrous" solution until the ferric cyanide spot test shows a faint blue color. Then 2 cc. excess of the "ferrous" solution. Titrate back the excess with the standard potassium dichromate reagent until a drop of the indicator shows no color on the great plate, with a drop of the solution. indicator shows no color on the spot plate, with a drop of the solution.

Calculate the ratio of the ferrous solution and the dichromate to a common basis. Deduct the cc. dichromate from the cc. "ferrous" added to the bluish green solution above, and divide the result by 4. With an exactly N/10 solution the result will be the

percent vanadium in the sample.

Lead Acetate Method. The solution obtained from the fusion of the ore (see added to completely precipitate the vanadium (usually 2 or 3 grams, according to the amount of vanadium in the sample), the solution is stirred, allowed to settle and the lead vanadate filtered off and treated as follows.

Take the residue on the filter (this at first appears yellow) and dissolve in a very dilute solution of nitric acid. The acid should be hot. Transfer to an 800 cc. beaker.

Add about 10 cc. of concentrated sulphuric acid and evaporate to fumes of SO₁. All traces of nitrous oxide must be expelled. Dilute to 600 cc. with distilled water, add 25 cc. of concentrated sulphuric acid, hat and titrate with standard permanganate according to the first of the volumetric procedures.

¹ With acknowledgment to Theodore Marvin, Colorado School of Mines.

F. G. Breyer, L. S. Holstein And L. A. Wilson

Zn. at.wt. 65.37; sp.gr. 6.48 to 7.19; m.p. 419°; b.p. 920°; ZnO oxide.

DETECTION

The finely powdered material, when heated on charcoal in the reducing flame of a blowpipe, gives an incrustation, yellow when hot—white when cold. On moistening with cobalt nitrate solution and re-igniting, the mass is greenish-yellow. Materials containing above 5% Zn will give positive tests. With experience, less can be detected, but for smaller amounts the regular procedure as given under Titration in Acid Solution, Separating Zn as ZnS, should be followed, using samples as follows: For material containing 0.01-0.05%, 10 to 20 grams; 0.05-0.10%, 5 to 10 grams; 0.10-0.5%, 5 grams; 0.5% on up, 2 grams to 0.5 gram, depending on per cent of zinc present.

In case the material is of interest, only if it carries higher than several per cent of zinc, a shorter and easier wet test is to bring the material into solution by means of hydrochloric or nitric acid, add bromine water and then precipitate iron, aluminum and manganese with ammonia, as given under heading of Determination of Zinc in Acid Solution, Separating Iron, Aluminum and Manganese with Ammonia and Bromine, filter, wash and make the filtrate acid with hydrochloric acid, 10 cc. excess added for each 100 cc. of solution, and potassium ferrocyanide added. Zinc, if present, gives the characteristic precipitate. Copper interferes and if present must be separated with hydrogen sulphide, as given under heading Procedure for Copper-bearing Ores.

In case manganese and copper are known to be absent, a still shorter test may be used: To the solution of the zinciferous material add 2 or 3 grams of citric acid per 200 cc. solution, then make ammoniacal, add ferrocyanide—a white precipitate indicates zinc.

ESTIMATION

The determination of zinc is called for in the buying and selling of ores for smelters, refuse material, e.g., from galvanizing plants, foundries, brass mills, and blast furnaces, in manufacture of brass, white metals, and alloys in general, paints and pigments, zinc chloride for preservation purposes, and in the control work in smelting of zinc and lead ores.

Preliminary. The method to be followed in the estimation of zinc will depend largely on the nature of the material in which it occurs, the quantity present, and the experience of the analyst. Each of the methods outlined will give correct results only on the materials for which they are indicated, there being but one method recommended which is applicable to all zinciferous mate-

¹ Chief of Research Division, New Jersey Zinc Company.

Chief of Testing Department, New Jersey Zinc Company (of Pa.).
 Assistant Chief of Testing Department, New Jersey Zinc Company (of Pa.).

rials. It cannot be emphasized too strongly that each step has a definite purpose (which may not be at once apparent to the analyst making only an occasional zinc determination), and no part of the procedure should be varied or omitted, excepting after abundant experience.

Preparation of Sample

The representative sample should be ground to pass a 100-mesh screen or finer. If the material contains shot metal, it should be screened out and the percentage present calculated. It is then treated as given under heading Material Containing Metallics, page 602.

Moisture Determination in the Pulp

One of the commonest causes of differences in zinc ore analysis is the failure to take moisture determinations on the pulp sample.

In order that analyses made on the same pulp at different times and in different laboratories may be compared it is absolutely necessary that all determinations be corrected (o a dry basis. It is not sufficient that the sample be dried before or after having been pulped, but a sample for moisture must be weighed out at the same time as the sample for analysis, and the analytical result corrected for the per cent of moisture found at the time of weighing. This is especially true on roasted zinc ores which contain sulphates of zinc, iron and lime and which take up moisture quite rapidly under ordinary atmospheric conditions.

The usual temperature for drying should be 110° C., but on special ores, e.g., those containing sulphates, it is necessary to dry at 250° C. unless it is first shown that there is no loss of water above 110° C.

The determination is best made by weighing approximately two grams in a small glass-stoppered weighing tube and drying to constant weight, the weighing tube being closed with the glass stopper as soon as the tube is taken from the drying oven.

SEPARATIONS

Silica. Evaporate with hydrochloric acid or take to fumes of sulphuric acid. The dehydration with sulphuric acid is complete and gives silica that is easily filtered and washed.

Cadmium, Lead, Arsenic, Antimony, Bismuth and Copper. Aluminum may be used to separate all the metals, except cadmium, the latter being only partially separated. The procedure is as given in the standard method.

The separation may also be made as follows: Evaporate the solution of the zinciferous material to fumes with 7 cc. of 1:2 sulphuric acid. Cool, take up in about 50 cc. of water and warm, add 10 cc. of 10% sodium thiosulphate, boil until evolution of sulphur dioxide ceases, then filter. Cadmium if present is not precipitated. It should be separated by the procedure given under Titration in Acid Solution Separating Zine as Sulphide.

Iron, Aluminum and Manganese. This separation may be effected by precipitation with ammonia and bromine, providing the quantities present are small. When large amounts are present the basic acetate procedure is followed, or, better, the zinc separated as sulphide in dilute sulphuric acid solution, page 605.

Nickel and Cobalt. When nickel or cobalt are present, the only safe procedure is to separate the zinc as zinc sulphide in dilute sulphuric acid solution, as described under the standard method. Weiss has shown conclusively that zinc can be precipitated free from either cobalt or nickel under the conditions there outlined.

METHODS OF ANALYSIS

- I. Gravimetric methods.
- II. Electrolytic methods.
- III. Titration with standard solution of K4Fe(CN).
 - (a) In acid solution.
 - (b) In alkaline solution.
 - (c) In acid solution, separating Zn as ZnS. (Standard method.)

GRAVIMETRIC METHODS

Weighing as Zinc Oxide

In this case the procedure is the same as in the volumetric method, in which zinc is separated as zinc sulphide up to point where the zinc sulphide is filtered off and washed. It is now ignited in a weighed crucible and heated to 800 to 900° C. in a muffle for one hour and weighed as ZnO. Factor $\text{ZnO} \times 0.8034 = \text{Zn}$.

The precipitate of zinc sulphide may also be filtered on a Gooch crucible, and ignited as above.

Weighing as Sulphate

The zinc sulphide is dissolved in hydrochloric acid. Sulphuric acid is added and the solution evaporated in a weighed crucible, all excess acid fumed off and the resulting zinc sulphate finally ignited at a dull red heat and weighed. $ZnSO_4 \times .405 = Zn$.

Electrolytic Methods

The determination is best made from an alkaline electrolyte or one slightly acid with acetic acid and containing a considerable amount of sodium acetate. The alkaline electrolyte tends to give high results, due to the presence of zinc oxide or hydroxide in the deposit. The best results are obtained with a solution weakly acid with one of the weaker organic acids. The procedure for the acetate electrolyte is as follows:

The sine is separated from other elements by precipitating with hydrogen sulphide in dilute sulphuric acid solution, as given under the standard method. The precipitate is filtered and washed, dissolved in hot hydrochloric acid—5 cc. 1: 1 sulphuric acid added and the whole evaporated to fumes to expel hydrochloric acid. Cool and dilute, neutralize with sodium hydrate solution, make slightly alkaline, then acidify with acetic acid, and add about 5 grams of sodium acetate. The volume of solution should now be about 100 to 125 cc. Electrolyze with a platinum gauze electrode with 0.5 ampere at 5 volts.

The electrolytic methods, on account of the special apparatus needed, the experience and care necessary to get reliable results, and the unavoidable errors involved in their use, are less desirable than the gravimetric oxide method and

still less desirable than the ferrocyanide method.

VOLUMETRIC METHODS

Titration in Acid Solution, Separating Iron, Aluminum, and Manganese with Ammonia and Bromine

General. This method is especially adapted to material low in silica, alumina, iron, and manganese. When the operator gains experience in manipulation, it is, possible to obtain good results on samples higher in these elements, but its hap-hazard use with materials high in these impurities is one of the chief causes of the common inaccuracy of zinc work. If copper or cadmium are present in quantities, the titration in acid solution, separating Zn as ZnS, is to be preferred for accurate work.

Procedure for Ores. One-half or 1 gram (depending on the per cent of zinc present) is weighed in a 250-cc. beaker. Fifteen cc. of hydrochloric 1 acid (sp.gr. 1.2) are added, a cover-glass put on, and the ore agitated to prevent caking. Boil down to a volume of about 5 cc. 2 cool, wash down cover-glass and sides of beaker with a jet of water. Add 10 cc. of saturated bromine water, 5 grams of ammonium chloride and 15 cc. of ammonia water (sp.gr. 0.90) and boil vigorously for a minute or two. Filter off the precipitated hydroxides, and wash four times with hot water, containing 50 grams ammonium chloride and 25 cc. ammonia per liter. The precipitate is now washed from the filter into the beaker in which the original precipitation was made, and the precipitate dissolved in strong hydrochloric acid. Ten cc. of ammonia (sp.gr. 0.9) are added,* the solution boiled, filtered and washed as before, the filtrate being combined with the first filtrate.2 The solution is then diluted to 250 cc., heated to boiling, and 4 drops of ammonium sulphide solution added to destroy oxidizing agents and precipitate small amounts of copper and cadmium. The solution is neutralized with hydrochloric acid, the resolution of the precipitated zinc sulphide serving in lieu of an indicator. Ten cc. excess of concentrated hydrochloric acid are added 5 and the solution titrated, not below 75° C., with standard ferrocyanide, using uranium nitrate (10% solution) as an external indicator.

Standardization of the Ferrocyanide Solution

The potassium ferrocyanide is standardized by weighing out portions of C.P. zinc that will give a titration of approximately the same number of cc. as the sample. Dissolve in 15 to 20 cc. of hydrochloric acid and dilute to about 225 cc.

¹ Nitric acid should be added in case of sulphide ores.

² In case of siliceous ore, it is advisable to evaporate to dryness, and on unknown material to evaporate slowly, in order to make sure of complete solution of the zinc. Certain siliceous and oxide ores are difficultly soluble in hydrochloric acid, and frequently cause low results, where rapid decomposition is the routine.

³ In case of high silica, alumina, iron, and manganese materials, three precipitations

are necessary.

⁴ It is necessary to destroy all oxidizing agents, as they will react with the ferrocyanide.

⁵ The excess of hydrochloric acid should be carefully measured. A burette is very

useful in neutralizing the solution.

⁶ The strength of the uranium nitrate is a matter of personal preference, some using a saturated solution. On the other hand some prefer ammonium molybdate. The strength of solution given above, however, is recommended as the first choice of a large number of experienced zinc chemists.

*In presence of manganese 10 cc. of saturated bromine water are added.

Then add 37 cc. strong ammonia,¹ taking care to avoid spattering, heat to boiling, add 4 drops of ammonium sulphide, neutralize and add 10 cc. excess hydrochloric acid and titrate.

General Notes

The precipitate with ammonia carries down zinc. This is especially true with siliceous material or material high in iron and alumina. By working with hot ammoniacal ammonium chloride solution and making two or three precipitations, the amount held can usually be made negligible.

The precautions in regard to adding ferrocyanide and keeping conditions of stand-

ardization and titration the same, hold here as in all ferrocyanide titrations.

Titration in Alkaline Solution

General. This procedure is designed for rapid routine work on roasted or oxidized ores, especially those high in silica, alumina, iron, and manganese. It should only be used on unroasted sulphides, copper, or high cadmium-bearing ores, when the operator has had *long* experience. It is designed to give the zinc content of materials soluble in hydrochloric or nitric acid. For materials containing insoluble zinc, the titration in acid solution, in which zinc is separated as sulphide, is preferred.

Procedure for Common Ores. The following method is recommended: The weight of ore to be taken will depend on the approximate amount of zinc present. For material above 50%, take 1 gram; from 10 to 50%, 2 grams; 5 to 10%, 4 grams; and below 5%, 5 to 10 grams. Weigh the sample into a tall 400-cc. beaker, cover with water and add 25 cc. concentrated hydrochloric acid, rotating the beaker to prevent caking. In case sulphides are present, nitric acid also should be added. Place on a hot plate or steam bath and evaporate to dryness. Now add 40 cc. concentrated nitric acid, cover with a watch crystal and boil off all nitrous fumes. When these have disappeared, add about 3 to 4 grams KClO; and boil until chlorine fumes do not show. Cool, wash off the watch crystal and sides of the beaker, and dilute to about 100 cc. Wash into 500 cc. graduated flask, make up to the mark and shake well. Filter through a close 24-cm. qualitative paper and without waiting for the whole to run through, measure out 250 cc. of the clear filtrate 4 into a 600-cc. beaker. Add ferric nitrate solution, if necessary, so as to bring the iron content up to about 300 to 400 milligrams, i.e., if only a small amount is present, add 10 cc.; if 10 to 15% is present, add 5 cc., and proceed exactly as under Standardization.

Procedure for Copper-Bearing Ores. Either method is recommended: Separation of Copper by Aluminum. The sample is treated as usual up to

² The temperature of the hot plate should not be over 120° C., as ZnCl₂ is appreciably volatile at higher temperatures.

³ Any oxidizing agent such as chlorine or chlorine oxides acts on the ferrocyanide.

⁴ The graduated flasks should be standardized against one another, i.e., the 500 cc. should be twice the volume of the 250 cc.

¹ The amounts of acid and ammonia used throughout should be carefully measured, so as to keep the amount of ammonium salts approximately the same. This is very important in order to avoid errors, due to varying blanks.

the point where manganese has been separated and 250 cc. of the clear filtrate measured out. Add 25 cc. 1:1 sulphuric acid and evaporate to strong fumes, cool, dilute to 100 cc., add a gram or two of 20-mesh zinc-free aluminum. Heat until all the copper separates, filter, wash and proceed with the filtrate as in the regular method, after oxidizing iron with a few drops of nitric acid.

Separation of Copper by Hydrogen Sulphide. After separation of the manganese with chlorate, sulphuric acid is added and the solution taken to fumes, as in above. Cool, dilute to 100 cc., and add sulphuric acid so that 12% is present. Warm slightly and pass hydrogen sulphide through the solution. Filter off the copper sulphide, wash, boil H₂S out of the filtrate, and titrate as usual, after adding ferric nitrate and citric acid.

Material Containing Cadmium. If the material contains cadmium in quantities sufficient to warrant separation (0.15% or more), it is best to use the titration in acid solution, separating zinc as sulphide.

Material Containing Carbonaceous Matter. If the material under examination contains carbonaceous matter, coal, etc., it must be separated by taking to dryness with hydrochloric acid. Take up in acid and water, filter and wash, and evaporate the filtrate to dryness. Take up in nitric acid and proceed as in the regular method.

If the carbonaceous material is not removed, the manganese does not separate cleanly, due to the reducing action of carbonaceous compounds.

Procedure for Material Containing Metallics. On account of the lack of uniformity in the case of metallic zinciferous material containing lead and iron, it is well to work on large samples. Five or 10 grams of the metallics reduced to as fine a size as possible are weighed out and dissolved in nitric acid. The nitrous fumes are boiled off and the whole made up to 500 cc. or 1000 cc. Fifty or 100 cc. are now pipetted off into a 600-cc. beaker and the zinc titrated as usual. In case the metallic portion contains manganese, which is unusual, it can be separated by the regular procedure. Copper is separated as given under Copper-bearing Ores. Material containing cadmium should be analyzed by other methods, as given under Standard Procedure.

Solutions

Potassium Ferrocyanide. 34.8 grams pure salt in 1000 cc. water. One cc. = approximately 0.010 Zn. This solution should be allowed to stand about four weeks before using.

Ferric Nitrate. One part salt in 6 parts water. It is well to add a little nitric acid to prevent hydrolysis.

Citric Acid. One part acid in 3 parts water. One hundred cc. of nitric acid should be added to each liter to prevent mould growth.

Standardization. The factor for the standard solution varies slightly, as would be expected, with the amount of ferrocyanide used, so that it is best to have at least three sets of factors, one at 40 cc., one at 20 cc., and one at 10 cc.

Weigh into 600-cc. beakers at least three portions of C.P. zinc. Dissolve the metal in about 10 cc. nitric acid, first covering with water. Boil off the nitrous

fumes and dilute to 250 cc. with distilled water. Add 10 cc. of ferric nitrate solution, and 15 cc. citric acid solution, make faintly ammoniacal, using a piece of litmus paper as indicator. Then add a measured excess of ammonia, as follows: 40 cc. factor, 20 cc. excess; 20 cc. factor, 10 to 12 cc. excess; and for low titrations make only faintly ammoniacal. Heat the solution to a full boil, and titrate immediately with the standard ferrocyanide, stirring the solution thoroughly and adding ferrocyanide not too rapidly. The titration is completed when a drop of solution gives a bluish-green coloration with a drop of 50% acetic acid on a spot plate. To prevent passing the end-point, or until the operator is experienced, a portion (50 cc.) of the solution may be held back in a small beaker, the end-point passed, and the titration completed after adding the part in the small beaker.

General Notes

A standard zinc solution may be used in case the end-point is passed. However, this is not to be recommended as a usual practice. In any case it should be very dilute, so that 1 cc. = 0.001 gram zinc.

The ferrocyanide should be added gradually and the solution stirred constantly,

to prevent occlusion of ferrocyanide or zinc solution by the heavy precipitate.

A moisture sample should be weighed at the same time as the sample for analysis. The variation of factor with amount of zinc titrated is more marked in this method than in the titration in acid solution. Hence, it is necessary that standards be run covering the whole range of zincs to be titrated. It will be found that the factors from 30 to 50 cc. are almost the same and from 15 to 30 cc. slightly lower, from 5 to 15 cc. still lower.

The zinc used as a standard should be carefully examined for foreign particles and oxidized zinc. In case stick zinc is used, the surface should be scraped clean before cutting. Merck's and Kahlbaum's stick zinc, as well as Baker & Adamson's, Eimer & Amend's, or J. T. Baker's powdered zinc answer the purpose as regards metallic impurities. It is desirable to check the factor by means of a standard

The standard of the ferrocyanide solution should be frequently checked, at least once every ten days. A solution of such a strength that 1 cc. equals 10 milligrams of zinc has in glass a temperature coefficient sufficient to decrease the factor 0.2 % per 5° C. rise in temperature, so care should be taken that no sharp change of temperature occurs between standardization and titration.

The factors in alkaline and acid solution are not identical. In alkaline solution the precipitate closely approaches the normal ferrocyanide, while in acid solution

there is formed a double ferrocyanide of zinc and potassium.

Standard Method

Titration in Acid Solution—Separating of Zinc as Sulphide

General. The method of separating zinc as sulphide in a solution slightly acid with sulphuric acid is of almost universal application, and can be used on any class of zinciferous material that has come under the author's observation. steps fit together, so that copper and cadmium are easily separated and any zinc in the insoluble state, e.g., spinels, etc., can readily be looked for. The method of decomposing (taking to fumes of sulphuric acid) tends to take into solution material that would be overlooked in the rapid decompositions effected in the preceding methods. Moreover, the use of the internal indicator gives a very sharp end-point, so that this method is fully as accurate as any gravimetric method. The method is more time consuming than the ones already given, but

it is not designed for rapid routine work, but rather as a standard procedure that will give absolutely reliable results on all classes of material. This method is also recommended for routine work in case the analyst is called on to make only occasional zinc analyses.

Standardization of the Ferrocyanide Solution

Note. The standardization of the solution is given first, on account of the method of titration.

Weigh into tall 400-cc. beakers several portions of C.P. zinc, using about 0.35 gram. Cover with water and dissolve in 10 cc. hydrochloric acid (sp.gr. 1.2). Now add 13 cc. ammonia (sp.gr. 0.9), make acid with hydrochloric acid, and add 3 cc. excess. Add 0.03 or 0.04 milligram of ferrous iron in the form of a ferrous sulphate solution and dilute to about 200 cc. with distilled water. Heat to boiling and titrate as follows: About one-quarter of the solution is reserved in a small beaker and the ferrocyanide added to the main solution with vigorous stirring. The solution takes on a blue color, which changes to a creamy white when an excess of ferrocyanide is added. Now add a few cc. more and pour in the reserved portion of zinc solution, excepting about 5 or 10 cc. Add ferrocyanide until the end-point is reached and add about ½ cc. more. The last of the reserved zinc solution is then poured into the main beaker, washing out the small beaker with a portion of the main solution, and the ferrocyanide added drop by drop until the blue color fades sharply to a pea green with one drop of ferrocyanide. This is the end-point. Repeat until satisfactory standards are obtained.

Procedure. Weigh into a tall 150-cc. beaker an amount of sample so that it gives a titration of about 40 cc., i.e., 5 grams for a 10% ore to ½ gram for 60% ore and over. Moisten with water and add 10 cc. of hydrochloric acid (sp.gr. 1.20), cover with a watch-glass. In case of sulphides it is necessary to add nitric acid. Boil moderately on a hot plate for half hour or so. Remove and wash down cover-glass and sides of beaker, add 10 cc. of 1: 1 H₂SO₄ and evaporate to strong fumes of sulphuric acid. In case of very siliceous material, it is well to break up the silica with a glass rod before adding the sulphuric acid. After fuming, the solution is cooled and diluted to 40 to 50 cc. and about a gram of 20-mesh aluminum added. Cover with a watch crystal and boil until water white (about ten to fifteen minutes). This will reduce the iron and precipitate all the hydrogen sulphide metals, except cadmium.² The silica and precipitated metals are filtered off and washed with hot water.

Add 5 cc. of 1: 1 sulphuric to the filtrate and dilute to 100 cc. Pass a rapid stream of hydrogen sulphide through the solution for fifteen minutes. Add dilute ammonia, a drop at a time until yellow cadmium sulphide precipitates. Then heat the solution to 70 to 90° C. and continue to pass hydrogen sulphide for a few minutes. Filter at once through a close paper previously packed by washing with a polysulphide, an acid and water. The precipitate is washed with cold 8 to 10% sulphuric acid and finally with hot water. The filtrate is boiled to remove hydrogen sulphide, cooled, neutralized with potassium hydroxide

¹ It is only by adding an excess of ierrocyanide that one is assured of a precipitate of normal composition.

² Cadmium is partially precipitated, but goes back in solution.

³ All the cadmium is separated, except about 0.05%, which does not interfere with the titration at the given acidity.

solution, and finally potassium carbonate solution, to within an acidity of a couple of drops of 20% sulphuric acid. Methyl orange is used as an indicator. Add from 2 to 4 cc. of 5% 1 sulphuric acid per 100 cc. of solution according to the amount of zinc present. Cool thoroughly. A rapid stream of hydrogen sulphide is now passed through the solution for forty minutes. Allow the precipitate to settle ten or fifteen minutes, filter and wash with cold water. A hole is punched in the filter paper and the sulphide washed back into the beaker in which it was precipitated. The filter paper and glass tube are then washed with 10 cc. of hydrochloric acid in hot water, catching the washings in the same beaker. Boil off the hydrogen sulphide, add 13 cc. of ammonia (sp.gr. 0.9), neutralize with hydrochloric acid, add 3 cc. excess and dilute to 200 cc. Heat to boiling and titrate as under Standardization. When cadmium is absent or present in quantities less than 0.05, the procedure is of course shortened considerably.

To Separate Cadmium Electrolytically. After filtering off the silica and precipitated hydrogen sulphide metals, add 1 cc. of 1:1 sulphuric acid, dilute to 125 cc. and electrolyze with 0.8 to 1.0 ampere per 100 sq.cm. of electrode surface for 1½ hours at 2.95 to 3.05 volts. Proceed with the residual solution as above. As in all electrolytic separations the current must be carefully watched.

Procedure with Material Containing Insoluble Zinc

Proceed as usual up to point where the solution is to be reduced. Filter off the silica and insoluble material, wash with hot water and proceed with the filtrate as usual. Burn the insoluble residue in a platinum crucible, taking the usual precautions in case lead is present. Fume off the silica with hydrofluoric and sulphuric acids and fuse with acid potassium sulphate. Dissolve in water and sulphuric acid and proceed as in the regular method. The solution may be added to the main portion or titrated separately.

Discussion on Separating Zinc as Zinc Sulphide and Titrating in Acid Solution

Precipitation. The method of precipitating zinc as sulphide in sulpnuric acid solution was investigated by G. Weiss (Inaugural Dissertation, München, 1906), and the work confirmed by F. G. Breyer. The main points of Weiss' paper are as follows:

- 1. "Sulphate solutions are preferable to chlorides." A N/10 chloride solution is not completely precipitated by H₂S. Furthermore, the precipitate of sulphide from HCl solution when quantitative is not crystalline and easy to filter like that obtained from sulphate solution.
- 2. "The concentration of a sulphate solution is without influence on the completeness of precipitation from N/10 down. That is for solutions containing at most 400 milligrams ZnO per 100 cc."
- 3. "Sulphate solutions of 400 milligrams ZnO per 100 cc. may be N/100 acid with H₂SO₄ before beginning the precipitation." Even at acidity N/20 before
- ¹ Bear in mind at this point the acid liberated by the action of H₂S in the zinc sulphate. See Discussion below.

² In cold solution the precipitate is more granular and easier to filter.

³ The hydrogen sulphide should pass through at a rate of at least eight bubbles per second.

precipitation less than a milligram of zinc remains unprecipitated. According to Weiss, if the solution were diluted to 300 cc. 1.3 grams of H₂SO₄ could be added or 6½ cc. of 20% H₂SO₄, and still have the precipitation complete. Even if as much as 10 cc. of 20% acid were added the loss would still be only a little more than 1 milligram. Precipitating 300 milligrams from 100 cc., however, only 100 milligrams or ½ cc. of 20% acid could be added. This means that when the solution becomes more acid than 550 milligrams of H₂SO₄ per 100 cc, the precipitation of ZnS ceases. Knowing approximately the zinc content of a solution one can easily calculate the H₂SO₄, freed when the ZnSO₄ is converted into ZnS, and the difference between 550 milligrams and this calculated H₂SO₄ is the amount of acid that may be added when precipitating from 100 cc. of solution. For two hundred cc. of course more acid can be added, being the difference between 1.100 grams and the calculated H₂SO₄ freed from the ZnSO₄. One and one-half times the amount of Zn judged to be present is close enough for the H₂SO₄ freed.

4. "The precipitation, under the above given conditions, is incomplete when a slow current of hydrogen sulphide is used (about four bubbles per second). One must work with as fast a stream as possible without causing mechanical losses (at least eight bubbles per second)." Weiss is the first one to discuss this all-important question in the precipitation of ZnS. His explanation of the efficacy of the rapid stream of H_S is as follows:

The precipitation takes place according to the following equation:

$$ZnSO_4+H_2S \Leftrightarrow ZnS+H_2SO_4$$

Equilibrium is reached, i.e., the velocity becomes equal in both directions, and precipitation ceases when the amount of H₂SO₄ per 100 cc. reaches a certain point, under a given set of conditions. Let these conditions remain exactly the same with the exception of the H₂S and have the active mass of that increased. The equilibrium will be displaced from left to right and as a consequence ZnS will come down in the presence of more acid than before. H₂S is not very soluble in water at room temperature, but if one increases the surface of contact between the two the H₂S is dissolved much more rapidly and consequently the mass of H₂S active at any time greatly increased. This is exactly what is accomplished when the zinc solution is constantly kept full of bubbles of H₂S. One can easily see how greatly increased the mass of H₂S would be in the extreme case, when the solution is all foam.

- 5. "A strong current of gas, like that called for above, will precipitate the usual amounts of zinc used in analytical operations in forty minutes."
- 6. "At temperatures above 50° the precipitation is incomplete; furthermore, at room temperature the ZnS comes down in a form suitable for filtration."

Weiss found that not only were the precipitations incomplete at high temperatures, but the precipitate was finer and much more difficult to filter.

7. "Water only is required for washing the precipitates."

End-point. The change of color from blue to pea green is very sharp. It should be observed by looking down through the solution and not from the side. The change in color may be explained as follows: The ferrocyanide, having stood for three or four weeks, has oxidized slightly to ferricyanide, due to dissolved oxygen in the water. The few tenths of a milligram of ferrous iron added acts with this ferricyanide giving the ferro-ferricyanide blue as long as the ferro-

ZINC 607.

cyanide is not in excess. When it is in excess the blue is decomposed and gives the colorless ferro-ferrocyanide.

In case the ferrocyanide solution is freshly prepared, it is well to add about 300 milligrams of ferricyanide to each liter.

DETERMINATION OF SMALL AMOUNTS OF ZINC

The following method is applicable to samples containing 0.05% Zn or less. Procedure. A large sample, 10 or 20 grams, is brought into solution by the standard procedure, taken to fumes of sulphuric acid and the zinc precipitated as sulphide after separating groups 5 and 6 by the procedures given under Standard Method, filtered and dissolved in hydrochloric acid. The sample is now washed into a 100-cc. Nessler tube, 5 cc. of ferrocyanide added and the whole made up to the mark, mixed by pouring into a beaker and then back into the tube. A standard containing the same amount of acid is made up and a standard zinc chloride solution added until the turbidity of standard and unknown are the same. From the amount of zinc added to the standard the percentage can be calculated. The standard zinc solution is made up by dissolving C.P. zinc in hydrochloric acid and diluting so that 1 cc. is equal to 1 milligram of zinc.

SPECIAL METHODS

Determination of Metallic Zinc in Zinc Dust


Discussion. There have been various methods proposed for determining the metallic zinc content of zinc dust. Most of these are based upon its reducing power. The latter may be determined by any one of many ways, although the results from different methods will not be concordant, due to the inaccuracies inherent with most of the methods. Potassium bichromate, iodate, ferric sulphate, and iodine have been used for measuring the reducing power of zinc dust. Fresenius also proposed dissolving the zinc dust in dilute sulphuric acid and after drying passing the hydrogen over heated copper oxide in a combustion tube, absorbing the water formed in a calcium chloride tube and weighing.

There have also been methods devised based on the volume of hydrogen evolved when a sample of zinc dust is dissolved in dilute acid. Several investigators have concluded from comparative investigations that the gasometric determination of the hydrogen evolved gives the most consistently accurate results. The best arrangement of apparatus for carrying out this hydrogen evolution method is shown in Fig. 72. The time required for a determination is about 1½ hours.

Procedure. One gram of zinc dust is weighed and transferred as rapidly as possible to a small Erlenmeyer flask A, of 100 or 200 cc. capacity, in which is placed a piece of sheet platinum about 1.5 cm. square. About 5 g. of clean unoxidized ferrous sulphate crystals are added on top of the zinc dust and the flask nearly filled with distilled water saturated at room temperature with hydrogen gas.

The object of adding the sheet platinum and ferrous sulphate is to increase the rate of hydrogen evolution by catalytic action. A further reason for adding the ferrous sulphate on top of the zinc dust sample is to coagulate the latter as much as possible when it becomes wetted, and thus prevent the floating of more than an unappreciable amount of the sample.

The rubber stopper containing separatory funnel B and connecting tube C is tightly inserted into the neck of the flask. A little distilled water is poured into B

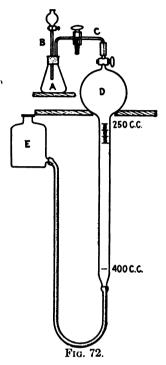

and the three-way stop-cock in C turned to connect the flask with the downward outlet. Enough water is now run in from the separatory funnel to displace all the air in the flask and the connecting tube through the bore in its stopcock. The stopcock in C is now turned so that the downward outlet is in connection with the measuring tube D. By raising the leveling bottle E, containing 10 per cent. sulphuric acid also saturated with hydrogen at room temperature, all the gas in D is displaced. stopcock in C is now turned through 90 deg. so as to connect the decomposing flask A with the measuring tube D. The system is hence completely filled with liquid and ready for the generation of hydrogen. The measuring tube D has a total capacity of 400 cc. and is graduated from 250 to 400 cc. by 0.25 cc.

Thirty cubic centimeters of 1:1 sulphuric acid are now poured into the separatory funnel. A small portion of this acid is allowed to run into the decomposing flask until a brisk but not too rapid evolution of hydrogen takes place. The acid, being much heavier than water, settles to the bottem of the flask and the action commences immediately. The gas evolved, together with some solution and a very small amount of zinc dust passes over into the measuring tube, displacing the acid there. When the action in the decomposing flask has slowed down, more strong acid is introduced until all has been

added. During this time the acid in the measuring tube and flask is shaken so as to wash down the particles of zinc dust from the upper parts of the flask and tube now filled with gas. The particles in the measuring tube on coming in contact with the 10 per cent. sulphuric acid are readily dissolved and generate their portion of hydrogen.

When all the zinc dust has been dissolved, water is run in from the separatory funnel to force the hydrogen over into the measuring tube and to fill the flask and connecting tube with water through to the stopcock which, is then closed. After leveling with the leveling bottle the volume of hydrogen generated from the 1-g. sample at the prevailing atmospheric conditions is read from the measuring tube. The percentage of metallic zinc in the sample is then calculated from the following expression:

Per cent. of Metallic Zinc =
$$\frac{V \times (P-p) \times 0.29196}{(1+0.00367t)760}$$
,

in which V = volume of gas in measuring tube at atmospheric conditions, P = barometric pressure, p = vapor tension of water above 10 per cent. sulphuric acid at room temperature, and t = room temperature.

Necessary Precautions. To obtain results of the highest accuracy, it is necessary when weighing out samples of zinc dust which are very finely divided, to keep the time of exposure as small as possible in order to minimize the oxidation


that takes place with the oxygen of the air. It is also highly important when samples are to be held, that they be kept in ground glass stoppered bottles, completely filled, and sealed with paraffin or wax.

The two variables most likely to affect the results are temperature and barometric pressure. A change in the barometric pressure is practically always ex-

tended over a reasonable length of time. A careful reading of the barometer when the volume of gas in the measuring tube is read will eliminate any error from this source. A temperature change, on the other hand, affects not only the volume of gas, according to Charles' law, but also affects the vapor tension of water and hence the actual pressure of the hydrogen when measured.

The rubber connection between the connecting and measuring tubes must be of heavy rubber and should be shellacked.

The vapor tension of water is slightly 1 ower above 10 per cent. sulphuricacid than above pure water, as shown in Fig. 73 and for accurate work should be used in place of the ordinary vapor tension tables.

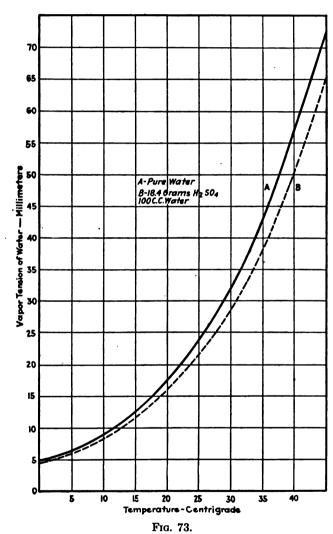

The result obtained should be corrected for any metallic impurities, as Fe, Al, etc., which evolve hydrogen when dissolved in sulphuric acid.

DETERMINATION OF IMPURITIES IN SPELTER

LEAD

Electrolytic Method

The sample is thoroughly mixed on a sheet of paper and a magnet passed over to remove iron particles. Any pieces showing discolorations are discarded. The pieces of spelter for the weighed sample are removed from the paper by lifting and not pouring. The amount of sample taken is determined by the amount of lead in the spelter.

For No. 1 or High Grade Spelter a sample of 17.286 grams is weighed into a 600 cc. beaker, 200 cc. of distilled water added, and 60 cc. of concentrated nitric acid added gradually until solution is complete. The solution is boiled down to 200 cc., expelling all nitrous fumes, and then transferred to a 250 cc. beaker, washing out original beaker without unnecessarily increasing volume. Four or five drops of 5% silver nitrate solution are added, to precipitate any traces of chlorine present, and the solution electrolyzed for one and one-half to two hours, with initial temperature of 60-70° C. and current of 1.8 amperes.

For No. 2 or Intermediate grade, a sample of 8.643 grams is weighed into a 250 cc. beaker, 100 cc. of distilled water added, and 40 cc. of concentrated nitric acid added. The solution is boiled until all nitrous fumes have been expelled and diluted to 200 cc. with distilled water, 4 or 5 drops of 5% silver nitrate added and the solution electrolyzed as given under High Grade Spelter.

For the three lower grades of spelter, Brass Special, Selected and Prime western, a sample of 17.286 grams is weighed into a 600 cc. beaker, covered with 200 cc. of water and 60 cc. of concentrated nitric acid added. This solution is boiled down to 200 cc. transferred to a 500 cc. graduated flask and the flask filled to the graduation. After thorough mixing, an aliquot portion of 125 cc. (equivalent to 4.3215 grams) is poured into a 250 cc. beaker, 10 cc. of concentrated nitric acid added, boiled for ten minutes, diluted to 200 cc., with distilled water, silver nitrate added and electrolyzed as given for high grade spelter.

The anode is made of sheet platinum with wire stem and is sand blasted. No gold solder should be used on these cylinders. The surface area is 135 sq. cm. A spiral of platinum wire is used as a cathode. A spiral of aluminum wire may also be used, although its life is much shorter.

When electrolysis is complete, the anode is removed from the solution as rapidly as possible, washed three times with distilled water, once with alcohol, dried in an air bath at 210°C. for thirty minutes, cooled and weighed.

The weight of PbO₂ can be calculated directly to percentage of lead as factor weights of sample were taken.

Lead Acid Method

Weigh 10 grams of the sample into a 400 cc. beaker and add 120 cc. of "lead acid." When all but about 10% of the zinc is dissolved, filter and wash with lead acid. Retain the filtrate. Wash the metallics back into the beaker and dissolve in nitric acid. Add 40 cc. of "lead acid" and evaporate to strong fumes. Cool and add 35 cc. of water, which is the amount evaporated from the "lead acid," and heat to boiling. Add the filtrate containing most of the zinc and a little lead sulphate, stir and allow to settle over night. Filter on a Gooch crucible, wash with lead acid, a mixture of alcohol and water (1:1), finally with alcohol and ignite inside a porcelain crucible and weigh as lead sulphate.

Lead Acid. Add 1 gram of lead acetate in 300 cc. of water to dilute sulphuric acid (300 cc. acid to 1800 cc. of water). Shake well, allow to cool and settle. Filter off the precipitated lead sulphate. By the use of this sulphuric acid saturated with lead, the solubility of lead sulphate need not be considered, the solution being brought back to the same concentration each time.

NOTE. The rejection limits for spelter of the American Society for Testing Materials consider five grades as follows:

	Grade .	Pb Not Over	Fe Not Over	Cd Not Over	Sum Pb+Fe+Cd Not Over	Al
	High Grade	.07%	0.3%	.07%	.10%	None
No. 2.	Intermediate	.20	.03	.50	.50	"
No. 3.	Brass Special	.60	.03	.50	1.0	"
	Selected	.80	.04	.75	1.25	"
	Prime Western	1.60	.08			

IRON

Hydrogen Sulphide Method

Ten grams or more of the sample of spelter, which has been passed under a magnet to remove any metallic iron particles, is weighed out into a 250 cc. beaker and dissolved with 50 cc. of concentrated hydrochloric acid. After standing several minutes until violent action has ceased, about 1 cc. of potassium chlorate solution (50 grams per liter) is added and boiled until all chlorine fumes have been driven off. It is then cooled, 50 cc. of water added, neutralized with ammonia, adding a large excess of the latter, boiled for two or three minutes and then allowed to settle. The solution is filtered, the precipitate on the filter washed with dilute ammonia water and finally with hot water. The precipitate is dissolved into a 500 cc. Erlenmeyer flask, using 10 cc. 1: 4 sulphuric acid. The paper is washed thoroughly After diluting to a volume of about 300 cc. hydrogen sulphide with hot water. is passed through for 5 minutes to reduce the iron. The excess of hydrogen sulphide is boiled off, being careful to exclude the entrance of any air. When no trace of hydrogen sulphide is present, as indicated by no test with lead acetate paper, the solution is cooled rapidly, and titrated with a standard solution of potassium permanganate, 1 cc. of which is equivalent to about 0.00034 grams of iron. A blank determination is also run in order to determine the amount of potassium permanganate required to show the pink color on titration. The permanganate solution is standardized against Bureau of Standards Sodium Oxalate.

Colorimetric Method

Solutions. Ammonium Sulphocyanate. One part salt to 2 parts of water. Potassium Chlorate. One part salt to 20 parts of water.

į

Standard Iron Solution I. 500 grams of low iron granulated zinc is dissolved in 800 to 1000 cc. of concentrated hydrochloric acid, sufficient amount of potassium chlorate solution added to oxidize the iron present, boiled several minutes to expel chlorine, cooled and made up to 2500 cc. This solution is standardized by measuring off 50 cc. portions, corresponding to 10 grams of zinc, and determining the iron content by the Hydrogen Sulphide Method.

Standard Iron Solution II. 0.7 grams of ferrous ammonium sulphate is dissolved in water, 10 cc. dilute sulphuric acid added, and the iron oxidized with permanganate. The solution is diluted to 1000 cc. each cc. being equivalent to .0001 gram iron.

Procedure. Ten grams of sample are dissolved and oxidized as given under the Hydrogen Sulphide Method. The solution is cooled and diluted to about 25 cc. and transferred to a comparison tube, 12 cc. of the sulphocyanate solution are added, and the volume brought up to 100 cc. and mixed by pouring into the beaker and back into the tube. The red color is compared with the color produced on adding 2 cc. of sulphocyanate to 50 cc. of standard iron solution I, 2 and diluting to 100 cc. Standard Iron Solution II is added until the colors are the same, and the iron present in the unknown calculated. In case the iron is over 0.030, it should be determined by the Hydrogen Sulphide Method.

CADMIUM

Sulphide Method

The determination of cadmium in spelter is best carried out by either of the two following methods, according as the amount to be determined is low or high.

Cadmium in Spelter (Cd -.001% to .02%)

A sample of 500 grams is taken and placed in a 2000 cc. flask with 500 cc. of water and 100 cc. of 1:1 sulphuric acid. Sulphuric acid (1:1) is added in small quantities from time to time, to maintain solution of the zinc (but never any violent action), until about 90% of the sample has been dissolved. This requires about 750 cc. of 1:1 sulphuric acid. When the evolution of hydrogen has become slow, after the last addition of acid, the solution is filtered off, retaining as much of the undissolved metallics as possible in the flask. The metallics are washed twice with water, decanting and pouring the small amount of metallics on the filter. The metallics on the filter are then washed from the paper into the original flask and all dissolved in nitric acid. The solution is washed into a 600 cc. beaker and sufficient sulphuric acid (1:1) added to convert all the metals present to sulphates, leaving an excess of free acid of 10-15 cc. This requires about 95 to 100 cc. of acid. The solution is evaporated until all nitric acid has been expelled.

After cooling, water is carefully added and the beaker heated until all the soluble salts have been dissolved. The lead sulphate is allowed to settle, filtered off and washed. Enough water must be added to keep all zinc sulphate in solution after cooling. Hydrogen sulphide is passed through the filtrate for 15-20 minutes. No precipitate will appear at first, so that a drop or two of ammonia is added and repeated at intervals until a considerable amount of zinc sulphide has been precipitated. The sulphides are then filtered off and washed with cold water. The film of sulphides on the side of the original beaker and the sulphides on the paper are dissolved in 1:2 hydrochloric acid, washing with water, and catching the solution in a tall 400 cc. beaker. 15 cc. of 1:1 sulphuric acid are added and evaporation carried down to fumes. After cooling, 200 cc. of water is added, hydrogen sulphide passed through and ammonia added as above to produce a pre-

¹ Clear glass test-tubes ³ in. in diameter, and holding 110 cc. make good comparison tubes.

² The zinc content of the standard and unknown must be approximately the same. (See references, Bureau of Standards Bulletin, No. 1, Vol. 3.)

cipitate of cadmium sulphide. The precipitate is treated as before and a third precipitation made. In the case of very low cadmium, a fourth precipitation is advisable. The last precipitate is filtered at once on a weighed Gooch crucible, washed with cold water, dried at 110° C. and weighed as CdS or the cadmium may be weighed as metallic cadmium, by dissolving the last precipitate and electrolyzing as given by the following method:

The last precipitation of cadmium as CdS is filtered off, washed with cold water, and dissolved in dilute hydrochloric acid as in previous precipitations, catching solution and washings in original beaker. Twenty-five cc. of 1:1 sulphuric acid are added and evaporation carried to dense fumes. After cooling, a small amount of water is added, the solution neutralized with ammonia (using methyl orange as indicator), then made just acid with sulphuric acid (sp.gr. 1.09) and 3 cc. added in excess. The solution is then transferred to a 250 cc. beaker, (washing out the original beaker), diluted to cover the cylinder (beaker \frac{2}{3}\text{ full}), and electrolyzed over night using a current of one ampere. The cylinder with cadmium deposit is removed, washed with water and alcohol, dried at 110° C., removed from oven as soon as dry, cooled and weighed.

Cadmium in Spelter (Cd -0.2% to 1.0%)

A sample of 10 (or 25) grams is taken and entirely dissolved in a tall 400 cc. beaker with nitric acid, the solution then treated with 25 (or 50) cc. of 1:1 sulphuric acid and evaporated to expel all nitric acid. After cooling, water is carefully added and the beaker heated until all the soluble salts have been dissolved. The lead sulphate is allowed to settle, filtered off and washed. The filtrate is diluted to 200 cc. and hydrogen sulphide gas passed through for 15-20 minutes. No precipitate will appear at first, so that a drop or two of ammonia is added and repeated at intervals until a considerable amount of zinc sulphide has been precipitated. The sulphides are filtered off and washed with cold water. They are then dissolved with 1:2 hydrochloric acid, catching in the original beaker, 15 cc. of 1:1 sulphuric acid added and taken to fumes. This is again diluted to 200 cc. hydrogen sulphide gas passed through, and ammonia added as before to produce a precipitate of cadmium sulphide. This is treated as above and a third precipitation made. The cadmium sulphide from this is filtered at once on a weighed gooch, washed with cold water, dried at 110° C., and weighed as CdS, or the cadmium may be weighed as metallic cadmium, by dissolving the last precipitate and electrolyzing as given under Method for Low Cadmium.

General Remarks

A very retentive filter paper must be used for the cadmium sulphide precipitates. In dissolving the cadmium sulphide precipitates from the filter paper, the funnel should be covered to guard against loss by spraying. The number of treatments with hydrochloric acid depends upon the amount of sulphides on the paper. The paper may be finally washed with water after all sulphides have dissolved, if desired.

It is not absolutely necessary to wash the final precipitate of cadmium sulphide on the gooch, as this has been accomplished in the transfer of the precipitate from the beaker. This has been included in the methods to safeguard against free acid remaining on the Gooch.

ANALYSIS OF ZINC CHLORIDE SOLUTION

The methods to be used for the analysis of zinc chloride solution or fused zinc chloride are essentially those given under the various chapters for the various elements. It seems advisable, however, to include a set of methods of analysis suitable for the commercial evaluation of zinc chloride.

1. Specific Gravity at 15° C.

The specific gravity is determined by means of a picnometer. The volume is brought to the graduation after the solution in the picnometer has been brought to 15° C., using a water bath. The weight of this volume of boiled distilled water is determined at 15° C., and the specific gravity of the zinc chloride solution calculated, compared to water at 15° C.

II. Zinc (Manganese and Copper Absent)

About 25 grams of the well shaken solution is weighed out in a weighing bottle and transferred to a 500 cc. graduated flask. Sufficient nitric acid is added to clarify the solution upon dilution. The flask is filled to the mark with distilled water and thoroughly mixed.

A portion, approximately equivalent to one gram of ZnCl₂ is accurately measured from a pipette or a burette and the zinc determined by titration with a standard potassium ferrocyanide solution as given under procedure for zinc in ores.

Zinc (Manganese or Copper Present)

If manganese or copper is present an aliquot portion is measured out and the manganese or copper separated according to the methods given under procedures for ores, before titration with potassium ferrocyanide.

III. Chlorine

Another portion of this solution, approximately equivalent to .5 grams ZnCl₂ is measured off into a 500 cc. Erlenmeyer flask, 15 cc. of distilled water, 100 cc. of standard N/10 silver nitrate solution and 40 cc. of nitric acid are added to the flask and boiled until all nitrous fumes are driven off. After cooling, the excess silver nitrate is titrated with standard N/10 ammonium thiocyanate solution using 5 cc. (1-6) ferric nitrate solution as an indicator. A blank is run at the same time and the amount of chlorine determined from the difference in volumes of ammonium thiocyanate required. The factor for the standard ammonium thiocyanate solution is best determined with C.P. sodium chloride.

IV. Sulphuric Anhydride (SO₃)

Twenty-five cc. of the original well shaken solution of zinc chloride are measured off with a pipette into a 400 cc. beaker, diluted to 300 cc. with hot water and a few drops of hydrochloric acid added. Any insoluble matter is filtered off, five cc. of bromine water are added to the filtrate and the solution boiled until excess bromine is all driven off. The SO₃ in the filtrate is precipitated with 25 cc. hot 10% barium chloride solution. After standing on the steam plate for 3 hours, the barium sulphate is filtered off, ignited and weighed. The weight of the sample is determined from the specific gravity.

V. Iron (Fe)

A portion of the well shaken solution, equivalent to 10 grams of zinc is evaporated to a syrupy consistency and the iron determined by the colorimetric method as under spelter.

In case the iron is too high to estimate colorimetrically, it is separated with ammonia, filtered off, washed with hot water and dissolved in hot dilute sulphuric acid. This solution is cooled, run through a Jones reductor and titrated with standard potassium permanganate solution, or the iron may be determined by the hydrogen sulphide method as given under analysis of spelter.

VI. Iron and Aluminum (Fe₂O₃+Al₂O₃)

Either 10 or 20 cc. of the original well shaken solution are transferred to a 400 cc. beaker, diluted with 150 cc. of water and hydrochloric acid added to a very faint excess. (2 drops concentrated acid.) A rapid stream of hydrogen sulphide is passed through the solution for 30 to 40 minutes. The precipitate of zinc sulphide is filtered off and washed thoroughly. The filtrate is boiled for about 15 minutes to remove hydrogen sulphide, cooled, sufficient bromine water added to more than oxidize all the iron, and then boiled to remove the excess bromine. Ammonium hydroxide is now added in slight excess, the precipitate of iron and alumina filtered off and washed with hot water. The precipitate is dissolved from the paper with hot hydrochloric acid (1:4) re-precipitated, filtered off, washed free from chlorides, ignited and weighed.

VII. Manganese (Mn)

Either 10 or 20 cc. of the original well shaken solution are transferred to a 400 cc. beaker, 25 cc. of sulphuric acid (1:1) added and evaporated to practically complete expulsion of all excess sulphuric acid. Nitric acid (1:3) is now added and the manganese determined according to the bismuthate method.

VIII. Lime (CaO)

Twenty-five cc. of the well shaken solution are measured off with a pipette, a few drops of hydrochloric acid added, and the solution diluted to 150 cc. Twenty grams of ammonium chloride and a few drops of bromine water are added. The iron and manganese are precipitated by ammonia and filtered off after bringing to boiling. The filtrate is evaporated to 150 cc., the lime precipitated with 25 cc. ammonium oxalate solution (saturated solution) and allowed to stand for 3 hours. The calcium oxalate is filtered off and washed four times with hot water. A hole is then punched in the filter paper, the precipitate washed into a 400 cc. beaker, with boiling water, 10 cc. of sulphuric acid (1:1) poured over the paper and the paper washed with boiling water. The solution is diluted to 150 cc. with hot water and titrated with standard potassium permanganate solution.

IX. Magnesia (MgO)

The filtrate and washings from the lime determination is made slightly acid with hydrochloric acid and 15 cc. of a saturated solution of microcosmic salts added. The solution is cooled and the magnesia precipitated by the slow addition of ammonia. Sufficient ammonia must be added to hold all zinc in solution, an excess

616 · · · ZINC

of about, 50 cc. being required. The precipitate after standing 12 hours is filtered off, and redissolved in hot 1-4 hydrochloric acid. Twenty grams of ammonium chloride are added to this solution, then a few drops of microcosmic solution, and precipitation affected with ammonia as before, the excess of ammonia being only 10 cc. in this case. After standing 12 hours, the precipitate is filtered off, washed six times with 1:10 ammonia water, or until free from chlorides, ignited and weighed as $Mg_2P_2O_7$.

X. Alkalies (NaCl+KCl)

A sample of about 10 grams is taken and made up to a volume of 500 cc. From this a portion equivalent to approximately 2 grams is measured off, slightly acidified with hydrochloric acid and the zinc precipitated with hydrogen sulphide. After filtering, the filtrate is tested with ammonium sulphide, and any zinc, iron and manganese precipitated is filtered off. The filtrate is boiled for about thirty minutes to drive off the hydrogen sulphide, and cooled. After cooling, the solution is made slightly acid with hydrochloric acid, a few drops of bromine water added and the excess of bromine boiled off. The solution is diluted to about 200 cc. with hot water, and 10 cc. of hot 10% BaCl₂ solution added, to precipitate SO₂. Without filtering off the barium sulphate, the solution is made ammoniacal, one gram of ammonium carbonate and 5 cc. of ammonium oxalate solution added and the precipitates allowed to settle in a warm place. The precipitate is filtered off, washed with hot water, and the combined filtrate and washings evaporated to dryness in a porcelain dish. The ammonium salts are completely driven off by ignition over a low flame. The residue remaining is dissolved in a small amount of water with two drops of hydrochloric acid, transferred to a weighed platinum dish, the porcelain dish being washed with a minimum amount of water, evaporated to dryness on a hot plate, and after cooling weighed.

Any magnesia which may be present with the alkali chlorides is determined, calculated to MgCl₂ and deducted from the weight of salts in the dish. This difference is expressed as combined alkali chlorides KCl+NaCl.

XI. Copper

Twenty cc. of solution are taken, 5 grams of ammonium chloride and 20 cc. of ammonium hydroxide added, diluted to 100 cc. in a color comparison tube and compared with a zinc chloride solution of equal strength, to which a measured amount of standard copper solution is added to give the same depth of color. If iron interferes with the color comparison, it should be filtered off before diluting to volume. When the amount of copper present is over 0.05%, the determination should be carried out by some other method. See chapter on copper.

XII. Barium (Ba)

If sulphuric anhydride (SO₃) is found to be present, it is not worth while to make a determination for barium. If no sulphuric anhydride is present, barium should be looked for and determined by diluting 10-20 cc. to 300 cc. with water, adding slight excess of hydrochloric acid heating to boiling and precipitating the barium with ammonium sulphate solution (10 per cent.).

ANALYSIS OF FUSED ZINC CHLORIDE

The analysis of fused zinc chloride for zinc, etc., is carried out by the same methods as given under Zinc Chloride Solution, working on a solution of the fused salt in water. This solution is made up by rapidly transfering approximately 29 grams of fused salt to a weighing bottle, weighing, dissolving in water in a 2000 cc. graduated flask to which a few drops of nitric acid has been added to prevent precipitation of basic zinc chloride, and filling to the mark. Aliquot portions are taken from this solution for the various determinations.

Special determinations are sometimes called for with fused zinc chloride which is to be used for some special purpose. It is very essential that such analyses be carried out carefully according to the method prescribed in order that the results, which are largely empirical, may be comparable. One analysis of this sort which is commonly called for is Basicity expressed in some empirical way to give a measure of the relative quantities of the basic zinc chloride, which will settle out upon dissolving fused zinc chloride in water. It may be expressed as the volume of standard hydrochloric acid (usually N/2) required to neutralize 10 cc. of a 40° Baume solution of the fused zinc chloride, diluted with 300 cc. of water, when using Methyl orange as indicator, or the weight of basic chloride obtained by treating 10 grams of the sample, weighed in a weighing bottle, with 400 cc. of water, agitating to complete all possible solution, filtering off insoluble on a gooch crucible and washing with water until combined filtrate and washings total just 1000 cc.

Ammonia (NH₃)

It is often of value to know if ammonium chloride is present. A sample of 5–10 grams is weighed and transferred to a 500 cc. distilling flask, 100 cc. of water, 50 cc. of sodium hydroxide (20 per cent.) and a small quantity of granulated zinct added. The ammonia and water are distilled over into an absorption bottle containing a measured quantity of standard acid. The excess of acid is titrated with standard alkali solution, using methyl orange.

See chapter on nitrogen, page 343, also analysis of paint pigments, volume 2.

¹ The addition of granulated zinc aids in the expulsion of the ammonia by hydrogen formed with the sodium hydroxide.

ZIRCONIUM

R. STUART OWENS.1

Zr, at.wt. 90.6; sp.gr. 4.15; m.p. 1700° ± C.; oxides ZrO2, ZrO2.

DETECTION

The zirconium having been brought into solution by one of the methods outlined below may be distinguished:

- (1) By the addition of sodium phosphate to a slightly acid solution. A white precipitate which is difficultly soluble in hydrochloric acid is characteristic of zirconium.
- (2) By its solution in hydrochloric acid coloring turmeric paper orange. Titanium, however, colors it brown, and will mask the color due to zirconium, when both are present, hence it is necessary to reduce the titanium by the addition of a few pieces of zinc. Reduced titanium does not color turmeric paper, but it oxidizes rapidly, hence the test should be made as quickly as possible. Boric acid also produces a yellow color with turmeric paper, but both elements are met with in the same sample on very rare occasions only.
- (3) From alumina by the solubility of its carbonate in an excess of an alkali carbonate. The solution from ammonium carbonate if boiled precipitates zirconia.
- (4) From glucinum by the insolubility of its hydroxide in ammonium chloride. Glucinum hydroxide dissolves readily in the reagent.
- (5) By spectroscopic methods. Zirconium shows lines of greatest intensity in the arc spectrum at 4687.9, 4739.6, 4772.5, 4815.8, and in the spark spectrum at 3999.1, 4149.4, 4209.4, 4380.1.2

ESTIMATION

The determination of zirconium is required in minerals, artificial gems, incandescent gaslight mantles, firebrick, enamels, glass and various salts of the mineral acids. The chief source of zirconium is the mineral zircon (ZrSiO₄) and its valuable modifications as hyacinth. Zircon contains from 60 to 67% of ZrO₂.

Preparation and Solution of the Sample

A. Materials Containing a Large Amount of Silica

Decomposition by Hydrofluoric Acid. Five grams of the finely powdered sample are treated in a large platinum dish with 50 cc. HF and 50 cc. of H₂SO₄. When the violent action has ceased the solution is evaporated first on the steam bath to expel the HF and then on a sand bath till fumes of SO₄ are given off. The

¹ Research Chemist, New York City.

² All of these lines are in the visible spectrum.

residue is taken up with water. This usually effects complete solution of the sample. If, however, an insoluble residue still remains, it is filtered off, washed with cold water, ignited in platinum, and fused with 10 parts by weight of potassium acid sulphate. The cooled fusion is dissolved by boiling with 20% HCl. All the zirconium will now be in solution and may be determined as detailed below. Barium if present will remain insoluble and should be filtered off.

Notes. Heating the mineral to dull redness and suddenly plunging into cold water enables zircon to be easily pulverized.

If the KHSO₄ fusion is extracted with dilute H₂SO₄ and boiled, the white basic sulphate, 3ZrO₂·SO₃, is apt to form and remain in the residue.

B. General Method for Minerals, Oxides, etc.

Decomposition by Fusion with an Alkali Carbonate. Two grams of the finely pulverized sample are fused with 10 grams of Na₂CO₂ (free of sulphur) and ½ gram of KNO₂ in a large platinum dish.¹ The melt is taken up in water and if manganese is present a few drops of alcohol are added to reduce the manganate to the manganous condition. The solution is filtered and the residue washed with dilute NaOH solution. The filtrate then contains all the silica as sodium silicate, while the residue contains all the zirconium, barium, etc. The residue is dissolved in dilute H₂SO₄ and the zirconium present determined as detailed below.

C. Other Methods of Decomposition which are Sometimes Used

Fusion with acid potassium fluoride. Fusion with caustic soda and sodium fluoride. By long boiling with concentrated hydrochloric acid.

SEPARATIONS

From Iron by the volatilization of the iron as chloride in the presence of strong hydrochloric acid and chlorine at a temperature of 200 to 300° C.²

From Iron. Zirconium is precipitated free from iron by phenylhydrazine.³
From Titanium by precipitating the titanium from dilute sulphuric acid solution by boiling in the presence of acetic acid.⁴

From thorium by precipitation of both metals as oxalates by ammonium oxalate and then adding an excess of oxalic acid when the zirconium oxalate dissolves completely.

From cerium and the iron groups by boiling the hydrochloric acid solution with sodium thiosulphate. The zirconium is precipitated as thiosulphate, which may, after filtering and washing, be ignited to the oxide.

Tartaric acid prevents the precipitation of zirconium hydroxide.

¹ A nickel dish should be used in place of platinum if sulphur, lead or phosphorus is present.

² Havens and Way, A. J. C., (4), 7, 217. ³ Allen, J. A. C. S., 25, 426.

- Streit and Franz, J. pr. Chem., 108, 75; Streit and Franz, Zeitsch, anal. chem., 9, 388.
 - Roscoe and Schorlemmeyer, Vol. II, Part II, p. 276.

⁶ Ibid., p. 272.

GRAVIMETRIC METHODS FOR THE DETERMINATION OF ZIRCONIUM

Salts of Zirconium

"A" solutions containing zirconium are treated with 5 cc. of H₂SO₄ and evaporated to fumes; taken up with cold water and diluted to 400 cc.

"B" dry salts are treated with 5 cc. of H₂SO₄ and heated to fumes of SO₃ on a sand bath. The residue is taken up with cold water and diluted.

Minerals, Silicates, etc.

The sample having been decomposed by one of the methods outlined and the zirconium being present in solution as sulphate the liquid is diluted so as to contain about 1% of free H_*SO_4 .

Determination as Phosphate

To the acid solution sufficient H₂O₂ is added to oxidize the titanium which may be present. (The solution is colored yellow by H₂O₂ when titanium is present.) A sufficient quantity of ortho-phosphate (as (NH₄)₂HPO₄ or Na₂HPO₄) is added to precipitate all the zirconium as phosphate (aluminum and iron are not precipitated in the presence of free acid). If titanium is present and the color bleaches after a time, more H₂O₂ is added until the color is restored. (Any reduced titanium is carried down with the zirconium phosphate.) The precipitate is filtered off, washed well with water containing some H₂O₂, ignited and weighed as zirconium phosphate, which contains 51.8% of ZrO₂. The solution after precipitation should be allowed to stand several hours. Traces require ten to fifteen hours, while considerable amounts of zirconium require only from thirty minutes to one hour of settling on the steam bath for complete precipitation.

Conditions for Accuracy¹

The phosphate method for determining zirconium, originally designed by W. F. Hillebrand, requires certain conditions for accurate results in estimation of large quantities of zirconium. The following details are modifications of the procedure published by Nicolardot and Reglado² worked out by G. E. F. Lundell and H. B. Knowles, U. S. Bureau of Standards.

- A. Volume of Solution. From 25 cc. for small amounts (i.e., .0005 g. ZrO₂). 200 cc. for amounts ranging around 0.1 g. ZrO₂.
 - B. Acidity. Twenty per cent. H₂SO₄ by weight.
- C. Hydrogen Peroxide. Sufficient to keep TiO₂ peroxidized; 10 cc. will do no harm.

¹ The method was sent to the editor by W. F. Hillebrand, U. S. Bureau of Standards, before it appeared in print and is published by his permission and by courtesy of the authors, G. E. F. Lundell and H. G. Knowles.

² Compt. Rend., Vol. 168, p. 349, 1919.

D. Precipitant. Secondary ammonium phosphate in excess. From 10 to 100 times the theoretical requirement as expressed by the ratio Zr: P₂C₅, should be used. The large excess is desirable when small amounts of ZrO₂ are determined.

E. Precipitation Conditions.

1. Temperature. Cold or tepid, preferably 40 to 50° C.

2. Time. Two hours for amounts of ZrO₂ in excess of .005 g. Six hours or longer for smaller amounts.

F. Filtration. Warm solution, decant as far as possible, to avoid clogging the filter.

G. Washing. This should be done with cold 5% NH₄NO₃, since the phosphate is appreciably soluble in pure water.

H. Ignition. Ignite very carefully in a partially covered platinum crucible over a low flame until carbon is destroyed, then blast or heat over a Méker burner for 15 minutes.

Determination as Zirconium Oxide

With pure salts the zirconium may be precipitated completely as the hydroxide by the addition of ammonia, settling and finally igniting and weighing as the oxide, ZrO₂.

Determination as Zirconium Oxide in the Presence of Iron Oxide 1

The aqueous solution of zirconium and iron free from other metals is treated with a slight excess of ammonia water and then boiled to remove the excess. The precipitated hydroxides are filtered off, washed with water, and dried at 105° C. The filtrate is evaporated to dryness, the residue taken up in hydrochloric acid and the solution again precipitated as before. The combined precipitates which have been dried to constant weight in a porcelain crucible are cooled and weighed as $ZrO_2 \cdot Fe_2O_3$. The oxides are then ground in a mortar, weighed into a platinum crucible and ignited to constant weight in a current of hydrogen. Only the iron is reduced to the metallic state, hence data are at hand for calculating the percentages of iron and zirconium.

Determination of Zirconium in Steel, U. S. Bureau of Standards Method


See chapter on Iron.

¹ Method of Gutbier and Hüller, Zeit. anorg. Chem., 32, 92.

Preparation of a Gooch Crucible

Asbestos Fibre.—The asbestos for use in Gooch crucibles should be carefully selected. The fibres should be moderately stiff, not the "cottony" type. Cut the fibre into pieces about \(\frac{1}{4} \) inch long. Ignite the asbestos in a platinum dish at low red heat. Cool and transfer to a clean porcelain mortar and mascerate to a pulp with strong hydrochloric acid. Dilute with water and transfer to a large beaker containing 600-800 cc. of water. Stir thoroughly, allow to settle and pour off the milky water. Repeat the washing with water until the milkiness, due to powdered fibres, is scarcely evident. Now filter off the asbestos onto a Buechner funnel. Again wash with water until free of acid. Transfer to a wide mouth bottle, add water in sufficient amount to form with the stirred up fibre a thin suspension of asbestos. This is now ready for use. If preferred the asbestos may be dried and kept in this form until desired.

Preparation of the Filter.—The Gooch crucible, either of platinum or porcelain, having a perforated bottom, is placed in a funnel tube and the apparatus set up as is shown in Fig. 74. The suction bottle holding the Gooch is attached to a second bottle, if a water filter pump is used to obtain the vacuum,

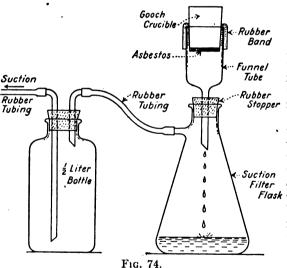

as there is danger of water being sucked into the apparatus from the tap. Suction is now applied and a small amount of the finely suspended asbestos is poured into the crucible. in amount sufficient to Stopper form a thin pad of the material about $\frac{1}{16}$ inch thick over the bottom of the Gooch. The felt is washed with distilled water, the asbestos drawn down hard. It is possible Flask to see light through the bottom of a properly made The crucible is filter. placed in an oven and the filter dried to constant weight at 110° C. BaSO₄ and AgCl determin-

ations it is advisable to make the filter about twice the above thickness to prevent the precipitate from passing through. Whenever the Gooch crucible is used, suction should be applied before pouring material into the crucible and the suction continued during the washing of the precipitate.

A very effective type of filter can be made by placing a perforated Witt plate $1\frac{1}{4}''-1\frac{1}{2}''$ in diameter into a 3-inch funnel, placing over this a paper filter that extends slightly beyond the plate, then after placing the funnel stem through the rubber stopper of the suction flask, apply suction, wet the paper filter, drawing it down on the plate. Pour a little paper pulp on the filter to close the edges of the filter. The material should now be filtered without breaking the suction.

VOL. I PART II QUALITATIVE TESTS OF SUBSTANCES



QUALITATIVE TESTS OF SUBSTANCES

BLOWPIPE AND FLAME TESTS OF SOLIDS

Blowpipe Tests on Charcoal

Heat a small portion of the material on charcoal in the reducing flame, using a blowpipe. Scoop out a round hole in the charcoal, place a little of the substance in the cavity, and direct the inner flame of the blowpipe against it at an angle of thirty degrees.

RESULT OF TEST.	Inference.
Melts and runs into the charcoal	Alkalies, K, Na, etc.
An alkaline residue on charcoal	Ca, Sr, Ba, Mg.
A residue which, when moistened with a drop of	
Co(NO ₃) ₃ and heated in O. F., produces a color	
which is blue	Aluminum, silicon.
Produces a color which is green	Zinc, tin, antimony,
Produces a color which is red	Barium.
Produces a color which is pink or rose-red	Manganese.
Deflagrates	Nitrates, chlorates.
Leaves an incrustation which is white near flame	Antimony.
White, garlic odor	Arsenic.
Dark red	Silver.
Red to orange	Cadmium.
Lemon yellow (hot), light yellow (cold)	Lead.
Orange yellow (hot), light yellow (cold)	Bismuth.
Yellow (hot), white (cold)	Zinc or tin, latter nonvolatile.

Blowpipe Tests. — Substance fused with Na₂CO₃ on Charcoal. Place a small amount of the substance on charcoal with a little sodium carbonate, and fuse, using reducing flame.

RESULT OF TEST.	Inference,
Metallic globules, without incrustation	
Yellow flakes	Gold.
Red flakes	Copper.
White globule, moderately soft	Silver.
Metallic globules, with incrustation	-
White, moderately soft beads	Lead or tin (volatilized lead leaves yellow coat).
White, brittle beads	Bismuth or antimony (yellowish).
Yellow in O. F.	Chromium.
Green in O. F.	Manganese.
A substance (in R. F.) which, when moistened and placed on a silver coin, leaves a brown or black	
stain	Sulphur compounds.

Test.	Inference.
Dark gray magnetic powder which, when moistened	
on a filter paper with a drop of dil. HCl and HNO,	
and gently dried over a flame, leaves a stain which	
is faint pink, turning blue	Cobalt.
Green stain, turning yellow	Nickel.
A stain turned blue by K ₄ Fe(CN) ₅	Iron.

In place of using charcoal the above tests may be made with a splinter of wood covered with a coating of fused Na₂CO₃. The test is made by dipping the heated splinter into a mixture of the powdered substance with fused sodium carbonate and plunging for a moment in the reducing flame. Examine the material on the splinter, scrape off on a piece of glazed paper and examine.

Blowpipe Test. Substance moistened with cobalt nitrate solution and ignited.

Color of Residue or Incrustation.	Inference.
Brick red	BaO
Pink	MgO
Gray	SrO, CaO.
Yellowish green	ZnO
Dark muddy green	Sb ₂ O ₅
Bluish green	SnO
Blue	Al ₂ O ₃ , SiO ₂

Flame Test

Flame Test. Moisten a platinum wire in conc. HCl, dip into the powdered substance and insert into a Bunsen flame. If sodium is prominent, examine through a blue glass. (Test the cobalt glass to see if it is effective in cutting out the yellow sodium light by examining a sodium flame through it.)

FLAME COLOR.	COLOR THROUGH BLUE GLASS.	ELEMENT.
Carmine red	Purple	Lithium
Dull red	Olive green	Calcium
Crimson	Purple	Strontium
Golden yellow	Absorbed	Sodium
Greenish yellow	Bluish green	Barium, molybdenum
Green		Cu , $-PO_4$, $-B_2O_3$,
Blue		Cu, Bi, Pb, Cd, Zn, Sb, As
Violet	Violet red	Potassium

The platinum wire should be cleaned before making the test. This can be accomplished by dipping it into cone. HCl and holding it in the Bunsen, or, better, a flame of a blast lamp, until the flame is no longer colored. Repeatedly dipping into the HCl may be necessary.

Examine the flame through a spectroscope, if available, and compare the spectra with a spectra chart. Mere traces of the alkali and alkaline earth metals can be detected in this way by their characteristic spectral lines.

Behavior of Substances fused with Microcosmic Salt and Borax Beads

are mostly changed to oxides. In the Table-h. signifies hot; c., cold; sups., supersaturated with oxide; s. s., to be examined, and heat again—first in the oxidizing flame; second in the reducing or inner flame. Metallic salts A clear bead is formed by fusing the flux on a loop of platinum wire. Dip the bead in the finely powdered substance strongly saturated; h. c., hot and cold.

Color of the		With Microcosmic Salt, Sodium Ammonium Hydrogen Phosphate.	With Sodium Tetraborate (Borax).	raborate (Borax).
Bead.	In outer or oxidizing Flame. In inner or reducing Flame.	In inner or reducing Flame.	In outer or oxidizing Flame. In inner or reducing Flame,	In inner or reducing Flame.
Colorless.	Si (swims undissolved). Al. Mg. Ca, Sr. Ba, Sn. (N. N., upuque). Ti. Zn, Cd, Pb, Bi, Sb (nul sat.).	Si (swims undissolved). Al, Mg, Ca, Sr, Ba (sups, not eleur). Ce, Mn, Sn.	h. c.: Si, Al, Sn (sups. opaque). Al, Mg, Sr, Ca, Ba, Ag (not sup. Sr, Ca, Ba, Ag (not sup. Sr, Ca, Ba, Mg, Ca, Ca, Ph. St. Tr, Mg	Si, Al, Sn (s. s. opaque). Alkaline earths and earths. h. c.: Wn, Ge. h.: Cu.
Yellow or Brownish.	h. (s. s.): Fe, U, Ce.	h.: Fe, Tl.	h., not sat.: Fe. U. h., sups.: Pb. Bi, Sb.	h.: Ti, Mo.
Red.	h. (8, 8.); Fe, Mi, Cr, Ce.	c.: Cu.	h.: Fe, Ce.	c.: Cu (sups. opaque).
Violet or Amethyst.	h. c.: Mn.	c: 71.	h, c.: Mn. $h.: Ni$ with Co.	c: Ti.
Blue.	h. c.: Co. c.: Cu.	h. e.; Co.	h. c.: Co.	h. c.: Go.
Green.	h.: Cu, Mo; Fe with Go or c.: Cr. c.: Cr. c.: Cr.	c.: Gr. h.: U, Mo.	c.: Cr. h.: Cu, Fe with Go.	Gr. sups.: Fe.
Gray and Opaque.		Ag, Pb, Sb, Cd, Bi, Zn, Ni.		The same as with micro-

GENERAL SUMMARY OF TESTS FOR ACIDS

ACIDS.	DETECTING REAGENTS.	REACTIONS RESULTING FROM TEST.
Acetates	H ₂ SO ₄ (conc.)	Odor of vinegar
Arsenates	(a) $(NH_4)_2MoO_4 + HNO_3$	Yellow precipitate
	(b) Magnesia mixture	White granular precipitate
	(c) Reduced on C+Na ₂ CO ₈	Garlic odor, arsenic mirror
Arsenit es	(a) Magnesia mixture	No reaction
	(b) H ₂ S+HCl	Yellow precipitate
Bromides	(a) H ₂ SO ₄ (conc.)	Red Br vapor
	(b) Chlorine water + CS,	Reddish color, due to Br
Borates	H ₂ SO ₄ (conc.) +alcohol	Green flame
Carbonates	Dilute acids	CO2 evolved. Limewater test
Chlorates	(a) H ₂ SO ₄ (conc.)	Explosive liberation of Cl + ClO
	(b) Heated alone	O given off
Chlorides	AgNO ₃ +HNO ₃	White precipitate, sol. in NH40
Chromates	(a) H ₂ SO ₄ (conc.)	O liberated (sol. yellow to green
	(b) HCl	Chlorine of HCl liberated
	(a) Alcohol + NaOH	Reduced and Cr(OH) ₃ precip
Cyanides	H ₂ SO ₄ (conc.)	HCN (POISON). Odor, bitte
Ferricyanides	FeSO ₄ +HCl	Turnbull's blue precipitate
Ferrocyanides	FeCl ₃ +HCl	Prussian blue precipitate
Fluorides	H ₂ SO ₄ (conc.)	IIF gas liberates silicic acid from
	color, (come)	glass rod with drop of H ₂ O
Hypochlorites	Dilute acids	Cl liberated, yellow gas
lodides	(a) H ₂ SO ₄ (conc.)	Violet vapor of iodine
	(b) Chlorine water + CS ₂	Violet color to CS ₂
Nitrates	FeSO ₄ + H ₂ SO ₄ (conc.)	Brown ring
Nitrites 1	Dilute acids	N ₂ O ₃ brown evolved
Oxalates	H ₂ SO ₄ (conc.)	CO+CO ₂ evolved
Permanganates	Reducing agents	Decolorized
Phosp hate s	HNO3+(NH4)2MoO4 at 40°	Yellow precipitate
Silicates	(a) Fused with Na ₂ CO ₃ and HCl added	Silicic acid precipitated
	(b) HF	SiF ₄ gas liberated
Sulphates	HCl+BaCl₂	White precipitate of BaSO4
Sulphides	Dil. acids	H ₂ S gas blackens Pb(C ₂ H ₂ O ₂)
Sulphites	Dilute acids	SO ₂ gas
Sulphocyanides	FeCla	Deep red color
Thiosulphates	Dilute acids	SO ₂ gas + free S
Tartrates	Ignited	Char. Odor of burnt sugar
Organic acids	Heated	Generally char.

¹ Nitrites + KI + CS₂ = violet color in CS₂ due to free I.

TABLES OF REACTIONS BASES AND ACIDS

631

TABLES OF REACTIONS OF THE BASES.

HYDROGEN CHLORIDE GROUP.

REAGENT.	LEAD, Pb(NO ₃);	Mercury, HgNO3.	SILVER, AgNO3.
Hvdrochloric acid, HCl.	Lead chloride, PbCl,, white ppt. Slightly sol. in cold water. Solubility in 100 c.c. H ₂ O,0° = 673 mg. 100° = 3340 mg. Converted into the insol. basic salt by NH ₄ OH.	Mercurous chloride, HgCl, white ppt. Sol. in hot HNOs and in aqua regia. NH4OH converts it to HgCl. NH2+ Hg. black. 100 c.c. H2O dissolves 0.31 mg. (cold), 10 mg. (hot).	Lead chloride, PbCl, white ppt. Slightly sol. in cold water. ppt. Sol. in hot HNOs and in aqua Insol. in acids. Sol. in NH4OH, Solubility in 100 c.c. H ₂ O,0° = 673 regia. NH4OH converts it to HgCl. KCN, and Na ₂ S ₂ O ₃ . AgCl darkens mg. 100° = 3340 mg. Converted NH ₂ + Hg, black. 100 c.c. H ₂ O distribution the insol. basic salt by solves 0.31 mg. (cold), 10 mg. (hot). H ₂ O, 0.152 ²⁰⁰ mg, 2.21 ⁶⁰⁰ mg.
Ammonium hydroxide, NH,OH.	(PbO) ₂ Pb(NO ₃) ₂ . Basic salt, white ppt. Insol. in excess. Only slightly sol. in water.	Mercuric ammonium salt and mercury. HgNH ₂ NO ₃ + Hg, black ppt. Insol. in excess.	Mercuric ammonium salt and mercury. HgNH ₂ NO ₃ + Hg, black ppt. Sol. ig excess. Sol. in KCN. 4.3 ²⁰⁰ Insol. in excess.
Hydrogen sulphide, H ₂ S.	Lead sulphide. PbS. black ppt. Insol in (NH4)2Sx. Sol. in HNO3. Cold water dissolves o.1 mg. Hot water, insol.	Lead sulphide. PbS. black ppt. Mercuric sulphide, HgS + Hg. Silver sulphide, Ag.S. black ppt. Insol in (NH4):Sx. Sol. in HNO3. black ppt. Slightly sol. in HNO3. Insol in (NH4):Sx. Sol. in hot Sol. in aqua regia. Insol. in water. HNO3, o oz mg. in cold water. Sol. water, insol.	Silver sulphide, Ag ₂ S, black ppt. Insol in (NH ₄) ₂ S _x . Sol. in hot HNO ₃ , o o2 mg. in cold water. Sol. in conc. H ₂ SO ₄ .
Potassium chro- mate, K ₂ CrO ₄ .	Lead chromate, PbCrO,, yellow ppt. Slightly sol. in HNO ₃ . Sol. in NH ₂ OH. Solubility 0.02 ¹⁸⁰ . Insol. in hot water and in acetic acid.	Potassium chro- Lead chromate, PbCrO, yellow Mercurous chromate, Hg2CrO, brick ppt. Slightly sol. in HNO3. Sol. red. Slightly sol. in HNO3. Sol. in aqua regia. Sol. in hot water and in acetic in KCN.	Silver chromate. Ag ₂ CrO ₄ , dark red ppt. Sol. in HNO ₃ and in NH ₄ OH. 2.81% mgs. in 100 c.c. H ₂ O. Sol. in KCN.

•	203				
Silver ferrocyanide, Ag.Fe(CN), yellowish white ppt. Insol. in acids and in NH4OH. Sol. in KCN.	Silver carbonate, Ag ₂ CO ₃ , white ppt. Sol. in NH ₄ OH, 3.110°, 50 mg. at 100° in H ₂ O. Sol. in Na ₂ S ₂ O ₄ .	Silver oxide, Ag ₂ O, brown ppt. Sol. in NH ₄ OH and in HNO ₃ . 4.3 mg. at 20° in H ₂ O. Sol. in KCN.	Sol. in Mercury, Hg. dark gray ppt. Sol. Silver chloride, AgCl, white ppt. in HNO ₃ , conc. H ₅ SO ₄ . Insol. in (See above.)	Mercurous sulphate, Hg ₂ SO ₄ , white Silver sulphate, Ag ₂ SO ₄ , white ppt. ppt. Slightly sol. in water, 200 mg. Formed only in conc. solutions. Sol. in H ₂ SO ₄ , HNO ₃ . Insol. in alkalies. Sol in H ₂ SO ₄ and in HNO ₃ . 580 mg. in H ₂ O ₄ .	Insoluble salts, AgBr, AgI. Ag is displaced from its salts in crystalline form by Zn, Cu, Hg, and in gray form by SO ₂ , SnCl ₂ , FeSO ₄ , etc. Ag sol. in HNO ₃ . Insol. in alkalies.
Mercurous ferrocyanide, Hg,Fe(CN)s, white ppt.	Basic salt, yellow ppt, becoming black.	Lead hydroxide, Pb(OH) ₂ , white ppt. Sol. in excess. Sol. in Sol. in HNO ₃ . Insol. in NH ₄ OH. Sol. and alkalies. Sol. in glacial acetic in KOH. Slightly sol. in water.	Mercury, Hg, dark gray ppt. Sol. in HNO ₂ , conc. H ₂ SO ₄ . Insol. in HCl.	Mercurous sulphate, Hg ₂ SO ₄ , white ppt. Slightly sol. in water, 200 mg. Sol. in H ₂ SO ₄ , HNO ₃ .	Zn ppts. Pb in crystalline form. Pb Pptd. in acid solutions by Cu, Zn, sol. in HNO3. Hot conc. H ₂ SO ₄ . from its salts as metallic Hg. SO ₄ reduces mercurous salts to Hg, which collects as globules on boiling solution. Hg sol. in HNO ₃ . Insol. in HCl.
Lead ferrocyanide, Pb.Fe(CN), 'Mercurous ferrocyanide, whiteppt. Insol. in cold water. Hg.Fe(CN), white ppt.	Basic lead carbonate, 2 PbCO ₃ · Pb(OH), white ppt., "white lead." Insol. in hot and cold water.	Lead hydroxide, Pb(OH), white ppt. Sol. in excess. Sol. in HNO ₃ . Insol. in NH ₄ OH. Sol. in KOH. Sightly sol. in water.	Stannous chloride, Lead chloride, PbCl. Sol. in SaCl	Lead sulphate, PbSO ₄ , white ppt. Insol. in excess. Slightly sol. in HNO ₃ . Sol. in NaOH, NH ₄ C ₂ H ₃ O ₂ . 4.2 at 20 ² .	Zn ppts. Pb in crystalline form. Pb sol. in HNO3. Hot conc. H2SO4.
Potassium ferro- cyanide, K ₄ Fe(CN).	Sodium carbon- ate, Na ₂ CO.	Sodium hydrox- ide, NaOH.	Stannous chloride, SaCl ₂ .	Sulphuric acid, H ₂ SO ₄ .	Miscellany.

The numerals indicate milligrams of the substance that will dissolve in 100 c.c. of water at stated temperature. Reference to Van Nostrand's Chemical Annual, edited by Olsen.

THE HYDROGEN SULPHIDE GROUP.

Insoluble Subgroup.
Sol. = Soluble. Insoluble.

Mercury (= ic), HgCls.	Mercuric sulphide, HgS, white → yellow → red → brown → black. Insol. in HNO ₃ , (NH4),S _x . Sol. in Br + KClO ₃ or aqua regia, Na ₂ S. Cold H ₂ O, 2.5 mg.	Amido mercuric chloride, HgNH ₂ Cl, white ppt.	Mercuric chromate, HgCrO ₄ , reddish yellow ppt. Sol. in HNO ₈ . Slightly sol. in water.	Hg(CN) ₂ . Sol. in water.
COPPER, CuSO4.		Basic copper, Ammonium sulphate. Sol. in excess = a deep blue. Cu(NH ₂), "SQ," .H ₂ O, characteristic test.	Copper chromate, CuCrO _t , reddish brown H ppt. Sol. in NH ₂ OH, forming a green solution.	le, Cu(CN); w ppt. = N); No
CADMIUM, CdSO4.	Bismuth sulphide, Bi ₂ S ₃ , Cadmium sulphide, CdS, Copper sulphide, CuS, brown ppt. Sol. in HNO ₃ , yellow ppt. Sol. in HNO ₃ , Insol. in (NH ₄) ₂ S _x and in KCN. Cold water 100 c. in (NH ₄) ₂ S _x , KCN. Cold (NH ₄) ₂ S _x . Insol. in dissolves 0.018 mg. H ₂ O ₄ o.13 mg. H ₂ O ₄ (hot dil.). Cold forms coloidal solution.	Cadmium hydroxide, Cd(OH) ₂ , white ppt. Sol. in excess. Insol. in water, e.g. 0.26 ²⁵⁰ mg. Sol. in NH ₄ salts.	Basic chromate, Cd ₂ (OH) ₂ CrO ₄ , yellow. Insol. in NaOH.	Cadmium cyanide, Cd(CN), white ppt. Sol. in excess, = Cd(CN), (KCN), From Cu(CN), (HC), this H ₂ S ppts. Cd:S, yellow.
Віѕмотн, ВіСія.	Bismuth sulphide, Bi ₂ S ₃ , brown ppt. Sol. in HNO ₃ . Insol. in (NH ₄) ₂ S _x and in KCN. Cold water 100 c.c. dissolves 0.018 mg.	Bismuth hydroxide, Bi(OH)3, white ppt. In- sol. in excess. Changed by boiling to Bi ₂ O ₃ . Insol. in H ₂ O. Insol. in alkalies.	Bismuth chromate, (BiO) ₂ CrO ₄ , yellow ppt. Cd ₂ (OH) ₂ CrO ₄ , yellow. Sol. in HNO ₄ . Insol. in Insol. in NaOH. KOH. (See Pb.)	
REAGENT.	Hydrogen sul- phide, H ₂ S.	Ammonium hydroxide, NH,OH.	Potassium chromate, K ₂ CrO ₄ .	Potassium cya- nide, KCN.

·	Mercuric basic carbonate, HgCO ₈ (HgO) ₈ , reddish brown ppt. Changed to yellow HgO on boiling. Insol. in H ₃ O.	Mercuric hydroxide, Hg(OH) ₂ . Easily changed to HgO, yellow. Insol. in excess. In presence of NH ₄ Cl = HgNH ₂ Cl, white ppt.	No precipitate.	Murcurous chloride, HgCl, white ppt. In ex- cess = gray, Hg.	Precipitated by Cu. KI ppts. Hgl,, red. Sol. in excess. Hg sol. in HNO,, conc. H ₂ SO ₄ . Insol. in HCl.
Copper ferrocyanide, Cu ₂ Fe(CN) ₆ , reddish brown pp. Slightly sol. in NH ₄ OH. Insol. in acids.	Basic copper carbonate, Cu ₂ (OH) ₂ CO ₄ , blue. Changed to black CuO on boiling.	Copper hydroxide. Cu(OH)s, light blue. Insol. in excess. Changed to black CuO on boiling.	No precipitate.	Cuprous chloride, CuCl, white ppt. Sol. in HCl, NHs aq., NH4Cl. Insol. in H2O.	Na ₂ HPO ₄ precipitates Cu ₂ (PO ₄) ₂ , greenish blue. Sol. in NH ₂ OH. KI ppts. Cu ₂ I ₃ , white + I = brown. Cu sol. in HNO ₂ , hot conc. H ₂ SO ₄ .
Cadmium ferrocyanide, Cd.Fe(CN)a, yellowish white ppt. Sol. in HCl. Insol. in H ₂ O.	Cadmium carbonate, CdCO3, white ppt. Insol. in excess. Sol. in NH4OH. Sol. in acids.	Cadmium hydroxide, Cd(OH)3, white ppt. Insol. in excess. (See above.)	No precipitate.		Na,HPO, ppts. Cd.(PO,), white. Sol. in NH,OH and in dilute acids. Cd sol. in acids. Sol. in NH,NO,
Jismuth ferrocyanide, Bi,(Fe(CN) ₆),, white ppt. Insol. in HCl.	Basic bismuth carbon- ate, (BiO)2CO3, white ppt. Insol. in water. Sol. in acids. Insol. in Na ₂ CO ₃ .	Bismuth hydroxide, Bi(OH)s, white ppt. See above.	* No precipitate.	Darkens. Precipitate of BiOOH changes to Bi ₂ O ₃ .	In water Bi salt precipitates as BiOCI, white. Reduced by Na,SnO, to metallic Bi, black. Bi sol. in HNO, conc. H ₂ SO ₄ .
Fotassium ferrocyanide, K ₄ Fe(CN) ₆ .	Sodium carbonate, Na ₂ CO ₃ .	Sodium hydroxide, NaOH.	Sulphuric acid, H ₂ SO ₄ .	Stannous chloride, SnCl ₂ .	Miscellany.

• A precipitate forms on long standing.

The Soluble HeS

	Arsenic, As····, As·····.		Antimony, Sb., Sb.,		
	(ous) K ₃ AsO ₃ .	(ic) KH ₂ AsO ₆ .	(ous) SbCl ₃ .	i (ic) KSbO ₃ .	
Hydrogen sulphide, H ₂ S.	Arsenic trisulphide, As ₂ S ₃ , yellow ppt. Sol. in alkalies, (NH ₄) ₂ S _x , (NH ₄) ₂ S. Insol. in conc. HCl.	Arsenic trisul- phide + S. As ₂ S ₃ + S ₂ , yel- low. The ppt. forms slowly by heat.	Antimony trisulphide, Sb ₂ S ₃ , orange ppt. Sol. in alkalies, (NH ₄) ₂ S ₃ , (NH ₄) ₂ S, HCl (conc.). 0.17 mg.	Antimony penta- sulphide, Sb ₂ S ₄ , orange ppt. Sol. in alkalies, (NH ₄) ₂ S _x , (NH ₄) ₂ S, HCl (conc.).	
Ammonium hydroxide, NH ₄ OH.			Antimonious hydroxide, Sb(OH) ₃ , white ppt. Sol. in excess.	Ammonium metantimonate, NH ₄ SbO ₃ . Very slightly sol. in excess.	
Copper sulphate, CuSO ₄ .	Copper arsenite, CuHAsO ₃ , yel- lowish green ppt. Sol. in NH ₄ OH, NaOH, HNO ₃ .	Copper arsenate, Cu ₃ (AsO ₄) ₂ , greenish blue ppt. Sol. in NH ₄ OH and in HNO ₃ .	Antimony oxy- chloride, white, SbOCl, caused by dilution. Insol. alk. Sol. HCl, CS ₂ .	Copper antimonate, brown ppt.	
Mercuric chloride, HgCl ₂ .	Mercuric arse- nite,Hg ₃ (AsO ₄) ₂ , white ppt. Sol. in acids.		Antimony oxy- chloride, caused by dilution. Sol. in conc. HCl.		
Silver ni- trate, AgNO ₃ .	Silver arsenite, Ag ₃ AsO ₃ , yellow ppt. Sol. in HNO ₃ , NH ₄ OH, HC ₂ H ₃ O ₂ .	Silver arsenate, Ag ₃ AsO ₄ , red- dish brown ppt. Sol. in HNO ₃ and NH ₄ OH.	Silver chloride and antimony trioxide, AgCl+Sb ₂ O ₃ , white ppts.	Silver antimo- nate. Ag ₂ SbO ₃ , white ppt. Sol. in NH ₄ OH.	
Miscellany.	Magnesia mix- ture. No ppt. Arsenic sol. in HNO ₃ , Cl ₂ , H ₂ O, aq. reg., hot alkalies.	Magnesia mix- ture ppts. MgNH ₄ AsO ₄ , white crys. ppt. Sol. in acetic acid.	KOH ppts. Sb(OH) ₃ . Na ₂ CO ₃ ppts. Sb(OH) ₃ .	Sb. sol. in hot conc. H ₂ SO ₄ and in aq. reg.	
	Marsh test (Zn + HCl, etc.)	AsH ₃ flame deposits arsenic. Sol. in NaOCl. Sol. in (NH ₄) ₂ S. Residue insol. in HCl (conc.).	Marsh test (Zn + HCl).	SbH ₃ in flame deposits anti- mony. Insol. in NaOCI.	

^{*} See Van Nostrand's Chemical Annual for solubility of salts.

Subgroup.

Tin, Sn", Sn"		PLATINUM, Pt	Gold, Au	
(ous) SnCl ₂ .	(ic) SnCl ₄ .	PtCl4.	Au Cla.	
Stannous sulphide, SnS, dark brown. Sol. in alkalies. Difficultly sol. in (NH ₄) ₂ S _x . Sol. in HCl (conc.). 100 c.c. H ₂ O diss. 0.002 mg.	Stannic sulphide, SnS ₂ , yellow ppt. Sol. in alkalies, (NH ₄) ₂ S _x , (NH ₄) ₂ S and alkali carbon- ates. HCl (conc.). H ₂ O=0.02 mg.	Platinic sulphide, PtS ₂ , dark brown ppt. Difficultly sol. in alkali sul- phides. Sol. in aqua regia. Insol. in HCl (conc.).	Gold sulphide, Au ₂ S ₃ , black ppt. Sol. in alkali sul- phides, aqua regia. Insol. in HCl (conc.).	
Stannous hydroxide, SnO(OH): Insol. in excess. Darkens on cooling. Insol. in H ₂ O. Sol. in dilute acids, alk.	Stannic hydroxide, Sn(OH) ₄ . Slightly sol. in excess.	Ammonium chlo- roplatinate, (NH ₄) ₂ PtCl ₆ , yel- low ppt. Sol. in large excess. 679 ²⁰⁻⁹ mg.	Fulminating gold, Au ₂ O ₃ . 2 NH ₃ , yellow ppt., Insol. in excess.	
Cuprous chloride, 2 CuCl, white ppt. Sol. in acids. Reduction by SnCl ₂ .				
Mercurous chloride, HgCl, white ppt. Insol. in cold HCl (conc.). Reduction by SnCl ₂ .				
Silver chloride and silver, AgCl + Ag. Reduction by SnCl ₂ .	Silver chloride, AgCl.	Silver chloride and platinum oxide, AgCl + PtO, brown ppt.	Silver chloride and gold oxide, AgCl + Au ₂ O ₃ , brown ppt.	
KOH ppts. Sn(OH) ₂ , Na ₂ CO ₁ ppts. Sn(OH) ₂ . Insol. in excess.	KOH ppts. Sn(OH) ₂ . NaCO ₃ ppts. Sn(OH) ₂ . Insol. in excess.	KOH ppts. K ₂ PtCl ₆ . Na ₂ CO ₃ gives no ppt. Pt sol. in aq. r., fused alk.	SnCl ₂ solution ppts. "Purple of Cassius," red ppt. Au sol. in KCN, aq. reg.	
Metallic Sn deposited by Zn in Marsh test.	Stannic salts reduced by H, gen- erated by Sn.	Zn ppts. Pt, black, from its salts. Also see Electro- motive Series, p. 10.	Zn ppts. Au from its salts.	

The Ammonium Sulphide Group.

	A A)	······································	2	Ē
REAGENT,	in the support	. 10 (10)	ARON, FC .	. 64
	Al, K, (SO,),.	Cr ₂ K ₂ (SO ₄)4.	· FERROUS, PeSO.	FERRIC, FeCl.,
Ammonium sulphide, (NH ₄) ₂ S.	Aluminum hydroxide, Al(OH) ₈ , white flocculent ppt. Sol. in acids. H ₂ S gas liberated.	Chromium hydroxide, Cr(OH)3, grayish green, ppt. H ₂ S liberated. Sol. in acids and alkalies.	Iron sulphide, FeS, black ppt. sol. in acids. Oxidizes in the air to FeSO ₄ and finally to a brown basic ferric sulphate. 0.89 mg.	Iron sulphide, FeS(+S), black ppt. Sol. in acids. S remains undissolved.
Ammonium hydroxide, NH ₄ OH.	Aluminum hydroxide, Al(OH)3, white. Very slightly sol. in excess of reagent.	Chromium hydroxide, Cr(OH)3, grayish green. Slightly sol. in excess, forming a reddish solu- tion when cold and concentrated.	Ferrous hydroxide, white ppt. becoming green, then reddish brown, in the air and in presence of NH ₄ Cl. Fe(OH) ₃ slowly forms. Sol. in NH ₄ Cl. 6.7 mgs.	Ferric hydroxide, Fe(OH)s, reddish brown ppt. Insol. in excess of reagent.
Ammonium carbonate, (NH ₄) ₂ CO ₈ .	Aluminum hydroxide, Al(OH)3, white ppt. CO ₂ gas.	Chromium hydroxide, Cr(OH) ₃ , grayish green. Sol. in excess of reagent CO ₂ liberated.	Ferrous carbonate, FeCO ₃ , white ppt. sol. in excess. Slowly changed to hydroxide.	Basic salt changing to Fe(OH)s, reddish brown ppt.
Barium carbonat e, BaCO ₈ .	Aluminum hydroxide, Al(OH)3, white.	Basic salt, CO ₂ , liberated, and Cr(OH) ₈ formed.	Iron not pptd. in ferrous form by BaCOs.	Same as above.
Borax bead, Na ₂ B ₄ O ₇ ··10 H ₂ O.	·	OF, yellowish green when hot, changing to emeraldgreen, cold.	OF, yellow. RF, green.	OF, yellow. RF, green.
Hydrogen sulphide, H ₂ S.		-	In presence of sodium acetate, FeS pptd.	Ferr reduced to Ferwith liberation of free S. (Also reduced by SnC1.)

	blue.	αw	i.e)s. red	
Keddish brown color produced.	Ferric ferrocyanide, Fe ₄ (FeC ₆ N ₈) ₃ , (Prussian blue), dark blue. Insol. in mineral acid. NaOH forms Fe(OH) ₈ +.	• Ferric hydroxide, Fe(OH) ₃ , reddish brown ppt. Insol. in excess. Sol. ín mineral acids.	FePO4, yellowish white, scl. in excess. Insol. in HC ₂ H ₈ O ₂ .	KCNS = red Fe(SCN)s. Boiling with NaC, HsO; in neutral solutions a red brown ppt. formed of Fe(OH)s(C, HsOs).	itation.
Ferrous ferricyanide (Tumbull's blue), Fes(FeCeNe), dark blue ppt. Insol. in HCl. De- composed by NaOH to Fe(OH),	Potassium ferrous ferrocyanide, K ₂ Fe ₃ (FeC ₆ N ₆) ₂ , bluish white, oxidized in air to blue.	• Ferrous hydroxide, Fe(OH), white becoming Fe(OH), Insol. in excess. Non-volatile organic substance prevents pption.	Fe ₃ (PO ₄), white ppt. becoming blue in the air.	KCNS, no color. KCN ppts. Fe(CN), brown. Sol. in excess.	* Presence of non-volatile organic substances, tartrates, citrates, and sugar prevents precipitation
(All Cr compounds or oxidized to compounds of chromic acid; e.g. 2 Na ₂ CO ₂ + 3 KNO ₂ + 2 Cr(OH) ₃ = 2 Na ₂ CrO ₄ + etc.)		*Chromium hydroxide, Cr(OH)3, greenish ppt. Sol. in excess, forming green solution NaCrO ₂ . Repptd. by boiling or by addition of NH ₄ Cl.	CrPO ₄ , green ppt. Sol. in mineral acids and in NaOH.	NaC ₂ H ₈ O ₂ forms no ppt. unless Fe and Al are present, in which case Cr partially pptd. by boiling.	mic substances, tartrates, citr
	White ppt. forms slowly.	• Aluminum hydroxide, Al(OH)s, white. Sol. in excess, forming Na's - AlOs" (NaAlO2). Repptd. by NH4Cl.	AlPO4, white. Sol. in NaOH. Insol. in HC ₂ H ₃ O ₂ .	Sodium acetate in excess boiled with Al salt ppts. basic Al(OH) ₂ (C ₂ H ₃ O ₂) in neutral solutions.	* Presence of non-volatile orga
Potasslum ferricyanide, KaFe(CN)e.	Potassium ferrocyanide, K ₄ Fe(CN)•	Sodium hydroxid e, NaOH.	Sodium phosphate, Na ₂ HPO ₄ .	Miscellany.	

REACTIONS OF THE BASES

The Ammonium Sulphide Group.

		REA(TIONS OF	THE	SASES		
Fe	FERRIC, FeCls.	Iron sulphide, FeS(+S), black ppt. Sol. in acids. S remains undissolved.	Ferric hydroxide, Fe(OH), reddish brown ppt. Insol. in excess of reagent.	Basic salt changing to Fe(OH)3, reddish brown ppt.	Same as above.	OF, yellow. RF, green.	Ferr reduced to Fer with liberation of free S. (Also reduced by SnCl ₂ .)
Iron, Fe	FERROUS, PeSO4.	Iron sulphide, FeS, black ppt. sol. in acids. Oxidizes in the air to FeSO ₄ and finally to a brown basic ferric sulphate. 0.89 mg.	Ferrous hydroxide, white ppt. becoming green, then reddish brown, in the air and in presence of NH ₄ Cl. Fe(OH) ₃ slowly forms. Sol. in NH ₄ Cl. 6.7 mgs.	Ferrous carbonate, FeCO ₃ , white ppt. sol. in excess. Slowly changed to hydroxide.	Iron not pptd. in ferrous form by BaCO ₃ .	OF, yellow. RF, green.	In presence of sodium acetate, FeS pptd.
Снвомии, Сг	Cr ₂ K ₂ (SO ₄) ₄ .	Chromium hydroxide, Cr(OH)3, grayish green, ppt. H ₂ S liberated. Sol. in acids and alkalies.	Chromium hydroxide, Cr(OH)3, grayish green. Slightly sol. in excess, forming a reddish solu- tion when cold and concentrated.	Chromium hydroxide, Cr(OH), grayish green. Sol. in excess of reagent CO, liberated.	Basic salt, CO ₂ , liberated, and Cr(OH) ₈ formed.	OF, yellowish green when hot, changing to emeraldgreen, cold.	
ALUMINUM, Al	Al ₃ K ₂ (SO ₄) ₄ .	Aluminum hydroxide, Al(OH)3, white flocculent ppt. Sol. in acids. H ₂ S gas liberated.	Aluminum hydroxide, Al(OH)3, white. Very slightly sol. in excess of reagent.	Aluminum hydroxide, Al(OH) ₃ , white ppt. CO ₂ gas.	Aluminum hydroxide, Al(OH) ₈ , white.		
	REAGENT.	Ammonium sulphide, (NH ₄) ₂ S.	Ammonium hydroxide, NH4OH.	Ammonium carbonate, (NH ₄) ₂ CO ₃ .	Barium carbonate, BaCO ₈ .	Borax bead, Na ₂ B ₄ O ₇ . 10 H ₂ O.	Hydrogen sulphide, H ₂ S.

Reddish brown color produced.	Ferric ferrocyanide, Fe ₄ (FeC ₆ N ₆) ₂ , (Prussian blue), dark blue. Insol. in mineral acid. NaOH forms Fe(OH) ₈ +.	• Ferric hydroxide, Fe(OH)3, reddish brown ppt. Insol. in excess. Sol. in mineral acids.	FePO, yellowish white, scl. in excess. Insol. in HC ₂ H ₈ O ₂ .	KCNS = red Fe(SCN)s. Boiling with NaC ₂ HsO ₂ in neutral solutions a red brown ppt. formed of Fe(OH) ₂ (C ₂ HsO ₂).
Ferrous ferricyanide (Tumbull's blue), Fe ₂ (FeC ₆ N ₆), dark blue ppt. Insol. in HCl. De- composed by NaOH to Fe(OH);	Potassium ferrous ferrocyanide, K.F.Fe.(Fe.G.N.e.)., bluish white, oxidized in air to blue.	• Ferrous hydroxide, Fe(OH), white becoming Fe(OH), Insol. in excess. Non-volatile organic substance prevents pption.	Fe ₈ (PO ₄),, white ppt. be- coming blue in the air	KCNS, no color. KCN ppts. Fe(CN), brown. Sol. in excess.
(All Cr compounds oxidized to compounds of chromic acid; e.g. 2 Na ₂ CO ₃ + 3 KNO ₃ + 2 Cr(OH) ₃ = 2 Na ₂ CrO ₄ + etc.)		• Chromium hydroxide, Cr(OH)3, greenish ppt. Sol. in excess, forming green solution NaCrO ₂ . Repptd. by boiling or by addition of NH ₄ Cl.	CrPO, green ppt. Sol. in mineral acids and in NaOH.	NaC ₅ H ₅ O ₅ forms no ppt. unless Fe and Al are present, in which case Cr partially pptd. by boiling.
	White ppt. forms slowly.	*Aluminum hydroxide, Al (OH)3, white. Sol. in Cr(OH)3, greenish ppt. Sol. in excess, forming Na's - AlO3". (NaAlO2). Repptd. by NH4Cl. Repptd. by NH4Cl.	AlPO,, white. Sol. in NaOH. Insol. in HC ₂ H ₂ O ₂ .	Sodium acetate in excess boiled with Al salt ppts. basic Al(OH), (C2H3O2) in neutral solutions.
Potasstum ferricyanide, KeFe(CN)e	Potassium ferrocyanide, K ₄ Fe(CN) ₆ .	Sodium hydroxide, NaOH.	Sodium phosphate, Na ₂ HPO ₄ .	Miscellany.

* Presence of non-volatile organic substances, tartrates, citrates, and sugar prevents precipitation.

The Ammonium Sulphide Group — Continued

	I.	EACTIONS	OF THE	BASE	 -	
ZINC, ZnSOL	Zinc sulphide, ZnS, white ppt. Insol. in HC,H ₃ O ₂ . Sol. in HCl. Presence of NH ₄ Cl aids pption.	Zinc hydroxide, Zn(OH)s, white ppt. Sol. in excess, ZnSO ₄ (NH ₃), formed. In presence of NH ₄ Cl no ppt. forms.	Basic zinc carbonate, usually Zn ₂ (OH) ₂ CO ₃ , white ppt. Sol. in excess. (Acid carbonate ppts. ZnCO ₃ white.)	No pption. in cold. (Na ₂ CO ₃ ppts. above aided by boiling.)		From neutral or alkaline solutions, or in solutions acidified with HC ₂ H ₃ O ₃ . ZnS is pptd.
MANGANESE, MESO4.	Manganese sulphide, MnS, buff-colored ppt. Sol. in HCl, HC ₂ H ₂ O ₃ . Oxidizes in the air. o.6 mg.	Manganese hydroxide, Mn(OH) ₂ , white ppt. turning brown. In presence of NH ₄ Cl a dark brown ppt. slowly forms by oxidation, Mn(OH) ₃ .	Manganese carbonate, MnCO ₃ , white ppt. Sol. in excess. Boiling aids pption.	No ppt. in cold.	OF, violet-red, hot. Amethyst-red, cold. RF, colorless.	MnS forms slowly from alkaline solutions. No ppt. in acid solutions.
NICKEL, NICI,	Nickel sulphide, NiS, black ppt. Slightly sol. in excess, forming a brown solution. Very slightly sol. in HCl. Sol. in aqua regia. 0.36 mg.	Nickel hydroxide, Ni(OH)3, green ppt. Sol. in excess, forming a blue solution. No ppt. formed in presence of NH ₄ Cl.	Basic carbonate of variable compositions, green ppt. Sol. in excess.	No ppt. in cold.	Violet, hot. Yellowish brown, cold.	From neutral or alkaline solutions, NiS. No ppt. in acid solutions.
COBALT, CoCl,	Cobalt sulphide, CoS, black ppt. Insol. in HC ₂ H ₃ O ₂ . Very slightly sol. in HCl. Sol. in aqua regia and warm HNO ₃ . o.38 mg.	Blue basic salt, sol. in excess, forming red solution. No ppt. formed in presence of NH ₄ Cl. Solution becomes red.	Basic carbonate, red, lilac, or pink ppt. Sol. in excess, forming red solu- tion, becoming brown by air oxidation.	No ppt. in cold.	Blue.	From neutral or alkaline solutions, CoS, black. No ppt. in acid solutions.
REAGENT.	(NH ₁) ₂ S.	NH,OH.	(NH ₄) ₂ CO ₈ .	BaCO ₈ .	Borax bead.	H.S.

KeFe(CN)e.	Cobalt ferricyanide, Cos(FeCeNe)2, dark brown ppt. Insol. in HCI.	Nickel ferricyanide Ni,(FeCaNa), yellowish green ppt. Insol. in HCl.	Manganese ferricyanide, Mns(FeCeNs)2, brown ppt. Insol. in HCl.	Zinc ferricyanide, Zn ₃ (FeC ₆ N ₆) ₂ , yellowish brown ppt. Sol. in HCl and in NH ₄ OH.
K ₄ Fe (CN)6.	Cobalt ferrocyanide, CosFe(CN)s, green ppt. becoming greenish blue. Insol. in HCl. Sol. in KCN.	Nickel ferrocyanide, Ni ₂ Fe(CN) ₆ , light green ppt. Insol. in HCl.	Manganese ferrocyanide, MnsFe(CN), faint red ppt. Diff. sol. in HCl. Easily sol. in H ₂ SO ₄ , HNO ₃ .	Zinc ferrocyanide, Zn.Fe(CN), white ppt. Insol. in dilute acids and in NH4OH.
NaOH.	Basic salt, blue. Boiled with excess = red. Insol. in excess. Sol. in HC ₂ H ₃ O ₂ , HCl, NH ₄ OH.	Nickel hydroxide, Ni(OH), apple green ppt. Insol. in excess. Sol. in HC,HsO, HCl. NH,OH. Oxidized by Br to Ni (OH).	Manganese hydroxide, Mn(OH), white ppt. turning brown. Insol. in excess. Sol. in NH ₄ Cl.	Zinc hydroxide, Zn(OH)3, white ppt. Sol. in excess, forming Na ₂ ZnO ₂ . Repptd. by boiling.
Na ₂ HPO ₄ .	Co.(PO.)., blue ppt. Sol. in NH.OH. Sol. in dil. acids. Sol. in H,PO.	Ni,(PO ₄), green ppt. Sol. in NH,OH. Sol. in dil. acids.	Mn ₂ (PO ₁), white ppt. Sol. in NH ₁ OH, mineral acids, and HC ₂ H ₃ O ₂ . Boiled with NH ₁ OH + NH ₄ Cl = MnNH ₁ PO ₄ , rose colored.	Zn ₁ (PO ₄) ₂ , white ppt. Sol. in excess and in dil. acids and in NH ₄ OH.
Miscellany.	HCN ppts. reddish brown, Co(CN). Sol. in excess. Addition of Br+NaOH = K ₃ Co(CN). Co not pptd. (Ni is pptd.)	HCN ppts. greenish yellow, Ni(CN). Sol in. excess. Repptd. by HCl. Pptd. by Br + NaOH as Ni(OH)s. black + CNBr (poison gas).	PbO ₂ + HNO ₃ + Mn salt warmed = red HMnO ₄ . Na ₂ CO ₃ + KNO ₃ fused on Pt = green, Na ₂ MnO ₄ .	KCN ppts. Zn(CN); white. Sol. in excess. From this solution (NH ₄); S ppts. ZnS, white.

For solubility of salts, see tables in D. Van Nostrand's Chemical Annual, edited by Olsen.

The Ammonium Carbonate Group

Solubility in milligrams per 100 c.c. of water cold, "c", and hot, "h".

	or NH.	arbon- (OH), ng. No I, salts absent, mgs.	ide,	· -		
	SOLUBLE IN PPERENCE OF NH, SALTS. MAGNESIUM, MgSO.	Basic magnesium carbon- ate MgCO ₃ + Mg(OH) ₃ , white ppt. on warming. No ppt. formed if NH ₄ salts are present. But if absent, solubility only 10.6 mgs.	Magnesium hydroxide, Mg(OH) ₂ . Sol. in NH ₄ Cl.	·		
old, c , and not, 11 .	STRONTIUM, SrClg.	Strontium carbonate, SrCO ₈ , white ppt. Sol. in acids. Slightly sol. in NH ₄ Cl. Rendered less sol. by boiling with excess of NH ₄ OH. "c" 1.1 mg.		Strontium oxalate, SrC ₂ O ₄ , white ppt. Sol. in HCl. Slightly sol. in HC ₂ H ₃ O ₂ and water. "c" 5.1 mg. Sol. in hot solutions.	Strontium sulphate, SrSO,, white ppt. Slightly sol. in H ₂ O and in (NH ₄) ₂ SO ₄ . "c" 11.4 mg.; "h" 10.4 mg.	
Solubility in minigrams per 100 e.e. or water cold, e., and not, n.	CALCIUM, CACIP.	white ppt. Sol. in acids. white ppt. Sol. in acids. Sightly sol. in NH ₄ Cl. Slightly sol. in NH ₄ Cl. Rendered less sol. by boil- NH ₄ Cl. Rendered less cess of NH ₄ OH and by ing with NH ₄ OH. "c" 1.3 sol. by boiling with exboiling. "c" 2.2 mg.; "h" 88 mg. mg.		Calcium oxalate, CaC ₂ O ₄ white ppt. Sol. in HCl. Almost insol. in HC ₂ H ₃ O ₂ or in H ₂ C ₂ O ₄ . "c" o.68 ng.; "h" 14 mg.	Calcium sulphate, white Strontium sulphate, SrSO,, ppt. Somewhat sol. in white ppt. Slightly sol. H ₂ O. Sol. in (NH ₄) ₂ SO ₄ . in H ₂ O and in (NH ₄) ₂ SO ₄ . In Sol. in alcohol. "c" 179 "c" 11.4 mg.; "h" 10.4 mg.; "h" 178 mg.	
Solubinty in in	Barium, BaClp.	Barium carbonate, BaCOs, white ppt. Sol. in acids. Slightly sol. in NH ₄ Cl. Precipitation aided by excess of NH ₄ OH and by boiling. "c" 2.2 mg.; "h" 6.5 mg.		Barium oxalate, BaC ₂ O ₄ , white ppt. Sol. in HCl. Slightly sol. in HC ₂ H ₃ O ₂ and water. "c" 9.3; "h" 22.8.	Ammonium sul-Barium sulphate, BaSO,, phate, (NH4) ₂ SO,, white ppt. Insol. in H ₂ O or sulphuric acid, and in acids. "c" 0.17 H ₂ SO ₄ .	Barium chromate, BaCrO ₄ , yellow ppt. Insol. in HC ₄ H ₃ O ₄ in presence of K ₂ CrO ₄ . Sol. in HCl, HNO ₃ . "c" o.38 mg.;
	REAGENT.	Ammonium carbonate, (NH4)2CO3.	Ammonium hydroxide, NH,OH.	Ammonium oxalate, (NH ₄) ₂ C ₂ O ₄ .	Ammonium sulphate.(NH ₄) ₂ SO ₄ , or sulphuric acid, H ₂ SO ₄ .	Potassium chromate, K ₂ CrO ₄ .

	REACTIONS O	F THE	BASES	64
Magnesium hydro xide, Mg(OH) ₂ , white p pt. Sol. in NH ₄ Cl.	Magnesium hydrogen phosphate, MgHPO, white ppt. Boiled = Mg,(PO,)z. In presence of NH M, POH a white crystalline ppt. of MgNH,PO, slowly forms.	White.		No ppt. by H ₂ SiF ₆ . Boiled with Na ₂ CO ₆ = white Mg ₁ (CO ₁) ₂ . No ppt. if NH ₄ Cl present.
Strontium hydroxide, Sr(OH), white ppt. Slightly sol. in water; "c" 410 mg.; "h" very soluble.	Strontium hydrogen phosphate, SrHPO4, white ppt. Sol. in acids. See BaHPO4. Insol. in H2O.	Crimson.	Several orange and red lines. Brilliant blue line.	No ppt. by H ₂ SiF ₆ .
Calcium hydroxide, Ca(OH), white ppt. Difficultly sol. in water. Sol. in NH ₄ Cl. "c" 170 mg.; "h" 80 mg.	Calcium hydrogen phosphate, CaHPO,, white ppt. "c" = 28 mg. Sol. in acids. In presence of NH,OH, Cas(PO,), pptd. "c", 3 mg. to 8 mg.	Yellowish red.	Sharp orange line α and Several orange and red bluish line β .	No ppt. by H ₂ SiF ₆ .
Barium hydroxide, Ba(OH), white ppt. formed only in conc. solutions. "c" 5560 mg.; "h" very soluble.	Barium hydrogen phospate, BaHPO,, white ppt. "c" 10-20 mg. Sol. in acids. If NH4OH present, BaNH4PO, formed.	Yellowish green.	Green α and β bands. Fainter yellow and red bands.	H ₂ SiF ₆ ppts. BaSiF ₆ . Insol. in alcohol and dilute acids. "c" 26 mg.; "h" 90 mg.
Sodium hydrox- ide, NaOH.	Sodium phos- phate, Na ₂ HPO ₄ .	Flame.	Spectra.	Miscellany.

The Soluble Metal Group.

Sodium, NaCl.	Sodium fluosilicate, Na ₂ SiF ₆ , white ppt. Somewhat sol. in water. "c" = 650 mg.; "h" 2460 mg.			Sodium pyroantimonate, Na ₂ H ₂ SD ₂ O ₇ , white cryst. ppt. Best formed in slightly alkaline solutions. NaSbO ₃ + aqua. "c" = 31 mg.	
POTASSIUM, KCI.	Potassium fluosilicate, K.sSiF _n . Transparent ppt. Slightly sol. in water. " c' = 120 mg.; " h" 955 mg.		Potassium chloroplatinate, K ₂ PtCl ₆ , yellow ppt. Slightly sol. in water. Insol. in alcohol or ether. "c" 480 mg.; "h" 5180 mg.		
LITHIUM, LICI,					Lithium carbonate, Li ₂ CO ₃ , white ppt. Slightly sol. in water. Less sol. in hot than in cold. "c" = 1539 mg.; "h"728 mg.
AMMONIUM, NH,CI.		Reddish brown or yellow, according to amount of ammonia. Test very delicate.	Ammonium chloro- platinate, (NH4),PtCl ₀ , yellow ppt. Slightly sol. in water. Insol. in alcohol. "c" 670.0 mg. Very sol. in hot water.		Ammonia gas evolved on boiling.
REAGENT.	Hydrofluosilicic acid, H ₂ SiF ₆ .	Nessler's reagents, Hgl ₂ (KI) ₂ , KOH.	Platinic chloride, PtCl, H ₂ PtCl ₆ .	Potassium pyroantimonate, H ₂ K ₂ Sb ₂ O ₇ .	Sodium carbonate, Na ₂ CO ₈ .

	TUBROTTON	OF THE	DADER	
No ppt. in acetic acid solutions of sodium salts.				Yellow flame. Single yellow line.
Potassium cobalt nitrite, KrCo(NO ₂), yel'ow, or KrNaCo(NO ₂), in presence of an excess of sodium. In- sol. in acetic acid. Sol. in in- organic acids. Hastened by warming. Solution should have acetic acid present.			Monopotassium tartrate, KHC,H,O ₆ , white cryst. ppt. Hastened by stirring. Somewhat sol. in H ₂ O. "c" 370 mg.	. Violet flame. A red and blue line.
		Lithium phosphate, Li ₃ PO ₄ , white ppt. Slightly sol. in water. Sol. in HCl. " c" = 40 mg.		Red flame. Bright crimson line with feeble orange line.
In acetic acid solutions (see Na), Co(NO ₂)3·3 NH ₄ NO ₃ , yellow ppt. Sol. in inorganic acids.	Ammonia gas evolved when salt is warmed with NaOH or KOH.		Monoammonium tartrate, NH4HC,H4O6, white cryst. ppt. Hastened by shaking. Slightly sol. in H2O.	
Sodium cobaltic nitrite, Co(NO ₂) ₈ .	Sodium or potassium hydrox- ide, NaOH or KOH.	Sodium phosphate, Na ₂ HPO ₄ .	Tartaric acid, H ₂ C ₄ H ₄ O ₆ .	Flame and spectrum.

REACTIONS OF THE ACIDS.

Inorganic Acids.	CHARACTERISTIC REACTIONS.	(NH ₄) ₂ MoO ₄ produces a yellow ppt. MgSO ₄ + NH ₄ Cl + NH ₄ OH = white ppt.	Marsh's test with both forms—ous and -ic—gives arsenic mirror. Sol. in NaOCl. H ₂ S produces yellow As ₂ S ₂ and AS ₂ S ₂ . Gutzeit test.	Sol. White ppt. Caused H ₂ SO ₄ + C ₂ H ₄ OH colors flame by lead acetate. green. Turmeric paper dipped Sol. in excess. In boric acid salt acidified with HCl, dried, turns red.	Effervesces with dilute inorganic acids, HCl, H ₂ SO ₄ , HNO ₂ , etc., CO ₂ gas being evolved. Linewater clouded by CO ₅ , CaCO ₅ being formed.
	LEAD ACETATE, Pb(C ₂ H ₅ O ₂) ₂ .	Lead acetate ppts. white salt. Insol.) in acetic acid. Sol. in HNOs.	White ppt. Sol. Lead acetate ppts.) in C ₂ H ₄ O ₂ . white arsenious salt. Sol. in acetic acid, HNO ₃ .	White ppt. Caused by lead acetate. Sol. in excess.	Lead acetate ppts. white lead. Sol. in HNOs.
	CALCTUM CHLORIDE, CaCly.	White ppt. Cas(AsO4)2. Sol. in acetic acid.	White ppt. Sol. in C ₂ H ₄ O ₂ .	White ppt. Sol. in acids.	White ppt., CaCO ₂ . Sol. in acids. 2.2 mg.
	BARUM CHLORIDE, BaCl ₂ ,	White ppt., Ba ₃ (AsO ₄) ₂ . Sol. in acids.	White ppt., Bas(AsO ₃). Sol. in acids.	Sol. White ppt. Not readily sol. in water. Sol. in acids.	White ppt., BaCO ₂ . Sol. in acids. 2.2 mg.
	SILVER NITEATE. Agnos.	Reddish brown ppt., AgsAsO ₄ . Sol. in NH4OH, HNO ₈ .	Yellow ppt., AgsAsO ₃ . Sol. in NH ₄ OH, HNO ₈ .	White ppt. Sol. in NH4OH, HNO ₃ .	Grayish white ppt., AgrCO3. Sol. in HNO3. 3.14° mg.
	ACIDS.	Arsenic, HaAsO4, arsenates.	Arsenious, H ₃ ASO ₃ , arsenites.	Boric, H ₃ BO ₃ , (H ₂ B ₄ O ₇), borates.	Carbonic, H ₂ CO ₃ , car bonates.

nc. Heated on charcoal deflagrates. It salt H ₂ SO ₄ evolves yellow gas, ClO ₂ . dosion.	Pb(C ₂ H ₃ O ₂) ₂ ppts. Reduced to green CrCl ₃ by warm-yellow l'bCrO ₄ . Sol. in NaOH. o.02 ⁸⁸⁰ mg.	ad salt Liberated from its salts by HNO, yellow. or Cl water. Imparts in free form: water. violet color to CS, blue to starch.	2)2ppts. Liberated from its salts by Cl, ite. twater.
H ₂ SO ₄ , conc. warmed with salt causes explosion.	Pb(C ₂ H ₃ O ₂), ppt yellow PbCrO ₄ . Sol. in NaOH. o.o2 ^{86°} mg.	Soluble lead salt ppts. Pbl., yellow. Sol. in hot water. 39,000 mg.	Pb(C ₂ H ₃ O ₂) ₂ ppts. PbB ₇ , white. Sol. in hot water. 455 mg.
·	Yellow ppt. BaCrO, Sol. in HCl, HNOs. Insol. in acetic acid. 0.38 mg.		
	Dark red ppt., Ag ₂ CrO ₄ . Sol. in HNO ₅ . 2.8 ^{18°} mg.	Yellow ppt., Agl ₂ . Very difficultly sol. in NH ₀ OH. o.o35 ²¹⁶ mg.	Light yellow ppt., AgBr. Difficultly sol. in NH4OH.
Chloric, HClOs, chlorates.	Chromic, H ₂ CrO ₄ , chromates.	Hydroiodic, HI, iodides.	Hydrobromic, HBr, bromides.

REACTIONS OF INORGANIC ACIDS

Inorganic Acids.

	REAC	TIONS OF II	Olioanic	ACIDO	
CHARACTERISTIC REACTIONS.	K ₂ Cr ₂ O ₇ + H ₂ SO ₄ (conc.), gives CrO ₂ Cl ₂ . MnO ₂ +H ₂ SO ₄ gives Cl gas. KMnO ₄ +HCl evolves Cl.	Warmed with NaOH+FeSO ₄ +FeCl ₃ and acidified with HCl, "Prussian Blue" formed. Warmed with (NH ₄) ₂ S _x =NH ₄ CNS, which produces a blood-red color with FeCl ₃ .	On warming, PbO ₂ Dark blue, Turnbull's blue, is pptd. ppt. with FeSO ₄ (Fe·.).	Prussian Blue with FeCl ₃ (Fe). Red ppt. with copper salts (Cu).	Pb(C ₂ H ₃ O ₂) ₂ ppts. H ₂ SO ₄ evolves HF, which etches white salt. Sol. in glass. HNO ₃ .
Pb(C2H3O2)2.	PbCl ₂ , white, is pptd. Sol. in hot water. Insol. in alcohol. 673 mg.	White ppt. with sol. Pb salt, Pb(CN) Sol. in HNOs.	On warming, PbO; is pptd.	White ppt. Sol. in HNO ₃ .	Pb(C ₂ H ₃ O ₂) ₂ ppts. white salt. Sol. in HNO ₃ .
CaCl _p .					White ppt., CaF., Sol. in HCl. Insol. in acetic acid.
BaCl ₃ .					White ppt., BaF ₂ Sol. in HCl. 163 ¹⁸ mg.
AgNO ₅ .	White ppt., AgCl. Insol. in HNOs. Sol. in NH ₄ OH, KCN. 0.152 mg.	White ppt., AgCN. Sol. in NH ₄ OH, KCN. 0.021 mg.	Orange ppt., AgsFeCys. Sol. in NH,OH. KCN. Insol. in HNOs.	White ppt. Sol. in KCN. Insol. in HNO ₃ .	
Actos.	Hydrochloric, HCl. chlorides.	Hydrocyanic, HCN, cyanides.	Hydroferri- cyanic, H ₃ Fe(CN) ₆ , ferricyanides.	Hydroferro- cyanic, H ₄ Fe(CN) ₆ , ferrocyanides.	Hydrofluoric, HF, fluorides.

Decomposed by H ₂ SO ₄ into HF and SiF ₄ . Ppts. K in concentrated solution, as K ₂ SiF ₆ , white.	Most sulphides decomposed by strong inorganic acids, with odor of rotten eggs (see AgNOs and Pb(NOs)2 tests). Colors sodium nitro prussiate, violet.	Cl evolved when salt is treated with HCl and many other acids. Ppts. MnO ₂ black from solution of MnSO ₄ .	With acetic acid and KI, free iodine formed. CS ₂ colored violet. Starch colored blue.	Coagulates albumen. Boiled with HNO ₃ = H ₃ PO ₄ .
	Black ppt., PbS. Sol. in hot HNO ₈ . o.1 mg.	White ppt., becomes brown on boiling.	White ppt. Sol. in HNO ₈ .	White ppt. Sol. in HNOs.
	·			White ppt. Sol. in dil. acids.
White ppt., BaSiFe. Insol. in HCl. 26 ^{17°} mg.			White ppt., Ba(10 ₄) ₂ . Sol. in HCl. 8 mgs.	White ppt. Sol. in excess of meta-phosphate.
	Black ppt., Ag.S. Sol. in hot HNOs. 0.02 mg.	White ppt . AgClO. Sol. in HNO3.	White ppt., AglO ₂ . White ppt., Sol. in NH ₄ OH. Ba(1O ₄) ₂ . Sol. Reduced by SO ₂ in HCl. 8 mgs. to Agl. 4.4 mg.	White ppt. Sol. in NH ₄ OH, HNO ₃ .
Hydrofluo- silicic, H ₂ SiF ₆ , fluosilicates.	Hydrosul- phuric, H ₂ S, sulphides.	Hypochlorous, HClO, hypochlorites.	Iodic, HIO3, iodides.	Metaphos- phoric, HPO 1, metaphos- phates.

Inorganic Acids.

CHARACTERISTIC REACTIONS.	H ₂ SO ₄ (conc.) poured into a mixture of a nitrate salt with FeSO ₄ produces a brown ring at upper surface of heavier H ₂ SO ₄ .	With an iodide, when acidified with HCl, liberates iodine, which will color CS ₂ violet.	White ppt. with Pb (NH ₄) ₂ MoO ₄ + HNO ₃ ppts. at 40°, salt. Sol. in NaOH yellow phospho ammonium Insol. in NH ₄ OH. molybdate. Magnesia mixture Insol. in HC ₂ H ₃ O ₂ . produces a white ppt., MgNH ₄ PO ₄ oo14 mg.	Reducing action. Very concentrated solutions heated evolve PH ₃ .	Does not coagulate albumen as does the metaphosphoric acid. Boiled with HNO ₈ changes to H ₈ PO ₄ .
Pb(C ₃ H ₃ O ₃) ₃ ,			White ppt. with Pb salt. Sol. in NaOH Insol. in N4OH. Insol. in HC2H ₃ O ₃ .	White ppt. Insol. in HC ₂ H ₃ O ₂ . Sol. in HNO ₃ .	Pb salt same as Ca salt.
CaCl			White ppt. Sol. in inorganic and in acetic acids.	White ppt. Sol. in NH4Cl.	White ppt. Sol. in excess of the pyrophos- phate.
BaCI,			White ppt., Ba ₃ (PO ₄);; Sol. in acids.	White ppt. Sol. in acids, acetic acid.	White ppt. Sol. in HCI. 10 mg.
AgNO ₃ ,		White ppt., AgNO ₂ . Sol. in hot water. 330 mg.	Yellow ppt., AgsPO4. Sol. in NH,OH and HNO3. 1.93 mg.	White ppt. On warming, causes reduction of silver salt to Ag.	White ppt. Sol. in NH4OH, HNOs.
Acibs.	Nitric, HNO ₈ , nitrates.	Nitrous, HNO ₂ , nitrites.	Phosphoric, H ₈ PO ₄ , phosphates.	Phosphorus, H ₈ PO ₄ , phosphites.	Pyrophos- phoric, H ₄ P ₂ O ₃ , pyro- phosphates.

Heated with Na ₂ CO ₃ , evolves CO ₂ . SiO ₂ skeleton with NaPO ₃ bead. Decomposes when evaporated to dryness, SiO ₂ separating.	FeCl ₃ produces a blood-red color, which is destroyed by HgCl ₃ .	Sulphates heated with Na ₂ CO ₃ on charcoal in reducing flame from Na ₂ S, which blacken a silver coin when it is moistened.	Reducing agent. Reduces KI (starch sol. test). Decolorizes KMO4. SO ₂ evolved when salt is acidified with HCl.	Decomposed by HCl to SO ₂ + S. Na ₂ S ₂ O ₃ dissolves AgCl.	
White ppt. Insol. in HNOs.	White ppt.	White ppt. Sol. in NaOH, NH,C ₂ H ₃ O ₃ , (NH ₄) ₂ C ₄ H ₄ O ₆	White ppt.	White ppt. On boiling becomes gray. PbSO ₄ + PbS.	
White ppt.			White ppt. Sol. in HCI.		
White ppt.		White ppt., BaSO4. White ppt. Insol. in acids. Sol. in water and o.172 mg.	White ppt. Sol. in HCl. 19.7 mg.	Conc. solution produces white ppt.	
Yellow ppt. Sol. in HNO ₂ .	White ppt., AgCNS. Diffi- cultly sol. in NH40H.	Conc. AgNO ₃ produces white ppt., Ag ₂ SO ₄ . Sol. in water. 580 mg.	White ppt.,Ag.SO ₃ . White ppt. Decomposed by Sol. in HCl. boiling into Ag + Ag.SO ₄ + SO ₂ .	AgsS-O ₃ , white ppt. Sol. in NassO ₃ . Decomposed by boiling, forming H ₂ SO ₄ + AgsS.	
Silicic, H ₂ SiO ₃ , silicates.	Sulphocyanic, HCNS, thiocyanates or sulpho- cyanates.	Sulphuric, H ₂ SO ₄ , sulphates.	Sulphurous, H ₂ SO ₃ , sulphites.	Thiosulphuric, H ₂ S ₂ O ₃ , thiosulphates.	

Organic Acids.

		Ş	5	3 00 11	
AgNO ₃ . CaCl ₃ .	20		FeCls.	H ₂ SO ₄ Conc.	SP_CIAL TrsTS.
White ppt. Sol. in hot water.			Reddish brown so- lution. Ppts. on boiling offerricace- tate=Fe ₂ (OH) ₂ A ₄ Sol. in HCl.	Heated, gives odor of vinegar.	H ₂ SO ₄ + alcohol = ethyl acetate, recognized by characteristic odor.
White ppt. CeHsCOOAg. Sol. in hot water.			Buff-colored ppt. (CH ₆ COO)FeOH. Sol. in HCl.	Dissolves without charring or evolution of gas.	Pb(C ₂ H ₂ O ₂) ₂ ppts. white compound. m.p. 121°, sublimes when heated. H ₂ SO ₄ + C ₂ H ₅ OH heated = ethyl benzoate.
			Deep violet. Color destroyed by acetic acid (not destroyed in case of salicylic acid).		Bromine water, even in very dilute solutions, gives a white ppt. sol. in NaOH, KOH. C ₆ H ₆ OH + 1 c.c. H ₂ SO ₄ + NaNO ₂ warmed = deep green or blue color.
Citric, Catric, Cat	White pp sol. in ho cold water NH,Cl. I NaOH. G line form	t. Less t than Sol. in Insol. in Crystal- insol. in			White ppt. with lead acetate. Sol. in ammonium citrate. Prevents pption. of Fe(OH), by alkalies. CdCl ₂ ppts. Cd(C ₆ H ₈ O ₇), Insol. in hot water. Sol. in acetic acid. (Cd salts, no ppt. with tartrates.)
White ppt. in conc. solutions. Becomes dark from reduced silver salt.			Red ppt. Color destroyed by HCl.	With reducing agent heated, gives CO, which burns with blue flame.	H ₂ SO ₄ (conc.) + ethyl alcohol= ethyl formate, pleasant char- acteristic odor.

Gallic, Gallic			Blue-black ppt. Sol. in excess = green.		Melts at 200°. The alkaline solutions absorbs O. Limewater.or Ba(OH) ₂ produces a blue ppt.
Reduction results. Ag formed (no action on Fehling's sol.).				Charring on heating with evolution of CO.	Decolorizes KMnO4 and efferverscence takes place, with odor of acetaldehyde.
White ppt. White ppt. only in presence of strong alcohol (distinction from citric).	White ppt. only in presence of strong alcohol (distinction from citric).				Lead acetate ppts. white salt. Sol. in hot water. Prevents pption. of Fe(OH), by alkalies.
White ppt. Sol. in White ppt. Insol. HNOs, NH4OH. Sol. in ACI, HNOs,				Heated, CO ₂ and CO evolved.	H ₃ SO ₄ (dilute) + MnO ₂ gives CO ₂ . Destroys color of KMnO ₄ when heated with that reagent in presence of dilute H ₂ SO ₄ .
White ppt. Sol. in hot water, Centoncooks.			Deep violet color. Destroyed by mineral acids.	Dissolves. Prolonged heating darkens solution and gas is evolved.	Lead acetate ppts. a white salt. Acid m.p. 156°. HNO ₃ heated with salt produces yellow picric acid. Color is intensified by caustic soda.
White ppt.			Blue-black color (ink).		Lead acetate gives a yellow ppt with astringent takte. The acid ppts. a solution of glue. Lime- water produces a gray ppt.
White ppt. Sol. White crystalline in excess of tar-trate, HCl, lar to magnesium NH4OH. Reduction on heating.		1			Chars when heated. Odor of burnt sugar. Prevents pption. of Fe(OH), by alkalies. Silver Nitrate test, page to4.

SOLUBILITY TABLE

Since no salt is absolutely insoluble, the term "insoluble" is only relative. For solubility of the salts formed, see Van Nostrand's Chemical Annual, edited by Professor John C. Oisen,

CATION.	F	Cl,	Br'	.1	CN	NO,	ClO ₈ ′	C2H3O2	S''	,,eO3	SiO,"	"Yos	CrO,"	BO ₃ "	PO4""	AsO ₄ "	AsO ₃ ""	Fe(CN)6"	Fe(CN),""	C'0',,
K.	w	w	w	w	w	w	w	w	w	w	w	w	w	w	w	w	w	w	w	w
Na [·]	W	W	W	W	W	W	W	W	W	w	W	W	W	W	W	W	W	w	W	w
Li [·]	W	W	W	W	W	W	W	W	W	W	W	W	W	W	W	W	W	W	W	W
Ba"	wa	W	W	W	wA	W	W	W	W	A	A	1	A	A	A	A	A	-	wA	_
Sr.	wa	W	w	W	W	W	W	w	W	A	A	I	wA	A	A	A	A	_	W	_
Ca"	wa	W	W	W	W	W	W	W	W	A	A	wa	wA	A	A	A	A	W	W	_
Mg.	wa	W	W	W	W	W	W	wA	W	A	A	W	W	wA	A	A	A	W	W	_
A1	W	W	W	W	_	W	W	W	-	_	wa	W	_	A	A	A	_	-	_	_
Mn.	A	W	W	W	A	W	W	wA	A	A	A	W	W	A	A	A	A	I	A	_
Zn··	wA	W	W	W	A	W	W	W	A	A	A	W	w	A	A	A	_	A	wa.	_
Cr	W	W	W	W	A	W	W	wA	-	_	A	W	A	A	A	A	-	-	-	_
Cd	wA	W	W	W	A	W	W	W	A	A	A	W	W	wA	A	_	_	-	-	-
Fe"	wA	W	W	W	wa	W	W	w	A	A	A	W	-	A	A	A	A	I	1	-
Fe···	W	W	W	-	_	W	W	A	-	_	A	W	W	A	A	A	A	W	1	-
Co	wA	W	W	W	wa	W	W	W	A	A	A	W	A	A	A	A	A	I	I	-
Ni*	wA	W	W	w	wa	W	W	w	A	A	A	W	A	A	A	A	A	I	1	-1
Sn"	W	W	-	W	_	W	W	A	A	_	_	W	A	A	A	_	_	1	I	-
Sn	W	W	_	W	_	_	-	-	A	_	_	_	-	-	A	A	A	-	I	-
Pb	A	W	W	W	A	W	W	W	A	A	A	1	I	A	A	A	-	wA	A	-
Cu	A	W	W	I	I	W	W	W	A	A	_	W	W	A	A	A	A	-	1	-
Sb	W	A	A	wA	_	-	_	A	A	_	_	A	A	-	A	A	-	-	-	-
Bi···	W	A	A	A	_	A	W	A	A	A	A	A	A	A	A	A	_	-	-	-
Hg	_	1	I	I	_	W	W	A	_	A	_	wA	A	-	A	A	A	-	-	-
Hg.	wA	W	W	A	W	W	W	A	A	A	_	W	wA	-	A	A	A	-		-
Ag.	W	1	1	1	I	W	W	A	A	A	A	wA	A	A	A	A	A	A	I	-
Pt	=	W	W	I	W	w	_	_	A	_	_	W	_	_	-	_	A	-	_	-
Au.	_	W	W	A	W	_	_	_	A		_	2	_	_	_	_	-1	_	_	_

ABBREVIATIONS. — W = soluble in water; A = soluble in acids; wA = slightly soluble in water, readily soluble in acids; wA = slightly soluble in water and in acids; wA = slightly soluble in water and acids.

The metals are arranged in order of their electromotive series,

VOL. I

PART III FACTORS, ACID AND ALKALI TABLES AND OTHER USEFUL DATA



TABLES AND USEFUL DATA

I.—INTERNATIONAL ATOMIC WEIGHTS, 1921

,	Symbol.	Atomic Weight.		Symbol	Atomic Weight.
Aluminum	Al	27.1	Neodymium	Nd	144.3
Antimony	$\mathbf{S}\mathbf{b}$	120.2	Neon	Ne	20.2
Argon	A	39.9	Nickel	Ni	58.68
Arsenic	As	74.96	Niton (radium em-		
Barium	Ba	137.37	anation)	Nt	222.4
Bismuth	Bi	208.0	Nitrogen	N	14.008
Boron	B	10.9	Osmium	Os	190.9
Bromine	Br	79.92	Oxygen	0	16.00
Cadmium	Cd	112.40	Palladium	Pd	106.7
Caesium	Cs	132.81	Phosphorus	P	31.04
Calcium	Ca	40.07	Platinum	Pt	195.2
Carbon	C	12.005	Potassium	K	39.10
Cerium	Ce	140.25	Praseodymium	Pr	140.9
Chlorine	Cl	35.46	Radium	Ra	226.0
Chromium	Cr	52.0	Rhodium	Rh	102.9
Cobalt	Co	58.97	Rubidium	Rb	85.45
Columbium	Cb	93.1	Ruthenium	Ru	101.7
Copper	Cu	63.57	Samarium	Sa	150.4
Dysprosium	Dy	162.5	Scandium	Sc	45.1
Erbium	Er	167.7	Selenium	Se	79.2
Europium	Eu	152.0	Silicon	Si	28.3
Fluorine	F	19.0	Silver	Ag	107.88
Gadolinium	Gd	157.3	Sodium	Na	23.00
Gallium	Ga	70.1	Strontium	Sr	87.63
Germanium	Ge	72.5	Sulphur	S	32.06
Glucinum	Gl	9.1	Tantalum	Ta	181.5
Gold	Au	197.2	Tellurium	Te	127.5
Helium	He	4.00	Terbium	Tb	159.2
Holmium	Ho	163.5	Thallium	Tl	204.0
Hydrogen	H	1.008	Thorium	Th	232.15
Indium	In	114.8	Thulium	Tm	168.5
Iodine	I	126.92	Tin	Sn	118.7
Iridium	Īr	193.1	Titanium	Ti	48.1
Iron	Fe	55.84	Tungsten	W	184.0
Krypton	Kr	82.92	Uranium	Ū	238.2
Lanthanum	La	139.0	Vanadium	v	51.0
Lead	Pb	207.20	Xenon	Xe	130.2
Lithium	Li	6.94	Ytterbium (Neoyt-	İ	
Lutecium	Lu	175.0	terbium)	Yb	173.5
Magnesium	Mg	24.32	Yttrium	Yt	89.33
Manganese	Mn	54.93	Zinc	Zn	65.37
Mercury	Hg	200.6	Zirconium	Zr	90.6
Molybdenum	Mo	96.0		ı	1

II.—MELTING-POINTS OF THE CHEMICAL ELEMENTS 1

Reproduced from Circular No. 35 (2d edition) of U. S. Bureau of Standards.

Standards.					
Element.	C.	F.	Element.	C.	F.
Helium	<-271	<-456	Neodymium	840?	15 44
Hydrogen	-259	-434	Arsenic	850?	1562
Neon	-253?	-423	Barium	850	1562
Fluorine	-223	-369	Praseodymium	ı 940?	1724
Oxygen	-218	-360	Germanium	958	1756
Nitrogen	-210	-346	SILVER	960.5	1761
Argon	-188	-306	Gold	1063.0	1945.5
Krypton	-169	-272	Copper	1083.0	1981.5
Xenon	-140	-220	Manganese	1260	2300
Chlorine	-101.5	-150.7	Samarium	1300-1400	2370-2550
Mercury	- 38.9	-38.0	Bervllium		
Bromine	- 7.3	+18.9	(glucinum)	1350?	2462 '
Caesium	+ 26	79	Scandium	?	
Gallium	· 30	86	Silicon	1420	2588
Rubidium	38	100	NICKEL	1452	2646
Phosphorus	44	111.2	Cobalt	1480	2696
Potassium	62.3	144	Yttrium	1490	2714
Sodium	97.5	207.5	Chromium	1520	2768
Iodine	113.5	236.3	Iron	1530	2786
	$S_1 112.8$	235.0	PALLADIUM	1549	2820
Sulphur	$\{S_{m} \ 119.2$	246 .6	Zirconium	1700?	3090
	S_{m} 106.8	224.2	Columbium		
Indium	155	311	(Niobium)	1700?	3090
Lithium	186	367	Thorium	∫ >1700	>3090
Selenium	217-220	422-42 8	l .	\ <pt< td=""><td><pt< td=""></pt<></td></pt<>	<pt< td=""></pt<>
TIN	231.9	449.4	Vanadium	1720	3128
Bismuth	271	520	PLATINUM	1755	3191
Thallium	302 ·	576	Ytterbium	?	
CADMIUM	320 .9	609 .6	Titanium	1800	3272
LEAD	327 . 4	621.3	Uranium	<1850	<3362
ZINC	419.4	786 .9	Rhodium	1950	3542
Tellurium	452	846	Boron	2200-2500? 4	000-4500
Antimony	630.0	1166	Iridium	2350?	4262
Cerium	640	1184	Ruthenium	2450?	4442
Magnesium	651	1204	Molybdenum	2500?	4500
ALUMINUM	65 8. 7	1217.7	Osmium	2700?	4900
Radium	700	1292	Tantalum	2850	5160
Calcium	810	1490	TUNGSTEN	3000	5430
Lanthanum	810?	1490	Carbon {	>3600 ∫	>6500
Strontium	>Ca <ba?< td=""><td></td><td>Carbon \</td><td>for $p. = 1$ at. $)$</td><td>for $p. = 1$ at.</td></ba?<>		Carbon \	for $p. = 1$ at. $)$	for $p. = 1$ at.

III. OTHER TEMPERATURE STANDARDS

Temperatures of Flames. ²		
• • •	Cent.	Deg. of Accuracy.
Bunsen, open	1100	Within 100° C.
Meker		
Petrol blow lamp	1600 ¹	
Oxyhydrogen with H ₂ +O		Within 100° C.
Oxyacetylene	2400^{1}	
Thermat	2500	
Electric arc	3500	Within 150° C.
Sun	6000	Within 500° C.
Motallurgical and Chemical Engineering, Vol. XIII	No 5	

Metallurgical and Chemical Engineering, Vol. XIII, No. 5, May, 1915.
 Measurement of High Temperatures, G. K. Burgess and H. Le Chatelier.
 Pyrometer tests of the open Bunsen flame gave temperatures ranging from 1000° to 1100° C.

TABLES AND USEFUL DATA

III.—OTHER TEMPERATURE STANDARDS (Continued)

Approximate Temperatures by Colors.	•	
22pp, cashiate 2 chops are see e.g. control	Cent.	Fahr.
L	525	977
	700	1292

First visible red		977 1292
Cherry red	900	1652
Dull orange		2012 2372
Dazzling white	1500	2732

Substance.	Phenomenon.	c.	F.	Variation with pressure (pressure in mm. of Hg.)
Oxygen	Boiling	-183.0	-297.4	C. °-183.0+0.01258 (p. 760) -0.0000079 (p. 760)
Carbon dioxide	Sublimation in inert liquid	- 78.5	-109.3	C. $° = -78.5 + 0.017$ (p. 760)
Sodium sulphate Na ₂ SO ₄ +10H ₂ O	Transforma-		90.291	
Water		100	212	C. °-100+0.03670 (p. 760) -0.00002046 (p. 760)
Naphthalene	Boiling	217.96	423.73	C. $°=217.96+0.058$ (p. 760)
Benzophenone		305.9	582.6	C. $^{\circ}$ -305.9+0.063 (p. 760)
Sulphur		444.6	832.3	C. °=444.6+0.0908 (p. 760) -0.000047 (p. 760)
Ag ₃ Cu ₃	Eutectic			(P. 100)
G	Freezing	779	1434	
Sodium chloride.	Freezing	801	1472	

IV.—ELECTROMOTIVE ARRANGEMENT OF THE ELEMENTS

Each element is positive to the element placed after it and negative to the element placed above.

14. Al	27. Ge	40. Os	53. Mo
15. Zr	28. In	41. Au	54. V
16. Th	29. Ga		55. Cr
17. Ce	30. Bi		56. As
18. Di	31. U	44. Si	57. P
19. La	32. Cu		58. Se
20. Mn	33. Ag	46. Cb	59. I
21. Zn	34. Hg		60. Br
22. Fe	35. Pd		61. Cl
23. Ni			62. F
24. Co			63. N
			64. S
26. Pb	39. Ir	52. W	65. O
	15. Zr 16. Th 17. Ce 18. Di 19. La 20. Mn 21. Zn 22. Fe 23. Ni 24. Co 25. Cd	15. Zr 28. In 16. Th 29. Ga 17. Ce 30. Bi 18. Di 31. U 19. La 32. Cu 20. Mn 33. Ag 21. Zn 34. Hg 22. Fe 35. Pd 23. Ni 36. Ru 24. Co 37. Rh 25. Cd 38. Pt	15. Zr 28. In 41. Au 16. Th 29. Ga 42. H 17. Ce 30. Bi 43. Sn 18. Di 31. U 44. Si 19. La 32. Cu 45. Ti 20. Mn 33. Ag 46. Cb 21. Zn 34. Hg 47. Ta 22. Fe 35. Pd 48. Te 23. Ni 36. Ru 49. Sb 24. Co 37. Rh 50. C 25. Cd 38. Pt 51. Bo

ACID AND ALKALI TABLES

V.—HYDROCHLORIC ACID

By W. C. FERGUSON

Degrees Baum	Sp. Gr.	Degrees Twaddeil.	Per Cent HCl.	Degrees Baume.	Sp. Gr.	Degrees Twaddell.	Per Cent HCl.
1.00	1.0069	1.38	1.40	14.25	1.1090	21.80	21.68
2.60	1.0140	2.80	2.82	14.50	1.1111	22.22	22.09
3.00	1.0211	4.22	4.25	14.75	1.1132	22.64	22.50
4.00	1.0284	5.68	5.69	15.00	1.1154	23.08	22.92
5.00	1.0357	7.14	7.15	15.25	1.1176	23.52	23.33
5.25	1.0375	7.50	7.52	15.50	1.1197	23.94	23.75
5.50	1.0394	7.88	7.89	15.75	1.1219	24.38	24.16
5.75	1.0413	8.26	8.26	16.0	1.1240	24.80	24.57
6.00	1.0432	8.64	8.64	16.1	1.1248	24.96	24.73
6.25	1.0450	9.00	9.02	16.2	1.1256	25.12	24.90
6.50	1.0469	9.38	9.40	16.3	1.1265	25.30	25.06
6.75	1.0488	9.76	9.78	16.4	1.1274	25.48	25.23
7:00	1.0507	10.14	10.17	16.5	1.1283	25.66	25.39
7.25	1.0526	10.52	10.55	16.6	1.1292	25.84	25.56
7.50	1.0545	10.90	10.94	16.7	1.1301	26.02	25.72
7.75	1.0564	11.28	11.32	16.8	1.1310	26.20	25.89
8.00	1.0584	11.68	11.71	16.9	1,1319	26.38	26.05
8.25	1.0603	12.06	12.09	17.0	1.1328	26.56	26.22
8.50	1.0623	12.46	12.48	17.1	1.1336	26.72	26. 39
8.75	1.0642	12.84	12.87	17.2	1.1345	26.90	26.56
9.00	1.0662	13.24	13.26	17.3	1.1354	27.08	26.73
9.25	1.0681	13.62	13.65	17.4	1.1363	27.26	26.90
9.50	1.0701	14.02	14.04	17.5	1.1372	27.44	27.07
9.75	1.0721	14.42	14.43	17.6	1.1381	27.62	27.24
10.60	1.0741	14.82	14.83	17.7	1.1390	27.80	27.41
10.25	1.0761	15.22	15.22	17.8	1.1399	27.98	27.58
10.50	1.0781	15.62	15.62	17.9	1.1408	28.16	27.75
10.75	1.0801	16.02	16.01	18.0	1.1417	28.34	27.92
11.00	1.0821	16.42	16.41	18.1	1.1426	28.52	28.09
11.25	1.0841	16.82	16.81	18.2	1.1435	28.70	28.26
11.50	1.0861	17.22	17.21	18.3	1.1444	28.88	28.44
11.75	1.0881	17.62	17.61	18.4	1.1453	29.06	28.61
12.00	1.0902	18.04	18.01	18.5	1.1462	29.24	28.78
12.25	1.0922	18.44	18.41	18.6	1.1471	29.42	28.95
12.50	1.0943	18.86	18.82	18.7	1.1480	29.60	29.13
12.75	1.0964	19.28	19.22	18.8	1.1489	29.78	29.30
13.00	1.0985	19.70	19.63	18.9	1.1498	29.96	29.48
13.25	1.1006	20.12	20.04	19.0	1.1508	30.16	29.65
13.50	1.1027	20.54	20.45	19.1	1.1517	30.34	29.83
13.75	1.1048	20.96	20.86	19.2	1.1526	30.52	30.00
14.00	1.1069	21.38	21.27	19.3	1.1535	30.70	30.18

V.—HYDROCHLORIC ACID (Continued)

Degrees Baumé.	Sp. Gr.	Degrees Twaddell.	Per Cent HCl.	Degrees Baumé.	Sp. Gr.	Degrees Twaddell.	Per Cent HCl.
19.4	1.1544	30.88	30.35	22.5	1.1836	36.72	36.16
19.5	1.1554	31.08	30.53	22.6	1.1846	36.92	36.35
19.6	1.1563	31.26	30.71	22.7	1.1856	37.12	36.54
19.7	1.1572	31.44	30.90	22.8	1.1866	37.32	36.73
19.8	1.1581	31.62	31.08	22.9	1.1875	37.50	36.93
19.9	1.1590	31.80	31.27	23.0	1.1885	37.70	37.14
20.0	1.1600	32.00	31.45	23.1	1.1895	37.90	37.36
20.1	1.1609	32.18	31.64	23.2	1.1904	38.08	37.58
20.2	1.1619	32.38	31.82	23.3	1.1914	38.28	37.80
20.3	1.1628	32.56	32.01	23.4	1.1924	38.48	38.03
20.4	1.1637	32.74	32.19	23.5	1.1934	38.68	38.26
20.5	1.1647	32.94	32.38	23.6	1.1944	38.88	38.49
2 0.6	1.1656	33.12	32.56	23.7	1.1953	39.06	38.72
20.7	1.1666	33.32	32.75	23.8	1.1963	39.26	38.95
20.8	1.1675	33.50	32.93	23.9	1.1973	39.46	39.18
20.9	1.1684	33.68	33.12	24.0	1.1983	39.66	39.41
21.0	1.1694	33.88	33.31	24.1	1.1993	39.86	39.64
21.1	1.1703	34.06	33.50	24.2	1.2003	40.06	39 . 86
21.2	1.1713	34.26	33.69	24.3	1.2013	40.26	40.09
21.3	1.1722	34.44	33.88	24.4	1.2023	40.46	40.32
21.4	1.1732	34.64	34.07	24.5	1.2033	40.66	40.55
21.5	1.1741	34.82	34.26	24.6	1.2043	40.86	40.78
21.6	1.1751	35.02	34.45	24.7	1.2053	41.06	41.01
21.7	1.1760	35.20	34.64	24.8	1.2063	41.26	41.24
21.8	1.1770	35.40	34 .83	24.9	1.2073	41.46	41.48
21.9	1.1779	35.58	35.02	25.0	1.2083	41.66	41.72
22.0	1.1789	35.78	35.21	25.1	1.2093	41.86	41.99
22.1	1.1798	35.96	35.40	25.2	1.2103	42.06	42.30
22.2	1.1808	36.16	35.59	25.3	1.2114	42.28	42.64
22.3	1.1817	36.34	35 .78	25.4	1.2124	42.48	43.01
22.4	1.1827	36.54	35.97	25.5	1.2134	42.68	43.40

Sp. Gr. determinations were made at 60° F., compared with water at 60° F. From the Specific Gravities, the corresponding degrees Baumé were calculated by the following formula: Baumé = 145 - 145/Sp. Gr. Atomic weights from F. W. Clarke's table of 1901. O = 16.

ALLOWANCE FOR TEMPERATURE:

10-15° Bé. - 1/40° Bé. or .0002 Sp. Gr. for 1° F. 15-22° Bé. - 1/30° Bé. or .0003 " " " 1° F. 22-25° Bé. - 1/28° Bé. or .00035 " " " 1° F.

AUTHORITY - W. C. FERGUSON.

This table has been approved and adopted as a Standard by the Manufacturing Chemists' Association of the United States.

W. H. Bower, Jas. L. Morgan, Henry Howard, Arthur Wyman, A. G. Rosengarten,

New York, May 14, 1903.

Executive Committee.

VI.—HYDROCHLORIC ACID Lunge and Marchlewski

Specific Gravity. 15° 4° In Vacuo.	Per Cent HCl by Weight.	r Liter con- tains Grams HCl.	Specific Gravity 15° 4° in Vacuo.	Per Cent HCl by Weight.	r Liter con- tains Grams HCl.	Specific Gravity 15° 4° in Vacuo.	Per Cent HCl by Weight.	r Liter con- tains Grams HCl.
1.000	0.16	1.6	1.075	15.16	163	1.145	28.61	628
1.005	1.15	12	1.080	16.15	174	1.150	29.57	340
1.010	2.14	22	1.085	17.13	186	1.152	29.95	345
1.015	3.12	32	1.090	18.11	197	1.155	30.55	353
1.020	4.13	42	1.095	19.06	209	1.160	31.52	366
1.025	5.15	53	1.100	20.01	220	1.163	32.10	373
1.030	6.15	64	1.105	20.97	232	1.165	32.49	379
1.035	7.15	74	1.110	21.92	243	1.170	33.46	392
1.040	8.16	85	1.115	22.86	255	1.171	33.65	394
1.045	9.16	96	1.120	23.82	267	1.175	34.42	404
1.050	10.17	107	1.125	24.78	278	1.180	35.39	418
1.055	11.18	118	1.130	25.75	291	1.185	36.31	430
1.060	12.19	129	1.135	26.70	303	1.190	37.23	443
1,065	13.19	141	1.140	27.66	315	1.195	38.16	456
1.070	14.17	152	1.1425	28.14	322	1.200	39.11	469

COMPOSITION OF CONSTANT BOILING HYDROCHLORIC ACID*

Pressure mm. of Mercury.	Per Cent of HCl.	Grams constant boiling distillate for 1 mol. HCl.
770	20.218	180.390
760	20.242	180.170
750	20.266	179.960
740	20.290	179.745
730	20.314	179.530
, , ,		

Temperature of constant boiling hydrochloric acid is 108.54° at 763 mm. Specific gravity 1.09620°.

^{*} Hulett and Bonner, Jour. Am. Chem. Soc. xxxi, 390.

VII.—NITRIC ACID
By W. C. Ferguson

Degrees Baumé.	8p. Gr. 60° 60° F.	Degrees Twaddell.	Per Cent HNOs.	Degrees Baumé.	8p. Gr. 60° P.	Degrees Twaddell.	Per Cent
10.00	1.0741	14.82	12.86	21.25	1.1718	34.36	28.02
10.25	1.0761	15.22	13.18	21.50	1.1741	34.82	28.36
10.50	1.0781	15.62	13.49	21.75	1.1765	35.30	28.72
10.75	1.0801	16.02	13.81	22.00	1.1789	35.78	29.07
11.00	1.0821	16.42	14.13	22.25	1.1813	36.26	29.43
11.25	1.0841	16.82	14.44	22.50	1.1837	36.74	29.78
11.50	1.0861	17.22	14.76	22.75	1.1861	37.22	30.14
11.75	1.0881	17.62	15.07	23.00	1.1885	37.70	30.49
12.00	1.0902	18.04	15.41	23.25	1.1910	38.20	30.86
12.25	1.0922	18.44	15.72	23.50	1.1934	38.68	31.21
12.50	1.0943	18.86	16.05	23.75	1.1959	39.18	31.58
12.75	1.0964	19.28	16.39	24.00	1.1983	39.66	31.94
13.00	1.0985	19.70	16.72	24.25	1.2008	40.16	32.31
13.25	1.1006	20.12	17.05	24.50	1.2033	40.66	32.68
13.50	1.1027	20.54	17.38	24.75	1.2058	41.16	33.05
13.75	1.1048	20.96	17.71	25.00	1.2083	41.66	33.42
14.00	1.1069	21.38	18.04	25.25	1.2109	42.18	33.80
14.25	1.1090	21.80	18.37	25.50	1.2134	42.68	34.17
14.50	1.1111	22.22	18.70	25.75	1.2160	43.20	34.56
14.75	1.1132	22.64	19.02	26.00	1.2185	43.70	34.94
15.00	1.1154	23.08	19.36	26.25	1.2211	44.22	35.33
15.25	1.1176	23.52	19.70	26.50	1.2236	44.72	35.70
15.50	1.1197	23.94	20.02	26.75	1.2262	45.24	36,09
15.75	1.1219	24.38	20.36	27.00	1.2288	45.76	36.48
16.00	1.1240	24.80	20.69	27.25	1.2314	46.28	36.87
16.25	1.1262	25.24	21.03	27.50	1.2340	46.80	37.26
16.50	1.1284	25.68	21.36	27.75	1.2367	47.34	37.67
16.75	1.1306	26.12	21.70	28.00	1.2393	47.86	38.06
17.00	1.1328	26.56	22.04	28.25	1.2420	48.40	38.46
17.25	1.1350	27.00	22.38	28.50	1.2446	48.92	38.85
17.50	1.1373	27.46	22.74	28.75	1.2473	49.46	39.25
17.75	1.1395	27.90	23.08	29.00	1.2500	50.00	39.66
18.00	1.1417	28.34	23.42	29.25	1.2527	50.54	40.06
18.25	1.1440	28.80	23.77	29.50	1.2554	51.08	40.47
18.50	1.1462	29.24	24.11	29.75	1.2582	51.64	40.89
18.75	1.1485	29.70	24.47	30.00	1.2609	52.18	41.30
19.00	1.1508	30.16	24.82	30.25	1.2637	52.74	41.72
19.25	1.1531	30.62	25.18	30.50	1.2664	53.28	42.14
19.50	1.1554	31.08	25.53	30.75	1.2692	53.84	42.58
19.75	1.1577	31.54	25.88	31.00	1.2719	54.38	43.00
20.00	1.1600	32.00	26.24	31.25	1.2747	54.94	43.44
20.25	1.1624	32.48	26.61	31.50	1.2775	55.50	43.89
20.50	1.1647	32.94	26.96	31.75	1.2804	56.08	44.34
20.75	1.1671	33.42	27.33	32.00	1.2832	56.64	44.78
21.00	1.1694	33.88	27.67	32.25	1.2861	57.22	45.24

VII.—NITRIC ACID (Continued)

Degrees Baumé.	Sp. Gr. 60° 60° F.	Degrees Twaddell.	Per Cent HNO ₂ .	Degrees Baume.	Sp. Gr. 60° F.	Degrees Twaddell.	Per Cent HNO _a .
32.50	1.2889	57.78	45.68	40.75	1.3909	78.18	63.48
32.75	1.2918	58.36	46.14	41.00	1.3942	78.84	64.20
33.00	1.2946	58.92	46.58	41.25	1.3976	79.52	64.93
33.25	1.2975	59 .50	47.04	41.50	1.4010	80.20	65.67
33.50	1.3004	60.08	47.49	41.75	1.4044	80.88	66.42
33.75	1.3034	60.68	47.95	42.00	1.4078	81.56	67.18
34.00	1.3063	61.26	48.42	42.25	1.4112	82.24	67.95
34.25	1.3093	61.86	48.90	42.50	1.4146	82.92	68.73
34.50	1.3122	62.44	49.35	42.75	1.4181	83.62	69.52
34.75	1.3152	63.04	49.83	43.00	1.4216	84.32	70.33
35 .00	1.3182	63.64	50.32	43.25	1.4251	85.02	71.15
35.25	1.3212	64.24	50.81	43.50	1.4286	85.72	71.98
35.50	1.3242	64.84	51.30	43.75	1.4321	86.42	72.82
35.75	1.3273	65.46	51.80	44.00	1.4356	87.12	73.67
36.00	1.3303	66.06	52.30	44.25	1.4392	87.84	74.53
36.25	1.3334	66.68	52.81	44.50	1.4428	88.56	75.40
36.50	1.3364	67.28	53.32	44.75	1.4464	89.28	76.28
36.75	1.3395	67.90	53.84	45.00	1.4500	90.00	77.17
37.00	1.3426	68.52	54.36	45.25	1.4536	90.72	78.07
37.25	1.3457	69.14	54.89	45.50	1.4573	91.46	79.03
37.50	1.3488	69.76	55.43	45.75	1.4610	92.20	80.04
37.75	1.3520	70.40	55.97	46.00	1.4646	92.92	81.08
38.00	1.3551	71.02	56.52	46.25	1.4684	93.68	82.18
38.25	1.3583	71.66	57.08	46.50	1.4721	94.42	83.33
38.50	1.3615	72.30	57.65	46.75	1.4758	95.16	84.48
3 8.75	1.3647	72.94	58.23	47.00	1.4796	95.92	85.70
39 .00	1.3679	73.58	58.82	47.25	1.4834	96.68	86.98
8 9.25	1.3712	74.24	59.43	47.50	1.4872	97.44	88.32
39 .50	1.3744	74.88	60.06	47.75	1.4910	98.20	89.76
39.75	1.3777	75.54	60.71	48.00	1.4948	98.96	91.35
40.00	1.3810	76.20	61.38	48.25	1.4987	99.74	93.13
40.25	1.3843	76.86	62.07	48.50	1.5026	100.52	95.11
40.50	1.3876	77.52	62.77			1	

ALLOWANCE FOR TEMPERATURE:

```
At 10° — 20° Bé. — 1/30° Bé. or .00020 Sp. Gr. = 1° F. 20° – 30° Bé. — 1/23° Bé. or .00044 " " = 1° F. 30° – 40° Bé. — 1/23° Bé. or .00060 " = 1° F. 40° – 48.5° Bé. — 1/17° Bé. or .00084 " = 1° F. AUTHORITY — W. C. FERGUSON.
```

This table has been approved and adopted as a Standard by the Manufacturing Chemists^a
Association of the United States.

W. H. BOWER, JAS. L. MORGAN, HENRY HOWARD, ARTHUR WYMAN, A. G. ROSENGARTEN, Executive Committee

New York, May 14, 1903.

TABLES AND USEFUL DATA

VIII.—NITRIC ACID

LUNGE AND REY

Specific Gravity 15°	vity contain .		r liter con- tains grams		Specific Gravity 15°	100 parts by weight contain		r liter con- tains grams	
in vacuo	% N ₂ O ₅	% HNO,	N ₂ O ₅	HNO2	in vacuo	% N ₂ O ₅	₩ HNO₃	N ₂ O ₅	HNO3
1.000	0.08	0.10	1	1	1.195	27.10	31.62	324	378
1.005	0.85	1.00	8	10	1.200	27.74	32.36	333	388
1.010	1.62	1.90	16	19	1.205	28.36	33.09	342	399
1.015	2.39	2.80	24	28	1.210	28.99	33.82	351	409
1.020	3.17	3.70	33	· 38	1.215	29.61	34.55	360	420
1.025	3.94	4.60	40	47	1.220	30.24	35.28	369	430
1.030	4.71	5.50	49	57	1.225	30.88	36.03	378	441
1.035	5.47	6.38	57	66	1.230	31.53	36.78	387	452
1.040	6.22	7.26	64	75	1.235	32.17	37.53	397	463
1.045	6.97	8.13	73	85	1.240	32.82	38.29	407	475
1.050	7.71	8.99	81	94	1.245	33.47	39.05	417	486
1.055	8.43	9.84	80	104	1.250	34.13	39.82	427	498
1.060	9.15	10.68	97	113	1.255	34.78	40.58	437	509
1.065	9.87	11.51	105	123	1.260	35.44	41.34	447	521
1.070	10.57	12.33	113	132	1.265	36.09	42.10	457	533
1.075	11.27	13.15	121	141	1.270	36.75	42.87	467	544
1.080	11.96	13.95	129	151	1.275	37.41	43.64	477	556
1.085	12.64	14.74	137	160	1.280	38.07	44.41	487	568
1.090	13.31	15.53	145	169	1.285	38.73	45.18	498	581
1.095	13.99	16.32	153	179	1.290	39.39	45.95	508	593
1.100	14.67	17.11	161	188	1.295	40.05	46.72	519	605
1.105	15.34	17.89	170	198	1.300	40.71	47.49	529	617
1.110	16.00	18.67	177	207	1.305	41.37	48.26	540	630
1.115	16.67	19.45	186	217	1.310	42.06	49.07	551	643
1.120	17.34	20.23	195	227	1.315	42.76	49.89	562	656
1.125	18.00	21.00	202	236	1.320	43.47	50.71	573	669
1.130 1.135	$18.66 \\ 19.32$	$\begin{bmatrix} 21.77 \\ 22.54 \end{bmatrix}$	211 219	246 256	1.325	44.17 44.89	51.53 52.37	585 597	683
1.135	19.32	23.31	219	266 266	1.3325		52.37 52.80		
1.145	20.64	24.08	237	276	1.335	$45.26 \\ 45.62$	53.22	603 609	704
1.150	21.29	24.08	245	286	1.340	46.35	54.07	621	725
1.155	21.29	25.60	254 254	296	1.345	47.08	54.93	633	739
1.160	22.60	26.36	262	290 306	1.350	47.82	55.79	645	753
1.165	23.25	27.12	202 271	316	1.355	48.57	56.66	658	768
1.170	23.90	27.88	279	326	1.360	49.35	57.57	671	783
1.175	24.54	28.63	288	336	1.365	50.13	58.48	684	798
1.180	25.18	29.38	297	347	1.370	50.13	59.39	698	814
1.185	25.83	30.13	306	357	1.375	51.69	60.30	711	829
1.190	26.47	30.88	315	367	1.380	52.52	61.27	725	846

VIII.—NITRIC ACID (Continued)

Specific Gravity 15°	100 parts by weight contain		r liter con- tains grams		Specific Gravity	100 parts by weight contain		z liter con- tains grams	
in vacuo	% N ₂ O ₅	HNO ₃	N ₂ O ₅	HNO,	150 4° in vacuo	% N ₂ O ₈	HNO,	N ₂ O ₅	HNO,
1.3833	53.08	61.92	735	857	1.495	78.52 80.65	91.60 94.09	1174	
1.385	53.35 54.20	62.24 63.23	739 753	862 879	1.500	81.09	94.60	1210 1217	1411 1420
1.395	55.07	64.25	768	896	1.501	81.50	95.08	1224	
1.400	55.97	65.30	783	914	1.502	81.91	95.55	1231	1436
1.405	56.92	66.40	800	933	1.504	82.29	96.00	1238	
1.410	57.86	67.50	816	952	1.505	82.63	96.39	1244	
1.415	58.83	68.63	832	971	1.506	82.94	96.76	1249	
1.420	59.83	69.80	849	991	1.507	83.26	97.13	1255	1464
1.425	60.84	70.98	867	1011	1.508	83.58	97.50	1260	1470
1.430	61.86	72.17	885	1032	1.509	83.87	97.84	1265	1476
1.435	62.91	73.39	903	1053	1.510	84.09	98.10	1270	1481
1.440	64.01	74.68	921	1075		84.28	98.32	1274	1486
1.445	65.13	75.98	941	1098	1	84.46	98.53	1277	1490
1.450	66.24	77.28	961	1121		84.63	98.73	1280	
1.455	67.38	78.60	981	1144	1.514	84.78	98.90	1283	
1.460	68.56	79.98	1001	1168		84.92	99.07	1287	1501
1.465	69.79	81.42	1023	1193	1.516	85.04	99.21	1289	1504
1.470	71.06	82.90	1045	1219	1.517	85.15	99.34	1292	
1.475	72.39	84.45	1068	1246	1.518	85.26	99.46	1294	1510
1.480	73.76	86.05	1092	1274	1.519	85.35	99.57	1296	_
1.485	75.18	87.70	1116		1.520	85.44	99.67	1299	1515
1.490	76.80	89.60	1144	1335			i i		Ì

IX.—PHOSPHORIC ACID AT. 17.5°

Specific Gravity.	Per Cent. P ₂ O ₅ .	Per Cent. H _a PO ₄ .	Specific Gravity.	Per Cent. P ₂ O ₆ .	Per Cent. H ₃ PO ₄ .	Specific Gravity.	Per Cent. P ₃ O ₅ .	Per Cent. H ₃ PO ₄ .
1.809	68.0	93.67	1.462	46.0	63.37	1.208	24.0	33.06
1.800	67.5	92.99	1.455	45.5	62.68	1.203	23.5	32.37
1.792	67.0	92.30	1.448	45.0	61.99	1.198	23.0	31.68
1.783	66.5	91.61	1.441	44.5	61.30	1.193	22.5	30.99
1.775	66.0	90.92	1.435	44.0	60.61	1.188	22.0	30.31
1.766	65.5	90.23	1.428	43.5	59.92	1.183	21.5	29.62
1.758	65.0	89.54	1.422	43.0	59.23	1.178	21.0	28.93
1.750	64.5	88.85	1.415	42.5	58.55	1.174	20.5	28.24
1.741	64.0	88.16	1.409	42.0	57.86	1.169	20.0	27.55
1.733	63.5	87.48	1.402	41.5	57.17	1.164	19.5	26.86
1.725	63.0	86.79	1.396	41.0	56.48	1.159	19.0	26.17
1.717	62.5	86.10	1.389	40.5	55.79	1.155	18.5	25.48
1.709	62.0	85.41	1.383	40.0	55.10	1.150	18.0	24.80
1.701 1.693	61.5	84.72	1.377	39.5	54.41	1.145	17.5 17.0	24.11
1.685	61.0	84.03 83.34	1.371 1.365	39.0 38.5	53.72 53.04	1.140	16.5	23.42 22.73
1.677	60.0	82.65	1.359	38.0	52.35	1.130	16.5	22.73
1.669	59.5	81.97	1.354	37.5	51.66	1.136	15.5	21.35
1.661	59.0	81.28	1.348	37.0	50.97	1.120	15.0	20.66
1.653	58.5	80.59	1.342	36.5	50.28	1.118	14.5	19.97
1.645	58.0	. 79.90	1.336	36.0	49.59	1.113	14.0	19.28
1.637	57.5	79.21	1.330	35.5	48.90	1.109	13.5	18.60
1.629	57.0	78.52	1.325	35.0	48.21	1.104	13.0	17.91
1.621	56.5	77.83	1.319	34.5	47.52	1.100	12.5	17.22
1.613	56.0	77.14	1.314	34.0	46.84	1.096	12.0	16.53
1.605	55.5	76.45	1.308	33.5	46.15	1.091	11.5	15.84
1.597	55.0	75.77	1.303	33.0	45.46	1.087	11.0	15.15
1.589	54.5	75.08	1.298	32.5	44.77	1.083	10.5	14.46
1.581	54.0	74.39	1.292	32.0	44.08	1.079	10.0	13.77
1.574	53.5	73.70	1.287	31.5	43.39	1.074	9.5	13.09
1.566	53.0	73.01	1.281	31.0	42.70	1.070	9.0	12.40
1.559	52.5	72.32	1.276	30.5	42.01	1.066	8.5	11.71
1.551	52.0	71.63	1.271	30.0	41.33	1.062	8.0	11.02
1.543	51.5	70.94	1.265	29.5	40.64	1.058	7.5	10.33
1.536	51.0	70.26	1.260	29.0	39.95	1.053	7.0	9.64
1.528	50.5	69.57	1.255	28.5	39.26	1.049	6.5	8.95
1.521	50.0	68.88	1.249	28.0	38.57	1.045	6.0	8.26
1.513 1.505	49.5	68.19	1.244	27.5	37.88	1.041	5.5	7.57 6.89
1.498	49.0	67.50 66.81	1.239	27.0	37.19	1.037 1.033	5.0	6.20
1.498	48.5 48.0	66.12	1.233	26.5 26.0	36.50 35.82	1.033	4.5	5.51
1.484	47.5	65.43	1.228	25.5	35.82	1.029	3.5	4.82
1.476	47.0	64.75	1.218	25.0	34.44	1.023	3.0	4.13
1.469	46.5	64.06	1.213	24.5	33.75	1.017	2.5	3.44

X.-SULPHURIC ACID

By W. C. FERGUSON AND H. P. TALBOT

Degrees Baumé.	Specific Gravity $\frac{60^{\circ}}{60^{\circ}}$ F.	Degrees Twaddell.	Per Cent H ₂ SO ₄ .	Weight of t Cu. Ft. in Lbs. Av.	Per Cent O. V.*	Pounds O. V. in 1 Cubic Foot.
0	1.0000	0.0	0.00	62.37	0.00	0.00
1	1.0069	1.4	1.02	62.80	1.09	0.68
2	1.0140	2.8	2.08	63.24	2.23	1.41
3	1.0211	4.2	3.13	63.69	3.36	2.14
4	1.0284	5.7	4.21	64.14	4.52	2.90
5	1.0357	7.1	5.28	64.60	5.67	3.66
6	1.0432	8.6	6.37	65.06	6.84	4.45
7	1.0507	10.1	7.45	65.53	7.99	5.24
8	1.0584	11.7	8.55	66.01	9.17	6.06
. 9	1.0662	13.2	9.66	66.50	10.37	6.89
10	1.0741	14.8	10.77	66.99	11.56	7.74
11	1.0821	16.4	11.89	67.49	12.76	8.61
12	1.0902	18.0	13.01	68.00	13.96	9.49
13	1.0985	19.7	14.13	68.51	15.16	10.39
14	1.1069	21.4	15.25	69.04	16.36	11.30
15	1.1154	23.1	16.38	69.57	17.58	12.23
16	1.1240	24.8	17.53	70.10	18.81	13.19
17	1.1328	26.6	18.71	70.65	20.08	14.18
18	1.1417	28.3	19.89	71.21	21.34	15.20
. 19	1.1508	30.2	21.07	71.78	22.61	16.23
20	1.1600	32.0	22.25	72.35	23.87	17.27
21	1.1694	33.9	23.43	72.94	25.14	18.34
22	1.1789	35.8	24.61	73.53	26.41	19.42
23	1.1885	37.7	25.81	74.13	27 .69	20.53
24	1.1983	39.7	27.03	74.74	29.00	21.68

Sp. Gr. determinations were made at 60° F., compared with water at 60° F. From the Sp. Grs., the corresponding degrees Baumé were calculated by the following formula: Baumé = 145-145/Sp. Gr.

Baumé Hydrometers for use with this table must be graduated by the above formula, which formula should always be printed on the scale.

* 66° Baumé = Sp. Gr. 1.8354 = Oil of Vitriol (O. V.). 1 cu. ft. water at 60° F. weighs 62.37 lbs. av. Atomic weights from F. W. Clarke's table of 1901. O = 16. $H_2SO_4 = 100 \text{ per cent.}$

> % H,SO. % O. V. %60° O. V. = 93.19100.00 = 119.9860° = 77.6783.35 = 100.0050° = 62.18 =66.72 = 80.06

Degrees Baumé.	* Freezing (Melting) Point. F.	APPRO	CIMATE 50° B.	BOILING 295° F.	POINTS
			60° "	386°·"	
0	32.0		61° "	400° "	
i	31.2		62° "	415° "	
2	30.5	,	63° "	432° "	
3	29.8		64° "	451° "	•
4	28.9		65° "	485° "	
- 1			66° "	538° "	
5	28.1		00	000	
6	27.2		FIXED	POINTS	
7	26.3	•	1111111	101.111	
8	25 .1				
9	24.0	Specific Gravity.	Per Cent H ₂ SO ₄ .	Specific Gravity.	Per Cent H ₂ 80 ₄ .
10	22.8				
11	21.5	1.0000	.00	1.5281	62.34
12	20.0	1.0048	.71	1.5440	63.79
13	18.3	1.0048	5.14	1.5748	66.51
14	16.6	1.0347	9.48	1.6272	71.00
		1.0049	$\frac{9.48}{14.22}$	1.6679	74.46
15	14.7	1.1353	19.04	1.7044	77.54
16	12.6	1.1736	23.94	1.7044	79.40
17	10.2	1.2105	28.55	1.7472	81.32
18	7.7	1.2513	33.49	1.7700	83.47
19	4.8	1.2951	38.64	1.7959	86.36
20	+ 1.6	1.3441	44.15	1.7959	88.53
20	+ 1.0 - 1.8	1.3947	49.52	1.8117	89.75
22	-6.0	1.4307	53.17	1.8275	91.32
23	- 0.0 -11	1.4667	56.68	1.8354	93.19
23 24	-11 -16	1.4822	58.14	1.0004	90.18
24	-10	1.7022	00.14	l l	

Acids stronger than 66° Bé, should have their percentage compositions determined by chemical analysis.

This table has been approved and adopted as a standard by the Manufacturing Chemists' Association of the United States.

W. H. BOWER,
HENRY HOWARD,
JAS. L. MORGAN,
ARTHUR WYMAN,
A. G. ROSENGARTEN,
Executive Committee

New York, June 23, 1904.

^{*} Calculated from Pickering's results, Jour. of Lon. Ch. Soc., vol. 57, p. 363.

AUTHORITIES — W. C. FERGUSON; H. P. TALBOT.

Degrees Baumé.	Specific Gravity 60° F.	Degrees Twaddell.	Per Cent H ₂ 80 ₄ .	Weight of r Cu. Ft. in Lbs. Av.	Per Cent 0. V.	Pounds O. V. in r Cubic Poot.
25	1.2083	41.7	28.28	75.33	30.34	22.87
26	1.2185	43.7	29.53	76.00	31.69	24.08
27	1.2288	45.8	30.79	76.64	33.04	25.32
28	1.2393	47.9	32.05	77.30	34.39	26.58
29	1.2500	50.0	33.33	77.96	35.76	27.88
30	1.2609	52.2	34.63	78.64	37.16	29.22
31	1.2719	54.4	35.93	79.33	38.55	30.58
32.	1.2832	56.6	37.26	80.03	39 .98	32.00
33	1.2946	58.9	38.58	80.74	41.40	33.42
34	1.3063	61.3	39.92	81.47	42.83	34.90
35	1.3182	63.6	41.27	82.22	44.28	36.41
36	1.3303	66.1	42.63	82.97	45.74	37.95
37	1.3426	68.5	43.99	83.74	47.20	39.53
38	1.3551	71.0	45.35	84.52	48.66	41.13
39	1.3679	73.6	46.72	85.32	50.13	42.77
40	1.3810	76.2	48.10	86.13	51.61	44.45
41	1.3942	78.8	49.47	86.96	53 .08	46.16
42	1.4078	81.6	50.87	87.80	54.58	47.92
43	1.4216	84.3	52.26	88.67	56 .07	49.72
44	1.4356	87.1	53.66	89.54	57.58	51.56
45	1.4500	90.0	55.07	90.44	59.09	53.44
46	1.4646	92.9	56.48	91.35	60.60	55.36
47	1.4796	95.9	57.90	92.28	62.13	57.33
48	1.4948	99.0	59.32	93.23	63.65	59.34
49	1.5104	• 102.1	60.75	94.20	65.18	61.40
50	1.5263	105.3	62.18	95.20	66.72	63.52
51	1.5426	108.5	63.66	96.21	68.31	65.72
52	1.5591	111.8	65.13	97.24	69.89	67.96
53	1.5761	115.2	66.63	98.30	71.50	70.28
54	1.5934	118.7	68.13	99.38	73.11	72.66
55	1.6111	122.2	69.65	100.48	74.74	75.10
56	1.6292	125.8	71.17	101.61	76.37	77.60
57	1.6477	129.5	72.75	102.77	78.07	80.23
58	1.6667	133.3	74.36	103.95	79.79	82.95
59	1.6860	137.2	75.99	105.16	81.54	85.75

Degrees Baumé.	Preesing (Melting) Point. °F.	AL	LOWANCE	FOR TEM	(PERATUR)	9
25	-23					
26	-30	At 10°	Bé029° Bé	or .00023	3 Sp. Gr. =	1° F.
27	-39	" 20°	" .036°	" .0003		10 "
28	-49	" 30°	" .035°	" :0003	9 " =	10 "
29	-61	" 40°	" .031°	" .0004	1 " =	1° "
		" 50°	" .028°	" .0004	5 " =	1° "
30	-74	" 60°	" .026°	" .0005	3 " =	1° "
31	-82	" 63°	" .026°	" . 0 005	7 " =	1° "
32	-96	" 66°	" .0235°	" .0005	4 " =	1° "
33	-97					•
34	-91					
35	-81					
36	-70		1 -			
37	-60	Per Cent	Pounds 60° Baumé	Per Cent	Pounds 50° Baumé	
38	-53	60° Baumė.	in	50° Baumé.	in	
39	-47		z Cubic Foot.		r Cubic Foot.	
40	-41	61.93	53.34	77.36	66.63	
41	-35	63.69	55.39	79.56	69.19	
42	-31	65.50	57.50	81.81	71.83	
43	-27	67.28	59.66	84.05	74.53	
44	-23	69.09	61.86	86.30	77.27	
45	-20	70.90	64.12	88.56	80.10	
46	-14	72.72	66.43	90.83	82.98	
47	-15	74.55	68.79	93.12	85.93	
48	-18	76.37	71.20	95.40	88.94	
49	-22	78.22	73.68	97.70	92.03	
50	-27	80.06	76.21	100.00	95.20	
51	-33	81.96	78.85	102.38	98.50	
52	-39 .	83.86	81.54	104.74	101.85	
53	-49	85.79	84.33	107.15	105.33	
54	-59	87.72	87.17	109.57	108.89	
5 5)	89.67	90.10	112.01	112.55	
56	₃	91.63	93.11	114.46	116.30	
57	Below	93.67	96.26	117.00	120.24	
58	🛱	95.74	99.52	119.59	124.31	
59	7/	97.84	102.89	122.21	128.52	ı

			101010 11011	ODD WIND		
Degrees Baumé.	Specific Gravity 60° F.	Degrees Twaddell.	Per Cent H ₂ SO ₄ .	Weight of 1 Cu. Ft. in Lbs. Av.	Per Cent O. V.	Pounds O. V. in 1 Cubic Foot
60	1.7059	141.2	77.67	106.40	83.35	88.68
61	1.7262	145.2	79.43	107.66	85.23	91.76
62	1.7470	149.4-	81.30	108.96	87.24	95.06
63	1.7683	153.7	83.34	110.29	89.43	98.63
64	1.7901	158.0	85.66	111.65	91.92	102.63
641	1.7957	159.1	86.33	112.00	92.64	103.75
641	1.8012	160.2	87.04	112.34	93.40	104.93
64 7	1.8068	161.4	87.81	112.69	94.23	106.19
65	1.8125	162.5	88.65	113.05	95.13	107.54
65 1	1.8182	163.6	89.55	113.40	96.10	108.97
651	1.8239	164.8	90.60	113.76	97.22	110.60
653	1.8297	165.9	91.80	114.12	98.51	112.42
66	1.8354	167.1	93.19	114.47	100.00	114.47
Degrees Baumé.	Freezing (Melting) Point.	Per Cent 60° Baumé.	Pounds 60° Baumé in Cubic Foot.	Per Cent 50° Baumé.	Pounds 50° Baumé in Cubic Foot.	
60	+12.6	100.00	106.40	124.91	132.91	
61	27.3	. 102.27	110.10	127.74	137.52	
62	39.1	104.67	114.05	130.75	142.47	
63	46.1	107.30	118.34	134.03	147.82	}
64	46.4	110.29	123.14	137.76	153.81	
641	43.6	111.15	124 . 49	138.84	155.50	
$64\frac{1}{2}$	41.1	112.06	125.89	139.98	157.25	1
643	37.9	113.05	127.40	141.22	159.14	
65	33.1	114.14	129.03	142.57	161.17	ł
65 1	24.6	115.30	130.75	144.02	163.32	
$65\frac{1}{2}$	13.4	116.65	132.70	145.71	165.76	!
653	- 1	118.19	134.88	147.63	168.48	1
66	-29	119.98	137.34	149.87	171.56	

XI.—SULPHURIC ACID TABLE 94-100% H₂SO₄ By H. B. Bishop

Bé.	Sp. Gr. at 60° F.	Per Cent. H ₂ SO ₄	Wt. 1 Cu. Ft.	Allowance for Temperature.				
66	1.8354	93.19	114.47	At 94% .00054 sp.gr. = 1° l				
66.12	1.8381	94.00	114.64	" 96 .0053 " = 1°1				
66.23	1.8407	95.00	114.80	0.00052 0.00052 0.00052				
66.31	1.8427	96.00	114.93	" 100 .00052 " =1° H				
66.36	1.8437	97.00	114.99					
66.36	1.8439	97.50	114.99	1				
66.36	1.8437	98.00	114.99	l .				
66.30	1.8424	99.00	114.91	1				
66.16	1.8391	100.00	07.411	\				

FUM'NG SULPHURIC ACID EQUIVALENTS

Total SOs	Equivalent H ₂ SO ₄	Per Cent H ₂ SO ₄	Per Cent Free 80s	Total SO:	Equivalent H ₂ SO ₄	Per Cent H ₂ SO ₄	Per Can Free 80
81.63	100.00	100	0	90.82	111.25	50	50
81.82	100.23	99	i	91.00	111.48	49	51
82.00	100.45	98	` 2	91.18	111.70	48	52
82 .18	100.43	97	2 3	91.37	111.93	47	53
82.37	100.90	96	4	91.55	112.15	46	54
82.55	101.13			91.73	112.13		
		95	5			45	55
82.73	101.35	94	6	51.92	112.60	44	56
82.92	101.58	93	7	92.10	112.82	43	57
83.10	101.80	92	8	92.29	113.05	42	58
83.29	102.03	91	9	92.47	113.28	41	59
83.47	102.25	90	-1	92.65	113.50	40	60
83.65	102.47	89	11	92.84	113.73	39	61
83.84	102.70	88	12	93.02	113.95	38	62
84.02	102.92	87	13	93.20	114.17	37 -	63
84.20	103.15	86	14	93.39	114.40	36	64
84.39	103.38	85	15	93.57	114.62	35	65
84.57	103.60	84	16	93.76	114.85	34	66
84.75	103.82	83	17	93.94	115.08	33	67
	104.05						
84.94		82	18	94.12	115.30	32	68
85.12	104.27	81	19	94.31	115.53	31	69
85.31	104.50	80	20	94.49	115.75	30	70
85.49	104.73	79	21	94.67	115.97	29	71
85 . 67	104.95	78	22	94.86	116.20	28	72
85 .86	105.18	77	23	95.04	116.42	27	73
86.04	105.40	76	24	95.22	116.65	26	74
86.22	105.62	75	25	95.41	116.88	25	75
86.41	105.85	74	26	95.59	117.10	24	76
86.59	106.07	73	27	95.78	117.33	23	77
86.78	106.30	72	28	95.96	117.55	22	78
86.96	106.53	71	29	96.14	117.77	21	79
87.14	106.75	70	30	96.33	118.00	20	80
87.33	106.98	69	31	96.51	118.22	19	81
87.51	107.20	68	32	96.69	118.45	18	82
87.69	107.42	67	33	96.88	118.68	17	83
87.88	107.65	66	34	97.06	118.90	16	84
88.06	107.87	65	35	97.25	119.13	15	85
88.24	108.10	64	36	97.43	119.35	14	86
88.43	108.33	63	37	97.61	119.57	13	87
88.61	108.55	62	38	97.80	119.80	12	88
88.80	108.78	61	39	97.98	120.03	11	89
88.98	109.00	60	40	98.16	120.25	10	90
89.16	109.22	59	41	98.35	120.48	9	91
89.35	109.45	58	42	98.53	120.70	8	92
89.53	109.67	57	43	98.71	120.92	7	93
89.71	109.90	56	44	98.90	121.15	6	94
89.90	110.13	55	45	99.08	121.37	Š	95
90.08	110.35	54	46	99.27	121.60	4	96
90.27	110.58	53	47	99.45	121.83	3	97
90.45	110.80	52	48	99.63	122.05	2	98
	111.02	51	49	99.03	122.03	ĺi	99
90.63	111.02	91	4:,		122.28		
	ı	ı	I	100.00	1 122.50	1 0	100

Compiled from the table by H. B. Bishop, Van Nostrand's Chemical Annual, 1913.

XII.-ACETIC ACID AT 15°

OUDEMANS

			OUDE				
Specific Gravity.	Per Cent H.C, H ₃ O ₃ .	Specific Gravity.	Per Cent H.C,H,O,	Specific Gravity.	Per Cent H.C,H,O,	Specific Gravity.	Per Cent H.C,H,Q,
0.9992	0	1.0363	26	1.0623	51	1.0747	76
1.0007	1 1	1.0375	27	1.0631	52	1.0748	77
1.0022	2	1.0388	28	1.0638	53	1.0748	78
1.0037	3	1.0400	29	1.0646	54	1.0748	79
1.0052	4	1.0412	30	1.0653	55	1.0748	80
1.0067	5	1.0424	31	1.0660	56	1.0747	81
1.0083	6	1.0436	32	1.0666	57	1.0746	82
1.0098	7	1.0447	33	1.0673	58	1.0744	83
1.0113	8	1.0459	34	1.0679	59	1.0742	84
1.0127	9	1.0470	35	1.0685	60	1.0739	85
1.0142	10	1.0481	36	1.0691	61	1.0736	86
1.0157	11	1.0492	37	1.0697	62	1.0731	87
1.0171	12	1.0502	38	1.0702	63	1.0726	88
1.0185	13	1.0513	39	1.0707	64	1.0720	89
1.0200	14	1.0523	40	1.0712	65	1.0713	90
1.0214	15	1.0533	41	1.0717	66	1.0705	91
1.0228	16	1.0543	42	1.0721	67	1.0696	92
1.0242	17	1.0552	43	1.0725	68	1.0686	93
1.0256	18	1.0562	44	1.0729	69	1.0674	94
1.0270	19	1.0571	45	1.0733	70	1.0660	95
1.0284	20	1.0580	46	1.0737	71	1.0644	96
1.0298	21	1.0589	47	1.0740	72	1.0625	97
1.0311	22	1.0598	48	1.0742	73	•1.0604	98
1.0324	23	1.0607	49	1.0744	74	1.0580	99
1.0337	24	1.0615	50	1.0746	75	1.0553	100
1.0350	25	11		II		H	I

XIII.—MELTING POINTS OF ACETIC ACID RUDORFF, Ber. 3, 390.

100 gr. H.C ₂ H ₃ O ₂ mixed with gr. water.	by weight con- tain parts water.	Melting (solidi- fying) point °C.	100 gr. H.C ₂ H ₈ O ₂ mixed with gr. water.	by weight contain parts water.	Melting (solidifying) point °C.
0.0	0.0	16.7°	8.0	7.407	6.25°
0.5	0.497	15.65	9.0	8.257	5.3
1.0	0.990	14.8	10.0	9.090	4.3
1.5	1.477	14.0	11.0	9.910	3.6
2.0	1.961	13.25	12.0	10.774	2.7
3.0	2.912	11.95	15.0	13.043	-0.2
4.0	3.846	10.5	18.0	15.324	-2.6
5.0	4.761	9.4	21.0	17.355	-5.1
6.0	5.660	8.2	24.0	19.354	-7.4
7.0	6.542	7.1			!

Boiling point 100% acid 117 8°.

XIV.—AQUA AMMONIA According to W. C. Ferguson

Degrees Baumė.	Sp. Gr. 60° F.	Per Cent NH ₃ .	Degrees Baumé.	Sp. Gr. 60° F.	Per Cent NH ₃ .	Degrees Baumé.	Sp. Gr. 60° F.	Per Cent
10.00	1.0000	.00	16.50	.9556	11.18	23.00	.9150	23.52
10.25	.9982	.40	16.75	.9540	11.64	23.25	.9135	24.01
10.50	.9964	.80	17.00	.9524	12.10	23.50	.9121	24.50
10.75	.9947	1.21	17.25	.9508	12.56	23.75	.9106	24.99
11.00	.9929	1.62	17.50	.9492	13.02	24.00	.9091	25.48
11.25	.9912	2.04	17.75	.9475	13.49	24.25	.9076	25.97
11.50	.9894	2.46	18.00	.9459	13.96	24.50	.9061	26.46
11.75	.9876	2.88	18.25	.9444	14.43	24.75	.9047	26.95
12.00	.9859	3.30	18.50	.9428	14.90	25.00	.9032	27.44
12.25	.9842	3.73	18.75	.9412	15.37	25.25	.9018	27.93
12.50	.9825	4.16	19.00	.9396	15.84	25.50	.9003	28.42
12.75	.9807	4.59	19.25	.9380	16.32	25.75	.8989	28.91
13.00	.9790	5.02	19.50	.9365	16.80	26.00	.8974	29.40
13.25	.9773	5.45	19.75	.9349	17.28	26.25	.8960	29.89
13.50	.9756	5.88	20.00	.9333	17.76	26.50	.8946	30.38
13.75	.9739	6.31	20.25	.9318	18.24	26.75	.8931	30.87
14.00	.9722	6.74	20.50	.9302	18.72	27.00	.8917	31.36
14.25	.9705	7.17	20.75	.9287	19.20	27.25	.8903	31.85
14.50	.9689	7.61	21.00	.9272	19.68	27.50	.8889	32.34
14.75	.9672	8.05	21.25	.9256	20.16	2775	.8875	32.83
15.00	.9655	8.49	21.50	.9241	20.64	28.00	.8861	33.32
15.25	.9639	8.93	21.75	.9226	21.12	28.25	.8847	[,] 33.81
15. 50	.9622	9.38	22.00	.9211.	21.60	28.50	.8833	34.30
15.75	.9605	9.83	22.25	.9195	22.08	28.75	.8819	34.79
16.00	.9589	10.28	22.50	.9180	22.56	29.00	.8805	35.28
16.25	.9573	10.73	22.75	.9165	23.04			1

ALLOWANCE FOR TEMPERATURE

The coefficient of expansion for ammonia solutions, varying with the temperature, correction must be applied according to the following table:

Corrections Deg	Corrections to be Subtracted for Rach Degree Above 60° F.											
Degrees Baumé.	40° F.		50° F.		70° F.		80° F.		90° F.		100° F.	
14° Bé	.015°	Bé	.017°	Bé	.020°	Bé	.022°	Bé	.024°	Bé	.026°	Bé
16°	.021	"	.023	66	.026	"	.028	"	.030	"	.032	•
18°	.027	"	.029	"	.031	"	.033	"	.035	"	.037	•
20°	.033	"	.036	"	.037	"	.038	"	.040	"	.042	6
22°	.039	"	.042	"	.043	"	.045	"	.047	"		
26°	.053	"	.057	"	.057	"	.059	"		l		

XV.—SODIUM HYDROXIDE SOLUTION AT 15°

LUNGE

Specific	Degrees Baume,	Degrees Twaddell.	Per Cent	Per Cent	I Liter Gra	contains ms
Gravity.	Baume.	I Waddell.	Na ₂ O.	NaOH.	Na ₂ O.	NaOH
1.007	1.0	1.4	0.47	0.61	4	6
1.014	2.0	2.8	0.93	1.20	9	12
1.022	3.1	4.4	1.55	2.00	16	21
1.029	4.1	5.8	2.10	2.70	22	28
1.036	5.1	7.2	2.60	3.35	27	35
1.045	6.2	9.0	3.10	4.00	32	42
1.052	7.2	10.4	3.60	4.64	38	49
1.060	8.2	12.0	4.10	5.29	43	56
1.067	9.1	13.4	4.55	5.87	49	63
1.075	10.1	15.0	5.08	6.55	55	70
1.083	11.1	16.6	5.67	7.31	61	79
1.091	12.1	18.2	6.20	8.00	68	87
1.100	13.2	20.0	6.73	8.68	74	95
1.108	14.1	21.6	7.30	9.42	81	104
1.116	15.1	23.2	7.80	10.06	87	112
1.125	16.1	25.0	8.50	10.97	96	123
1.134	17.1	26.8	9.18	11.84	104	134
1.142	18.0	28.4	9.80	12.64	112	144
1.152	19.1	30.4	10.50	13.55	121	156
1.162	20.2	32.4	11.14	14.37	129	167
1.171	21.2	34.2	11.73	15.13	137	177
1.180	22.1	36.0	12.33	15.91	146	183
1.190	23.1	38.0	13.00	16.77	155	200
1.200	24.2	40.0	13.70	17.67	164	212
1.210	25.2	42.0	14.40	18.58	174	225
1.220	26.1	44.0	15.18	19.58	185	239
1.231°	27.2	46.2	15.96	20.59	196	253
1.241	28.2	48.2	16.76	21.42	208	266
1.252	29.2	50.4	17.55	22.64	220	283
1.263	30.2	52.6	18.35	23.67	232	299
1.274	31.2	54.8	19.23	24.81	245	316
1.285	32.2	57.0	20.00	25.80	257	332
1.297	33.2	59.4	20.80	26.83	270	348
1.308	34.1	61.6	21.55	27.80	282	364
1.320	35.2	64.0	22.35	28.83	295	381
1.332	36.1	66.4	23.20	29.93	309	399
1.345	37.2	69.0	24.20	31.22	326	420

XV.—SODIUM HYDROXIDE SOLUTION AT 15° (Continued)

Specific	Degrees Baumi.	Degrees	Per Cent	Per Cent	r Liter contains Grams	
Gravity.	Baums.	Twaddell.	Na ₂ O.	NaOH.	Na ₂ O.	NaO:
1.357	38.1	71.4	25.17	32.47	342	441
1.370	39.2	74.0	26.12	33.69	359	462
1.383	40.2	76.6	27.10	34.96	375	483
1.397	41.2	79.4	28.10	36.25	392	506
1.410	42.2	82.0	29.05	37.47	410	528
1.424	43.2	84.8	30.08	38.80	428	553
1.438	44.2	87.6	31.CO	39.99	. 446	575
1.453	45.2	90.6	32.10	41.41	466	602
1.468	46.2	93.6	33.20	42.83	487	629
1.483	47.2	96.6	34.40	44.38	510	658
1.498	48.2	99.6	35.70	46.15	535	691
1.514	49.2	102.8	36.90	47.60	559	721
1.530	50.2	106.0	38.00	49.02	581	750

XVI.—VAPOR TENSION OF WATER IN MILLIMETERS OF MERCURY -2° TO $+36^{\circ}$ C.

According to Regnault, Broch, and Weibe

°c.	0	.1	.2	.3	.4	.5	.6	.7	.8	.9
	mm.	mm.	mm.							
-2		3.929		3.872	3.844	3.815		3.760	3.732	
-1		4.227	4.197	4.166		_		4.046	l .	
-0	4.579	4.546		4.481	4.448	4.416	4.384	4.352	4.321	4.289
0	4.579	4.612	4.646	4.679	4.713	4.747	4.782	4.816	4.851	4.886
1	4.921	4.957	4.992	5.028	5.064	5.101	5.137	5.174	5.211	5.248
2		5.324	5.362	5.400	5.438	5.477	5.516	5.555	5.595	5.635
3		5.715		5.796	5.837	5.878	5.920	5.961	6.003	1
4		6.131	6.174		6.261	6.305	6.349	6.393		
5	6.528	6.574		6.666		6.759	6.806		6.901	6.949
6	6.997				7.192		7.292	7.342	7.392	7.443
7		7.546			7.702		7.808	7.861	7.914	7.968
8	1	1	ł		8.243		8.355	8.412	8.469	8.526
9	8.584	8.642			8.818		8.937	8.997	9.057	9.118
10		9.240				9.490		9.616		9.745
11		9.875								10.410
	10.479									11.114 11.859
										12.647
										13.480
			1	1		_				14.359
										15.287
										16.266
										17.299
										18.390
										19.542
22	19.661	19.780	19.900	20.021	20.142	20.264	20.386	20.5 10	20.634	20.758
23	20.883	21.010	21.137	21.264	21.393	21.522	21.652	21.782	21.913	22.045
24	22.178	22.311	22.446	22.581	22.716	22.853	22.990	23.128	23.266	23.406
										24.839
										26.349
										27.939
										29.613
29	29.785	29.958	30.132	30.307	30.482	30.659	30.836	31.015	31.194	31.374
										33.225
										35.172
				35.978						
										39.365
										41.621
30	41.583	42.085	42.319	42.004	42.791	43.028	43.200	43.500	43.747	43.989
		'		'						

XVII.—USEFUL DATA OF THE MORE IMPORTANT INORGANIC COMPOUNDS *

Substance.	Formula.	Molecular or Atomic Weight.	Normal Coefficient 1 c.c. = gm.	Solubility in 100 Gms. Water.	Indi- cator
Acetic acid	HC ₂ H ₂ O ₂	60.04	.06004		
anhydride	(CH ₂ CO) ₂ O	102.07	.051035		l
Aluminium	Al	27.10	.009033	İ	
chloride	Al ₂ Cl ₆	266.96	.04449	69.8715°	P.
chloride	Al ₂ Cl ₆ ·12H ₂ O	483.15	.08053	40	P.
oxide	Al ₂ O ₃	102.20	.01703	insol.	
phosphate	AlPO ₄	122.14	.04071		
sulphate	Al ₂ (SO ₄) ₃	342.38	.05706	36.120°	P.
sulphate	Al ₂ (SO ₄) ₃ 18H ₂ O	666.67	.11111	87	P.
Ammonia	NH,	17.03	.01703		M.
Ammonium	NH.	18.04	.01804		M.
chloride	NHACI	53.50	.05350	29.4°°	M.
hydroxide	NHOH	35.05	.03505	-0	M.
nitrate	NH NO	80.05	.08005	118°°	M.
oxalate	(NH ₄) ₂ C ₂ O ₄ ·H ₂ O	142.11	.0710513	***	
sulphate	(NH ₄) ₂ SO ₄	132.14	.06607	7100	M.
Antimony	Sb	120.20	.06010	**	141.
chloride (tri)	SbCl	226.58	.113293	 •	
chloride (penta)	SbCl	297.50	.148753	l	
oxide (tri)	Sb ₂ O ₃	288.40	.072103		ł
oxide (penta)	Sb ₂ O ₅	320.40	.080103		
Arsenic	As	74.96	.03748		
oxide	As ₂ O ₅	229.92	.03832 1	150	
	As ₂ O ₅	229.92	.05748	130	
oxide		197.92	03299	1.7160	
	As ₂ O ₃	197.92		1.7160	
Arsenious oxide	As ₂ O ₃		.04948 3	1.75	
Barium	Ba BaCO	137.37 197.37	.068685	.002220°	M.
		208.29	.104145	30.9°°	WI.
chloride	BaCl ₂		.104145	36.2°°	
chloride	BaCl ₂ 2H ₂ O	244.32 171.38		30.2	
hydroxide	Ba(OH) ₂		.08569	F 15160	
hydroxide	Ba(OH) ₂ 8H ₂ O	315.51	.15775	5.15160	
oxalate	BaC ₂ O ₄ ·H ₂ O	243.40	.12170	1 500	
oxide	BaO	153.37	.076685	1.500	
sulphate	BaSO ₄	233.43	.11672	.000172°°	
sulphite	BaSO ₃	217.43	.10872		
peroxide	BaO ₂	169.37	.08469 *	insol.	
Boric acid	H ₂ BO ₂	61.92	.06192	4	
Bromine	Br	79.92	.07992	4.17°°	
Cadmium carbonate.	CdCO3	172.405	.08620	insol.	
chloride	CdCl ₂	183.32	.09166	140200	
chloride	CdCl ₂ 2H ₂ O	219.35	. 109675	16820°	
_ sulphide	CdS	144.46	.07223	insol.	
Calcium	Ca	40.07	.020035		
acetate	$Ca(C_2H_2O_2)_2$	158.14	.07907	· 1	
bicarbonate	Ca(HCO ₃) ₂	162.10	.08105		
carbonate	CaCO ₃	100.075	.050037	.0013	М.
chloride	CaCl ₂	110.99	.055495	59.5°°	
chloride	CaCl ₂ 6H ₂ O	219.09	.109543	117.4°°	
fluoride	CaF ₂	78.07	.039035		
	$C_{\bullet}(\Omega \mathbf{H})$	74.09	.037045	1700	
hydroxide oxa'ate	$C_{a}(OH)_{2}$ $C_{a}C_{2}O_{4}\cdot H_{2}O$	146.10	.037043	. 17°°	

Precipitation reagents.
 Acids and bases.
 Oxidising and reduce M. Methyl orange.
 P. Phenolphthalein.
 * Compiled and arranged by R. M. Meiklejohn. Oxidizing and reducing agents.
Ohthalein. Temp. C.

XVII.—USEFUL DATA OF THE MORE IMPORTANT INORGANIC COMPOUNDS (Continued)

Substance.	Formula.	Molecular or Atomic Weight.	Normal Coefficient 1 c.c. = gm.	Solubility in 100 Gms. Water.	Indi- cator
Calcium oxide	CaO	56.07	.028035	.13°°	
sulphate	CaSO	136.13	.06807	.179°°	
sulphide	CaS	72.13.	.03607	.15100	
Carbon	Č	12.005	.003001	insol.	
dioxide	ČO ₂	44.005	.0220031	179.67 cc.0°	
dioxide	CO ₂	44.005	.0440052	1.0.0,	P.
Chlorine	Cl	35.46	.03546	150 cc.º°	1.
Chromio anhudrida	CrO ₁	100.00	.0333333	163 .40°°	
Chromic anhydride		152.00	.025333 3		
oxide	Cr_2O_3			insol.	
	H ₃ C ₆ H ₄ O ₇	192.09	.06403	133.	
Cobalt	Ç ₀	58.97	.029485		
Copper	Cu	63 . 57	.031785	i í	
oxide	CuO	79.57	.07957		
sulphate	CuSO ₄	159.63	.15963	20°°	
sulphate	CuSO ₄ 5H ₂ O	249.71	.24971	31.61°°	
sulphide	CuS	95.63	.047815	.000033	
Cyanogen	CN	26.013	.026013	1	
Ferric oxide	Fe ₂ O ₂	159.68	.07984 3		
phosphate	FePO ₄ ·4H ₂ O	222.94	.07431	i	
Ferrous oxide		71.84	.07184 3	insol.	
sulphate		151.90	.15190 *		
sulphate		278.01	.27801	32.8°°	
amman'm gulphata	FeSO ₄ (NH ₄) ₂ SO ₄ 6H ₂ O	392.14	.39214	18°°	
Especia acid	HCOOH	46.02		10,	
Formic acid			.04602	001 000	
Hydrobromic acid		80.93	.08093	221.200	
Hydrochloric acid	HCI	36.47	.03647	82.510°	
Hydrocyanic acid		27.02	.02702		
Hydrofluoric acid	HF	20.01	.02001	264	
Hydrofluosilicic acid.		144.32	.02405 2	i	
Hydroiodic acid	HI	127.93	. 12793	1	
Hydrogen peroxide	H_2O_2	34.016	.017008		
Hydrogen sulphide	H ₂ S	34.076	.017038	437 cc.º°	
Iodine	I	126.92	.12692	.018211°	
Iron'	Fe	55.84	. 05584		
Lead	Pb	207.20	. 10360		
carbonate	PbCO ₂	267.205	. 13360	.00198	M.
chromate		323.20	. 16160	.00002180	2-2-
		223.20	.11160		
perovide	PhO.	239.20	.11960	1	
oxide peroxide sulphate	PhSO.	303.26	.15163	1 1	
sulphatesulphide	Pkg	239.26		0001	
aulphide	DP8O T NO		.11963	.0001	
sulphite		287.26	.14363 1	1	
Mag nesium		24.32	.01216	0100	
carbonate	MgCO ₃	84.32	.04216	.0106	
chloride	MgCl ₂	95.24	.04762	52.2°°	M.
chloride	MgCl₂6H₂O	203 34	.10167	167	Μ.
		40.32	. 02 016	.00062	Μ.
sulphate	$MgSO_4$	120.38	.06019	26.9°°	Μ.
sulphate	MgSO ₄ 7H ₂ O	246.49	. 123245	76.9°°	M.
Malic acid	H ₂ C ₄ H ₄ O ₅	134.07	.06703	1	
Manganese	Mn	54.93	.027465		
chloride	MnCl.	125.85	.062925	62.1610°	
peroxide	MnO ₂	86.93	.043465	insol.	
peroxide	474 AL UZ	OO . 00	COTOTO	111201.	

¹ Precipitation reagents.

² Acids and bases.

³ Oxidizing and reducing agents.

M. Methyl orange.

P. Phenolphthalcin.

Temp. C.

XVII.—USEFUL DATA OF THE MORE IMPORTANT INORGANIC COMPOUNDS (Continued)

Substance.	Formula.	Molecular or Atomic Weight.	Normal Coefficient 1 c.c. = gm.	Solubility in 100 Gms. Water.	Indi- cator.
Manganese sulphate.	MnSO ₄	150.99	.075495	53.2°°	
Mercuric chloride		271.52	.13576	5.73°°	! !
Mercurous chloride	HeCl	236.06	.23606 3	0.10	ŀ
Mercury	Hg	200.6	.2006		
Nickel	Ni	58 68	.02934		
Nitric acid	HNO,	63.02	.06302 2		Ì
Nitric acid	HNO ₃	63.02	.021006		,
Nitrogen trioxide	N ₂ O ₃	73.02	.019005 3		
pentoxide	N_2O_5	108.02	.05401 2		
pentoxide	N ₂ O ₅	108.02	.0180333		l
Nitrous acid		47.02	.01702		1
Nitrous acid	HNO2				
Ntirogen	N	14.008	.01401		!
Oxalic acid		90.03	.04501	4 000	•
Oxalic acid	H ₂ C ₂ O ₄ 2H ₂ O	126.06	.06303	4.900	
Phosphoric acid	H ₂ PO ₄	98.06	.09806 2	v. sol.	М.
Phosphoric acid	H ₃ PO ₄	98.06	.04903 *	v. sol. 0	P.
Phosphoric acid	H ₃ PO ₄	98.06	.03268	v. sol.	İ
Phosphorous acid				[!	
(ortho)		82.06	.02735		
pentoxide		142.08	.02368		
Potassium		39.10	.03910		l
bicarbonate	KHCO,	100.11	. 10011	22.40°	M.
bitartrate	KHC ₄ H ₄ O ₄	188.16	. 18816	.37°°	P.
heamata	K D=C)	167.02	. 16702		
biodate	KH(IO ₂) ₂	389.95	38995 2		l
biodate	KH(I() ₃) ₂	389.95	.03249 3		l
biodatebromide	KBr	119.02	. 11902	53.48°°	
carbonate	K _* CO _*	138.20	.06910	89.40°	M.
carbonate		138.20	06910 2	.,,,,,	
chlorate		122.56	020427 3	3.3°°	
Potassium chloride		74.56	.07456	28.5°°	ł
chromate	K ₂ CrO ₄	194.20	.06473 3	61.5°°	
cvanide	KCN	65.11	. 06511	v. sol.	1
dichromate	K ₂ Cr ₂ O ₇	294.20	.07355 1	V. 501.	
dichromate		294.20	14710 :	4.900	P.
dichromate	K ₂ Cr ₂ O ₇	294.20	.04903 3	4.900	1 .
		368.32	36832	4.9	!
ferrocyanide	K ₄ Fe(CN);	422.37		27.8120	İ
ferrocyanide			.422.373	21.0.	1
fluoride	KF	58.10	.05810	107110	
hydroxide	KOH	56.11	.05611	107160	1
iodateiodide	KIO,	214.02	. 03567	4.7400	Į
	KI	166.02	.16602	126.1°°	i
manganate		197.13	. 0492831		
nitrate	KNO ₃	101.11	.033703	13.3°°	ļ
nitrite	KNO ₂	85.11	. 08511	30015.60	
oxalate	$K_2C_2O_4 \cdot H_2O$	184.23	.09211		Ì
oxide	$K_2()$	94.20	.04710	v. sol.	
perchlorate	KClO ₄	138.56	.01732 3		
permanganate	KMnO ₄	158 03	.031606	2.83°°	
sulphide	K-S	110.26	. 05513	sol.	
sulphocyanate	KCNS	97.17	.09717	177.2°°	
tartrate	K ₂ C ₄ H ₄ O ₆	226.25	. 11312	sol.	
Silver	Ag	107.88	.10788		

¹ Precipitation reagents. ² Acids and bases. ³ Oxidizing and reducing agents.

M. Methyl orange. P. Phenolphthalein. Temp. C.

XVII.—USEFUL DATA OF THE MORE IMPORTANT INORGANIC COMPOUNDS (Continued)

Substance.	Formula.	Molecular or Atomic Weight.	Normal Coefficient 1 c.c. = gm.	Solubility in 100 Gms. Water.	Indi- cator
Silver bromide	AgBr	187.80	. 18780		
chloride	AgCl	143.34	.14334		i
nitrate	AgNO ₃	169.89	.16989	122°°	i
Sodium		23.00	.02300	122	İ
bromide		102.92	. 10292	79.5°°	i
bicarbonate		84.01	.08401	6.90°°	· М.
carbonate		106.005	.053002	7.10°	M.
		106.005	.017743	7.1	141.
chloratechloridecyanide	NaClO ₃			25 700	l
cnioride	NaCI N. CN	58.46.	.05846	35.7°°	1
cyaniae	Nach	49.01	.04901	sol.	ł
cyanidehydroxideiodide	NaOH	40.01	.04001	133.3180	
iodide	Nai	149.92	.14992 1	158.7°°	1
nitrate	NaNO ₃	85.01	.02834	72.9°°	l
nitrite		69.01	.06901	83.3200	Ì
oxalate	Na ₂ C ₂ O ₄	134.01	.06700	3.2215.50	ĺ
oxide	Na ₂ O	62.00	.03100	decomp.	
pnospnate (mono).	Nan ₂ PO ₄	120.06 ²	. 12006	v. sol.	M.
phosphate (disod)	Na ₂ HPO ₄	142.05 ²	. 14205		P.orl
phosphate (disod)	Na₂HPO₄12H₂O	358.24 2	. 35824	6.3°°	P.or!
phosphate (trisod).	Na ₃ PO ₄	164.04 ²	. 16404	1	P
phosphate		380.24	.380243	ł	P
sulphide		78.06	. 03903	15.410°	_
sulphite		126.06	. 06303		
thiosulphate		248.20	.24820	74.70°	1
thiosulphate		248.20	.24820*		
Stannic oxide		150.70	.15070	i	1
Stannous chloride		189.62	.09481	83.9°°	1
chloride		225.65	.112825	118.7°°	1
oxide		134.70	.06735	insol.	l
Sulphur dioxide	1 80.	64.06	.03203	7979 cc.º°	1
		80.06	.04003	1919 00.	ŀ
Sulphuric acid	SO ₃ H ₂ SO ₄ H SO	98_076	.049038		ł
Sulphuric acid	H ₂ SO ₃	82.076	.04104 2	Ì	l
Sulphurous acid	$\Pi_2 \odot U_3$			11500	Ì
Tartaric acid	H ₂ C ₄ H ₄ O ₆	150.07	.075035	115°°	Į.
Tin	Sn	118.70	.05935	•	ł
Titanium chloride		154.48	.15448 3		1
Zinc	Zn	65.37	.037685	004.40	ļ
carbonate		125.37	.062685	.001150	1
chloride	ZnCl ₂	136.29	.068145	209°°	
oxide	ZnO	81.37	.040685	.001	1
sulphatesulphate	ZnSO ₄	161.43	.080715	43.02°°	1
sulphate	ZnSO₄7H₂O	287.54	. 14377	115.2°°	1
sulphide	ZnS	97.43	.048715	.00069	İ

XVIII.—CONVERSION FACTORS *

AgAg	В	B'				
			Α'	A	В	B'
Ag	AgBr	0.5744	0.3055	AgNO ₂	HNO2	3.2729
	AgBrO ₁	0.4575	0.2470	AgNO ₂	N ₂ O ₂	4.0487
Ag	AgCl	0.7526	0.3709	AgNO ₃	HNO ₃	2.6959
Ag	AgCN	0.8057	0.3441	AgNO ₃	NaCl	2.9061
Ag	AgI	0.4595		AlCl ₃	<u>Cl</u>	1.2547
Ag	AgNO ₂	0.7010	1.1023	AlCla	H ₂ SO ₄	0.9072
Ag	AgNO ₁	0.6350	1.3925	AlF ₃	CaF ₂	0.7182
Ag	Ag ₂ O	0.9310	0.5303	Al_2O_3	Al	1.8856
Ag	Ag ₂ PO ₄	0.7731	2.6121	Al ₂ O ₃	AlCl	0.3828
Ag	Ag ₄ P ₂ O ₇	0.7126	2.2336	Al ₂ O ₃	Al ₂ P ₂ O ₇	0.4477
Ag	As	4.3175	2.3902	Al ₂ O ₃	$Al_2P_2O_8$	0.4184 0.2985
Ag	Br	1.3498 1.3330	3.3501	Al ₂ O ₃	$Al_2(SO_4)_3$	0.2900
Ag	HBr	3.0423	6.5232	Al_2O_3	Al ₂ (SO ₄); ·18H ₂ O	0.1533
Ag	HCl	2.9582	2.1088	ALO	FeO	0.1333
Ag	HI	0.8433	1.5625	Al ₂ O ₃	Fe ₂ O ₂	0.6400
Ag	Ĭ	0.8500	2.8792	Al ₂ O ₃	H.SO	0.3473
Ag	KBr	0.9064	2.0192	Al ₂ O ₂	K ₂ Al ₂ (SO ₄),	0.0210
Ag	KCI	1.4469	9.2859	Augor	·24H ₂ O	0.1077
Ag	KClO	0.8802	1.6067	Al ₂ O ₂	Na ₂ Al ₂ O ₄	0.6224
Ag	KClO	0.7786	8.8738	Al ₂ O ₂	(NH ₄) ₂ Al ₂	0.000
Ag	KCN	1.6568	0.0100	22203	(SO ₄) ₄ ·24H ₂ O	0.1127
Ag	KI	0.6498	1.8804	Al ₂ O ₃	(SO ₃)	0.5318
Ag	NaBr	1.0482	2.3501	Al ₂ O	$(SO_3)_3$	0.4255
Ag	NaCl	1.8453	0.2219	AlPO4	Àl	4.5070
Ag	NaI	0.7196	0.4185	AlPO4	Al ₂ O ₃	2.3902
AgBr	Br	2.3498	0.5816	AlPO ₄	P ₂ O ₅	1.7193
AgBr	BrO ₃	1.4681	0.6224	$Al_2P_2O_7$	P ₂ O ₄	1.6067
AgBr	HBr	2.3206	0.5816	$Al_2P_2O_8$	P ₂ O ₅	1.7193
AgBr	KBr	1.5779	2.0453	$Al_2(SO_4)_3$	BaSO ₄	0.4889
AgBr	KBrO ₃	1.1244	0.8594	$Al_2(SO_4)_3$	H ₂ SO ₄	1.1636
AgBr	AgBrO₃	0.7964	1.4723	$Al_2(SO_4)_3$	NaHCO ₃	0.6792
AgBr	NaBr	1.8247	0.7015	$Al_2(SO_4)_3$	SO3	1.4255
AgCl	Ag	1.3287	0.7506	Al ₄ C ₃	Al	1.3322
AgCl	AgNO₃	0.8437	1.4154	Al ₄ C ₃	Al ₂ O ₃	0.7065
AgCl	CĪ	4.0423	4 0175	A -	A	0.2316
AgCl	HCl	3.9305	4.3175	As	Ag	0.6096
AgCl	KClO ₁	1.9225 1.1695	1.6403 1.8538	As	AsO ₃	0.5394
AgCl	NaCl	2.4519	1.3201	As	As _t O ₂	0.7578
AgCl	NH ₄ Cl	2.6793	1.5336	As	As ₂ O ₃	0.652
AgCl	ZnCl ₂	2.1034	1.6417	As	As ₂ S ₁	0.609
AgCN	KCN	2.0564	2.0692	As	As ₂ S ₁	0.483
AgCN	HCN	4.9551	3.3862	As	2I	0.295
AgI	NH.I	1.6197	2.5391	As	MgNH ₄ AsO ₄	
AgI	HI	1.8354			H,O	0.3938
AgI	I	1.8500	2.0715	As	Mg.As.O7	0.482
AgI	IO	1.3423	2.1875	As	NaH ₂ AsO ₄	0.457
AgI	I ₂ O ₂	1.5558	2.4809	As	Na ₂ HAsO ₄	0.403
AgI	I ₂ O ₇	1.2836	1.9233	As ₂ O ₁	MgNH ₄ AsO	l
AgI	KI	1.4143			H ₂ O	0.5199
AgI	KIO ₃	1.0971	1.5691	As ₂ O ₃	Mg ₂ As ₂ O ₇	0.6373
AğI	NaI	1.5661	1.1253	As ₂ O ₂	Mg ₂ P ₂ O ₇	0.8886

 $A \times A' = B$ $B \times B' = A$

mpiled by Wilfred W. Scott and R. M. Meiklejohn. See page 698.

-		1				
A'	A	В	В'	A'	A	В
1.1616	A82O2	As ₂ O ₅	0.8609	0.8111	BaO ₂	Ba
1.2435	As ₂ O ₁	As ₂ S ₂	0.8042	0.4912	BaSiF ₆	Ba
1.5674	As ₂ O ₃	As ₂ S ₅	0.6380	0.7448	BaSiF	BaCl₂
2.5652	As ₂ O ₃	4I	0.3898	0.6271	BaSiF ₆	BaF2
1.3493	As ₂ O ₅	A82S6	0.7411	0.5484	BaSiF ₆	BaO
1.3507	As ₂ O ₅	Mg ₂ As ₂ O ₇	0.7403	0.4076	BaSiF ₆	F
1.6556	As ₂ O ₅	MgNH ₄ AsO ₄		0.4292	BaSiF ₆	HF
		· }H₂O	0.6040	0.5160	BaSiF ₆	H ₂ SiF ₆
1.4264	As ₂ O ₅	NaH ₂ AsO ₄	0.7011	0.3729	BaSiF ₆	SiF ₄
1.6177	As ₂ O ₅	Na ₂ HAsO ₄	0.6182	0.2156	BaSiF	SiO₂
2.2081	As ₂ O ₅	4I	0.4529	0.8108	BaS	Ba
			2.22	1.2833	BaS	BaSO ₃
1.5394	Au	AuCl	0.6496	1.3777	BaS	BaSO ₄
2.0898	Au	HAuCl ₄		1.4725	BaS	BaS ₂ O ₁
1.8172	A	·4H ₂ O	0.4785	0.6318	BaSO ₃	Ba
1.8172	A u	KAu(CN)	0 5500	1.0736	BaSO ₁	BaSO ₄ BaS ₂ O ₃
		·H ₂ O	0.5503	1.1475 0.4889	BaSO ₄	$Al_2(SO_4)_3$
3.2018	B	B ₂ O ₃	0.3123	0.4885	BaSO ₄	Ba
11.5596	В	KBF ₄	0.0865	0.8923	BaSO ₄	BaCl
1.2292	B ₂ O ₂	BO ₂	0.8135	1.0466	BaSO ₄	BaCl. 2H.(
1.6877	B ₂ O ₂	BO	0.5925	0.8455	BaSO ₄	BaCO ₃
1.1146	B ₂ O ₃	B ₄ O ₇	0.8972	1.0854	BaSO ₄	BaCrO ₄
1.7743	B ₂ O ₂	H.BO	0.5636	1.1197	BaSO ₄	Ba(NO ₂) ₂
3.6103	B ₂ O ₁	KBF	0.2770	0.6571	BaSO	BaO
2.7347	B ₂ O ₁	Na ₂ B ₄ O ₇	0.2.70	0.7256	BaSO ₄	BaO ₁
		·10H₂O	0.3657	0.8599	BaSO4	Ba ₂ (PO ₄) ₂
0.4915	KBF ₄	H ₃ BO ₃	2.0347	0.7258	BaSO ₄	BaS
0.7575	KBF ₄	Na ₂ B ₄ O ₇		1.0688	BaSO ₄	BaS ₂ O ₃
		·10H₂O	1.3202	0.5147	BaSO ₄	CaSO ₃
1.8594	Ba	$Ba(C_2H_3O_2)_2$	0.5378	0.5832	BaSO ₄	CaSO
1.8444	Ba	BaCrO ₄	0.5420	0.3766	BaSO ₄	FeS
1.6993	Ba	BaSO ₄	0.5885	0.1457	BaSO4	H ₂ S
1.4368	Ba	BaCO ₃	0.6960	0.3517	BaSO ₄	H ₂ SO ₃
1.8162	Ba	BaS ₂ O ₃	0.5506	0.4202	BaSO ₄	H ₂ SO
0.7002 0.9335	Ba	S_3 S_4	1.4283 1.0712	0.7465 1.0164	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	K ₂ SO ₄ K ₂ Al ₂ (SO ₄) ₄
1.1207	Ba BaCl ₂	BaSO ₄	0.8923	1.0104	D8304	·24H
0.4709	BaCl ₂	H ₂ SO ₄	2.1238	0.5834	BaSO ₄	KHSO4
. 1.2837	BaCO ₃	BaCrO ₄	0.7790	0.3334	BaSO ₄	MgO
0.7770	BaCO ₃	BaO	1.2869	1.0560	BaSO4	MgSO ₄ ·7H
0.0608	BaCO	C	16.4411	0.6469	BaSO4	MnSO
0.2229	BaCO	$\check{\mathrm{CO}}_2$	4.4853	0.4541	BaSO ₄	Na ₂ CO ₂
8.1696	C(in BaCO ₃)	H ₂ SO ₄	0.1223	0.4458	BaSO	NaHSO
0.5420	BaCrO ₄	Ba	1.8444	0.2656	BaSO ₄	Na ₂ O
0.6053	BaCrO ₄	BaO	1.6520	0.3344	BaSO ₄	Na ₂ S
0.9213	BaCrO	BaSO ₄	1.0854	0.5401	BaSO ₄	Na ₂ SO ₃
0.2052	BaCrO ₄	Cr	4.8725	0.3387	BaSO ₄	Na ₂ S ₂ O ₂
0.3947	BaCrO ₄	CrO_3	2.5337	0.6086	BaSO ₄	Na ₂ SO ₄
0.3000	BaCrO ₄	Cr_2O_3	3.3338	1.3804	BaSO ₄	Na ₂ SO ₄
1.4138	BaCrO ₄	$\operatorname{Cr}_2(\operatorname{SO}_4)_3$			D 20	·10H
0 #222	D 0 0	18H₂O	0.7073	0.5661	BaSO ₄	(NH ₄) ₂ SO ₄ .
0.7666	BaCrO ₄	K₂CrO₄	1.3046	1.2991	BaSO ₄	PbSO ₄
0.5807	BaCrO ₄	K₂Cr₂O₁	1.7224	0.1373	BaSO ₄	S
0.5723	Ba(OH) ₂	H_2SO_4	1.7473	0.2744	BaSO ₄	SO_2
	l	<u> </u>				<u> </u>

A'	A	В	B'	A'	A	В	B'
0.3430	BaSO ₄	SO ₂	2.9155	0.5133	CaF ₂	Са	1 9483
0.4115	BaSO4	SO4	2.4301	0.7182	CaF ₂	CaO	1.3924
0.4174	BaSO ₄	ZnS	2.3957	1.7438	CaF ₂	CaSO	0.5735
1.2318	BaSO ₄	ZnSO ₄ ·7H ₂ O	0.8118	0.4867	CaF ₂	F	2.0545
1.2010	Daboti	20001 1110	0.0220	0.5126	CaF ₂	HF	1.9508
See Gl.	Be			1.8485	CaF ₂	H ₂ SiF ₆	0.5410
56 6 Ci.	DC			1.0760	CaF ₂	NaF	0.9294
1.6681	Bi	BiAsO ₄	0.5995	0.3459	Ca(HCO ₂) ₂	CaO	2.8908
1.1154	Bi	Bi ₂ O ₃	0.8965	0.5429	Ca(HCO ₃) ₂	$\widetilde{\mathrm{CO}}_{2}$	1.8419
0.5994	BiAs()4	Bi	1.6683	0.4119	CaHPO	CaO	2.4276
0.8017	BiOCl	Bi	1.2474	0.9338	CaHPO	Ca ₂ P ₂ O ₇	1.0709
1.8658	BiOCl	Bi(NO ₂) ₂		0.5219	CaHPO	P ₂ O ₅	1.9161
		` 5H₂O	0.5359	0.7175	$Ca(H_2PO_4)_2$.	NaHCO ₁	1.3938
0.8942	BiOCl	Bi ₂ O ₃	1.1184	0.6067	Ca(H ₂ PO ₄) ₂	P ₂ O ₄	1.6483
1.1024	BiOCl	BiONO	0.9072	1.0833	CaH ₂ P ₂ O ₇	Ca(H ₂ PO ₄) ₂	0.9231
0.8965	Bi ₂ O ₂	Bi	1.1154	0.2594	CaH ₂ P ₂ O ₇	CaO	3.8553
1.4955	Bi ₂ O ₁	BiAsO ₄	0.6687	0.7773	CaH ₂ P ₂ O ₇ *	NaHCO:	1.2866
1.2328	Bi ₂ O ₃	BiONO ₃	0.8112	0.6573	CaH ₂ P ₂ O ₇	P ₂ O ₅	1.5214
2.08 67	Bi ₂ O ₃	Bi(NO ₃) ₃		0.2773	$Ca(HSO_3)_2$	CaO	3.6063
		·5H ₂ O	0.4792	0.6336	Ca(HSO ₃) ₂	SO ₂	1.5783
1.0691	Bi ₂ O ₃	Bi ₂ SO ₃	0.9354	0.6582	Ca(NO ₃) ₂	N ₂ O ₅	1.5192
0.8122	Bi_2S_3	Bi	1.2313	0.7146	CaO	Са	1.3993
′ 0 .9059	Bi ₂ S ₃	Bi ₂ O ₃	1.1039		CaO	$Ca(CH_3CO_2)_2$	0.3546
				1.9795	CaO	CaCl ₂	0.5052
1 .3498	Br	Ag	0.7408	1.7847	CaO	CaCO ₃	0.5603
1.7935	Br	AgCl	0.5576	1.3924	CaO	CaF_2	0.7182
2 .3498	Br	AgBr	0.4256	2.8908	CaO	$Ca(HCO_3)_2$.	0.3459
1 .0126	Br	HBr	0.9875	4.1766	CaO	$Ca(H_2PO_4)_2$	0.2394
0.1001	Br	0	9.9900		CaO	CaH ₂ P ₂ O ₇	0.2594
0.8433	BrO ₃	Ag	1.1858	3.6063	CaO	$Ca(HSO_3)_2$	0.2773
1.4681	BrO ₃	AgBr	0.6811	1.8446	CaO	$Ca_{1}P_{2}O_{1}$	0.5421
		0.01	0.0010	2.1427	CaO	CaSO	0.4667
2.7699	Ca	CaCl ₂	0.3610	2.4280	CaO	CaSO ₄	0.4119
1.3993	Ca	CaO	0.7146	3.0707	CaO	CaSO.·2H₂O	0.3257
1.7690	Ca	C1	0.5653 0.2944	2.1417 0.7848	CaO	CH ₂ CO ₂ H	0.4670
3.3973	Ca	CaSO ₄	1.2820	1.7494	CaO	<u>C</u> O₂	1.2743
0.7800	$Ca_1(AsO_4)_2$ $Ca(CH_1CO_2)_2$	Mg ₂ As ₂ O ₇ CaO	2.8203	2.0852	CaO	H ₂ SO ₄ NaCl	0.5716 0.4796
0.3546 0.7594			1.3169	1.8905	CaO CaO	Na ₂ CO ₃	0.4790
0.6202	$Ca(CH_2CO_2)_2$ $Ca(CH_2CO_2)_2$	H ₂ SO ₄	1.6124	2.5336	CaO	Na ₂ SO ₄	0.3247
0.0202	CaCl ₂	CaCO ₂	1.1091	0.5718	CaO	S	1.7489
0.5052	CaCl ₂	CaO	1.9795	1.4280	CaO	SO ₁	0.7003
1.2265	CaCl ₂	CaSO	0.8153	0.5421	Ca ₈ P ₂ O ₈	CaO	1.8446
0.6390	CaCl	Cl	1.5650	0.7178	Ca ₃ P ₂ O ₅	Mg ₂ P ₂ O ₇	1.3932
0.4004	CaCO	Ca	2.4975	12.0994	Ca ₂ P ₂ O ₃	(NH ₄),PO ₄	1.0002
1.1091	CaCO ₃	CaCl ₂	0.9016		Junga 108	12MoO ₂	0.0826
1.6197	CaCO ₂	Ca(HCO ₃) ₂	0.6174	0.4579	Ca ₃ P ₂ O ₈	P ₂ O ₅	2.1839
0.5603	CaCO3	CaO	1.7847	3.2362	CaS	BaSO ₄	0 3091
0.4397	CaCO	CO ₂	2.2743	1.9429	CaSO ₂	BaSO	0.5147
1.3604	CaCO	CaSO ₄	0.7351	0.4667	CaSO	CaO	2.1427
1.7204	CaCO3	CaSO ₄ ·2H ₂ O.	0.5813	1.7147	CaSO ₄	BaSO ₄	0.5832
1.3810	CaCO ₁	K ₂ CO ₃	0.7241				
1.0593	CaCOs	Na ₂ CO ₃	0.9441	0.8153	CaSO4	CaCl ₂	1.2265
0.7288	CaCO	HCl	1.3720	0.5735	CaSO4	CaF ₂	1.7438
0.7182	CaF ₂	AlF ₃	1.3925	0.4119	CaSO ₄	CaO	2.4280
	Ī]				
	<u>'</u>					<u> </u>	<u></u>

 $A \times A' = B$ $B \times B' = A$

[•] I'henolphthalein indicator.

. A'	A	В	В'	A'	A	В
0.2791 0.2939	CaSO ₄	F HF	3.5824 3.4021	0.2607	C ₄ H ₄ O ₆ HK	H ₂ SO ₄
0.7205	CaSO ₄	H ₂ SO ₄	1.3880	3.0423	<u>C</u> 1	Ag
0.5881 0.3257	CaSO ₄ CaSO ₄ ·2H ₂ O	SO ₃ CaO	1.7003 3.0707	4.0423 4.7910	C1	AgClAgNO ₂
0.8088	CaWO4	WO3	1.2364	1.2547	Cl	AlCl ₃
1.4296	Сь	Cb_2O_6	0.6995	3.5726 2.6645 0.5653	Cl	BaCrO ₄ CH ₂ ClCO ₂ H. Ca
1.6310	Çd	CdCl ₂	0.6131	1.5650	Cl ₂	CaCl ₂
2.1033 1.1423	Cd	$Cd(NO_3)_2$ CdO	0.4754 0.8754	4.7454 0.5358	Cl	CsCl
1.2853	Cd	CdS	0.7780	1.0284	Či	HCl
1.8547	Çd	CdSO₄	0.5392	1.3831	<u>C</u> 1	H ₂ SO ₄
0.2853 1.4277	Cd	SCdCl.	3.5059	3.5792 1.1027	Cl	I
1.1251	CdO	CdS	0.8888		Či	KKCl
1.6235	CdO	CdSO₄	0.6159	3.4563	<u>C</u> 1	KClO ₁
1.2690 1.6365	CdS	$CdCl_2$ $Cd(NO_2)_2$		3.9075 0.1957	Cl	KClO4 Li
1.4430	CdS	CdSO4		0.3429	Či	Mg
0.2359	CdS	H.S		1.3429	<u>C</u> 1	MgCl ₂
0.2220	CdS	8	4.5059	2.8672 0.5685	C1	MgCl ₂ ·6H ₂ O. MgO in
2.1340	Ce	$Ce_2(C_2O_4)_3$ $3H_2O$	0.4686	1.2257	Cl	MgCl ₂ MnO ₂
2.7685	Ce	$Ce(NO_2)_{A}$	0.3612	0.6486	Ci	Na
4.0385	Ce	Ce(NO ₂) ₄		1.6486	C1	NaCl
	,	(NH ₄ NO ₃) ₂ H ₂ O	0.2476	3.0023 3.4535	Cl	NaClO ₃ NaClO ₄
1.1711	Ce	Ce ₂ O ₃	0.8539	0.5088	Cl	NH
1.2282	Ce	CeO ₂	0.8142	1.5088	Cl	NH.Cl
3.0548 2.2542	Ce CeO ₁	$Ce(SO_4)_3$ $Ce(NO_3)_4$	0.3274	0.2256 2.4098	C1	O Rb
1.0487	Ce ₂ O ₂	CeO ₂	0.9536	3.4098	C1	RbCl
2.3640	Ce ₂ O ₃	Ce(NO ₃) ₄	0.4230	0.8368	Cl	Sn in SnCl
0.3753	CH,ClCO,H.	C1	2.6645	1.8369 3.9216	Cl	SnCl_{2}
0.5446	СНСНОН			4.5572	Cl	PbCrO₄
1.3169	CH CO H	H ₂ SO ₄	1.8366 0.7594	2.6737 1.9217	Cl	$SnCl_2$ $ZnCl_2$
1.3663	CH ₂ CO ₂ H CH ₂ CO ₂ H	Ca(CH ₃ CO ₂) ₂ CH ₃ CO ₂ Na	0.7319	0.8934	ClO ₂	KCl
0.8499	CH ₂ CO ₂ H	(CH ₂ CO) ₂ O	1.1766	1.7175	ClO ₃	AgCl
0.8167 0.8828	CH ₂ CO ₂ H	H ₂ SO ₄	1.2244 1.1327	0.7005 1.4412		NaCl AgCl
0.5164	CH ₂ CO ₂ H CH ₂ CO ₂ H	Na ₂ CO ₂ Na ₂ O	1.9368	0.7496	ClO ₄	KCl
1.7255	CH ₂ CO ₂ H	Pb	0.5796	0.5878	ClO₄	NaCl
0.5979 0.3779	CH ₃ CO ₂ Na CH ₃ CO ₂ Na	H ₂ SO ₄ Na ₂ O	1.6729 2.6463	4.1472	CN	Δσ
0.8660	CH ₃ CO ₂ Na	Na ₂ SO ₄	1.1547	5.1472	CN	AgCN
0.9609	(CH ₃ CO) ₂ O	H ₂ SO ₄	1.0407	2.8577	CNS	AgCNS
1.0897 0.7782	CHO.2HO	H ₂ SO ₄ H ₂ SO ₄	0.9177 1.2851	0.7240 4.9361	CNS	$(CN)_2S$ $Co(NO_3)_2$
0.6537	$\begin{array}{c} C_2H_2O_4 \cdot 2H_2O \\ C_4H_6O_6 \cdot \cdot \cdot \cdot \cdot \end{array}$	H ₂ SO ₄	1.5298		· · · · · · · · · · · · · · · · · · ·	6H ₂ O
1.1197	C ₄ H ₆ O ₆	NaHCO ₃	0.8931	7.6706	Co	$Co(NO_2)_3$ $(KNO_2)_3$
			<u> </u>			(KINO2)3

	Α .	В	B'	A'	А	В	B.'
	Co	C ₀ O	0.7866	3.8476	CrO ₂	PbCrO ₄	0.2599
: <u> </u>	Co	Co ₃ O ₄	0.7343	2.5337	CrO ₃	BaCrO ₄	0.3947
- 1	Co	CoSO4	0.3804	1.9420	CrO ₃	K₂CrO₄	0.5149
- [Co	CoSO ₄ ·7II ₂ O	0.2097		CrO ₃	K ₂ Cr ₂ O ₇	0.6798
- 1	C ₀ O	Co ₂ O ₄	0.9336		CrO ₃	PbCrO ₄	0.3094
- [C ₀ O	Co(NO ₂) ₃	0.000	4.2526	Cr ₂ O ₃	PbCrO4	0.2351
•	0001111111	(KNO ₂) ₃	0.1657	1.3158	Cr ₂ O ₃	CrO ₃	0.7600
1	CoO	CoSO	0.4836				
1	~		0.0000	0.2670	Cs	Cl	3.7453
I	CO ₂	BaCO ₃	0.2229	1.2670	C₃	CsCl	0.7893
	CO ₂	BaO	0.2869	1.0602	C ₈	Cs ₂ O	0.9432
1	CO ₂	Ba(HCO ₁) ₂	0.3393		Cs	Cs ₂ CO ₃	0.8157
	ÇO ₂	C	3.6656		Cs	Cs₂SO₄	0.7344
ł	CO ₂	CaCO ₃	0.4397	0. 394 5	Cs ₂ PtCl ₆	Cs	2.5359
	CO ₂	Ca(HCO ₃) ₂	0.5429	0.4182	Cs₂PtCl ₆	Cs ₂ O	2.3918
_	CO ₂	CaO	0.7847	1.1950	Cs ₂ O	CsCl	0.8368
r	CO ₂	CO	1.5713		Cs ₂ O	Cs ₂ SO ₄	G . 7786
	CO ₂	CqCO3	0.2552	0.4996	Cs₂PtCl ₆	CsCl	2.0015
	CO ₂	CO ₂		0.4834	Cs.PtCla	Cs ₂ CO ₂	2.0686
	CO ₂	Cs ₂ CO ₃	0.1351	0.9305	Cs ₂ SO ₄	CsCl	1.0747
	CO ₂	FeCO ₁	0.3798	0.9003	Cs ₂ SO ₄	Cs ₂ CO ₂	1.1107
	CO ₂	Fe(HCO ₃) ₂	0.4951				
	CO2	H ₂ SO ₄	0.4487	1.2517	Cu	CuO	0.7989
	CO ₂	K ₂ CO ₃	0.3184	1.1258	Cu	Cu ₂ O	0.8882
	CO2	K ₂ O	0.4671	1.2522	Cu	Cu ₂ S	0.7986
	CO ₂	Li₂CO₃	0.5956	2.5112	Cu	CuSO ₄	0.3982
			0.6476	3.9283		CusO ₁	0.3562
	CO_2	LiHCO ₁	1.4727		Cu	CuSO ₄ ·5H ₂ O	
	CO ₂	Li ₂ O	1.4/2/	0.5226	CuCNS	Cu	1.9137
	CO ₂	MgCO ₃	0.5218	0.6541	CuCNS	CuO	1.5288
	C O₂	$Mg(HCO_3)_2$	0.6013	2.0062	C uO	CuSO ₄	0.4985
	C O₂	MgO	1.0913	1.2327	C uO	H ₂ SO ₄	0.8112
	$\mathcal{L}_{\mathbf{Q}_{2}}^{\mathbf{Q}_{2}}$	MnCO ₃	0.3828	3.1383	CuO	CuSO ₄ ·5H ₂ O	0.3186
	CO_2	$Mn(HCO_3)_2$	0.4973	0.3353	CuS	8	2.9828
	CO ₂	MnO	0.6203	0.9996	Cu₂S	CuO	1.0004
	CO ₂	Na ₂ CO ₂	0.4151	0.8991	Cu₂S	Cu₂O	1.1122
	CO ₂	NaHCO ₃	0.5238	3.1371	Cu ₂ S	CuSO ₄ ·5H ₂ O.	0.3188
	CO ₂	Na ₂ SO ₄	0.3098				
	CO ₂	Na₂O	0.7097	0.8746	Er ₂ O ₃	Er	1.1433
	CO ₂	(NH ₄) ₂ CO ₃	0.4579				
,	CO ₂	PbCÓ ₁	0.1647	2.4533	F	BaSiF ₆	0.4076
	CO ₂	Rb ₂ CO ₃	0.1906	2.0545	F	CaF ₂	0.4868
	CO ₂	RbHCO ₃	0.3006	3.5827	F	CaSO	0.2791
ı	CO2	Rb ₂ O	0.2354	1.0531	F	HF	0.9496
ı	CO ₂	SrCO ₂	0.2981	1.2660	F	H ₂ SiF ₆	0.7899
•	CO_2	Sr(HCO ₃) ₂	0.4198	1.9342	F	K ₂ SiF ₆	0.5170
1	CO ₂	SrO	0.4246	2.2105	F	NaF	0.3170
1	CO ₂	ZnCO ₂	0.3510	1.6518	F	Na ₂ SiF ₆	0.6054
4				1.0010	*	1102011 6	
1	Cr	BaCrO ₄	0.2052	2.2701	Fe	FeCl ₂	0.4405
٠, ١	Cr	Cr ₂ O ₃	0.6842	2.9051	Fe	FeCl	0.3442
١.	Cr	PbCrO	0.1609	4.8410	Fe	FeCl ₂ ·6H ₂ O	0.2066
3	Čr	K ₂ CrO ₄	0.2678	3.1851	Fe	Fe(HCO ₂) ₂	0.3140
8	Cr	K ₂ Cr ₂ O ₇	0.3535	1.2865	Fe	FeO	0.3140
ň	CrO ₂	BaCrO ₄	0.3315	1.4298	Fe	Fe ₂ O ₃	0.7773
- 74			U. 0010	1.7200	T.C	I 1 02 03 · · · · · · ·	U.U884
8	C-0.			1 2000	l Fo	Fa O	ሰ ማባባል
15	CrO ₁	CrO ₁	0.8400	1.3820	Fe	Fe ₃ O ₄	0.7236

A'	A	В	B'	A'	A	. В
2.7020	Fe	FePO ₄	0.3701	0.6938	GeO ₂	Ge
1.5743	Fe	FeS	0.6352	0.2739	K ₂ GeF ₄	Ge
2.1483	Fe	FeS ₂	0.4655	0.2.00	112001 6	<u> </u>
2.7205	Fe	FeSO ₄	0.3676	0.3626	G10	Gl
		F-90 TILO				0101
4.9789	Fe	FeSO ₄ ·7H ₂ O.	0.2008	3.1881	G10	GlCl.
3.5807	<u>F</u> e	$Fe_2(SO_4)_3$	0.2793	7.0607	GlO	GISO ₄ ·4H ₄ O
7.0225	Fe	FeSO ₄ (NH ₄) ₂	1494	0.0262	77	H.O
0.5643	Fe(titr.	SO₄6H₂O	0.1424	8.9363 0.5636	H	B ₂ O ₂
0.0010	equiv.)	HNO ₃	1.7721	1.3330	HBr	Ag
0.7820	Fe	Na ₂ Cr ₂ O ₇	1 2788	2.3206	HBr	AgBr
0.3798	FeCO ₃	CO ₂	2.6327	3.9305.	HCi	AgCl
	FeCUS			0.9000.		
0.4948	Fe(HCO ₃) ₂	CO ₂		1.3720	HCI	CaCO ₃
0.4742	F eO	Al_2O_3	2.1088	0.9724	HCl	<u>Cl</u>
1.6125	F eO	FeCO ₃	0.6202	1 2893	HCl	HNO ₂
2.4757	Fe O	Fe(HCO ₃) ₂	0.4039	1.7280	HCl	HNO ₃
1.1114	FeO	Fe ₂ O ₃	0.8998	1.1255	HCl	H ₂ SO ₂
2.1002	FeO	FePO	0.4761	1.3448	HCl	H.SO
1.2237	FeO	FeS		2.0445	HCl	KCl
1.6698	FeO	FeS,	0.5989	1.2915	HCI	K ₂ O
2.1146	FeO	FeSO ₄	0.4729		HČi	NaCl
3.8700	FeO	FeSO ₄ ·7H ₂ O	0.2584		HCI	Na ₂ CO ₃
		11 00	0.2004	1 4000	HCI	NH.Cl
1.3653	FeO	H ₂ SO ₄	0.7324			NILCI
1.1146	FeO	803	0.8972		HCl	SnCl
0.6400	$\underline{Fe_2O_3}$	Al ₂ O ₃	1.5625	2.8089	HCNS	AgCNS
2.0318	Fe ₂ O ₃	FeCl ₃	0.4922	2.0589	HCNS	CuCNS
1.4509	Fe ₂ O ₃	FeCO ₃	0.6892	3 .9510	HCNS	BaSO ₄
2.2277	Fe_2O_3	Fe(HCO ₃) ₂	0.4489			
0.9666	Fe ₂ O ₂	Fe ₂ O ₄	1.0346	1.0658	HCO₂H	H ₂ SO ₄
1.8898	Fe ₂ O ₃	FePO4	0.5292			
1.1011	Fe ₂ O ₃	FeS	0.9082	2.3297	HF	BaSiF
1.5028	Fe ₂ O ₃	FeS ₂	0.6655	1.9508	HF	CaF ₂
1.9027	Fe ₂ O ₃	FeSO ₄	0.5256	3 4021	HF	CaSO
3.4822	Fe ₂ O ₃	FeSO ₄ 7H ₂ O.		0.9496	HF	F
4.9118	Fe ₂ O ₂	FeSO ₄ (NH ₄) ₂	0.2012			
4.9110	re203		0.000	2.4510	HF	H ₂ SO ₄
	n 0	SO ₄ ·6H ₂ O	0.2036	1.8368	HF	K_2SiF_6
2.5041	$\operatorname{Fe_2O_3}$	$Fe_2(SO_4)_3$	0.3993	3.6065	HF(2HF)	H-SiF ₆
1.8428	Fe ₂ O ₃	H_2SO_4	0.5427	1.2022	HF(6HF)	H₂SiF ₆
1.5041	Fe ₂ O ₃	SO_3	0.6648			
0.4708	FePO ₄	$P_2O_5 \dots$	2.1239	1.1768	Hg	HgCl
2.6554	FeS	BaSO₄	0.3766	1.3535	Hg	HgCl2
0.3877	FeS	H ₂ S	2.5795	1.0798	Hg	HgO
1.1155	FeS	H_2SO_4	0.8963	1.1599	Hg	HgS
0.3648	FeS	S	2.7417	1.1125	HgCl	HgNO ₃
0.6654	FeS	Fan	1.5025	0.9856	HgCl	HgS
		$Fe_2O_3 \dots$				SnCl ₂
0.5346	FeS ₂	S	1.8709	0.4017	HgCl	
0.6457	FeSO4	H ₂ SO ₄	1.5487	0.5519	HgCl	SnCl ₄
0.5271	FeSO4	SO_3	1.8973	0.8694	HgCl ₂	HgCl
0.3528	$FeSO_4 \cdot 7H_2O$.	H ₂ SO ₄	2.8345	0.8569	$\mathrm{HgCl_2}$	HgS
0.7358	$Fe_2(SO_4),\ldots$	H ₂ SO ₄	1.3590	1.0898	H g O	HgCl
0.1114	FeSO ₄ (NH ₄) ₂			1.1316	Hg ₂ O	HgCl
	SO ₄ ·6H ₂ ()	Na ₂ Cr ₂ O ₇	8.9802		HgS	Hg(CN)₂
		l		1.1287	HgS	HgNO ₃
0.7450	Ga_2O_3	Ga	1.3424	1.3952	HgS	Hg(NO ₁) ₂
0.5931	Ga ₂ S ₃	Ga	1.6860	0.8966	HgS	Hg ₂ O

AI			1		70	D/
	B	B'	A'	A	В	B'
HgS	HgO	1.0741	2.0391	H ₂ SiF ₆	H ₂ SO ₄	0.4904
HgS	HgSO4	0.7843	1.5279	H ₂ SiF ₆	K ₂ SiF ₆	0.6545
			0.7227	H ₂ SiF ₆	SiF4	1.3837
HI	Ag	1.1859	0.9860	H ₂ SiF ₆	SiF ₆	1.0141
HI	AgI	0.5448	0.7699	H ₂ SiO ₂	SiO ₂	1.2988
HI	Pd	2.3979				
HI	PdI2	0.7097	2.8441	H ₂ SO ₃	BaSO ₄	0.3517
HI	TII	0.3866	0.8885	H ₂ SO ₃	HCl	1.1255
			1.1949	H ₂ SO ₃	H ₂ SO ₄	0.8369
HNO2	AgNO ₂	0.3055	Q.7805	H ₂ SO ₃	SO ₂	1.2812
HNO2	HCl	1.2893				
HNO2	H ₂ SO ₄	0.9587	0.9072	H ₂ SO ₄	AlCl ₃	1.1023
HNO ₂	NO	1.5667	0.3473	H ₂ SO ₄	Al ₂ O ₃	2.8789
HNO2	NH ₂	2.7605	1.1636	H_2SO_4	$Al_2(SO_4)_3$	0.8594
HNO ₃	C1	1.7772	1.7473	H ₂ SO ₄	Ba(OH)2	0.5723
HNO	HCl	1.7280	2.3800	H ₂ SO ₄	BaŠO	0.4202
HNO2	H ₂ SO ₄	1.2850	0.1223	H ₂ SO ₄	C(in BaCO ₃).	8.1696
HNO ₃	KNO ₃	0.6233	1.6124	H ₂ SO ₄	$Ca(CH_1CO_2)_2$	0.6203
HNO ₂	N		0.5716	H ₂ SO ₄	CaO	1.7494
HNO ₂	NaNO ₂	0.7413	1.3878	H ₂ SO ₄	CaSO4	0.7205
HNO ₂	NH ₂	3.7000	1.8366	H ₂ SO ₄	СН,СНОН	
HNO3	NH ₄ Cl	1.1780			CO ₂ H	0.5446
HNO ₃	(NH ₄) ₂ PtCl ₆	0.2838	1.2244	H ₂ SO ₄	CH ₂ CO ₂ H	0.8169
HNO3	NO	2.0999	1.6729	H ₂ SO ₄	CH ₂ CO ₂ Na	0.5979
HNO3	N_2O_3	1.6579	1.0407	H ₂ SO ₄	$(CH_2CO_2)_2O$.	0.9609
HNO ₂	N_2O_4	1.3697	0.9177	H ₂ SO ₄	$C_2H_2O_4$	1.0894
HNO ₂	N_2O_5	1.1668	1.2851	H ₂ SO ₄	$C_2H_2O_4 \cdot 2H_2O$	0.7782
HNO ₃	Pt	0.6457	1.5298	H ₂ SO ₄	C ₄ H ₆ O ₆	0.6537
		1 0000	0.7230	H ₂ SO ₄	Cl ₂	1.3831
H ₂ PO ₄	HPO ₃	1.2251	0.4487	H ₂ SO ₄	CO ₂	2.2287
H,PO	H ₄ P ₂ O ₇	1.1012	1.6275	H ₂ SO ₄	CuSO₄	0.6144
H.PO	H ₂ SO ₄	0.9998	0.5694	H ₂ SO ₄	Fe	1.7564
H ₂ PO ₄	Mg ₂ P ₂ O ₇	0.8806 3.1593	0.7324 0.5427	H ₂ SO ₄ H ₂ SO ₄	FeO Fe ₂ O ₂	1.3653 1.8428
H ₂ PO ₄	P	1.3804	0.8963	H ₂ SO ₄	FeS	1.1155
H ₂ PtCl ₆	P ₂ O ₅	1.3004	1.5487	H ₂ SO ₄	FeSO ₄	0.6457
6H ₂ O	Pt	2.6541	2.8345	H ₂ SO ₄	FeSO₄·7H ₂ O.	0.3528
-01120	1	2.0011	1.3590	H.SO.	Fe ₂ (SO ₄)	0.7358
H-S	As ₂ S ₃	0.4154	0.9651	H-SO	H.AsO.	1.0362
H.S	As ₂ O ₄	0.7410	0.7436	H ₂ SO ₄	HCl	1.3448
H ₂ S	BaSO	0.1460	0.9177	H-SO.	H ₂ C ₂ O ₄	1.0894
H ₂ S	CdS	0.2360	0.9383	H.SO.	HCO ₂ H	1.0658
H ₂ S	FeS	0.3877	0.4080	H ₂ SO ₄	HF	2.4510
H.S*	H ₂ SO ₄	0.3474	0.9587	H ₂ SO	HNO ₂	1.0436
H ₂ S	S	1.0629	1.2850	H.SO	HNO2	0.778
H ₂ S	$\widetilde{\mathrm{SO}}_{2}$	0.5319	0.9998	H-SO.*	H.PO	1.000
H ₂ S	SO ₁	0.4258	0.3474	H-SO.*	H ₂ S	2.8782
			0.8369	H ₂ SO ₄ *	H-SO	1.1949
H ₂ SeO ₃	Se	1.6315	0.4904 2.4293	H ₂ SO ₄	H ₂ SiF ₆ K ₂ Al ₂ (SO ₄) ₄	2.0388
H ₂ SiF ₆	BaSiF ₆	0.5160	4.7400	118504	·24H ₂ O	0.4116
H ₂ SiF ₆	CaF ₂	1.8485	3.8370	H-SO4	KHC ₄ H ₄ O ₆	0.260
H ₂ SiF ₆	F	1.2660	2.0617	H ₂ SO ₄	KNO ₁	0.485
H_2SiF_6	2HF	3.6065		H ₂ SO ₄	K.O	1.0413
H ₂ SiF ₆	6HF	1.2022	1.1442	H.SO	кон	0.874
	l	1	1		l	1

 $A \times A' = B$ $B \times B' = A$

^{*} Phenolphthalein indicator.

XVIII.—CONVERSION FACTORS (Continued)

		· · · · · · · · · · · · · · · · · · ·				ı
A'	A	В	В'	A'	A	В
1.1241 1.7767	H ₂ SO ₄	K ₂ SiF ₆ K ₂ SO ₄	0.8896 0.5628	2.6074	I	Tl
0.4111	H ₂ SO ₄	MgO	2.4325	1.2090	In	In ₂ O ₂
1.2274	H ₂ SO ₄	MgSO ₄	0.8147	1.4187	In	In ₂ S ₃
1.1920	H ₂ SO ₄	NaCl	0.8389			
1.0808	H.SO.†	Na ₂ CO ₃	0.9252	1.1243	Ir	Ir ₂ O ₃
1.3661 2.6711	H ₂ SO ₄	Na ₂ C ₂ O ₄ Na ₂ Cr ₂ O ₇	0.7320 0.3744	3.5437	K	KClO ₄
1.7132	H ₂ SO ₄ †	NaHCO ₁	0.5837	1.2046	K	K ₂ O
2.4583	H-SO.*	NaH.PO	0.4085	6.2169	K	K ₂ PtCl ₄
2.8964	H ₂ SO ₄ †	Na ₂ HPO ₄	0.3453	2.2285	K	K.SO
2.1222	H ₂ SO ₄	NaHSO ₃	0.4712	0.0571	K ₂ Al ₂ (SO ₄) ₄	
1.7334	H ₂ SO ₄	NaNO ₃	0.5769	0 1077	24H ₂ O	Al
0.6321 0.8158	H ₂ SO ₄	Na ₂ O NaOH	1.5820 1.2258	0.1077 0.4556	ditto ditto	Al ₂ O ₂
1.1151	H ₂ SO ₄	Na ₂ PO ₄	0.8968	0.4116	ditto *	H ₂ SO ₄
0.7959	H.SO	Na ₂ S	1.2564	0.4134	ditto(total)	H ₂ SO ₄ (+Al
0.9598	H ₂ SO ₄	Na ₂ SiF ₆	1.0418			+K)
2.5706	H ₂ SO ₄	Na ₂ SO ₃	0.3890	0.1352	ditto	S
1.4485	H ₂ SO ₄	Na ₂ SO ₄	0.6904	0.3374	ditto	<u>§</u> O₃
0.3473	H ₂ SO ₄	NH.	2.8792	0.0824	ditto	K
1.0909 0.5310	H ₂ SO ₄ H ₂ SO ₄	NH4Cl (NH4)2O	0.9167 1.8850	0.0993 0.9756	ditto K ₂ Al ₂ (SO ₄) ₄	K ₂ O NaHCO ₃
0.6948	H ₂ SO ₄	(NH ₄) ₂ S	1.4392	0.7575	KBF ₄	Na ₂ B ₄ O ₇
1.3473	H.SO.	(NH ₄) ₂ SO ₄	0.7422	0.10.0	1101 (10H ₂ O
2.3268	H ₂ SO ₄	(NH ₄) ₂ S ₂ O ₈	0.4298	0.9064	KBr	Ag
0.7750	H ₂ SO ₄	N ₂ O ₃	1.2903	1.5779	KBr	AgBr
0.9382	H ₂ SO ₄	N ₂ O ₄	1.0659	0.6715	<u>KBr</u>	Br
1.1013	H ₂ SO ₄	N ₂ O ₅	0.9080	0.3285	KBr	K
0.0275	H ₂ SO ₄ ‡	D	36.336	1.4469 1.9225	KCl	Ag AgCl
0.4829	(Y ppt.) H ₂ SO ₄	P_1O_5	1.0709	0.4756	KCl	Ci
0.0629	H ₂ SO ₄ ‡	1 208	1.0100	0.4891	KCI	HCI
	(Y ppt.)	P ₂ O ₅	15.878	1.6438	KCl	KClO ₃
0.3267	H ₂ SO ₄	S	3.0590	1.8584	KCl	KClO4
0.6532	H ₂ SO ₄ †	$ \mathrm{SO}_2$	1.5309	2.5233	KCl	KHC ₄ H ₄ O ₆
1.3064	H ₂ SO ₄ *	$ \underset{SO}{\text{SO}_2} \dots $	0.7655	3.2602	KCl	K₂PtCl ₆
0.8163 1.0912	H ₂ SO ₄	$SO_3S_2O_{\delta}Cl_2$	1.2250 0.9164	1.1686 1.3090	KCl	K_2SO_4
1.1881	H ₂ SO ₄	SO ₃ HCl	0.8417	1.1696	KClO ₁	AgCl
0.4084	$H_2\widetilde{SO}_4$	TiO ₂	2.4488	0.2893	KClO ₁	CÎ
0.6665	H ₂ SO ₄	Zn	1.5004	0.3843	KClO ₃	K ₂ O
0.8296	H_2SO_4	Z nO	1.2054	0.3399	KClO ₄	K₂O
1.6459	H ₂ SO ₄	ZnSO ₄	0.6076	1.6568	KCN	Ag
0.8500	I	A =	1 1765	2.0564	KCN	AgCN
1.8500	I	Ag AgI	1.1765 0.5405	2.2014 0.3184	KCN	CÖ2
0.2794	İ	ČÎ	3.5792	0.8120	K ₂ CO ₃	кон
1.0079	Ĭ	HI	0.9921	1.2610	K₂CO₃	K₂SO₄
1.3081	I	KI	0.7645	1.3046	K₂CrO₄	BaCrO ₄
1.6863	Ţ	$ KIO_3 $	0.5930	0.5149	K₂CrO₄	CrO3
1.5594	Į	NaIO ₃	0.6413	1.7224	K₂Cr₂O ₇	BaCrO ₄
0.4967 0.4203	I	$egin{array}{ll} { m Na_2SO_3} \\ { m Pd} \end{array}$	2.0135 2.3790	0.6800 1.1388	$K_2Cr_2O_7$ $K_2Cr_2O_7$	CrO ₃ Fe
1.4204	I	PdI ₂	0.7040	0.3200	$K_2Cr_2O_7$	K₂O
1.1201	*	A (4A2	0.7040	. 0200	11201207	
			<u> </u>		'	

 $A \times A' = B$ $B \times B' = A$

^{*} Phenolphthalein

A' A B B' A' A B' B' \$4395 KHCO, CO, 2.2752 0.8896 K,SiFt, H,SO, 1.124 \$4,7763 KHCO, K,SO, 1.1490 0.5270 K,SiFt, KF 1.897 \$4,7645 KI I 1.3081 0.4730 K,SiFt, SiFt, 2.114 \$6,6399 KHSO, K,SO, K 2.262 S,SO, 1.5081 3.056 \$7645 KI I 1.3081 0.3903 K,SiD, SiO, 2.562 \$4995 KMnO, MnO, 2.0022 0.4820 K,SO, K 2.228 \$4820 KMnO, Mando, 2.2022 0.4855 K,SO, KCO, 1.176 \$4820 KMnO, Mando, 2.2022 0.4855 K,SO, KCO, 1.180 \$4820 KMnO, MsAO, 2.0179 0.4505 K,SO, K,SO, K,CO, 1.204								
1.740 KHCO K,SO 1.1490 0.5270 K,SiF KF 1.897 1.7414 KHSO BaSO 0.5834 0.4730 K,SiF SiF SiF SiF 3.656	A'	A	В	B'	A'	A	В′	B'
1.740 KHCO K,SO 1.1490 0.5270 K,SiF KF 1.897 1.7414 KHSO BaSO 0.5834 0.4730 K,SiF SiF SiF SiF 3.656	4395	KHCO	CO	2.2752	0.8896	K ₂ SiF ₄	H-SO.	1 124
1,7141 KHSO. BaSO. 0.5834 0.4730 K,SiF. SiF. 2.114	8703						KF	
6.6399 KHSO. KSO. 1 5628 0.2735 K,SiG. 3 656° 6.7645 KI I 1 3081 0.3903 K,SiG. SiG. 2 562 6.23255 KI K 4 2460 0.5628 K,SGO. H,SGO. 1 1776° 6.2826 KMnO. MnpO. 2 0721 0.8557 K,SGO. KCI 1 168 6.28408 KMnO. NaMnO. 1 1134 0.7930 K,SGO. K,CO. 1 1.261 6.2408 KNO. NaNO. 1 1134 0.7930 K,SGO. K,CO. 1 1.850 7.2401 KSGO. K,CO. 1 1.261 K,SGO. K,CO. 1 1.850 7.2401 KSGO. KNO. NAO. 1 8.590 K,SGO. K,CO. 1 1.850 8.2402 KNO. NAO. 1 1.440 1 1.727 La. La.CO. 0 1.851 8.342 KOH K,GO. 1 1.913 Li.CO. 1 1.400 0 4.644 8.7117 KO		KHSO					SiF	
8,764.5 KI I 1.3081 0.3903 K,SiO, SiO, 2.5622 8,499.5 KMnO, Mn,O, 2.0022 0.4487 K,SO, K 2.228 8,482.6 KMnO, Mn,O, 2.0721 0.8557 K,SO, KC 1.168 9,4881 KMnO, NaMnO, 1.1134 0.7930 K,SO, K,CO, 1.2611 9,4898 KNO, H,SO, 2.0617 0.5405 K,SO, K,CO, 1.2811 9,2968 KNO, NANO, 1.1894 0.6327 K,SO, K,FUCI, 0.3584 9,2968 KNO, NO. 1.8721 0.6059 K,SO, K,G 1.580 9,2968 KNO, NO. 1.8721 0.6059 K,SO, K,G 1.580 1,2315 KOH H,GO, 1.1913 L La La,O, 0.8524 1,2315 KOH K,GO, 1.1913 L Li Li LiCI 0.1632 <th></th> <th>KHSO.</th> <th>K-SO.</th> <th></th> <th></th> <th></th> <th></th> <th></th>		KHSO.	K-SO.					
\$\begin{align*}{2} \text{5} \text{ KMn0. } \text{ Mn0.0} \text{ Mn0.0} \text{ 2.024 } 0.487 \text{ K,SO. } \text{ K,SO. } \text{ KCl. } 1.168 \text{ K,SO. } \text{ KCl. } 1.168 \text{ K,SO. } \text{ KCl. } 1.168 \text{ K,SO. } \text{ KCl. } 1.168 \text{ K,SO. } \text{ KCl. } 1.261 \text{ 1.68 \text{ K,SO. } \text{ KCl. } 1.261 \text{ 1.68 \text{ K,SO. } \text{ KCl. } 1.261 \text{ 1.68 \text{ KNO. } \text{ K,SO. } \text{ KCl. } 1.261 \text{ 1.68 \text{ KNO. } \text{ KNO. } \text{ KNO. } \text{ KNO. } \text{ K,SO. } \text{ KCl. } 1.235 \text{ Co. } 1.2811 \text{ M.NO. } \text{ K,PCl. } 0.4159 \text{ 2.7897 } \text{ K,SO. } \text{ K,Cl. } 1.358 \text{ 8.542 } \text{ KNO. } \text{ NO. } \text{ N.O. } \text{ N.O. } 1.8721 \text{ 0.6059 } \text{ K,SO. } \text{ K,SO. } \text{ K,SO. } \text{ 2.176 } \text{ K,SO. } \text{ KNO. } \text{ N.O. } \text{ N.O. } \text{ N.O. } \text{ 1.1440 } \text{ 1.1420 } 1.1	7645			1 3081				2 562
8.4995 KMnO, Mn ₁ O ₁ 2.0022 0.4876 K,SO. K 2.188 8.4826 KMnO, NaMnO, 1.1134 0.7920 K,SO. K,CO. 1.281 8.4850 KNO, H,SO. 2.0617 0.5405 K,SO. K,CO. 1.2810 8.4850 KNO. H,SO. 2.0617 0.5405 K,SO. K,CO. 1.2810 8.4940 KNO. NANO. 1.1894 0.6327 K,SO. K,PtCla. 0.358 8.2048 KNO. NANO. 1.1894 0.6327 K,SO. K,PtCla. 0.358 8.711 KOH H,SO. 1.1140 1.1727 La. La.0. 0.2176 8.8741 KOH K,GO. 0.8120 1.1727 La. La.0. 0.8521 8.7131 KOH K,GO. 1.8191 1.1727 La. La.0. 0.8521 8.7131 KOH NaO 1.11913 La.0. La.0. 0.8521			lĸ	4 2460			H-SO.	
6.8926 KMnO. Mn.O. 2.0721 0.8557 K.SO. KCO. 1.188 6.8981 KMnO. NaMnO. 1.134 0.7930 K.SO. K.CO. 1.281 2.4041 KNO. H.SO. 2.0617 0.5405 K.SO. K.FCL. 0.3589 2.9088 KNO. NANO. 1.1894 0.6327 K.SO. K.SO. S.S. 1.580 4.5342 KNO. NO. 3.3694 0.4595 K.SO. K.SO. SO. 2.176 4.5342 KNO. NO. 1.8721 0.6059 K.ASO. M.G. 1.1580 4.5342 KNOH H.SO. 1.11440 1.2015 KAH K.SO. M.G. 1.650 4.8741 KOH H.SO. 1.1913 L. L.L. L.C. 0.852 2.8394 KOH K.GO. 1.1913 L. L.C. 0.187 4.7117 K.BARSO. M.B.SA.O. 1.4024 1.902 1.1251 L			Mn ₀ O ₁			K-SO.	K	
6.4850 KNO. NAMO. 1.1134 0.7930 K.SO. K.GO. 1.2611 0.5405 K.SO. K.GO. 1.850 2.4041 KNO. H.SO. 2.6017 0.5405 K.SO. K.GO. 1.850 6.4850 KNO. NANO. 1.1894 0.6327 K.SO. K.SO. K.PtCla 0.358 6.4808 KNO. NANO. 1.1894 0.6327 K.SO. K.SO. K.PtCla 0.358 1.5860 KNO. NO. 3.3694 0.4595 K.SO. SO. 2.176 6.6342 KNO. N.O. 1.8721 0.6059 K.SO. SO. 2.176 6.6342 KNO. N.O. 1.8721 0.6059 K.SO. SO. 2.176 6.6342 KNO. N.O. 1.8721 0.6059 K.SO. SO. 2.176 6.6342 KOH K.GO. 1.1913 6.7131 KOH K.GO. 1.1913 6.7131 KOH NAOH 1.4024 6.1096 Li. LicCO. 0.1877 6.7131 KOH NAOH 1.4024 6.1096 Li. LicCO. 0.1877 6.7131 KOH NAOH 1.4024 6.1096 Li. LicCO. 0.1877 6.7117 K.HAsO. Mg.As.O. 1.4050 2.1527 Li. LicCO. 0.1877 6.7717 K.HAsO. Mg.As.O. 1.2915 0.3523 LiC. LicCO. 0.1876 6.7717 K.GO. C. 1.3282 5.5648 LiC. LisO. 0.1876 6.7717 6.7743 K.O. HCO. 1.2915 0.3523 LiC. LisO. 0.1637 6.7711 6.7743 K.O. HCO. 1.2915 0.3523 LiC. LisO. 0.1638 6.791 6.791 K.O. KCI. 0.6317 2.5550 Li.O. LisO. 0.1637 6.8302 K.O. K.G. K.G. 1.2046 2.4727 Lio. LisO. 0.503 1.10413 K.O. K.GO. 0.6816 1.7595 LicO. LisO. 0.4044 1.4071 1.5830 K.O. KCI. 0.6317 2.5550 LisO. LisO. LisO. 0.404 1.4071 1.4071 K.O. K.GO. 0.6816 1.7595 LisPO. LisO. 0.568 1.1201 K.O. K.GO. 0.6816 1.7595 LisPO. LisCO. 0.3877 1.4671 K.O. K.GO. 0.6816 1.7595 LisPO. LisO. 1.10451 K.O. K.GO. 0.404 0.2504 1.4234 LisPO. LisGO. 0.568 1.1201 K.O. K.GO. 0.404 0.2504 1.4234 LisPO. LisGO. 0.568 1.1201 K.O. K.GO. 0.404 0.2504 1.4234 LisPO. LisGO. 0.568 1.1201 K.O. K.GO. 0.404 0.2504 1.4234 LisPO. LisGO. 0.568 1.1201 K.O. K.GO. 0.404 0.2504 1.4234 LisPO. LisGO. 0.568 1.1201 K.O. K.GO. 0.6816 1.7595 LisPO. LisGO. 0.568 1.1201 K.O. K.GO. 0.568 1.1201 K.O. K.GO. 0.6816 1.7595 K.O. K.GO. 0.6816 1.7595 K.O. K.GO. 0.6816 1.7595 K.O. K.GO. 0.6816 1.7595 Mg.O. M.G. O. 0.000 Mg.			Mn.O.					
6.4850 KNO. H.SO. 2.0617 0.5405 K.SO. K.O. 1.850. 2.4041 KNO. K.PICI. 0.4159 2.7897 K.SO. K.PICI. 0.358 2.2088 KNO. NAO. 1.1894 0.6327 K.SO. K.SO. 1.580 4.5342 KNO. NO. 3.3694 0.4995 K.SO. SO. 2.176 4.8741 KOH H.SO. 1.1440 1.1440 1.1727 La La201 0.8524 2.8394 KOH K.O. 1.1913 6 1.096 Li LiCI. 0.1637 3.7529 K.O. C.C. 1.3225 5.5484 Li Li ₂ CO. 0.1871 3.7529 K.O. C.C. 1.2915 0.3323 LiCI. Li ₂ CO. 0.1789 4.7117 K.HABASO, Mg.Asp.Or. 1.4024 1.505 2.1247 Li Li Li-CO. 0.1871 3.712 K.O. C.O. 2.1409 <	6 8 081		NaMnO.					
2.4041 KNO. K.PtCl. 0.4159 2.7897 K.SO. K.SCl. 0.3588 €.8408 KNO. NANO. 1.1894 0.6327 K.SO. K.S. 1.580 €.8408 KNO. NO. 3.3694 0.4595 K.SO. SO. K.S. 1.580 €.8741 KOH. H.SO. 1.1440 1.2315 KOH. K.CO. 0.8120 1.1727 La. La.O. 0.8521 €.8394 KOH. K.GO. 1.1913 €.7131 KOH. NAOH. 1.4024 6.1096 Li. LiCl. 0.1633 €.4004 K.MnO. Mn.O. 2.4975 5.3231 Li. Li.CO. 0.1871 €.7117 K.HASO. Mg.AspO. 1.4050 2.1527 Li. Li.CO. 0.1871 €.7117 K.HASO. Mg.AspO. 1.4050 2.1527 Li. Li.CO. 0.1871 €.7117 K.HASO. Mg.AspO. 1.4050 2.1527 Li. Li.SO. 0.1791 €.7743 K.O. Cl. 1.3282 5.5648 Li. Li.PO. 0.1794 €.4671 K.O. CO. 2.1409 1.2965 Li.Cl. Li.SO. 0.7711 €.7743 K.O. H.Cl. 1.2915 0.3523 LiCl. Li.SO. 0.7711 €.7743 K.O. H.SO. 0.9604 0.5956 Li.CO. CO. 1.670 €.8302 K.O. K. 1.2046 2.4727 Li.O. Li.CO. 0.4044 €.8.5270 K.O. KBr. 0.3967 3.6794 Li.O. Li.SO. 0.2181 €.1.5830 K.O. KCC. 0.6317 2.5850 Li.O. Li.SO. 0.2711 €.7741 K.O. KCC. 0.6317 2.5850 Li.O. Li.SO. 0.2711 €.7742 K.O. KHCO. 0.4705 0.9569 Li.PO. Li.PO. 0.3877 €.1.5830 K.O. KHCO. 0.4705 0.9569 Li.PO. Li.SO. 0.702 €.1.231 K.O. K.CC. 0.6816 1.7955 5.500 Li.PO. Li.CO. 1.0451 €.1.4671 K.O. K.CC. 0.6816 1.7955 5.500 Li.PO. Li.CO. 1.0451 €.1.4671 K.O. K.CC. 0.6816 1.7955 5.500 Li.PO. Li.CO. 1.0451 €.1.4671 K.O. K.CC. 0.6816 1.7955 5.500 Li.PO. Li.CO. 1.0451 €.1.4671 K.O. K.CC. 0.6816 1.7955 5.500 Li.PO. Li.CO. 1.0451 €.1.4671 K.O. K.CC. 0.6816 1.7955 5.500 Li.PO. Li.CO. 1.0451 €.1.4671 K.O. K.CC. 0.6816 1.7955 5.500 Li.PO. Li.CO. 1.0451 €.1.4671 K.O. K.C.CO. 0.3876 €.1.4671 K.O. K.C.CO. 0.3876 €.1.4671 K.O. K.C.CO. 0.3800 0.1362 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.4688 €.1.4671 K.O. K.C.CO. 0.46			H-SO.			K-SO.	K ₀ O	
1.88408 KNO, NaNO, 1.1894 0.6327 K,SO, K,S 1.5800 1.8721 0.6059 K,JASO, SO, 2.1761 1.8741 KOH H,SO, 1.1440 1.1727 La La₂O, 0.8521 1.7131 KOH K,CO 0.8120 1.1727 La Li₂CO, 0.1871 1.7131 KOH M,AGN M						K.SO.	K ₂ PtCl ₂	
\$\begin{align*}{2}\text{9088} \text{ KNO ₁ . NO. 3.3694 0.4595 K.SO ₁ . K.SO ₁ . SO ₁ 1.650 \$\begin{align*}{2}\text{4}\$ KOH. H ₂ SO ₁ . 1.1440 1.2315 KOH. K.GCO ₂ . 0.8120 1.1727 La. La ₀ O ₂ . 0.8522 0.8524 La ₀ O ₂ . \$\begin{align*}{2}\text{3}\text{131}\$ KOH. NaOH. 1.4024 6.1096 Li. Li.Cl. 0.1873 0.1873 Li.Cl. 0.1873 0								
\$.8741 KOO. N ₁ O. 1.8721 O.6059 K ₁ AsO ₄ . Mg ₂ As ₂ O ₇ 1.6500 \$.8741 KOH H ₃ SO ₆ . 1.1440 \$.8741 KOH K ₁ O. 0.8120 \$.8394 KOH K ₁ O. 1.1913 \$.7131 KOH NaOH 1.4024 6.1096 Li Li ₂ CO ₆ . 0.8524 \$.84004 K ₂ MnO ₄ . Mn ₂ O ₇ . 2.4975 5.3231 Li Li ₂ CO ₆ . 0.1877 \$.7117 K ₂ HASO ₄ . Mg ₂ As ₂ O ₇ . 1.4050 2.1527 Li Li ₂ CO ₆ . 0.1877 \$.7117 K ₂ HASO ₄ . Mg ₂ As ₂ O ₇ . 1.4050 2.1527 Li Li ₂ CO ₆ . 0.4644 \$.7117 K ₂ HASO ₄ . Mg ₂ As ₂ O ₇ . 1.4050 2.1527 Li Li ₂ CO ₆ . 0.4644 \$.7117 K ₂ HO ₆ . CO ₇ . 2.1409 1.2965 LiCl Li ₂ SO ₄ . 0.7711 \$.7117 K ₂ HO ₇ CO ₇ . 2.1409 1.2965 LiCl Li ₂ SO ₄ . 0.7711 \$.7117 K ₂ HO ₇ CO ₇ . 2.1409 1.2965 LiCl Li ₂ SO ₄ . 0.7711 \$.7117 K ₂ HO ₇ CO ₇ . 2.1409 1.2965 LiCl Li ₂ SO ₄ . 0.7711 \$.7117 K ₂ HO ₇ CO ₇ . 2.1409 1.2965 LiCl Li ₂ SO ₄ . 0.7711 \$.7117 K ₂ HO ₇ CO ₇ . 2.1409 1.2965 LiCl Li ₂ SO ₄ . 0.7711 \$.7117 K ₂ HO ₇ CO ₇ . 2.1409 1.2965 LiCl Li ₂ SO ₄ . 0.7711 \$.7118 K ₂ O H ₃ SO ₄ . 0.9604 0.5956 Li ₂ CO ₇ . CO ₇ . 1.6790 \$.8302 K ₂ O K ₂ O K ₃ D K ₃ D K ₄ D K ₄ D K ₄ D Li ₂ D Li ₂ CO ₁ . 0.4044 \$.25270 K ₂ O KBr 0.3957 3.6794 Li ₃ O Li ₂ CO ₁ Li ₃ SO ₄ . 0.2711 \$.7118 Li ₂ SO ₄ K ₄ O KCl 0.6317 2.5850 Li ₂ O Li ₂ PO ₄ Li ₃ PO ₄ . 0.3877 \$.7118 Li ₂ PO ₄ K ₄ O K ₄ CO ₄ O.6816 1.7595 Li ₂ PO ₄ Li ₃ SO ₄ . 0.7922 \$.7118 Li ₂ PO ₄ K ₄ O K ₄ CO ₄ CO ₇ 0.6816 1.7595 Li ₂ PO ₄ Li ₄ SO ₄ . 0.7022 \$.7118 Li ₂ PO ₄ K ₄ O K ₄ CO ₄ CO ₇ 0.3200 0.1262 Li ₂ SO ₄ Li ₂ SO ₄ D.125O ₄ 0.7022 \$.7118 Li ₂ PO ₄ K ₄ O K ₄ CO ₄ O.8394 0.7282 Li ₂ SO ₄ Li ₄ CO ₄ Li ₄ SO ₄ 0.7022 \$.7118 Li ₄ PO ₄ K ₄ CO ₄ K ₅ CO ₇ 0.4851 2.9162 Mg Mg Mg Mg Mg Mg Mg Mg Mg Mg Mg Mg Mg	2968							
1.2315 KOH	6342							
1	8741		H ₂ SO ₄					
1	1.2315		K.CO		1.1727	La	La ₂ O ₃	0.852
8.7131 KOH NaOH 1.4024 6.1096 Li LicC 0.1637	A.R394	кон	K ₂ O					l——
1.	7131	КОН	NaOH		6.1096	Li	LiCl	0.163
1.	. 4004	K-MnO	Mn ₂ O ₃	2.4975	5.3231	Li	Li ₂ CO ₃	
1.7529	· 1 :7117			1.4050	2.1527	Li	Li ₂ O	
1.4671 K ₄ O	D.7529		Cl	1.3282	5.5648		Li ₂ PO ₄	0.1798
1.0413 K ₄ O	4671	K₂O	CO ₂	2.1409		LiCl	Li ₂ SO ₄	
1,0413	0.7743	K₃O	HCl	1.2915	0.3523	LiCl	Li ₂ O	2.8381
2,5270	1.0413	K₂O	H ₂ SO ₄	0.9604	0.5956	Li ₂ CO ₃	CO ₂	1.6790
1.5830 K ₄ O KCl 0.6317 2.5850 Li ₂ O Li ₄ PO ₄ 0.3870 2.1255 K ₄ O KHCO ₅ 0.4705 0.9569 Li ₄ PO ₄ Li ₄ CO ₁ 1.0451 1.4671 K ₄ O K ₂ CO ₃ 0.6816 1.7595 Li ₄ PO ₄ Li ₄ PO ₄ 0.5682 3.9949 K ₄ O KHC ₄ H ₄ O ₆ 0.2504 1.4234 Li ₄ PO ₆ Li ₄ PO ₆ 1.58O ₆ 0.7022 3.1231 K ₄ O K ₂ Cr ₂ O ₇ 0.3200 0.1262 Li ₃ SO ₄ Li ₁ Cl 1.2966 1.1913 K ₄ O KOH 0.8394 0.7282 Li ₄ SO ₄ Li ₁ Cl 1.2966 1.1916 K ₄ O KNO ₃ 0.4658 3.1666 K ₄ O K ₂ Cr ₁ O ₄ 0.4851 2.9162 Mg Cl 0.3426 5.1609 K ₄ O K ₂ PCC ₄ 0.1938 1.6579 Mg MgO 0.6032 5.8500 K ₄ O K ₂ SO ₄ 0.5406 4.5789 Mg MgCO ₂ 0.0032 5.8500 K ₄ O Na ₄ O 1.5194 4.9498 Mg MgSO ₄ 0.2024 6.6582 K ₄ O Na ₄ O 1.5194 4.9498 Mg MgSO ₄ 0.2024 6.8500 K ₄ O SO ₅ 1.1765 0.7447 MgCl ₂ Cl 1.3426 6.1609 K ₂ PCC ₄ KCl 3.2602 0.5218 MgCO ₂ CO ₂ 1.9164 6.2844 K ₂ PtCl ₆ KCl 3.2602 0.5218 MgCO ₂ CO ₂ 1.9162 6.2844 K ₂ PtCl ₆ K ₃ CO ₃ 3.5177 0.6013 Mg (HCO ₂) ₂ CO ₂ 1.9662 6.28585 K ₂ PtCl ₆ K ₃ O ₃ 2.4041 5.7894 MgO BaSO ₄ 0.1727 6.1938 K ₃ PtCl ₆ K ₃ CO ₃ 3.5177 0.6013 MgO CO ₂ 0.9164 6.2844 K ₃ PtCl ₆ K ₃ CO ₃ 3.5177 0.6013 MgO CO ₂ 0.9164 6.2845 K ₄ PtCl ₆ K ₃ CO ₃ 3.5177 0.6013 MgO CO ₂ 0.9164 6.2845 K ₄ PtCl ₆ K ₃ CO ₃ 3.5177 0.6013 MgO CO ₂ 0.9164 6.28585 K ₄ PtCl ₆ K ₃ CO ₃ 3.5177 0.6013 MgO CO ₂ 0.9164 6.2845 K ₄ PtCl ₆ K ₃ CO ₃ 2.7897 1.0913 MgO CO ₂ 0.9164 6.2845 K ₄ PtCl ₆ K ₃ CO ₃ 2.7897 1.0913 MgO MgCO ₃ 0.4782 6.28585 K ₄ PtCl ₆ K ₃ CO ₃ 2.7897 1.0913 MgO MgCO ₃ 0.4782 6.28636 K ₃ PtCl ₆ K ₃ CO ₃ O ₄ 2.4820 0.5120 2.3621 MgO MgCO ₃ 0.4782 6.28785 K ₃ PtCl ₆ F ₁ Cl ₄ 1.4427 2.9859 MgO MgCO ₃ 0.9346 6.8785 K ₃ PtCl ₆ PtCl ₄ 5H ₄ O 1.1383 3.5236 MgO Na ₆ SO ₄ 0.3346 6.8785 K ₃ PtCl ₆ PtCl ₄ 5H ₄ O 1.1383 3.5236 MgO Na ₆ SO ₄ 0.3346 6.8785 K ₃ PtCl ₆ PtCl ₄ 5H ₄ O 1.1383 3.5236 MgO Na ₆ SO ₄ 0.3346 6.8785 K ₃ PtCl ₆ PtCl ₄ 5H ₄ O 1.1383 3.5236 MgO Na ₆ SO ₄ 0.3346 6.8785 K ₃ PtCl ₆ PtCl ₄ 5H ₄ O 1.1383 3.5236 MgO Na ₆ SO ₄ 0.2356 6.5170 K ₃ SiF ₆ F 1.9342 0.7951 MgO SO ₆ 0.5036							Li ₂ CO ₃	
2,1255 K ₂ O K ₁ CO ₁ 0,4705 0,9699 L ₁ PO ₄ L ₁ CO ₂ 1,0451 1,4671 K ₂ O K ₂ CO ₃ 0,6816 1,7595 L ₁ PO ₄ L ₁ PO ₄ L ₁ CO ₃ 0,5682 1,231 K ₂ O K ₂ Cr ₂ O ₇ 0,3200 0,1262 L ₁ PO ₄								
1.4671							Li ₂ PO ₄	
\$ 9949 K ₂ O KHC,H ₄ O ₆ 0.2504 1.4234 Li ₂ PO ₄ Li ₂ SO ₄ 0.702; \$ 1231 K ₂ O K ₂ Cr ₂ O ₇ 0.3200 0.1262 Li ₂ SO ₄ Li ₂ Cl 1.296; \$ 1.913 K ₂ O KOH 0.8394 0.7282 Li ₂ SO ₄ SO ₂ 1.373; \$ 1466 K ₂ O K ₁ O ₁ K ₁ O ₂ 0.4658 2.9162 Mg MgO 0.603; \$ 1609 K ₂ O K ₂ PtCl ₆ 0.1938 1.6579 Mg MgO 0.603; \$ 1.8500 K ₂ O K ₂ SO ₄ 0.5406 4.5789 Mg MgSO ₄ 0.202; \$ 8500 K ₂ O Na ₂ O 1.5194 4.9498 Mg MgSO ₄ 0.202; \$ 8500 K ₂ PtCl ₆ K ₂ O 1.7765 0.7447 MgCl ₂ 6H ₂ O 1.342; \$ 1.609 K ₂ PtCl ₆ KCl 3.2602 0.5218 MgCO ₂ CO ₂ 1.9164 \$ 1.808 K ₂ PtCl ₆ K ₂ CO ₂ 3.5177 0.6013 Mg(HCO ₃) ₂ CO ₂ 1.662; \$ 1.938 K ₂ PtCl ₆ K ₂ O 5.1609 1.7590 MgO CO ₂ 0.1727; \$ 1.938 K ₂ PtCl ₆ K ₂ SO ₄ 2.4041 5.7894 MgO BaSO ₄ 0.1727; \$ 1.941 MgO MgCl ₃ 0.5485 \$ 1.9521 K ₂ PtCl ₆ K ₂ C ₃ O ₃ 2.7897 1.0913 MgO MgCl ₃ 0.4234 \$ 1.9521 K ₂ PtCl ₆ K ₂ C ₃ O ₃ 2.444 ₂ O 0.4964 3.6294 MgO MgCl ₃ 0.4234 \$ 1.9521 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3346 \$ 1.9531 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3346 \$ 1.9531 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3346 \$ 1.9531 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3346 \$ 1.9536 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3346 \$ 1.9531 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3346 \$ 1.9531 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3346 \$ 1.9531 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3346 \$ 1.9531 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3346 \$ 1.9531 MgO Ng ₂ O ₃ 0.3621 \$ 1.9532 MgO Ng ₂ O ₃ 0.3621 \$ 1.9534 MgO Ng ₂ O ₃ 0.3621 \$ 1.9536 MgO Ng ₂ O ₃ 0.3346 \$ 1.9536 MgO Ng ₂ O ₃ 0.3621 \$ 1.9536 MgO N							Li ₂ CO ₃	
1231 K ₂ O							LiHCO	
3.5248 K ₄ O KI 0.2837 0.7712 Li ₂ SO ₄ LiCl 1.2966 3.1466 K ₂ O KOH 0.8394 0.7282 Li ₂ SO ₄ LiCl 1.2966 3.0616 K ₂ O KNO ₃ 0.4658 2.9162 Mg Cl 0.3428 3.1609 K ₂ O K ₂ PtCl ₆ 0.1938 1.6579 Mg MgO 0.6032 3.8500 K ₂ O K ₂ SO ₄ 0.5406 4.5789 Mg MgCO 0.03428 3.8500 K ₂ O Na ₂ O 1.5194 4.9498 Mg MgCO 0.0334 3.8500 K ₂ O SO ₂ 1.1765 0.7447 MgCl ₂ Cl 1.3428 3.8609 K ₂ PtCl ₆ K 6.2169 0.3488 MgCl ₂ Cl 1.3428 3.8088 K ₂ PtCl ₆ KCl 3.2602 0.5218 MgCO ₂ CO ₂ 1.9164 3.24159 K ₂ PtCl ₆ K ₂ NO ₃ 2.4041 7.894 MgO BaSO ₄ <			KHC ₄ H ₄ O ₆					
1,1913 K ₂ O KOH 0.8394 0.7282 Li ₂ SO ₄ SO ₃ 1.3733 2,0616 K ₂ O K ₂ CrO ₄ 0.4858 2.9162 Mg Cl 0.3428 5,1609 K ₂ O K ₂ PtCl ₆ 0.1938 1.6579 Mg MgO 0.6032 4,8500 K ₂ O K ₂ SO ₄ 0.5406 4.5789 Mg MgCO 0.2184 6,8582 K ₄ O Na ₄ O 1.5194 4.9498 Mg MgSO ₄ 0.2020 8,800 K ₂ O SO ₃ 1.1765 0.7447 MgCl ₂ Cl 1.3426 1,8008 K ₂ PtCl ₆ K 6.2169 0.3488 MgCl ₂ GL 1.3426 1,8068 K ₂ PtCl ₆ KCl 3.2602 0.5218 MgCl ₂ Cl 1.3426 1,2544 K ₃ PtCl ₆ K ₂ CO ₂ 3.5177 0.6013 Mg(HCO ₂) ₂ CO ₂ 1.962 1,2544 K ₃ PtCl ₆ K ₂ SO ₂ 2.7897 1.9590 MgO			K ₂ Cr ₂ C ₇					
2.1486 K ₂ O KNO ₂ 0.4658 0.4851 2.9162 Mg Cl 0.3428 3.0616 K ₂ O K ₂ CrO ₄ 0.4851 2.9162 Mg Cl 0.3428 3.1609 K ₂ O K ₂ PtCl ₆ 0.1938 1.6579 Mg MgO 0.6032 3.6580 K ₂ O Na ₂ O 1.5194 4.9498 Mg MgSO ₄ 0.2020 3.500 K ₂ O SO ₃ 1.1765 0.7447 MgCl ₂ Cl 1.3426 3.609 K ₂ PtCl ₆ KCl 3.2602 0.5218 MgCO ₂ Cl 1.3426 3.608 K ₂ PtCl ₆ KCl 3.2602 0.5218 MgCO ₂ Cl 1.3426 3.2602 0.5218 MgCO ₂ CO ₂ 1.9164 3.2602 0.5218 MgCO ₂ CO ₂ 1.9164 3.2602 0.5218 MgCO ₂ CO ₂ 1.9624 3.2602 0.5218 MgCO ₂ CO ₂ 1.9624 <								
3,0616 K ₂ O K ₂ CrO ₄ 0.4851 2.9162 Mg Cl 0.3428 4,1609 K ₂ O K ₂ PtCl ₆ 0.1938 1.6579 Mg MgO 0.6032 4,8500 K ₂ O Na ₂ O 0.5406 4.5789 Mg Mg ₂ P ₂ O ₇ 0.2184 6,6582 K ₂ O Na ₂ O 1.5194 4.9498 Mg MgSO ₄ 0.2020 8,500 K ₂ O SO ₃ 1.1765 0.7447 MgCl ₂ Cl 1.3426 9,1609 K ₂ PtCl ₆ K 6.2169 0.3488 MgCl ₂ Cl 1.3426 1,2514 K ₂ PtCl ₆ KCl 3.2602 0.5218 MgCO ₂ CO ₂ 1.9164 1,2514 K ₂ PtCl ₆ K ₂ CO ₂ 3.5177 0.6013 Mg(HCO ₃) ₂ CO ₂ 1.6624 1,2514 K ₂ PtCl ₆ K ₃ O ₄ 2.7897 1.0913 MgO CC 0.9164 1,2521 K ₂ PtCl ₆ K ₃ Cl ₂ (Sl ₄) ₄ 2.4325 MgO	1.1913				0.7282	L125U4	SU ₃	1.3/32
\$1609 K ₂ O K ₂ PtCl ₆ 0.1938 1.6579 Mg MgO 0.6035 \$6582 K ₂ O K ₂ SO ₄ 0.5466 4.5789 Mg MgC 0.2184 \$6582 K ₂ O Na ₄ O 1.5194 4.9498 Mg MgSO ₄ 0.2024 \$600 K ₂ O SO ₃ 1.1765 0.7447 MgCl ₂ Cl 1.3428 \$6088 K ₂ PtCl ₆ K 6.2169 0.3488 MgCl ₂ ·6H ₂ O Cl 2.8672 \$3088 K ₂ PtCl ₆ KCl 3.2602 0.5218 MgCO ₂ CO ₂ 1.9164 \$2444 K ₂ PtCl ₆ K ₂ CO ₂ 3.5177 0.6013 Mg(HCO ₃) CO ₂ 1.6628 \$4159 K ₂ PtCl ₆ K ₃ O 5.1609 1.7590 MgO Cl 0.5686 \$3585 K ₂ PtCl ₆ K ₃ O 2.7897 1.0913 MgO CO ₂ 0.9164 \$.9521 K ₂ PtCl ₆ K ₃ Cr ₃ (SO ₄) 2.3621 MgO MgCO	3.1400 B.0016		K C-O		2 0162	Ma	Cl	0.2400
1.8500 K ₂ O K ₃ SO ₄ 0.5406 4.5789 Mg Mg ₂ P ₂ O ₇ 0.2184 0.6582 K ₂ O Na ₂ O 1.5194 4.9498 Mg MgSO ₄ 0.2020 0.8500 K ₂ O SO ₃ 1.1765 0.7447 MgCl ₂ Cl 1.3426 0.1609 K ₂ PtCl ₆ K 6.2169 0.3488 MgCl ₂ ·6H ₂ O Cl 2.8672 0.3068 K ₂ PtCl ₆ KCl 3.2602 0.5218 MgCO ₂ CO ₂ 1.9164 0.2444 K ₂ PtCl ₆ K ₂ CO ₂ 3.5177 0.6013 Mg(HCO ₃) ₂ CO ₂ 1.9624 0.4139 K ₂ PtCl ₆ K ₂ O 5.1609 1.7590 MgO Cl 0.5625 1.9521 K ₂ PtCl ₆ K ₃ SO ₄ 2.7897 1.9013 MgO CO ₂ 0.9164 1.9521 K ₂ PtCl ₆ K ₃ Cl ₂ (SO ₄) ₄ 2.4325 MgO MgCl ₁ 0.4234 2.0545 K ₂ PtCl ₆ PtCl ₄ 0.4964 3.6294			K.D.CI				Mac	
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$							Mg P.O.	
1.8500 K₂O								
8.1609 K₂PtCl6 K. 6.2169 0.3488 MgCl₂·6H₂O Cl. 2.8672 8.2844 K₂PtCl6 KCl 3.2602 0.5218 MgCO₂. CO₂. 1.9164 9.4159 K₂PtCl6 KNO₂. 2.4041 5.7894 MgO. BaSO₄. 0.1727 9.1938 K₂PtCl6 K₂O. 5.1609 1.7590 MgO. Cl. 0.5685 9.3855 K₂PtCl6 K₂SO₄. 2.7897 1.0913 MgO. CO₂. 0.9164 1.9521 K₂PtCl6 K₂Al₂(SO₄)₄ 2.44120 0.5120 2.3621 MgO. MgCl₂. 0.4111 2.4645 K₂PtCl6 K₂Cr₂(SO₄)₄ 2.4906 2.7619 MgO. MgCl₂. 0.4782 9.4013 K₂PtCl6 Pt. 2.4906 2.7619 MgO. MgCl₂. 0.3349 9.4013 K₂PtCl6 PtCl₄. 1.4427 2.9859 MgO. MgSO₄. 0.3349 9.4013 K₂PtCl6 PtCl₄. 1.3838 3.5236	0.0002 0.0002					MgCl.		
B, 2068 K,PtCl ₆ KCl 3 2602 0.5218 MgCO ₂ CO ₂ 1 9164 2,2844 K ₂ PtCl ₆ K ₂ CO ₂ 3 5177 0.6013 MgCO ₂ CO ₂ 1 662 2,4159 K ₂ PtCl ₆ KNO ₃ 2 4041 5 7894 MgO BaSO ₄ 0.1727 6,1938 K ₂ PtCl ₆ K ₂ O 5 1609 1,7590 MgO Cl 0.5682 3,585 K ₂ PtCl ₆ K ₂ SO ₄ 2 7897 1.0913 MgO CO ₂ 0.9164 1,9521 K ₂ PtCl ₆ K ₂ Al ₂ (SO ₄) ₄ 2 4810 0.5120 2.3621 MgO MgCl ₂ 0.4111 2,4H ₂ O 24H ₂ O 0.4964 3.6294 MgO MgCO ₃ 0.4782 9,4013 K ₂ PtCl ₆ Pt 2.4906 2.7619 MgO Mg(HCO ₃) ₂ 0.3621 0,4013 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3346 0,5785 K ₂ PtCl ₆ PtCl ₄ 1.3383 </th <th>1600</th> <th></th> <th>K</th> <th></th> <th></th> <th>MoClas6HaO</th> <th></th> <th></th>	1600		K			MoClas6HaO		
B.2844 K₂PtCl₀ K₂CO₂ 3.5177 0.6013 Mg(HCO₂)₂ CO₂ 1.662 6.1938 K₂PtCl₀ KNO₃ 2.4041 5.7894 MgO Cl 0.5685 6.5855 K₂PtCl₀ K₂SO₄ 2.7897 1.0913 MgO CO₂ 0.9164 1.9521 K₂PtCl₀ K₂Al₂(SO₄)₄ 2.4H₂O 0.5120 2.3621 MgO MgCl₃ 0.4234 2.0545 K₂PtCl₀ K₂PtCl₀ C₂4H₂O 0.4964 2.0914 MgO MgCO₃ 0.4782 9.4013 K₂PtCl₀ Pt 2.4906 2.7619 MgO MgCN₂ 0.3621 0.6931 K₂PtCl₀ PtCl₄ 1.4427 2.9859 MgO MgSO₄ 0.3346 0.5170 K₂SiF₀ F 1.9342 0.7951 MgO S 1.2576 0.5144 K₅SiF₀ HF 1.8368 1.9859 MgO SO₃ 0.5036	2068		KCI			McCO.		
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	2844							
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	4159							
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$								
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$								
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$					2.4325		H ₂ SO ₄	
0.4013 K ₂ PtCl ₆ Pt. 2.4906 2.7619 MgO. Mg(HCO ₃) ₂ . 0.275ξ 6.6931 K ₂ PtCl ₆ PtCl ₄ . 1.4427 2.9859 MgO. MgSO ₄ . 0.334ξ 0.5785 K ₂ PtCl ₆ PtCl ₄ . 1.1383 3.5236 MgO. Na ₈ SO ₄ . 0.283ξ 0.5170 K ₅ SiF ₆ F 1.9342 0.7951 MgO. S. 1.257ξ 0.5444 K ₅ SiF ₆ HF 1.8368 1.9859 MgO. SO ₃ . 0.503ξ			·24H₂O	0.5120	2.3621	MgO		0.4234
0.4013 K ₂ PtCl ₆ Pt. 2.4906 2.7619 MgO. Mg(HCO ₃) ₂ . 0.275ξ 6.6931 K ₂ PtCl ₆ PtCl ₄ . 1.4427 2.9859 MgO. MgSO ₄ . 0.334ξ 0.5785 K ₂ PtCl ₆ PtCl ₄ . 1.1383 3.5236 MgO. Na ₈ SO ₄ . 0.283ξ 0.5170 K ₅ SiF ₆ F 1.9342 0.7951 MgO. S. 1.257ξ 0.5444 K ₅ SiF ₆ HF 1.8368 1.9859 MgO. SO ₃ . 0.503ξ	2.0545	K₂PtCl ₆	K ₂ Cr ₂ (SO ₄) ₄	1	2.0914	MgO	MgCO ₃	0.4782
0.4013 K ₂ PtCl ₆ Pt 2.4906 2.7619 MgO Mg ₂ P ₂ O ₇ 0.3621 0.6931 K ₂ PtCl ₆ PtCl ₄ 1.4427 2.9859 MgO MgSO ₄ 0.3349 0.5785 K ₂ PtCl ₆ PtCl ₄ ·5H ₂ O 1.1383 3.5236 MgO Na ₆ SO ₄ 0.2836 0.5170 K ₂ SiF ₆ F 1.9342 0.7951 MgO S 1.2576 0.5444 K ₃ SiF ₆ HF 1.8368 1.9859 MgO SO ₈ 0.5036			·24H₂O				$Mg(HCO_3)_2$	0.2755
8.6931 K₂PtCl₂ PtCl₄ 1.4427 2.9859 MgO MgSO₃ 0.3345 9.5785 K₂PtCl₂ PtCl₄·5H₂O 1.1383 3.5236 MgO Na₂SO₃ 0.2836 9.5170 K₂SiF₂ F 1.9342 0.7951 MgO S 1.2576 9.5444 K⋅SiF₂ HF 1.8368 1.9859 MgO SO₃ 0.5036	9.4013		Pt				$Mg_2P_2O_7$	0.3621
0:8785 K ₂ PtCl ₆ PtCl ₄ ·5H ₂ O 1.1383 3.5236 MgO Na ₆ SO ₄ 0.2838 0.5170 K ₂ SiF ₆ F 1.9342 0.7951 MgO S 1.2576 0.5444 K ₂ SiF ₆ HF 1.8368 1.9859 MgO SO ₅ 0.5036	6.6931		PtCL				$MgSO_4$	
0.5444 K ₂ SiF ₄ HF 1.8368 1.9859 MgO SO ₄ 0.5036	0:87 85		PtCl₄ · 5H₂O			MgO		
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	0.5170					MgO	8	
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$							SO	
	0.6545	K ₂ SiF ₆	H ₂ SiF ₆	1.5279	1.3932	$Mg_2P_2O_7$	$Ca_3(PO_4)_2$	0.7178

A'	A	В.	B'	A'	Λ	В
0.8806	Mg ₂ P ₂ O ₇	H ₂ PO ₄	1.1356	0.5303	MnSO ₄	SO ₃
0.2184	Mg ₂ P ₂ O ₇	Mg	4.5789			
1.2784	$Mg_2P_2O_7$	Mg(CH ₁ CO ₂) ₂	0.7822	1.5000	Мо	MoO3
0.8552	$Mg_2P_2O_7$	MgCl ₂	1.1692	2.0022	Mo	MoS ₃
1.8260	$Mg_2P_2O_7$	MgCl ₂ ·6H ₂ O	0.5477	3.8250	Mo	PbMoO4
0.7572	$Mg_2P_2O_7$	MgCO	1.3206	1.3348	MoO	MoS ₁
1.3141	Mg ₂ P ₂ O ₇	Mg(HCO ₃) ₂	0.7610	1.3617	MoO ₃	(NH ₄) ₂ MoO ₄ .
0.3621	Mg ₂ P ₂ O ₇	MgO	2.7619	1.0863	MoO ₃	(NH ₄),PO ₄
1.0811		MgSO ₄	0.9250	1.0003	M10O3	$(MoO_3)_{12}$
	$Mg_2P_2O_7$	MgSO₄·7H₂O	0.4516	9 5500	MoO ₃	PbMoO ₄
2.2135	Mg ₂ P ₂ O ₇	MESO4.1 L2O		2.5500		
1.0781	$Mg_2P_2O_7$	NaH ₂ PO ₄	0.9276	1.8727	$MoO_4 \cdot (NH_4)_2$	PbMoO₄
1.4731	$Mg_2P_2O_7$	Na ₄ PO ₄	0.6789	0.0704		77370
3.2170	$Mg_2P_2O_7$	Na ₂ HPO ₄		3.3564	<u>N</u>	HNO ₂
		·12H₂O	0.3109	4.4986	N	HNO3
3.4144	$Mg_2P_2O_7$	Na ₃ PO ₄		6.0757	N	KNO₂
		·12H₂O	0.2929	7.2179	N	KNO3
. 2755	$Mg_2P_2O_7$	Na ₂ HPO ₄	0.7840	4.9263	N	NaNO ₂
.2758	$Mg_2P_2O_7$	Na ₂ SO ₄	0.7838	3.2841	N	NO
.0336	Mg ₂ P ₂ O ₇	(NH ₄)H ₂ PO ₄ .	0.9675	2.7131	N	N ₂ O ₂
.1865	$Mg_2P_2O_7$	(NH ₄) ₂ HPO ₄ .	0.8428	3.2841	N	N ₂ O ₄
2787	$Mg_2P_2O_7$	P	3.5877	3.8551	N	N ₂ O ₅
6379	Mg ₂ P ₂ O ₇		1.5676	6.0685	N	NaNO ₃
		P ₂ O ₅	0.5158	1.2159	N	NH ₂
.9389	MgSO ₄	BaSO ₄				Pt
.8147	MgSO ₄	H ₂ SO ₄	1.2274	6.9874	N	
2.0476	$MgSO_4$	MgSO ₄ ·7H ₂ O	0.4884	2.8576	N	SO ₂
0.6651	MgSO ₄	SO_1	1.5036			
0.3248	MgSO ₄ ·7H ₂ O	803	3.0786	3.4748	Na	Br
0.9469	MgSO ₄ ·7H ₂ O	BaSO ₄	1.0560	1.5417	Na	C1
				5.5182	Na	I
2.0923	Mn	MnCO3	0.4779	4.4747	Na	NaBr
1.2913	Mn	MnO	0.7744	2.5417	Na	NaCl
1.5826	Mn	MnO_2	0.6319	2.3044	Na	Na ₂ CO ₃
. 4369	Mn	Mn ₂ O ₃	0.6959	1.8261	Na	NaF
.3884	Mn	Mn ₃ O ₄	0.7203	3.6525	Na	NaHCO ₃
2.5846	Mn	Mn ₂ P ₂ O ₇	0.3869	6.5183	Na	NaI
. 5838	Mn	MnS	0.6314	1.3478	Na	Na ₂ O
3828	$MnCO_3$	CO ₂	2.6121	1.7395	Na	NaOH
.2352	$MnCO_3$	$Mn_2P_2O_7$	0.8096	2.7404	Na	Na ₂ SO ₂
. 4973	Mn(HCO ₃) ₂	CO_2	2.0108	3.0885	Na	Na ₂ SO ₄
0.6204	MnO	CO_2	1.6119	0.6224	Na ₂ Al ₂ O ₄	Al ₂ O ₂
6203	MnO	MnCO	0.6172	0.0224	$Na_2Al_2(SO_4)_4$	A12O3
.2256	MnO			0.1355		Q
	MnO	MnO_2	0.8159	0 0005	24H ₂ O	8
2.1287	MnO	MnSO ₄	0.4698	0.6925	Na ₂ B ₄ O ₇	B ₂ O ₃
2.0016	MnO	$Mn_2P_2O_7$	0.4996	1.2287	Na ₂ B ₄ O ₇	H ₃ BO ₃
1.1128	MnO	Mn_2O_3	0.8987	0.3657	Na ₂ B ₄ O ₇	
. 2266	MnO	MnS	0.8153		· 10H₂O	B_2O_3
.1289	MnO	SO_3	0.8859	0.6488	ditto	H ₃ BO ₃
2.0022	Mn ₂ O ₃	KMnO ₄	0.4995	1.3202	ditto	KBF ₄
0.9662	Mn ₂ O ₃	Mn ₃ O ₄	1.0349	1.0482	NaBr	Ag
.9130	Mn ₂ O ₃	MnSO ₄	0.5227	1.8247	NaBr	AgBr
0.4062	Mn ₂ O ₃	8	2.4619	0.7765	NaBr	Br
. 1014	Mn ₃ O ₄	MnO ₂	0.9080	1.8454	NaCl	Ag
2.5848	Mn ₃ O ₄	K ₂ MnO₄	0.3869	2.4519	NaCl	AgCl
1.7357	MnS	MnSO4	0.5761	2.9061	NaCl	AgNO
1.5458	MnSO	BaSO ₄	0.6469	0.4796	NaCl	CaO
3438						

XVIII.—CONVERSION FACTORS (Continued)

A'	A	В	B'	A'	A	В	B'
.6066	NaCl	Cl	1.6486	1.6003	NaH ₂ PO ₄ *	NaH ₂ PO ₄	
.6239	NaCl	HCl	1.6030			·4H ₂ O	0.62
	NaCl	H ₂ SO ₄	1.1920	0.2582	NaH2PO4*	Na ₂ O	3.87
.8389	NaCl	NaClO ₃	0.5491			D.	3.86
.8211				0.2585	NaH ₂ PO ₄ *	P	
.1632	NaCl	NaClO ₄		0.5917	NaH ₂ PO ₄ *	P ₂ O ₅	1.69
.9066	NaCl	Na ₂ CO ₃		0.3453	NaH ₂ PO ₄ †	H_2SO_4	2.89
.4370	NaCl	NaHCO3	0.6959	2.5220	Na ₂ HPO ₄	Na ₂ HPO ₄	1.00
.2149	NaCl	Na ₂ HPO ₄	0.8231	C. C. 16. 1		·12H ₂ O	0.39
.7803	NaCl	NaHSOa	0.5617	0.4365	Na ₂ HPO ₄	Na ₂ O	2.29
5303	NaCl	Na ₂ O	1.8858		Na ₂ HPO ₄	Na4P2O7	1.06
.2151	NaCl	Na ₂ SO ₄	0.8230	0.5001	Na ₂ HPO ₄	P ₂ O ₅	1.99
		7-01				Na HCO	
.1656	NaCl	ZnCl2	0.8579		Na ₂ H ₄ P ₂ O ₇	NaHCO ₃	1.32
7.3331	NaClO ₃	Cl		0.2792	$Na_2H_2P_2O_7$	Na ₂ O	3.58
.2896	NaClO ₄	Cl	3.4535	0.6397	$Na_2H_2P_2O_7$	P2O5	1.56
2.2022	Na ₂ CO ₃	BaSO4	0.4541	0.3395	Na(NH ₄)		
0:9441	Na ₂ CO ₃	CaCO ₃	1.0593		HPO4·4H2O	P.O	2.94
0.5290	Na ₂ CO ₃	CaO	1.8905	0.8968	Na ₃ PO ₄	H ₂ SO ₄	1.11
	Na ₂ CO ₃	CH ₃ CO ₂ H	0.8828		Na ₃ PO ₄	$Mg_2P_2O_7$	1.47
1.1327		CO ₂ CO ₂ H			Nagro4		
0.4151	Na ₂ CO ₃	CO ₂	2.4091	0.5669	Na ₃ PO ₄	Na ₂ O	1,76
0.6881	Na ₂ CO ₃	HCl	1.4533	1.2991	Na ₃ PO ₄	Na ₂ SO ₄	0.76
0.9253	Na ₂ CO ₃	H ₂ SO ₄	1.0807	2.3179	Na ₃ PO ₄	Na ₃ PO ₄	100
1.3038	Na ₂ CO ₃	K2CO3	0.7670		1254 COPPER TO	·12H ₂ O	0.43
1:4340	Na ₂ CO ₃	Na	2.3044	0.4331	NasPO4	$P_{\nu}O_{\delta}$	2.30
1.1030	Na ₂ CO ₃	NaCl	0.9066		NaHSO	BaSO ₄	0.44
1.1000	Na ₂ CO ₂	NaHCO ₁	0.6309		NaHSO ₃	H ₂ SO ₄	2.12
1.5850		Nancos					
1.9637	Na ₂ CO ₃	NaHSO ₃		0.5617	NaHSO ₃	NaCl	1.78
0.7549	Na ₂ CO ₃	NaOH	1.3247		NaHSO3	Na ₂ O	3.35
0.5849	Na ₂ CO ₃	Na ₂ O	1.7097		NaHSO3	Na ₂ S ₂ O ₅	1.09
7.7320	Na C2O4	H2SO4	1.3661	0.3081	NaHSO3	S	3.24
1.9951	Na ₂ CrO ₄	PbCrO ₄		0.6156	NaHSO3	SO ₂	1.62
.2788	Na ₂ Cr ₂ O ₇	Fe		1.5662	NaI	AgI	0.63
0.3744	Na ₂ Cr ₂ O ₇	H ₂ SO ₄	2.6711	0.8466	NaI	I	1.18
						Na	200
1.2367	Na ₂ Cr ₂ O ₇	Na ₂ CrO ₄		0.1534	NaI	Na	6.51
0.9294	NaF	CaF ₂	1.0760		NaI	Na ₂ O	4.83
9135	Na ₂ HAsO ₃	Mg2As2O7	1.0947		NaIO3	I	1.58
.4031	Na ₂ HAsO ₄	As	2.4809	0.7413	NaNO3	HNO3	1.34
.6182	Na ₂ HAsO ₄	As ₂ O ₅	1.6177	0.5769	NaNOa	H2SO4	1.73
1.8349	Na ₂ HAsO ₄	Mg2As2O7	1.1978		NaNO3	KNO2	0.84
0700	NaHCO ₃	$Al_2(SO_4)_1$	1.4721		NaNOa	NaNO2	1.23
.3938		Ca(H ₂ PO ₄) ₂	0.7175	0.3647	NaNOa	Na ₂ O	2.74
.3938		Ca(H ₂ FO ₄) ₂	0.7173	0.0047			
2800	NaHCO ₃ *	CaH ₂ P ₂ O ₇	0.7773	0.2004	NaNO ₃	NH3	4.99
.8931	NaHCO ₁	$C_4H_6O_6$	1.1197		NaNO3	NO	2.83
1.5238	NaHCO3	CO2	1.9092	0.6353	NaNO3	N ₂ O ₅	1.57
.5838	NaHCO ₃	H-SO4	1.7129	1.2258	NaOH	H2SO4	0.81
.0251	NaHCOa	K2Al2(SO4)4.	0.9756	0.7748	NaOH	Na ₂ O	1.29
.2395	NaHCO3	KHC4H4O6	0.4465		NaOH	Na ₂ SiF ₆	0.84
	NaHCO ₁	KMnO ₄	1.0760		NaOH	(NH ₄) ₃ PO ₄	0.0
,9284		N.		2.0400	IvaOII	(M-0)	0 40
2740	NaHCO ₃	Na	3.6525	0 7074	N 0	(MoO ₃) ₁₂	0.49
1.6309	NaHCO ₃	Na ₂ CO ₃	1.5851	3.7651	Na ₂ O	BaSO ₄	0.26
.4291	NaHCO3*	NaH ₂ PO ₄	0.6997	1.9365	Na ₂ O	CH ₃ CO ₂ H	0.51
-3219	NaHCO3*	Na ₂ H ₂ P ₂ O ₇	0.7565	2.6463	Na ₂ O	CH ₃ CO ₂ Na	0.37
3690	NaHCO3	Na ₂ O	2.7099	1.5820	Na ₂ O	H ₂ SO ₄	0.68
1.0000	NaH ₂ PO ₄ *	H ₂ SO ₄	2.4482	0.7419	Na ₂ O	Na	1.34
1.4085		NaHCO ₃	1.4291		Na ₂ O	NaCl	0.53
6997	·NaH ₂ PO ₄ *	Manous	1.4291	1.7097	Na ₂ O	Na ₂ CO ₂	0.58

 $A \times A' = B$

 $B \times B' = A$

*Phenolphthalein

† Methyl orange.

XVIII.—CONVERSION FACTORS (Continued)

	A	В	B'	A'	A	В	ı
.3548	Na ₂ O	NaF	0.7381	1.1663	Nd	Nd2O3	t
.7099	Na ₂ O	NaHCO3	0.3690		1 = 0 = 12 12 12 12 12	200	Į.
2.2911	Na ₂ O	Na ₂ HPO ₄	0.4365	3.6999	NH3	HNO3	1
.8728	Na ₂ O	NaH ₂ PO ₄	0.2582	2.8792	NH	H ₂ SO ₄	1
	Na ₂ O	Na ₂ H ₂ P ₂ O ₇	0.2792	4.9969	NH	KNO2	ı
.5822							ı
3.3570	Na ₂ O	NaHSO ₃	0.2979		NH ₃	KNO ₃	1
2.7423	Na ₂ O	NaNO3	0.3647	0.8227	NH3	N	ı
.2906	Na ₂ O	NaOH	0.7748	4.0517	NH3	NaNO2	1
.2916	Na ₂ O	NaPO3	0.3038	4.9911	NH3	NaNO3	1
.7639	Na ₂ O	Na ₄ PO ₄	0.5669	2.8207	NH3	(NH ₄) ₂ CO ₃	ı
.2592	Na ₂ O	Na ₂ S	0.7942	3.1409	NH3	NH ₄ Cl	1
.0334	Na ₂ O	Na ₂ SO ₃	0.4918		NH3	(NH ₄)2HPO4.	ı
.2915	Na ₂ O	Na ₂ SO ₄	0.4364		NH	NH4H2PO4	ı
.5503	Na ₂ O	Na ₂ S ₂ O ₃	0.3921	2.0577	NH	NH.OH	ı
		Na C O	0.3261		NH ₃	(NH ₄) ₂ PtCl ₆ .	ı
.0665	Na ₂ O	Na ₂ S ₂ O ₅		13.035	NH3	(NIII4)2FtCl6.	ı
.1458	Na ₂ O	Na ₄ P ₂ O ₇	0.4660	3.8790	NH ₁	(NH ₄) ₂ SO ₄	ı
.1458	Na ₂ O*	P2O5	0.8727	3.1714	NH	N ₂ O ₅	1
.2915	Na ₂ O	SO ₃	0.7743	0.1127	(NH ₄) ₂ Al ₂	100	ı
.9904	Na ₂ S	BaSO ₄	0.3344		(SO ₄) ₄ ·24H ₂ O	Al ₂ O ₃	ı
.8506	Na ₂ S	CdS	0.5404	0.0376	ditto	NHa	1
.4365	Na ₂ S	H.S	2.2908		ditto	8	1
.2564	Na ₂ S	H ₂ SO ₄ :	0.7959	0.3531	ditto	SO ₃ AgCl	1
.7942	Na ₂ S	Na ₂ O		2.6793	NH.Cl	AgCl	1
.4108	Na ₂ S	8		0.6628	NH.Cl	Cl	ı
	Na ₂ SO ₃	BaSO ₄				HCl	1
.8515		II CO	0.5401		NH ₄ Cl	HCL	ı
6511	Na ₂ SO ₃	H ₂ SO ₃		0.9167	NH ₄ Cl	H ₂ SO ₄	ı
.3890	Na ₂ SO ₃	H ₂ SO ₄		0.9675	$(NH_4)H_2PO_4$.	$Mg_2P_2O_7$	ı
.0135	Na ₂ SO ₁	I		0.1480	(NH ₄)H ₂ PO ₄ .	NH3	ı
.4918	Na ₂ SO ₃	Na ₂ O	2.0334		(NH ₄) ₂ HPO ₄ .	$Mg_2P_2O_7$	ı
.5082	Na ₂ SO ₃	SO2	1.9677	0.2578	(NH ₄) ₂ HPO ₄ .	NH3	1
.2541	Na ₂ SO ₄ ·7H ₂ O	802	3.9356	0.4896	(NH ₄) ₂ MoO ₄ .	Mo	1
.9524	Na ₂ S ₂ O ₂	BaSO		0.0165	(NH ₄) ₈ PO ₄		1
.5696	Na ₂ S ₂ O ₃	Na ₂ S ₂ O ₃	513631		(MoO ₃)12	P	ı
.0000	21142020311111	·5H ₂ O	0 6371	0.0378	ditto	P ₂ O ₅	ı
.6431	Na ₂ SO ₄	BaSO4		0.2838	(NH4)2PtCl6	HNO	١
.3947	Na ₂ SO ₄	CaO		0.4393	(NH4)2PtCl6.	Di	ı
	Na ₂ SO ₄	CaO				Pt	1
.1547		CH3CO2Na		0.9188	(NH ₄) ₂ PtCl ₆ .	PtCl6	1
.6904	Na ₂ SO ₄	H ₂ SO ₄		1.4392	(NH ₄) ₂ S	H ₂ SO ₄	ı
.2267	Na ₂ SO ₄	K ₂ SO ₄		1.7665	(NH ₄) ₂ SO ₄	BaSO4	1
.2838	Na ₂ SO ₄	MgO		0.7422	(NH ₄) ₂ SO ₄	H ₂ SO ₄	١
.7838	Na ₂ SO ₄	Mg2P2O7	1.2758	0.2120	(NH ₄) ₂ SO ₄	N	
.3238	Na2SO4	Na	3.0883	0.2578	(NH ₄) ₂ SO ₄	NH3	1
.8230	Na ₂ SO ₄	NaCl	1.2151	0.5753	(NH ₄) ₂ SO ₄	N.O	ı
.7461	Na ₂ SO ₄	Na2CO3	1.3403	0.4298	(NH4)2S2O8	H ₂ SO ₄	ı
.5913	Na ₂ SO ₄	NaF	1.6912	0,1200	(2,224)3020811	22001111111	J
.6739	Na ₂ S ₂ O ₅	SO ₂	1.4839	4.9225	Ni	NiCaH14N4O4.	1
.6904	Na ₂ SO ₄	NaHSO4	0.5916	4.9556		Ni(NO ₃) ₂	١
				4.9550	Ni	N1(NO3)2	١
.4364	Na ₂ SO ₄	Na ₂ O	2.2915		371	·6H₂O	1
.5495	Na ₂ SO ₄	Na ₂ S	1.8198	1.2727	Ni	NiO	1
.8874	Na ₂ SO ₄	Na ₂ SO ₃	1.1269	2.6371	Ni	NiSO4	
.8877	Na ₂ SO ₄	$Na_2SO_47H_2O$.	0.5297	4.7863	Ni	NiSO4.7H.O.	1
.2681	Na ₂ SO ₄	Na ₂ SO ₄		3.0643	NiO	NiC8H14N4O4	1
		·10H ₂ O	0.4409	2.0720	NiO	NiSO.	
.3383	Na ₂ SO ₄	Na ₂ S ₂ O ₅	0.7472	1.8150	NiSO4	NiSO4.7H2O.	
.5636	Na ₂ SO ₄	SO ₃	1.7743	2.0200	-14004	The state of	1

 $A \times A' = B$ $B \times B' = A$

XVIII.—CONVERSION FACTORS (Continued)

A	В	B'	A'	A	В	B'
NO	HNO ₂	0.6382	1.6900	P ₂ O ₅	NaH ₂ PO ₄	0.5917
NO	HNO	0.4762	1.5632	P ₂ O ₅	Na ₂ H ₂ P ₂ O ₇	0.6397
NO	KNO ₂	0.3526	2.9441	P ₂ O ₃	Na(NH ₄)	0.0037
NO	KNO	0.3320	2.5111	1 203	HPO4·4H ₂ O	0.3395
NO	NaNO ₂		0.0700	P ₂ O ₅	No. 0	
	NaNO	0.4040	0.8729		Na ₂ O	1.1458
NO	NaNO ₃	0.3530	2.3091 26.424	P ₂ O ₅	(NH ₄) ₃ PO ₄	0.4331
N ₂ O ₃	AgNO ₃	0.2470	20.121	1 106	$(MoO_3)_{12}$	0.0378
N ₂ O ₃	HCl	1.0423	1.8727	P ₂ O ₅	Na ₄ P ₂ O ₇	0.5340
N ₂ O ₃	HNO.	0.6032	5.0278	P ₂ O ₅	$U_2P_2O_{11}$	0.1989
N ₂ O ₃ *	H ₂ SO ₃	0.9261	0.0270		022 2011	0.1000
N ₂ O ₃	H.SO4	0.7750	0 5797	Pb	CH ₂ CO ₂ H	1.7255
N ₂ O ₃	KNO ₂	0.4466		Pb	$Pb(C_2H_2O_2)_2$	0.6369
N ₂ O ₄	N	2.7131	1.3424	Pb	PbCl ₂	0.7449
N ₂ O ₃	NaNO ₂	0.5508		Pb	PbCO ₃	0.7754
	NO			Pb	(PhCO) Ph	0.7734
N ₂ O ₃	N ₂ O ₄	1.2666	1.2479	Fb	(PbCO ₃) ₂ Pb	0.0014
N ₂ O ₃		0.8262	1 5001	DL	DL C-0 (OH)2	0.8014
N ₂ O ₄	HCl	1.2617	1.5601	Pb	PbCrO ₄	0.6410
N ₂ O ₄	HNO ₃	0.7301	1.0773	Pb	PbO	0.9283
N ₂ O ₄ *	H ₂ SO ₃	1.1210		Pb	PbO ₂	0.8662
N ₂ O ₄	H ₂ SO ₄		1.1643	Pb	Pb(OH)₂	0.8589
N_2O_4	N	3.2841	1.1549	<u>P</u> b	PbS	0.8659
N ₂ O ₄	<u>NO</u>	1.5332	1 4639	Pb	PbSO₄	0.6831
N ₂ O ₅	HCl	1.4810	0.1548	Pb	S	6.4629
N ₂ O ₆	HNO_3	0.8571	0.2551	PbCl ₂	Cl ₂	3.9216
N ₂ O ₅ *	H ₂ SO ₃	1.3159	0.1647	PbCO ₃	CO ₂	6.0722
N₂O₅	H ₂ SO ₄	1.1013	0.1612	PbCrO	Cr	6.2154
N ₂ O ₆	KNO ₃	0.5342	0.2352	PbCrO ₄	Cr ₂ O ₃	4.2526
N_2O_5	NaNO ₃	0.6353	0.4551	PbCrO4	K ₂ Cr ₂ O ₇	2.1971
N ₂ O ₅	$NH_3 \dots \dots$	3 1710	0.5014	PbCrO ₄	Na ₂ CrO ₄	1.9951
N ₂ O ₅	NO	1.7997	0.6410	PbCrO ₄	Pb	1.5600
N ₂ O ₅	N_2O_3	1.4209	1.1733	PbCrO₄	$Pb(C_2H_3O_2)_2$	
					·3H₂O	0.8523
Os	OsO ₄	0.7489	0.7999	PbCrO₄	(PbCO ₃) ₂ Pb	
	TT DO	0.010		DI CI CI	(OH) ₂	1.2501
P	H ₂ PO ₄		0.6905	PbCrO₄	PbO	1.4482
P	$Mg_2P_2O_7$	0.2787	0.7401	PbCrO ₄	Pb ₂ O ₄	1.3512
P	NaH ₂ PO ₄	0.2585	0.9383	PbCrO ₄	PbSO ₄	1.0657
P	(NH ₄) ₃ PO ₄		0.5642	PbMoO ₄	Pb	1.7722
_	$MoO_3)_{12}$		0.2615	PbMoO ₄	Mo	3.8250
P	P ₂ O ₅		0.3923	PbMoO₄	MoO ₃	2.5500
P ₂ O ₅	Ag_1PO_4		0.9283	PbO	Pb	1.0772
P₂O₅	AIPO₄		1.2461	PbO	PbCl₂	0.8025
P ₂ O ₅	$Al_2P_2O_8$	0.5816	1.1972	PbO	PbCO ₂	0.8353
P ₂ O ₅	CaHPO ₄	0.5219	1.4842	PbO	$Pb(NO_3)_2$	0.6738
P ₂ O ₅	$Ca(H_2PO_4)_2$	0.6067	1.3589	PbO	Pb\$O ₄	0.7359
P ₂ O ₅	CaH ₂ P ₂ O ₇	0.6573	0.8659	PbS	Pb	1.1549
P ₂ O ₅	Ca ₂ P ₂ O ₇	0.5589	0.9328	PbS	PbO	1.0720
P ₂ O ₅	Ca ₃ P ₂ O ₈	0.4579	0.1340	PbS	8	7.4629
P ₂ O ₅	FePO	0.4708	0.7697	PbSO ₄	BaSO ₄	1.2991
P ₂ O ₅	H ₂ PO ₂	0.8657	1.2507	PbSO	Pb(C ₂ H ₂ O ₂) ₂	2001
P ₂ O ₅	H ₂ PO ₄	0.7244	2001	2 0004	3H ₂ O	0.7995
P ₂ O ₅	H ₂ SO ₄	0.4829	0.8525	PbSO4	(PbCO ₃) ₂ Pb	U.1880
P ₂ O ₅	$Mg_2P_2O_7$	0.4829	0.0020	± 00004		1 1791
P ₂ O ₅		0.6962	0.7887	PbSO4	PbO ₂	1.1731 1.2679
L 20/6					F UU2	
P ₂ O ₅	No.HDO.	0.5001	IN 7595 !	$PbSO_4$	Pb ₃ O ₄	1.3272

 $A \times A' = B$ $B \times B' = A$

A'	A	В	B'	A'	A	В	I
0.7889	PbSO ₄	PbS	1.2676	6.4630	8	Pb	0.1
0.2640	PbSO	SO ₃	3.7879	1.9981	S	SO ₂	1.0
3.7270	Pd	K ₂ PdCl ₆	0.2683	2.4972 1.7616	S	SO ₃ BaS	0.4
2.0024	Pd	PdCl ₂ ·2H ₂ O	0.4994	1.3212	84	BaS	lŏ:i
3.3791	Pd	PdI_2	0.2959	3 .6439	SO ₂	BaSO.	0.5
2.1623 2.3979	Pd Pd	Pd(NO ₃) ₂	0.4625 0.4170	1.5783 1.2812	SO ₂	Ca(HSO ₃) ₂ H ₂ SO ₃	0.6
2.3790	Pd	Î	0.4203	1.5309	SO ₂ †	H ₂ SO ₄	ŏ.e
0.7096	PdI2	HI	1.4092	0.7655	SO ₂ *	H ₂ SO ₄	1.8
0.7041 0.9703	PdI ₂ PdI ₂	IO	1.4204 1.0306	1.6244 1.9677	SO ₂	NaHSO ₃ Na ₂ SO ₃	0.6
	1 412	103	1.0000	3.9356	SO ₂	Na ₂ SO ₂ ·7H ₂ O	Ŏ.2
2.4903	Pt	K₂PtCl ₆		1.2498	803	SO ₃	3.0
2.6541 2.2748	Pt	H ₂ PtCl ₆ ·6H ₂ O (NH ₄) ₂ PtCl ₆	0.3768 0.4396	0.4255 1.4255	SO ₃	Al_2O_3	2.3 0.7
1.7266	Pt	PtCL	0.5792	2.9155	SO ₃	BaSO ₄	3.0
2.1881	Pt	$PtCl_4 \cdot 5H_2() K_2PtCl_6$		0.7003	SO ₃	CaSO4	1.4
1.4423 1.3177	PtCl4 PtCl4	(NH ₄) ₂ PtCl ₆	0.6934 0.7589	1.7003 1.2250	SO ₃	H ₂ SO ₄	3.0
1.1383	PtCl. 5H2O	K₂PtCl₅	0.8785	2.1765	80	K ₂ SO ₄	0.4
1.1703	Pr	Pr ₂ O ₃	0.8545	0.5036	SO ₃	MgO(in	1.9
1.1703	Fr			1.5036	SO ₂	$MgSO_4$) $MgSO_4$	0.6
3.7382	Rh	Na ₁ RhCl ₆	0.2675	1.8858	SO ₃	MnSO ₄	0.5
2.0338	Rh	RhCl ₁	0.4917	0.7743 1.7743	SO ₃	$Na_2O \dots Na_2SO_4 \dots$	$\frac{1.2}{0.5}$
1.6775	Rb	AgCl	0.5961	1.1416	80	66° O. V	ŏ.ĕ
0.4150	Rb	Cĭ		2.0162	SO ₃	ZnSO ₄	0.4
1.4150 1.3510	Rb Rb	RhCl RbCO3	0.7067 0.7402	2.4298 0.3130	SO ₄ SO ₃ ·HCl	BaSO ₄ HCl	0.4 3.1
1.0937	Rb	Rb ₂ O		0.8417	SO ₂ ·HCl	H ₂ SO ₄	1.1
1.5622	Rb	Rb_2SO_4		0.4561	$S_2O_5Cl_2$	H ₂ SO ₄	2.1
3.3871 1.1855	Rb RbCl	Rb₂PtCl ₆ AgCl	0.2952 0.8435	2.7649	Sb	KSbOC ₄ H ₄ O ₅	
0.2933	RbCl	Cĭ	3.4098			· ł H ₂ O	0.3
1.2686 1.2939	Rb_2CO_3 Rb_2O	RbHCO3	0.7883	1.8850	Sb	SbCl ₃	0.5
1.4284	Rb_2O	RbCl Rb₂SO₄	0.7729 0.7001	1.1997 1.3328	Sb	Sb_2O_3 Sb_2O_5	0.7
0.4178	Rb ₂ PtCl ₆	RbCl	2.3938	1.4002	8b	Sb_2S_3	0.7
0.3987 0.5060	$ Rb_{2}PtCl_{6} $ $ Rb_{2}PtCl_{6}$	Rb_2CO_3 $RbHCO_3$	2.5071 1.9762	1.2662 1.1109	Sb	$\mathrm{Sb_2O_4}$ $\mathrm{Sb_2O_5}$	0.7
0.3229	Rb ₂ PtCl ₆	Rb ₂ O	3.0972	1.3462	$\mathrm{Sb_2O_3}$ $\mathrm{Sb_2S_3}$	SbCl ₃	0.7
		D. C.	0.1000	1 0015			
5.2848 6.7820	S	BaSO ₁	0.1892 0.1475	1.6315 1.8336	Se	$H_2SeO_3H_2SeO_4$	$0.6 \\ 0.5$
7.2810	S	BaSO ₄	0.1373	1.4040	Se	SeO ₂	0 7
6.0334	S	BaS ₂ O ₃	0.1657	1.6060	Se	SeO ₃	0.6
6.3143 2.2117	S	BaS ₂ O ₃ · H ₂ O . BaS ₄ · H ₂ O	0.2397 0.4521	2.1307	Si	SiO ₂	0.4
1.0629	8	H ₂ S	0.9408	2.6961	Si	SiO ₃	0.3
3.0591 2.7417	S	H ₂ SO ₄ FeS	0.3270 0.3648	3.2615 2.6814	Si SiF4	SiO ₄ BaSiF ₆	0.8 0.8
1.8709	S	FeS ₂		1.3837	SiF ₄	H ₂ SiF ₆	0.7
3.4392	8	K ₂ S	0.2908	2.1141	SiF4	K ₂ SiF ₆	0.4
2.4348	8	Na ₂ S	0.4108	1.0141	SiF ₆	H ₂ SiF ₆	9.0

 $A \times A' = B$

 $A \times A' = A$

† Methyl orange.

^{*} Phenolphthalein.

XVIII.—CONVERSION FACTORS (Continued)

				(00110111111111111111111111111111111111	, I	
Λ	В	B′	A'	A	В	В'
SiO_2	BaSiF6	0.2156	0.5000	Tl2PtCl6	Tl	1.9999
SiO ₂	H ₂ SiO ₃	0.7699	0.5869	Tl2PtCl4	TiCl	1.7038
SiO ₂	K ₂ SiF ₆	0.2735	0.5738	Tl ₂ PtCl ₆	Tl ₂ CO ₂	1.7435
SiO ₂	K ₂ SiO ₃	0.3903	0.8111	Tl ₂ PtCl ₅		1.2329
	No SiO				TII	1.5337
SiO ₂	Na ₂ SiO ₃	0.4930	0.6520	Tl ₂ PtCl ₆	TINO3	
$SiO_2 \dots \dots$	SiF4	0.5782	0.5196	Tl ₂ PtCl ₆	Tl₂O	1.9244
SiO_2	SO ₃	0.3766	0.6178	Tl ₂ PtCl ₆	Tl ₂ SO ₄	1.6187
$SiO_2 \dots \dots$	Si(OH)	0.6259	0.8094	Tl_2SO_4	Tl	1.2354
SiO ₂	ZnSiO ₃	0.4256				
			0.8817	UO ₂	U	1 . 1342
Sn	Cl_2	1.6737	0.8482	U ₃ O ₈	ITT	1.1789
Sn	$SnCl_2 \dots$	0.6261	0.9621	U_3O_8	l UO2	1.0394
Sn	SnCl ₂ ·2H ₂ O.	0.5260	1.7884	U_3O_8	$UO_2(NO_3)_2$	
Sn	SnCL	0.4555			·6H ₂ O	0.5591
Sn	SnO	0.8812	0.6668	$U_2P_2O_{11}$	U	1.4990
Šn	SnO_2	0.7877	0.7566	$U_2P_2O_{11}$	ŬO ₂	1.3221
SnCl ₂	Cl	2.6738	0.1000	011 2011	001	1.0221
SnCl ₂	HCI	2.6000	1.3137	v	V ₂ O ₂	0.7612
SnCl ₂	F ₀ O	1.1875	1.4706	v	V ₂ O ₃	0.6800
	Fe ₂ O ₃					
$\operatorname{SnCl}_2 \dots$	SnCl ₂ ·2H ₂ O	0.8404	1.6275	<u>V</u>	V ₂ O ₄	0.6145
SnCl		1.8369	1.7843	y	V ₂ O ₅	0.5604
SnCl ₄	HCI	1.7861	0.5604	V ₂ O ₅	<u>v.</u>	1.7843
SnO_2	SnCl ₂ ·2H ₂ O	0.6678	1.2638	V ₂ O ₅	VO4	0.7913
SnO_2	SnCL	0.5784				
SnO_2	SnCl.		0.8785	Yt₂O₃	Yt	1.1383
	(NH ₄ Cl) ₂	0.4100	0.7882	Y ₂ O ₃	Y	1.2687
SnO_2	SnO	1.1188				
			2.4739	W	PbWO ₄	0.4042
Sr	SrCO ₃	0.5935	0.8519	WO₂	W	1.1739
Sr	SrO	0.8456	0.7931	WO3	W	1.2609
Sr	SrSO ₄	0.4770	1.9621	WO ₃	PbWO ₄	0.5099
SrO	SrCl ₂	0.6536				
SrSO ₄	SO ₃	2.2943	1.5004	Zn	H_2SO_4	0.6665
			1.2247	Zn	SO_3	0.8165
Та	TaCls	0.5059	2.0849	Zn	ZnCl ₂	0.4796
Ta	Ta ₂ O ₅	0.8194	7.6222	Zn	ZnHg(CNS)	0.1312
		0.0101	1.2448	Zn	ZnO	0.8034
Те	H ₂ TeO ₄	0.6587	2.3315	Zn	$Zn_2P_2O_7$	0.4289
Te	H ₂ TeO ₂ H ₂ O.	0.5554	1.4906	Zn	ZnS	0.6709
Te	TeO_2	0.3334	2.1035	ZnCl ₂	AgCl	0.0709
	TeO ₃	0.7994	0.5204	7nCl		1.9217
Te	1603	0.7200		ZnCl ₂		
ThO	Th	1 1970	0.8579	ZnCl ₂	NaCl	1.1656
ThO ₂	Th	1.1379	1.2054	ZnO	H ₂ SO ₄	0.8296
ThO ₂	ThCL	0.7065	0.9840	ZnO	SO_3	1.0162
ThO ₂	Th(NO ₃)	ا میرم	1.6749	ZnO	ZnCl₂	0.5970
	·6H ₂ O	0.4492	1.1541	Z nO	$ZnCO_3$	0.6490
			2.9427	Z nO	$\mathbf{Z}\mathbf{n}_{2}\mathbf{P}_{2}\mathbf{O}_{7}\dots$	0.3398
Ti	TiO₂	0.6005	1.1975	ZnO	$\mathbf{Z}\mathbf{nS}$	0.8351
	I	I	1.9840	Z nO	ZnSO ₄	0.5040
<u>Tl</u>	TICI	0.8519	3.5340	Z nO	IZnSO₄·7H₂O.	0.2830
Tl	Tl ₂ CO ₃	0.8718	2.3957	Z nS	BaSO ₄	0.4174
Tl	ITII	0.6165	2.9510	ZnS	$ZnSO_4 \cdot 7H_2O$.	0.3389
Tl	TlNO ₃	0.7669	0.4256	ZnSiO ₃	SiO ₂	2.3495
T1	Tl₂O	0.9623	0.4960	ZnSO ₄	SO ₃	2.0162
Tl ₂ CrO ₄	Tl	1.2843			l———	
TIHSO	T1	1.4759	0.7390	ZrO ₂	Zr	1.3532
TlI ₂	Ťi	1.6222	l	l	1	
	•	/ D	<u> </u>	'	<u> </u>	<u> </u>

Note.—The editor will welcome additional factors not appearing in these tables. Although a large portion of these factors have appeared in previous editions the entire list has received careful revision, using the atomic weights of 1920. Credit for the arrangement of this section is due to R. M. Meiklejohn. The factors have been checked by three men working independently.

Example of Method for Using Factors. Suppose the product weighed is 0.8535 gram AgCl and the equivalent weight of Cl is desired; hunt up the factors AgCl-Cl. This may be found on the first page of the conversion factors, a little below the middle of the page. Using the formula $A \times A' = B$, and substituting the values for A (weight of AgCl) and A' (factor) we have $0.8535 \times 0.2474 = 0.21124$ gram Cl. If, on the other hand, the weight of Cl were known to be, say, 0.2501 gram and the weight of the equivalent AgCl were desired, we would use the formula $B \times B' = A$ and, substituting the values for B and B', we would have $0.2501 \times 4.0423 = 1.01098$ gram AgCl.

VOLUMETRIC FACTORS

```
1 c.c. N/2 HCl = .018235 gram HCl

1 c.c. N/10 HCl = .003647 gram HCl

1 c.c. N/2 KOH = .028055 gram KOH

1 c.c. N/6 KOH = .04706 gram oleic acid = .008173 gram H<sub>2</sub>SO<sub>4</sub>

1 c.c. N/10 KOH = .00561 gram KOH

1 c.c. K<sub>2</sub>Cr<sub>2</sub>O<sub>7</sub> = 3.8633 gram per liter = .010 gram I

1 c.c. N/10 Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub>5H<sub>2</sub>O = .0248 gram Na<sub>2</sub>S<sub>3</sub>O<sub>3</sub>5H<sub>2</sub>O = .012692 gram I
```

1 c.c. NO=0.0021 gram HNO₂ =0.0028143 gram HNO₃ =0.0045154 gram KNO₃ =0.003796 gram NaNO₂ =0.00134 gram NO =0.001696 gram N₂O₃ =0.0024119 gram N₂O₅

A	В	B'	. A'	A	В	B'
	i.				·	
						J
Y						

III - COMPARISON OF CENTURADE AND FAHRENHEIT SCALE

°C.	- 1818.1	- - 3 .	-4	- in in i	- 364	- 39 1 -	- 476)	-36	-4516.,	- 796		-900	-(
	·F	F.	F.	F.	F.	F.	F.	F.	7.	Y.	Y.	Y.	1
3	- [.6 5] -	22	32	-27:2	300	1."Y	. 1.	337	LILE		1453	1652	0
3	-:5	- 23	41:	221	BI.	i).	741	54:	I	L30L	1451	1661	5
	- [deli -	L	31	2364	LIA	300	47	563)	LL30	BIA	1499	1670	10
	1759	-	到	230	413	319		955)	I Las	1319	1450	16.3	15
	– isa –	- 4	454	200		40		3000	II-E	133	130%	1668	20
	– 1904 –	12		23.	ET.	SI.		36.	ILE	L33.	1517	1697	25
	-202 -		فالج	25/1	145	436	4)6	356	I I W	L345	1335	1706	30
	-211 -		36	27.30	135	435	·Li	16 5i	11.3	1355	1535	1715	35
	- 22N -		in.	25.4	44-5	611	- B	L:	II.	1364	1544	1724	40
	– XXV –		113	210	£3	161	133	LOLI	1193	13.3	1553	1733	45
孙	- 25% -		122	300			***	I		LIST	1563	1742	50
	- 25		131	311	424	50 L	ŠĪ.	MBI:	1211	Læi	1571	1751	55
160	· 2501 -		I ##	33)	300	(3:0)		1040	1237	1-000	1580	1260	60
	- III -		i #	323	3/6	49.01	393	10-23		1-103	1569	1769	65
	- 2.4 -		136	235	515	60	30.4	1956	121	1415	1596	1778	70
	- ジピー		15.	34.	32.	.17.	**	105	126	1427	1607	1787	75
	- ZIZ -		176	23%	53%	716		100.4	1256	1436	1616	1796	80
	-#11. -		المكاف	345	515	725	905	1053	1355	1442	1625	1805	85
., .	-3111 -		134	37.4	554	.34	914	1004	127.4	1454	1634	1814	90
	-314 -		ЭG	353	553	743	923	1103	1283	1463	1643	1823	95
us,	-25 -	145	-212	X12	5.2	752	933	1112	1293	1473	1652	1832	100
11	:5\$#	100.	~ 100¢	-201	-3001	-400; -	-500	-600	-700	-800	-900	+1000	٥(.
C^{γ}	1100 2012	12 21		1300 2372	1400 2552	1500 2732		500 012	1700 30 9 2	1800 3272	190 343		000 5'.2
إبدا	and C	/1.5	-3.=	· [Negre	r≈ F.			Degr	ees F.	-3 2 ÷	1.8=E)egrees	C.
				Almost	IITE 181	-27	3° C	= -4	39° F				

Absolute zero, -273° C. = -459° F.

Comparison of Centigrade and Fahrenheit Scale for Every 1° C. from 0° to 100° C.

(),	0	10	20	30	40	50	60	70	80	90	C.
	F.	F.	F.	F.	F .	F.	F.	F.	F.	F.	
"	352	<i>56</i>)	68	86	104	122	140	158	176	194	0
1	23 8	51.8	69.8	87.8	105.8	123.8	141.8	159.8	177.8	195.8	1
2	75, 6	53.6	71.6	89.6	107.6	125.6	143.6	161.6	179.6	197.6	2
3	37 4	55. 4	73.4	91.4	109.4	127.4	145.4	163.4	181.4	199.4	3
4	39 2	57 2	75.2	93.2	111.2	129.2	147.2	165.2	183.2	201.2	4
5	41 0	5/3	77	95	113	131	149	167	185	203	5
6,	42 8	60.8	78.8	96.8	114.8	132.8	150.8	168.8	186.8	204.8	6
7	11 6	62.6	80.6	98.6	116.6	134.6	152.6	170.6	188.6	206.6	7
ķ	46 4	64 4	82.4	100.4	118.4	136.4	154.4	172.4	190.4	208.4	8
9	48 2	66.2	84.2	102.2	120.2	138.2	156.2	174.2	192.2	210.2	9
r;	9	. 19	29	39	49	59	69	79	89	99	C.

 $100^{\circ} \text{ C.} = 212^{\circ} \text{ F.}$

KX.—RELATION OF BAUMÉ DEGREES TO SPECIFIC GRAVITY AND THE WEIGHT OF ONE UNITED STATES GALLON AT 60° F.—LIQUIDS LIGHTER THAN WATER

Baumé.	Specific Gravity.	Pounds in Gallon.	Baumé.	Specific Gravity.	Pounds in Gallon.	Baumé.	Specific Gravity.	Pounds in Gallon.	Baumé.	Specific Gravity.	Pounds in Gallon.
10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27	1.0000 0.9929 0.9859 0.9790 0.9722 0.9655 0.9589 0.9523 0.9459 0.9395 0.9333 0.9271 0.9210 0.9150 0.9090 0.9032 0.8974	8.33 8.27 8.21 8.16 8.10 7.99 7.83 7.89 7.89 7.72 7.67 7.62 7.75 7.53 7.48	31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47	0.8695 0.8641 0.8588 0.8536 0.8484 0.8433 0.8383 0.8383 0.8284 0.8235 0.8187 0.8139 0.8092 0.8045 0.7954	7.24 7.20 7.15 7.11 7.03 6.98 6.94 6.90 6.86 6.78 6.74 6.70 6.66 6.63 6.59	52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68	0.7692 0.7650 0.7650 0.7567 0.7526 0.7486 0.7446 0.7407 0.7368 0.7329 0.7290 0.7253 0.7216 0.7179 0.7142 0.7106 0.7070	6.41 6.37 6.34 6.30 6.27 6.24 6.17 6.14 6.11 6.01 5.98 5.95 5.95	73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88	0.6896 0.6863 0.6829 0.6763 0.6763 0.6698 0.6666 0.6635 0.6604 0.6573 0.6542 0.6511 0.6481 0.6451 0.6452 0.6392	5.75 5.52 5.69 5.66 5.63 5.55 5.52 5.548 5.42 5.38 5.38 5.33
27 28 29 30	0.8917 0.8860 0.8805 0.8750	7.43 7.38 7.34 7.29	48 49 50 51	0.7865 0.7821 0.7777 0.7734	6.55 6.52 6.43 6.44	69 70 71 72	0.7035 0.7000 0.6965 0.6930	5.86 5.83 5.80 5.78	90 95 	0.6363 0.6222	5.30 5.18

XX.—(a) RELATION OF BAUMÉ DEGREES TO SPECIFIC GRAVITY—LIQUIDS HEAVIER THAN WATER

Baumé Degrees.	Specific Gravity.	Baumé Degrees.	Specific Gravity.	Baumé Degrees.	Specific Gravity.	Baumé Degrees.	Specific Gravity.
0.0	1.0000	6.0	1.0432	24.0	1.1983	42.0	1.4078
0.1	1.0007	7.0	1.0507	25.0	1.2083	43.0	1.4216
0.2	1.0014	8.0	1.0584	26.0	1.2185	44.0	1.4356
0.3	1 0021	9.0	1.0662	27.0	1.2288	45.0	1.4500
0.4	1.0028	10.0	1.0741	28.0	1.2393	46.0	1.4646
0.5	1.0035	11.0	1.0821	29.0	1.2500	47.0	1.4796
0.6	1.0042	12.0	1.0902	30.0	1.2609	48.0	1.4948
0.7	1.0049	13.0	1.0985	31.0	1.2719	49.0	1.5104
0.8	1.0055	14.0	1.1069	32.0	1.2832	50.0	1.5263
0.9	1.0062	15.0	1.1154	33.0	1.2946	51.0	1.5426
1.0	1.0069	16.0	1.1240	34.0	1.3063	52.0	1.5591
1.5	1.0105	17.0	1.1328	35.0	1.3282	53.0	1.5761
2.0	1.0140	18.0	1.1417	36.0	1.3303	54.0	1.5934
2.5	1.0175	19.0	1.1508	37.0	1.3426	55.0	1.6111
3.0	1.0211	20.0	1.1600	38.0	1.3551	56.0	1.6292
3.5	1.0247	21.0	1.1694	39.0	1.3679	57.0	1.6477
4.0	1.0284	22.0	1.1789	40.0	1.3810	58.0	1.6667
5.0	1.0357	23.0	1.1885	41.0	1.3942	59.0	1.6860
				!!		60.0	1.7059

						ing 11 ing 11								96 = 96 =				_	
	k 0 1 2 3 4 5 6 7 8 9																		
			_	_			_			_	1	2	3	4	5	6	7	8	9
100 22 24	250 1115		255	記事 報政 機能 22時 23時	9866		3	=			4 3 3			M		2 E	**	H H H H H	HHH
is in in	***	=	=	二	204	223 223 223	=	焉	100 M		3 2 2	5 5 5			13	E E	H		**
Runn	***	744	=	100				200 100 170		3000	3	4444	6 6 6	8 8	II D M 9	11	H		11
***	450	44	66 66	4	400 423 423 423 423 426	455	400	480 53	485		3	3	5 5 5 4	ī	9 8 8 5 7		n n	II II II II	15 14 14
RHHHH	991.4 9951 9651		5653 5653 5611	4864 4866 5468 5234 5234	Side Side	2000 (1122 (4122 (4122		941 945 924		72 72		3	***	5	T T T 6		100	11 11 11 11 11 11 11 11 11 11 11 11 11	12
****	5663 5660 5796	5573 5604 5500	5587 3786 5821	5478 5580 5717 5432 5644	5611 5729 5043	5623 5740 5855	5425 57.72	5541 5763 5677	5056 5775 3700	57.765 54002	11111	1 1	44333	5	6			10 15 9	11 12 12 12 12 12 12 12 12 12 12 12 12 1
***	6126 6222 6225	6126 6045 6045	61.49 6253 6355	6052 6149 6053 6365 6464	6170 6274 6375	6199 6294 6865	6191 6194 6294 6365 6483	6294 6234 6425	6212 6314 6415	6222 6325 6425	1	2 2 2	2 2 2 2		5	99999	87777		9
45 46 47 46 49	6721 6721	6637 6730 6621	65-10 67-70 68-70	6561 6656 6749 6430	5005 6758 6048	6675 6767 6857	6399 6004 6776 6066 6065	6:15 6:15	6782 6794 6884	6712 6865 6683	1 1 1 1 1	2	3 3 3 3 3		5 5 5 4 4	86555	7766	8 7 7 7 7	
50 51 52 54 54	7976 7189 7343	7004 7108 7251	7003 7177 7259	7016 7101 7185 7267 7346	7110 7193 7275	7118 7302 7204	7942 7126 7210 7292 7372	7135 7218 7300	7143 7236 7300	7152 7235	1		2		44444		66866	7 7 7 6 6	88777
					r =3	11416).497).502		10			

COMPUTED BY H. G. SHAW, PH.D.

A convenient chart mounted on cardboard may be obtained of the above logarithms and the following antilogarithms from L. E. Knott Apparatus Co., 79–83 Amherst Street, Cambridge, Mass.

LOGARITHMS

No. O 1 2 3 4 5 6 7 8 9 PROPORTIONAL PARTS 1 2 3 4 5 6 7 7 7 7 7 7 7 7 7					•	4-10 6	740 259	= 9.° = 0.2	og .55:	col				3-10	7782	0 = 1. 0 = 8.	og 60	col	П
1		ARTS	L P	NAI	RTIO		_		7.7	7.	-	-							
1	8 9	7	6	5	4	3	2	1	•	•	<u>'</u>	•		•	3	2	1	0	Nos.
70	6			4										7435	7427	7419	7412	7404	55
Time	6													7513	7505	7497	7490	7482	
59	6													7589	7582	7574	7566	7559	
7833 7860 7868 7875 7882 7889 7896 7903 7910 7917 1 1 2 3 3 4 4 5 7924 7931 7938 7945 7952 7059 7966 7973 7898 7987 1 1 2 3 3 3 4 5 8028 8006 8007 8014 8021 8028 8035 8041 8048 8055 1 1 2 3 3 3 4 5 8028 8062 8069 8075 8082 8093 8008 8102 8109 8116 8122 1 1 2 3 3 3 4 5 8028 8195 8202 8209 8215 8222 8228 8235 8241 8248 8254 1 1 2 3 3 3 4 5 8028 8255 8331 8338 8344 8351 8358 8344 8351 8358 8395 8401 8407 8414 8420 8426 8432 8432 8432 8432 8432 8432 8435 8355 8361 8519 8525 8531 8537 78585 8502 8265 8525 8531 8537 78 8565 8578 8578 8585 8591 8597 8503 8609 8615 8621 8627 874 8608 8814 8820 8825 8831 8508 8814 8820 8825 8831 8508 8814 8820 8825 8831 8508 8814 8820 8825 8831 8539 8989 8904 8910 8915 1 1 2 2 3 3 4 4 8 8028 8268 8814 8820 8825 8831 8398 9804 8910 8915 1 1 2 2 3 3 4 4 8 8028 8268 8814 8850 8825 8831 8359 898 9904 8910 8915 1 1 2 2 3 3 4 4 8 8028 826 8825 8831 8359 898 8998 8904 8910 8915 1 1 2 2 3 3 4 4 8 8028 826 826 8831 8359 898 8904 8910 8915 1 1 2 2 3 3 4 4 8 8028 826 8831 8359 898 8904 8910 8915 1 1 2 2 3 3 4 4 8 8028 826 8831 8359 898 8904 8910 8915 1 1 2 2 3 3 4 4 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	6			i										7738	7657	7649	7642 7716	7634 7709	
7833 7860 7868 7875 7882 7889 7896 7903 7910 7917 1 1 2 3 3 4 4 5 7924 7931 7938 7945 7952 7059 7966 7973 7898 7987 1 1 2 3 3 3 4 5 8028 8006 8007 8014 8021 8028 8035 8041 8048 8055 1 1 2 3 3 3 4 5 8028 8062 8069 8075 8082 8093 8008 8102 8109 8116 8122 1 1 2 3 3 3 4 5 8028 8195 8202 8209 8215 8222 8228 8235 8241 8248 8254 1 1 2 3 3 3 4 5 8028 8255 8331 8338 8344 8351 8358 8344 8351 8358 8395 8401 8407 8414 8420 8426 8432 8432 8432 8432 8432 8432 8435 8355 8361 8519 8525 8531 8537 78585 8502 8265 8525 8531 8537 78 8565 8578 8578 8585 8591 8597 8503 8609 8615 8621 8627 874 8608 8814 8820 8825 8831 8508 8814 8820 8825 8831 8508 8814 8820 8825 8831 8508 8814 8820 8825 8831 8539 8989 8904 8910 8915 1 1 2 2 3 3 4 4 8 8028 8268 8814 8820 8825 8831 8398 9804 8910 8915 1 1 2 2 3 3 4 4 8 8028 8268 8814 8850 8825 8831 8359 898 9904 8910 8915 1 1 2 2 3 3 4 4 8 8028 826 8825 8831 8359 898 8998 8904 8910 8915 1 1 2 2 3 3 4 4 8 8028 826 826 8831 8359 898 8904 8910 8915 1 1 2 2 3 3 4 4 8 8028 826 8831 8359 898 8904 8910 8915 1 1 2 2 3 3 4 4 8 8028 826 8831 8359 898 8904 8910 8915 1 1 2 2 3 3 4 4 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	6		4	-	-		1		7040	7020	7020	7005	wa10	~010	H000				
70	6				3									7882	7875	77868	7789	7782	
63 7993 8000 8007 8014 8021 8028 8035 8041 8048 8055 1 1 2 3 3 4 5 8062 8069 8075 8082 8089 8096 8102 8109 8116 8122 1 1 2 3 3 4 5 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	6	5		3	3	2	1							7952	7945	7938	7031	7800	
64 8062 8069 8075 8082 8089 8096 8102 8109 8116 8122 1 1 2 3 3 4 5 5 6 6 8129 8136 8142 8149 8156 8162 8169 8176 8182 8189 1 1 1 2 3 3 3 4 5 6 8 825 8202 8209 8215 8222 8228 8228 8235 8241 8248 8254 1 1 2 3 3 3 4 5 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 4 8 8 3 1 8 5 7 8 8 6 8 8 8 8 8 8 8 3 4 8 8 3 1 8 5 7 8 8 6 8 8 8 8 8 8 3 8 8 4 8 8 3 1 8 5 7 8 8 6 8 8 8 8 8 8 8 8 8 8 8 4 8 8 8 1 8 5 7 8 8 6 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	5	5	4	3	3	2	1		8055	8048	8041	8035	8028	8021	8014	8007	8000	7993	
66 8 135 8202 8209 8215 8222 8228 8235 8241 8248 8254 1 1 2 3 3 4 5 67 8261 8267 8274 8288 8287 8293 8299 8306 8312 8319 1 1 2 3 3 3 4 5 68 825 8331 8338 8344 8351 8357 8363 8370 8376 8382 1 1 2 3 3 3 4 4 4 8 8 8 8 8 8 8 8 8 8 8 8 8 8	5	5	4	3	3	2	1	1	8122	8116	8109	8102	8096	8089	8082	8075	8069	8062	
66 8195 8202 8209 8215 8222 8235 8241 8248 8254 1 1 2 3 3 4 5 6 8 5225 8331 8338 8344 8351 8357 8363 8370 8376 8382 1 1 2 3 3 3 4 5 6 8 5325 8331 8338 8344 8351 8420 8426 8432 8439 8445 1 1 2 2 3 3 4 4 4 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	5				3		1							8156	8149	8142	8136	8129	65
68 8325 8331 8338 8344 8351 8420 8426 8432 8439 8445	5	5		3	3									8222	8215	8209	8202	8195	66
69 8388 8395 8401 8407 8414 8420 8426 8432 8439 8445 1 1 2 2 3 4 4 70 8451 8457 8463 8470 8476 8543 8549 8555 8561 8567 1 1 2 2 3 4 4 71 8513 8519 8525 8531 8537 8543 8549 8555 8561 8567 1 1 2 2 3 4 4 72 8573 8579 8585 8591 8597 8603 8609 8615 8621 8637 1 1 2 2 3 4 4 73 8633 8639 8645 8651 8657 8603 8609 8615 8621 8637 1 1 2 2 3 4 4 74 8692 8698 8704 8710 8716 8716 872 872 8733 8739 8745 1 1 2 2 3 4 4 75 8751 8756 8762 8768 8774 8779 8785 8791 8797 8802 1 1 2 2 3 3 4 4 75 8808 8814 8820 8825 8831 8878 8893 8899 8904 8910 8915 1 1 2 2 3 3 4 4 869 891 8927 8932 8938 8943 8949 8954 8960 8965 8971 1 1 2 2 3 3 4 4 80 9031 9036 9042 9047 9053 9004 9009 9015 9020 9025 1 1 2 2 3 3 4 4 80 9031 9036 9042 9047 9053 9058 9063 9069 9074 9079 1 1 2 2 3 3 4 4 80 9031 9036 9042 9047 9053 9129 9117 9122 9128 9133 1 1 2 2 3 3 4 4 81 9085 9090 9096 9101 9106 9112 9117 9122 9128 9133 1 1 2 2 3 3 4 4 82 9138 9143 9144 9154 9159 9165 9170 9175 9180 9186 1 1 2 2 3 3 4 4 82 9138 9143 9144 9154 9159 9165 9170 9175 9180 9186 1 1 2 2 3 3 4 4 82 9243 9248 9253 9258 9263 9269 9274 9279 9284 9289 1 1 2 2 3 3 4 4 85 9244 9299 9304 9309 9315 9309 9325 9330 9335 9340 1 1 2 2 3 3 4 4 85 9244 9299 9304 9309 9315 9309 9325 9330 9335 9340 1 1 2 2 3 3 4 4 86 9345 9350 9355 9360 9365 9469 9474 9479 9484 9489 0 1 1 2 2 3 3 3 4 87 9395 9400 9405 9410 9415 9420 9425 9430 9435 9440 0 1 1 2 2 3 3 3 4 87 9395 9600 9605 9609 9661 9669 9671 9675 9680 0 1 1 2 2 3 3 3 94 90 9542 9547 9552 9557 9562 9566 9571 9576 9581 9586 0 1 1 2 2 3 3 3 94 90 9543 9643 9649 9699 9703 9703 9708 9713 9717 9722 97277 0 1 1 2 2 3 3 3 94 90 9543 9643 9649 9699 9703 9703 9708 9713 9717 9722 9727 0 1 1 2 2 3 3 3 94 91 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 3 94 91 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 3 96 92 9638 9641 9698 9703 9703 9708 9809 9814 9818 0 1 1 1 2 2 3 3 3 96 93 9777 9782 9786 9791 9795 9800 9805 9809 9814 9818 0 1 1 1 2 2 3 3 3 94 95 9777 9782 9786 9791 9795 9800 9805 9809 9814 9818 0 1	5													8287	8280	8274	8267	8261	
70 8461 8457 8463 8470 8476 8543 8549 8555 8561 8567 1 1 2 2 3 4 4 8573 8579 8585 8591 8597 8603 8609 8615 8621 8637 1 1 2 2 3 4 4 8692 8698 8704 8710 8716 8722 8727 8733 8739 8745 1 1 2 2 3 4 4 8692 8698 8704 8710 8716 8722 8727 8733 8739 8745 1 1 2 2 3 3 4 4 8692 8698 8704 8710 8716 8722 8727 8733 8739 8745 1 1 2 2 3 3 4 4 8692 8698 8704 8710 8716 8722 8727 8733 8739 8745 1 1 2 2 3 3 4 4 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	5													9414	9407	8338	8331	8325	
71 8513 8519 8525 8531 8537 8638 8543 8549 8555 8561 8567 1 1 2 2 3 4 4 4 8692 8698 8704 8710 8716 8623 8669 8675 8681 8686 1 1 2 2 3 4 4 4 8692 8698 8704 8710 8716 8722 8727 8733 8739 8745 1 1 2 2 3 4 4 4 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	_		-	_	_	-	-	•	VX10	0100		0260	9220	0212	1010	6401	8395	6388	69
72 8573 8579 8585 8591 8597 8603 8609 8615 8621 8627 1 1 2 2 3 3 4 4 8692 8698 8704 8710 8716 8722 8727 8733 8739 8745 1 1 2 2 3 3 4 4 4 8692 8698 8704 8710 8716 8722 8727 8733 8739 8745 1 1 2 2 3 3 4 4 4 8 8692 8698 8704 8710 8716 8722 8727 8733 8739 8745 1 1 2 2 3 3 4 4 4 8 8692 8698 8704 8710 8716 8722 8727 8733 8739 8745 1 1 2 2 3 3 4 4 4 8 800 8826 8814 8820 8825 8831 8878 8842 8848 8854 8859 1 1 2 2 3 3 3 4 8 8 8 892 8897 8932 8938 8899 8904 8910 8915 1 1 2 2 3 3 3 4 8 8 8 891 8927 8932 8938 8943 8949 8954 8960 8965 8971 1 1 2 2 3 3 3 4 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	5													8476	8470	8463	8457	8451	
73 8633 8639 8645 8651 8657 74 8692 8698 8704 8710 8716 75 8751 8756 8762 8768 8774 76 8808 8814 8820 8825 8831 77 8865 8871 8876 8882 8887 78 8921 8927 8932 8938 8943 79 8976 8982 8987 8993 8998 80 9031 9036 9042 9047 9053 81 9085 9090 9096 9101 9106 81 9038 9042 9047 9053 82 9138 9143 9149 9154 9159 83 9191 9196 9201 9206 9212 84 9243 9248 9253 9258 9263 85 9294 9299 9304 9309 9315 85 9294 9299 9304 9309 9315 85 9345 9360 9355 9360 9365 87 9355 9400 9405 9410 9415 88 946 9454 9459 9554 9960 9385 9390 89 904 9499 9504 9509 9510 88 9445 9459 9558 960 958 9671 89 91 91 91 91 91 91 91 91 91 91 91 91 91	5													8597	8591	8585	8570	8513	
74 8692 8698 8704 8710 8716 8722 8727 8733 8739 8745 1 1 2 2 3 4 4 75 8751 8756 8762 8768 8774 8719 8785 8791 8797 8802 1 1 2 2 3 3 4 4 76 8808 8814 8820 8825 8831 8837 8842 8848 8854 8859 1 1 2 2 3 3 4 4 77 8865 8871 8876 8882 8887 8938 8943 8954 8960 8915 1 1 2 2 3 3 3 4 8 89 9031 9036 9042 9047 9053 9058 9069 9015 9020 9025 1 1 2 2 3 3 4 8 80 9031 9036 9042 9047 9053 9058 9069 9074 9079 1 1 2 2 3 3 4 8 81 9085 9090 9096 9101 9106 9112 9117 9122 9128 9133 1 1 2 2 3 3 4 8 82 9138 9143 9149 9154 9159 9165 9170 9175 9180 9186 1 1 2 2 3 3 4 9 84 9243 9248 9253 9258 9263 9269 9274 9279 9284 9289 1 1 2 2 3 3 4 9 85 9294 9299 9304 9309 9315 9369 9374 9279 9284 9289 1 1 2 2 3 3 4 9 85 924 9299 9304 9309 9315 9320 9325 9330 9335 9340 1 1 2 2 3 3 3 4 9 87 9395 9400 9405 9410 9415 9420 9425 9430 9435 9440 0 1 1 2 2 3 3 3 8 9 88 9445 9450 9455 9460 9465 9469 9474 9479 9484 9489 0 1 1 2 2 3 3 3 9 90 9542 9547 9552 9557 9562 9566 9571 9576 9581 9586 0 1 1 2 2 3 3 3 9 90 9542 9547 9552 9557 9562 9566 9571 9576 9581 9586 0 1 1 2 2 3 3 3 9 91 9590 9595 9600 9605 9609 9614 9619 9664 9628 9633 0 1 1 2 2 3 3 3 9 91 9777 9782 9786 9791 9795 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 3 9 95 9777 9782 9786 9791 9795 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 9 95 9777 9782 9786 9791 9795 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 9 96 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 2 2 3 3 3	5	4	4	3	2	2	.1		8686	8681	8675	8669	8663	8657	8651	8645	8639	8633	
76 8808 8814 8820 8825 8831 8837 8842 8848 8854 8859 1 1 2 2 3 3 4 4 8858 8814 8820 8825 8887 8898 8904 8910 8915 1 1 2 2 3 3 3 4 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8	5	4	4	3	2	2	1	1	8745	8739	8733	8727	8722						
76 8808 8814 8820 8825 8831 8837 8842 8848 8854 8859 8856 8871 8876 8882 8887 88878 8898 8894 8910 8915 1 1 2 2 3 3 4 3 4 3 4 3 4 3 4 3 4 3 4 3 4 3	5				2			1						8774	8768	8762	8756	8751	75
77 8865 8871 8876 8882 8887 8998 8904 8910 8915 8911 1 1 2 2 3 3 4 8916 892 892 8938 8938 8954 8960 8965 8971 1 1 2 2 3 3 4 8916 892 8987 8998 8998 8954 8960 8965 8971 1 1 2 2 3 3 4 8916 892 8987 8998 8998 8954 8960 8965 8971 1 1 2 2 3 3 4 8916 8916 8916 8916 8917 8918 918 918 918 918 919 910 910 910 9112 9117 9122 9128 9133 1 1 2 2 3 3 4 82 9138 9143 9149 9154 9159 9165 9170 9175 9180 9186 1 1 2 2 3 3 3 4 9243 9248 9248 9253 9269 9217 9222 9227 9232 9238 1 1 2 2 3 3 3 4 9243 9248 9253 9258 9263 9269 9274 9279 9284 9289 1 1 2 2 3 3 3 4 9245 9359 9359 8960 9851 9365 9360 9365 9368 9373 9375 9382 9385 9385 9365 9361 9365 9373 9375 9382 9386 9385 9360 0 1 1 2 2 2 3 3 948 9331 9336 9341 9345 9350 9365 9363 9368 9373 9375 9382 9386 9385 9360 0 1 1 2 2 2 3 3 948 9331 9336 9341 9345 9350 9365 9368 9383 9368 9373 9375 9382 9386 9383 9388 9386 9384 9385 9360 0 1 1 2 2 2 3 3 948 9331 9336 9341 9345 9350 9365 9368 9373 9368 9373 9376 9378 9378 9378 9378 9378 9378 9389 9386 9388 9386 9341 9388 9386 9341 9388 9388 9388 9388	5			3	2									8831	8825	8820	8814	8808	76
89 8976 8982 8987 8993 8998 9004 9009 9015 9020 9025 1 1 2 2 3 3 4 8 8 9 8 9085 9090 9096 9101 9106 9112 9117 9122 9128 9133 1 1 2 2 3 3 3 4 9 8 9181 9189 9149 9159 9165 9170 9175 9180 9186 1 1 2 2 3 3 3 4 9 8 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9	4													8887	8882	8876	8871	8865	77
80 9031 9036 9042 9047 9053 9018 9063 9069 9074 9079 1 1 2 2 3 3 4 9085 9090 9096 9101 9106 9112 9117 9122 9128 9133 1 1 2 2 3 3 4 9191 9196 9201 9206 9212 9217 9222 9227 9232 9238 1 1 2 2 2 3 3 4 9243 9248 9253 9258 9263 9269 9274 9279 9284 9289 1 1 2 2 3 3 4 9243 9248 9253 9258 9263 9269 9274 9279 9284 9289 1 1 2 2 3 3 3 4 9243 9245 9259 9258 9263 9269 9274 9279 9284 9289 1 1 2 2 3 3 3 4 9243 9245 9259 9304 9309 9315 9320 9325 9330 9335 9340 1 1 2 2 3 3 3 4 9243 9249 9304 9309 9315 9320 9325 9330 9335 9340 1 1 2 2 3 3 3 4 9243 9249 9400 9405 9410 9415 9420 9425 9430 9435 9340 0 1 1 2 2 3 3 3 94 940 9405 9405 9465 9465 9469 9474 9479 9484 9489 0 1 1 2 2 3 3 3 9494 9499 9504 9509 9613 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 94 9731 9736 9741 9745 9750 9763 9765 9581 9586 0 1 1 2 2 3 3 3 94 9731 9736 9741 9745 9750 9763 9768 9773 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9763 9768 9773 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9809 9814 9818 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9809 9814 9818 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9809 9814 9818 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 96 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 2 2 3 3 3 94 9731 9736 9740 9795 9703 9708 9713 9717 9722 9737 0 1 1 2 2 3 3 3 94 9731 9736 9741 9745 9750 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 3 94 9731 9736 9740 9795 9703 9708 9713 9717 9722 9737 0 1 1 1 2 2 3 3 3 94 9731 9736 9740 9795 9703 9708 9713 9717 9722 9737 0 1 1 1 2 2 3 3 3 94 9731 9736 9740 9795 9703 9708 9713 9717 9722 9737 0 1 1 1 2 2 3 3 3 94 9731 9736 9740 9795 9708 9713 9717 9722 9737 0 1 1 1 2 2 3 3 3 94 9731 9736 9740 9795 9703 9708 9713 9717 9722 9737 0 1 1 1 2 2 3 3 3 94 9731 9736 9740 9745 9750 9800 9805 9809 9814 9818 0 1 1 1 2 2 3 3 3 94 9731 9736 9748 9759 9763 9763 9763 9763 9763 9773 0 1 1 1 2 2 3 3 3 94 9731 9736 9748 9759 9763 9763 9763 9763 9763 0711 1 1 2 2 3	4																		78
81 9085 9090 9096 9101 9106 9112 9117 9122 9128 9133 1 1 2 2 3 3 4 4 918 9143 9149 9154 9159 9165 9170 9175 9180 9186 1 1 2 2 3 3 3 4 924 9299 920 9206 9212 9217 9222 9227 9232 9238 1 1 2 2 3 3 4 924 924 924 925 9258 9263 9269 9274 9279 9284 9289 1 1 2 2 3 3 4 928 927 9235 9258 9263 9269 9274 9279 9284 9289 1 1 2 2 3 3 4 928 928 928 928 928 928 928 928 928 928	•	^	°	•	-			•	9020	9020	9019	9009	9004	8998	8993	8987	8982	8976	79
82 9138 9143 9149 9154 9159 9165 9170 9175 9180 9186 1 1 2 2 3 3 4 9249 9191 9196 9201 9206 9212 9217 9222 9227 9232 9238 1 1 1 2 2 3 3 3 4 9248 9248 9253 9258 9263 9269 9274 9279 9284 9289 1 1 2 2 3 3 3 4 9245 9345 9350 9355 9360 9365 9370 9375 9380 9385 9340 1 1 2 2 3 3 3 4 9245 9345 9340 9410 9415 9420 9425 9430 9435 9340 0 940 5 9410 9415 9420 9425 9430 9435 9440 0 1 1 2 2 3 3 3 8 9445 9450 9450 9450 9465 9469 9474 9479 9484 9489 0 1 1 2 2 3 3 3 944 949 9504 9509 9513 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 945 9494 9499 9504 9509 9513 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 945 9450 9450 9450 9450 9451 9469 9474 9479 9484 9489 0 1 1 2 2 3 3 3 945 9450 9450 9450 9614 9619 9624 9628 9633 0 1 1 2 2 3 3 3 945 9450 9450 9614 9619 9624 9628 9633 0 1 1 2 2 3 3 9645 9643 9647 9652 9657 9661 9666 9671 9675 9680 0 1 1 2 2 3 3 945 9731 9736 9741 9745 9750 9764 9759 9763 9768 9773 0 1 1 2 2 3 3 945 9731 9736 9741 9745 9750 9764 9759 9763 9768 9773 0 1 1 2 2 3 3 945 9731 9736 9741 9745 9750 9763 9768 9773 0 1 1 2 2 3 3 965 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 1 2 2 3 3 3 965 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 1 2 2 3 3 3 965 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 1 2 2 3 3 3 965 9823 9827 9832 9836 9841	4						1							9053	9047	9042	9036	9031	
83 9191 9196 9201 9206 9212 9217 9222 9227 9232 9238 1 1 2 2 2 3 3 4 9243 9248 9253 9258 9263 9269 9274 9279 9284 9289 1 1 2 2 3 3 3 4 9243 9248 9253 9258 9263 9274 9279 9284 9289 1 1 2 2 3 3 3 4 925 924 9299 9304 9309 9315 9320 9325 9330 9335 9340 1 1 2 2 3 3 3 4 925 9335 9400 9405 9410 9415 9420 9425 9439 9435 9440 0 1 1 2 2 3 3 3 4 925 924 9299 9504 9509 9613 9409 9405 9469 9465 9469 9474 9479 9484 9489 0 1 1 2 2 3 3 3 940 9404 9499 9504 9509 9613 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 94 9494 9499 9504 9509 9613 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 94 9494 9499 9504 9509 9613 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 94 9404 9409 9405 9405	4			3	9									9106	9101	9096	9090	9085	
84 9243 9248 9253 9258 9263 9274 9279 9284 9289 1 1 2 2 3 3 4 85 9294 9299 9304 9309 9315 9320 9325 9330 9335 9340 1 1 2 2 3 3 4 86 9345 9350 9355 9360 9365 9370 9375 9380 9385 9390 1 1 2 2 3 3 4 87 9395 9400 9405 9460 9420 9425 9430 9435 9440 0 1 1 2 2 3 3 4 88 9445 9499 9504 9509 9513 9518 9523 9532 9533 9538 0 1 1 2 2 3 3 90 9542 9547 9552 9557 9562 9518 9580 9533 9538 0 1 1 2 2 3 3 91 9590 9559 9605 9605 9607 9614 9619 9624 9628	4													9109	9104	9149	9143	9138	
86 9345 9350 9355 9360 9365 9370 9375 9380 9385 9390 1 1 2 2 2 3 3 4 9385 9400 9405 8410 9415 9420 9425 9430 9435 9440 0 1 1 1 2 2 3 3 3 940 9405 9459 9465 9469 9474 9479 9484 9489 0 1 1 1 2 2 3 3 3 9404 9499 9504 9509 9613 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 9404 9499 9504 9509 9613 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 9404 9499 9504 9609 9613 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 9404 9409 9504 9609 9605 9609 9614 9619 9624 9628 9633 0 1 1 2 2 3 3 3 94 9731 9736 9741 9745 9750 9763 9763 9763 9768 9773 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 96 9823 9827 9832 9836 9841 9845 9850 9854 9818 0 1 1 2 2 3 3 96 9823 9827 9832 9836 9841	4													9263	9258	9253	9248	9243	
86 9345 9350 9355 9360 9365 9370 9375 9380 9385 9390 1 1 2 2 2 3 3 4 3 3 9385 9400 9405 9410 9415 9420 9425 9430 9435 9440 0 1 1 1 2 2 3 3 3 9404 9499 9504 9509 9613 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 94 9530 9555 9600 9605 9609 9614 9619 9624 9628 9633 0 1 1 2 2 3 3 3 94 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 96 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 2 2 3 3 3 96 9823 9827 9832 9836 9841	4	4	3	3	2	2	1.	1	9340	9335	9330	9325	9320	9315	9309	9304	0900	0204	00
87 9395 9400 9406 9415 9420 9425 9430 9435 9440 0 1 1 2 2 3 3 88 9445 9450 9459 9469 9474 9479 9484 9489 0 1 1 2 2 3 3 90 9542 9547 9550 9557 9562 9566 9571 9576 9581 9586 0 1 1 2 2 3 3 91 9590 9595 9605 9605 9605 9607 9614 9619 9628 9633 0 1 1 2 2 3 3 92 9635 9643 9647 9671 9675 9680 0 1 1 2 2 3 3 93 9685 9689 9694 9699 9703 9708 9713 9717 9722 9727 0 1 1 2 2 3 3 95 9	4	4			2	2	1		9390	9385	9380	9375	9370	9365	9360	9355	9350	9345	
89 9494 9499 9504 9509 9513 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 90 9504 9509 9513 9518 9523 9528 9533 9538 0 1 1 2 2 3 3 3 90 9509 9509 9509 9509 9509 9614 9619 9624 9628 9633 0 1 1 2 2 3 3 90 9509 9644 9699 9703 9708 9713 9717 9722 9727 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9763 9763 9768 9773 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9763 9763 9768 9773 0 1 1 2 2 3 3 9685 9693 9741 9745 9750 9763 9763 9768 9773 0 1 1 2 2 3 3 9685 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 2 2 3 3 96 9823 9827 9832 9836 9841	4													9415	9410	9405	9400	9395	
90 9542 9547 9552 9557 9562 9566 9571 9576 9581 9586 0 1 1 2 2 3 3 959 9595 9600 9605 9609 9614 9619 9624 9628 9633 0 1 1 2 2 3 3 3 9647 9649 9649 9657 9661 9666 9671 9675 9680 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9768 9713 9717 9722 9727 0 1 1 2 2 3 3 94 9731 9736 9741 9745 9750 9764 9759 9763 9768 9773 0 1 1 2 2 3 3 3 94 9731 9736 9741 9745 9750 9763 9768 9773 0 1 1 2 2 3 3 94 9751 9752 9786 9791 9795 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 96 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 2 2 3 3	4													9465	9460	9455	9450	9445	
91 9590 9595 9600 9605 9609 9614 9619 9624 9628 9633 0 1 1 2 2 3 3 3 955 9639 9641 9629 9638 9643 9645 9657 9661 9666 9671 9675 9680 0 1 1 2 2 3 3 3 94 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 3 94 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 3 95 9777 9782 9786 9791 9795 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 96 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 2 2 3 3	4	•	°	-	-		•	٠	0038	9933	9028	8023	9918	9013	9509	9504	9499	9494	89
92 9638 9643 9647 9652 9657 9661 9666 9671 9675 9680 0 1 1 2 2 3 3 3 9685 9689 9694 9699 9703 9708 9713 9717 9722 9737 0 1 1 2 2 3 3 3 94 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 3 955 9777 9782 9786 9791 9795 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 96 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 2 2 3 3 3	4																		
93 9685 9689 9694 9699 9703 9708 9713 9717 9722 9737 0 1 1 2 2 3 3 3 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 3 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 3 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 3 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 3 9754 9759 9763 9763 9768 9773 0 1 1 2 2 3 3 3 9754 9759 9763 9763 9763 9763 9763 9763 9763 976	1													9657	9659	9600	9595	9590	
94 9731 9736 9741 9745 9750 9754 9759 9763 9768 9773 0 1 1 2 2 3 3 95 9777 9782 9786 9791 9795 9800 9805 9809 9814 9818 0 1 1 2 2 3 3 96 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 2 2 3 3 3	4	3	3	2	2		1												
96 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 2 2 3 3	4	3	3	2	2														
96 9823 9827 9832 9836 9841 9845 9850 9854 9859 9863 0 1 1 2 2 3 3 3	4			2										9795	9791	9786	9782	9777	95
AN I DOOR DOWN DOOR DOOR DOOR DOOR DOOR DOOR DOOR DO 1 1 1 9 9 1 1 3	4			2	2									9841	9836	9832	9827	9823	96
01 0000 0018 0011 0007 0000 0007 0000 0007	4	3	3			1													97
98 9912 9917 9921 9926 9930 9934 9939 9943 9948 9952 0 1 1 2 2 3 3 3 99 9956 9961 9965 9969 9974 9978 9983 9987 9991 9996 0 1 1 2 2 3 3 3	3																		
g = 32.16 log g = 1.5073	-	-	-	-	_		-	-	5072	w = 2	les	_	_		_	6	22.1	145	

-	_		_								_	PI	ROPO	RTIC	NAI	. P	ART	<u>.</u>	
Maats.	0	1	2 .	3	4	5	6	7	8	9	1	2	3	4	5	6	7	8	•
.00 .01 .02 .03	1023 1047 1072	1026 1050 1074	1005 1028 1052 1076 1102	1030 1054 1079	1033 1057 1081	1035 1059 1084	1088 1062 1086	1016 1040 1064 1089 1114	1042 1067 1091	1045 1069 1094	00000	0 0 0 0 1	1 1 1 1	111111	111111	1 1 1 2		2 2 2 2 2	2222
.05 .06 .07 .08	1148 1175 1 203	1151 1178 1905	1127 1153 1180 1908 1236	1156 1183 1911	1159 1186 1213	1161 1189 1216	1164 1191 1219	1140 1167 1194 1222 1250	1169 1197 1225	1178 1199 1 32 7	00000	1 1 1 1	1 1 1 1 1	11111	1 1 1	2 2 2 2	22222	2 2 2 2 2	2223
.10 .11 .13 .13	1288 1318 1349	1291 1321 1852	1985 1994 1394 1355 1387	1397 1327 1358	1300 1330 1361	1334 1365	1337 1368	1279 1309 1340 1371 1403	1343 1374	1346 -1377	0000	1 1 1 1	1 1 1 1	111111.	1 2 2 2 2	2222	2 2 2 2	2 2 3 3	3 3 3 3
.15 .16 .17 .18	1445 1479 1514	1449 1483 1517	1419 1459 1486 1531 1556	1455 1489 1534	1459 1493 1528	1463 1496 1631	1466 1500 1535	1435 1469 1503 1538 1574	1507 1543	1510 1545	00000	111111	11111	1,111111	2 2 2 2	2222	2 2 2 2 2	3 3 3 3 3	3 3 3 3
·20 .91 .93 .93	1629 1860 1696	1696 1663 1702	1593 1629 1667 1706 1746	1633 1671 1710	1637 1675 1714	1641 1679 1718	1644 1633 1723	1611 1648 1637 1726 1766	1652 1690 1730	1656 1694 1734	00000	1 1 1 1 1 1	1 1 1 1	19999	2 2 2 2 2	22223	9333	3 3 3 3	33344
.25 .26 .27 .23	1890 1863 1906	1894 1866 1910	1786 1828 1871 1914 1959	1832 1875 1919	1837 1879 1923	1841 1884 1928	1845 1888 1932	1807 1849 1898 1936 1962	1854 1897 1941	1858 1901 1945	00000	1 1 1 1 1	1 1 1 1 1	2000	2 2 2 2		3 3 3 3	3 3 4 4	44444
.30 .31 .39 .33	9049 9069 9138	2046 2064 2148	9004 9051 9099 9148 9198	9056 9104 9153	9061 2109 2158	9065 9113 9163	9070 9118 9168	2028 9075 2128 2173 2223	9080 9198 9178	2064 2133 2183	0 0 0 0	1 1 1 1	1 1 1 1 2	2002	2 2 2 3 8	3 3 3 3	3 8 3 3 4	4444	4444
.35 .36 .87 .38	2391 2344 2399	2296 2350 2404	2949 2301 2355 2410 2466	2307 2360 2415	2312 2366 2421	2817 2371 2427	2323 2377 2432	2375 2328 2382 2438 2438	2333 2388 2443	2339 2393 2449	1 1 1 1 1	111111	2 2 2 2 2	2222	3 3 8 8	3 3 3 3 8	44444	44445	5 5 5 5
.40 .41 .43 .43 .44	2570 2630 2692	2576 2636 2698	2523 2582 2642 2704 2767	2588 2649 2710	2594 2655 2716	2600 2661 2723	2606 2667 2729	2553 2612 2673 2735 2799	2618 2679 2742	2624 2665 2748	1 1 1 1 1	1 1 1 1	2 2 2 2	2223	3 3 3 3	44444	44444	5 5 5 6	5 6 6
.45 .46 .47 .48 .49	2884 2991 3020	2891 2958 3027	2331 2897 2965 3034 8105	2904 2972 3041	2911 2979 3048	2917 2965 3055	2924 2992 3062	2864 2931 2999 3069 3141	2938 3006 3076	2944 3013 3063	1 1 1 1 1	1 1 1 1	3 2 2 2	3 3 3 3	3 3 4 4	44444	5 5 5 5	5 5 6 6	6 6 6

	_		_								T		202	ORT	ON	A1. 1	PAD	TS.	
Mark.	°	1	2	3	4	5	6	7	8	9	h 3	_	_	_	5		-	_	9
.50					3192 3266					3238	,	1	,	T,	4	4		5 (7
.51 .53					3342					3304 3381	1	3					1 2		
.58	3388	3396	3404	3412	3420	3428	3436	3443	3451	3459	li	2	2	1 3	4	. 5	1	i	7
.44	<u> </u>				3499	3508	3516	3534	3532	3540	Ľ	2		Ľ	4	-	Ľ	_	7
.5.5 .88	3631	3639	3565 3648 3733	3656	3664	· 3673	3681	3690	3698	3683 3707	1	2	3	3	4	5			Š
.57 .58			3819			3846	3855	3864	3873	3793 3882	1	3	3	;	4		:		
.59	3690	3899	3908	3917	3926	3936	3945	3954	3963	8972	1	8	3	1	•	5	Ľ	7	•
.60			3999					4046			1	8	8	4	5	6	و ا	7	
.61 .68	4169	4178	4093 4188	4196	4907			4140 4236			lì	2	3	1	5	6	1 7		
.63	4966	4976	4285	4295	4305	4315	4325	4335	4345	4355	1	3	8	Į Ā	5	Ğ	7	Č	Ť
.64	4365	4875	4385	4395	4406	4416	4426	4436	4446	4457	1	•	<u>.</u>	Ľ	-5	è	7	_	•
.65			4487			4519					1	8	8	4	5	6	7		
.66 .67	4871 4677					4634 4738					1	2	3	4	5	6	7		10 10
66	4786	4797	4806	4819	4831	4842	4853	4864	4875	4887	1	2	8	4	6	7	ě		10
.60	4096	4909	4930	4932	4943	4955	4966	4977	4989	5000	1	2	•	Ľ	•	7	Ľ	•	10
.70	5012									5117	1	3	4	5	6	7			11
.71 .79	5129 5248					5188 5309				5236	1	2	4	5	6	7		10 10	11
.78	5370	5383	5395	5408	5420	5433	5445	5458	5470	5488	1	ã	4	-8	ĕ		9	10	11
.74	5495	5508	5591	5504	5548	5559	5572	5 585	5598	5610	1	3	4	Ľ	6	•	Ľ	10	19
.75	5698					5689					1	3	4	5	7	6		10	
.76 .77	5754 5888					5831 -5957					1	3	4	1	7			11 11	
.78	6026					6095					i	š	4	i	7	•		ii	
.79	6166	6180	6194	6909	6223	6937	6252	6266	6381	6295	1	3	4	Ľ	7	•	10	11	13
.80	6310					6388					1	8	4	6	.7			18	
.81 .83	6457 6807					6531 6683	6546 8899	8561 8714	6577 6730	6598 6745	2	3	•	. 6	1	. 8		19 19	
.83	6761	6776	6792	6808	6823	6839	6855	6871	6887	6902	3	i	3	•	š	9	11	13	14
.54	6918	6034	6950	6966	6982	6998	7015	7031	7047	7063	2	•	•	•	•	10	11	13	16
.85	7079					7161					2	3	5	7		10		13	
.86 .87	7944 1 7413 1					7396 '					2	:	5	7		10 10		13 14	
.33	7588					7674					3	•	3	1 7		iĭ		14	
.00	7763	7780	7798	7816	7834	7852					2	4	•	7	•	11	13	14	16
.90 .91	7943 1 8128 1					8035 8223					3 2	4	•	7		11		15 15	
.92	8318					8414	1433	1453	8472	8493	•	4		8	10	12	14	15	17
.93	8511					8610					. 🖁	4	ě	8	10	12	14	16	18
.94	8710	5/3U 1	9/80	9770	90	8810	9631	9501	5378	9492	8	4	_	Ľ	10		14	16	13
.95	8913					9016					3	4	6		10			17	
.96 .97	9120 8 9333 8					9336 9 9441 9					2	4	9		11 11		15	17	
.98	9550 8	9572 1	9594	9616 1	9638	9661 1	683	9705	9727	9750	8	4	7	9	11	13	16	18	20
.99	9772 9	795	9817	9840 1	9663	9886 1	9908	931	9954	9977	2	•	7	•	11	14	16	18	20
1			_									_					_	-	_

XXI.—COMPARISON OF METRIC AND CUSTOMARY UNITS (U. 8.).

Length

1 millimeter, mm 1 centimeter, cm.		1 inch = 25.4001 millimeters. 1 inch = 2.54001 centimeters.
1 meter, m.	=3.28083 feet.	1 foot = 0.304801 meter.
1 meter 1 kilometer	=1.09361 yards. =0.62137 (U. S.) mile.	1 yard = 0.914402 meter. 1 mile = 1.60935 kilometers.

Areas

1 square millimeter, sq.mm.	= 0.00155 sq.in.	1 sq.in. = 645.16 sq.mm.
1 square centimeter, sq.cm.	= 0.1550 sq.in.	1 sq.in. = 6.452 sq.cm.
1 square meter, sq.m.	= 10.764 sq.ft.	1 sq.ft. = 0.929 sq.m.
1 square meter	= 1.196 sq.yd.	1 sq.yd. = 0.8361 sq.m.
1 square kilometers	= 0.3861 sq.mi.	1 sq.mi. = 2.5900 sq.km.
1 hectare	= 2.471 acres.	1 acre = 0.4047 hectare

Volumes

1 cubic millimeter, cu.mr. 1 cubic centimeter, cc.	= 0.06103 cu.in.	1 cu.in. =16,387.2 cu.mm. 1 cu.in. =16.3872 cc.
1 cubic meter	=35.314 cu.ft.	1 cu.ft. = 0.02832 cu.m.
	=61,028 cu.ins.	=28.32 liters.
1 cubic meter	= 1.3079 cu.yd.	1 cu.yd. = 0.7645 cu.m.

Capacities

1 cubic centimeter, co	c. = 0.03381 (U.S.) liquid ounce.	1 ounce $=29.574$ cc.
1 cubic centimeter	=0.2705 (U. S.) apothecaries'	
	dram.	1 dram = 3.6967 cc.
1 cubic centimeter	=0.8115 (U.S.) apothecaries'	
	scruple.	1 scruple = 1.2322 cc.
1 liter	=1.05668 (U. S.) liquid quarts.	1 quart $= 0.94636$ liter.
1 liter	=0.26417 (U. S.) gallon.	1 gallon $=3.78543$ liters.
1 liter	=0.11351 (U. S.) peck.	1 peck $= 8.80982$ liters.
1 hectoliter	=2.83774 (U.S.) bushels.	1 bushel =0.35239 hectoliter.

Masses

1 gram	=15.4324 grains.	1 grain	= 0.06480 gram.
1 gram	= 0.03527 avoirdupois ounce.	1 ounce (av.)	=28.3495 grams.
1 gram	= 0.03215 troy ounce.		= 31.10348 grams.
1 kilogram	= 2.20462 pounds (av.)		= 0.45359 kilogram.
1 kilogram	= 2.67923 pounds (troy).	1 pound (troy) = 0.37324 kilogram.

Table of Equivalents, U. S. Bureau of Standards. For British Imperial Weights and Measures see Van Nostrand's Chemical Annual.

Avoirdupois Weight

The system of weights in ordinary use by which common or heavy articles are weighed.

```
16 drams = 1 ounce = 28.35 grams.
16 ounces = 1 pound = 453.59 grams.
25 pounds = 1 quarter = 11.34 kilograms.
4 quarters = 1 hundred weight = 45.359 kilograms.
1 avoirdupois pound contains 7000 grains.
1 avoirdupois ounce contains 437.5 grains.
```

Apothecaries' Weight

The system of weights employed in weighing medicines.

```
1 grain = 0.0648 gram.
20 grains = 1 scruple = 1.296 grams.
3 scruples = 1 drachm = 3.888 grams.
8 drachms = 1 ounce = 31.103 grams.
12 ounces = 1 pound = 373.236 grams.
1 apothecaries' (or troy) pound contains 5760 grains.
1 apothecaries' (or troy) ounce contains 480 grains.
```

Fluid Measure

```
.06161 cubic centimeter.
 1 minim
                =1 fluid drachm =
                                     3.696
                                             cubic centimeters.
60 minims
                                 = 29.573
                                              cubic centimeters.
 8 fluid drachms = 1 fluid ounce
16 fluid ounces = 1 pint
                                 =473.179
                                              cubic centimeters.
                 =1 gallon
                                     3.785
                                             liters.
 8 pints
             1 gallon contains 231 cubic inches.
```

The minim, fluid drachm, fluid ounce and pint are the fluid measures employed by apothecaries.

Other Data

1 cubic foot of water weighs 62.37 pounds.

1 gallon (U. S.) of water weighs 8.33 pounds (the British gallon is 20% more than the U. S.).

1 liter of water weighs approximately 2.2 pounds. .

Areas of Plane Figures

Area of any triangle $=\frac{1}{2}$ base multiplied by the altitude.

Rectangle. Area = base multiplied by altitude, i.e., multiply the length of one side by the length of a perpendicular side.

Parallelogram. Area = multiply the length of one side by the vertical distance to the parallel side.

Trapezoid. Area = multiply half the sum of the parallel sides by the perpendicular distance between the two.

Circle. Area = $0.7854d^2$, or πr^2 or $\frac{1}{2}Cr$, or $\frac{1}{4}Cd$.

 $\pi = 3.1416$, r = radius, C = circumference, d = diameter.

Volumes of Solids

Regular Prism. Area = $\frac{1}{2}nrah$, or Bh.

n = number of sides, r = perpendicular from center of base to sides of the base, h = height of prism, B = area of base. Lateral area = $2\pi rh$.

Right Circular Cylinder. Volume = $\pi r^2 h$ also Bh. Lateral area = $2\pi rh$.

Regular Pyramid. Volume = $\frac{1}{3}$ altitude multiplied by area of base.

Right Circular Cone. Volume = $\frac{1}{5}\pi rh$. Lateral area = πrs .

r = radius of base, s = slant height or $\sqrt{r^2 + h^2}$.

Sphere. Volume = $4/3\pi r^3$, or $4.189r^3$. Area = $4r^2$ or $3.1416d^2$.

Barrel or Cask. Approximate gallons = $.0034n^2h$ where n = mean diameter of barrel. h = height, both measurements in inches.

XXII.—A TABLE OF CONSTANTS

THE UNITED GAS

All Volumes of Gases and Vapors are given at 60° F, and 30" pressure.

I.	11.		111.	IV.	v.	VI.	VĮI.	VIII.	IX.	X.	XI.	XIL.	
	Aromat. Acetyl. Oledin Paramin Series		12 0.83 12 0.00 12 0.83 12 0.00 12 0.0	Gravity Gas apor at 60° F ir = 1.0.	Bolling-point	0.8027	0.2450 3.0490 0.5929 0.4040 0.3754 0.2163 0.4060 0.4060 0.5929	15,749 15,749 13,503 188,620 23,626 12,594 8,587 4,594 4,47 5,398 13,495 4,107 5,398 14,107 6,998 4,107 6,998 1,1096 2,178 1,1096 2,178 1,1096 2,178 1,1096	06350 .06350 .06350 .07407 .00535 .07407 .0053 .04234 .07940 .11645 .12760 .07410 .11115 .14820 .10585 .22760 .07411 .11115 .14820 .10585 .22760 .20640 .20640 .24345 .28050 .31755 .31755 .317	Heat of	Combu	mbustion.	
NAME OF GAS OR VAPOR.										29,000 G6,960 G7,960 G8,300 211,033 370,440 529,210 G87,190 96,500 467,550 467,550 467,550 11,282,310 158,620 259,620 259,630 310,050 158,620 259,630 310,050 310,050 310,050 467,550 310,050	British Thermal Units.		
											Per Cu. Ft.	Per Pound.	
Carbon to CO Carbon to CO Carbon to CO Carbonle Ox. Hydrogen. Methane Ethane. Bethane. Propane. Butane. Propane. Butane. Bethylene. Hexane Ethylene. Amylene. Amylene. Crotonylene. Butylene. Allylene. Crotonylene. Benzene. Toluene. Xylene. Mesitylene. Naphthalene. Naphthalene. Carbon Bi-Sul. Ammonia. Hydrogen Sul. Ammonia. Hydrogen Sul. Ammonia. Hydrogen Sul. Carbon Bi-Sul. Carbon Bi-Sul. Carbon Bi-Sul. Carbon Carbon Acid. Carbon Acid. Carbon Acid.				0.8292 0.8292 0.9671 0.6962 1.0368 1.5206 2.0483 2.9721 0.9676 1.4514 1.4514 1.3823 2.4191 0.8984 1.3823 3.1792 3.6630 4.1468 4.							923 5 323 5 323 5 326 2 2 1009 0 1764 4 4 2521 0 3274 0 4 4035 6 4759 8 1588 0 2347 2 2347 2 227 1 3807 5 4552 0 6108 0 672 2 432 8 757 0 1238 2 1264 6 872 9	14.544 4.366 61.525 23.838 22.222 21.655 21.327 22.1,177 20.914 21.126 21.046 18.444 18.699 19.23 7.544 9.59 9.59 10.25	

AUTHORITIES AND METH

In Column IX. the figures given in Hempel's "Gas Analysis," p. 375, were selected for the fundamental weight of Oxygen, Nitrogen, Hydrogen, Carbonic Oxide and Air.

The formula used for the conversion to English units, is—grams per liter at 0° C. and 760 mm.×.05922 pounds per cu.ft. at 60° F. and 30" pressure. The derivation of the factor employed is

$$.05922 = \frac{28.316 \times .0022046 \times 30.00 \times 492}{29.92 \times 520}.$$

The weights of the compound gases are calculated from these data by Avogadro's law.

Column 1V. is calculated by the formula: $sp.gr = \frac{wt. 1 \text{ cu. ft. gas}}{wt. 1 \text{ cu.ft. air}}$, and the figures thus obtained agree with the theoretical formula: sp.gr. = $\frac{\text{mol. wt.}}{\text{og od}}$. 28.94

FOR CERTAIN GASES AND VAPORS

IMPROVEMENT COMPANY

The Temperature of Products of Combustion is reduced to 18° C. = 64.4° F.

XIII.	XIV.	xv.	XVI.	XVII.	xviii	XIX.	XX.	XXI.	XXII.	XXIII.	XXIV.	xxv.	XXVI.
Cu. Ft. per Cu. Ft. of Combustible.				Pounds per Pound of Combustible.					Heat of Formation at Const. Pres.				
Reg. for Combus- tion. Products of Combustion.		Req. for Combus- tion.		Products of Combustion.			B.t.u.		NAME OF GAS OR VAPOR.				
Air.	Oxy- gen.	CO ₂	H ₂ O.		Alr	Oxy- gen.	COs	H±O		Calories per Molecular In Grams.	Per Cu. Ft.	Per Pound.	
4, 785 9, 570 2, 393 2, 393 2, 393 38, 289 38,	7.5 2.5 4.0 5.5 7.5 9.0 10.5 12.0 1.5 0.78 1.23 2.0 3.0 1.5	1.0 2.0 1.0 2.0	1 0 2 0 0 3 0 0 5 0 0 0 0 0 0 0 0 0 0 0 0 0 0	SO ₂ -1.0 N-0.5 N-0.5 N-1.0 SO ₂ -2.0	11.541 2.471 34.624 17.312 16.156 15.737 15.520 15.386 14.836 14.836 14.836 14.836 13.313 13.850 14.105 13.313 13.547 13.720 13.850 14.836 14.836 15.313 13.547 13.547 13.720 13.850 14.836 15.313 13.850 16.111 6.111 6.111 6.410 5.323 5.466 6.492 9.033	4 000 3 .733 .636 3 .586 3 .586 3 .584 3 .428 3 .428 3 .428 3 .076 3 .209 3 .076 3 .100 3 .000 3 .000 1 .412 1 .412 1 .481 1 .230 1 .265 2 .087	3.666+ 1.571 2.750 2.933 3.000 3.034 3.055 3.069 3.142 3.142 3.142 3.384 3.300 3.259 3.384 3.311 3.300 3.437 3.46 3.311 3.300 3.311 3.300 3.311 3.311 3.300 3.311	9,000 2,250 1,800 1,636 1,552 1,500 1,286	SO ₂ -1.883 N-0.823 N-0.518 N-0.538 SO ₂ -1.684	+21,750 +28,560 +35,160 +42,450 +41,850 -2,710 +3,220 +10,660 +18,770 -39,650 -12,510 -3,520 +41,740 +11,890 -2,7,480 -27,480 -65,700 -26,010 +51,450 +58,470	+103.1 +136.0 +167.2 +202.2 +227.9 +290.9 -12.9 +15.3 +50.7 +113.7 -227.5 -188.8 -47.3 +16.7 +23.6 +246.4 +278.2 +246.4 +278.2 +246.4 +278.2 +463.1 +327.1	+2435.6 +1713.6 +1436.3 +11317.3 +1196.2 +1278.4 -174.2 +138.1 +342.6 +614.1 -3300.7 -229.3 -68.8 +7.3 -68.8 +7.3 -125.0 +1259.6 +1259	Propane Butane Pentane Hexane Ethylene Propylene Butylene Amylene Amylene Antylene Allylene Crotonylene Benzene Toluene Xylene Mesitylene Maghthalene Hydrogen Sul Ammonia Hydrocy, acid Cyanogen Carbon Bi-Sul Methyl Ale. Ethyl Alcohol Carbonia Acid Carbon Acid
		100				****	******		*********	******	77.14.10		Oxygen Nitrogen Air

ODS OF CALCULATION.

Columns V. and VI. are taken chiefly from Lunge's "Coal Tar and Ammonia."

Column VII. is from Ganot's "Physics," edition 1896, page 445.

Column X. and XXIII. are from Julius Thomsen's "Thermochemical Investigations," and his results are translated into English units in columns XI.-XII. and XXIV.-XXV.

Columns XIII. and XVIII. are calculated on the assumption that

air = 20.9% oxygen + 79.1% nitrogen by Volume.

air = 23.13% oxygen + 76.87% nitrogen by Weight.

XXIII.—SPECIFIC GRAVITY OF GASES*

Nome	Formula.	Molecular	Specific	Weight in Grams of 1 Liter at 0°	
Name.	Formula.	Weight.	Calculated.1	Observed.	760 mm. a Sea Level, Lat. 45°.
Acetylene	C ₂ H ₂	26.026	0.8993	0.9056	1.1624
Air			1.0000		1.2926
Ammonia	NH ₃	17.034	0.5856	0.5971	0.7608
Argon	A	39.88	1.3780	1.379	1.7812
Arsine	AsH ₃	77.984	2.6933	2.695	3.4830
Bromine	Br2	159.84	5.5230	5.524(227.9°)	7.1390
Butane	C4H10	58.10	2.0075	2.01	2.5949
Carbon dioxide	CO ₂	44.005	1.5205	1.52908	1.9654
Carbon monoxide	CO	28.005	0.9677	0.96716	1.2508
Carbon oxysulphide	COS	60.065	2.0754	2.1046	2.6827
Chlorine	Cl ₂	70.92	2.4505	2.4901	3.1675
Cvanogen	C ₂ N ₂	52.03	1.7977	1.8064	2.3338
Ethane	C ₂ H ₆	30.058	1.0386	1.0494	1.3425
Ethylene	C.H	28.042	0.9689	0.9852	1.2524
Fluorine	F ₂	38.0	1.3130	1.26	1.6972
Helium	Не	4.00	0.1382	0.131	0.1786
Hydrobromic acid	HBr	80.928	2.7963	2.71	3.6145
Hydrochloric acid	HCl	36.468	1.2601	1.2681	1.6288
Hydrofluoric acid	HF	20.008	0.6913	0.7126	0.8936
Hydroiodic acid	HI	127.928	4.4203	4.3757	5.7137
Hydrogen	H	2.016	0.06965	0.06952	0.09004
Hydrogen selenide	H.Se	81.216	2.8063	2.795	3.6274
Hydrogen sulphide	H.S.	34.076	1.1774	1.1906	1.5220
Hydrogen telluride	H ₂ Te	129.516	4.4752	4.489	5.7846
Krypton	Kr	82.92	2.8252	2.868	3.7035
Methane	CH4	16.037	0.5541	0.5545	0.7163
Neon	Ne	20.2	0.6980	0.6963	0.9022
Nitric oxide	NO	30.01	1.0370	1.0367	1.3404
Nitrous oxide	N ₂ O	44.02	1.5210	1.5298	1.9661
Nitrogen	N ₂	28.02	0.9682	0.96737	1.2515
atmospheric	N ₂ +A etc	20.02	0.9002	0.97209	1.25718
Nitrogen dioxide	NO ₂	46.01	1.5898	1.60(135°)	2.0550
"" ""	N ₂ O ₄	92.02	3.1788	2.65(26.7°)	4.1099
Mitmagul ablamida	NOCL	65.47	2.2622	2.03(20.74)	2.9241
Nitrosyl chloride		32.00	1.1057	2.31 1.1053	1.4292
Oxygen	O ₂			1.1053	1.5214
Phosphine	PH:	84.064	1.1770	1.1829	1.8787
Propylene	C ₃ H ₆	42.063	1.4534		4.6584
Silicon fluoride	SiF ₄	104.3	3.6039	3.60	2.8611
Sulphur dioxide	$SO_2 \dots$	64.06	2.2135	2.2638	5.8152
Xenon	X	130.2	4.4988	4.526	0.8192

^{*} D. Van Nostrand Chemical Annual.—Olsen.

¹ Obtained by dividing the weight of one liter of the gas by 1.2926 (i.e., by the weight of one liter of air).

² Obtained by multiplying ½ the molecular weight of the gas by ¼ × 1.429234 (i.e., by ¼ × weight of one liter of oxygen).

USEFUL MEMORANDA

Gas Calculations

Conversion Formulae for Gas Volumes. Conversion from existing to standard conditions.

$$V = \frac{V' \times 273 \times (P - w)}{273 + t \times 760}.$$

Gas at standard volume to new conditions of temperature and pressure

$$V' = \frac{V \times 273 + t \times 760}{273 \times (P - w)}.$$

- V= standard volume, V'= volume under other conditions of temperature and pressure (other than 0° C. and 760 mm. Hg pressure).
- t =temperature of the gas, P =barometric pressure in mm. Hg + static pressure of the gas. w =water vapor pressure at temperature and pressure that the gas is measured or to which it is to be converted.

Petot Formulae for Measuring the Velocity of a Gas in a Flue.

- A. Simple formula for fair approximations $V = 42\sqrt{h}$.
- B. More exact formula $V = 1290 \frac{\sqrt{\frac{1}{2}h(1 + .00217t)}}{BM}$.
- V= velocity in feet per second. h= gauge reading in terms of water, i.e., the total differential in terms of vertical reading. In a gauge inclined 1:10, with ether in place of water, 10'' differential $=10\times.72\div10=.72$. In the formula $B^{-\frac{1}{2}}$ the reading is taken as the deflection due to velocity pressure is half the total deflection (proven by repeated tests, suction is producted by the gas flow on the straight petot arm). Allowance is made for this in formula A. t= temperature of the gas measured. B= barometric pressure + plus static pressure of the gas in terms of inches of mercury (air standard 29.92"). M= specific gravity of the gas compared with the hydrogen molecule $H_2=2.016$.

To obtain the specific gravity of a gas, multiply the molecular weight of each constituent by its per cent ratio in the mixture, divide by 100 and finally divide the sum of these results by 2.016.

Examples. The sp.gr. of a gas having the composition 87% nitrogen, 5% oxygen, and 8% sulphur dioxide we would find

28.02 (N₂)
$$\times$$
 87 ÷ 100 = 24.38
32.00 (O₂) \times 5 " = 1.6
64.06 (SO₂) \times 8 " = 5.12 total = 31.1 sp.gr. = $\frac{31.1}{2.016}$ = 15.42.

The sp.gr. of air containing 78% nitrogen, 21% oxygen, 1% argon would be

$$28.02 \times .78 = 21.86$$
, $32.00 \times .21 = 6.72$, $39.88 \times .1 = 0.4$ total = 28.98 sp.gr. = 14.38.

Consult table XXIII.

The gram molecular weight of any gas occupies 22.4 liters.

Definitions

Heat

Calorie is 1/100 of the heat required to raise the temperature of one gram of water from 0° C. to 100° C.

One kilogram calorie = 1000 gram calories or 3.968 B.t.u.

Latent heat of evaporation is the quantity of heat required to convert 1 gram of a liquid into vapor without change of temperature.

Latent heat of fusion is the quantity of heat required to change a gram of the substance from a solid to a liquid state without changing temperature.

Specific heat. The British thermal unit (B.t.u.) = 1/180 part of the heat required to raise the temperature of one pound of water from 32° F. to 212° F.

Specific heat of a body is the quantity of heat required to raise the temperature of a unit weight of that body one degree, C.

Photometry

Lux. This is the practical unit of illumination and is the light received from a source of 1 meter distance.

Foot-candle. This is the illumination received by a standard candle at one foot distance. The candle loses in burning 120 grams per hour.

1 foot-candle = 10.76 lux.

Candle-power. The comparison of the illumination of a light with one standard candle. A simple method for determination is to place the light and the burning candle 60 inches apart (2 meters and 100 inches distance also taken). A screen with a spot of oil is so placed between the lights as to receive a uniform illumination on each side, which is readily seen by the spot. The square of the distance from the screen to the light tested divided by the square of the distance from the screen to the standard candle = the candle-power of the light. When gas is tested the flame is so regulated that it burns 5 cubic feet of gas an hour. The standard candle burns 120 grams per hour as stated above.

Units in Electricity

Ampere is the unit of current flow. An ampere will deposit from a silver nitrate solution 1.118 milligrams of silver (.001118 g.) per second.

Coulomb is the unit of quantity. One coulomb will deposit .001118 g. Ag (time factor not considered as in case of ampere). 96,494 coulombs will deposit the gram equivalent of an element from a solution of its salt, i.e.,

107.88 grams of silver, $\frac{63.57}{2}$ grams of cupric copper Cu⁺⁺ $\frac{55.84}{3}$ of ferric

iron Fe⁺⁺⁺, 63.57 of cuprous copper Cu⁺, $\frac{55.84}{2}$ gram of ferrous iron

Fe⁺⁺, etc. One gram equivalent of an element carries 96,500 (round numbers) coulombs.

Electromotive force—E.M.F.—is the force causing electricity to move.

Erg. This is the unit of power and is the force which applied to the standard gram body would give that body an acceleration of 1 cm. per second.

Dyne = the force which acting on one gram for one second produces a velocity of one centimeter per second.

Joule. This is the practical unit of electrical energy and is produced when a steady current of one coulomb per second, i.e., one ampere, passes through a resistance of one ohm for one second.

Ohm. This is the resistance that is offered at 0° C. by a column of mercury 106.3 centimeters long, being 1 square millimeter in cross section and weighing 14.4521 grams.

Volt. This is the electromotive force which produces one ampere of current through a conductor having a resistance of one ohm.

If any two of the factors are known the third can be found by the formula I = E/R; I = ampere current, E = electromotive force (volts) and R = ohms resistance.

Watt. One watt is produced when one ampere of current flows under a pressure of one volt (E.M.F.).

One watt = .00134 horse power, = 44.25 foot pounds, per minute, = 14.33 gram calories per minute, = .057 B.t.u. per minute.

Watt-hour and kilowatt-hour are the units of energy used in commercial electrical work.

Watt-hour = 3600 joules, = 2655.4 ft. lbs., = 859975 gram calories, = 3.412 B.t.u. = .001341 h.p. hr.
One kilowatt = 1000 watts.

Other Terms

Foot-pound is the unit of work done in raising a weight of one pound through a distance of one foot. Work = weight multiplied by height, or force multiplied by distance.

Horse power = 550 foot pounds.

Specific gravity of a substance is the ratio of the weight of a given volume of that substance compared with the weight of an equal volume of water.

- a. Solid heavier than water. Weight of solid in the air divided by the difference between this weight and its weight in water = sp.gr. of solid.
- b. Solid lighter than water. The weight of the solid in the air divided by this weight + the loss of weight of a sinker due to the buoyancy of the solid = sp.gr.
- c. Solid soluble in water. Determine gravity in a liquid in which it is insoluble whose specific gravity is known, multiply the gravity in terms of the liquid by the gravity of the liquid = sp.gr. in terms of water.
- d. Liquids. Compare with water by weighing in a specific gravity bottle; the bottle being filled with water is weighed, the bottle, drained and dried, is filled with the liquid and again weighed; the weights are compared on subtracting the weight of the empty bottle.

 e. The loss of weight of an insoluble substance immersed in the liquid is divided by the loss of weight of the substance immersed in water = sp.gr.

f. The specific gravity is determined by the hydrometer. See chapter on Acids, Volume 2.

1 lb. av. = 7000 grains ..1 gallon = 58417.87 grains

> .: 1 gal. =8.34541 lb. .: 1 lb. av. =27.679886 cu. in. H₂O at 4°C.

> > .. 1 cu. in. = 16.387083 cc. = 16.387083 g H₂ O at 4°C = 39°F.

Values used in constructing table: 1 inch = 2.540001 cm.

to .0301428.

231 cu. in. = 1 gallon = 3785.4162 g.

1 lb. av. =453.5926 g.

VOLUME AND WEIGHT CONVERSION TABLE

	To Cu. M.	0.1639 0.28317 764556 0.22957 0.4732 0.03785 0.6479 0.3110 0.3123 0.4536 0.01000	ivalent
Multiply by	To To To To To To To To To To To To To T		all subnumeral following a zero indicates that the zero is to be taken that number of times: thus, .0.1428 is equivalent
	CC. or G.	0,2143554112 .034632 .017316 .004329 .252 .891 .526857 .578037 .043905 .036127 16 .3871 .016387 .037037 .957 .505 59 .8442 29 .9221 7 .48052 .436996 .910 .408 .998 .848 75 .8674 62 .4280 .28316 .9 28 .3169 1 .00000 .25852 .6 1615 .79 .807 .896 .201 .974 .117990, .24581 .0 26968 .9 2048 .42 1685 .56 764556 764 .556 .0,3868 1 .00000 .062500 .031520 .007813 456 .390 .956813 1 .04318 .079234 .065199 .29 .5736 .029573 .0,3868 1 .00000 .00000 .500000 .250000 .04260 .15 .2130 .16 .69081 .26775 1 .04318 .473 .77 .473177 .001238 .32 .0000 .000000 .000000 .250000 .025000 .02083 .3816 .2.53550 .08635 .946 .354 .004951 .128 .000 8 .000000 1 .00000 .58417 .912 .704 .133 .52710 .1420 .8.4551 .785 .42 .946354 .0,4968 1 .05173 .065733 .032867 .06217 .480 .0001 .00000 .002083 .002286 .0,1736 .0,4742 .06479 .0,6479 .0,4068 1 .05173 .065733 .032867 .008217 .480 .0001 .00000 .075955 .062500 .28350 .0,4882 12 .65288 .059957 .007489 .437 .500 .911457 1 .0000 .87595 .00200 .83550 .00000 .83550 .0,4882 12 .65288 .78880 .394400 .098600 .7760 .012 .0000 .31657 .00000 .82857 .373242 .005593 .053913 .002013 .001238 .03287 .00286 .119826 .70000 .012 .0000 .31657 .00265 .00225 .00000 .002067 .00265 .00000 .82857 .00000 .20000 .83550 .00286 .0.25287 .00000 .20000 .20000 .33724 .00267 .0.2642 .15 .4323 .032574 .002679 .00262 .00000 .001000 .001308 .33.814 0 .71337 1 .05669 .264172 .15432 .332 .1507 .35.2739 2 .67923 2 .20462 .10000 .001000 .001308 .33.814 0 .713 .77 154.390 .33160 .73573 .9957 .09570 .99570 .001308 .33.814 0 .713 .77 154.390 .33160 .73573 .9957 .09570 .99570 .001000 .	hus, .0.14
	To Lb. Av.	.036127 1085 56 1085 56 1065199 1.04318 8.34541 0.1428 0.02500 1.00000 1.00000 1.00206	times: t
	To Lb. Troy.	043905 75.8674 2048.42 079234 11.26775 2.53550 10.1420 041736 083333 10.0050 11.21528 002679	mber of
	To Oz. Av.	578037 998.848 26968.9 11.04318 116.6908 33.5216 002286 11.09714 11.0000 11.0000 11.0000 13.1657 16.000	that nu
	To Os. Troy.	526857 910 408 24581 0 950813 15 2130 30 4260 121 704 002083 1 00000 14 5833 032 1507	be taken
	To Grain.	252 891 436969 1179904 456 390 7302 23 1460 45 1 00000 1 00000 1 00000 1 1 2 2 2 3 1 2 2 3 1 2 3 2 3 1 2 3 2 3 1 2 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3	ero is to
	To Gallon.	004329 7.48052 201.974 007813 1.155000 1.00000 0,1712 008217 007489 0074	nat the zi
	To To Quart. Gallon.	29.9221 807.896 .031520 .031520 .032867 .022867 .022957 .334400 .419306 .001057	licates th
	To Pint.	034632 1615.79 106250 0.06250 2.00000 0.1369 0.65733 0.65733 0.65733 0.65733 0.059913 7.88800 0.11337	zero inc
	To F1. Oz.	554112 25852.6 1.00000 16.0000 12.0000 12.620 12.6208 12.6308 12.6308 12.6308 13.3378	llowing
	To To Cu. Yd. Fl. Oz.	0,2143 0,37037 1,00000 1,00000 0,4868 0,4887 0,4888 0,4888 0,4888 0,1308	meral fo
	To Cu. Ft.	0,5787 1.00000 27.00001 27.0000 101014 001014 0,2288 001038 001001 0,2288 001038 001031 0,3331 0,33315	all subnu
	To Cu. In.	1,00000 1,728.00 1,528.00 1,80469 23.8750 231.003954 1,72999 22.7766 27.6799 21.0237	The sma
	To Convert From	Cu. In. 1.00000 Cu. Ft. 1728.001 Cu. Yd. 46656.02 Fi. Oz. 1.80469 Pint. 28.8750 Quart. 57.7500 Gallon 003954 Oz. Troy 1.89865 Oz. Av. 1.72999 Lb. Troy 22.7766 Lb. Av. 27.6799 CC or 27.6799 CC or 27.6799 CC or 27.6799 CC or 27.6799 CC or 27.6799 CC or 27.6799 CC or 27.6799 CC or 37.6799 CC or 37.6799 CC or 37.6799 CC or 37.6799	Note.

7	,		
	2		
2000	•		
		1	
	•		
(
	į		
:			
	•		
1	۶		١
(•		
	>		
(
۰			
	•		

To the state of th						Multiply by					
	B. T. U.	7. P. C. U.	78 0	Ft. Lbs.	Ft. Tons	Kg. M.	нР нв.	KW Hra.	Joules	Libra Co	Lbs. HyO
	1.80000	-	- -	778 000 1400 40 3091 36	.389001 .700202 1.54368	107.563 193.613 426.844	0,3929 0,7072 001559	.0,2931 C,5276 .001163	1055.20 1899.36 4187.37	!	<u> </u>
	2.57069			200000	1.00000	138255 276 511	.065050	.0,3767 .0,7535		0,8840	
	2544 99		8 641.327	1980000	990.004	273747	1.00000	746000	2685473		2.62261
	039477 039477 14544 0 970 400	7 0,5265 0 8080.00 0 539.111		737311 113150, 754971	0,3687 0,3687 5657 63 377 487	300959 101937 1564396 104379	0,3724 5.71434 381270	0,2778 4.26285 284424	153470s		
"P. C. U." refers to the fficiency, equivalent to the 100% efficiency. The subsquivalent to .000003653.	the "poun the correst ab-numera 3.	to the "pound-centigrade unit." o the corresponding number of h sub-numeral following a zero ind 653.	to the "pound-centigrade unit." The ton used is 2000 pounds. "Lbs. C" refers to pounds of carbo o the corresponding number of heat units. "Lbs. H ₂ O" refers to pounds of water evaporated at 100 sub-numeral following a zero indicates that the zero should be taken the number of times indicated. 553. INTER-CONVERSION TABLE	3 + C	sed is 2000 pounds. "Lbs. C" refers to pounds of carbon oxidized, 100 % "Lbs. H ₂ O" refers to pounds of water evaporated at 100° C. = 212° F. at the zero should be taken the number of times indicated. Thus: 0,3653 is CVERSION TABLE	ounds. "; refers to I ild be take TABLE	Lbs. C" re pounds of 1 n the num	fers to po water eva, ber of tim	ounds of ca porated at nes indicat	ლ ზ	oxidized, 100 % C. = 212° F. at Thus: 0,3653 is
11					Mul	Multiply by					
5	Grains per Cu. Ft.	Ounces per Cu. Ft.	Pounds per Cu. Ft.	Grams per Cu. Ft.	Grains per Gallon	Ounces per Gallon	Pounds per		Grains per Cu. In.	Ounces per Cu. In.	Grams per Liter
1461	1.00000 437.500 7000.00	.002286 1.00000 16.0000 035274	.0,1428 .062497 1.00000	.064799 28.4954 453.593	. 133680 58.4848 935.757 2.06302	0,3056 .133678 2.13885 004715	6 .041910 8 .008355 55 .133680 5 .0,2947	1	.035787 .253180 4.05090 008931	.0,1323 .0,5786 .009258 .0,2041	.002288 1.00103 16.0163 035310
P 60 10 .		7.48050 1119.690	.001069 .467510 7.48014	484727 21.2068 3393.09	1.00000 437.500 7000.00	. 002286 1. 0000 16. 0000		~~~	.004329 1.89392 30.3028	.0,9894 .003429 .069261	7.48798 119.808
	1728.00 756000 437.050	3.94960 1728.00 .998950	. 246840 108 . 000 . 062432	48987.8 28.3203	231.000 101061 58.4220	. 527990 231 . 000 . 133540	0 .032990 0 14.4370 0 .008346		437 500 252910	1.00000 1.00000 0,5780	3.95380 1729.73 1.0000
1	-	-				_	-	-	-		

TABLES AND USEFUL DATA

INTER-CONVERSION TABLE

	Multiply by						
To Convert From	Lbs. per Sq. In.	Tons per Sq. In.	Kg. per Sq. Cm.	M. Tons per Sq. Cm.	Atmospheres		
Lbs. per Sq. In	1.00000	.000446	.070307	.047031	.068041		
Tons per Sq. In	2240.00	1.00000	157 .488	.157488	152.412		
Kg. per Sq. Cm	14.2233	.006350	1.00000	.001000	.967768		
Metric Tons per	Ì		1		l		
Sq. Cm	14223.0	6.34969	1000.00	1.00000	967.768		
Atmospheres	14.6970	.006558	1.03329	.001033	1.00000		

1 gram = 15.43 grams

1 gram = .0468 grams 1 m. = 3.28 ft.

The above tables were obtained by courtesy of du Pont Ne Mours Company through the kindness of Dr. E. C. Lathrop.

General References

- Allen, A. H., Organic Analysis, v. 1-8, 4th Ed., 1909-1913. P. Blakiston's Son & Co. Arnold and Mandel, Compendium of Chemistry. John Wiley & Sons, New York. 1904.
- Authenrieth, W., and Warren, W. H., Laboratory Manual for the Detection of Poisons. 1921. P. Blakiston's Son & Co., Philadelphia, Pa.
- Baskerville, C., and Curtman, L. J., Quantitative Analysis, 1910. The Macmillan Co. Blair, A. A., The Chemical Analysis of Iron, 7th Ed., 1918. Lippincott & Co., Philadelphia, Pa.
- Brearly, H., and Ibbotson, F., The Analysis of Steel Works Materials, 1902. Longmans, Green & Co., London and New York.
- Browning, P. E., Introduction to the Rarer Elements, 3d Ed., 1919. John Wiley & Sons, New York.
- Cahen, E. and Wootton, W. O., The Mineralogy of Rarer Metals, 1920. J. B. Lippin-cott Co.
- Carins, F. A., Quantitative Chemical Analysis, 3d Ed., 1896. H. Holt & Co., New York.
- Clowes and Coleman, Quantitative Analysis, 5th Ed. P. Blakiston's Son & Co.
- Classen, A., Quantitative Analysis. Translated by N. H. Harriman, 1902. Geo. Wahr, Pub., Ann Arbor, Mich.
- Comey, A. M., Dictionary of Chemical Solubilities. 1921. Macmillan & Co.
- Crookes, W., Select Methods in Chemical Analysis, 4th Ed., 1905. Longmans, Green & Co., New York, London. 1905.
- Dennis, L. M., Gas Analysis. Macmillan & Co., New York. 1913.
- Fresenius, K. M., Quantitative Chemical Analysis, 6th Ed. Translated by A. I. Cohn, 1911. John Wiley & Sons, New York. 1912.
- Ibid., Qualitative Chemical Analysis. Trans. 17 Ed., 1921, by C. A. Mitchell. J. Wiley and Sons.
- Fulton, C. M., Fire Assaying, 2d Ed., 1911. McGraw-Hill Co., New York. 1911.
 Furman, H. Van F., Practical Assaying, 5th Ed., 1901. John Wiley & Sons, New York.
- Gardner, H. A., Paint Technology and Tests, 1911. McGraw-Hill Book Co., New York.
 Gardner, H. A., and Schaeffer, J. A., Analysis of Paints and Painting Materials, 1911.
 McGraw-Hill Book Co., New York.
- Griffin, Technical Methods of Analysis, 1921. McGraw-Hill.
- Gill, A. H., Gas and Fuel Analysis for Engineers, 3d Ed., 1903. J. Wiley & Sons, New York.
- Gill, A. H., A Short Hand-book of Oil Analysis, 6th Ed., 1911. J. B. Lippincott Co., 1919, Philadelphia and London.
- Gooch, F. A., Methods in Chemical Analysis, 1912. John Wiley & Sons, New York. Hempel, W., Gas Analysis. Macmillan & Co., New York.
- Hillebrand, W. F., The Analysis of Silicate and Carbonate Rocks, Bull. 422, U. S. Geological Survey, 1910. Washington Gov. Print. Office.
- Johnson, C. M., Rapid Methods for the Chemical Analysis of Special Steels, 2d Ed., 1920, 1914. John Wiley & Sons, New York.
- Julian, F. A., Text Book of Quantitative Analysis, 1902. Ramsey Publishing Co., St. Paul, Minn.
- Langbein, Electro Deposition of Metals. 1920. H. C. Baird & Co.
- Leach, A. E., Food Inspection and Analysis, 4th Ed., 1920, John Wiley & Sons, New York.
- Levy, S. I., The Rare Earths, 1915. Edward Arnold Pub.

Lewkowitsch, J., Chemical Analysis of Oils, Fats, Waxes, 1913-1916. The Macmillan Co.

Liddell, Metallurgists and Chemists' Handbook. 1918.

Low, A. H., Technical Methods of Ore Analysis, 7th Ed., 1919. John Wiley & Sons, New York.

Lunge, G., The Manufacture of Sulphuric Acid and Alkali, 4th Ed., 1913. Van Nostrand Co., New York.

Lunge, G., Technical Methods of Chemical Analysis. Trans. Edited by Chas. A. Keane. Gurney & Jackson, London. D. Van Nostrand Co., New York.

Mahin, E. G., Quantitative Analysis, 1919. McGraw-Hill Book Co.

Marks, L. S., Mechanical Engineers' Handbook, 1916, McGraw-Hill Book Co.

Mead, R. K., Portland Cement, 2d Ed., 1911. The Chemical Pub. Co., Easton, Pa. Ibid., Chemists' Pocket Manual, The Chemical Pub. Co., Easton, Pa.

Mellor, J. W., Treatise on Quantitat re Inorganic Analysis, 1913. Chas. Griffin & Co., Ltd., London.

Olsen, J. C., Quantitative Chemical Analysis, 5th Ed., 1921. D. Van Nostrand Company, New York.

Perkin, F. M., Electro Chemistry. Longmans, Green & Co., London and New York. 1905.

Prescott, A. B., and Johnson, O. C., Qualitative Chemical Analysis, 7th Ed., 1920. Revised by J. C. Olsen. D. Van Nostrand Co., New York.

Rhead, E. L., and Sexton, A. H., Assaying and Metallurgical Analysis, 2d Ed., 1911. Longmans, Green & Co., London and New York.

Rogers, A., Manual of Industrial Chemistry, 3d Ed., 1921. D. Van Nostrand Co.

Roscoe, H. E., and Schorlemmer, C., Treatise on Chemistry, 1911. Macmillan & Co. Scott, W. W., Qualitative Analysis, 4th Ed., 1921. D. Van Nostrand Co., New York. Segerblom, W., Tables of Properties. Exeter Book Pub. Co., Exeter, N. H.

Seidell, A., Solubilities of Inorganic and Organic Substances, Second Ed., 1919. D. Van Nostrand Co., New York.

Smith, E. F., Electro-analysis. P. Blakiston's Son & Co. 1918.

Stillman, T. B., Engineering Chemistry, 5th Ed., 1916. The Chemical Publishing Co., Easton, Pa.

Sutton, F. A., Systematic Handbook of Volumetric Analysis, 10th Ed., 1911. P. Blakiston's Son & Co., Philadelphia.

Talbot, H. P., An Introductory Course in Quantitative Chemical Analysis, 1899.

Macmillan & Co., New York.

Thorpe, E., A Dictionary of Applied Chemistry, Five Volumes, 1913. Longmans, Green & Co., London and New York.


Treadwell, E. P., Analytical Chemistry. Translated by W. T. Hall, 4th Ed., 1914. J. Wiley & Sons, New York.

Van Nostrand's Chemical Annual. Edited by J. C. Olsen, 4th Issue, 1918. D. Van Nostrand Company, New York.

White, C. H., Methods in Metallurgical Analysis, 1915. D. Van Nostrand Co., New York

Wiley, H. W., Principles and Practice of Agricultural Analysis, 1914. The Chemical Pub. Co., Easton, Pa.

1 30









		•		
i				
· ·				
	•			



